
Step 1: Install the ESP-IDF (v5.2.1) Extension for VS Code

1. Launch VS Code on your computer.
2. Press Ctrl+Shift+X (Cmd+Shift+X on macOS) to open the Extensions view, or click on the Extensions icon located in the left sidebar of VS Code.
3. In the Extensions search bar, type ESP-IDF.
4. Find ESP-IDF by Espressif Systems and click Install.

Step 2: Install ESP-IDF Tools

1. Press Ctrl+Shift+P (Cmd+Shift+P on macOS) to open the Command Palette.
2. Type ESP-IDF: Configure ESP-IDF extension and select it from the list. This command will guide you through the process of downloading and installing the required tools.

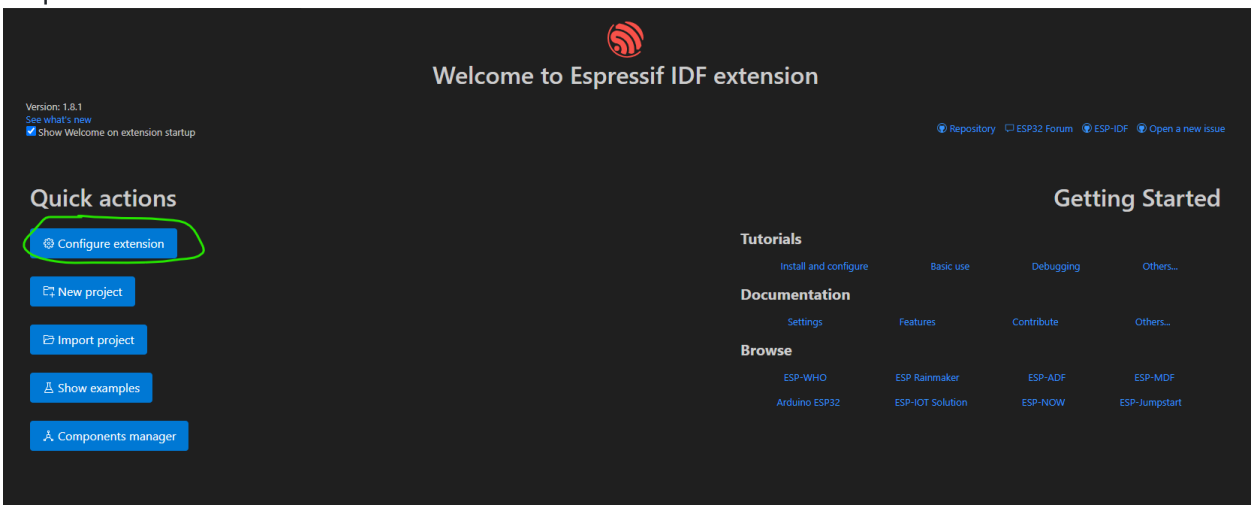

3. When prompted, select a directory where the ESP-IDF tools will be installed (e.g., C:\esp-idf or a directory of your choice).
4. The extension will ask to install Python dependencies and other necessary tools. Follow the prompts to install Python packages, Git, CMake, Ninja, and other dependencies required for ESP-IDF development
5. Once the installation is complete, you can verify that everything is set up correctly by opening a new terminal in VS Code and typing
    a. idf.py –version

Step 3: Installation Of PlatformIO IDE(v3.3.3)

1. Install PlatformIO IDE from the extension of VS Code. PlatformIO IDE will automatically install in VS Code and may prompt you to reload or restart vs-code after installation.
2. Once the installation is complete, you can open PlatformIO IDE from within Visual Studio Code.

3. Press Ctrl+Shift+P (or Cmd+Shift+P on macOS) to open the Command Palette. Type PlatformIO: Home and select it. Alternatively, you can also open the PlatformIO Home by clicking the PlatformIO icon (alien head) in the left sidebar of VS Code.
4. Once PlatformIO is installed and running, you can set up your project.
5. In PlatformIO Home, click on Open Project `SlimeVR-Tracker-ESP-main`.
6. Update the board in platformio.ini file

```
[env:seeed_xiao_esp32c3]
platform = espressif32
board = seeed_xiao_esp32c3
upload_speed = 921600
```

7. After updating Platformio, restart start to configure the new board.

Step 4: Compilation Process and Flashing

1. After successfully adding your code, open the main.cpp file in your project. Click on tick to compile, it will take some time for compilation.
2. Click on flash arrow to flash