

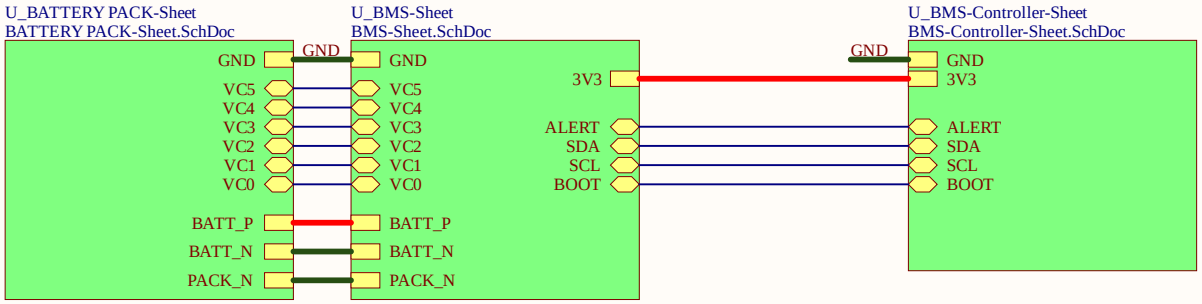


Cannot open file D:\eSpark-Consultants\eSpark-Hardware\Altium Template\espark-consulting-group-800x300.jpg. File does not exist.


Title: Top-Sheet.SchDoc	
File: BMS-v1.0.PrjPcb	
Date: 26/10/2023	Page Num: 1
Drawn By: Huzaifa Ali	Page Total: 4

BATTERY PACK

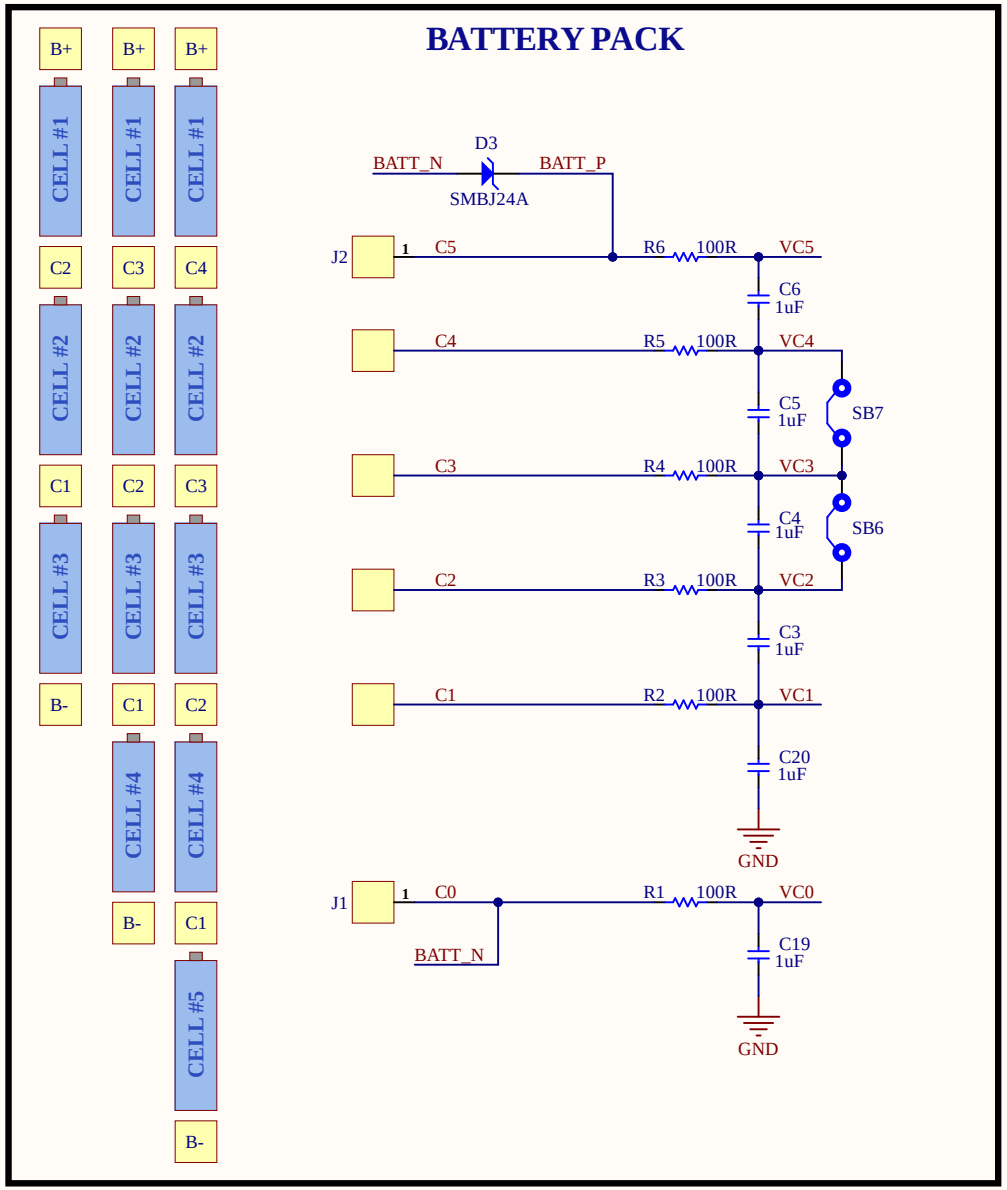

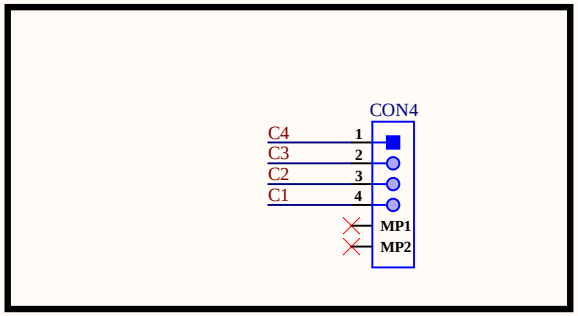


CHARGING AND DISCHARGING

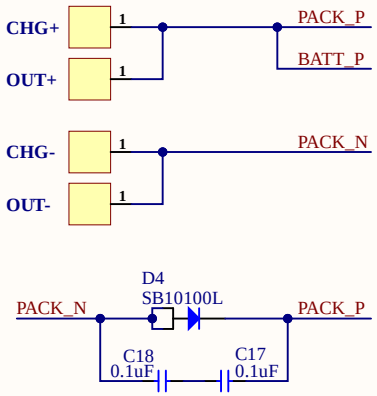


NOTE:

Cell Connections for bq76920


Cell Input	3 Cells	4 Cells	5 Cells
VC5–VC4	CELL 3	CELL 4	CELL 5
VC4–VC3	short	short	CELL 4
VC3–VC2	short	CELL 3	CELL 3
VC2–VC1	CELL 2	CELL 2	CELL 2
VC1–VC0	CELL 1	CELL 1	CELL 1

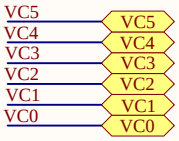

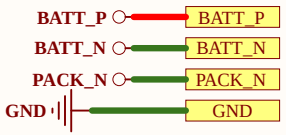


Title		
Size A	Number	Revision
Date: 11/07/2023		Sheet of
File: C:\Users\..\BATTERY PACK-Sheet.SchDoc		Drawn By:


BATTERY MANAGEMENT CIRCUIT
Analog front end IC (AFE)

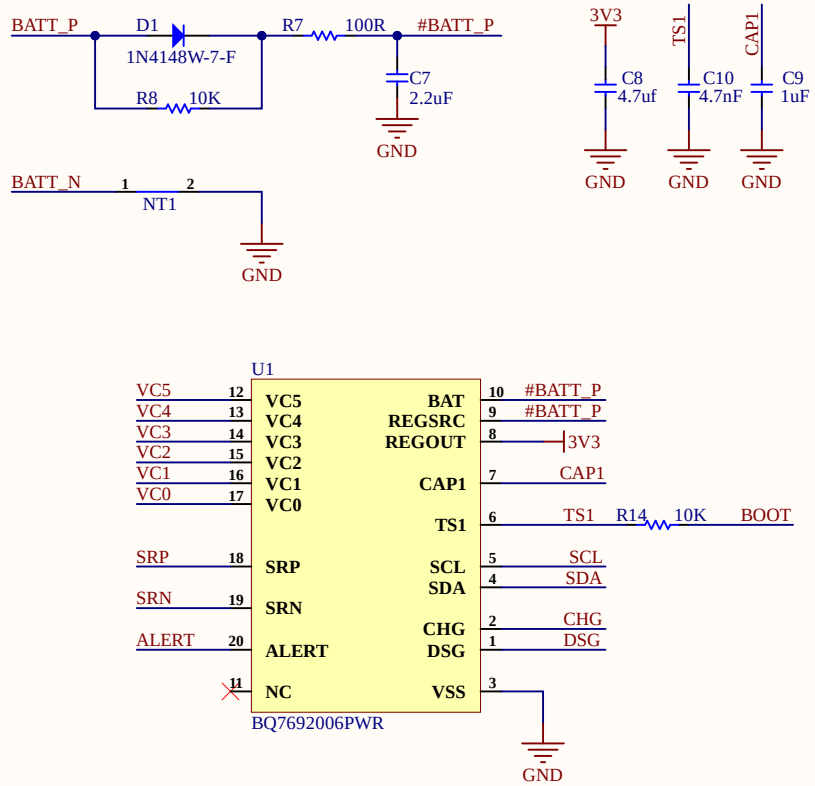


I2C PULL-UP

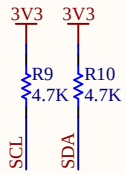

I2C ALERT

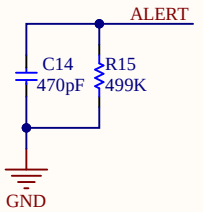


THERMISTER

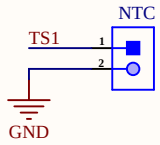


Place NTC 10K OHM
NEAR CELL


LCSC PART: C394024
C964951


CURRENT SENSE

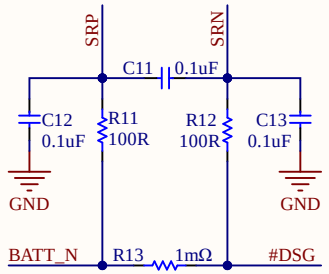


CHARGE AND DISCHARGE FET

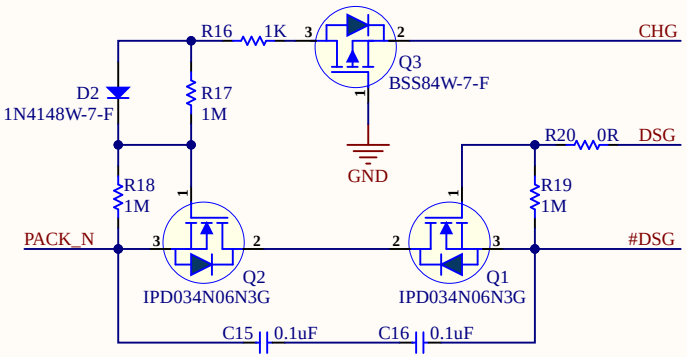



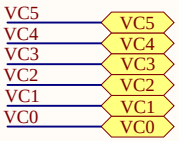


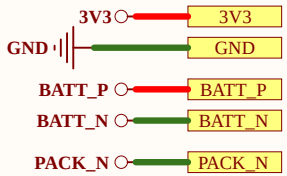


Title		
Size: A	Number	Revision
Date: 11/07/2023		Sheet of
File: C:\Users\..\BMS-Sheet.SchDoc		Drawn By:

BATTERY MANAGEMENT CONTROLLER


CONTROLLER

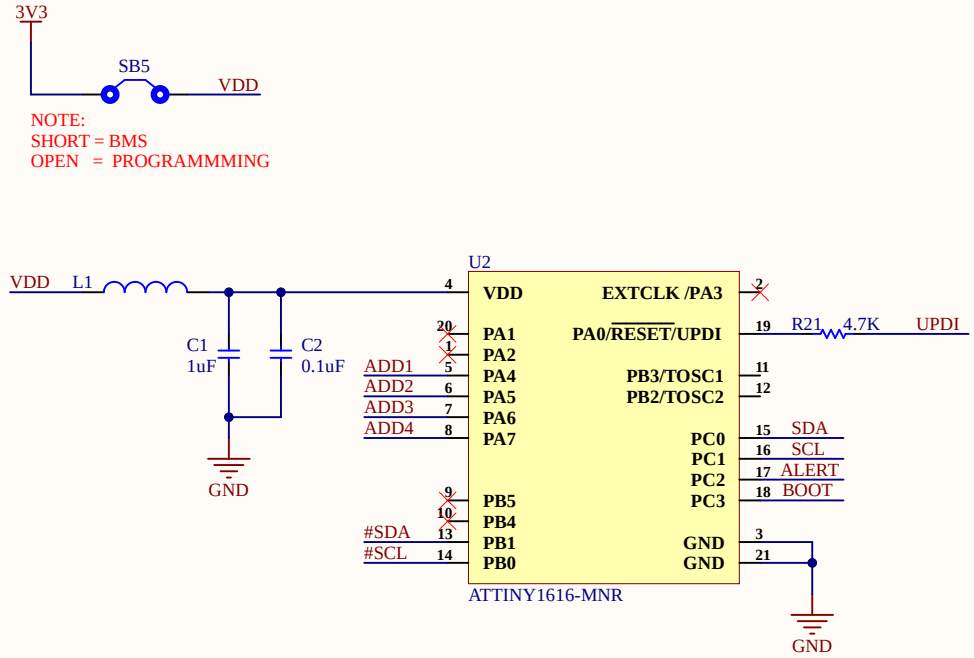


PULL-UP

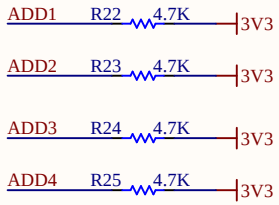

I2C PULL-UP

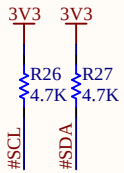


UPDI_PROGRAMMING

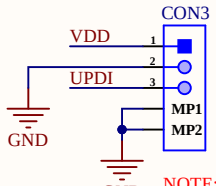


NOTE:
During Programming, SB7
Solder Bridge must be open
or removed


I2C ADDRESS SELECTION

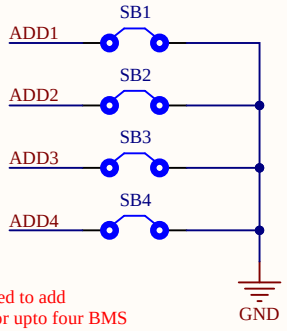


NOTE:
SB3-SB6 used to add
Addresses for upto four BMS


HOST I2C

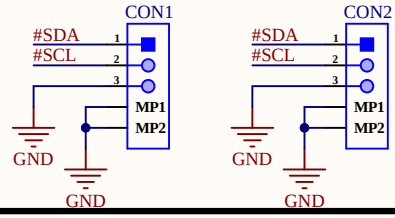





Title		
Size: A	Number	Revision
Date: 11/07/2023	Sheet of	
File: C:\Users\..\BMS-Controller-Sheet.SchDoc	Drawn By:	

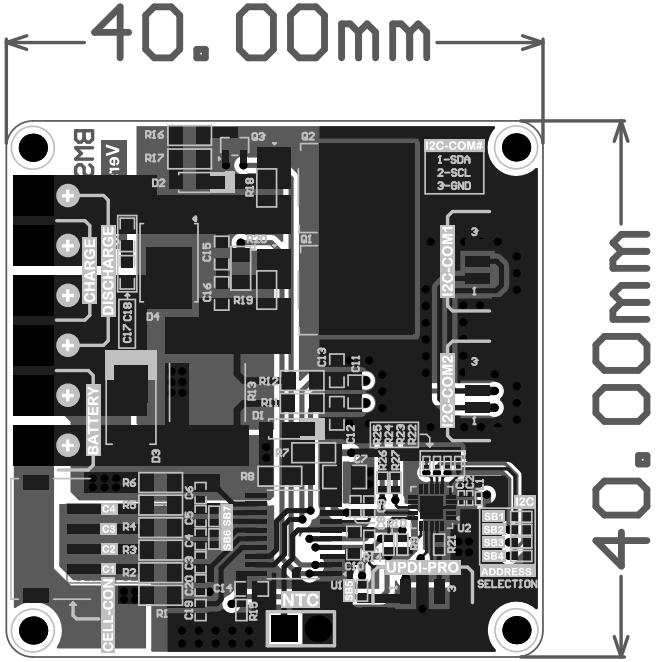

Layer	Name	Material	Thickness	Constant	Board Layer Stack
	Top Overlay				
	Top Solder	Solder Resist	0.076mm	3.5	
1	Top Layer		0.229mm		
	Dielectric 1	FR-4	0.406mm	4.8	
2	Bottom Layer		0.229mm		
	Bottom Solder	Solder Resist	0.076mm	3.5	
	Bottom Overlay				

Total board thickness: 1.016mm