



HAPTIC BRACELET / MAIN PCBA

250 kbaud logical ring: ESP TX -> pod 0 -> ... -> pod 7 -> RETURN -> ESP RX.
Physical five-wire chain; RETURN runs back through the same links. No electrical connection across clasp.

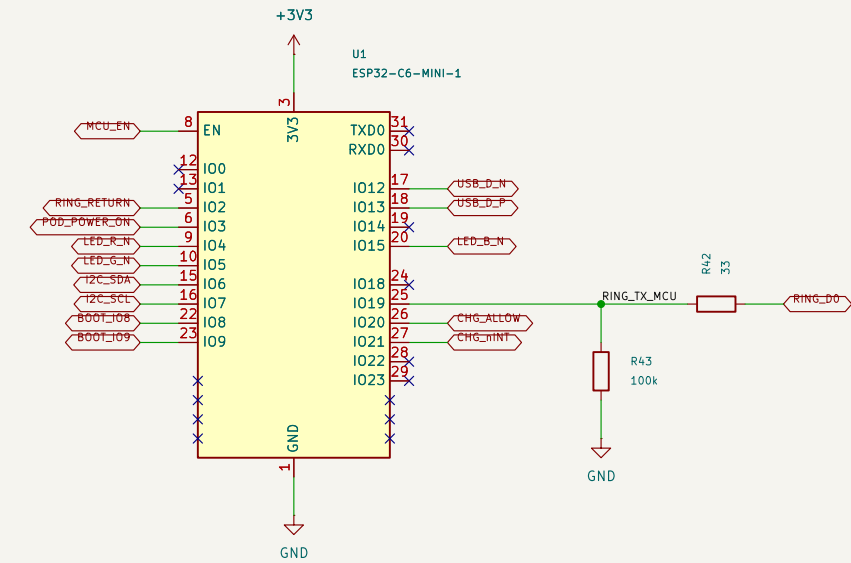


GPI019 ring TX / GPI02 ring RX
GPI018 spare (no connect)
GPI03 high powers pods
GPI06/7: charger I2C only
GPI00/1/14/22/23 spare (USB controls removed)
UART0 pads removed; native USB handles programming/debug

Pod recovery: cycle +3V3_POD through U26.
No shared reset wire; local ICE reset only.

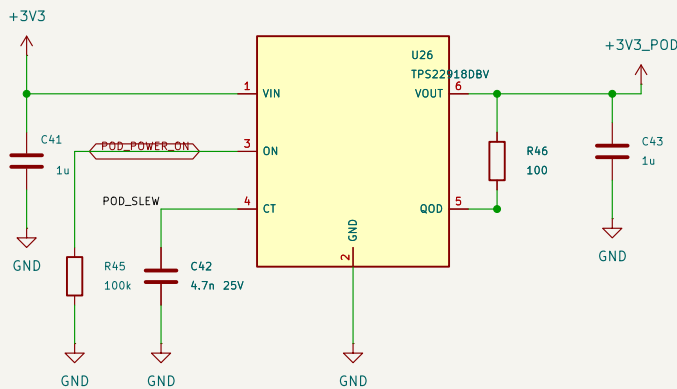


POD SUPPLY: default OFF; ESP, USB and charger stay powered.
CT controls ramp; Q0D discharges the ring after shutdown.
Do not enable UART idle-high until POD_3V3 has settled.
Disable charging before removing required pod temperature sensing.

Local haptic pod and harness




File: local-pod.kicad_sch

Charger and regulated supply



File: power.kicad_sch

USB-C data and power



File: usb.kicad_sch

ESP reset, boot and decoupling



File: controller-support.kicad_sch

One wrist / ring pod schematic draft

Sheet: /
File: main.kicad_sch

Title: Controller and switched pod power

Size: A3	Date: 2026-09-12	Rev: 0.5
KiCad E.D.A. 10.0.1	Id: 1/5	

