
LienCAM Setup Sheet


Program: "01_Fixture_plate_-_M6_x_1.ngc"
Units: mm

Setup: "Setup 1" (G54)
  Work offset origin: X-62.5 Y-45 Z0 mm
  Stock: "Stock 1" size 125 x 90 x 8 mm
  Origin offset from stock min corner: X0 Y0 Z8 mm
  Workholding:
    Method: Tape and glue
    Note: "Apply masking tape to the spoilboard and the underside of the whole plate blank. Apply su
    perglue between the taped faces, glue the blank down, and press one minute. Keep the plate and o
    ffcuts bonded through all operations; pry off with a putty knife after the program ends."


1. "Face 1"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -0.5 to 15 mm
   NC lines: 4-59

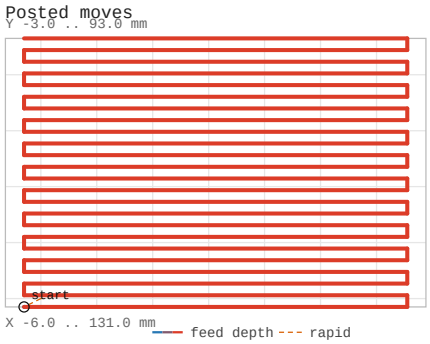


2. "Drill 2"
   Tool: T3 "5 mm drill - M6 pilot" dia 5mm flute length 20mm
   Spindle: 10000 RPM
   Feed: cutting 180mm/min, plunge 150mm/min
   Z range: -10.002 to 15 mm
   NC lines: 60-83

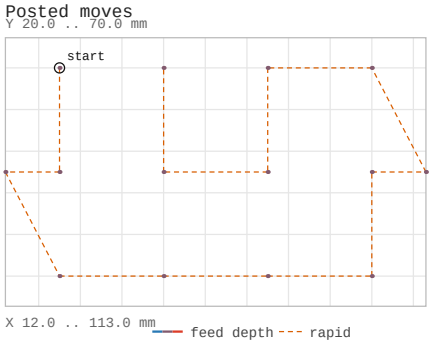


3. "Thread Mill 3"
   Tool: T4 "3 mm single-point thread mill - 8 mm neck" dia 3m
   m flute length 6mm
   Spindle: 10000 RPM
   Feed: cutting 300mm/min, plunge 150mm/min
   Z range: -8 to 15 mm
   NC lines: 84-4976

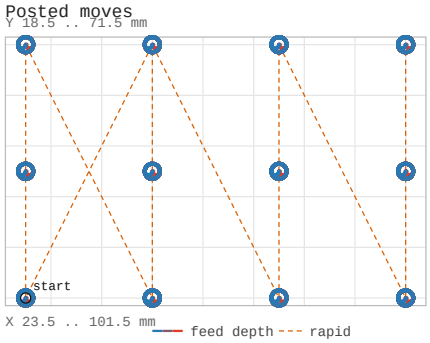

4. "Contour 4"
   Tool: T2 "6 mm flat end mill" dia 6mm flute length 18mm
   Spindle: 10000 RPM
   Feed: cutting 800mm/min, plunge 150mm/min
   Z range: -8.2 to 15 mm
   NC lines: 4977-5471

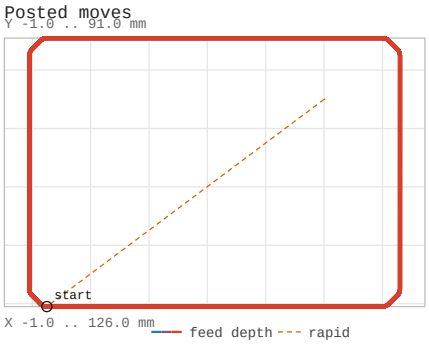

5. "Chamfer 5"
   Tool: T6 "6 mm 90 deg chamfer mill" dia 6mm flute length 12 mm
   Spindle: 10000 RPM
   Feed: cutting 400mm/min, plunge 150mm/min
   Z range: -0.8 to 15 mm
   NC lines: 5472-8505

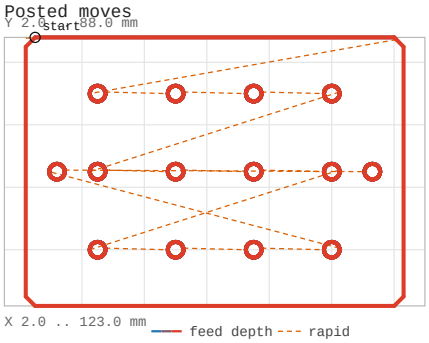

File: "01_Fixture_plate_-_M6_x_1.ngc"
Bytes: 195002
SHA-256: 7449ca3476ba642681c08e094d1d699b35a7216df68923a52400f918bc145efa