
LienCAM Setup Sheet


Program: "08_Gear_pair.nc"
Units: mm

Setup: "Setup 1" (G54)
  Work offset origin: X0 Y0 Z6 mm
  Stock: "Stock 1" size 200 x 120 x 6 mm
  Origin offset from stock min corner: X0 Y0 Z6 mm
  Workholding:
    Method: Tape and glue
    Note: "Apply masking tape to the spoilboard and underside of the full 200 x 120 x 6 mm sheet. Bo
    nd the taped faces with superglue and let it cure. Run both setups on this same sheet without mo
    ving it. Both outlines cut 0.5 mm below the stock bottom, through the tape and slightly into the
     sacrificial spoilboard, to ensure breakthrough. Both gears stay glued in place. Pry off both ge
    ars and deburr. Tabs are off to keep nubs off the tooth flanks."


1. "Bore 1"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6 to 15 mm
   NC lines: 3-307

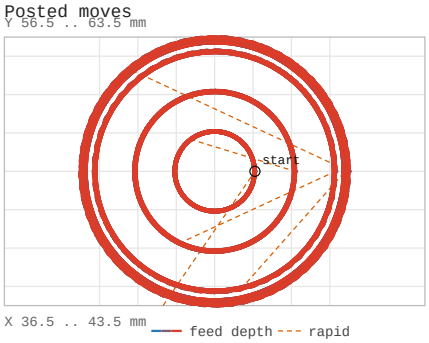

2. "Pocket 2"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6 to 15 mm
   NC lines: 308-2488

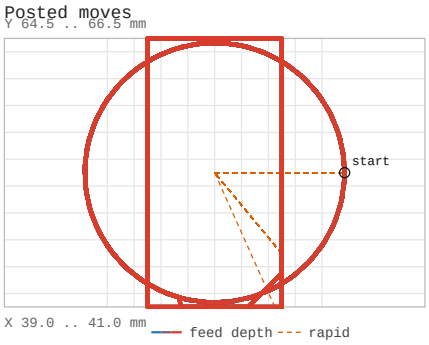


3. "Contour 3"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6.5 to 15 mm
   NC lines: 2489-4774

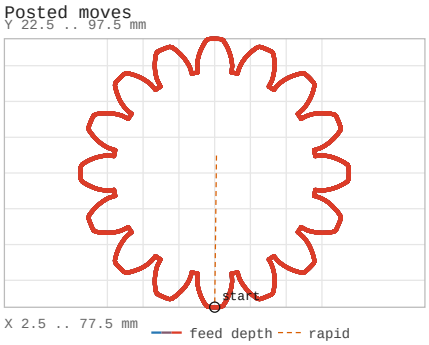


Setup: "Setup 2" (G54)
  Work offset origin: X0 Y0 Z6 mm
  Stock: "Stock 1" size 200 x 120 x 6 mm
  Origin offset from stock min corner: X0 Y0 Z6 mm
  Workholding:
    Method: Tape and glue
    Note: "Apply masking tape to the spoilboard and underside of the full 200 x 120 x 6 mm sheet. Bo
    nd the taped faces with superglue and let it cure. Run both setups on this same sheet without mo
    ving it. Both outlines cut 0.5 mm below the stock bottom, through the tape and slightly into the
     sacrificial spoilboard, to ensure breakthrough. Both gears stay glued in place. Pry off both ge
    ars and deburr. Tabs are off to keep nubs off the tooth flanks."


4. "Bore 1"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6 to 15 mm
   NC lines: 4778-5079

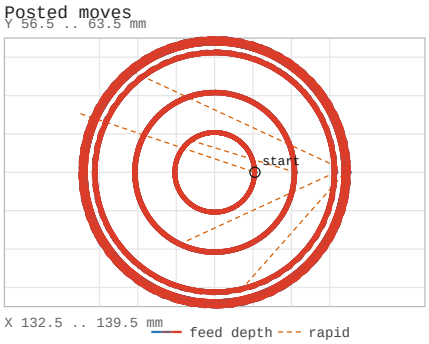

5. "Pocket 2"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6 to 15 mm
   NC lines: 5080-7260

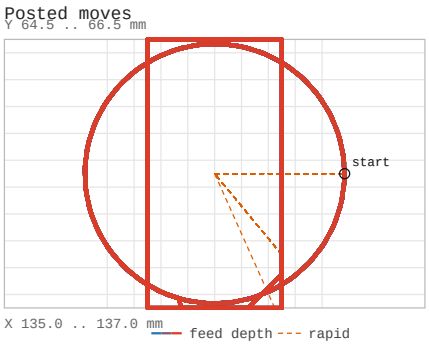

6. "Contour 3"
   Tool: T1 "3 mm flat end mill" dia 3mm flute length 12mm
   Spindle: 10000 RPM
   Feed: cutting 450mm/min, plunge 150mm/min
   Z range: -6.5 to 15 mm
   NC lines: 7261-10363

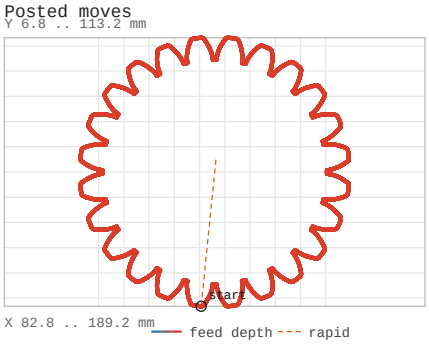

File: "08_Gear_pair.nc"
Bytes: 261230
SHA-256: b2cbe463b6dd73552387a810d431b71d855056fe1ddcc9b5f3502893eb4fcb94