

DATA SHEET CT 100



For more information, please visit: www.dewesoft.com



Product Overview

Zero-flux current transducers are not simple transformers, they have sophisticated constructions and integrated electronics. They have two windings which are operated in saturation to measure the DC current, a primary winding for the AC current and a secondary winding for compensation. This kind of current measurement is very precise because of the zero-flux compensation.

This is a very important point because when the magnetic core of the transformer stays magnetized with the residual magnetic flux, it destroys the accuracy of the measurement. In these transducers, the parasitic magnetic flux is perfectly compensated. Therefore, zero-flux current transducers are used for measuring currents with high precision, but they are not suitable for simple and fast measurements such as iron-core clamps or Rogowski coils. Zero-flux transducers are used to measure currents with the highest accuracy for both AC and DC and have high bandwidth capabilities (up to 2 MHz). They are very linear and have low phase and offset errors.

These types of transducers measure current flows with galvanic isolation. They reduce the high currents to a much lower value. The conductor with the measured current must be guided through the loop of the sensor (meaning the circuit must be broken to install the transducer) because current transducers function on the principle of a transformer, where a high current is transformed to a low current which can then be measured with the DAQ.





Working principle:

In the transducer a magnetic flux is produced by the flow of the primary current, this current is counteracted by the secondary current that produces a secondary magnetic flux that counteracts the primary magnetic flux from a secondary winding. The secondary current flows over a burden resistor which induces a voltage over the terminals. This voltage is then measured as it is proportional to the current that is flowing in the conductor.



Dimensions

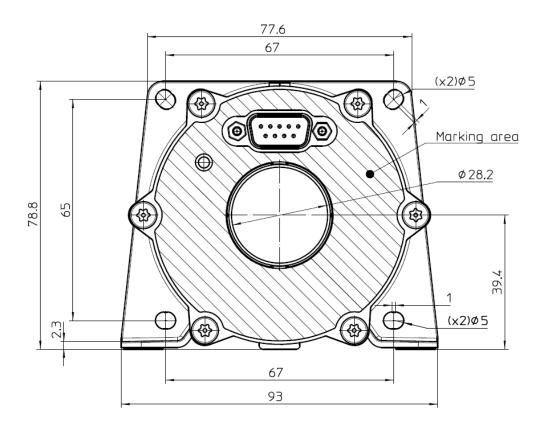

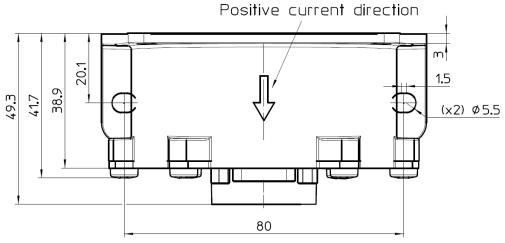

All dimensions are in [mm]




Specifications

CT 100				
Туре	Zero-Flux	Angular Accuracy	0.015 °/kHz	
Primary Current Range DC RMS Sinus	100 A	Rated isolation voltage RMS, single isolation CAT III, pollution deg. 2, IEC 61010-1 standards, EN 50178 standards	1000 V	
Conversion ratio	1:500	Test voltage 50 / 60 Hz, 1 min	4.95 kV	
Overload Ability Short Time (100 ms)	20 kApk	Inner diameter	28 mm	
Max. burden resistor (100 % of lp)	25 Ω	Dimensions	93 x 78.8 x 49.5	
di/dt (accurately followed)	100 A/µs	Supply voltage (±5 %)	±15 V	
Temperature influence	0.2 ppm/K	Operating humidity	20 % to 80 % (not condensing)	
Nominal secondary current	200 mA at 100 A	Operating temperature	- 40 °C to + 85 °C	
Bandwidth (0.5 % of Ip)	DC 2 MHz	DEWESoft® Shunt	5Ω	
Linearity	< 0.002 %	Frequency Influence	Yes	
Offset	< 0.0015 %	Compatible amplifiers	SIRIUS LV / HS-LV / XHS-LV SIRIUS STG / HS-STG SIRIUS STGM DEWE 43	
Frequency Influence	0.01 %/kHz	Cable length	5 m - MCTS to Transducer 0.3 m - Amplifier to MCTS	




Typical Amplitude and Phase Characteristics

Amplitude characteristic

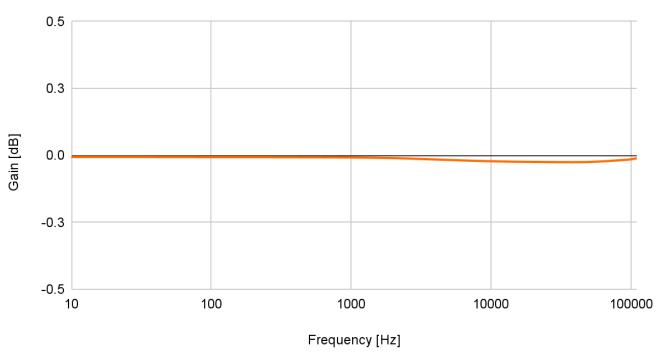

Phase Characteristic

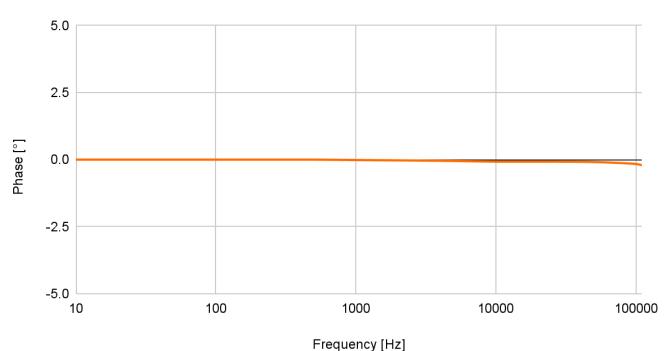

Document version history

Revision Number: 1

Last modified: 23 August 2022

Version	Date [yyyy.mm]		Notes
V22-1	2022-08	Initial document creation	