

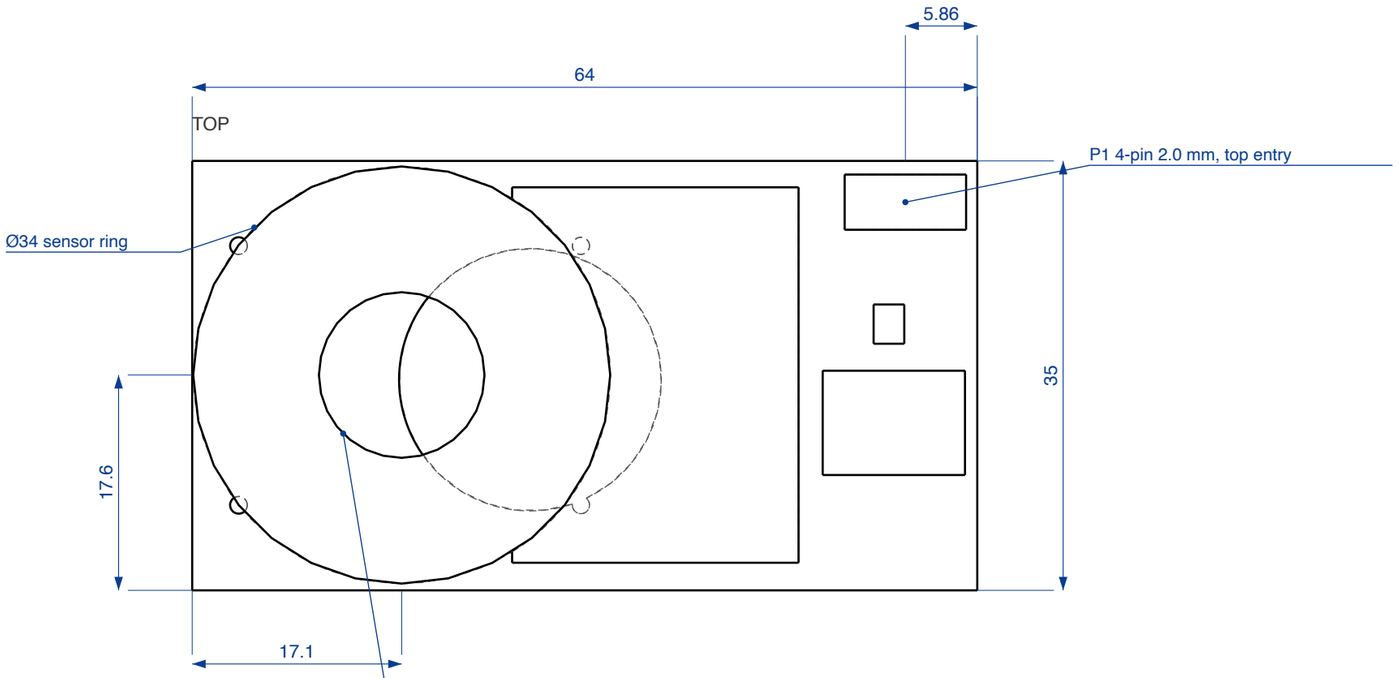


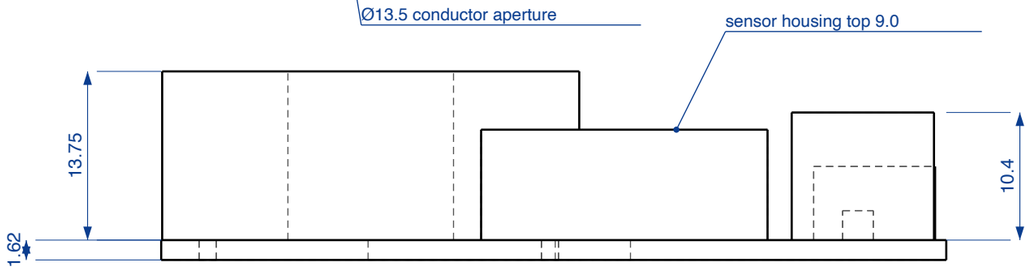


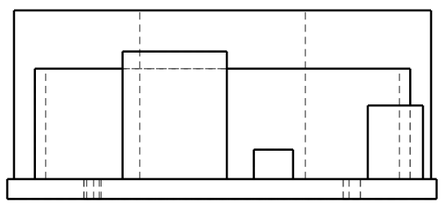

FRONT

RIGHT

ISOMETRIC (not to scale)

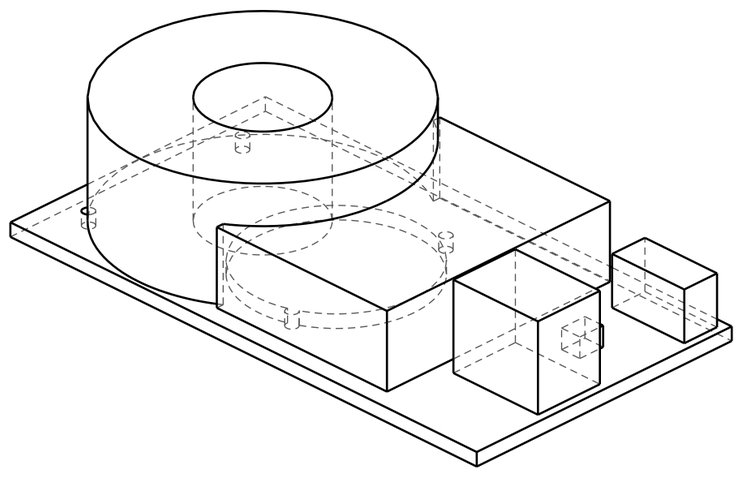

NOTES

1. All live conductors (L and N, insulated) pass through the Ø13.5 sensor aperture; keep the passage free (STEP).
2. No mounting holes: hold the board by its edges (card guide or clip). Keep 3.5 mm free below (through-hole pins).
3. P1: +12 V, GND, test input and alarm output; leave 20 mm above P1 for the mating plug and wires.
4. Board has a Ø21.4 cut-out under the sensor ring. Highest part: sensor ring 13.75 above the board.
5. Outline, holes and positions from the board's CAD model; part shapes are envelopes (±0.5 mm).

EdgeTech DC leakage detector board		
PART NUMBER EVSE-X-DCD	REVISION A	DATE 2026-10-11
UNITS mm	SCALE (A3) 2:1	PROJECTION third angle

For fit and installation only, not for manufacture.

≈ = estimated dimension (see notes). File: evse-x-dcd.step