Ventilation Fault Detection, Diagnosis and Graceful Degradation

D7065E, Architecture Document

Project Group 5 (solo): Wassim Akachi

v1.1, submission, 2026-10-11

Report: 42 pages (Sections 1–13, pp. 4–45). Appendices A–K: 38 pages, reference only.

On the state of the evidence. The architecture, the physics, the detector, the supervisor and the dashboard are built and running, and the unit suite is green at **621 tests, 0 failures, 0 errors**, with eleven integration tests skipped by design when nothing is up for them to assert against (Section 10.2). The *offline evaluation harness* (`project/evaluation/`) is written and has run, so R-1 to R-7 all carry the experimental evidence their acceptance criteria name (Section 11.2). **R-3 is not met; R-1, R-2 and R-7 are met on the arm their criteria name and fail on the harder arm beside it; R-4, R-5 and R-6 are met.** R-4 carries both the in-JVM kill experiment and the container-level chaos run, and R-5's case rebuild has been demonstrated against a live stack *and* is now covered by integration tests that execute its real SQL. T-15's confusion matrix has been measured, and it is the least flattering result here: **one of the four injectable mechanisms is classified correctly**. The blocked-filter signature is unreachable under this plant's physics, and the sensor-drift branch is unreachable from *either* sensor mechanism, which is a property of the classifier rather than of the fault model and was established by adding the mechanism that was supposed to fix it (Section 7.3). T-29's optional learned contender has been measured and **dropped**: at the monitor's detection rate it costs about twenty times the false alarms and seven times the delay, and its misses are exactly the monitor's. T-35's reordering of the diagnosis has been measured and **not adopted**, for a reason worth more than the change: the third diagnostic signal is blind after a confirmation rather than merely late (Section 13.6). **No measurement in this report is now outstanding**, which is not the same as every requirement passing, and Section 11.6 keeps the bound on what each result actually is. Every remaining gap is marked **[PENDING:** *what is missing*] in place, and Section 11.6 lists all of them in one table. No number in the prose or tables is an estimate: each comes from a file in the repository, a command I ran, or parameters that are. Figures can lag their sources, and have.

How to read this report, and in what order. The body is Sections 1–13. Everything whose job is to be *available* rather than read is in a lettered appendix, cross-referenced from the exact place in the body where a reader would otherwise go looking. **No appendix is load-bearing**: every verdict, every decision and every limitation is stated in the body, and the appendices carry only the working behind them.

The nineteen-page path. The whole argument is in five places (nineteen pages of the forty-two), and a reader short of time can stop after them:

- **§1**, pp. 4–6: the use case in one sentence, the two nested loops, and *where the seven requirements landed* before any detail.
- **§3**, pp. 7–9: the requirements table: each requirement's type, priority, measurable acceptance criterion, verdict, and **the regime that verdict holds in**. Four of the seven carry a failing clause and it is in the table, not buried.
- **§4.5–4.6**, pp. 13–18: every significant decision against the alternative it beat and the price paid, then how the architecture grows: the two scaling ceilings, the shard boundary, and the one boundary that is *not* a seam.
- **§11.2 and §11.7**, pp. 35 and 38: the measured R-1 to R-7 results, and what the compensation costs in energy to buy what it buys.
- **§13**, pp. 41–45: the honest critique: what fails, the mechanism behind each failure, and what I would do differently.

Where the rest lives.

- **Appendix A** reprints §3's seven rows with their full evidence column. **Appendix F** carries the working behind every verdict in §11.2, and **Appendix G** the register of every measurement with the bound on what it actually is.
- **Appendix I** carries the mechanism behind each finding in §13, and **Appendix J** the risk register.
- **The remaining appendices** hold supporting depth: **B** the component, code-level and sequence views, **C** the six rooms, the invented parameters and the REST contract, **D** the diagnosis and its confusion matrix, **E** the compensation algebra and its second lever, **H** the dashboard evidence frames, **K** the test plan, the suite and the harness.

One rule for reading the verdicts. None of them is global. Where a requirement is met on one occupancy regime and fails on another, both arms are stated wherever the verdict appears, and quoting either alone misrepresents the result.

Contents

1 Summary **4**
1.1 Changes since the proposal 5

2 Use case and building context (BuildSim) **6**

3 Requirements **7**
3.1 The tension these requirements set up 8
3.2 Gaps with no requirement ID 9

4 Architecture **9**
4.1 Context diagram (C4 Level 1) 9
4.2 Container diagram (C4 Level 2) 10
4.3 Authority separation: who may act 12
4.4 Component diagram (C4 Level 3) and the code structure 12
4.5 Design decisions and alternatives 13
4.6 How this architecture grows 16

5 Interfaces and data contracts **18**
5.1 MQTT topics and payloads 18
5.2 REST, against BuildSim 19
5.3 Journal (TimescaleDB) 20

6 Simulating the sensor values (the physical model) **20**
6.1 The six rooms 20
6.2 The shared air handler, the flow split and the fan laws 20
6.3 The air: a well-mixed CO_2 balance per room 21
6.4 The people 21
6.5 The faults 22

7 Autonomous services and data pipeline **22**
7.1 The inner loop, and why it is deliberately plain 22
7.2 The observer: judging what the command owed 23
7.3 Residual, CUSUM, state machine, classifier 24
7.4 Compensation: the trim is the gain 26
7.5 The data pipeline 28

8 Behaviour **28**
8.1 Key scenario (C4 dynamic diagram) 28
8.2 The same scenario in time (sequence diagram) 30
8.3 Process lifecycle (state machine) 30

9 Deployment and component placement **31**

10 Test plan **33**
10.1 How the system is verified 33
10.2 The state of the suite, stated plainly 34

11 Evaluation and results **34**
11.1 Measured: the week-37 separation spike 34
11.2 Measured: the evaluation harness, R-1 to R-7 35
11.3 Proved: compensation holds the healthy rooms exactly 37
11.4 Proved: architectural properties 37
11.5 Not measured: what the numbers above do not say 38

11.6 Every pending measurement, in one place . . . 38
11.7 Measured: what the compensation costs in energy . . . 38

12 Dashboard 39
12.1 Two defects the capture found, and one limit it exposed . . . 40

13 Risks and critical reflection 41
13.1 Four functional holes, two of which are now closed . . . 41
13.2 The detector is evaluated against its own generator . . . 42
13.3 Every physical parameter is invented . . . 42
13.4 The CUSUM margin is thin, R-3 does fail, and the margin was the symptom rather than the cause . . . 42
13.5 R-7 fails at design occupancy, and the failure is R-3's arriving somewhere else . . . 43
13.6 The third diagnostic signal is blind after a confirmation, and reordering the pipeline does not help . . . 44
13.7 The occupancy dependency is mitigated, not solved . . . 44
13.8 Latching is the right trade here, and it is a trade . . . 44
13.9 Scope, and the debts taken knowingly . . . 45
13.10 What I would do differently . . . 45
13.11 Risk register . . . 45

A Requirement verdicts and their evidence, in full 47
A.1 R-1 — confirm a damper that has stopped responding . . . 47
A.2 R-2 — hold the faulted zone below 1000 ppm by compensation . . . 47
A.3 R-3 — no more than one false alarm per simulated week . . . 47
A.4 R-4 — report unavailable on stale readings, and diagnose nothing . . . 47
A.5 R-5 — make every diagnosis reconstructable . . . 48
A.6 R-6 — identify the zone count at which the monitor misses its interval . . . 48
A.7 R-7 — keep every other room unchanged while one is latched . . . 48

B The component view, the code-level views, the sequence view, and the documentation approach 50
B.1 Component diagram (C4 Level 3): inside `fault-monitor` . . . 50
B.2 Code diagrams (C4 Level 4), and why only two . . . 51
B.3 The key scenario in time (sequence diagram) . . . 54
B.4 The documentation approach: C4 for the views, arc42 for the frame . . . 55

C The six rooms, and the physical model's invented parameters 55
C.1 The six rooms . . . 55
C.2 Every invented parameter, and what it decides . . . 55
C.3 The REST contract against BuildSim . . . 56

D Diagnosis in detail: the plausibility ceiling, the confusion matrix, and the reordering experiment 57
D.1 The monitor's eighteen named defaults, and what the plausibility ceiling costs . . . 57
D.2 What the classifier actually emits, measured (T-15) . . . 57
D.3 Why the sensor-drift branch is the classifier's and not the generator's . . . 59

E The compensation algebra, and the second lever 60
E.1 The closed form §7.4 states . . . 60
E.2 Spending fan speed when there is no trim to make . . . 61

F Evaluation evidence in full, R-1 to R-7 61
F.1 The spike's two caveats . . . 61
F.2 What the observer's occupancy dependency costs, stratified . . . 61

F.3 R-1 to R-7, the measurements behind the verdicts 62

G Every measurement and its bound, in one place **69**

H Dashboard evidence, and the defects the capture found **71**
H.1 The remaining captured frames 72
H.2 Two defects the capture found, and one limit it exposed 74

I Risks and critical reflection, in full **74**
I.1 Four functional holes, two of which are now closed (§13.1 in full) 74
I.2 The air handler's rating was corrected on measurement (§13.3 in full) 76
I.3 The CUSUM margin, and why h was never the knob (§13.4 in full) 76
I.4 R-7 at design occupancy, and the two bounds on that finding (§13.5 in full) 76
I.5 The third diagnostic signal is blind after a confirmation (§13.6 in full) 77
I.6 Scope, and the debts taken knowingly (§13.9 in full) 78

J Risk register **79**

K The test plan, the test suite and the evaluation harness, in full **81**
K.1 The test plan, with each test's expected result and its evidence 81
K.2 The state of the suite and the harness, stated plainly 84

1. Summary

This system runs demand-controlled ventilation over six rooms of an office floor and, on top of it, a second loop that decides whether that ventilation is still *working*. The guiding principle is one sentence and it is the thread through every decision that follows: **a stuck damper and a full room look identical to a CO_2 controller, and what tells them apart is a model of what the last command should have achieved.** A controller that sees only concentration cannot distinguish a room that will not ventilate from a room with more people in it; both read high. Predicting the response each command owes, and watching the gap between that prediction and the measurement, turns the fault from an invisible condition into an observable one, which makes the autonomous part an inference problem rather than a threshold, and makes fault injection and degraded operation the use case itself rather than an experiment bolted on at the end.

The system is therefore **two nested loops**, and the outer one is the contribution.

Loop	Period	Closes because
Inner, control (`dcv-controller`)	≈ 1 s	A damper command changes airflow, which changes CO_2, which the controller reads next
Outer, supervision (`fault-monitor` + `supervisor`)	≈ 60 s	A confirmed fault changes the control strategy, which changes the commands, which changes the residual the monitor reads next

The inner loop is deliberately a plain rule: CO_2 in, damper position out, with hysteresis and a freshness check. That is not an omission but the point. Demand-controlled ventilation is a solved problem, and making the inner rule cleverer would have bought nothing the course grades; the interesting and unsolved question is what happens when the actuator the clever rule depends on has quietly stopped working. Keeping the inner loop simple also keeps it *verifiable*, which matters because the outer loop judges it: an observer that has to model a sophisticated controller inherits that controller's complexity as model error.

Field	Value
Project title	Ventilation Fault Detection, Diagnosis and Graceful Degradation
Team members	Wassim Akachi (project group 5, solo)

Field	Value
Use case	Demand-controlled ventilation that detects, diagnoses and survives faults in its own equipment
Repository	https://github.com/eduni-pro/202608-d7065e, subfolder `project/`
Version / date	v1.1, submission, 2026-10-11

This is a solo project, so no contribution statement is included: the course requires one only where a pair submits a single system, and every decision, measurement and line of code recorded here is my own.

Where it landed, before the detail. Two of the seven requirements are met outright. Three more pass on the arm their acceptance criterion names and fail on the harder arm beside it, and they are reported as *two* numbers rather than one, because a single verdict would have to pick which regime to be silent about. **R-3 is the one that fails everywhere (0.55 confirmed false alarms per fault-free simulated week against a budget of one, and a worst week of 6, which is the criterion it is scored on) and R-1's, R-2's and R-7's harder arms all have that same false-alarm rate somewhere in their causes.** One defect, surfacing four times, is a more useful thing to know about this system than four defects would be, and §11 reports it that way rather than softening it. The regime that separates the arms is not the same in each case and is named with each result: for R-2 and R-7 it is *occupancy* (the drawn weekday passes, design occupancy does not), while for R-1 it is the *protocol*, which detects 20 of 20 at a p95 of 6 min when the damper is stepped deliberately and 15 of 20 at 257 min when the fault must be found in the closed loop that is also compensating for it.

1.1 Changes since the proposal

Three things changed, and each was forced by a decision I had to make rather than by a change of mind. The accepted proposal (2026-09-18) carried one examiner condition, *"make sure to include several rooms"*, and answering it honestly is what drove all three.

1. The coupling topology: six independent rooms became one shared air handler with a damper per room. "Several rooms" can be satisfied by replication, six copies of the single-room spike with nothing one room can do to another, and the implementation plan's risk register names exactly that as the failure to avoid. ADR-0008 therefore weighed three couplings and chose **option B**: one air-handling unit `AHU-A120`, one damper per room, and a proportional flow split, sized 43 % above the sum of the six rooms' design flows, but only 0.4 % above it at the normal fan speed of 0.7, so that *the only way one room gets more air is if another damper closes* and the headroom is a compensation budget rather than normal slack. Rejected: option A (independent rooms, a fan each), which makes R-7 hold by construction and its experiment measure nothing; and option C (option B plus inter-room air exchange), which is the proposal's literal wording but whose exchange coefficient, the one parameter nothing can measure, would be what decides whether R-2 passes.

2. "Over-ventilate the neighbour" became "over-drive the shared handler and trim the neighbours' dampers". The proposal said the supervisor would compensate by over-ventilating the faulted room's neighbour, which presumes air moves between rooms. Under option B it does not: rooms are coupled through the *duct*, not through the wall. The mechanism that replaces it is better, not merely different, and Section 7.4 derives it: one common trim on the healthy dampers plus one raise of the shared fan speed holds every healthy room's airflow exactly where it was while multiplying the faulted room's flow by the reciprocal of the trim. The cost is a stated bound (a damper stuck fully shut has no air path and cannot be reached at all), and that bound is reported with R-2 rather than hidden.

3. Fan power moved from a per-room signal to a plant signal, and that is what makes discrimination possible at all. In the proposal's sketch each room had its own fan, so fan power was a local quantity and a blocked filter was a local anomaly. With one shared unit, fan power belongs

to the plant. That single relocation is what gives the monitor a *cross-room* signal: a blocked filter starves all six rooms at once and raises power per unit of flow, while a stuck damper moves one room's residual and leaves plant power flat. Without it, separating those two faults would have needed a fourth invented signal, which the risk register explicitly forbade.

One thing did *not* change and deserves saying so: the detection method. The proposal proposed a predicted step response, a residual and a CUSUM (one-sided then, two-sided now that §7.3's guarded lower arm has been added), and the week-37 spike (Section 11.1) found the separation so large that the design question moved from "can this be detected" to "how few false alarms can it be detected with".

2. Use case and building context (BuildSim)

The building. The system controls six rooms on level 0 of the A-building, modelled in **BuildSim**. BuildSim is the *shared state* of the cyber-physical system: it owns the building model (levels, rooms, equipment), exposes a REST API to register devices and to read and write their state, and streams live state to a 3D web viewer. BuildSim is not modified; it is instrumented. That seam is the boundary between the physical half of a cyber-physical system (the building, behind BuildSim's API) and the cyber half (my processes), and keeping it clean is what would let the same software later drive a real air handler.

BuildSim provides the rooms and no physics, so the air, the people and the plant are all simulated here (Section 6). How the processes use BuildSim is fixed and narrow:

- `physics-simulator` is the *only* process that touches the environment. It reads the current damper and fan-speed actuator state from BuildSim, advances the CO_2 balance and the air handler, and writes the resulting sensor values back. This is what closes the loop.
- `co2-sensor` reads the six room CO_2 values and the one air handler's fan power from BuildSim and publishes them to the broker. It emulates devices that observe and report; it does not generate values.
- `damper-actuator` applies validated commands to BuildSim: the six dampers and the one fan speed. BuildSim remains the single source of truth for actuator state.
- `dashboard` repaints BuildSim's own floorplan as room layers, and `supervisor` writes work orders as BuildSim alerts. Those two are the only writers of operator-facing state.

Actors. The **facilities technician** receives the work order and repairs the damper, which is the only external event that can clear a latched diagnosis. **Room occupants** are the CO_2 source and the people whose comfort R-2 protects; they influence the system only by being present. Neither actor is on the control path: both loops run autonomously.

The scenario the demo tells. At 09:00 the meeting room A115 is booked and ten people arrive. CO_2 climbs past 800 ppm, the controller opens the damper, and at 1020 ppm it commands the damper fully open. The damper is frozen at 0.15, so the airflow never changes and CO_2 keeps rising. The monitor saw the same command, predicted the fall that opening from 0.15 to 1.00 owed, and instead watches the gap grow until the accumulated residual is too large and too persistent to be sensor noise. Plant fan power flat argues against a blocked filter; a correct overnight decay to outdoor level argues against a drifting sensor; the monitor publishes a confirmed `STUCK_DAMPER`. The supervisor degrades A115 so the inner loop stops commanding it, trims the five healthy dampers and raises the shared fan so the five keep the airflow they had, and raises a work order on the 3D view. A115's CO_2 falls back under the limit, and **the diagnosis stays latched**, because the thing that made the residual shrink was the response to the diagnosis, not a repair. That last sentence is the hardest property in the design and the one the oral will probe.

Why it matters. A demand-controlled system that silently stops ventilating is worse than no demand control at all: the fixed-schedule system it replaced would at least have kept moving air. Faults in ventilation equipment are undramatic: a damper that no longer modulates produces no alarm, no noise and no visible symptom, only a room that is slightly worse to be in for however many weeks pass

before somebody complains. A loop that can tell "this room is busy" from "this room is broken" is what makes demand control safe to deploy, and that is the whole use case. Ventilation fault detection is also only one of several systems that would run on this same building model (fire detection, access control and energy management would each be their own), and this report designs one of them.

3. Requirements

The requirements are the root of the traceability thread: each is a **testable** statement with a stable ID, written in **EARS**[1] form (an optional `When` event, `While` state or `If` unwanted-condition precondition, then *the system shall* a response), traced to a design element in Sections 4–9 and to a verification in Section 10. The authoritative repository's copy is `project/REQUIREMENTS.md`; this section adds each requirement's verdict and the regime it holds in.

The **verdict column is the honest one**, and it is the most important column in this report. The offline evaluation harness has now run, so all seven requirements carry the experimental evidence their acceptance criteria name, and **four of the seven carry a failing clause**: R-1, R-2, R-3 and R-7, which the column says in its first words rather than at the end of a paragraph. Two of those four fail on the harder of two arms and pass on the one their criterion names, and both arms are stated. R-4's evidence is now a container kill as well as an in-JVM one, and R-5's is a live rebuild *and* an integration test that executes its SQL.

[1] **E**asy **A**pproach to **R**equirements **S**yntax, from Rolls-Royce's airworthiness work: A. Mavin, P. Wilkinson, A. Harwood and M. Novak, "Easy Approach to Requirements Syntax (EARS)", *2009 17th IEEE International Requirements Engineering Conference*, pp. 317–322, doi:10.1109/RE.2009.9; practitioner guide at https://alistairmavin.com/ears/. Of its six patterns this report uses four: the three preconditions below, and the ubiquitous form that takes none.

ID	Type	Pri.	Statement (EARS)	Acceptance criterion, and how it is verified	Verdict, and the regime it holds in
R-1	Func.	Must	*When* a damper stops responding to commands, the system shall confirm the fault.	p95 confirmation $\leq$ 15 min after the first ignored command; injection harness, $\geq$ 20 runs	**Met as specified; not met in closed loop**
R-2	Func.	Must	*While* a fault is latched, the system shall keep the affected zone below 1000 ppm by compensation.	Zone CO_2 $\leq$ 1000 ppm for $\geq$ 95 % of occupied minutes during the fault; end-to-end scenario test	**Met on the case it covers; not met at design occupancy**
R-3	Non-f.	Must	The monitor shall raise no more than one false alarm per simulated week.	$\leq$ 1 `FaultConfirmed` in a 7-day fault-free replay, scored on the *worst* week; replay test on a fixed seed	**Not met**
R-4	Non-f.	Must	*While* readings are stale beyond three intervals, the monitor shall report unavailable and issue no diagnosis.	State is `BLIND`, zero fault events published; fault injection, kill `co2-sensor`	**Met, in-JVM and at container level**
R-5	Non-f.	Must	The system shall make every diagnosis reconstructable.	Inputs, command, residual series, classification and timestamp recoverable for any `caseId`; rebuild a case from the journal	**Built, demonstrated live against the deployed stack, and now covered by integration tests**
R-6	Non-f.	Should	The system shall identify the zone count at which the monitor misses its interval.	Sustained zone count where the p95 monitor cycle exceeds 60 s is reported; scaling experiment to breaking point	**Met, with an extrapolated answer**. And the deployed ceiling is a different and far smaller number
R-7	Non-f.	Must	*While* a fault is latched in one room, the system shall keep control and diagnosis of every other room unchanged.	Zero fault events and no control-mode change in the other five, their CO_2 *and their airflow* inside the healthy-run band; injection in one room, $\geq$ 3 rooms rotated as the injected one	**Met on the drawn weekday; not met at design occupancy**

No requirement here is Regulatory, and that is a gap rather than an absence. Five of the seven are non-functional, which is the right shape for a system whose interesting claims are about latency, false-alarm rate, auditability, scale and isolation. But R-2's 1000 ppm is exactly the kind of number a regulation supplies rather than a designer, and this report asserts it without a source. Grounding it in the Swedish indoor-air guidance it is plainly borrowed from would convert R-2's threshold from an invented parameter into a cited one, and §13.3, which owns the fact that every physical parameter here is invented, would have one fewer row.

Every measured figure behind those verdicts is in §11.2, one row per requirement, and **Appendix A** carries the same seven rows with their evidence column in full. The two failing pairs are the ones to read twice: R-1 and R-7 pass on the arm their own criterion names and fail on the harder arm beside it, and both arms are stated wherever either appears.

The verdict column above is the short form. **Appendix A reprints the same seven rows with their full evidence column**, naming the verification each verdict rests on; §11.2 reports the experiments themselves.

3.1 The tension these requirements set up

R-2 and R-7 pull against each other, and that is deliberate. R-2 needs a physical lever that reaches a faulted room from outside it; every such lever risks disturbing the rooms R-7 says must stay unchanged. With six independent fans there would be no tension and nothing to design: R-7 would hold because

nothing couples the rooms, and R-2 would have no mechanism. The shared air handler creates the tension, and resolving it is the supervisor's whole job (Section 7.4). R-1 and R-3 pull against each other in the same way, through a single number: lowering the CUSUM limit `h` detects sooner and cries wolf more often. Section 11.1 reports that trade-off as measured rather than asserted, and §11.2 now reports a sharper version of the same tension that was not visible when this was written: the binding knob turned out to be not `h` but what the CUSUM's *reference* is, and the setting of it that meets R-3 outright takes R-1's closed-loop detection from 15 of 20 to 1 of 20 (ADR-0010).

3.2 Gaps with no requirement ID

Kept visible rather than discovered during marking. Each is real work with no ID attached, so nothing in the table above constrains it and no test can name an ID for it.

- **Data quality.** R-4 covers *stale* readings only, and only insofar as staleness drives `BLIND`. Nothing requires duplicate suppression, out-of-order handling, or defines what the `quality` field in `readings/{zone}/co2` must mean.
- **The dashboard.** No requirement states what the 3D view must show, how fresh it must be, or what counts as the fault being visible. Its verification is "screenshot evidence for the report", which is a deliverable and not a criterion.
- **R-2's bound.** That a damper stuck fully shut must produce a work order rather than an attempted compensation is recorded in ADR-0008 and asserted by a unit test, but it is not itself a requirement, so no acceptance criterion covers it.


Traceability. The five architecture viewpoints map onto this document so that nothing is left unverified: *context* (4.1), *functional* (4.2–4.5), *information* (5–6), *behavioural* (8), *deployment* (9). Section 10 closes the loop from each requirement back to a verification, and Section 11.6 lists every verification that has not yet run.

4. Architecture

This section carries two subsections beyond the template's four, so its numbering runs one ahead from 4.3 onwards. The template's ***4.3 Component diagram*** *is §4.4 here, and its* ***4.4 Design decisions and alternatives*** *is §4.5. Nothing is omitted: §4.3 adds the authority separation and §4.6 how the architecture grows, both of which the architecture needs and neither of which the template has a slot for. The two code-level diagrams (C4 Level 4) and the documentation method are in Appendix B, with the reason only two of the former are drawn.*

4.1 Context diagram (C4 Level 1)

The context view fixes the **system boundary**. The system reads and commands the building only through BuildSim; the technician receives a work order and, by repairing the damper, is the only actor who can clear a latched case; occupants are sensed, not connected. Nothing internal appears.

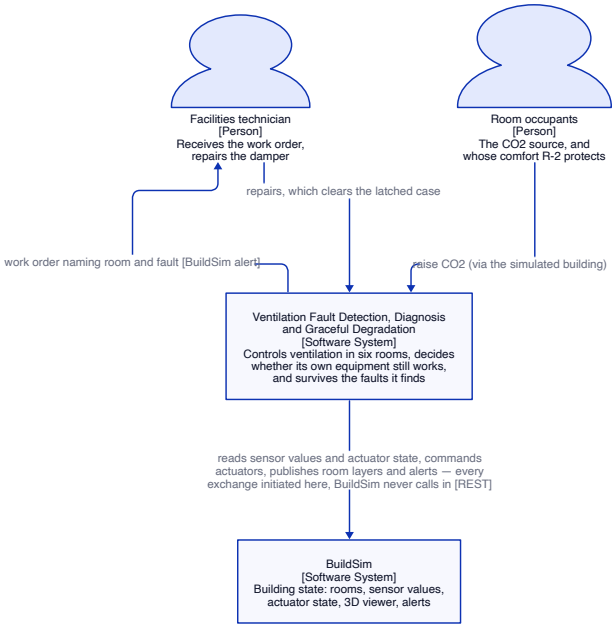


C4 System Context (Level 1), from `project/diagrams/context.d2`*. Person and software-system elements; every arrow is a directed relationship labelled with its purpose and protocol.*

4.2 Container diagram (C4 Level 2)

Each box is one Docker container, one service in `docker-compose.yml` and one folder under `project/`. That 1:1 mapping is a hard constraint of the implementation plan, not a coincidence, and it is what keeps the diagram from drifting from the code: adding a box means adding a folder and a service, which is why the fan-speed command is applied by `damper-actuator` rather than by a container of its own (Section 4.5).

Ten compose services, seven of them project-authored: `physics-simulator`, `co2-sensor`, `damper-actuator`, `dcv-controller`, `fault-monitor`, `supervisor` and `dashboard`, plus `buildsim` from the `buildingsim/` folder of the same repository and the third-party images `mosquitto` and `timescaledb`, configured under `project/deploy/`. Two folders are deliberately *not* containers (`shared/` is a library and `evaluation/` the offline harness), which is the entire reason the folder set is larger than the service set, and the mapping stays 1:1 for all seven.

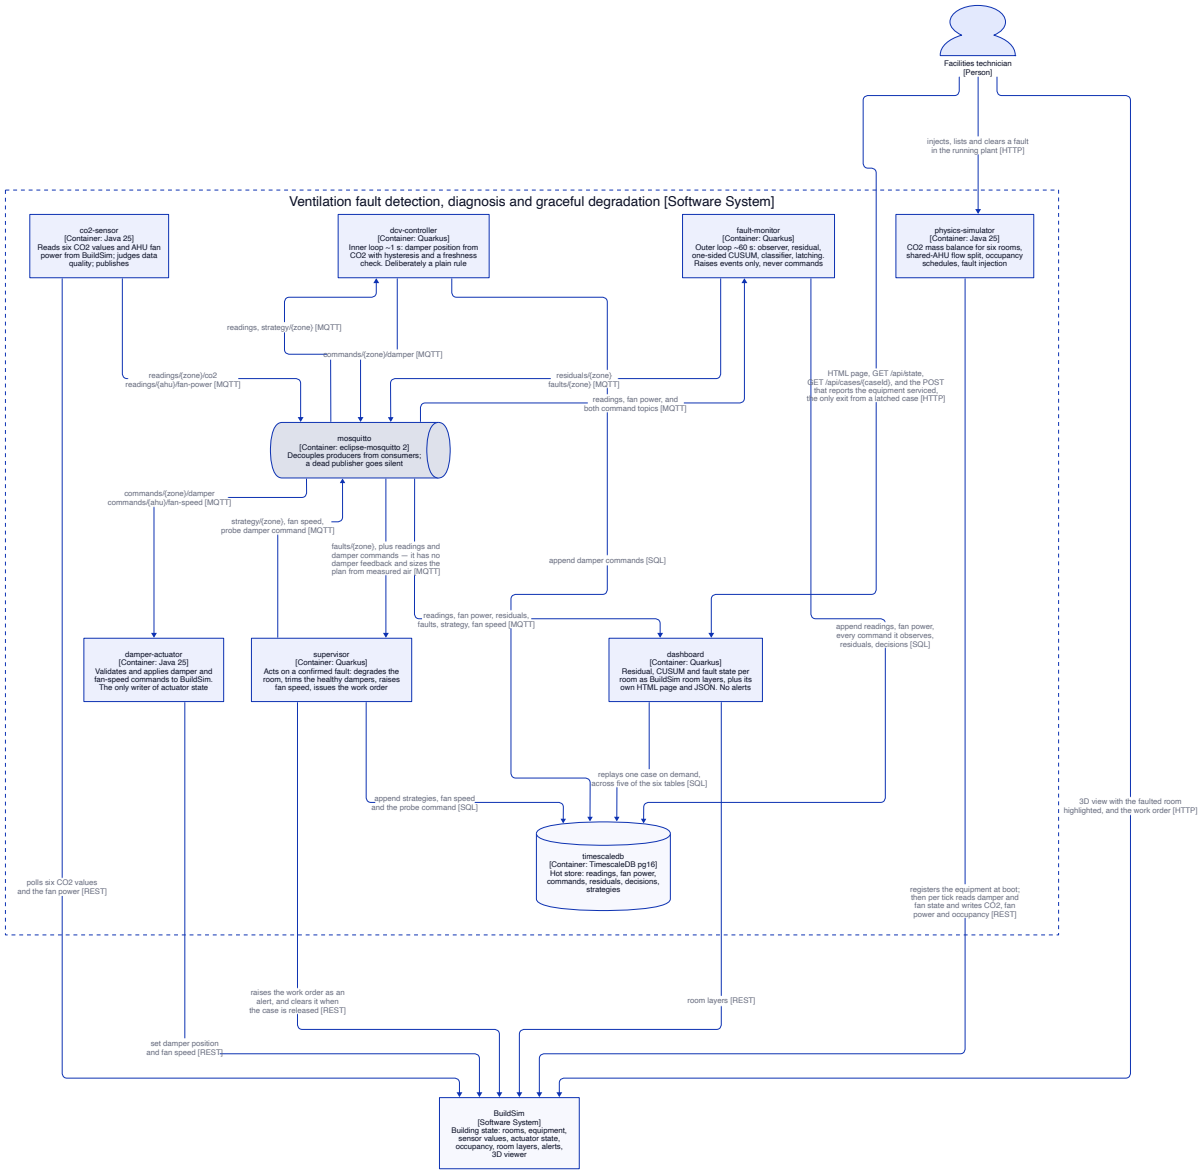

C4 Container diagram (Level 2), from `project/diagrams/container.d2`. *The dashed boundary is the system in scope; BuildSim is external; every arrow carries its protocol. The figure is service-for-service identical to* `project/docker-compose.yml`.

The loop the figure describes is the one that makes this a cyber-physical system rather than a dashboard. `physics-simulator` reads actuator state from BuildSim, advances the physics and writes sensor values back; `co2-sensor` reads those values and publishes them; `dcv-controller` commands a damper position; `damper-actuator` applies it to BuildSim; and that actuator change alters the environment the simulator advances on its next tick. The outer loop rides the same bus one order of magnitude slower.

The technician writes into the system in two places. One reports the equipment serviced to `dashboard`, which is the only exit from a latched case; the other is a small HTTP fault control surface on `physics-simulator` (`POST`, `GET` and `DELETE` on `/faults`) that injects, lists and clears a fault in the running plant. The second is what makes a recovery demonstrable rather than merely described: the scenario can be changed and the damper repaired without restarting the stack. Both ports are published on `127.0.0.1` only.

4.3 Authority separation: who may act

`fault-monitor` raises events and never commands. `supervisor` is the only component that acts. This is the single most important structural decision in the system and it is worth being explicit about why, because the two halves could obviously have been one process.

- **A crashing monitor must not be able to stop ventilation.** Diagnosis is the speculative, model-dependent, newest and least-trusted code in the system. Control is the part that keeps people breathing. If they share a process, a null pointer in the classifier takes the damper commands down with it. Split, the worst a dead monitor can do is stop producing diagnoses, and ventilation continues on the inner rule.
- **A wrong diagnosis must not be able to command anything by itself.** The monitor's output is a belief about the world, derived from a model I wrote about physics I also wrote. A belief that can actuate is a belief that can degrade a healthy room. Separating them means every action passes through a component whose only input is a *confirmed* fault, and that component is small enough to read in one sitting.

The separation is enforced structurally rather than by convention: the monitor's container has no publisher for any `commands/*` topic, and the single exception (the per-room active probe, which is a damper command) is owned by the supervisor precisely so that the rule has no exception. The same reasoning fixes ownership of the fan speed: `commands/{ahu}/fan-speed` is the compensation lever, so the supervisor owns it and the inner loop never writes it.

Container	Responsibility (one job)	Tech	Why it is a separate process
`physics-simulator`	Advance the CO_2 balance, the occupancy schedules, the air handler and the injected fault; write sensor values to BuildSim; take a fault in or out at runtime	plain Java 25	It is the environment, not the system. Nothing else may write a sensor value, or the loop would not close through the building
`co2-sensor`	Read six CO_2 values and the unit's fan power from BuildSim; judge data quality; publish	plain Java 25	Emulates the devices. Restartable without touching control; its failure must produce silence, which is what R-4 detects
`damper-actuator`	Validate and apply HVAC commands to BuildSim: six dampers and the one fan speed	plain Java 25	The only writer of actuator state. A separate failure domain from whoever decided the command
`dcv-controller`	Inner loop: damper position from CO_2, with hysteresis and a freshness check	Quarkus JVM	Must survive the monitor and the supervisor dying. Its rule changes on a different schedule from the diagnosis
`fault-monitor`	Observer, residual, one-sided CUSUM, state machine, classifier. **Events only**	Quarkus JVM	See above: the least-trusted code must not hold actuator authority
`supervisor`	Act on a confirmed fault: degrade, compensate, work order	Quarkus JVM	The only component that commands. Small, auditable, and its input is already a decision
`dashboard`	Residual and fault state as BuildSim room layers, plus its own page and JSON	Quarkus JVM	Presentation must not be able to slow control. Every dependency is optional so the page still serves when the rest is down
`mosquitto`	Decouple producers from consumers	Mosquitto 2	One source feeds many consumers; a dead publisher goes silent rather than blocking
`timescaledb`	Hot store for readings, commands, residuals, decisions, strategies	TimescaleDB pg16	Every service only appends to it; the one window read is R-5's case replay, from the dashboard
`buildsim`	Building state and the 3D view	Go (unmodified)	External system; pinned by being in the same repository (ADR-0007)

4.4 Component diagram (C4 Level 3) and the code structure

`fault-monitor` is the one container complex enough to deserve its own picture, and **Appendix B.1** draws it: every box one *component*, labelled with the exact type name so a reader can grep for it, with the `boundary` group holding every framework and transport type and `control` and `entity` depending on nothing outward. What matters in the body is the rule the figure obeys.

BCE inside hexagonal. Packages are organised by **business component** (`ventilation/`, `diagnosis/`, `supervision/`, `physics/`, `devices/`, `dashboard/`), and each business component has the same three layers:

- `entity/`: the domain model as Java records, with invariants enforced in compact constructors. `FanSpeed` cannot hold 1.4; `DamperPosition` cannot hold −0.1; `AirHandlingUnit` cannot be commanded outside its range. An illegal state is unconstructible rather than merely untested.
- `control/`: the business logic: the observer, the residual accumulator, the state machine, the classifier, the compensation solver, the hysteresis rule. No framework type appears here, which is why all of it is unit-testable without a broker, a database or a container.
- `boundary/`: every adapter: Paho for MQTT, JDBC with native SQL for TimescaleDB, an HTTP client for BuildSim, Quarkus scheduling and health.
- `event/`: **a fourth package, in `shared` only**, and it is named here because a reader who opens `shared/src/main/java/se/ltu/d7065e/shared/` finds three directories and this description otherwise promises two. It holds `DomainEvent`, its eight permitted records and `Topics`. It is not a boundary (it carries no framework import), and it is not one component's entity layer, because the alternative to a shared package is a dependency from every subscriber onto every publisher. ADR-0005 and ADR-0006 record the choice.

The dependency rule is what makes this hexagonal rather than merely three-layered: the arrows point *inward*. `control` and `entity` never reference `boundary`; instead the core declares **ports** in domain vocabulary. There are seven, all of them in `shared`'s `control` package and nothing else in it: `ReadingStreamPort`, `EventPublisherPort`, `ResidualJournalPort`, `BuildingStatePort`, `BuildingOverlayPort`, `OccupancyPort` and `ClockPort`. And `boundary` implements them. One adapter may implement more than one: `MqttAdapter` is a single class satisfying both `ReadingStreamPort` and `EventPublisherPort`, because subscribing and publishing are one broker session. The payoff is concrete and is not architectural tidiness for its own sake: because the clock is a port, the evaluation harness can drive seven simulated days through the same classes the containers run, in minutes; and because the reading stream is a port, every control-layer test runs with an in-memory fake instead of Docker.

Two honest notes on the structure. There is **no DTO or mapper layer**: domain records are serialised directly, and translation exists only where the schema is not mine (BuildSim and the journal). That is justified by lock-step single-author deployment and is wrong the moment any consumer deploys independently: it makes a domain rename a wire-format break. And `shared/` holds both the domain language and the three infrastructure adapters, so it is a library two kinds of thing live in; splitting it would add a module for no behavioural gain today. Below this level, two places in the system are claims about the *shape of the code* rather than about the physics, and both are hidden inside a single Level 3 box: **Appendix B.2** draws them and states the criterion that admitted exactly those two.

4.5 Design decisions and alternatives

Each row states the choice, the alternative genuinely considered, the requirement it serves and the price paid. A decision with no rejected alternative is only an assumption. The full records are in `project/decisions/`.

Decision	Chosen	Alternatives considered	Justification (requirement)	Trade-off accepted
Language and runtime (ADR-0002)	Java 25 on Quarkus, one container per component	**Go, which the course recommends**; Erlang/OTP	The course allows another language *if strongly motivated*, and the motivation is the assessment itself: the oral is individual, unaided and caps the grade at what can be defended at a whiteboard, so fluency is an architectural input rather than a preference. Erlang was weighed properly and fails on the requirement: OTP supervision runs *inside* the BEAM, so using it as intended puts N sensors in one Unix process and violates the one-process-per-device rule, while one node per sensor is the heaviest possible host for a single actor	A larger baseline container footprint than Go on the trivial sensor processes. ADR-0002 undertook to **measure** this rather than argue it, because footprint per container feeds the breaking-point experiment directly (§11, R-6); the figure was never taken, so it stands as accepted rather than measured
Coupling topology (ADR-0008)	One shared air handler, a damper per room, proportional split	Six independent rooms with a fan each; shared handler *plus* inter-room air exchange	Creates a real cross-room signal (plant fan power) and makes R-7 something the supervisor must earn rather than something the topology gives away (R-2, R-7)	A seventh simulated element and its invented fan curve; compensation cannot reach a damper stuck fully shut
Monitor/supervisor split	Two containers, events one way	One "autonomous service"	A crashing monitor cannot stop ventilation; a wrong diagnosis cannot command (R-4). **Measured rather than assumed**: T-27 kills each component in turn; 23 of 23 assertions in one JVM, and at container level five of six rooms reach `BLIND` within 12 s while ventilation continues (§11.2, Appendix G)	One more process, and a topic hop in the latency budget
Detection statistic	One-sided CUSUM on the residual, $k = 30$ ppm, $h = 150$ ppm	Raw residual threshold; two-sided CUSUM; learned one-class model	Accumulation catches a small persistent bias long before a threshold fires, and the spike measured 16.7 σ separation (R-1, R-3). **The learned alternative was not merely reasoned about, it was built and measured**: on a held-out fault-free week T-29's contender raises **11.25** false alarms per week against the rule's **0.55**, and it was dropped on that evidence (§11.2, Appendix F)	One-sided means a sensor drifting *low* is invisible (§13)
Inner control law	Plain rule with hysteresis and a freshness check	PID; model-predictive control	The outer loop must model the inner one, so inner complexity becomes observer model error (R-1)	Less efficient ventilation than an optimiser would give
Clearing policy	Latch; only an explicit service event clears	Clear when the residual falls	Compensation shrinks the residual that found the fault, so a self-clearing monitor would oscillate with a broken damper still broken (R-2)	A false positive is sticky, and a false positive costs one technician visit and one HTTP request (§13)

Decision	Chosen	Alternatives considered	Justification (requirement)	Trade-off accepted
Fan-speed ownership	`supervisor` publishes it; `damper-actuator` applies it	A `fan-actuator` container of its own	The fan is the compensation lever, so the inner loop must not write it; a container of its own for one PUT is not worth a box, a folder and a service (plan constraint 4)	`damper-actuator`'s name is now narrower than its job
Transport	MQTT pub/sub for readings, commands and fault events	Direct REST between components; Kafka	One sensor feeds controller, monitor, store and dashboard; a dead publisher goes silent rather than blocking (R-4)	A broker to run; and without retained replay a monitor restart loses its residual history
Service state across a restart (ADR-0012)	One JSON document per service on its own volume	Replaying the journal to rebuild state; a second database (MongoDB was adopted and then rejected); accepting the loss	The journal is an append-only record of *what happened* and this is *what is believed now*: different lifetimes, and one of the three things needed (the pinned damper belief) exists nowhere in the journal but as prose. A restarted monitor kept no latch, and a restarted supervisor *erased* live work orders	Host-local: the file follows the volume, not the service, so a multi-host deployment must replace it. No history and no query: correct for state, wrong for evidence, which is why the journal is untouched
Hot store	TimescaleDB with native SQL over six hypertables	Plain PostgreSQL; files; an ORM	The residual window query per `caseId` is the hot path, and R-5 needs provenance on every row	Native SQL is hand-maintained; one more stateful service
Runtime	Java 25; Quarkus JVM for the four scheduled services, plain `java -jar` for the three device processes	Quarkus everywhere; Spring Boot; native images in development	Scheduling, config and health are worth a framework; a 40-line sensor loop is not (ADR-0002)	Two startup styles to understand in one repository
Architecture style	BCE inside hexagonal, ports in the core	Layered by technology; framework annotations in the core	Lets the evaluation harness drive the same classes through a simulated clock, and keeps control-layer tests container-free (R-6, R-3)	More indirection than a small system strictly needs
Fault injection point	Between the command and its physical effect	At the sensor; at the controller	The command record and the physics must disagree, or there is nothing to detect (R-1)	The fault model is mine, and so is the detector (§13)
Healthy-room airflow bound (ADR-0009)	One symmetric 5 % allowance, kept, with the two sides separated in the code because they are different quantities	An asymmetric over-supply allowance at 0.10, 0.20, 0.43 or unbounded; a per-room trim instead of one common factor	Swept closed-loop, the allowance buys R-2 zero occupied minutes at every setting (0.024 and 0 of 5 seeds throughout) because with every healthy damper on its floor the fan lever is not selective and the plant caps it at 1.43 against the 2.0–3.3 the regime asks (R-2, R-7)	R-2 keeps a named failure instead of a bought pass, at 134 ppm of mean concentration the plant could have delivered
Plausibility guards are bounds, not filters (ADR-0010)	Drive the guarded lower arm off the outdoor clamp, and re-anchor the other five rooms when a confirmation pins a damper	Gate both arms on the judging window; never let a re-anchor lower the ceiling; clamp at the design generation alone; raise h; fix the lower arm only	`correctTowards` pulled both guards 30 % of the way onto every reading, so each was a filter and each arm ran on a filter error rather than on a residual; correcting the lower arm's half halves R-3's rate and moves no other requirement (R-3)	R-3 is still not met, and the variant that does meet it is left on a branch because it costs R-1's closed-loop arm 15 of 20 against 1 of 20, T-27 and R-7


4.6 How this architecture grows

Three growth directions are worth separating, because the architecture answers them very differently: **more zones on one plant**, **more plants or more buildings**, and **new or replaced services**. For the first two the limits are measured and the bottleneck is named. For the third the honest answer is not a list of seams but the one boundary that *looks* like a seam and is not, so this subsection ends there rather than beginning there.


More zones on one plant. Two ceilings exist and they are never quoted as one. The harness reaches **25 600 zones at a p95 of about 6 s** inside the 60 s interval, fits $p95 = 1.196 \times 10^{-8}\, n^{1.97}$ with $r^2 = 0.9991$, and extrapolates the 60 s crossing to roughly **86 000 zones** (§11, R-6). The *deployed* ceiling is **58 zones**, and it is BuildSim's floorplan (the simulator will not host equipment in a room its level-0 plan does not have), not anything about the monitor. The exponent 1.97 is the useful part: the saturated element is `AhuFlowModel.believedFlowTo`, which sums every damper's opening to find the denominator of the proportional split and is therefore $\Theta(n)$ per zone and $\Theta(n^2)$ per cycle. The harness names it in its own output rather than leaving it to be inferred (`ScalingExperiment.java:122`). It is also the cheapest thing in the system to fix: the denominator is one scalar that changes only when a damper moves, so caching it and invalidating on change makes the cycle $\Theta(n)$ and moves the crossing out by orders of magnitude. That work is not done because 58 zones is the ceiling that binds, and optimising past a limit the deployment cannot reach would be sophistication with nothing behind it.

More plants, or more buildings. The shard boundary is one air-handling unit, and it is a shard rather than a partition for a structural reason: the only cross-room term in the whole design is the flow-split denominator above, and that sum runs over one plant's dampers. Two air handlers share no term, so two monitors over two AHUs compute exactly what one monitor over each would: no coordination, no distributed state, no consensus. The wire is already shaped for it: `Topics.fanPower(AhuId)` and `Topics.fanSpeedCommand(AhuId)` take the handler as a parameter, so `readings/{ahu}/fan-power` is per-plant today and a second AHU needs no topic design at all. One `fault-monitor`, one `supervisor` and one `dcv-controller` per AHU, sharing the broker and the journal, is the whole scaling story for a building, and the per-zone tables already carry the zone, so the journal needs no change either. What is *not* shaped for it is named below.

New or replaced services. Every boundary at which an implementation can be swapped is inventoried in `project/diagrams/seams.md`, which separates two kinds that are routinely confused. A **contract seam** is run-time and language-agnostic (an MQTT topic plus the payload record on it), so anything publishing the right topic with the right payload is substitutable whatever language it is written in, and the far side cannot tell; this is where a physical sensor or a real DDC panel is installed. A **port seam** is compile-time and same-JVM: a Java interface in `shared/control`, declared in the core's vocabulary rather than mirroring an adapter's API (ADR-0005), swapped in a composition root with no change to `control` or `entity`. **A port seam cannot install a device, and a contract seam cannot be unit-tested with a stub**, which is why the system has both.

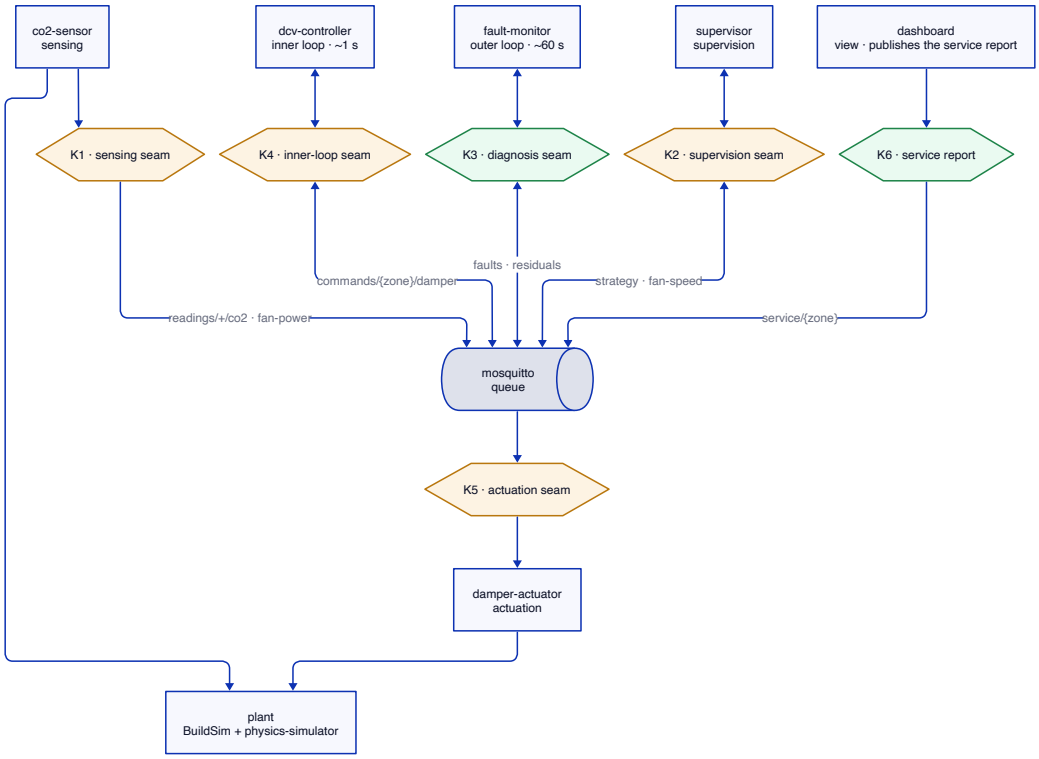

The contract seams, from `project/diagrams/seams-overview.d2`*. Hexagons are contract seams at the wire; the tier colouring is in the legend below. The per-boundary figures (*`seams-plant`*,* `seams-transport`*,* `seams-storage`*,* `seams-clock`*,* `seams-topology`*) carry the port seams and the non-seams.*

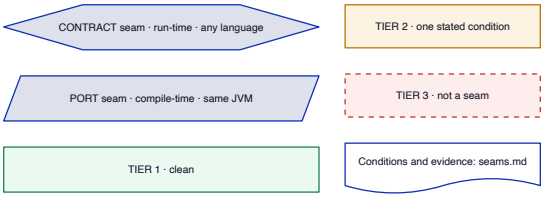

Tier 1 clean: replace one side, nothing else changes. Tier 2: genuinely substitutable, but something named must change with it or be inherited. Tier 3: looks like a boundary on the container diagram, and crossing it would mean changing code on both sides. ***The Tier 2 conditions and the Tier 3 entries are the content****. Twelve seams all claimed clean would be a prettier set of figures and a worse one.*

Two questions an examiner is entitled to ask are each answerable by pointing at one line. *Where do we cut to replace the virtual CO_2 sensor with a real one in the ceiling?* At **K1**, the wire, where `readings/{zone}/co2` carries `ReadingObserved`, not at `BuildingStatePort`, because that is a Java interface on this classpath and a device in a ceiling is not a Java class. K1 is Tier 2 and the replacement inherits three stated conditions: it must judge its own data quality, because nothing downstream can; it must publish fan power too, or nothing does; and it must stamp `ObservedAt` on the shared timeline. *Where do we cut to replace the supervisor?* At **K2**, whose three published topics are the complete *control* contract, provided the replacement also inherits two obligations that are not topics at all: it must be the only writer of BuildSim's alert collection, and it must journal its own decisions.

And the part that is not a seam, which is the real answer to how this grows. `Topology.java` hard-codes the plant: the six rooms with their areas and design flows, the nominal flow and power, the normal fan speed, the damper floor, the outdoor and comfort concentrations, the generation per person, both noise sigmas, and the CUSUM slack and limit. It is an interface of static members in `shared/`, **with no port in front of it and no injection point**, and **34 main-source files import it**. And the readers are `control` classes rather than adapters, which is precisely what makes it unsubstitutable. A real corridor has measured design flows, a measured air handler and a measured sensor noise floor, so every one of those numbers is edited in one file in the library all seven services link, which recompiles and redeploys all seven. `Topology.AIR_HANDLER` is likewise a single literal, `AhuId.of("AHU-A120")`, so the per-AHU sharding the topics already support is blocked by one constant rather than by any part of the design.

The sharpest consequence is not the redeploy. **The CUSUM slack and limit are tuned to the sensor noise sigma** and the file says so in place: a real sensor with a different noise floor does not merely change a constant, it **invalidates the spike that measured k and h together** (16.7 σ separation, 0 of 20 false alarms, §11.1) until that spike is redone against the real instrument. That is the honest cost of taking this architecture to a real building, and it is a *commissioning* cost rather than a software one. If one thing were done first it would be this: put the plant behind a configuration port so the numbers are data rather than code, and make the tuning of k and h an explicit function of the measured noise floor instead of a pair of constants that happen to match it.

5. Interfaces and data contracts

Three communication patterns are used, each for the job it fits. **MQTT pub/sub** carries readings, commands, residuals, fault events and strategies, because one producer feeds several consumers and a dead producer should go silent rather than block. **REST** carries every call to BuildSim, because each is a one-to-one request whose result the caller must confirm. **HTTP** serves the dashboard page and its JSON. This section is written to be precise enough to re-implement a component from.

5.1 MQTT topics and payloads

`{zone}` is one of the six zone identifiers `A125A`, `A125`, `A116A`, `A115`, `A124`, `A145`; `{ahu}` is `AHU-A120`. The zone identifier is the bare room name and not BuildSim's key `level0/A115`, because the key contains a slash, which would split an MQTT topic; the BuildSim adapter is the only place that knows the key.

Topic	Publisher	Subscribers	Payload fields	Semantics
`readings/{zone}/co2`	`co2-sensor`	controller, monitor, supervisor, dashboard	`zone`, `ppm`, `ts`, `quality`	One per room per second. `quality` is the sensor process's own judgement of the reading. The supervisor is a subscriber because it sizes a compensation plan from measured air
`readings/{ahu}/fan-power`	`co2-sensor`	monitor, dashboard	`ahu`, `watts`, `ts`, `quality`	One fan, so one topic. The monitor's only cross-room signal
`commands/{zone}/damper`	`dcv-controller`; `supervisor` for the probe	actuator, monitor, supervisor	`zone`, `position`, `ts`, `reason`, `commandId`	`commandId` is what the residual is keyed to; `reason` is human-readable so every action is auditable. The supervisor subscribes to its own topic because it has no other damper feedback

Topic	Publisher	Subscribers	Payload fields	Semantics
commands/{ahu}/fan-speed	supervisor only	actuator, monitor, dashboard	ahu, speed, ts, reason, commandId	The compensation lever. The inner loop never writes this topic; the monitor subscribes so that its believed flow split tracks the speed it was not told about directly
residuals/{zone}	fault-monitor	dashboard	zone, residual, cusum, ts, commandId	Published every cycle, including in WARMUP, where no diagnosis is issued
faults/{zone}	fault-monitor	supervisor, dashboard	zone, state, classification, evidence, ts, caseId	state is the monitor state; classification is one of STUCK_DAMPER, DAMPER_STUCK_OPEN, BLOCKED_FILTER, SENSOR_DRIFT or UNCLASSIFIED
strategy/{zone}	supervisor	controller, dashboard	zone, mode, trimmedPosition, ts, caseId	DEGRADED tells the inner loop to stop commanding that room; COMPENSATING carries that one room's own trimmed damper position in trimmedPosition, absent under the other two modes
service/{zone}	dashboard, or any operator tool	fault-monitor	zone, caseId, reason, ts	The equipment behind a latched case was repaired, which is the *only* thing that clears one. Refused unless that exact case is open and latched. **Deliberately not under commands/**: it reports something about the world rather than instructing an actuator, and putting it there would give a second publisher authority over the topic space damper-actuator owns

Two example payloads, with units in the field names or stated, so no consumer has to guess:

readings/A115/co2

```
{ "zone": "A115", "ppm": 1020.4,
  "ts": "2026-10-05T09:14:00Z", "quality": "GOOD" }
```

faults/A115

```
{ "zone": "A115", "state": "CONFIRMED",
  "classification": "STUCK_DAMPER",
  "evidence": ["cusum 175 ppm > h 150 ppm for 2 cycles",
               "fan power flat at 137 W",
               "5 of 6 residuals quiet",
               "overnight floor 418 ppm"],
  "ts": "2026-10-05T09:21:00Z", "caseId": "case-3" }
```

5.2 REST, against BuildSim

BuildSim's schema is not mine, so this is the one place a translation layer exists.

Six calls, all one-to-one writes or reads whose result the caller must confirm, which is why each is REST and not a message: the simulator writes sensor values and reads back the actuator state that actually applied, co2-sensor reads its own sensor, damper-actuator writes actuator state as the single source of truth, supervisor writes the work-order alert, and dashboard repaints the room layers every 5 s

idempotently. **Appendix C.3** gives caller, direction, purpose and the reason for each.

5.3 Journal (TimescaleDB)

Six typed hypertables: `readings`, `fan_power`, `commands`, `residuals`, `decisions` and `strategies`. Every row of all six carries two provenance columns (`source`, which process wrote it, and `received_at`, distinct from the event's own observation time so that an arrival delay is visible rather than invisible), and `commands` and `residuals` additionally carry `command_id`. That last column is the one that makes R-5 mean anything: **a residual that cannot be tied to the command it was judged against is not evidence**. Window queries over the residual series for one `caseId` are hand-written native SQL rather than an ORM, which is the one place the plan allows raw SQL and the one place it is clearly right: the query is a time-bounded ordered window, not entity retrieval.

There is no retention or compression policy, and no chunk interval is specified, so TimescaleDB's seven-day default applies and nothing is ever dropped. For runs of the length this project uses that is harmless; it is stated here because describing a policy that does not exist would be the easier and less honest option.

6. Simulating the sensor values (the physical model)

BuildSim provides the rooms and no physics, so the air, the people and the plant are all simulated. The aim is not physical perfection but enough structure (distinct time constants, daily cycles, genuine responses to actuation) that the controller reacts to meaningful data and the observer has something real to be wrong about.

Every parameter in this section is invented rather than measured, and each is derived from a stated rule rather than picked. That distinction matters and is the reason ADR-0008 lists the derivations: it is what lets Section 13 say precisely which claims the invention invalidates (the detection-performance numbers) and which it does not (the architectural properties).

6.1 The six rooms

The six rooms are the cluster on corridor A120 of level 0, taken from BuildSim's own `level0/floorplan_data.json`. Every one has a room → entry → corridor path in BuildSim's walkable graph ending at corridor node `A120` and at no other corridor, and the six lie within 59 m of one another along it. Volume is floor area × an assumed **3 m ceiling**; the floorplan carries no height. Design flow is the Swedish workplace guideline, **7 l/s per person plus 0.35 l/s per m²**, at the room's intended occupancy.

Appendix C.1 tabulates all six: area, volume, intended use and schedule, design occupancy and design flow, with the Σ row the plant is sized from.

Five distinct sizes spanning 18–76.5 m², a 4:1 span in volume, so no two rooms share a time constant V/Q or a schedule. That matters because R-7's "unchanged" is measured against those differences: the rejected alternative room set (the corridor A170 cluster) had better wall adjacency but eight of its ten rooms were 69–79 m², and six same-size rooms would pass R-7 more easily and mean less.

6.2 The shared air handler, the flow split and the fan laws

The rooms do not each get a fan. One air-handling unit `AHU-A120` serves all six, with one damper per room. Its flow and power are

$$Q_{\text{fan}} = Q_{\text{nom}}\, s\,(1-\beta), \qquad P = P_{\text{nom}}\, s^3\,(1+\beta),$$

with speed $s \in [0.2, 1.0]$ and filter blockage β. The cube in the speed is the fan affinity law; β enters the two with *opposite* signs, which is the whole point: a blocked filter costs more power for less air,

and that asymmetry is what the classifier tests. The flow is split over the six damper openings in proportion:

$$Q_i = Q_{\text{fan}} \frac{a_i}{\sum_j a_j}, \qquad a_i = p_i \, A_i,$$

where i indexes the six rooms and j runs over the same set, p_i is the commanded damper position and A_i the damper's authority, taken proportional to that room's design flow. This is the simplest law under which the dampers genuinely interact, and the interaction is not incidental: it is the mechanism of Section 7.4.

Every one of those parameters is invented rather than measured, and each is derived from a stated rule rather than picked. **Appendix C** gives the full table (parameter, value, derivation, and the requirement each is first-order on), and §13.3 says which claims the invention invalidates and which it does not.

The consequence of the authority rule is worth stating on its own, because it is the design: at $s = 1$ with every damper open each room receives 143 % of its design flow (the 43 % of headroom the table above reserves for compensation), and *no room can take more than its share of a fixed total*, so **the only way a room gets more air is if another damper closes.** That is simultaneously what makes compensation possible and what makes R-7 non-trivial.

6.3 The air: a well-mixed CO_2 balance per room

Each room is one well-mixed volume:

$$V_i \frac{dC_i}{dt} = n_i \, g \cdot 10^6 - Q_i \, (C_i - C_{\text{out}}),$$

integrated with forward Euler at a 1 s tick, where V_i is the room volume, C_i its CO_2 concentration, n_i its occupant count, g the generation rate per person and C_{out} the 420 ppm outdoor concentration. The 10^6 converts a volumetric generation rate into the ppm the concentration is measured in: V is m^3, Q and g are m^3/s, so without it the production term is a volume fraction while the dilution term is ppm and the two cannot be added. It is also the factor that makes the sizing come out right: 165.9 l/s holds A145 at roughly 1000 ppm with its 20 design occupants, so the ventilation guideline and the comfort limit agree about that room, which is the coincidence the fan sizing leans on. There is **no inter-room air exchange** and no corridor volume: that was option C's consequence and option C was rejected.

Actuator commands feed back into this equation *through BuildSim*: when the controller opens a damper, a_i rises, the split gives that room more of Q_{fan}, Q_i rises, CO_2 falls, and the next reading reflects it. That is the sense–compute–act loop made concrete.

6.4 The people

Occupancy drives everything else, so it is modelled explicitly as a weekday schedule per room type: arrivals spread over 07:30–09:00, departures over 16:00–18:00, lunch dips of 30–60 min, booked meetings (a 0.35 probability per hour for the meeting room, 0.3 per two-hour slot for the seminar room), 5–8 of 8 desks occupied in the open-plan office, and empty nights and weekends, with randomness seeded so that no two days are alike but every run is reproducible.

Empty nights do double duty: they are the **reference condition for the sensor**. With nobody in the building, CO_2 *must* decay to the outdoor level, so a floor that is wrong overnight is evidence of a drifting sensor and of nothing else. That is the third of the classifier's signatures, and it exists because the schedule has nights in it.

6.5 The faults

Four faults, injected **between the command and its physical effect**, so that the command record and the physics disagree, which is what gives the monitor something to detect. Four *mechanisms* against the monitor's three *classifications*: the last two are two ways for a sensor to be wrong, and the monitor has one word for both of them (§7.3).

Fault	Scope	What it does to the physics	Signature it is meant to leave
`STUCK_DAMPER`	one room	The vane ignores the command and holds its magnitude position	One residual rises; plant fan power flat
`BLOCKED_FILTER`	plant-wide	Scales Q_{fan} by $(1-\beta)$ and power by $(1+\beta)$	All six residuals rise together; power per unit of flow rises
`SENSOR_DRIFT`	one room	Adds a linear, *uncapped* ramp in ppm per hour at the *sensor*, not in the room	Step-response shape right, overnight floor wrong
`SENSOR_OFFSET`	one room	Adds a *fixed* offset in ppm at the sensor from its onset and holds it there: a recalibration against the wrong reference, or a replacement element installed without one	The same signature in principle; in practice it confirms within minutes, long before the overnight floor it would need (§7.3)

The magnitude means something different for each kind, and the records enforce the range: a frozen damper position in $[0, 1]$; a blockage β in the open interval $(0, 1)$; a drift rate in ppm per hour that must be non-zero *and may be negative*; and an offset in ppm under the same rule. That last permission matters and Section 13.1 returns to it: a negative drift is a fault the generator can produce and the deployed guarded lower arm does see, because a room reading below the 420 ppm outdoor concentration betrays itself. The two sensor faults are separate kinds rather than one parameterised kind because their magnitudes carry different *units* (ppm per hour against ppm) and one kind holding both would need a fifth field in the spec grammar below, breaking every scenario already written. Sensor errors on one sensor accumulate; two stuck positions do not, the last declared one wins.

Faults are declared as `KIND:TARGET:MAGNITUDE:ONSET`, several separated by `;` or newlines, with `#` comments ignored, passed to the simulator through `FAULT_SPEC` or `FAULT_SPEC_FILE` so a demo scenario needs no file edit:

```
STUCK_DAMPER:A115:0.15:T+1800          # vane frozen at the 0.15 floor, 30 min into the run
BLOCKED_FILTER:PLANT:0.4:T+7200        # beta = 0.4; PLANT, because the filter is shared
SENSOR_DRIFT:A124:150:2026-10-05T09:00:00Z   # +150 ppm per hour from that instant
```

The ground truth of which faults are active is carried on every simulator snapshot alongside *both* the true and the measured concentration, so an experiment can always compare what the detector concluded against what was injected. Sensor noise is Gaussian at $\sigma = 30$ ppm from a random stream separate from the occupancy schedules, so noise and people can be varied independently, and that 30 ppm is the same number the CUSUM's k and h are tuned to, which is why it is not a free parameter.

7. Autonomous services and data pipeline

7.1 The inner loop, and why it is deliberately plain

`dcv-controller` runs **once a second** per room. It reads `readings/{zone}/co2` and publishes `commands/{zone}/damper`, through a rule with three parts:

- **A hysteresis band.** Above **800 ppm** the damper follows a proportional ramp; below **650 ppm** it returns to the 0.15 minimum; *between* the two it holds whatever position it has. The band is what stops a vane chattering as noise crosses one threshold.
- **A ramp, not a switch.** From the minimum at 800 ppm the opening rises linearly to fully open at the **1000 ppm comfort limit**: position $= 0.15 + \frac{C-800}{200}(1 - 0.15)$, clamped open at and above the limit. So a room at the limit is already asking for everything the plant can give it.

- **A freshness check and a publish dead band.** A reading staler than three sample intervals (3 s) produces no command at all: the position is held, nothing is announced. A command that differs from the current position by less than **0.02** is not published, because a stream of no-op commands would bury the step the observer is looking for.

A room whose `strategy/{zone}` says `DEGRADED` is not commanded at all, and a room in `COMPENSATING` follows the supervisor's trim with CO_2 getting no vote. That is enforced twice: once by an explicit guard in the control loop, and once by the entity invariant. Asking a degraded `VentilationZone` for a normal control command throws.

This is the simplest thing that meets the requirement, and four reasons make simplicity the right choice rather than a shortcut. First, the outer loop has to *model* the inner one, and an observer predicting a model-predictive controller inherits that controller's complexity as model error, which is exactly what the residual cannot distinguish from a fault. Second, and sharpest, **integral action would mask the fault**: a PID controller facing a room that will not respond winds up its integral term and pushes harder, which is precisely how a competent controller hides a stuck damper from everything downstream. The plain rule commands what the concentration asks for and nothing more, so the gap between command and effect stays visible. Third, a plain rule is verifiable, and it is the component that must keep working when everything cleverer has crashed. Fourth, demand control is a solved problem and improving it would earn nothing the course grades.

Two thresholds are deliberately *not* configurable: the 1000 ppm comfort limit and the 0.15 damper minimum come from the shared topology rather than from deployment config, because letting a deployment override either would let configuration move the goalposts the evaluation measures.

7.2 The observer: judging what the command owed

The autonomous service proper is `fault-monitor`, and its core is the **observer**. Each damper command is a step. The observer integrates the same mass balance of Section 6.3, driven by the *commanded* position and the air handler's state, and predicts the CO_2 trajectory that step should have produced over roughly the following ten minutes. The **residual** is $r = C_{\text{measured}} - C_{\text{predicted}}$: positive means the room is dirtier than the command should have left it.

The observer uses no occupancy, and that is the answer to the project's central risk. A prediction needs a generation term, and head-count is the one thing a real building does not measure. Three design choices together replace it:

1. **Judge only commanded step responses.** The *shape* of a step response depends on airflow and volume, not on how many people are in the room; a constant occupancy shifts the level, not the response to actuation. Judgement is restricted to a **10 min window** after a command, and only a command that moves the damper by at least **0.05** arms that window. A nudge smaller than five points of travel is not a step response worth judging.
2. **Estimate generation from quasi-steady state, then stop updating it.** With $dC/dt = 0$ the balance gives $G_{\text{est}} = Q\,(C_{\text{measured}} - C_{\text{out}})$ directly from quantities the system already has. It is smoothed by a first-order filter at gain **0.3** and is updated **only while the observer is not judging**: not inside an open window, not in `SUSPECT`, not while a case is latched. So occupancy learned before a step informs the prediction and occupancy during the step cannot contaminate it.
3. **Guard with a design-occupancy ceiling.** The estimate is invalid exactly when quasi-steadiness is: a room filling up mid-window produces a residual the damper did not cause. The guard is a **second trajectory integrated in parallel** at the room's design occupancy, which the observer recovers from the damper authority alone as $n_{\text{design}} = (A_i - 0.35\,\text{area})/7$, inverting the ventilation guideline of Section 6.1. Suspicion is measured against *that* ceiling, so an unmodelled arrival cannot by itself confirm a fault.

Between commands the prediction is pulled toward the measurement by a first-order filter at gain 0.3 rather than snapped onto it. That choice is worth a sentence because it is quantitative: a hard

re-anchor would inject a full σ of sensor noise into the prediction at every sample, which raises the residual's standard deviation by $\sqrt{2}$ and, by the run-length formula of Section 7.3, would turn a 79-day in-control run length into roughly half a day. The same reasoning decides what a step anchors to: the *filtered* prediction, not the single raw sample taken at the moment of the command.

That guard is not free, and Section 13.7 states its cost: in A145 (20 seats) or A115 (10 seats), a room holding two people has a ceiling far above anything a stuck damper produces, so the fault is invisible until the room fills, and detection delay therefore depends on occupancy. The harness prices that dependency at its two ends rather than describing it: with every room at design occupancy the p95 confirmation delay is **6 min**, and on a drawn weekday (the same fault, the same limit, the same seeds) it is **257 min** (§11.2). The closed-loop arm turns out to carry the points between them, because its 20 runs are 20 *different* drawn weekdays and the harness records the head count present at each first ignored command. **Appendix F.2** gives that stratification and states plainly what kind of evidence it is: a stratification of the runs that happened, not a sweep of a controlled input.

7.3 Residual, CUSUM, state machine, classifier

The statistic is a **two-sided CUSUM** on the residual. Its upper arm, which every figure in this report is scored on, is:

$$S_0 = 0, \qquad S_t = \max\bigl(0,\ S_{t-1} + r_t - k\bigr), \qquad \text{alarm when } S_t \geq h,$$

where r_t is the residual at cycle t, and *which* residual is the subtlety below, since it is not the published one, with $k = 30$ ppm $= 1\sigma$ the reference value, $h = 150$ ppm $= 5\sigma$ the limit, and σ the sensor noise of Section 6. The reference value k is set to σ because a stuck damper produces a large growing bias rather than a subtle shift, which makes the statistic insensitive to noise and to small model errors; subtracting k at every sample is also what makes a noise tail draw decay away instead of accumulating. The limit h comes from R-3 through Siegmund's approximation, which the monitor carries in code so the tuning can be re-derived rather than remembered: at $(k, h) = (1\sigma, 5\sigma)$ the in-control average run length is $\approx 1.1 \times 10^5$ samples ≈ 79 days at 60 s, an order of magnitude inside R-3's one false alarm per week. The derivation came first and the spike's 20-seed check set then confirmed it, 0 of 20 at 5σ against 1 of 20 at 4σ (§11.1); the empirical result is corroboration, not the reason for the value. Why the CUSUM rather than a raw threshold: accumulation catches a *small persistent* bias long before any single-sample threshold fires, which is the regime a partly stuck damper lives in.

The lower arm is the mirror, $S_t^- = \max\bigl(0,\ S_{t-1}^- - r_t - k\bigr)$, and it is *guarded*: it accumulates against the 420 ppm outdoor floor rather than against the prediction, so it sees a sensor drifting downward, which under-ventilates an occupied room, without accusing a room that has simply emptied. Section 13.1 states what that guard can and cannot catch, and Appendix F accounts for the nine of twenty-six pre-fix false confirmations that came from this arm before ADR-0010 corrected the plausibility guards.

One subtlety that matters, and that I would not have guessed before building it: the residual that is published is not the residual that is accumulated. The residual on `residuals/{zone}` is the honest one, measured minus predicted, because that is what a human and the dashboard should see. The CUSUM is driven instead by measured minus the *plausibility ceiling* of Section 7.2, which is the conservative quantity: it is what makes an unmodelled arrival unable to confirm a fault. The ceiling residual is *subtracted*, not clipped at zero, because clipping would rectify the sensor noise, give the statistic a positive mean and destroy the in-control run length the previous paragraph just derived. And that run length is the entire basis of R-3.

Two thresholds, not one. Opening a case uses a lower bar than confirming it: the statistic passing **90 ppm** ($0.6\ h$) moves a room to `SUSPECT`, and only the full h held for **two consecutive cycles** confirms. Persistence is the real defence against a tail draw: a single excursion is gone on the next sample, since the CUSUM subtracts k from every one, while a stuck damper clears h every cycle. A suspect room whose statistic has decayed back to **zero for three consecutive cycles** returns to

`HEALTHY`. Rooms need **three usable cycles** to leave `WARMUP`, and readings staler than **three sample intervals** (180 s at the 60 s monitor cadence) drive `BLIND`.

The state machine runs one instance per room: `WARMUP` → `HEALTHY` → `SUSPECT` → `CONFIRMED` → `COMPENSATING` → `SERVICED` → `WARMUP`, with `BLIND` reachable from `WARMUP`, `HEALTHY` and `SUSPECT` on readings stale beyond three intervals. Four properties of its shape are the design:

- **`BLIND` is not a fault.** It reports unavailable and issues no diagnosis (R-4), and there is *no edge* from it into `SUSPECT` or `CONFIRMED`: missing data is not evidence of a fault. It always returns to `WARMUP`, never into an open case, so the step response is re-identified before judging resumes.
- **`SUSPECT` can recover; `CONFIRMED` cannot.** `SUSPECT` → `HEALTHY` is the machine's one recovery edge, taken when S has decayed back to zero for three consecutive cycles. Falling below h is not enough: that only stops the confirmation count, and a statistic parked between zero and h keeps the case open. The asymmetry is deliberate.
- **`CONFIRMED` and `COMPENSATING` are latched**, and the only exit is `serviced()`. That is the masking defence: compensation shrinks the residual that found the fault, so a monitor that believed its own shrinking residual would be talked out of a true diagnosis by the evidence its own response destroyed.
- **The active probe re-confirms but cannot clear.** Every 30 min a latched room's monitor *asks* for a damper step (as an **event**, never a command, which is §4.3's authority rule holding even here), and the supervisor issues it, rate-limited to one per room per 15 min and per-room because a fan-speed probe would perturb all six. A damper being compensated answers a step exactly as a repaired one does, so the outcome is recorded either way and the case stays latched until service.

Every one of those numbers is a named field with a documented default rather than a literal buried in a branch, which is what let the register of §11.6 name what each experiment must re-measure; **Appendix D.1** names eighteen of `MonitorParameters`' 25 settings. A nineteenth deserves an argument rather than a line in a list: the plausibility ceiling runs at **1.25** times design occupancy, and 25 % of headroom above design is a deliberately desensitising choice.

Appendix D.1 prices that choice rather than leaving it asserted. `MonitorParameters.withOccupancyCeiling` lets T-24 sweep the headroom against a control arm with nothing injected, and the sweep says what tightening the ceiling to 1.00 would buy and cost: one more closed-loop detection and some speed, paid for with 2 false alarms in 20 fault-free runs where the shipped 1.25 latches 0 of 20. The headroom is therefore not a free lever between R-1 and R-3, and below 1.00 it stops bounding occupancy at all. That control arm is also what makes the shipped setting's **15 of 20** closed-loop detections real detections rather than R-3's false alarms landing on a room that happened to have a fault in it.

The classifier is a short decision tree over four signals, with an explicit `UNCLASSIFIED` branch that alerts a human rather than acting:

Signal	Test	What it rules in or out
Common-mode count	How many of the six residuals are raised; 5 of 6 is the threshold	Many together ⇒ plant-wide, so a blocked filter; one alone ⇒ local
Plant fan power	Flat within 5 %, or raised beyond 10 % of the affinity-law prediction	Power up per unit of flow ⇒ blocked filter; flat ⇒ the fan is doing what it was told
Step amplitude	Against $2\sigma = 60$ ppm	Distinguishes a real response from noise; a drifting sensor still shows the right *shape*
Overnight floor	Within 100 ppm of the 420 ppm outdoor level over 24 h	A wrong floor with an empty building ⇒ sensor drift, since the room must decay to outdoor

The tree itself is four lines, evaluated in order, where *localised* means simply "not common mode":

```
common mode AND power up                                -> BLOCKED_FILTER
localised AND step shape unchanged AND floor wrong      -> SENSOR_DRIFT
localised AND power flat AND step shape NOT unchanged   -> STUCK_DAMPER
```

```
otherwise                                   -> UNCLASSIFIED
```

Two properties of this design are deliberate. First, `UNCLASSIFIED` is a *destination*, not an error path: it confirms the residual and declines to name a cause, producing a work order with an open question rather than a confident wrong answer. Second, the classifier gathers evidence **for and against all three hypotheses regardless of which one wins**, so the work order a technician reads carries the reasoning rather than the verdict, including, for instance, the measured plant power excess even when no signature matched. Localisation comes from *comparing rooms*, not from a fourth invented signal: that was an explicit instruction in the risk register, and Section 13.1 reports what following it cost, which turns out to be more than I expected.

What the tree actually emits, measured (T-15). The table above is what the tree is *for*; `ConfusionMatrixExperiment` measures what it does, over **218 runs** of the four injectable faults plus a no-fault arm. The headline is the least flattering result in this report and belongs in the body: **one of the four mechanisms is classified correctly**. Over seeds 42 and 1–10, `STUCK_DAMPER` is named correctly in 8 of 11 runs; `BLOCKED_FILTER` comes out `UNCLASSIFIED` 11 of 11, exactly as Section 4's cross-room analysis predicts, with its fan-power excess still attached so the work order points at the plant; `SENSOR_DRIFT` is **never emitted: 0 of 76 runs from a ramp and 0 of 76 from a step offset**, because its leaf wants an informative overnight floor *and* a step response that still matched in the same instant and the two injectable sensor mechanisms supply one each and never both; and the stuck-damper leaf fires *with no step on record*, because a probe is requested through the evidence on `FaultStateChanged`, so no step the monitor *asked for* has ever been judged when it classifies; whether an ordinary control command happened to arm a window by then is luck. That last one is deliberate rather than an oversight (requiring positive evidence of an unanswered step was tried and measured, and it left the tree classifying nothing at all), so every diagnosis reached without a judged step now says in its evidence that it rests on two signals rather than three and that a probe has been requested. Reordering the pipeline so the probe lands first was built and measured as T-35 and is **not adopted**: the third signal is blind after a confirmation rather than merely late (§13.6). **Appendix D.2** carries the matrix, the three off-diagonal mechanisms with the arithmetic that closes each, and T-35's 176 paired runs.

7.4 Compensation: the trim is the gain

This is the strongest technical result in the project, and it is a closed form rather than a search. The question is: a damper is frozen partly open, so that room is starved. The only levers are the other five dampers and one shared fan speed. Can the faulted room be given more air *without* taking any from the five healthy rooms?

Write $a_i = p_i A_i$ for each opening, f for the frozen room's opening, h for the sum of the healthy openings at the baseline and $A_0 = h + f$ for the total, then trim **every healthy damper by one common factor** $t \in (0, 1]$ and raise the fan from s_0 to s. **Appendix E.1** carries the four lines of algebra; two facts fall straight out of them and together they are the whole mechanism.

First: one fan speed holds every healthy room's flow at once. The healthy flow ratio contains no room index, because the trim is *common* and the split is *proportional*, so every healthy room's share of the total opening changes by the same factor and a single scalar $s = s_0\, A(t)/(t\, A_0)$ holds all five at their baseline simultaneously. There is nothing per-room to balance and no iteration, which is why the supervisor publishes one fan-speed command and five identical trims rather than solving a five-dimensional problem.

Second: at that speed the frozen room's flow is multiplied by exactly $1/t$. The trim *is* the gain. Trim the healthy dampers to a quarter and the starved room gets four times the air, with the other five rooms' airflow bit-for-bit unchanged.

Third, and the reason this is deployable: $Q_{\mathbf{nom}}$ and β cancel. Both appear in Q_i and in Q_i's baseline, so they vanish from both ratios. The supervisor therefore never needs to observe the filter blockage or know the plant's nominal flow to compensate correctly. It needs only the openings and the

baseline speed, which it already commands. A compensation scheme that required β would require diagnosing a second fault before answering the first.

Where it runs out. Two bounds on t, both physical rather than numerical, and one case no lever reaches at all. All three reported with R-2 rather than buried:

- **The dampers' floor.** No healthy damper may go below its own minimum, so $t \geq \max_i(\text{minimum}_i/p_i)$. With the healthy dampers modulating around 0.60 and the floor at 0.15 the trim bottoms out at 0.25, which caps the gain near fourfold; the solver's `MAXIMUM_REQUESTED_GAIN` is 4.0 for that reason and not as a tuning knob.
- **The fan's ceiling.** $s(t) > s_0$ always, so holding the healthy flows is paid for out of fan headroom, and s is capped at 1.0. The plant runs normally at $s_0 = 0.7$, which leaves 43 % more air to call on, and that is what makes the lever a lever. When the plant is *already* at full speed there is no headroom at all, and the solver neither abandons compensation nor quietly starves the healthy rooms: it trims only as far as `HEALTHY_FLOW_TOLERANCE` = 0.05 permits, so each healthy room gives up at most 5 % of its airflow, and it *reports the smaller gain it actually achieved*. That 5 % is kept on a measurement rather than assumed: the over-supply side was swept from 0.05 to unbounded and bought R-2 nothing (ADR-0009, §11.2). Flow is then redistributed rather than created, which is the honest description of a saturated fan.
- **A damper stuck fully shut is unreachable.** The gain multiplies an airflow of zero, so no trim and no fan speed touches it. The solver returns `CompensationPlan.none` saying so, and the supervisor raises a *critical* work order with occupancy advice rather than pretending. This is R-2's stated bound, and Section 13 concedes the uncomfortable part: ADR-0008 defines "stuck shut" *as* stuck at 0.15, so R-2's scenario is pinned at the one stuck-shut position that is reachable. The unreachable case is excluded by a parameter, not by physics.

The second lever, and why the trim alone was not enough. The derivation above assumes there is a trim to make, and in the regime R-2's drawn weekday covers there is not: the healthy rooms are below the inner loop's 800 ppm opening threshold when a plan is solved, so they are already on their 0.15 floor, the trim floor is $t = 1$, and the closed form returns the plant unchanged, a supervisory loop worth nothing and, at design occupancy, less than nothing (§11.2). The split law gives a second lever, because Q_i is linear in s, so raising the fan multiplies *every* room's flow including a frozen room's. But that lever is **not selective**: with no trim in force the frozen room's gain and the healthy rooms' over-supply are the same number, so ADR-0008's 43 % of headroom above $s_0 = 0.7$ is spendable selectively only *through* a trim, and without one the solver may spend it only as far as `HEALTHY_FLOW_TOLERANCE` = 0.05 permits. **Appendix E.2** derives the bound and prices the raise, which is not free: fan power goes as s^3, so 0.70 to 1.00 costs 2.92 times the fan power, and the work order states that multiple rather than implying it.

The measured instance. At the parameters of Section 6, with the five healthy dampers at 0.60, the fan at its normal 0.70 and A145's damper frozen at the 0.15 floor, A145 receives **59.69 l/s** against its 165.9 l/s design flow. The solver trims the healthy dampers to $t = 0.360$ ($0.60 \to 0.216$) and raises the fan to $s = 0.880$, which restores A145 to **165.9 l/s, its full design flow**, while the five healthy rooms' flows are unchanged **to within** 10^{-15}: eight decimal places and more.

Neither bound binds here, and that is the air handler's doing rather than the solver's. An earlier revision of this report read the same case off the *superseded* 0.42 m^3/s plant and found the trim bottoming out at its floor just as the fan reached its ceiling: an elegant coincidence, and a property it attributed to the topology. On the plant the repository now ships, 0.59 m^3/s, the two bounds are not close: the trim stops at 0.360 against a floor of **0.25** (the tightest healthy damper's 0.15/0.60), and the fan at 0.880 against a ceiling of **1.00**. What changed is not the closed form but the plant it is evaluated on. Re-sizing the air handler to cover its design condition at the speed it actually runs (Section 13.3) bought compensation margin that the earlier sizing did not have, and the coincidence was an artefact of being short of air rather than a property of the topology.

That margin is this case's and must not be read as the system's. This is the single-room

frozen-damper case with five healthy neighbours modulating at 0.60 and the rest of the building behaving. Section 11.2's measured multi-room runs at design occupancy are the regime where it runs out: there the healthy dampers are already near their own floors when a plan is solved, the fan reaches **1.00** on one of five seeds with every zone faulted and no damper left to trim, and the achieved gains run **1.05 to 1.77** against the 2.3 the comfort rule asks for. Headroom in the one-room case is not headroom in the regime R-2 fails in. Section 11.3 gives the per-room numbers; Section 10 names the test that pins them.

7.5 The data pipeline

Readings travel through one path that serves live control, diagnosis, the dashboard and the evaluation. `co2-sensor` publishes to **mosquitto**, which decouples one producer from four consumers and turns a dead publisher into silence rather than a blocked caller, silence being exactly what R-4 is written to detect. `dcv-controller`, `fault-monitor` and `supervisor` each append to **TimescaleDB**: commands, readings, residuals and decisions, strategies. The dashboard queries windows from the same store and subscribes to the broker for live state.

Data quality is judged at the edge that can see it, and there is more of it than the requirements ask for. `co2-sensor` stamps every reading `GOOD`, `STALE`, `MISSING` or `DUPLICATE`: a value identical to the last one is `DUPLICATE` until it has been unchanged past the staleness window, when it becomes `STALE`; a failed read publishes `MISSING` *carrying the last known value*, never a fabricated one, and nothing at all is published before the first successful read. The comparison is exact rather than tolerance-based, deliberately, because BuildSim round-trips values as fixed-decimal strings and a tolerance would classify slow genuine drift, a fault, as a duplicate. Downstream, the controller drops anything not `GOOD` and drops out-of-order redelivery, and the dashboard's projection accepts a reading only if it is strictly newer than the one it holds, so QoS-1 redelivery cannot rewrite history.


The honest gap is not in the mechanism but in the *specification*: no requirement says what `quality` must mean, what must happen to a duplicate, or how out-of-order arrivals must be handled, so the behaviour above is a reasonable invention rather than something a test can hold to an agreed criterion. That is Section 3.2's first gap.

What is retained: everything, for the length of a run, in the hot store only. There is no cold tier. The cold path the plan scheduled as Parquet (T-22) exists as CSV plus a one-command conversion instead: the harness writes nine tables totalling **430 797 bytes** into `evaluation/results/` and generates `export.sql` beside them, whose nine `COPY` statements convert every one of those tables to Parquet, one statement each. Parquet itself is not vendored, and the reason is measured rather than asserted: `parquet-hadoop` 1.15.2 with `hadoop-common` 3.4.1 closes over 98 jars and 64.8 MiB, and `duckdb_jdbc` 1.5.6.0 over 1 jar and 81.2 MiB, against roughly 150 kB of measurement data.

8. Behaviour

8.1 Key scenario (C4 dynamic diagram)

The dynamic view shows how the containers of Section 4.2 collaborate at runtime for the stuck-damper scenario, with numbered interactions. Steps 1–8 are the inner loop at about 1 s; steps 9–21 the outer loop at about 60 s. It exposes what the static diagrams cannot: that the monitor acts on a *command and its aftermath*, not on a reading, and that every action in the second half of the figure comes from the supervisor.

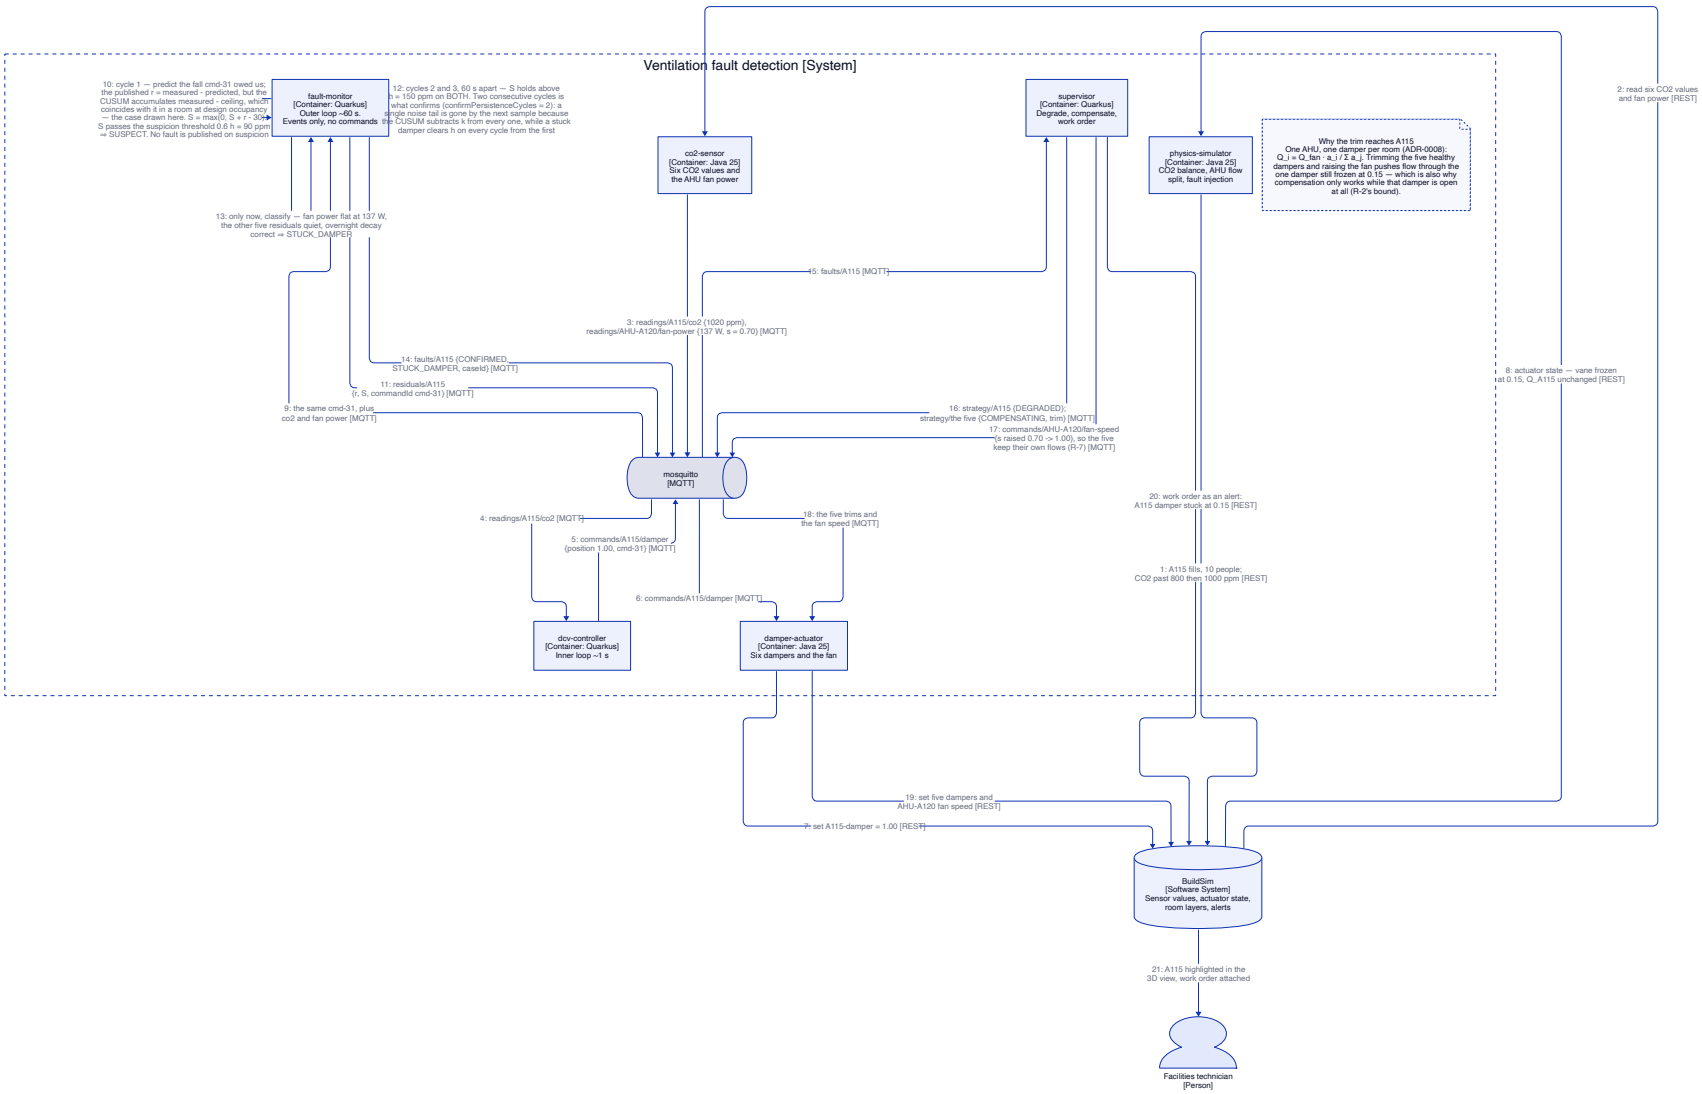


C4 Dynamic diagram, from `project/diagrams/dynamic.d2`*: a damper frozen at 0.15 in A115, the meeting room. Steps 1–8 are the inner loop, 9–21 the outer. The inset explains why trimming the five healthy dampers reaches A115 at all.*

8.2 The same scenario in time (sequence diagram)

The sequence view adds what the dynamic view leaves out: duration, and the three phases that follow confirmation. Its fourth group is the point of the project: after compensation the residual collapses to 20 ppm and the CUSUM to zero, and the case does *not* clear. The figure is **Appendix B.3**; the latch it draws is the trade §13.8 argues for.

8.3 Process lifecycle (state machine)


One instance per room. Every transition in this figure is code that had to be written, and two *absent* transitions are the design: there is no edge from `BLIND` into an open case, and no edge from `COMPENSATING` back to `HEALTHY`.

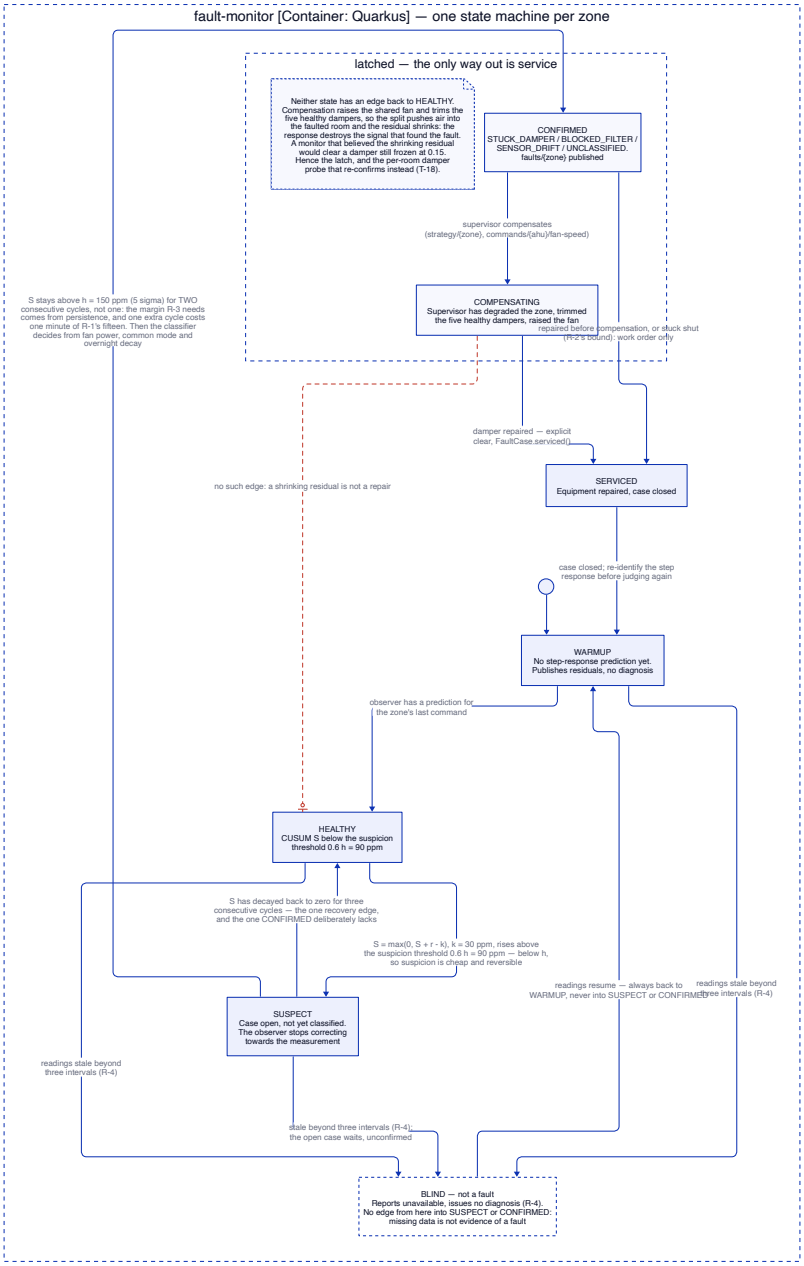

The monitor's state machine, from `project/diagrams/state.d2`*. The crossed-out edge is drawn deliberately: a shrinking residual is not a repair.*

9. Deployment and component placement

Everything runs on one laptop, so the deployment viewpoint here is about **how the system is composed from independent processes**, not about geography. Ten compose services share one Docker bridge network; five ports are published, all on the loopback interface only (BuildSim 9090, the dashboard 8080, the simulator 8081 for injecting and clearing a fault, and the broker 1883 and database 5432 for inspection). Images carry no compiler: `mvn package` builds the jars on the host and each image copies one over `eclipse-temurin:25-jre`, which keeps the images small and makes the build reproducible from one Maven reactor.

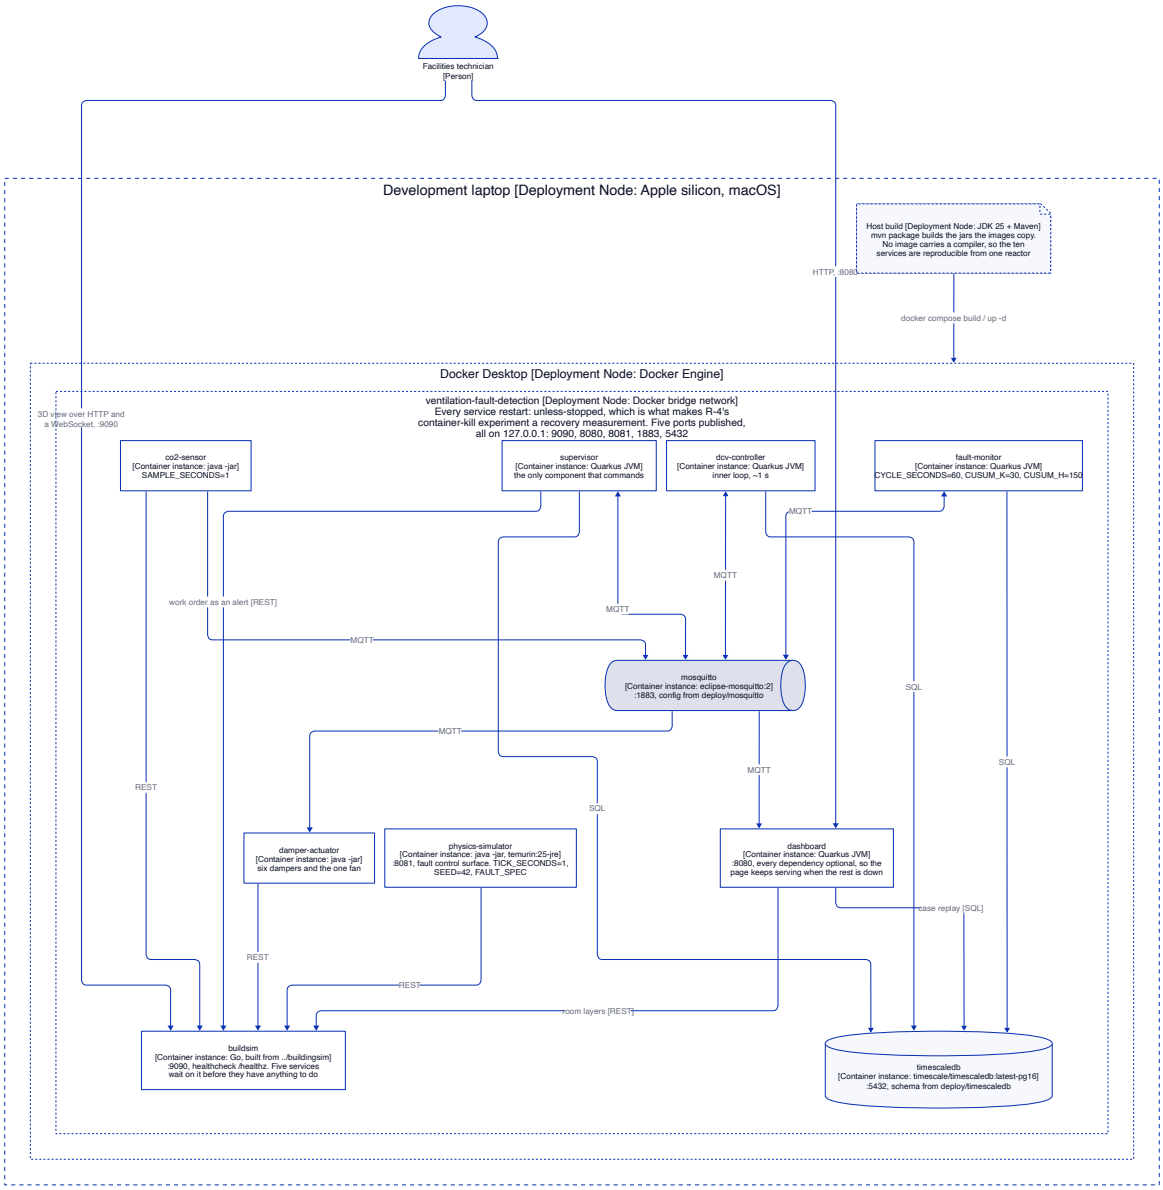

C4 Deployment diagram, from `project/diagrams/deployment.d2`*. C4's deployment vocabulary is used as C4 defines it:* deployment nodes *nest (laptop, then Docker Engine, then the bridge network), and each box inside the innermost node is one* container instance *of a container from Section 4.2, with the environment it is given. Grouping is therefore by what hosts what. An earlier revision grouped by the role each service plays, which is a readable picture but not a deployment view, and it reversed two edges by drawing reads as replies; the startup order is* `docker-compose.yml`*'s* `depends_on` *with health conditions.*

Startup order is part of the design, not an accident. `physics-simulator`, `co2-sensor`,

`damper-actuator`, `supervisor` and `dashboard` wait for BuildSim to pass its health check, because they have nothing to do before the building exists; `dcv-controller`, `fault-monitor` and `supervisor` wait for TimescaleDB to be ready. Every service carries `restart: unless-stopped`, which is what makes R-4's container-kill experiment a recovery measurement rather than a manual restart.

Restarting a process is not the same as restoring what it had concluded, and the gap used to be real. `restart: unless-stopped` brings a killed container back in about 3 s (§11.6), but a restarted `fault-monitor` came back with no latched diagnoses, a back door through the one exit the design reserves for a technician, and a restarted `supervisor` came back with no open cases, which was worse than forgetting them: it publishes the whole alert collection, so the next publish *erased* the operator's work orders. Both now keep a small JSON document on a bind-mounted volume of their own and read it once at boot (ADR-0012). The monitor keeps its latched cases with the evidence that argued them, the pinned damper belief that R-7's isolation depends on, and the believed fan speed; the supervisor keeps its open cases, the plant baseline its trim is computed against, and the probe limiter, so recovery cannot disturb a room inside the 15-minute guard. Work orders are stored nowhere and come back anyway, because they are a pure function of the state that *is* stored.

`dcv-controller` persists nothing, and that is the same kind of decision rather than an omission: its hysteresis re-derives from the next reading one second later, and because a cold start believes every damper is at its minimum, every recomputed demand is an opening instruction. The error can only over-ventilate. **Two bounds travel with this.** The write is atomic (a temporary file and a rename), and a document that is missing or unreadable means a cold start, so the store is never something a boot can fail on. And the state is *host-local*: a bind-mounted file follows the volume, not the service, so the day these containers are scheduled across machines this has to become a shared store, which is why it sits behind a port in `shared/control` rather than being called directly, and that port is the seam §4.6 would cut at.

One environment variable is shared by all seven project-authored services, and the reason is the same one that makes `REAL_EPOCH` and `TIME_SCALE` shared. `ZONE_COUNT` chooses the zone set, and every process has to agree on it: the sensor publishes per zone, the controller commands per zone, the monitor holds a model per zone, so one process on a different count computes residuals against a plant nobody else is simulating. It defaults to the six-room corridor and the stack has been run and watched at 12 and at 58. **58 is a hard ceiling and it belongs to BuildSim**, which refuses to host equipment in a room its floorplan does not have. Level 0 of the A building has 52 further rooms of comparable size, and `ZONE_COUNT=60` dies naming the room it cannot find. A zone past the sixth borrows a real room's *name and location* so BuildSim can carry its sensor and damper, while its volume, floor area, damper authority and occupancy schedule are a cycled copy of one of the six, so it is representative in size, time constant and head count and is not a claim about the room whose name it borrows.

What would be lost by merging components. Merging `fault-monitor` into `supervisor` would destroy the authority separation of Section 4.3 and is the one merge that would change the system's safety argument. Merging `dcv-controller` into either would mean a crash in diagnosis stops ventilation. Merging `co2-sensor` into `physics-simulator` would collapse the sensing seam: the simulator would then both produce and report values, and R-4, which detects a sensor that has gone silent, would have nothing left to kill. Merging the `dashboard` in would let a slow page render compete with a control cycle.

Edge and cloud. In a real building the whole control path (sensors, broker, store, controller, monitor, supervisor, actuators) belongs on a local *edge* server, because ventilation must keep working when the internet does not, and because the 60 s supervisory cycle is a latency budget a round trip would eat into. Only two things would belong off-box: a learned contender, if one were ever kept, would be *trained* off the critical path and only its coefficients shipped down; and the seven-day replay analysis is batch work that nothing waits on. The design keeps that line drawn even though everything currently runs in one place.

10. Test plan

10.1 How the system is verified

Three levels, and the traceability rule that every test names the requirement ID it verifies. Unit tests live beside the code and cover the **control** and **entity** layers, which is where the business logic is: the value objects and the monitor state machine in `shared/`, the mass balance, the flow split and fault injection in `physics-simulator/`, the hysteresis loop in `dcv-controller/`, the CUSUM and the classifier in `fault-monitor/`, the compensation solver in `supervisor/`, the view projection in `dashboard/`. Because the clock is a port, the **offline harness** in `evaluation/` drives the same control and diagnosis classes the containers run against a simulated clock, so a seven-day replay and twenty injection runs cost seconds rather than days. End-to-end and fault-injection runs go through the real compose stack.

ID	Test or experiment	Requirement	Has it run, and what came out
T-24	Detection delay swept against the CUSUM limit h, ≥ 20 runs per point	R-1	**Run**, 200 runs over six arms: stepped p95 6 min, 20/20; closed-loop p95 257 min, 15/20
T-25	Model-based monitor against a plain residual threshold, identical seeds, 7-day fault-free replay	R-1, R-3	**Run**: at equal alarm volume the monitor detects 0.75 against the threshold's 0.15 at a median delay of 74 min against 312; R-3 **fails** at 0.55 confirmed cases per fault-free week, worst week 6
T-15	Confusion matrix over the four injected faults on a fixed seed, plus a no-fault arm	R-1, R-3	**Run**, 218 runs: `STUCK_DAMPER` named correctly, `BLOCKED_FILTER` → `UNCLASSIFIED` 11/11, `SENSOR_DRIFT` **never emitted**; **one of four mechanisms classified**
T-26	Comfort during a latched fault, with and without compensation	R-2	**Run**: 5 of 5 seeds on the drawn weekday, **0 of 5 at design occupancy**, no-fault reference 5 of 5 throughout
T-27	Kill each container in turn	R-4	**Run** in-JVM, 23 of 23 assertions: `BLIND` in 4 cycles, 0 fault events, 0 commands on stale data; container kills **now also run** against `docker compose`, five of six rooms `BLIND` in 12 s
T-20	Rebuild a random diagnosis from the journal	R-5	**Demonstrated live** in the recorded demo run: HTTP 200, 77 248 bytes, **445 events**; the id was the one that run produced rather than a drawn one. **And now tested** by eight integration tests on the real SQL
T-28	Scale zones per monitor to the breaking point	R-6	**Run**: 25 600 zones at a p95 of about 6 s measured, $\approx$ 86 000 **extrapolated**, `AhuFlowModel.believedFlowTo` named
T-34b	Room isolation: one injected fault per run, rotating the injected room over ≥ 3 rooms	R-7	**Run**, both occupancy regimes, 540 observed rooms. Drawn weekday **0 of 270 failed**; design occupancy **231 of 270 failed**
T-29	Optional learned one-class contender against the CUSUM on identical seeds	R-1, R-3	**Run**: **dropped**. To match the monitor's 0.75 detection it costs about 20× the false alarms (11.25 against 0.55 per week) and 7× the delay (518 against 74 min)
T-35	Classify after a probe has been judged, or at confirmation? 176 paired runs on identical seeds	R-1	**Run**: **not adopted**. Detection moves in 0 of 88 pairs and the settled classification is identical in all 88, because the judged step reads `MISSING` for every condition
T-36	One observation published on the real broker, consumed by the running `fault-monitor` and asserted in the real journal	R-5	**Run**, 2 tests against the deployed stack: the row carries the published wattage, the publisher's instant and the monitor's own provenance; a reading for a room outside the zone set journals nothing. **Skips** with the reason when the stack is down

ID	Test or experiment	Requirement	Has it run, and what came out
T-37	A latched diagnosis survives a `SIGKILL` and restart of its container	—	**Run live on the demo profile**, transcript in `evaluation/results/T-37-restart-recovery.txt`. A115 confirmed `STUCK_DAMPER`; `docker kill` and restart; the case id and `confirmedAt` are *identical* across the kill while `updatedAt` keeps advancing. A cold start would have minted both afresh. The damper pin and the believed fan speed come back with it

Appendix K carries the same eleven rows with the expected result each was written against and the evidence in full; §11.2 and Appendix F report the experiments themselves.

Four named unit tests are worth quoting, because they are what the strongest claims in this report actually rest on. Test names describe the behaviour and carry the requirement ID, so the traceability runs all the way into the suite:

```
shouldHoldEveryHealthyFlowExactlyWhileTheFanHasHeadroom_R7    zero healthy deviation,
                                                              gain exactly 1/t
shouldRestoreTheFrozenRoomToItsDesignFlowAtTheNormalFanSpeed_R2   59.7 -> 165.9 l/s
shouldSpendExactlyTheStatedToleranceWhenTheFanIsAlreadyAtNominal_R7   the saturated fan
shouldRefuseToCompensateADamperWithNoAirPath_R2Bound          no command at all
```

10.2 The state of the suite, stated plainly

A full `mvn -o clean test` run on 2026-10-11 reports **BUILD SUCCESS over all nine reactor modules: 621 tests, 0 failures, 0 errors**. **The skip count is not a fixed property of the suite, and no skip is a gap**: eleven tests assume something outside the JVM is reachable, the eight journal tests that execute R-5's real SQL against a PostgreSQL (T-20), the two pipeline tests that need the broker and a running `fault-monitor` as well (T-36), and the one reconnect test that needs the broker, so they skip when nothing is up and run when the stack is. The run above was taken with the stack up, which is why it reports **0 skipped** rather than eleven. Starting anything is deliberately not the default, so the suite stays runnable in seconds with nothing installed.

What was the single largest gap in this project is closed: `evaluation/` holds its own sources (a `Main` and **ten** experiments), and a full run on OpenJDK 25.0.3 completes in **350 s** of wall clock, writing the nine result tables §11.2 reports from. That run is also the evidence for §13.9's determinism claim, and it is worth stating as a result: re-running the harness against the committed result files leaves **eight of the nine byte-identical**. The ninth is T-28, and it does not reproduce because it is the one experiment that measures *wall clock* rather than simulated behaviour, so the exception is the experiment where bit-for-bit reproduction would mean the measurement was not being taken. **Appendix K** gives the per-module test counts, the per-experiment timings and both results in full.

11. Evaluation and results

What follows is divided strictly into **what has been measured**, **what has been proved**, and **what is pending**. The division is the point: an examiner should be able to tell at a glance which claims are evidence and which are intent.


11.1 Measured: the week-37 separation spike

The kill criterion of the whole project was whether a residual separates a stuck damper from a busy room at realistic sensor noise at all. The spike (`project/spikes/residual-separation/`, plain Java 25, no dependencies, seeded and reproducible bit for bit) simulated one 210 m^3 room over 180 min, sampled at 60 s, with occupancy stepping $0 \rightarrow 10$ people at $t = 10$ min and a damper command 20 % $\rightarrow$ 80 % at $t = 40$ min, at $\sigma = 30$ ppm.

Run (seed 42)	**mean r**	**std r**	**mean r after the command**	**max CUSUM**	**crossing of h**
healthy	3.5 ppm	31.8 ppm	5.3 ppm	50.3 ppm	none
stuck	392.1 ppm	297.6 ppm	507.8 ppm	66 996 ppm	$t = 47$ min, 7 min after the ignored command

The post-command mean residuals are **16.7** σ apart. Over seeds 1–20: **20 of 20** stuck runs crossed h, with delay min/median/max **5 / 8 / 11 min** against R-1's 15 min budget, and **0 of 20** healthy runs crossed it. The healthy residual's standard deviation, 31.8 ppm, confirms that the injected noise is what reaches the residual and nothing else does.

The threshold sweep below is the R-1-against-R-3 trade-off, measured on those same 20 seeds (the CUSUM statistic depends on k only, so h can be evaluated after the fact):

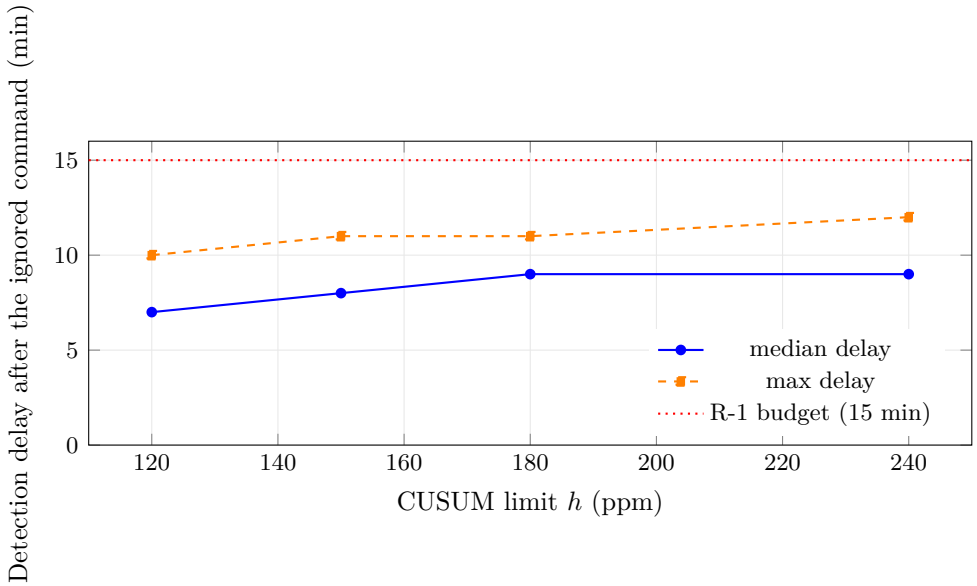

Measured, from the spike's 20 seeds. Raising h from 5σ (150 ppm) to 8σ (240 ppm) costs about one minute of delay; lowering it to 4σ (120 ppm) already produced ***1 false alarm in 20*** *three-hour healthy runs, while 5σ, 6σ and 8σ produced none. 150 ppm was derived from R-3 through Siegmund's approximation (§7.3); this check set* confirms *that choice rather than making it, and is the smallest swept limit with no false alarm in it.*

Two caveats bound every number above, and the spike's own result file states both. The observer used *true occupancy*, so the healthy residual was pure sensor noise with no model error, which makes 0 of 20 an optimistic bound. And the worst healthy seed peaked at **149.1 ppm against** $h =$ **150 ppm** (a 0.9 ppm margin, with the next-highest seed at 91.6 ppm), so the clean check set is a tail draw rather than a design property. R-3 asks the same statistic to hold over seven days and six rooms, which is far more samples, and **the margin did not survive that horizon**: §11.2 measures **0.55** confirmed cases per fault-free week with a **worst week of 6** against R-3's limit of one. The tuning is therefore no longer merely reported: it is measured, and it fails. **Appendix F.1** gives both caveats in full, with ADR-0010's attribution of why the margin was so thin; it was not the limit, which is why k and h are left where the spike put them rather than retuned (§13.4).

11.2 Measured: the evaluation harness, R-1 to R-7

The harness in `project/evaluation/` drives the same control and diagnosis classes the containers run (`BuildingSimulation`, `DcvControlLoop`, `FaultMonitor`, `SupervisionService`) in one JVM against a simulated clock, with events handed between them directly instead of through the broker and the journal replaced by a counter. One full run on OpenJDK 25.0.3, Mac OS X on aarch64, takes 350 s of wall clock over ten experiments and writes nine result tables. Every number in this subsection is read

off that run, which was taken after all of this session's changes had merged. So no figure here comes from a run of a subset of the code.

Req.	Run	Measured	Verdict
R-1	T-24	Stepped protocol, 20 seeds, $h = 150$ ppm: 20/20 detected at 4 / 6 / 6 / 7 min (min / median / p95 / max) against a 15 min budget, and p95 between 5 and 8 min over $h = 50 \ldots 300$ ppm. Closed loop on a drawn weekday at the same h: 15/20 detected, 21 / 74 / 257 / 257 min	**Met as specified; not met in closed loop**
R-2	T-26	Fraction of occupied minutes at or below 1000 ppm after onset, 5 seeds. Drawn weekday 1.000, 5 of 5 seeds, unchanged with the lower CUSUM arm off and with no damper feedback. Every room at design occupancy: 0.022 supervised against 0.009 unsupervised (**0 of 5 seeds**), while the no-fault reference is 1.000 and 5 of 5 in every case	**Met on the case it covers; not met at design occupancy**
R-3	T-25	Distinct confirmed cases per fault-free week over 20 simulated weeks of all six rooms: **0.55 per week** against a limit of 1, **16 of 20 weeks clean**, worst week 6 (1.30 per week with 9 clean weeks before ADR-0010). The scored criterion is the worst week	**Not met**
R-4	T-27	Each component killed in turn in one JVM, **23 of 23 assertions**: every observable room `BLIND` within 4 cycles, 0 fault events while blind, 0 damper commands on stale data, `HEALTHY` 3 cycles after readings return. **The container-level run has since been done**: five of six rooms `BLIND` within 12 s against `docker compose`, three-cycle recovery, restart policy firing on an in-container `SIGTERM`	**Met in-JVM and at container level**
R-6	T-28	25 600 zones at a p95 of about 6 s (5.68–6.05 s over five runs), inside the 60 s interval; fitted over the nine points from 100 zones up, p95 $= 1.196 \times 10^{-8}\, n^{1.97}$ s with $r^2 = 0.9991$; the crossing of 60 s extrapolated at $\approx$ 86 000 zones; saturated element `AhuFlowModel.believedFlowTo`, $\Theta(n^2)$ per cycle. **The deployed ceiling is a different and far smaller number**: 58 zones, bounded by BuildSim's floorplan rather than by the monitor	**Met in the harness**, and the two ceilings are never quoted as one
R-7	T-34b	Injected room rotated over all six rooms, 3 seeds, 3 configurations, in *two occupancy regimes*, 540 observed rooms. Drawn weekday, 270 rooms: **0 failed**, airflow inside the 5 % tolerance everywhere. Design occupancy, 270 rooms: **231 failed** (215 accused of a fault they did not have, 16 more outside the airflow band at a worst 0.058919, the two sets disjoint); 40 rooms reached `COMPENSATING` and **130 of the 215 falsely latched rooms reached `DEGRADED`**. The supervisor does not merely accuse those rooms, it takes their dampers off the inner loop	**Met on the drawn weekday; not met at design occupancy**

Six of the seven requirements are scored in that table; **R-5's evidence is a live rebuild rather than a harness experiment**, reported with the journal in §5 and in Appendix G.


Two readings of the table matter more than any single row. The first is that **every failing verdict above is a regime statement, not a global one**: R-1 is met on the stepped protocol its own verification column names and fails in closed loop; R-2 is met on the drawn weekday and fails with every room at design occupancy; R-7 is met on 270 drawn-weekday observed rooms and fails on 231 of 270 at design occupancy. Quoting either arm without the other misrepresents the result, so this report never does. The second is that **R-3 is not one failing requirement among four; it is the one whose failure the other three inherit.** R-2's design-occupancy seeds fail partly because false alarms have already latched rooms that would otherwise have been healthy dampers to trim (R-3's false alarms consume the lever R-2 depends on), and the larger half of R-7's failure is 215 observed rooms accused of a fault they did not have, which is R-3's rate arriving inside another requirement's experiment in a regime R-3's own replay never visits.

Appendix F.3 carries the working behind every verdict: what separates protocol from occupancy

in R-1's two arms, the stratification of T-24's 20 drawn weekdays, T-25's baseline contest and T-29's learned contender with the operating point attached to each ratio, R-2's five seeds and the lever each plan ran out of, R-3's 26 pre-fix confirmations classified by arm and cause with the half of the fix that was declined on evidence, R-6's fit and its two ceilings, and R-7's two disjoint failing clauses with the supervisor-dead pass that separates them.

11.3 Proved: compensation holds the healthy rooms exactly

This result is analytic and pinned by unit tests, not produced by an experiment, and it is presented as such. The per-room flows below follow from Section 7.4's closed form at Section 6's parameters: five healthy dampers at 0.60, A145's frozen at 0.15, baseline fan 0.70, trim $t = 0.360$, fan raised to $s = 0.880$.

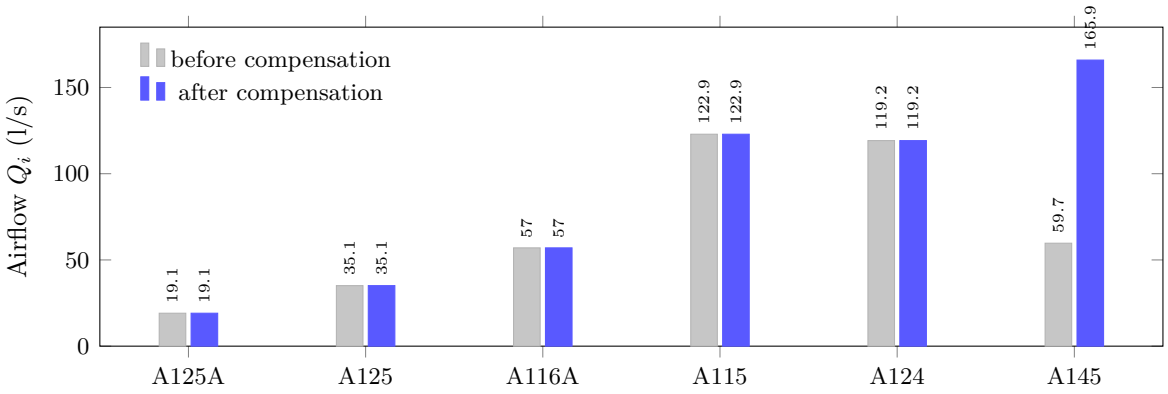

Computed from the solver's closed form, and asserted by `CompensationSolverTest`*. A145, frozen at its 0.15 damper floor, goes from 59.7 l/s to 165.9 l/s (its full design flow, a gain of 2.78), while the five healthy rooms' flows are unchanged to within* 10^{-15}*. This is arithmetic that closes exactly, not a measurement; the closed-loop* CO_2 *that is R-2's actual criterion is measured separately, and §11.2 reports where it holds and where it does not.*

Case	Trim t	Gain achieved	Healthy flow deviation
Requested gain 2.0, fan at 0.70	0.500	exactly 2.000	**0**, fan raised to 0.8012
Restore A145 to design flow, fan at 0.70	0.360	2.779	**0**, fan raised to 0.880
Requested gain 4.0, fan *already* at 1.00	0.733	**1.296 only**	exactly 5 %, the stated tolerance; the fan has nothing left to raise
Damper stuck fully shut	no trim	**none**	no command issued; critical work order instead

The third row is the honest one and the most useful: with the fan already saturated (peak occupancy, or a blocked filter the inner loop has already answered with speed), compensation delivers a gain of **1.296, not 4**, and buys even that by taking exactly 5 % from each healthy room. Flow is redistributed, not created. Reporting R-2 without that bound, and without the stuck-shut bound, would misrepresent it: the claim this design supports is not "the system keeps faulted rooms breathable" but "it does so while the damper still passes 15 % of its design opening and the fan has headroom".

11.4 Proved: architectural properties

These are properties of code rather than of physics, and a simulator is the right instrument for them. Each is covered by unit tests in the control and entity layers: that `fault-monitor` never writes an actuator topic; that an aggregate cannot be constructed in an illegal state (a `FanSpeed` outside $[0.2, 1.0]$, a damper position outside $[0, 1]$); that a latched `FaultCase` leaves `CONFIRMED/COMPENSATING` only through `serviced()`; that `BLIND` has no edge into an open case; and that a zone in `DEGRADED` mode receives no normal control command.

11.5 Not measured: what the numbers above do not say

The detector is evaluated against its own generator. `physics-simulator` freezes a damper, scales flow by $(1 - \beta)$ or adds a sensor offset, and `fault-monitor` looks for exactly those three things using the same mass balance and the same flow split. **Every detection result is therefore a measurement of self-consistency between two pieces of one person's arithmetic.** The p95 delay (R-1), the false-alarm rate (R-3) and the comfort percentile (R-2) are conditional on the generator: they describe how this detector behaves against this fault definition, and say nothing about a real air handler. Section 13.2 develops this.

A second, sharper limit on what can be claimed, and T-15 has since made it sharper still: of the faults the project set out to name, **one is classified and the others can only be pointed at**. `STUCK_DAMPER` is the reliable one, and T-24, T-25, T-26 and T-34b are all measurements of it. `BLOCKED_FILTER`'s branch is **unreachable with this physics** for structural reasons §13.1 sets out: it confirms as `UNCLASSIFIED` with its plant power excess reported, which is the right behaviour for a case the system cannot prove. And `SENSOR_DRIFT` is **never emitted at all** (0 of 76 runs from a drift ramp and 0 of 76 from a step offset), so the room is named a stuck damper instead: a confident, specific, wrong work order rather than an honest `UNCLASSIFIED`. **Appendix D.3** records why that is a property of the classifier rather than of the generator, an attribution this report had the wrong way round until the experiment was run.

11.6 Every pending measurement, in one place

Every row of that register is now filled, and no row is filled with an estimate. What was a fourteen-row table of pending measurements is seven rows of experiments that have all run: T-24's occupancy stratification, T-20's live case rebuild, T-27's container kills, T-15's confusion matrix over 218 runs, T-29's optional learned contender (**measured and dropped**), T-23's dashboard frames, and T-35's reordering of the diagnosis (**measured and not adopted**). Each row keeps the bound on what its evidence actually is.

The table being full is not the same as every requirement passing: R-1 and R-3 still fail on the arms §11.2 names, R-2 and R-7 fail on the harder of their two occupancy regimes, and one of four injected mechanisms is classified. **Appendix G** is the register row by row, with one result the obvious experiment measures wrongly: a `docker kill` cannot tell a working restart policy from a missing one, because the daemon records it as a manual stop.

11.7 Measured: what the compensation costs in energy

This is the last measurement folded in, which is why it sits after the register rather than among its siblings. It needed no new experiment: both halves are columns of `evaluation/results/T-26-comfort.csv`, the same five-seed run §11.2 scores R-2 from, read together for the first time.

Fan power follows the affinity law, $P \propto s^3$ (§6, Appendix E), so the second lever is priced superlinearly while the airflow it buys is not. The question that makes it a sustainability result rather than an arithmetic one is what the system actually spent, per regime, against what the spending bought.

Regime	Comfort, no supervisor	Comfort, supervisor	Mean plan fan speed	Fan power vs normal
Drawn weekday	1.0000	1.0000	**0.7000** (3 of 5 seeds)	×**1.00**
Design occupancy	0.0094	0.0217	0.8171 (max 1.0000)	×**1.59** (max ×2.92)

The result is the shape of those two rows, not either number on its own. On the drawn weekday, where R-2 is met, only **three of the five seeds** reach a plan at all, and all three come back `trim 1.00, fan 0.7000, gain 1.00`: a trim *factor* of 1.00 is no trim, and the gain it covers is a *requested* gain of 1.00. *Neither lever is spent*, because the room read under the 900 ppm target the

plan aims at. At design occupancy it costs on average **1.59 times the fan power**, and up to 2.92 times where no healthy room is left to over-supply, to move occupied comfort minutes from 0.0094 to 0.0217: a gain of **0.0123 against an acceptance criterion of 0.95**.

So the energy is spent almost exactly where it does least good, and that is a property of the *plant*, not of the control law. The ceiling is the damper floor and the fan curve: when every room is generating CO_2 at design rate, there is no healthy room with spare airflow to trim, the solver falls back on the one lever that remains, and that lever is the cubed one. **Buying 1.2 % of comfort minutes for 59 % more fan energy is not a trade worth making**, and the honest conclusion is that at design occupancy the supervisor should *decline* to compensate and say so in the work order, which is what the stuck-shut case already does, where the plan reports "no air path" and the narrative turns to occupancy advice (§7.4, Appendix E) rather than spending the fan on a room it cannot reach.

That change is not made here. It would alter R-2's measured arm two days before this document was frozen, and a requirement that fails for a mechanism this report can name is better evidence than one that passes because the experiment was changed after the result was known. It is recorded in §13 as the first thing to do next, with the number that justifies it.

12. Dashboard

The operator view has two halves, deliberately.

On BuildSim's own viewer, `dashboard` repaints all four layers every 5 s, and a query parameter switches which one the rooms are coloured by. The viewer offers a 3D mode and a floor plan; **every capture in this report is the plan**, deliberately. It shows all six rooms and which one has gone red in a single frame, where a perspective render hides whichever rooms are behind the near wall. The layer being painted is the same either way: the colouring is `dashboard`'s, pushed through BuildSim's room-layer API, and the view toggle is the operator's.


Layer	Range	Why that range	What it shows the operator
`co2`	420–1500 ppm	Outdoor level to half again the comfort limit	The air, which is what occupants feel
`residual`	−100 to +500 ppm	The spike measured healthy residuals spanning −76.5 to +80.3 ppm and a stuck damper's post-command mean at 507.8 ppm, so the scale is set by measurement rather than by taste	How far the room is from what its command owed
`cusum`	0–300 ppm	Twice h, so the limit sits at mid-scale	How close the room is to confirmation
`state`	0–3	latched 3, stale or `BLIND` 2, `SUSPECT` 1, else 0	The equipment, which is not the same thing as the air

The `state` layer is the interesting one and it exists for one reason: **it keeps a latched room hot after compensation has pulled its residual back to zero.** On the `co2` and `residual` layers a compensated room looks healthy (which is true of the air and false of the equipment), and the severity ordering is chosen precisely so that the latched room stays the hottest thing on the floor. The same concern shapes the projection behind the view: only an explicit fault-state event moves a room's monitor state, so the arrival of small residuals, which is exactly what successful compensation produces, cannot talk the display out of a diagnosis the monitor latched.

A stale measurement is painted at the layer minimum rather than frozen at its last value, because BuildSim's layer API carries numbers and a range with no no-data sentinel; `state` is exempt because it is not a measurement. And `dashboard` **never writes a BuildSim alert**: alerts are a whole-collection PUT, so a second writer would erase the supervisor's work orders rather than add to them. One writer per resource, for the same reason one component commands.

Beside it, a server-rendered HTML table at port 8080 (no JavaScript, no framework, no CDN, just a meta refresh every 5 s) with `GET /api/state` serving the same view as JSON and `GET /api/cases/{caseId}` replaying one diagnosis out of the journal, which is R-5's interface and not a convenience. The replay is encoded with the same codec that published the events, so a replay cannot disagree with what went over the wire, and its failure modes are distinguished rather than collapsed: 400 for a blank id, 404 for an unknown case, and 503 with *different detail text* depending on whether the journal is unconfigured or configured but unreachable.

Every dependency of this page is optional, and that is a deliberate inversion of the usual dependency direction for a dashboard: it keeps serving when the broker, BuildSim or the database is down, retrying each on its 5 s tick, which makes it the instrument for telling whether the rest of the system is alive. Its health probe is never reported DOWN for the same reason: a dashboard that failed readiness because no readings were arriving would be restarted by the orchestrator at precisely the moment an operator needed to look at it. The price is a little duplicated state-handling and a page that can show a confidently empty table.

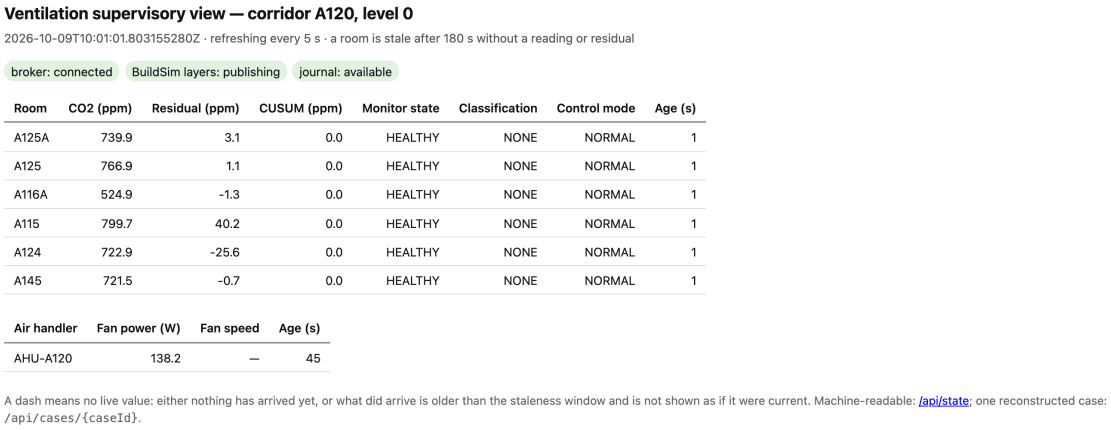

Ventilation supervisory view — corridor A120, level 0

2026-10-09T10:01:01.803155280Z · refreshing every 5 s · a room is stale after 180 s without a reading or residual

broker: connected | BuildSim layers: publishing | journal: available

Room	CO2 (ppm)	Residual (ppm)	CUSUM (ppm)	Monitor state	Classification	Control mode	Age (s)
A125A	739.9	3.1	0.0	HEALTHY	NONE	NORMAL	1
A125	766.9	1.1	0.0	HEALTHY	NONE	NORMAL	1
A116A	524.9	-1.3	0.0	HEALTHY	NONE	NORMAL	1
A115	799.7	40.2	0.0	HEALTHY	NONE	NORMAL	1
A124	722.9	-25.6	0.0	HEALTHY	NONE	NORMAL	1
A145	721.5	-0.7	0.0	HEALTHY	NONE	NORMAL	1

Air handler	Fan power (W)	Fan speed	Age (s)
AHU-A120	138.2	—	45

A dash means no live value: either nothing has arrived yet, or what did arrive is older than the staleness window and is not shown as if it were current. Machine-readable: /api/state; one reconstructed case: /api/cases/{caseId}.

Simulated 10:01:01, 46 simulated minutes after the damper jammed. A115 has climbed to 799.7 ppm and its residual is ***+40.2 ppm****, while its CUSUM is still* ***exactly 0.0*** *and every room reads* `HEALTHY`*. This is the frame worth defending against "your detector is only a threshold": a threshold placed anywhere below 40 ppm would have fired here. The CUSUM has not accumulated because it is not driven by this column:* `ZoneMonitor` *advances it on the* occupancy-plausible *residual, measured minus the prediction's* ceiling*, so the table's residual and the detector's input are two different series (§11, ADR-0010). The fan speed shows an em-dash because no live value had arrived yet, which is the no-stale-number rule in Section 12 acting rather than a gap.*

Three further frames are in **Appendix H.1**: the same table with A115 `CONFIRMED` at simulated 10:23:27, with the other five rooms `HEALTHY` at CUSUM 0.0, R-7's isolation visible in one frame; BuildSim's own floor plan beside the work order the *supervisor* PUT, naming the diagnosis, the action taken and the bound the plan ran into; and corridor A120 painted by all four layers at one instant with A115 latched and `COMPENSATING`. That last figure is this section's argument measured rather than asserted: compensation has done its job, so on `co2` the broken room is the second coolest on the floor and on `cusum` it is indistinguishable from five healthy rooms, and only `state` still says the equipment is broken.

What the figures do *not* settle is what the view *must* show: no requirement states it, so these are evidence that the operator path works end to end, not evidence against a criterion.

12.1 Two defects the capture found, and one limit it exposed

Capturing those frames found two defects and exposed one limit, and **Appendix H.2** reports all three in full. **The layers were overwriting each other**: `/api/room-layers` is a collection endpoint whose PUT replaces the whole collection, and the dashboard was publishing its four layers one at a

time, so each call erased the one before it and only the last layer of the enum ever reached BuildSim, with every individual PUT returning 200, so nothing anywhere said so. The fix sends every layer on every call, and the run above confirms it against the real stack: `GET /api/room-layers` returns **four layers of six zones each**. **A compensated room is painted exactly like a dead sensor**, because −100 is both the bottom of the `residual` scale and the only no-data encoding BuildSim's layer API offers; that is recorded as a limit rather than patched, for a reason the appendix gives. And **`SUSPECT` cannot be photographed**: a 1 Hz poll of `/api/state` caught A115 in it in **2 of 295 usable samples** against a page that refreshes every 5 s, so that state is evidenced from the `decisions` journal and from the poller instead, and the screenshots are taken only at states that latch.

13. Risks and critical reflection

This section is the honest account, and it is deliberately the least flattering part of the document. Several of the findings below are not disclosures but *functional holes* (things that do not work, rather than things that are merely unvalidated), and they are stated first because they are the ones worth the most to find.

13.1 Four functional holes, two of which are now closed

Four holes, each with its verdict; **Appendix I.1** carries the mechanism behind every one.

1. A damper stuck *wide open* is invisible at the deployed setting. The statistic is two-sided, and the deployed *guarded* lower arm catches the low-side fault with a safety consequence: a sensor drifting downward, which under-ventilates an occupied room and betrays itself by reading below the 420 ppm outdoor level. It cannot catch a damper stuck open, because "everybody left the room" explains a room that stopped getting stuffier at least as well and nothing inside a ten-minute judging window separates them. The unguarded arm sees both and costs more false confirmations than R-3 allows. **An observer with no occupancy signal cannot have both, and the choice was made in R-3's favour.**

2. `serviced()` had no transport, and now it has one. Closed. The only exit from a latched case was unreachable in deployment, so a false latch was **permanent**. `ServiceReported` now travels on `service/{zone}` validated against the open case, and the dashboard exposes `POST /api/zones/{zone}/cases/{caseId}/serviced`. The whole `CONFIRMED` → `COMPENSATING` → `SERVICED` → `WARMUP` → `HEALTHY` lifecycle is tested end to end. This matters most to §13.8, whose argument is that a false positive costs one technician visit, an argument that was being made against a system where it cost that visit *and* a permanently wrong work order.

3. The ambiguous fault is absent from the model, so the classifier's hardest discrimination is never tested. The ambiguity a real building would produce (a partial obstruction in one duct branch, reading as both a partly stuck damper and a partly blocked filter) **is not in the fault model at all**, and the enumeration cannot express it, so a clean confusion matrix would have been weak evidence rather than strong.

4. And worse than untested: the `BLOCKED_FILTER` branch is unreachable with this physics. This is the finding I least expected and would lead with in the oral; a unit test pins the outcome as `UNCLASSIFIED` so it cannot rot. Two structural reasons, neither a bug to patch: the proportional split only redistributes a fixed total, so no command the observer judges moves all six residuals the same way; and the quasi-steady generation estimate absorbs the blockage exactly. True flow low by $(1 - \beta)$, believed flow high by the same factor, so only the time constant differs. The work order still carries the measured plant power excess, which is right for a case the system cannot prove and is not a working three-way classifier. **Of the mechanisms this project set out to name, exactly one is classified: `STUCK_DAMPER`.** `BLOCKED_FILTER` can be pointed at but never confirmed, and `SENSOR_DRIFT` is never emitted at all, 0 of 76 runs from a drift ramp and 0 of 76 from a step offset (§7.3, §11.5).

13.2 The detector is evaluated against its own generator

The simulator produces exactly the faults the monitor looks for, using the same mass balance and the same flow split. That invalidates the **detection-performance numbers as transferable quantities** (R-1's delay, R-3's false-alarm rate and R-2's comfort percentile are conditional on my own fault definition) and does *not* invalidate the **architectural claims**, which are properties of code: that the monitor never commands, that a latched case has one exit, that stale readings give `BLIND` with zero fault events, that a confirmed fault changes strategy without stopping ventilation. A simulator is the right instrument for those, as it is for R-5 and R-6. Closing the gap needs measured fault data from a real air handler with service records, or at minimum a second fault model written independently of the detector. Neither was in scope, and the gap is no smaller for that.

13.3 Every physical parameter is invented

The full list, so it can be judged rather than taken on trust: the 3 m ceiling, from which every volume is `area` × 3.0; the opening law $a_i = p_i A_i$ with authority proportional to design flow, and the proportional split; $Q_{\text{nom}} = 0.59$ m^3/s; $P_{\text{nom}} = 400$ W from an assumed 400 Pa at 0.6 efficiency; `minimumDamperPosition` = 0.15; the **affinity exponent 3**, asserted rather than derived; β, which has no design value at all and is only a fault-injection magnitude; drift as an uncapped linear ppm/hour ramp; and the whole occupancy schedule.

Which of them matter, and how, is the useful part. **First-order on R-1**: ceiling height, because every time constant is V/Q and V is linear in it, so a 2.7 m ceiling makes all six rooms 10 % faster; the design-flow rule, because the observer recovers design occupancy from the authority and drives suspicion against that ceiling; and the schedule, because a room empty most of the day hides its own fault. **First-order on R-2**: `minimumDamperPosition` and a sizing that leaves $413/411.4 \approx 1.004$ at the normal speed and 43 % up to $s = 1$, which together decide whether compensation has anything to work with. **Near-cosmetic**: P_{nom}, because the classifier tests a *ratio* against the affinity-law prediction, so 400 W cancels. **Worse than cosmetic**: the exponent 3, because the generator and the detector share it, so the blocked-filter power test cannot fail except through β. Removing this gap needs a commissioning report: a measured fan curve, a measured pressure drop, a people counter.

One of them was corrected on measurement rather than argued, and it belongs here because the first choice was wrong. Q_{nom} was initially the design total rounded up, which meets the simultaneous design condition only at $s = 1$, the one speed compensation needs to borrow from. Run at the normal 0.7 that plant delivers 294 l/s against a 411.4 l/s design total, and the consequence was not subtle: with **nothing broken** no room could be held below 1000 ppm at design occupancy and the monitor confirmed a fault in all six, because a uniformly starved building looks exactly like a faulty one. Sizing from Σ design ÷ 0.7 separates the two jobs the rating was doing at once. **The fix is not free, and this is the honest cost: margin masks faults. Appendix I.2** gives the correction, its measured price (a filter blocking 35 % no longer starves the rooms enough for the monitor to confirm it) and the no-fault arm that now holds every occupied minute at or below 1000 ppm at design occupancy on all five seeds, which is the figure the earlier sizing scored 0.000 on.

13.4 The CUSUM margin is thin, R-3 does fail, and the margin was the symptom rather than the cause

The worst healthy seed peaked at 149.1 ppm against $h = 150$ ppm at $\sigma = 30$ ppm, over three hours in one room: a **0.9 ppm margin**, with the next seed at 91.6 ppm, so it is a tail draw and not a design property. R-3 asks for the same statistic across six rooms over seven days, far more samples, and the measurement contradicts the analytic run length: over 20 fault-free simulated weeks of all six rooms the monitor raises **0.55 confirmed cases per week against R-3's limit of one**, with **16 of 20 weeks clean** and a worst week of 6, against 1.30 per week and 9 clean weeks before ADR-0010, while on the same tuning R-1's stepped p95 is 6 min against a 15 min budget (§11.2). The scored criterion is the worst week, so R-3 fails.

But h was never the knob, and that is the correction this section needs. ADR-0010 attributed the failure to the *reference* the limit is applied to rather than to the limit: both plausibility guards were being corrected 30 % of the way onto every reading, so each CUSUM arm was accumulating a filter error instead of a residual. Correcting the lower arm's half of it halved the rate with $k = 30$ ppm and $h = 150$ ppm *untouched*. So k and h stay where the spike put them rather than being retuned until R-3 passes: retuning a limit on the experiment that failed it is the same methodological error §13.10 names. The upper arm's half of the same defect is measured, meets R-3 outright, and was declined because it costs three other requirements (§11.2, ADR-0010). **Appendix I.3** gives the full argument, including which week and which arm the residual failures sit on.

13.5 R-7 fails at design occupancy, and the failure is R-3's arriving somewhere else

Until this revision R-7 was reported as met, full stop, on 270 observed rooms. It was met on the occupancy regime it had been run in. With every room at its design head count the same experiment fails **231 of 270**, and the shape of the failure is the result.

The two failing clauses are **disjoint**: 215 observed rooms were themselves *accused of a fault they did not have* and 16 more sat outside the 5 % airflow band at a worst deviation of 0.058919 (215 plus 16 is the 231), and they attribute in opposite directions, which the supervisor-dead pass shows. Accusations run 85 of 90 rooms with the supervisor *dead* against 130 of 180 with it live, so they belong to the regime and the monitor rather than to the response to the fault; airflow breaches run 0 of 90 dead against 16 of 180 live, so that half is the compensation's own cost and nothing else's.

And the accusation is not where it stops. Of those 215 falsely latched rooms, **130 were also taken off the inner loop**: the supervisor published `DEGRADED` for them, confiscating the damper of a room with nothing wrong with it. Zero rooms were degraded without first being latched, so every one of the 130 is downstream of a false confirmation rather than a separate defect. That figure reads 0 in any copy of `T-34b-room-isolation.csv` generated before the supervisor began re-asserting a degraded zone's mode on every cycle; the confiscation was always happening, and what changed is that it is now announced often enough to be seen.

So the larger half of R-7's design-occupancy failure is R-3's false-alarm rate, measured by a different experiment in a regime R-3's own replay never visits. That is the second time this report has had to say it (§11.2 records the same pattern inside R-2), and **R-3 is not one failing requirement among four; it is the one whose failure the other three inherit**. ADR-0009 predicted this collision and noted that no experiment asserted R-7 in that regime. One does now. Two bounds travel with the finding and **Appendix I.4** states both: one of the two airflow columns cannot falsify this requirement at all, and the 5 % bound's *reference plant* is ambiguous in a way ADR-0008 never settles (an ADR-level question, not a code change).

The mechanism that turns one false alarm into six, which this section owed the reader and until now left in Appendix F. A false `STUCK_DAMPER` does not merely add one accusation; it *pins* that room's believed opening in `AhuFlowModel`, and the proportional split is a ratio over all six rooms. Pin one denominator term and the other five rooms are credited with air they are not receiving, so their predicted concentrations fall below their readings and they confirm in turn. When the false-alarm rate was 1.30 per week, instrumenting the replay by room, hour, arm and whether any room was already pinned showed the two halves to be **exactly even: 13 of the 26 confirmations were raised with no room yet pinned, and 13 were raised while another already was**. And of the 17 upper-arm confirmations, 11 were cascaded. One seed latched four rooms in 53 minutes; another latched all six (ADR-0010, Appendix F).

This is the finding that makes R-3 structural rather than statistical, and it is why ADR-0010's response was a re-anchor rather than a larger h: a confirmation that pins a damper now re-anchors the other five rooms and resets their arms, because a step change in believed airflow makes every ppm banked before it a statement about a different building. Aiming at the cascaded half took the rate from 1.30 to 0.55 and the clean weeks from 9 to 16 while moving no other requirement. The half that

remains is the primary half, which no re-anchor can reach: **a shared-plant design couples its own false alarms, and that coupling is a consequence of ADR-0008's option B rather than a defect in the detector**. Independent rooms would not cascade, and would also have made R-7 hold by construction and its experiment measure nothing (§4.5).

13.6 The third diagnostic signal is blind after a confirmation, and reordering the pipeline does not help

§7.3 records that the stuck-damper leaf fires on two signals rather than three, because a probe can only be requested once a case is latched, so the probe's own step is never judged at classification time. The obvious repair is to reorder: latch as usual, withhold the diagnosis, ask for the probe immediately, and name the fault when the step lands. **It was built, measured over 176 paired runs on identical seeds, and not kept.** It does what it was designed to do (detection moves in 0 of 88 pairs and the fault is named on a genuinely judged step in 28 of the 39 runs that defer, against none before), and **the settled classification is identical in all 88 pairs**, because the judged step reads `MISSING` for a stuck damper, a blocked filter, nine rooms whose dampers are in perfect health, and the run with nothing injected. A signal that reads the same for every condition decides nothing.

The cause is a located defect older than the ordering, and **correcting that baseline makes the reorder worse rather than better**, which is the finding worth defending, because by the time a probe can be commanded the supervisor has degraded the zone, raised the fan and trimmed the other five, so the room's answer is mostly the compensation's. **Appendix I.5** carries the defect, the counterfactual and the conclusion, which is the one concrete thing this report would hand to a successor: **a three-signal stuck-damper diagnosis needs a step judged *before* a case opens** (the inner loop's own trims, read against a baseline that survives them) rather than a probe requested after the response to the fault has already begun.

13.7 The occupancy dependency is mitigated, not solved

The plausibility ceiling of §7.2 keeps an unmodelled arrival from confirming a fault, and the sensitivity cost is not small: in A145 (20 seats) or A115 (10 seats), a room holding two people has a ceiling far above anything a stuck damper produces, so the fault stays invisible until the room fills. That dependency is now measured over the range a drawn weekday visits: stratifying T-24's closed-loop runs by the head count at the ignored command gives **0 of 4 confirmations at 0.625 of design occupancy** and a median falling to 31 min at 1.00 (§11.2). And the spike does not cover it at all: its observer used *true* occupancy, so **the kill-criterion gate was passed by a detector the system does not deploy**. What is still missing is exactly this: those figures are a stratification of runs that happened in one room over 0.625–1.000 of design occupancy, not a sweep holding the ratio as a controlled input over a wider range. Closing the remainder needs either a real occupancy signal, which BuildSim has no concept of, or that sweep (which is affordable, and was not done).

13.8 Latching is the right trade here, and it is a trade

Compensation shrinks the residual that found the fault, so without latching the monitor would clear every fault it handled successfully, the supervisor would stop compensating, and the pair would oscillate with a broken damper still broken. The active probe is the right re-test but cannot clear a case either, because a damper being compensated answers a step exactly as a repaired one does. The asymmetry is therefore deliberate: **a sticky false alarm is preferred to a self-clearing real fault.** For ventilation that is correct: a missed stuck damper means weeks of elevated CO_2, while a false latch costs one technician visit and a room running with trimmed neighbours. It is the *wrong* trade wherever the degraded mode is itself the hazard or the expense: latching that shut ventilation off, or paged an engineer nightly, would make the sticky false positive the more expensive failure and the clearing policy would have to invert. **And the cost of a false latch is now exactly what this argument says it is**, which it was not until recently: the missing `serviced()` transport made a false latch permanent, so the trade was being defended against a system that could not pay the price it quoted. The transport

exists (§13.1), so a false positive now costs one technician visit, one HTTP request and a room that ran with trimmed neighbours until it was made.

13.9 Scope, and the debts taken knowingly

Legitimate scope. Six rooms on one floor behind one air handler is not a building, but the shared fan makes R-7 non-trivial: keeping five rooms unchanged while compensating the sixth is something the supervisor must actively do. Simulated time through `ClockPort` is legitimate too, and what it buys has to be stated precisely because the obvious phrasing is false of half the system. **In the offline harness the replay is reproducible bit for bit**, which is exactly what R-3's false-alarm count needs. **In the containerised demo profile it is not**, and that is measured rather than suspected: four runs on identical `SEED`, `TIME_SCALE` and `START_AT` confirmed A115 at simulated 10:16, 10:17, 10:19 and 10:23. The offline number is the one every requirement is argued from. What simulated time does not exercise either way is anything that appears only over real duration: scheduler jitter, clock drift, broker backpressure, memory growth.

Debts. Skipping a DTO layer is justified by lock-step single-author deployment but makes a domain refactor a wire-format break; having no message replay is similarly contingent, since a monitor restart in a real deployment loses the residual history it was accumulating and R-5 then rests entirely on the journal. Four smaller debts of one shape, the same fact written down twice, have since been **corrected**, and **Appendix I.6** keeps them on the record because what they were is worth more than that they are gone, along with the measured side effect worth more than its fix: a 0.05 change in one probe amplitude moved **ten of T-34b's design-occupancy rows from pass to FAIL**, which says the design-occupancy regime is not merely failing but *unstable*.

13.10 What I would do differently

1. **Write ADR-0008 before the spike, not after.** The spike tuned $k = 30$ ppm and $h = 150$ ppm on a 210 m^3 room at $Q_{\max} = 0.175$ m^3/s, parameters none of the six real rooms carries, and those values entered ADR-0008's parameter table unchanged.
2. **Make the occupancy-free observer the spike.** The spike used true occupancy, so the kill-criterion gate tested a detector the system does not deploy.
3. **Run the false-alarm experiment at the requirement's horizon *before* tuning.** A 149.1 ppm peak against $h = 150$ should have triggered a seven-day six-room replay immediately; tuning a threshold on an experiment shorter than the requirement is this project's clearest methodological error.
4. **Put the ambiguous fault in the generator instead of in the critique.** A per-branch obstruction is what would make the confusion matrix worth reporting, and the enumeration cannot express it.
5. **Build the evaluation harness before the dashboard.** The dashboard is pleasant and the harness is the evidence.
6. **Let the supervisor decline to compensate when the compensation is not worth its energy.** §11.7 measures the trade and it is a bad one at design occupancy: a mean of 1.59 times the fan power, up to 2.92, to move occupied comfort minutes from 0.0094 to 0.0217 against a criterion of 0.95, while on the drawn weekday the plan never raises the fan at all. The machinery for refusing already exists: the stuck-shut case reports "no air path" and turns the work order to occupancy advice. This is the first change I would make next, and it is not made here because it would move R-2's measured arm after the result was known.

13.11 Risk register

The register is **Appendix J**: each row a risk or an assumption, its impact, and the response with its status. Three rows now read "measured, and it does happen" rather than "mitigated" (R-3 at its seven-day six-room horizon, the occupancy-dependent detection delay, and the trim lever already exhausted before the supervisor is asked for anything), which is the honest shape of this project's risk position.

Appendices

The report ends here. It is Sections 1–13, pp. 4–45 (42 pages), and it is complete on its own: every verdict, every decision and every limitation is stated there.

What follows is 38 pages of supporting depth, cross-referenced from the body. Nothing in these appendices is evidence the body does not already point at from the place it is needed; what is only here is the working.

A. Requirement verdicts and their evidence, in full

This is §3's requirement table with its full evidence column, laid out one requirement per block so that no column has to be narrow. The body carries the same seven rows reduced to statement, acceptance criterion and verdict; §11.2 and Appendix F carry the experiments behind them. Nothing here is new: it is the text the body used to print in place.

A.1 R-1 — confirm a damper that has stopped responding

Statement (EARS). *When* a damper stops responding to commands, the system shall confirm the fault.

Acceptance criterion. p95 confirmation $\leq$ 15 min after the first ignored command. **Verification.** Injection harness, $\geq$ 20 runs, report p95.

Status, honestly. Met as specified; not met in closed loop. On the stepped protocol this verification column names (the building settled, one ignored command, 20 seeds), the harness measures p95 = **6 min** at the deployed $h = 150$ ppm, 20/20 detected, and p95 stays between 5 and 8 min over $h = 50 \ldots 300$ ppm. `fault-monitor`'s own R-1 test agrees to the minute. On a drawn weekday with the inner loop and supervisor live the same injection gives median 74 min, **p95 257 min** and 15/20 detected; the cause is the plausibility ceiling, not detector latency (§11.2).

A.2 R-2 — hold the faulted zone below 1000 ppm by compensation

Statement (EARS). *While* a fault is latched, the system shall keep the affected zone below 1000 ppm by compensation.

Acceptance criterion. Zone $CO_2 \leq 1000$ ppm for $\geq$ 95 % of occupied minutes during the fault. **Verification.** End-to-end scenario test.

Status, honestly. Met on the case it covers; not met at design occupancy. The solver is proved exactly: a damper frozen at the 0.15 floor is restored from 59.7 to 165.9 l/s with the five healthy flows unchanged (§7.4, §11.3). And the closed-loop percentile is now measured: 1.000 of occupied minutes, 5 of 5 seeds, on a drawn weekday, with the lower CUSUM arm off and with no damper feedback alike. With every room simultaneously at design occupancy **0 of 5 seeds** meet it, while the no-fault reference meets it 5 of 5 in every case (§11.2).

A.3 R-3 — no more than one false alarm per simulated week

Statement (EARS). The monitor shall raise no more than one false alarm per simulated week.

Acceptance criterion. ≤ 1 `FaultConfirmed` in a 7-day fault-free replay. **Verification.** Replay test on fixed seed.

Status, honestly. Not met. Measured over 20 fault-free simulated weeks of all six rooms: **0.55 confirmed cases per week** against a limit of 1, **16 of 20 weeks clean**, worst week 6 (§11.2), down from 1.30 per week with 9 clean weeks before ADR-0010. The harness scores the worst week, so R-3 still fails the criterion it is judged by. The failure is no longer unattributed: both plausibility guards were being corrected 30 % of the way onto every reading, so each was a filter of the measurement rather than a bound and each CUSUM arm ran on a filter error (ADR-0010, §11.2). Fixing the lower arm's half of that halved the rate with k and h untouched, and they are still left where the spike put them rather than retuned until R-3 passes (§13.4).

A.4 R-4 — report unavailable on stale readings, and diagnose nothing

Statement (EARS). *While* readings are stale beyond three intervals, the monitor shall report unavailable and issue no diagnosis.

Acceptance criterion. State is `BLIND`; zero fault events published. **Verification.** Fault injection: kill `co2-sensor`.

Status, honestly. Met, in-JVM and at container level. The state machine has no edge from `BLIND` into `SUSPECT` or `CONFIRMED` and its transition tests cover the stale entry and exit (§7.3). T-27 now kills each component in turn in one JVM and **23 of 23 assertions pass**: every observable room reaches `BLIND` within **4 cycles** of the sensor kill (three sample intervals plus one cycle) with **0 fault events** published while blind and **0 damper commands** issued on stale data, and `HEALTHY` returns 3 cycles after the readings do (§11.2). **The container-level chaos run has since been done too**: against `docker compose`, five of six rooms reach `BLIND` within 12 s of the kill with no diagnosis and no healthy-room command while blind, recovery takes three cycles, and an in-container `SIGTERM` fires the restart policy: restart count 1, running again within 3 s (§11.6, `T-27-container-kills.txt`).

A.5 R-5 — make every diagnosis reconstructable

Statement (EARS). The system shall make every diagnosis reconstructable.

Acceptance criterion. Inputs, command, residual series, classification and timestamp recoverable for any `caseId`. **Verification.** Rebuild a random case from the journal.

Status, honestly. Built, and demonstrated live against the deployed stack. The hypertables carry provenance and the dashboard exposes `GET /api/cases/{caseId}` (§5, §12). In the recorded demo run, `GET /api/cases/aecd9137-6c3d-42a8-ac11-438ef3d9d2d6` returned **HTTP 200, 77 248 bytes and 445 events** (every reading, residual and CUSUM value in sequence) against a real TimescaleDB rather than a test double (`evaluation/results/T-23-demo-run.txt`, §5). One bound still travels with it (the `caseId` was the one that run produced rather than a randomly drawn one), but the other is gone: **R-5 now has an integration test**. Eight tests execute `replayCase`'s real SQL against a real PostgreSQL, covering the `?::jsonb` cast, the per-zone window scans, the case window and the one-hour evidence lookback that decides which readings belong to a case, pinned at −59, −60 and −61 min. They measured one bound nobody had assumed: a `timestamptz` round trip *rounds* to the nearest microsecond rather than truncating, so reconstruction fidelity is half a microsecond: unreachable in this deployment, where every journalled instant is a whole simulated second.

A.6 R-6 — identify the zone count at which the monitor misses its interval

Statement (EARS). The system shall identify the zone count at which the monitor misses its interval.

Acceptance criterion. Sustained zone count where p95 monitor cycle exceeds 60 s is reported. **Verification.** Scaling experiment to breaking point.

Status, honestly. Met, with an extrapolated answer. The sweep reaches **25 600 zones at a p95 of about 6 s** (5.68–6.05 s over five runs on the same machine), inside the 60 s interval, and the fit over the nine points from 100 zones up, $p95 = 1.196 \times 10^{-8}\, n^{1.97}$ s with $r^2 = 0.9991$, puts the crossing of 60 s at **about 86 000 zones**: an **extrapolation, not a measurement**, and labelled as one. The saturated element is named: `AhuFlowModel.believedFlowTo` sums every zone's opening and every zone asks it, so a cycle is $\Theta(n^2)$ (§11.2). **The deployed stack reaches a much smaller number, and for a reason outside the monitor**: `ZONE_COUNT` is now settable and all seven project-authored containers read the same one, but BuildSim refuses to host equipment in a room its floorplan does not have, and level 0 of the A building has 52 further rooms of comparable size, so the deployed ceiling is **58 zones**, verified in both directions. The two numbers are three orders of magnitude apart and this report never quotes one for the other.

A.7 R-7 — keep every other room unchanged while one is latched


Statement (EARS). *While* a fault is latched in one room, the system shall keep control and diagnosis of every other room unchanged.

Acceptance criterion. Zero fault events and no control-mode change in the other five; their CO_2 *and their airflow* stay within the healthy-run band. **Verification.** Injection in one room, assertions over the other five on CO_2 and airflow, ≥ 3 rooms as the injected one.

Status, honestly. Met on the drawn weekday; not met at design occupancy. With the injected room rotated over all six rooms, on three seeds and in three configurations, the drawn weekday gives **0 of 270** observed rooms failing: 0 fault events, 0 rooms degraded, 0 outside the CO_2 band, 0 reaching `COMPENSATING` or `DEGRADED`, airflow inside 5 % everywhere. With every room at its design head count the same experiment gives **231 of 270 failing**: 215 observed rooms *accused of a fault they did not have*, and 16 more outside the airflow band at a worst deviation of 0.058919, the two sets disjoint (§11.2). The accusations are R-3's false-alarm rate arriving inside R-7's experiment: with the supervisor dead they run 85 of 90 against 130 of 180 with it live, so they are the regime and the monitor rather than the response to the fault. The solver's analytic invariance (§11.3) is backed end to end on the drawn weekday only.

B. The component view, the code-level views, the sequence view, and the documentation approach


B.1 Component diagram (C4 Level 3): inside `fault-monitor`

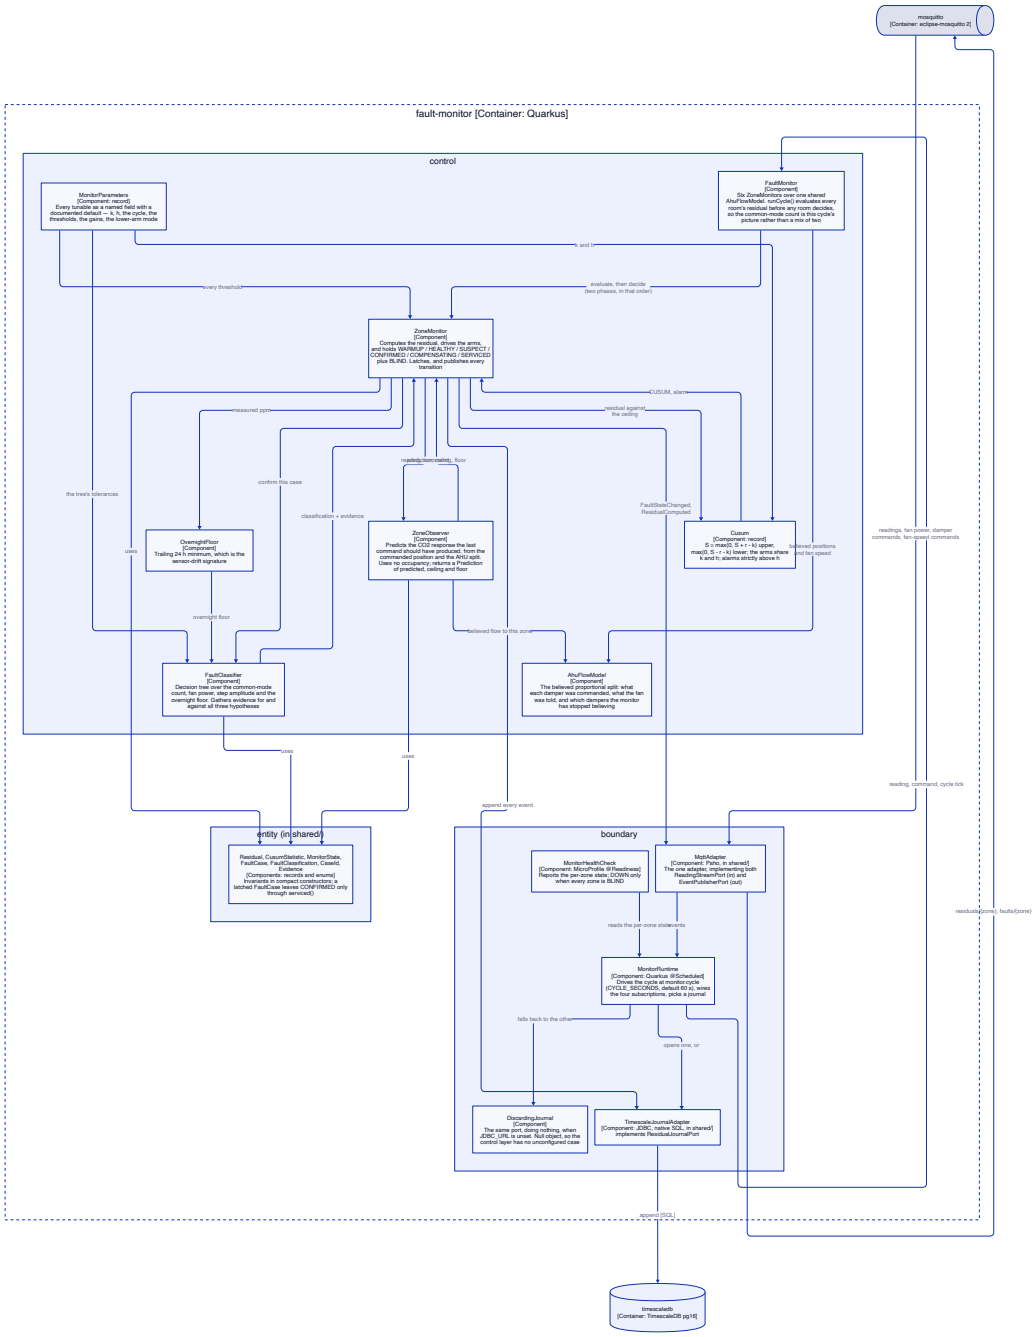

C4 Component diagram (Level 3), from `project/diagrams/component.d2`*: inside* `fault-monitor`*. Every box is one* component*, tagged with that element type and labelled with the exact type name so a reader can grep for it; where the source lives in* `shared/` *rather than in* `fault-monitor/` *the box says so, because at runtime it is a component of this container either way. The* `boundary` *group holds every framework and transport type;* `control` *and* `entity` *depend on nothing outward.*

B.2 Code diagrams (C4 Level 4), and why only two

C4's own guidance is that the code level is *optional* and worth drawing only for the parts that warrant it; a class diagram of everything is a diagram nobody reads and that rots on the first rename. The criterion used here is narrower than "the complicated parts": **a code diagram earns its page where a claim this report makes is a claim about the shape of the code rather than about the physics, and where the Level 3 box hides the very thing being claimed.** Two places meet it. Everything else in the system is either a plain adapter, where the port name is already the whole story, or logic whose interesting content is arithmetic that Sections 6 and 7 give in full.

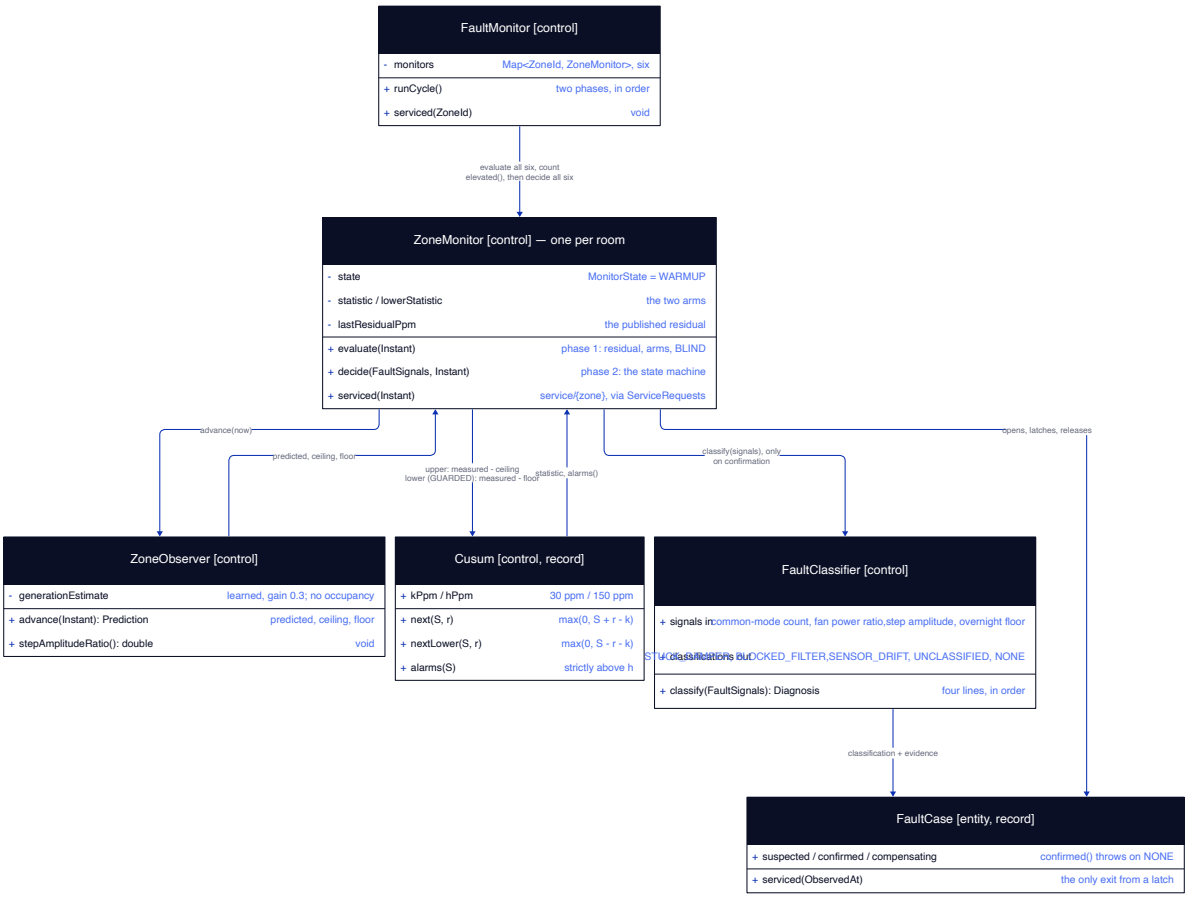

C4 Code diagram (Level 4), from `project/diagrams/code-diagnosis.d2`: the diagnosis chain in `fault-monitor`'s `control` layer. Deliberately partial: only the types an arrow lands on, and only the members that carry one of the claims below. `MonitorParameters`' 25 settings (23 numbers and durations, plus the `lowerArm` and `classifyWhen` mode enums), `OvernightFloor`, `AhuFlowModel` and `FaultSignals`' twelve components stay at Level 3; `MonitorState`'s constants and transitions are the state machine of Section 8.3 and are not drawn twice.

Four claims in this report are claims about this figure, and at Level 3 all four are hidden inside one box called `ZoneMonitor`.

- **The cycle has two phases and the order is load-bearing.** `FaultMonitor.runCycle()` calls `evaluate(now)` on all six monitors, then counts how many are `elevated()`, and only then calls `decide(signals, now)` on all six. The count is the common-mode signal that separates a blocked filter from a stuck damper, so a single-phase loop would hand room six a count mixed from this cycle and the last.
- **The published residual is not the accumulated one.** `ZoneMonitor.evaluate` computes three quantities from one `Prediction`: `measured - predicted` goes out on `residuals/{zone}` because it is the honest number a human should see; `measured - ceiling` drives the upper

CUSUM; and under the deployed `GUARDED` lower arm, `measured - floor` drives the lower one. The ceiling quantity is *subtracted* rather than clipped at zero, which Section 7.3 explains is what keeps the in-control run length R-3 rests on.

- **`serviced()` now has a transport, and the asymmetry this bullet used to describe is gone.** `FaultCase.serviced(ObservedAt)` is the only exit from `CONFIRMED` and `COMPENSATING`, and for most of this project's life nothing reached it: its only callers were two unit tests, so in the deployed system a false latch was permanent. It is reachable now by `ServiceReported` on `service/{zone}`, which `fault-monitor` subscribes to through a `ServiceRequests` adapter that validates it, and by `POST /api/zones/{zone}/cases/{caseId}/serviced` on the dashboard. The topic is deliberately *not* under `commands/`: it carries a report about the world, not an instruction to an actuator, and putting it under `commands/` would have given a second publisher authority over a topic space the actuator owns. The full `CONFIRMED` → `COMPENSATING` → `SERVICED` → `WARMUP` → `HEALTHY` lifecycle is executable and tested end to end, including that a reported repair unwinds the compensation (Section 13.1).
- **`DAMPER_STUCK_OPEN` now exists, and naming it did not make it reachable.** `FaultClassification` holds `NONE`, `STUCK_DAMPER`, `DAMPER_STUCK_OPEN`, `BLOCKED_FILTER`, `SENSOR_DRIFT` and `UNCLASSIFIED`. Three things branch on the new constant: the classifier's low-side leaf, the supervisor's work-order narrative, and its severity. A damper stuck open is `WARNING` rather than `CRITICAL`, because that room is over-ventilated and safe while the other five are short. The two extremes are deliberately re-joined by `isUnresponsiveDamper()` for the one purpose where the direction is irrelevant: pinning the shared flow belief. **But the diagnosis is still unreachable at the deployed setting**, because only the unguarded lower CUSUM arm sees a damper stuck wide open and that arm costs six false confirmations per fault-free week against R-3's limit of one (Section 13). So this makes the fault *expressible and actionable*, not detectable, and the trade it sits behind is unchanged.




C4 Code diagram (Level 4), from `project/diagrams/code-compensation.d2`*: the compensation solver in* `supervisor`*'s* `control` *layer. The inset lists the order of steps inside* `solve()`*; none of them repeats.* `PlantState`*,* `ProbeLimiter` *and* `WorkOrderNarrative` *are Level 3, and the algebra itself is Section 7.4 rather than this figure.*

The solver is the second case, and the reason is the same: Section 7.4's central claim is that holding five healthy flows while multiplying the sixth is a **closed form rather than a search**, and that is a statement about this code's shape that no box labelled "the compensation solver" can carry. `CompensationSolver.solve` is straight-line: no loop over candidate solutions, no convergence test, no per-room balance, and the only loop in the method writes the result map. The three helper methods are each a closed form (`trimFloor`, `preservingSpeed`, `toleratedTrimFloor`), and the one conditional re-solve, when the preserving speed would exceed the fan's ceiling, happens at most once. The two constants the figure names are bounds rather than tuning knobs: `MAXIMUM_REQUESTED_GAIN` $= 4.0$ because the dampers' 0.15 floor caps the trim at 0.25, and `HEALTHY_FLOW_TOLERANCE` $= 0.05$ because that is the most a healthy room may be asked to give up (or, read the other way, to be over-supplied by, once there is no trim left to make).

B.3 The key scenario in time (sequence diagram)

The sequence view adds what the dynamic view leaves out: duration, and the three phases that follow confirmation. Its fourth group is the point of the project: after compensation the residual collapses to 20 ppm and the CUSUM to zero, and the case does *not* clear.

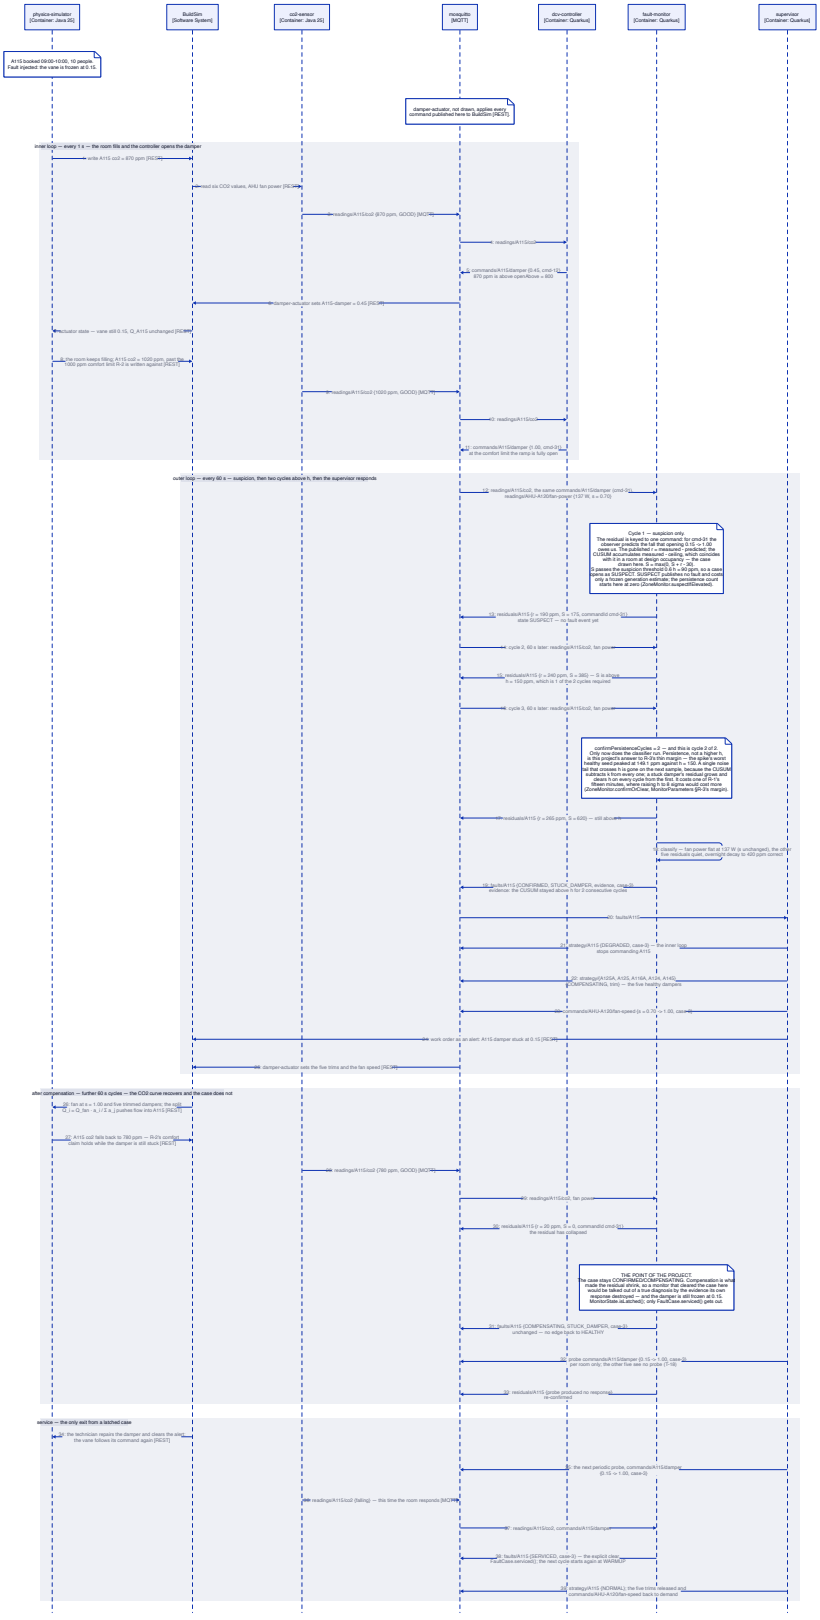

Sequence diagram, from `project/diagrams/sequence.d2`*. Four groups: the inner loop filling the room; the outer loop*

confirming and responding; the latch holding after compensation has made the CO_2 curve look healthy; and service, the only exit.

B.4 The documentation approach: C4 for the views, arc42 for the frame

Two frameworks are used, for two different jobs, and each is weak where the other is strong. **C4 supplies the structural views**: a numbered zoom from context to containers to components to code, with a fixed element vocabulary at each level, so a reader can tell what kind of thing a box is without reading its label twice. **arc42 supplies the document frame**: twelve numbered sections that force the questions a structural diagram cannot answer (constraints, cross-cutting concepts, quality scenarios, risks and technical debt). C4 has no place to put a measured quality scenario or an honest debt register, and arc42 names a "building block view" without saying what a building block may be.

The arc42 document is `project/docs/arc42.md`, and it deliberately does *not* repeat this report: where the report says something, arc42 cites the section and summarises it, and its value is the two things this report has no natural home for: the quality tree with its measurable scenarios (arc42 §10) and the debt register as of a stated date (arc42 §11). The C4 diagrams are shared rather than duplicated: both documents reference the same nine files in `project/diagrams/`.

C. The six rooms, and the physical model's invented parameters

C.1 The six rooms

The room set of §6.1. Volume is floor area × the assumed 3 m ceiling; design flow is the Swedish workplace guideline at the room's intended occupancy.

Zone	Area	Volume	Intended use and schedule	Design occ.	Design flow
`A125A`	18.0 m^2	54.0 m^3	single office, 08–17 with a lunch dip	1	13.3 l/s
`A125`	29.8 m^2	89.4 m^3	two-person office, staggered arrival	2	24.4 l/s
`A116A`	33.0 m^2	99.0 m^3	project room, intermittent use	4	39.6 l/s
`A115`	44.0 m^2	132.0 m^3	meeting room, booked 1-hour slots	10	85.4 l/s
`A124`	76.5 m^2	229.5 m^3	open-plan office, continuous daytime	8	82.8 l/s
`A145`	74.0 m^2	222.0 m^3	seminar room, booked 2-hour slots, empty between	20	165.9 l/s
Σ	**275.3 m^2**	**825.9 m^3**		**45**	**411.4 l/s**

C.2 Every invented parameter, and what it decides

Every parameter of §6.2, its derivation and the requirement it is first-order on. §13.3 says which of them the invention invalidates and which it does not.

Parameter	Value	Derivation (all invented, none picked)	Sensitivity
Q_{nom}	0.59 m^3/s (590 l/s)	The sum of the six design flows, 411.4 l/s, divided by the normal speed 0.7 and rounded up, so the plant covers the simultaneous design condition at the speed it runs rather than only at $s = 1$	First-order on R-2: at 0.7 it leaves 0.4 % spare, which is the coupling; the 43 % up to $s = 1$ is the compensation budget, not normal slack

Parameter	Value	Derivation (all invented, none picked)	Sensitivity
P_{nom}	400 W	0.59 $m^3/s \times 400$ Pa $\div$ 0.6 fan efficiency $\approx$ 393 W, rounded up; 137 W at the normal speed	Near-cosmetic: the classifier tests a *ratio* against the affinity law, so 400 W cancels
Affinity exponent	3	Textbook fan law, asserted rather than derived	Worse than cosmetic: generator and detector share it, so the power test cannot fail except through β
Fan speed s	$[0.2, 1.0]$, normally 0.7	The compensation lever; the invariant on `FanSpeed`	First-order on R-2: 0.7 is the 43 % headroom the lever uses
A_i (authority)	$\propto$ design flow	So that at the normal speed 0.7 with all dampers open each room gets its design flow $\times$ 413/411.4 $\approx$ 1.004	First-order on R-1: the observer recovers design occupancy as $(A_i - 0.35\,\text{area})/7$
`minimumDamperPosition`	0.15	Ventilation never fully closes; the floor a demand-controlled damper holds during occupied hours	First-order on R-2: it is also the position a "stuck shut" damper sticks at
Ceiling height	3.0 m	The floorplan carries no height	First-order on R-1: every time constant is V/Q and V is linear in it; a 2.7 m ceiling makes all six rooms 10 % faster
C_{out}	420 ppm	Outdoor concentration	Sets the residual's floor
g	5×10^{-6} m^3/s per person	CO_2 generation per person	First-order on R-1 through the prediction's generation term
Comfort limit	1000 ppm	The limit R-2 is written against	Definitional
Sensor noise σ	30 ppm	The spike's assumption (§11.1)	Sets k and h directly

C.3 The REST contract against BuildSim

The calls §5.2 names. BuildSim's schema is not mine, so this is the one place a translation layer exists.

Caller	Direction	Purpose	Why it is REST and not a message
`physics-simulator` → BuildSim	write sensor values	Make CO_2 and fan power visible to the sensors and the 3D view	One-to-one write whose success the caller must know
`physics-simulator` ← BuildSim	read actuator state	Close the physical loop: the damper and fan positions the physics must honour	The simulator must read the state that actually applied, not the command that was sent
`co2-sensor` ← BuildSim	read sensor value	Sample the environment	A device reads its own sensor
`damper-actuator` → BuildSim	write actuator state	Apply a validated command	BuildSim is the single source of truth for actuator state
`supervisor` → BuildSim	write alert	The work order the technician sees	An operator artefact, not a stream
`dashboard` → BuildSim	write room layers	Colour the floorplan by CO_2, residual, CUSUM or state	Idempotent repaint every 5 s

D. Diagnosis in detail: the plausibility ceiling, the confusion matrix, and the reordering experiment

D.1 The monitor's eighteen named defaults, and what the plausibility ceiling costs

Every one of those numbers is a named field with a documented default rather than a literal buried in a branch, which is what let the register of §11.6 name what each experiment must re-measure. Eighteen of `MonitorParameters`' 25 settings are the ones worth naming here: $k = 30$ ppm, $h = 150$ ppm, cycle 60 s, suspect fraction 0.6, confirm persistence 2 cycles, suspect-clear 3 cycles, warmup 3 cycles, stale 3 intervals, evaluation window 10 min, generation gain 0.3, anchor gain 0.3, minimum step 0.05, probe interval 30 min, probe step +0.20, common-mode 5 of 6, step-amplitude match 0.3, overnight tolerance 100 ppm over 24 h, integration step 1 s. A nineteenth deserves an argument rather than a line in a list: the plausibility ceiling runs at **1.25** times design occupancy, and 25 % of headroom above design is a deliberately desensitising choice. It is now priced rather than asserted.

`MonitorParameters.withOccupancyCeiling` lets T-24 sweep the headroom against a control arm with nothing injected, and the sweep settles what the setting costs: at a ceiling of 1.00 the closed-loop arm detects **16 of 20** at a median of 126 min from onset, but latches a room in **2 of 20** fault-free runs; at the shipped 1.25 it detects **15 of 20** at a median of 180 min from onset and latches **0 of 20**. Those minutes are counted from fault onset so that the two ceilings are comparable, and they are not R-1's delay, which Section 11.2's closed-loop arm counts from the first ignored command and reports as a median of 74 min and a p95 of **257 min**. Tightening the ceiling therefore buys one detection and some speed, and pays two false alarms for them, so the headroom is not a free lever between R-1 and R-3. And below 1.00 it stops bounding occupancy at all.

That control arm also retires a hypothesis this report would otherwise have left standing. A closed-loop detection rate quoted with nothing to compare it against is a count, not a measurement, and it was reasonable to suspect that the 15 detections were R-3's false-alarm mechanism landing on a room that happened to have a fault in it. The fault-free column is 0 of 20 at the shipped headroom, so they are real detections. The arithmetic behind the sweep is the same one that limits R-1 in Section 13.4: at A124's drawn occupancy of four to five of its eight desks the frozen damper is worth about **86 ppm** of steady state, against a ceiling sitting **270–600 ppm** above the reading.

D.2 What the classifier actually emits, measured (T-15)

The four-signal table of §7.3 is what the tree is *for*; this is what it does. `ConfusionMatrixExperiment` runs the pipeline once per injected condition (the four injectable faults plus a no-fault arm) on a fixed seed, and tabulates the condition injected against the classification emitted. The no-fault row is why T-15 is traced to R-3 and not only to R-1. 218 runs in all: 110 at the headline magnitudes over two arms, plus a 54-run drift-rate sweep and a 54-run offset sweep. Each cell is the first confirmed case anywhere in the building, because that is the work order an operator actually receives. Note that the rows are *mechanisms* and the columns are *classifications*, and there are more of the first than the second: `SENSOR_DRIFT` and `SENSOR_OFFSET` are two ways for a sensor to be wrong and the monitor has one word for both.

seed 42, closed loop	STUCK_DAMPER	BLOCKED_FILTER	SENSOR_DRIFT	UNCLASSIFIED	never confirmed
nothing injected	.	.	.	.	1
STUCK_DAMPER	1	.	.	.	.
BLOCKED_FILTER	.	.	.	1	.
SENSOR_DRIFT	1	.	.	.	.
SENSOR_OFFSET	1	.	.	.	.

Over seeds 42 and 1–10, eleven runs per row: nothing injected is silent in 10 of 11, `STUCK_DAMPER` is named correctly in 8 of 11 and never confirms in 3, `BLOCKED_FILTER` comes out `UNCLASSIFIED` in 11 of 11, `SENSOR_DRIFT` comes out `STUCK_DAMPER` in 11 of 11, and `SENSOR_OFFSET` comes out `STUCK_DAMPER` in 4, `UNCLASSIFIED` in 6 and never confirms in 1. **One of the four mechanisms is classified correctly**, and the report says so here rather than leaving the tree's branches to imply otherwise.

Three things are off the diagonal and each has a mechanism:

- `SENSOR_DRIFT` **is never emitted: 0 of 76 runs from a ramp and 0 of 76 from a step offset**, across rates 5–160 ppm/h and offsets 50–700 ppm, over both arms. The leaf asks for two things in the same instant: an informative overnight floor *and* a step response that still matched. **The two injectable sensor mechanisms each supply one of them and never both.** A ramp outlives the 24 h overnight window (it keeps growing, so it is still confirmable after a day), and by then the offset it accumulated has inflated the quasi-steady generation estimate past the step amplitude the leaf needs. A step offset keeps its amplitude and never reaches the window: with the inner loop running it confirms within the hour, and with it off nothing re-anchors the observer, the quasi-steady estimate absorbs a constant, and it never confirms at all. Counted over every sensor-fault run that confirmed, the ramp reached an informative floor 12 times and a matched step 0 times, the step reached a matched step 15 times and an informative floor 0 times, and **neither reached both once**.

  This report previously called that *a gap in the fault model, not a defect in the classifier*, on the grounds that the classifier's own unit test reaches the branch through a double applying a constant offset instantaneously, which no ramp can. **That attribution was tested and it was wrong.** The generator was given exactly that shape (`FaultKind.SENSOR_OFFSET`, injectable through the unchanged four-field `FAULT_SPEC` grammar), and the branch is still unreachable. The binding constraint is that **the classification is computed at the confirmation while one of its inputs needs a day of the fault**, which is a property of when the tree runs. The arithmetic that closes it: the overnight floor is a minimum over 1440 noisy samples, so it sits about $3.3\,\sigma$ (very nearly 100 ppm) below the level the room is holding, and the closest any offset came was a floor of 489 ppm against the 520 ppm the leaf needs, on a case confirmed 1621 min in. An offset large enough to lift the floor past 520 confirms within three minutes.

- `BLOCKED_FILTER` **confirms as** `UNCLASSIFIED`, 11 of 11, exactly as Section 4's cross-room analysis predicts: the proportional split only redistributes a fixed total flow, so no command the monitor can watch pushes all six residuals the same way. In every run the first room confirmed is a room with *no* damper fault in it, and all six latch by the end of the window. The fan-power excess is still attached as evidence, so the work order points at the plant even though the classification does not.

- **The stuck-damper leaf fires with no step on record, and trying to stop it emptied the leaf.** This is the most instructive thing T-15 found, and it took a failed fix to see it. `stepShapeUnchanged()` used to return `false` when the step-amplitude ratio was `NaN`, and `NaN` means *no step was ever judged*. So the test "the commanded step produced no matching response" was satisfied by a room that had never been commanded to move. 9 of 57 drift runs confirm by that route with zero judged steps; the other 48 failed the amplitude test genuinely, on 1–419 steps. The same codebase gets this right one field away, where `FaultSignals` documents the overnight floor's `NaN` as "no evidence, not healthy".

  The signal is now a three-valued `StepResponse` (`MATCHED`, `MISSING`, `NOT_JUDGED`), so the conflation cannot be written by accident any more. **But the leaf still accepts** `NOT_JUDGED`**, deliberately, and the reason is a property of the architecture rather than a shortcut.** A probe is requested *through the evidence on* `FaultStateChanged`, so a case must already be open before any *probe* step is commanded, which means **the monitor has never judged a step it asked for at the moment it classifies**. What it may have is an ordinary control command that happened to arm a window: 48 of the 57 drift runs above had one, and 9 had none. Requiring positive evidence of an unanswered step was tried and measured: it took the one cell on T-15's diagonal to `UNCLASSIFIED` and left the tree classifying *nothing at all*: the one named mechanism becoming none. The step-amplitude signal arrives *after* the decision it was designed to inform, and no amount of care in the classifier can fix an ordering problem in the pipeline.

So the leaf fires on localisation and flat fan power, and the work order now **says so**: a diagnosis reached without a judged step carries an explicit entry that it rests on two signals rather than three, that the room has not been asked to move and therefore has not failed to answer, and that a probe has been requested so the third signal can confirm or overturn it. The weakness is unchanged in behaviour and no longer invisible, which is what the evidence mechanism is for, and is strictly better than a boolean that quietly asserted a test nobody ran.

The obvious repair was then built and measured, and it does not work, because the third signal is blind after a confirmation rather than merely late. If the problem is ordering, reorder: latch the case on the same cycle as before but *withhold the diagnosis*, request the probe on that cycle instead of one probe interval later, and name the fault when the step window closes. That is implemented (`ClassifyWhen.AFTER_PROBE`) and measured as T-35 over 176 paired runs on identical seeds. It does what it was designed to do: the case latches on the same cycle (detection moves in **0 of 88 pairs**), and the fault is named on a genuinely judged step in 28 of the 39 runs that defer, against 0 under the deployed order. **And the settled classification is identical in all 88 pairs**, because the judged step comes back `MISSING` for a stuck damper, for a blocked filter, for nine drift runs whose damper is in perfect health, *and* for the run with nothing injected at all. A signal that reads the same for every condition decides nothing, so the reorder buys a median 11 min of work order with no diagnosis on it and no change of answer. It is **not adopted**, and `ON_CONFIRMATION` remains the deployed ordering.

The cause is located and it predates the ordering. `ZoneObserver.recordStepAmplitude` accumulates the measured leg of the amplitude against `predictedAtStep` while the predicted leg is also against `predictedAtStep`, so the measured leg carries the **standing residual** as a constant offset. The anchor-gain pull that would make that baseline legitimate is switched off while a case is open, so at the confirmation the prediction is stale by exactly the residual that confirmed it, and the ratio becomes a statement about the residual rather than about the response. On a 600 ppm offset with a healthy damper that answers its probe by dropping 300 ppm, the ratio runs from -7.0 to -0.8: negative. `ZoneObserver.measuredAtStep` is assigned for this purpose and never read.

Correcting that baseline was measured too, as an unlanded counterfactual, and it makes the reorder *worse*: 18/44 to 15/44 on T-15's diagonal, because the corrected signal reads `MATCHED` on 3 of 8 genuinely stuck dampers and `MISSING` on 5 of 11 healthy ones. By the time a probe can be commanded the supervisor has degraded the zone, raised the fan and trimmed the five healthy dampers, so **the room's answer to the probe is mostly the compensation's answer rather than the damper's**. The 18/44 baseline reproduces on the current code; the 15/44 was measured on a one-line patch that was then reverted, so it is the one figure in this report that cannot be re-derived from the repository as it stands. **The conclusion is the useful part**: a three-signal stuck-damper diagnosis needs a step judged *before* a case opens (the inner loop's own trims, read against a baseline that survives them), not a probe requested after the response to the fault has already begun. That is design work and §13 carries it.

D.3 Why the sensor-drift branch is the classifier's and not the generator's

A second, sharper limit on what can be claimed, and T-15 has since made it sharper still: of the faults the project set out to name, **one is classified and the others can only be pointed at**. This paragraph said *two* until the confusion matrix was measured, and the correction is the single largest change the measurement made to this report. `STUCK_DAMPER` is the reliable one, and T-24, T-25, T-26 and T-34b are all measurements of it. `BLOCKED_FILTER`'s branch is **unreachable with this physics** for structural reasons that Section 13.1 sets out: a blocked filter confirms as `UNCLASSIFIED` with its plant power excess reported, which is the right behaviour for a case the system cannot prove. `SENSOR_DRIFT` was described here as classified *conditionally*, on the grounds that its signature needs 24 h of overnight floor and a case opened earlier comes out `UNCLASSIFIED`. Measured, the condition is not merely restrictive but **unreachable**: the branch was emitted in **0 of 76 runs** across drift rates from 5

to 160 ppm/h, because the injected drift is a *rate* and by the time the floor has become informative the accumulated offset has already pushed the step amplitude below its match fraction. The room is then named a stuck damper: a confident, specific, wrong work order rather than an honest `UNCLASSIFIED`.

That diagnosis was then tested, and it was wrong in an instructive direction. The reasoning above blames the *fault model*: the classifier's own unit test reaches the branch through a double that applies a constant offset instantaneously, which no ramp can produce, so the obvious remedy was to give the generator that shape. It now has it: `FaultKind.SENSOR_OFFSET`, a sensor whose zero jumps once and holds, which is a real failure mode in its own right (a recalibration against the wrong reference, a replacement element installed without one) and is injectable through the unchanged `KIND:TARGET:MAGNITUDE:ONSET` grammar. **The branch is still unreachable**: 0 of 76 runs from a step offset, swept from 50 to 700 ppm, beside the 0 of 76 from a ramp. The leaf wants an informative overnight floor *and* a matched step response in the same instant, and the two mechanisms fail it in complementary places: of the runs that confirmed, the ramp reached an informative floor 12 times and a matched step 0 times, the step reached a matched step 15 times and an informative floor 0 times, and **neither reached both once**. The binding constraint is that the classification is computed at the confirmation while one of its inputs needs a day of the fault. **So this is a property of the classifier, not of the generator**, and the report had the attribution the wrong way round until the experiment was run.

The confusion matrix this paragraph said must be read with those caveats in front of it now exists, in Section 7.3, and it is read with exactly them.

E. The compensation algebra, and the second lever

E.1 The closed form §7.4 states

Write $a_i = p_i A_i$ for each opening, f for the frozen room's opening, h for the sum of the healthy openings at the baseline, $A_0 = h + f$ for the total, and s_0 for the baseline fan speed. *Two of these symbols are local to this appendix and collide with Section 7.3's*: h here is a sum of damper openings, not the CUSUM limit of 150 ppm, and r below is a dimensionless flow ratio, not a residual in ppm. Now trim **every healthy damper by one common factor** $t \in (0, 1]$ and raise the fan to s. The frozen damper does not move, so the total opening becomes $A(t) = t\,h + f$ and

$$Q_i(t,s) = Q_{\text{nom}}\, s\,(1-\beta)\,\frac{t\,a_i}{A(t)} \quad\Longrightarrow\quad \underbrace{\frac{Q_i(t,s)}{Q_i(1,s_0)}}_{\text{healthy ratio } r} = \frac{s}{s_0}\cdot\frac{t\,A_0}{A(t)}, \qquad \underbrace{\frac{Q_f(t,s)}{Q_f(1,s_0)}}_{\text{faulted ratio } \gamma} = \frac{s}{s_0}\cdot\frac{A_0}{A(t)} = \frac{r}{t}.$$

Two facts fall straight out, and together they are the whole mechanism.

First: one fan speed holds every healthy room's flow at once. The healthy ratio r contains no room index. Because the trim is *common* and the split is *proportional*, every healthy room's share of the total opening changes by the same factor, so a single scalar makes $r = 1$ for all five simultaneously:

$$\boxed{s = s_0\,\frac{A(t)}{t\,A_0}}$$

There is nothing per-room to balance and no iteration, which is why the supervisor publishes one fan-speed command and five identical trims rather than solving a five-dimensional problem.

Second: at that speed the frozen room's flow is multiplied by exactly $1/t$. Substituting $r = 1$ into $\gamma = r/t$ gives $\gamma = 1/t$. **The trim *is* the gain.** Trim the healthy dampers to a quarter and the starved room gets four times the air, with the other five rooms' airflow bit-for-bit unchanged.

E.2 Spending fan speed when there is no trim to make

§7.4 states that the fan is the second lever and that it is not selective. This is that derivation in full, with the bound it runs into.

The second lever, and why the trim alone was not enough. The derivation above assumes there is a trim to make. There is not always: with *every* healthy damper already sitting on its 0.15 floor the trim floor is $t = 1$, the proportional split cannot be shifted at all, and the closed form above returns the plant unchanged. That is not a corner case in this building: in the regime R-2's drawn weekday covers, the healthy rooms are below the inner loop's 800 ppm opening threshold when a plan is solved, so they *are* on their floor, and the measured consequence was a supervisory loop worth nothing and, at design occupancy, less than nothing (§11.2). The split law gives a second lever: Q_i is linear in s, so putting $t = 1$ into the two ratios gives $A(1) = A_0$ and

$$r = \gamma = s/s_0,$$

which is to say the frozen room's gain and the healthy rooms' *over*-supply become one and the same number. The fan lever is therefore **not selective**: the 43 % of headroom above $s_0 = 0.7$ is spendable selectively only *through* a trim, and with no trim in force the solver may spend it only as far as the healthy rooms tolerate being over-ventilated, the same `HEALTHY_FLOW_TOLERANCE` $= 0.05$, read in the other direction. So $s = \min(1.0,\ (1 + \text{tol})\, s(t),\ \gamma_{\text{wanted}}\, t\, s(t))$, each term a multiple of the preserving speed because every ratio here is linear in s, and a request the trim alone covers still lands on $s(t)$ exactly. The plant's ceiling binds only where there is no healthy room left to over-supply, which is what "every zone is faulted" means in a plan's limitation text. The raise is not free and the work order prices it: fan power goes as s^3, so 0.70 to 1.00 costs 2.92 times the fan power, and the plan states that multiple rather than implying it.

F. Evaluation evidence in full, R-1 to R-7

§11.1 and §11.2 carry the spike, the results table and each requirement's verdict. This appendix carries the evidence behind those verdicts: the spike's own caveats, the per-requirement narrative, the occupancy stratification, the baseline and learned-contender comparisons, and the per-seed detail. Every verdict and every regime qualifier also appears in the body; what is only here is the working.

F.1 The spike's two caveats

Two caveats that the spike's own result file states, and that bound every number above. The observer used *true occupancy*, so the healthy residual was pure sensor noise with no model error; the deployed observer carries the additional error of a smoothed estimate, which makes 0 of 20 an optimistic bound. And the worst healthy seed peaked at **149.1 ppm against h = 150 ppm**: a 0.9 ppm margin, with the next-highest seed at 91.6 ppm, so it is a tail draw rather than a design property. R-3 asks the same statistic to hold over seven days and six rooms, which is far more samples. That horizon has since been run, and the margin did not survive it: §11.2 measures **0.55** confirmed cases per fault-free week with a **worst week of 6** against R-3's limit of one, and measured 1.30 per week on the run this margin predicted. The tuning is therefore **no longer merely reported: it is measured, and it fails**. ADR-0010 has since named why the margin was so thin, and it was not the limit: each CUSUM arm was running against a plausibility guard that had been corrected onto the measurement, which made the statistic near-zero-mean and put it in exactly the i.i.d. regime the analytic run length assumes. That is why k and h are left where the spike put them rather than retuned (§13.4).

F.2 What the observer's occupancy dependency costs, stratified

That guard is not free, and Section 13.7 states its cost: in A145 (20 seats) or A115 (10 seats), a room holding two people has a ceiling far above anything a stuck damper produces, so the fault is invisible

until the room fills, and detection delay therefore depends on occupancy. The harness now prices that dependency at its two ends rather than describing it: with every room at design occupancy the p95 confirmation delay is **6 min**, and on a drawn weekday (the same fault, the same limit, the same seeds) it is **257 min**, with 5 of 20 injections never confirmed inside a twelve-hour window (§11.2). Two points are not a curve, but the closed-loop arm turns out to carry the points between them, and they were in the result file rather than missing from it. Its 20 runs are 20 *different* drawn weekdays, so they did not all present the same head count at the moment of the first ignored command, and the harness records that head count per run precisely so the correlation can be checked rather than taken. Stratified by it against A124's design occupancy of 8, the dependency is monotone and steep: **nothing at all is confirmed below 0.75 of design occupancy**, and above it the median delay falls from the 122 and 257 min of the two runs at 0.75, through 77 min over the eight at 0.875, to **31 min** over the five at 1.00. §11.2 gives the table and states plainly what kind of evidence it is: a stratification of the runs that happened, not a sweep of a controlled input.

F.3 R-1 to R-7, the measurements behind the verdicts

R-1 is met on the protocol it specifies and not met in closed loop, and both belong here. The stepped arm is what R-1's verification column names: the building settled, one command the frozen damper ignores, 20 seeds, delay measured from that command. At the deployed $h = 150$ ppm it confirms 20 of 20 injections with a p95 of **6 min** against a 15 min budget, and the sweep is almost flat: p95 moves from 5 min at $h = 50$ ppm to 8 min at $h = 300$ ppm, so a sixfold change in the limit costs three minutes. That makes h a false-alarm parameter rather than a speed parameter, which is why §13.4 prices it against R-3 and not against R-1. `fault-monitor`'s own R-1 test reports p95 = 6 min on the same protocol over the same seeds against a deliberately separate physics implementation, and the two agree to the minute: agreement across two independent plant implementations being the strongest available evidence that 6 min is a property of the detector rather than of either simulator.

The closed-loop arm injects the same fault on a drawn weekday with the inner loop commanding and the supervisor live, and it **fails**: 15 of 20 detected, median 74 min, **p95 257 min**, five injections never confirmed inside a twelve-hour window. The cause is observability rather than detector latency. The CUSUM is driven by the measurement against the plausibility ceiling of Section 7.2, the concentration the room would reach at design occupancy, while the controller issues its first ignored command as soon as the room passes its 800 ppm opening threshold, which on a drawn weekday happens with far fewer people present than that ceiling assumes. Until the room fills further the measurement stays under the ceiling and the statistic does not accumulate at all. The clock R-1 specifies starts at the ignored command; the physics does not start until later. Both numbers are reported because they answer different questions: 6 min is what the detector does when handed a step response to judge, and 257 min is what the building hands it.

That mechanism is not only argued, it is measured, and the measurement was already in the result file. The closed-loop arm's 20 runs are 20 different drawn weekdays, so the room held a different head count on each when the controller issued its first ignored command, and `T-24-detection-delay.csv` carries that head count, `occupants_at_ignored_command`, for every run. A124's design occupancy is 8 (§6.1), so the 20 runs stratify by the actual-to-design occupancy ratio the plausibility ceiling is sensitive to:

Occupants at the ignored command	Ratio to design	Runs	Confirmed	Delay min / median / max	
5	0.625	4	**0 of 4**	—	never inside 12 h
6	0.750	2	2 of 2	122 / — / 257 min	two runs, so no median
7	0.875	8	8 of 8	45 / **77** / 92 min	
8	1.000	5	5 of 5	21 / **31** / 44 min	

Occupants at the ignored command	Ratio to design	Runs	Confirmed	Delay min / median / max	
—	—	1	0 of 1	—	no ignored command was ever issued: the room never passed the opening threshold with the damper below it

The dependency is monotone, steep, and it has a floor: **below 0.75 of design occupancy nothing is confirmed at all**, because the measurement never reaches a ceiling computed at 1.25 times design. That is the mechanism stated as a measurement rather than as an explanation, and it is the curve §7.2's marker asked for.

What kind of evidence this is, stated rather than left to be assumed. It is a stratification of the 20 runs that happened, *not* a sweep of a controlled input, and three bounds follow from that. The strata are unbalanced (4, 2, 8 and 5 runs), so the 0.75 row is two observations and carries no median worth printing. The range sampled is only 0.625 to 1.000 of design, because that is what a drawn weekday puts in an eight-desk office; nothing here says what happens at 0.4 or at 1.5. And every point is one room, A124, at one limit, $h = 150$ ppm. A proper sensitivity curve would hold the occupancy ratio as an input and sweep it, which is a different experiment and has not been run.

One comparison in the table is worth more than the trend, because it separates two causes that are easily confused. The stepped arm's p95 of 6 min is *also* at an occupancy ratio of 1.0, and the closed-loop stratum at the same ratio has a median of 31 min. Those two numbers differ by a factor of five at identical occupancy, so the residue is **protocol, not occupancy**: the stepped arm hands the monitor a settled building, the inner loop switched off and one clean step to judge, while the closed-loop arm asks it to find the same fault in a room that is still filling and still being commanded. Occupancy explains the 257 min tail; the protocol explains the gap between 6 and 31 min at the top of the range.

The baseline comparison, which is the project's central claim, needs stating carefully. T-25 scores the deployed monitor and a fixed CO_2 threshold on the identical per-minute measured series from the identical runs: 20 seeds with a stuck damper for detection, the same 20 seeds over a fault-free week for false alarms. The threshold was tuned over 6 limits × 5 durations *on the very runs it is then scored on*, which flatters it, and that is deliberate: the question is whether a model of what the command owed beats the best a fixed threshold can be made to look, not whether it beats a careless one.

Measured, the monitor is ahead on every axis the experiment reports: detection **0.75** against **0.45**, alarm volume **0.55** against **2.35** per fault-free week, median delay **74 min** against **126**, Youden's J +0.55 against +0.30, and **0** healthy rooms flagged against 1. The best the grid can be tuned to is 900 ppm sustained for 5 min.

Until this revision the paragraph above said something weaker, and the correction is worth owning because it runs in the design's favour. The prose was describing a *pre*-ADR-0010 run, in which the monitor sat at 1.30 alarms per fault-free week and the threshold was consequently ahead on Youden's J at +0.25 against +0.20: a genuine trade, and the report called it one rather than claiming a win. ADR-0010 halved the monitor's alarm volume with its detection unchanged, the committed result file has been post-fix since, and the prose had not caught up: the report was contradicting its own repository and understating its own result. A correction in this direction deserves more scepticism than one that costs something, so every figure in the preceding paragraph is read off `evaluation/results/T-25-baseline-comparison.csv` as committed, and re-running T-25 reproduces that file byte for byte.

The discriminating comparison is at equal alarm volume, and it is the one the claim rests on. At 900 ppm sustained for 30 min the threshold raises **0.40** alarms per fault-free week (the closest match in the grid to the monitor's 0.55) and detects **0.15** of the faults against the monitor's **0.75**, taking 312 min to do it against the monitor's 74. So the honest ratio at equal alarm volume is **five**

times, and the *fifteen*-fold figure this report used to quote belonged to the pre-ADR-0010 operating point and is not true now. The ratio has moved twice as this number was re-measured (fifteen, then two and a half, now five), which is itself the reason it is quoted with the operating point attached rather than on its own.

T-29 re-matched the same grid on a *held-out* fault-free week, and there the threshold does worse again: **0.05** detection at 0.65 alarms per week, with a 296 min median delay. The gap between those two numbers is itself a measurement. Scored on the runs it was tuned on the threshold reaches 0.15 at a matched alarm volume; scored on a week it has never seen, 0.05. **Most of the baseline's apparent strength is the tuning-on-test advantage this comparison deliberately granted it**, and naming that is worth more than either ratio alone. **Two bounds still travel with the result**: both detectors were scored against the generator that produced the faults (§11.5), and the monitor also names the fault and carries its evidence while a threshold reports only that a room is above a number, which is not a detection-rate advantage and is the reason the system exists. The claim survives in direction at every one of these points; its magnitude depends on which is quoted, so all of them are, and **five is the one to defend**.

The third detector in that contest is T-29's learned contender, and it is dropped on the numbers it lost by. The test plan specified it as optional and kept only if it wins. It is a one-class novelty detector fitted on a fault-free commissioning window *only* (it never sees a labelled fault), scoring each minute by its distance from what the room looked like when it was healthy, over the features the monitor already computes. Thirty operating points, 20 seeds, scored on the same held-out week. **No point on the grid beats the monitor**: to reach its 0.75 detection the contender raises **11.25** alarms per fault-free week against **0.55** and takes a **518** min median delay against 74: about twenty times the false alarms and seven times the delay. Loosening it until it detects everything costs 475.10 alarms a week, which is not a detector.

The interesting part is *why*, and three measurements pin it rather than asserting it. First, **the contender's misses are exactly the monitor's**: the same five seeds, at every operating point but the loosest. Both read the same residual, so what limits detection on this plant is the evidence the residual carries, and **a learned decision rule cannot add evidence**. Second, the contender scores each minute on its own while the CUSUM accumulates; its only lever on in-control run length is a persistence requirement, which is the one part of it that is hand-set rather than learned. The observer re-anchors the residual towards each reading, so a stuck damper's excursion decays rather than persisting: the signal shape a cumulative statistic survives and a per-sample quantile does not. Third, the loss is not an artefact of its training: all twenty commissioning windows were clean by the monitor's own judgement, none of the 120 per-room fits was degenerate, and the alarms it is dropped for are counted on the held-out week. This is the result the project wanted from an optional contender: not that learning cannot work here, but a measured statement of what it would have to beat and by how far it failed.

R-2 is met on the case it covers, and the case it fails on is worth more than the pass. On a drawn weekday the faulted room holds 1.000 of its occupied minutes at or below 1000 ppm on all five seeds, and the figure is unchanged with the lower CUSUM arm off and with the harness's damper feedback off, so neither the two-sided statistic nor that fidelity control is doing the work. The reference arm is what makes the result readable: a run with *no fault at all* scores 1.000 and meets the criterion 5 of 5 in *every* case, including the one R-2 fails. That is the evidence that the plant is now correctly sized for the speed it runs at (§13.3), and it is what pins the surviving failure to one thing rather than to the building. With a stuck damper *and* every room simultaneously at its design head count, the supervised arm holds only 0.022 of occupied minutes and **0 of 5 seeds** meet the criterion, against 0.009 with the supervisor dead. **All five latch and all five carry a plan** (at minutes 481, 481, 481, 494 and 496), so none of them fails for want of a diagnosis. They fail for want of air, and the limitation each plan states says which lever ran out. On *one* seed the solver reports that every zone is faulted, so no healthy damper is left to trim and the gain of **1.43** is fan speed alone, 0.70 raised to its 1.00 ceiling. On another every healthy damper is already at its own minimum, so again only the fan is

left, and there it is the healthy rooms' own 5 % tolerance rather than the plant that stops it, at 0.735 and a gain of **1.05**. On the remaining three the trim runs to 0.82, 0.65 and 0.59 with the fan at 0.77, 0.77 and 0.81, reaching gains of **1.29, 1.62 and 1.77** with the healthy-flow deviation spent in full at exactly 0.0500. **So on four of the five it is the 5 % healthy tolerance that binds and not the plant's ceiling**, which is the same bound §7.4 names, arriving in the regime where it costs something. So the mechanism works where it runs and is worth +0.012 of occupied minutes, against a fault that costs 0.991. And the gap is not close: the solver's own comfort rule, $(C_{\text{measured}} - C_{\text{out}})/(C_{\text{target}} - C_{\text{out}})$, asks for **2.3 times** the room's flow at the unsupervised mean of 1754 ppm, against the **1.05 to 1.77** the plan reaches. **Compensation redistributes flow and buys a bounded amount of new flow from the fan, and a building already at design occupancy needs more than either gives.** That is the plain statement of R-2's failure and of its mechanism.

On every one of those five seeds the trim lever has already been damaged before the supervisor is asked for anything, and that is the larger finding. Each run carries at least one *other* room latched with no fault injected in it: one room on two of the seeds, two on another and four on a third, and on the one whose plan reports every zone faulted, all five. A latched room is counted among the faulted ones, so it is no longer a healthy damper the solver may trim: **R-3's false alarms consume the lever R-2 depends on**. The same effect appears on the drawn weekday from the other direction, where on two of the five seeds the room is never confirmed at all and no plan is reached: R-1's closed-loop miss arriving inside R-2's experiment. **R-2's design-occupancy failure is therefore substantially a *consequence* of R-3 and R-1 rather than an independent shortfall**, which also means it was never going to be fixed in the solver. ADR-0009 settles the part that could have been: the healthy-room airflow allowance was swept closed-loop from 0.05 to 0.99, one clean build per setting, and it does not move R-2's criterion by a single seed (0 of 5 at every setting, with byte-identical per-seed fractions) because with every healthy damper on its floor the fan lever is not selective and the plant caps it at 1.43 against the 2.00 to 3.30 the regime asks. The plant's own bound was then measured, with every unlatched room driven to its minimum position per room rather than by one common trim and the fan at its ceiling: it reaches only **2 of the 5 seeds**, and on a third it **starves A145 to 1033 ppm**. That last number refutes the premise the sweep was testing (that surplus air costs fan energy rather than comfort) because a per-room trim takes air from the open healthy rooms as well as giving it to the nearly shut ones. The constraint was therefore left at 0.05, with the two sides separated in the code because they are genuinely different quantities, and R-2's verdict is unchanged (ADR-0009).

One finding in this experiment is larger than R-2's verdict, and it is reported here rather than left in the result file. Until the final run the solver had a single lever: trim the healthy dampers so the proportional split hands the frozen room a larger share. On a drawn weekday every damper sits on its 0.15 occupied-hours floor when a plan is solved, so that lever was exhausted before it was ever used: every plan came back `trim 1.00, fan 0.70, gain 1.00` and the supervisory loop measured +0.000 of occupied minutes. At design occupancy the trim did reach three of the five seeds and bought +0.008, and the mean CO_2 over those same runs is what makes that figure unreadable on its own: the supervised arm's mean in the faulted room was **1788 ppm against 1754 ppm with the supervisor dead**, so the mechanism this project is named for left the room **34 ppm worse** than no supervision at all, for the price of a fan command, a work order and a mode change. What found it is the shape of the experiment rather than a reading of the code: T-26 runs an unsupervised arm beside the supervised one on the same occupancy draw, and nothing else in this project could have given that comparison a sign. The fix follows from the split law rather than from tuning: $Q_i = Q_{\text{fan}} a_i / \Sigma a_j$ is linear in s, so raising the fan multiplies *every* room's flow including a frozen room's, and the same regime now measures **1618.9 ppm** supervised against 1753.6 unsupervised: **135 ppm** of help where there was 34 ppm of harm. Three bounds travel with it. The fan lever is **not selective**: with no trim in force $A(t) = A_0$ and both ratios collapse to $r = \gamma = s/s_0$, so the frozen room's gain equals the healthy rooms' over-supply exactly, which means ADR-0008's 43 % of headroom is spendable selectively only *through* a trim and the lever is bounded by the 5 % healthy-flow tolerance rather than by the plant's ceiling: the ceiling binds only where no healthy room is left to over-supply. R-2 still fails this case. **And the**

charge this lever once carried against R-3 is withdrawn rather than renumbered. It read that spending fan speed moved R-3 from 1.25 to 1.30 confirmed cases per fault-free week, because a false alarm now draws a bounded fan raise that perturbs all six rooms, with the alternative measured rather than argued: keeping the no-op trim in the published plan dropped R-3 to 0.55 and would have passed it, while costing R-2 0.054 of occupied minutes and failing it by taking five healthy rooms off CO_2 control to hold them where they already were. All of those R-3 figures were measured against the *pre*-ADR-0010 detector, in which both plausibility guards were being corrected onto the reading and every CUSUM arm was running on a filter error. And ADR-0010's attribution accounts for all 26 of those confirmations without the fan: the 13 cascaded ones ran through the *believed* damper opening that a confirmation pins in `AhuFlowModel`, not through the fan command, and the re-anchor that closes that path is now shipped. ADR-0009 adds that the *size* of the lever does not move R-3 either, the over-supply allowance having been swept from 0.05 to 0.99 with R-3 unchanged at every setting. One extra confirmation in twenty weeks is inside the burst distribution those weeks have, so it is not re-asserted as this lever's price; what is honest is that the lever's separate cost to R-3 has not been re-measured since the fix, and that the rate with the lever in force is **0.55** per week (§11.2). The R-2 half of the alternative stands exactly as it was measured.

Case B (a damper genuinely shut at opening 0, which ADR-0008 places outside R-2's scope) is measured for the bound rather than for the requirement: 0.153 of occupied minutes at or below 1000 ppm, `compensates()` false, achieved gain exactly 1.000, and the real flow split with A124 shut and the fan at 70 % is A125A 16.7, A125 30.7, A116A 49.8, A115 107.3, A124 0.0, A145 208.5 l/s. The simulator cannot express this case: `VentilationZone`'s invariant clamps a stuck damper at 0 back to the room's 0.15 floor, which is ADR-0008's own decision rather than a bug. Case B is therefore integrated from the same `Co2MassBalance` and the same `FlowSplit` the simulator uses, at the same 1 s step and on the same occupancy draw, with the airflow a shut damper actually receives: zero. The bypass is declared in the harness's own output, not only here.

R-3 is not met, and it is the requirement this design does not meet. Over 20 fault-free simulated weeks of all six rooms the monitor raises **0.55 distinct confirmed cases per week** against a limit of one: **16 of the 20 weeks are clean** and the worst still raises 6. Before ADR-0010 the same experiment measured **1.30 per week with 9 clean weeks**, so the rate has more than halved and seven more weeks have come clean while the verdict has not moved: the harness scores the *worst* week, and that is the criterion this requirement is judged by. The rate is driven by a minority of weeks rather than spread evenly, which is what a tail-draw mechanism looks like and is what §11.1's 0.9 ppm margin predicted. A case is counted once, by distinct `caseId` reaching `CONFIRMED` rather than by published events, because a latched case republishes its state on every probe and counting events would charge the monitor a dozen alarms for one accusation; the threshold it is compared against is counted the same way, by episode.

The mechanism is attributed, and the attribution is worth more than the halved rate. It was measured rather than argued: the replay was instrumented and all **26 pre-fix** false confirmations (the 1.30 per week over 20 weeks that the sentences above quote, before ADR-0010) classified by room, hour, CUSUM arm and whether any room had already been pinned. The committed replay, post-fix, carries **11**. **13 were primary** and **13 cascaded**; **17 came from the upper arm** and 9 from the lower; all six rooms confirmed at least once, at hours spread across the whole working day, so it is neither a morning fill nor a warm-up artefact. The cause is **one defect with two faces**. `ZoneObserver.correctTowards` pulled *both* plausibility guards 30 % of the way onto every reading, so neither guard was a bound: each was a first-order filter of the measurement sitting a fixed offset away from it, which makes measured minus ceiling the error of that filter rather than a statement about occupancy. Each CUSUM arm was therefore driven by a near-zero-mean statistic, exactly the i.i.d. regime Siegmund's ARL_0 assumes, and over 120 room-weeks it duly fired. The trace is unambiguous: in a ten-seat room whose design-occupancy trajectory settles near 1500 ppm, the ceiling sat 50 to 80 ppm *above* the reading all day, so nine people arriving walked the measurement straight through it. The floor had the mirror defect, dragged *up* onto the reading and crossed from above by every departure, which is why the lower arm's confirmations cluster at 16:00 to 19:00 when offices empty.

And the cascade is the same defect at one remove: a false `STUCK_DAMPER` pins the room's believed opening in `AhuFlowModel`, the split is a ratio over all six rooms, so the other five are credited with air they are not getting, their filtered ceilings fall below their readings and they confirm in turn. One seed latched four rooms in 53 minutes and another latched all six (ADR-0010). The cross-room cascade an earlier pass blamed, which charged the *response* to a diagnosis rather than the belief behind it, stays ruled out *on the drawn weekday*: T-34b records 0 fault events and 0 degraded rooms across all 270 drawn-weekday observations in rooms with no injected fault. **At design occupancy it is not ruled out at all**: the same experiment's second arm accuses 215 of 270 observed rooms, and the supervisor-dead pass shows the accusations are the monitor's rather than the compensation's. That is this same rate, measured by a different experiment in a regime R-3's own replay does not visit, and §11.6 records it as the cross-requirement pattern it is.

Half of that defect is corrected and half is deliberately not, and the half that is not is the more interesting decision. Taken: the guarded lower arm now runs against the one bound that needs no anchor (the outdoor concentration less the overnight-floor allowance), and a confirmation that pins a damper re-anchors the other five rooms and resets their arms, because a step change in the believed airflow makes every ppm banked before it a statement about a different building. That is what took the rate from 1.30 to 0.55 and the clean weeks from 9 to 16, and it moved *no* other requirement: R-1's stepped p95 of 6 min and closed-loop 15 of 20, R-2, R-4 at 23 of 23, R-6 and R-7's drawn-weekday 0 of 270 are all unchanged. **Not taken: making the upper arm's ceiling a bound as well.** That variant was built and measured, and it makes **R-3 pass outright**: 0.00 false confirmations per week, 20 of 20 weeks clean. It was **declined on evidence**, because it takes **R-1's closed-loop detection from 15 of 20 to 1 of 20**, **T-27 from 23 of 23 assertions to 19** and **R-7 from 0 of 270 observed rooms failing to 2**, and because sweeping the plausibility ceiling's headroom finds no setting that recovers them: detection is 1 of 20 at 1.00 and 1 of 20 at 1.25, and below 1.00 the ceiling stops bounding occupancy at all. The arithmetic behind that is structural rather than a threshold. The closed-loop fault is worth about **86 ppm** of steady state at A124's drawn occupancy of 4 to 5 of its 8 desks, against **270 to 600 ppm** of ceiling headroom; and those detections are real rather than the same false alarms landing on a faulted room, because run as a pair the baseline latches A124 15 of 20 with the fault injected and **0 of 20 with nothing injected**. Both numbers come from one knob, what the CUSUM's reference is, and there is no setting of it that meets R-3 and keeps R-1's closed-loop arm. Breaking that tie needs a second, occupancy-free detection path rather than a better reference (`ZoneObserver.stepAmplitudeRatio`, which the classifier already reads as a signal and no CUSUM does), and that is design work rather than a parameter (ADR-0010). What is left unattributed is narrower than it was and worth stating exactly: the residual **11** confirmations sit in 4 weeks (6 on seed 2, 3 on seed 20, and one each on seeds 7 and 11), and seed 2's six are all on the upper arm, all after one primary on A124 at Wednesday 13:39.

R-6 is met, and its headline number is an extrapolation rather than a measurement. The sweep runs to **25 600 zones at a p95 of about 6 s**, roughly a tenth of the 60 s interval and a factor of over 4000 above the six rooms the system actually serves, so no measured point breaks the budget. That largest point is quoted to the precision the machine supports rather than to three decimals: it has come out at 5.676, 5.740, 5.759, **6.008** and 6.052 s over five runs on the same laptop (the fourth of those being the committed run this report quotes from), a spread of about 7 %, because this is the one experiment in the harness that measures real time. The breaking point is therefore read off a fit: over the nine points from 100 zones up, $\text{p95} = 1.196 \times 10^{-8}\, n^{1.97}$ s with $r^2 = 0.9991$, which crosses 60 s at about **86 000 zones**. And it moves with the run that fitted it: the committed run gives 85 992, while earlier runs of the same code gave 87 338, 88 109 and 87 521. So the figure carries one significant digit, 86 000 is the committed one, and the 86 000–88 000 spread is its only error bar. The harness labels it an extrapolation in those words and this report keeps the label; what is *measured* is the shape and the cause. The fitted exponent is 1.97 against a theoretical 2 and reproduces across runs, and the direct evidence is the $p95/n^2$ column: it falls while per-zone fixed costs dominate and then settles on 8.2–9.2 ns across the last seven points, 400 to 25 600 zones, a 64-fold range of n, which neither a linear nor an $n \log n$ cost would do. The saturated element is named rather than guessed:

`AhuFlowModel.believedFlowTo` sums every zone's opening to normalise the proportional split, and every zone's observer asks it, so one cycle is $\Theta(n^2)$ in the zone count. That is the computational price of ADR-0008 option B: one shared handler means every room's prediction depends on every other room's damper, and there is no decomposition that avoids the sum. At six rooms the price is 0.007 ms, which is why the decision was right. Reading ingestion was never close to the bottleneck: it stays at 0.89 ms p95 for 25 600 readings, three orders of magnitude under the cycle, against a risk register that had nominated the time-series query as the likely limit.

R-6 now has a second ceiling, and it is three orders of magnitude below the first. The capability is no longer harness-only: `ZONE_COUNT` is settable from the environment, all seven project-authored containers read the same one the way they already share `REAL_EPOCH` and `TIME_SCALE`, and the stack was brought up and observed at 12 and at 58 zones with the default six-room corridor unchanged end to end. **58 is a hard ceiling, and it is BuildSim's rather than the monitor's**: it refuses to host equipment in a room its floorplan does not have, so a deployable zone must be named after a real one, and level 0 of the A building has 52 further rooms of comparable size. Verified in both directions: `ZONE_COUNT=58` runs, `ZONE_COUNT=60` dies with `room "A124S9" does not exist on level "level0"`. So **R-6's breaking point remains a harness measurement** and this report does not claim otherwise; what the wiring buys is a deployed system that can be scaled and watched at all. One honesty note travels with the synthetic zones: a zone past the sixth takes a real level-0 room's *name and location* so BuildSim can carry its sensor and damper, while its volume, floor area, damper authority and occupancy schedule are a cycled copy of one of the six. `A119` is 109.6 m^2 in the floorplan and is simulated as a copy of `A125A`'s 18 m^2. A synthetic zone is therefore representative in size, time constant and head count, and is not a claim about the room whose name it borrows.

R-7 is met on the drawn weekday and fails at design occupancy, and the two numbers must always travel together. Each of the six rooms takes its turn as the injected room, on three seeds, in three configurations (the deployed guarded lower arm with the supervisor live, the arm off with the supervisor live, and the guarded arm with the supervisor dead, 90 observed rooms each), and each observed room is compared with *itself* in a fault-free run on the same seed rather than with a neighbour. On the **drawn weekday**, across all three passes, **0 of 270** observed rooms failed: no fault event in a room with no injected fault, no room degraded, no room outside the fault-free CO_2 band, and both the plan's own airflow figure and an independently recomputed `FlowSplit` at 0.0000 against a 5 % tolerance.

At design occupancy the same experiment fails 231 of its 270 observed rooms, and the way it fails is the result rather than the count. The two failing clauses are **disjoint**: 215 rooms were themselves *accused of a fault they did not have*, and a further 16 sat outside the airflow band at a worst deviation of **0.058919**: 215 plus 16 is the 231, so neither clause is standing in for the other. They also attribute in opposite directions, and the supervisor-dead pass is what separates them. Accusations run **85 of 90** rooms with the supervisor dead against 130 of 180 with it live, so they are the regime and the monitor rather than the response to the fault: compensation slightly *suppresses* them. Airflow breaches run **0 of 90** dead against 16 of 180 live, so that half is the compensation's own cost and nothing else's: a dead supervisor produces no plan to charge anyone for. **The accusing half is R-3's false-alarm rate arriving inside R-7's experiment**, which is the same cross-requirement pattern §11.2 already records for R-2, and ADR-0009 predicted it in those words while noting that no experiment asserted R-7 in that regime. One does now, and they collide.

The mode clause is no longer unexercised, and the requirement now fails under either reading. The drawn-weekday pass reported it as satisfied by accident rather than by design: a plan was in force in 16 of the 18 injections in each supervised pass and every one came back with a trim *factor* of exactly 1.00 — no trim at all, which publishes no damper command, so no healthy room left `NORMAL` control, and the record named the honest re-test as an experiment that *forces* a trim. The design-occupancy arm is it: **40 of 540** rooms reach `COMPENSATING`. So R-7's literal wording fails on 40 rooms and ADR-0008 consequence 9's defensible reading fails on 16, and choosing between the two readings no longer rescues the requirement. `DEGRADED` reaches **130 of 540**, which is the half that

matters: a degraded room is one the monitor accused and took off demand control, and §11.2 records 130 of the 215 falsely latched rooms in exactly that state.

One of the two airflow columns cannot falsify this requirement and should stop being quoted beside one that can. `CompensationPlan.worstHealthyFlowDeviation()` reaches 0.0500 and no further in any regime, because the solver caps the fan at the speed that makes the figure exactly `HEALTHY_FLOW_TOLERANCE` and then reports that cap: it is the solver quoting its own constraint back. The independently recomputed `FlowSplit` deviation is the only one of the two that can fail, and it does. Behind that sits an unresolved question that is ADR-level rather than a code change: **the 5 % bound's reference plant is ambiguous**. The solver bounds its claim over each latched room's *latch-time* opening while the recomputation uses its *pre-latch* one, which on one seed gives the same room 48.7940 against 38.4015 and the ratios 1.050000 against 1.058919. The two coincide until a second room latches inside one episode, which the drawn weekday never does and design occupancy routinely does. Both are defensible readings of "before the compensation"; ADR-0008 consequence 9 never says which.

The one large column is the *measured* end-to-end flow gap, **0.00 to 6.10 times the fault-free flow** over the 540 observed-room rows, and it is not a violation: a damper frozen near its minimum stops competing for the shared fan, so the five rooms *gain* the air it is not taking. ADR-0008 priced that coupling explicitly, and the 5 % tolerance bounds what compensation takes from the healthy rooms, not what the fault gives them.

G. Every measurement and its bound, in one place

So that nothing in this report can be mistaken for measured. What was a fourteen-row table is seven rows: the six requirement-level experiments that filled it have run and are reported in §11.2, and a seventh row records an experiment this report did not originally plan. The occupancy sensitivity the first asked for was already in T-24's own result file, R-5's rebuilt case and T-23's dashboard frames were captured from a live demo-profile run, T-27's kills were repeated against `docker compose`, T-15's confusion matrix has been measured over 218 runs, T-29's optional contender has been measured and dropped, and T-35's reordering of the diagnosis has been measured and not adopted, so **every row in this table is now filled**, and each keeps the bound on what its evidence actually is. That is not the same as every requirement passing: R-1 and R-3 still fail on the arms named in §11.2, R-2 and R-7 fail on the harder of their two occupancy regimes, and T-15 reports that one of four injected mechanisms is classified rather than all of them. The table being full means nothing in this report is waiting on a measurement, not that the measurements came out well.

One result is worth stating separately, because the obvious way to test it measures the wrong thing. All ten services declare `restart: unless-stopped`. After `docker kill` both killed containers sat at exit 137 with a restart count of **zero**, which looks like a broken policy and is not: a kill issued through the daemon is recorded as a manual stop and deliberately suppresses restarts. Nor does `SIGKILL` work from inside, because PID 1 in these images is the JVM itself with no init wrapper, and the kernel ignores `SIGKILL` sent to PID 1 from within its own namespace. The signal that does work is `SIGTERM` delivered inside the container: Quarkus handles it, the JVM shuts down of its own accord, and Docker sees a process that exited rather than one that was stopped. Measured that way the policy fires: exit code 0, **restart count 1**, and the container back in `running` within 3 s. **The distinction is the finding**: a chaos test that only runs `docker kill` cannot tell a working restart policy from a missing one, and would have reported this configuration as broken.

Req.	Run	The number that must replace the marker	Where it goes in this report
R-1	T-24	**Filled, with a bound on what it is.** Detection delay against the actual-to-design occupancy ratio is now read off the closed-loop arm's own per-run head count: 0 of 4 confirmed at 0.625 of design, then 122 and 257 min at 0.75, 77 min median at 0.875 and 31 min median at 1.00 (§11.2). It is a stratification of 20 drawn weekdays rather than a sweep of a controlled occupancy, over one room and one h, so a true sensitivity experiment is still a different run	§7.2, §11.2
R-4	T-27	**Filled, except for the restart policy.** The kills were carried out against `docker compose` on `daa2d5c`. Stopping `co2-sensor` put five of six rooms in `BLIND` within 12 s; the sixth was latched and stayed `COMPENSATING`, which is the design. No new diagnosis was raised while blind, and no healthy room was commanded. The only commands issued were the latched room's held position and the fan. Recovery ran `BLIND` → `WARMUP` → `HEALTHY` across all five rooms in three cycles. Killing `fault-monitor` left ventilation running; killing `supervisor` mid-compensation left the fan at 158.3 W, raised no new strategy and kept A115 latched. The restart policy is measured too, once the kill is delivered in a way Docker counts: see §11.6	§3 status, §11.2
R-5	T-20	**Filled, with a bound on what it is.** A diagnosis was rebuilt from the journal live, in the recorded demo run: `GET /api/cases/aecd9137-6c3d-42a8-ac11-438ef3d9d2d6` returned HTTP 200, 77 248 bytes and **445 events** (every reading, residual and CUSUM value in sequence) against a real TimescaleDB rather than a test double (`evaluation/results/T-23-demo-run.txt`, §5). The `caseId` was the one that run produced rather than a randomly chosen one. **R-5 now has an integration test as well**: eight tests execute `replayCase`'s real SQL against a real PostgreSQL, including the one-hour evidence lookback, and they bound reconstruction fidelity at half a microsecond because a `timestamptz` round trip rounds rather than truncates	§3 status
R-1, R-3	T-15	**Filled, and it is the least flattering result in this report.** 218 runs over the four injectable faults plus a no-fault arm. `STUCK_DAMPER` is named correctly; `BLOCKED_FILTER` confirms as `UNCLASSIFIED` 11 of 11, as predicted; `SENSOR_DRIFT` is **never emitted at all** (0 of 76 runs from a drift ramp over 5–160 ppm/h *and* 0 of 76 from a step offset over 50–700 ppm), so **one of four mechanisms is classified**. The no-fault arm is silent on 10 of 11 seeds, and the one false positive arrives as a *named* damper in a *named* room rather than as `UNCLASSIFIED`, which is a worse failure than a vague one (§7.3)	§7.3

Req.	Run	The number that must replace the marker	Where it goes in this report
R-1, R-3	T-29	**Filled: measured, and dropped.** A one-class detector fitted on a fault-free commissioning window only, scored on a held-out 7-day week over 20 seeds and 30 operating points. At the incumbent's 0.75 detection rate it costs about **20× the false alarms** (11.25 against 0.55 per week) and **7× the delay** (518 against 74 min), and no point on the grid beats the monitor. Its misses are *exactly* the monitor's (the same five seeds), which is the finding: what limits detection here is the evidence the residual carries, not the decision rule, and a learned rule cannot add evidence (§11.2)	§11.2, §13
—	T-23	**Filled, and re-captured after the room-layer fix.** Seven frames from a live demo-profile run: the dashboard with its detector deliberately not firing at simulated 10:01, the same table with A115 `CONFIRMED` at 10:23, BuildSim's floor plan beside the supervisor's work order at that instant, and **all four layers at one instant**, the last of which could not be taken at all before the collection defect was fixed, because three of the four never reached BuildSim. No requirement states what the view must show, so this is evidence the operator path works rather than evidence against a criterion	§12
R-1	T-35	**Filled by an experiment this report did not originally plan, and the answer is no.** The stuck-damper leaf accepts `NOT_JUDGED` because a probe can only be requested once a case is latched, so the obvious remedy is to withhold the diagnosis until a probe has landed. Built, and measured over 176 paired runs on identical seeds: detection moves in **0 of 88 pairs**, the fault is named on a genuinely judged step in 28 of the 39 runs that defer against 0 before, and the settled classification is **identical in all 88 pairs**, because the judged step returns `MISSING` for every condition, including nine rooms whose dampers are in perfect health and one run with nothing injected. **Not adopted** (§7.3, §13.6)	§7.3, §10, §13.6

H. Dashboard evidence, and the defects the capture found

§12 carries the two frames that make its argument. These are the rest of the captured evidence, and the two defects and one limit the capture exposed.

H.1 The remaining captured frames

Ventilation supervisory view — corridor A120, level 0

2026-10-09T10:23:27.550177620Z · refreshing every 5 s · a room is stale after 180 s without a reading or residual

broker: connected | BuildSim layers: publishing | journal: available

Room	CO2 (ppm)	Residual (ppm)	CUSUM (ppm)	Monitor state	Classification	Control mode	Age (s)
A125A	722.4	-10.2	0.0	HEALTHY	NONE	NORMAL	26
A125	800.3	42.9	0.0	HEALTHY	NONE	NORMAL	26
A116A	672.5	12.1	0.0	HEALTHY	NONE	NORMAL	26
A115	990.4	277.9	265.9	CONFIRMED	STUCK_DAMPER	DEGRADED	26
A124	768.2	20.6	0.0	HEALTHY	NONE	NORMAL	26
A145	673.3	-44.7	0.0	HEALTHY	NONE	NORMAL	26

Air handler	Fan power (W)	Fan speed	Age (s)
AHU-A120	137.9	74%	48

A dash means no live value: either nothing has arrived yet, or what did arrive is older than the staleness window and is not shown as if it were current. Machine-readable: /api/state; one reconstructed case: `/api/cases/{caseId}`.

Figure 1: Simulated 10:23:27, the same run. A115's row is pink and bold: 990.4 ppm, residual 277.9 ppm, CUSUM 265.9 ppm, `CONFIRMED` / `STUCK_DAMPER` / `DEGRADED`, with the air handler at 137.9 W and 74 %. The other five rooms are `HEALTHY` at CUSUM 0.0, which is R-7's isolation visible in one frame. All three dependency pills are green, including `BuildSim layers: publishing`.

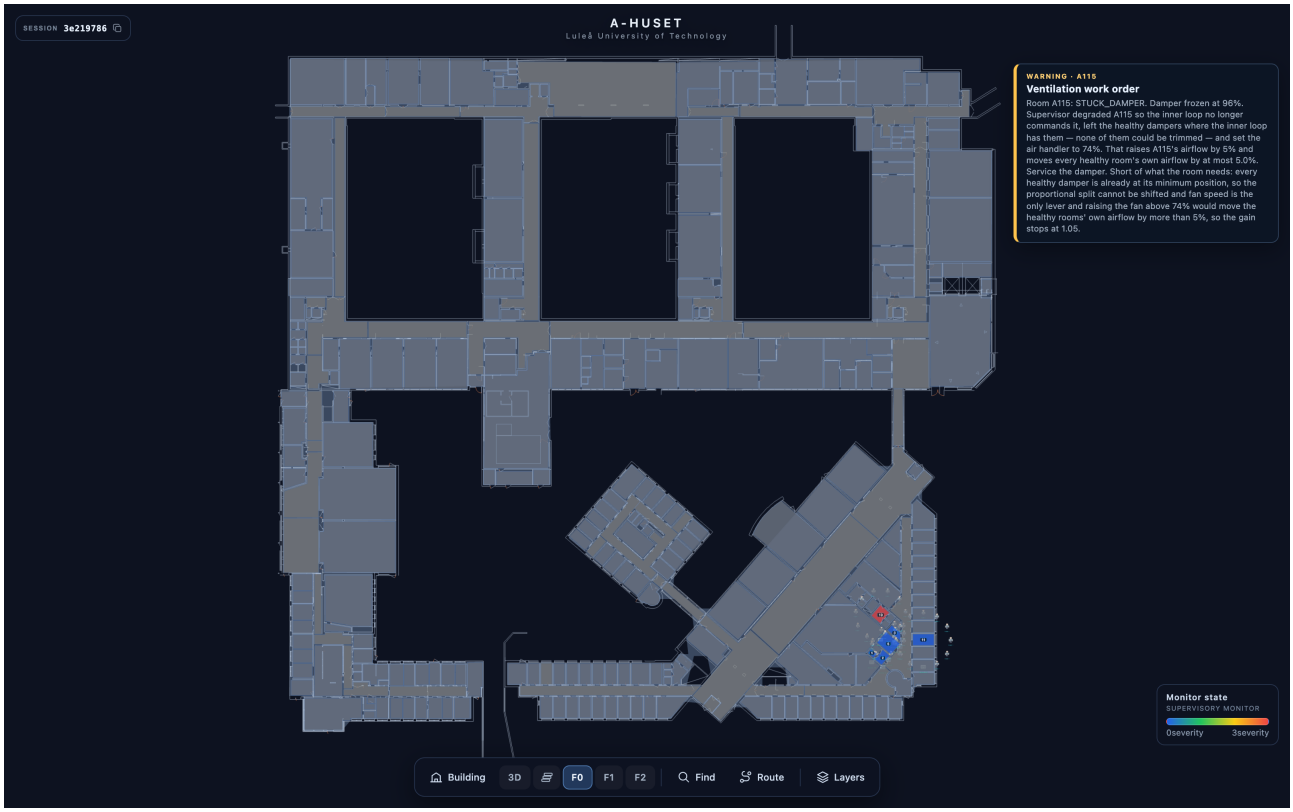


Figure 2: The same instant on BuildSim's own floor plan, `?layer=state`. A115 is the single hot room. The panel on the right is rendered by BuildSim from the alert the *supervisor* PUT, and it names the diagnosis, the action taken and the bound the plan ran into: the fan cannot be raised above 74 % without moving the healthy rooms' own airflow by more than 5 %, so the gain stops at 1.05. The legend at the lower right is the severity scale the `state` layer is painted on.



`co2`: A115 at 562 ppm, second *lowest* of the six



`residual`: A115 at the scale floor, −100



`cusum`: A115 at 0.0, like every other room



`state`: A115 at severity 3, the only non-zero room

Figure 3: Corridor A120 painted by all four layers at one instant, simulated 11:40:55, with A115 latched and `COMPENSATING`. **This is the argument of Section 12, measured rather than asserted.** Compensation has done its job, so on `co2` the broken room is the second coolest on the floor (562 ppm against its neighbours' 478–747), on `residual` it sits at the bottom of the scale, and on `cusum` it is indistinguishable from five healthy rooms. Only `state` still says the equipment is broken. **This figure could not be taken before the room-layer defect below was fixed**, because three of these four layers never reached BuildSim.

H.2 Two defects the capture found, and one limit it exposed

The layers were overwriting each other. `/api/room-layers` is a collection endpoint and a PUT replaces the whole collection, exactly as `/api/alerts` does, and the dashboard was publishing its four layers one at a time, so each call erased the one before it. Only the last layer of the enum, `state`, ever reached BuildSim; the other three selected nothing. Every individual PUT returned 200, so nothing anywhere said so, and the adapter's own work-order path had the collection semantics right the whole time two methods away. The fix is to send every layer on every call, and the regression test drives a real HTTP stub rather than a mock, because the defect was in what went over the wire. A mock of the adapter's own method would have asserted the bug. The run above confirms it against the real stack and not only the stub: `GET /api/room-layers` returns **four layers of six zones each**.

A compensated room is painted exactly like a dead sensor. At the instant of the four-layer figure A115's true residual was −303.9 ppm. The `residual` layer's range starts at −100, so `RoomLayer.onScale` clamps it to −100, and −100 is also the value that same method returns for a *stale* room, because the bottom of the scale is the only no-data encoding BuildSim's layer API offers. On that layer a deeply compensated room and a room whose sensor has died are therefore the same colour. The range itself is not the error: it was set from measured healthy residuals spanning −76.5 to +80.3 ppm and a stuck damper's post-command mean of 507.8 ppm, and widening it to reach −400 would spend most of the scale on a regime the operator almost never reads, making ordinary healthy variation invisible. So this is recorded as a limit rather than patched: the dashboard table carries the true number one click away, and the `state` layer already carries the fact that matters. It is also a limit that *only became observable* once the layers started arriving at all.

`SUSPECT` cannot be photographed, and now that is measured. A 1 Hz poll of `/api/state` across the whole run caught A115 in `SUSPECT` in **2 of 295 usable samples** (296 polls were written and the last was truncated by the teardown), CUSUM 108.5 then 153.5 ppm, on residuals of 274.9 and 190.8 ppm, against a page that refreshes every 5 s. A state that persists for two seconds may never be drawn at all, so it is evidenced from the `decisions` journal and from the poller, and the screenshots are taken only at states that latch. The instrument, not the intention, is what decides which evidence a behaviour can carry.

I. Risks and critical reflection, in full

§13 states each finding, its verdict and its bound. This appendix carries the mechanism behind each one. The subsection numbering follows §13 so a reader can move between them.

I.1 Four functional holes, two of which are now closed (§13.1 in full)

A damper stuck *wide open* is invisible at the deployed setting. The statistic is two-sided: the lower arm is the exact mirror of the upper one, $S_{\text{low}} = \max(0, S_{\text{low}} - r - k)$, sharing k and h so that symmetry cost no new tuning parameter. The deployed default is the *guarded* lower arm, driven by the measurement against the trajectory of an empty room clamped at the 420 ppm outdoor concentration, and it is what Section 11.2's headline figures are measured on. Two experiments deliberately run the arm *off* beside it, as a control rather than as a configuration: 180 of T-34b's 540 observed rooms and one of T-26's four regimes. That guard is what catches the low-side fault with a safety consequence: a sensor drifting downward makes the inner loop believe the room is cleaner than it is and *under-ventilate an occupied room*, and it betrays itself by reading below the outdoor concentration, which no amount of ventilation can produce. What the guard cannot catch is the other low-side fault. "Everybody left the room" explains a room that stopped getting stuffier at least as well as "the damper ignored the close command" does, and nothing inside a ten-minute judging window separates them, so a damper stuck wide open stays `HEALTHY`. The unguarded setting sees both and costs more false confirmations than R-3 allows, which the monitor's own fault-free-week test measures. That is the honest form of this hole: an observer with no occupancy signal *cannot* have both, and the choice was made in R-3's favour.

`serviced()` had no transport, so a latched false positive could not be cleared in deployment.

And now it has one. `FaultCase.serviced()` is the only exit from a latched case, and for most of this project's life nothing reached it: no MQTT topic, no REST endpoint, no dashboard action, only the unit tests and the harness. A false latch was **permanent** and the technician who repaired the damper had no way to tell the system so. That hole is closed. `ServiceReported` travels on `service/{zone}`, `fault-monitor` subscribes to it through an adapter that validates the report against the open case, and the dashboard exposes `POST /api/zones/{zone}/cases/{caseId}/serviced`, answering 202 when it is accepted, 404 for a room or case that does not exist, 409 when that case is not latched, and 503 when the broker is unreachable. The whole `CONFIRMED` → `COMPENSATING` → `SERVICED` → `WARMUP` → `HEALTHY` lifecycle is executable and tested end to end, including that a reported repair unwinds the compensation and hands the five healthy rooms back to the inner loop. **This matters most to the latching trade-off below**, whose whole argument is that a false positive costs only one technician visit: an argument that was being made against a system in which it cost that visit *and* a permanently wrong work order. It is now true as stated. One thing is deliberately absent: there is no button on the HTML status page, because that page is server-rendered with a meta refresh and no JavaScript, so a form post would land the operator on a JSON body. The endpoint is the operator path.

Blocked filters are plant-wide by construction, so the classifier's hardest discrimination is never tested. The statement "the three signatures may collapse into two" is too soft. In *this* simulator they cannot collapse: a blocked filter is plant-wide by construction, so it starves all six rooms and a stuck damper never does, and the common-mode count separates them trivially. The ambiguity that would really arise in a building (a partial obstruction in one duct branch, which reads as both a partly stuck damper and a partly blocked filter) **is not in the fault model at all**. The enumeration cannot express it. So a clean confusion matrix from the classifier would be weak evidence rather than strong, and reporting one without this paragraph would be misleading. The risk register forbade inventing a fourth *signal* to rescue a three-way taxonomy; it never forbade a fourth *fault*, and adding the ambiguous one is what would have made the classifier's evaluation worth reading.

And worse than untested: the `BLOCKED_FILTER` branch of the classifier is unreachable with this physics. This is the finding I least expected and the one I would lead with in the oral. A unit test pins it deliberately: it injects a blocked filter and asserts the classification is `UNCLASSIFIED`, with a message saying that if it ever starts classifying, the test's finding is out of date. Two structural reasons, and neither is a bug to be patched:

- **The split only redistributes a fixed total.** $Q_i = Q_{\text{fan}}\, a_i / \sum a_j$ means no damper command can move all six residuals the same way; a blockage shrinks Q_{fan}, but the observer judges *step responses to commands*, and no command it watches produces the plant-wide common mode the first branch of the tree requires.
- **The generation estimate absorbs the blockage exactly.** From Section 7.2, $G_{\text{est}} = Q\,(C_{\text{measured}} - C_{\text{out}})$ is learned from quasi-steady state. With a blockage, the true flow is low by $(1-\beta)$ and the believed flow used in the prediction is high by the same factor, so G_{est} comes out high by precisely $1/(1-\beta)$, and the two errors cancel in the predicted steady state. Only the *time constant* differs, and the residual the CUSUM sees never develops the bias it needs. The observer's defence against not knowing occupancy is, in other words, also a defence against noticing a blocked filter.

What saves the outcome from being useless is that the classifier reports its evidence even when it declines to name a cause, so the work order still states the measured plant power excess and that the residual is not common mode: a technician is sent to the air handler with the right number, by a system that admits it cannot prove which fault it is. That is the correct behaviour for an unclassifiable case and it is not the same thing as a working three-way classifier. **The honest headline is that of the mechanisms this project set out to name, exactly one is classified: `STUCK_DAMPER`.** `BLOCKED_FILTER` can be pointed at but never confirmed, for the structural reason above. And `SENSOR_DRIFT`, which this paragraph used to call classified "once a night of overnight-floor history exists", is **never emitted at all**, in 0 of 76 runs from a drift ramp and 0 of 76 from a step offset (§7.3, §11.5). Its leaf wants an informative overnight floor and a matched step response in the

same instant, and the two injectable sensor mechanisms supply one each and never both, because the classification is computed at the confirmation while one of its inputs needs a day of the fault.

I.2 The air handler's rating was corrected on measurement (§13.3 in full)

Run that plant at the normal 0.7 and it delivers 294 l/s against a 411.4 l/s design total, 71 % of design flow, and the consequence was not subtle: with **nothing broken** no room could be held below 1000 ppm at design occupancy and the monitor confirmed a fault in all six, because a uniformly starved building looks exactly like a faulty one. Sizing instead from Σ design $\div$ 0.7 separates the two jobs the rating was doing at once: the plant covers its design condition at the speed it actually runs, and the margin to $s = 1$ is reserved for compensation. The fix is not free, and this is the honest cost: **margin masks faults**. At the corrected rating a filter blocking 35 % no longer starves the rooms enough for the monitor to confirm it, where at the undersized rating it did. Detection sensitivity was being bought with occupant comfort, which is the wrong currency, so the trade is made deliberately in comfort's favour and its cost is stated here rather than hidden. The correction is now measured rather than argued: at the corrected rating the no-fault arm of T-26 holds every occupied minute at or below 1000 ppm at design occupancy, on all five seeds, in every regime (§11.2). That is the figure the earlier sizing scored 0.000 on.

I.3 The CUSUM margin, and why h was never the knob (§13.4 in full)

The worst healthy seed peaked at 149.1 ppm against $h = 150$ ppm at $\sigma = 30$ ppm, over three hours in one room: a **0.9 ppm margin**, with the next seed at 91.6 ppm, so it is a tail draw and not a design property. R-3 asks for at most one false alarm per simulated week *across six rooms*: the same statistic over far more samples, six times over. The mitigation is persistence rather than a higher limit: requiring the statistic to hold above h for two consecutive cycles removes a tail draw, which the next sample erases, while a stuck damper clears h every cycle. Raising h instead trades R-3 against R-1, and the sweep in §11.1 prices that trade: 8σ costs about a minute of delay, and 4σ already gave one false alarm in twenty short runs. Siegmund's $\mathrm{ARL}_0 \approx 1.1 \times 10^5$ samples $\approx$ 79 days is analytic, on i.i.d. noise which the production residual is not. And the measurement contradicts it. Over 20 fault-free simulated weeks of all six rooms the monitor raises **0.55 confirmed cases per week against R-3's limit of one**, with **16 of 20 weeks clean** and a worst week of 6, against 1.30 per week and 9 clean weeks before ADR-0010, while on the same tuning R-1's stepped p95 is 6 min against a 15 min budget (§11.2). So the trade this section prices came out on R-3's side of the line, but it was not the binding trade, and that is the correction this section needs. h **was never the knob.** ADR-0010 attributed the failure, and the defect was in the *reference* the limit is applied to rather than in the limit: both plausibility guards were being corrected 30 % of the way onto every reading, so each CUSUM arm was accumulating a filter error instead of a residual, which is what put the statistic into the very i.i.d. regime the analytic run length assumes and is why the analytic figure was contradicted so badly. Correcting the lower arm's half of it halved the rate with $k = 30$ ppm and $h = 150$ ppm *untouched*. The response taken is therefore unchanged and better supported than when it was taken: k and h stay where the spike put them rather than being retuned until R-3 passes, because retuning a limit on the experiment that failed it is the same methodological error §13.10 already names, and the measurement now says the limit was not the defect. What R-3 still fails on is the worst week, which is seed 2 at six confirmations, all on the upper arm; the upper arm's half of the same defect is measured, meets R-3 outright, and was declined because it costs three other requirements (§11.2, ADR-0010).

I.4 R-7 at design occupancy, and the two bounds on that finding (§13.5 in full)

Until this revision R-7 was reported as met, full stop, on 270 observed rooms. It was met on the occupancy regime it had been run in. Running the same experiment with every room at its design head count fails **231 of 270**, and the shape of the failure is the result.

The two failing clauses are **disjoint**: 215 observed rooms were themselves *accused of a fault they did not have*, and 16 more sat outside the 5 % airflow band at a worst deviation of 0.058919: 215 plus

16 is the 231. They attribute in opposite directions, and the supervisor-dead pass is what separates them. The accusations run 85 of 90 rooms with the supervisor *dead* against 130 of 180 with it live, so they belong to the regime and the monitor rather than to the response to the fault: compensation slightly *suppresses* them. The airflow breaches run 0 of 90 dead against 16 of 180 live, so that half is the compensation's own cost and nothing else's.

So the larger half of R-7's design-occupancy failure is R-3's false-alarm rate, measured by a different experiment, in a regime R-3's own replay never visits. That is the second time this report has had to say it: §11.2 records the same pattern inside R-2, where false alarms take the trim lever away entirely on two of the five design-occupancy seeds — on one because every room is latched and no healthy damper is left to trim at all, on the other because the single room still unlatched is already sitting on its own minimum position. Both then fall back on the fan, which is the non-selective lever. **R-3 is not one failing requirement among four; it is the one whose failure the other three inherit**, and stating it that way is worth more than three independently reported shortfalls. ADR-0009 predicted exactly this collision and noted that no experiment asserted R-7 in that regime. One does now.

Two bounds on the finding. The first is that `CompensationPlan.worstHealthyFlowDeviation()` **cannot falsify this requirement** and should stop being quoted beside the figure that can: it reaches 0.0500 and no further in any regime, because the solver caps the fan at the speed that makes the figure exactly the tolerance and then reports that cap. The second is that the 5 % bound's *reference plant* is ambiguous: the solver bounds its claim over each latched room's latch-time opening, the independent recomputation over its pre-latch one, and the two coincide until a second room latches inside one episode, which the drawn weekday never does and design occupancy routinely does. Both are defensible readings of "before the compensation" and ADR-0008 never says which. That is an ADR-level question, not a code change.

I.5 The third diagnostic signal is blind after a confirmation (§13.6 in full)

§7.3 records that the stuck-damper leaf fires on two signals rather than three, because a probe can only be requested once a case is latched, so the probe's own step is never judged at classification time. The obvious repair is to reorder: latch as usual, withhold the diagnosis, ask for the probe immediately, and name the fault when the step lands. **It was built, measured over 176 paired runs on identical seeds, and not kept.** Detection moves in 0 of 88 pairs and the fault is named on a genuinely judged step in 28 of the 39 runs that defer, against none before. And the settled classification is identical in all 88 pairs, because the judged step reads `MISSING` for a stuck damper, a blocked filter, nine rooms whose dampers are in perfect health, and the run with nothing injected.

The cause is a located defect older than the ordering, and it is the useful part. `ZoneObserver.recordStepAmplitude` measures the amplitude's *measured* leg against `predictedAtStep` while the predicted leg is also against `predictedAtStep`, so the measured leg carries the standing residual as a constant offset. And the anchor-gain pull that would make that baseline legitimate is switched off while a case is open, so at the confirmation the prediction is stale by exactly the residual that confirmed it. `ZoneObserver.measuredAtStep` is assigned for this purpose and never read. On a 600 ppm offset with a healthy damper that answers its probe by dropping 300 ppm, the amplitude ratio runs from -7.0 to -0.8.

And correcting that baseline makes the reorder worse, not better, which is the finding worth defending. Measured as an unlanded counterfactual, the corrected signal takes T-15's diagonal from 18/44 to 15/44: it reads `MATCHED` on 3 of 8 genuinely stuck dampers and `MISSING` on 5 of 11 healthy ones, because by the time a probe can be commanded the supervisor has degraded the zone, raised the fan and trimmed the other five, so the room's answer is mostly the compensation's. The 18/44 baseline reproduces on the current code; the 15/44 was measured on a one-line patch that was then reverted, so it is the one figure in this report that cannot be re-derived from the repository as it stands. This is the masking the latching argument in §13.8 already rests on, arriving one level down, in the diagnosis rather than in the clearing policy. **A three-signal stuck-damper diagnosis therefore**

needs a step judged *before* a case opens (the inner loop's own trims, read against a baseline that survives them) rather than a probe requested after the response to the fault has begun. That is design work, and it is the one concrete thing this report would hand to a successor.

I.6 Scope, and the debts taken knowingly (§13.9 in full)

Legitimate scope. Six rooms on one floor behind one air handler is not a building, but the shared fan makes R-7 non-trivial: keeping five rooms unchanged while compensating the sixth is something the supervisor must actively do. Simulated time through `ClockPort` is legitimate too, but the reproducibility it buys has to be stated precisely, because the obvious phrasing is false of half the system. **In the offline harness the replay is reproducible bit for bit**: the clock is a `SimulatedClock`, the bus is a list and the iteration order is fixed, so the draws are identical run to run, which is exactly what R-3's false-alarm count needs. **In the containerised demo profile it is not**, and that is measured rather than suspected: four runs on identical `SEED`, `TIME_SCALE` and `START_AT` confirmed A115 at simulated 10:16, 10:17, 10:19 and 10:23, a spread of seven simulated minutes. The cause is that the sensor model draws once per Euler sub-step and the sub-step count follows *real* elapsed time, so host scheduling decides how many draws a simulated minute contains. The offline number is the one every requirement is argued from; the demo profile is for showing the system work, not for measuring it. What simulated time does *not* exercise either way is anything that appears only over real duration: scheduler jitter, clock drift, broker backpressure, memory growth. R-6's cycle time is the only result in the plan that touches timing at all.

Debts. Skipping a DTO layer is justified by lock-step single-author deployment, but it makes a domain refactor a wire-format break and is wrong the moment any consumer deploys independently. Having no message replay is similarly contingent: R-3's evidence comes from a seeded harness rather than from the broker, so the evaluation never needs replay, but in a real deployment a monitor restart loses the residual history it was accumulating, and R-5 then rests entirely on the journal. Three smaller debts, all three of which have since been **corrected** and are kept here because what they were is worth more than that they are gone. The first: `Topology` could express a synthetic zone set larger than six but nothing in any container wired it, so the capability existed and R-6 could not be run from the deployed system. `ZONE_COUNT` is now an environment variable all seven project-authored containers read, and the stack was brought up and watched at 12 and at 58 zones, 58 being a hard ceiling that belongs to BuildSim rather than to the monitor, since it refuses to host equipment in a room its floorplan does not have. **R-6's breaking point therefore remains a harness measurement**, and the two ceilings are three orders of magnitude apart. The second: ADR-0005 and ADR-0006 argued in the superseded access-control vocabulary (doors, badges, requirement IDs that no longer exist) against requirements the project had replaced. Both were retargeted, and then checked line by line against the source tree, which found that the retargeted prose made three further wrong statements about the code: an interface inventory listing five where the tree has fifteen, a claim that five components carry the full `boundary/control/entity` structure, and device-process line counts given as "around a hundred each" against 297 and 237. **Correcting a document can introduce fresh errors of its own**, and only a pass against the tree finds them. The third, that the monitor's parameter record documented its plausibility ceiling as 1.0 while the code used 1.25, sat in the one parameter that decides how desensitised the detector is, which is the worst place to have two different numbers written down: `MonitorParameters` now reads 1.25 in both its javadoc and its defaults, and the same pass removed two further false claims from that record (ADR-0010).

A fourth of the same shape was found and closed in this pass, and it was the most expensive of them. The probe step had *two* numbers (`MonitorParameters.probeStepIncrease` at 0.20 and `SupervisionService.PROBE_STEP` at 0.25), and the consequence was worse than duplication, because the monitor *asks* in the evidence an operator reads while the supervisor *acts*. The system published "step to 0.35" on `faults/{zone}`, journalled that, and commanded 0.40: **it was telling the operator one thing and the building another**. There is one owner now, in `shared`, because the amplitude has to mean the same thing to the component that requests it and the one that commands it. Why the divergence survived is worth keeping: the request is prose inside `FaultStateChanged.evidence`, a

`List<String>`, so the supervisor could not read the amplitude off the wire without a schema change four components decode. The change was taken on the operator-facing argument and **not** on a measurement (no requirement verdict moved), and it had one measured side effect worth more than the fix: a 0.05 change in one amplitude moved **ten of T-34b's design-occupancy rows from pass to FAIL**, by causing one extra room to be falsely accused on one seed. That is R-3's false-alarm rate again, and it says the design-occupancy regime is not merely failing but *unstable*.

One debt was addressed, and what it cost to try is more interesting than the debt. T-15 found that `ZoneMonitor.stepShapeUnchanged()` collapsed "no evidence" into "evidence of a missing response": it returned `false` when the step-amplitude ratio was `NaN`, and `NaN` is what the observer reports when *no step has ever been judged*. The classifier's stuck-damper leaf read that as the commanded step having produced no matching response, so `STUCK_DAMPER` could be emitted for a room the monitor never asked to move: 9 of 57 drift runs confirm by exactly that route.

The signal is now a three-valued type, so the conflation cannot be written by accident again. The *strict* fix, requiring positive evidence of an unanswered step, was then tried, and **it emptied the leaf**: the one cell on T-15's diagonal went to `UNCLASSIFIED` and the tree classified nothing at all. The cause is an ordering problem, not a logic one. A probe is requested through the evidence on `FaultStateChanged`, so a case must be open before a step is commanded, and **the step-amplitude signal therefore arrives after the decision it exists to inform**. The `NaN` was not an incidental bug; it was the only thing making that leaf reachable, and the taxonomy has been quietly running on two signals rather than three for its whole life.

What is in the repository is the honest middle: the leaf still fires on localisation and flat fan power, and every diagnosis reached without a judged step now carries an explicit entry saying it rests on two signals, that the room has not been asked to move and so has not failed to answer, and that a probe has been requested to settle it. Behaviour is unchanged (T-15's, T-24's and T-25's result files reproduce byte for byte, so no number in this report moved), and the weakness is now in the work order an operator reads instead of inside a boolean. **The real fix is to command a probe step before classifying rather than after**, which reorders the diagnosis pipeline and would trade detection delay for diagnostic confidence. That is a design change with its own experiment attached, and it is the first thing this system should do next.

J. Risk register

The register §13.11 points at. Each row is a risk or an assumption, its impact, and the response with its current status.

Risk or assumption	Impact	Response, and its status
R-3 fails at the seven-day six-room horizon	The headline false-alarm claim goes	**Measured, and it does fail**: 0.55 confirmed cases per fault-free week against a limit of 1 over 20 weeks, 16 of 20 weeks clean, worst week 6, which is the scored criterion (§11.2); 1.30 per week with 9 clean weeks before ADR-0010 attributed the cause. Persistence of two cycles is in place and is not enough; the mechanism is now named and half of it is corrected, and the half that would meet R-3 outright costs R-1's closed-loop arm, T-27 and R-7

Risk or assumption	Impact	Response, and its status
A damper stuck wide open is invisible under the guarded lower arm	Five neighbours quietly robbed of air by the split, and a controller that never learns its damper is dead	The two-sided statistic **is implemented** and its guarded arm is the deployed default, which catches the safety-relevant low-side fault; the unguarded setting catches both and costs more false confirmations than R-3 allows. `DAMPER_STUCK_OPEN` now **exists** as a classification and three things branch on it, so the fault is expressible and actionable, but naming it did not make it detectable, and the trade is unchanged. Note the correction: a damper frozen open does *not* waste fan energy, because the shared fan delivers a fixed total at a given speed and the six openings only divide it. It misallocates
`serviced()` had no transport	A false latch would be permanent in deployment	**Implemented**: `service/{zone}`, a validating adapter, and `POST /api/zones/{zone}/cases/{caseId}/serviced`; the full lifecycle is tested end to end
The detector shares its generator's assumptions	Detection numbers do not transfer	Stated as a bound on every detection claim; a second independent fault model would be needed
Occupancy-dependent detection delay	A lightly occupied room hides its fault	**Measured, and the risk is real**: stratifying the closed-loop runs by the head count at the ignored command gives 0 of 4 confirmed at 0.625 of design occupancy, then 77 min median at 0.875 and 31 min at 1.00 (§11.2). The plausibility ceiling limits false confirmations and *is* the mechanism of this delay. What is still unmeasured is a sweep that holds the occupancy ratio as a controlled input over a wider range than a drawn weekday visits
The ambiguous fault is absent from the model	A clean confusion matrix would mean little	Add a per-branch obstruction to the generator; not done
`BLOCKED_FILTER` is unreachable with this physics	One of the three named faults can be pointed at but never confirmed	Pinned by a test that asserts `UNCLASSIFIED` so the finding cannot rot; the work order still carries the plant power excess
R-6's number comes from the harness, not from a container	R-6 is measured for the monitor rather than for the deployed system	The entity-layer capability is wired to the harness and measured there (§11.2); every container reads it through `ZONE_COUNT`, and what stays harness-only is the breaking point rather than the capability
Fan saturation	Compensation degenerates to redistribution, gain 1.296	Bounded by a 5 % healthy tolerance and reported as the achieved gain; working as designed
The healthy-damper trim is the only lever, and every damper sits on its floor	Compensation is a no-op and the supervisory loop is worth nothing, or less than nothing	**Measured, and it did happen**: +0.000 of occupied minutes on the drawn weekday and 34 ppm *worse* than no supervisor at design occupancy. Fan speed is now spent once the trim is exhausted (135 ppm of help in that regime), bounded by the 5 % healthy tolerance because the lever is not selective, and that 5 % is itself kept on a sweep rather than assumed (ADR-0009). The 0.05 cases per week once charged to this lever against R-3 is withdrawn: the allowance does not move R-3 at any setting from 0.05 to 0.99, and ADR-0010 attributes those confirmations to the plausibility guards instead (§11.2)
Broker is a single point of failure	Readings stop flowing	Restart policy; a dead publisher produces silence, which drives `BLIND` rather than a wrong decision

K. The test plan, the test suite and the evaluation harness, in full

K.1 The test plan, with each test's expected result and its evidence

ID	Test or experiment	Requirement	Expected result	Evidence, and whether it exists
T-24	Detection delay swept against the CUSUM limit h, ≥ 20 runs per point	R-1	Trade-off curve; p95 $\leq$ 15 min at the chosen h	**Run**, 200 runs over six arms: stepped p95 6 min, 20/20; closed-loop p95 257 min, 15/20 (§11.2)
T-25	Model-based monitor against a plain residual threshold, identical seeds, 7-day fault-free replay	R-1, R-3	Fewer false alarms at equal delay; ≤ 1 alarm per week	**Run**: at equal alarm volume the monitor detects 0.75 against the threshold's 0.15, at a median delay of 74 min against 312; R-3 fails at **0.55** confirmed cases per fault-free week, down from 1.30 before ADR-0010, with 16 of 20 weeks clean and a worst week of 6 (§11.2)
T-15	Confusion matrix over the four injected faults on a fixed seed, plus a no-fault arm	R-1, R-3	Each fault classified as itself; the no-fault arm silent	**Run**, 218 runs: `STUCK_DAMPER` named correctly, `BLOCKED_FILTER` $\rightarrow$ `UNCLASSIFIED` 11/11, `SENSOR_DRIFT` **never emitted** (0 of 76 from a drift ramp and 0 of 76 from a step offset), **one of four mechanisms classified** (§7.3)
T-26	Comfort during a latched fault, with and without compensation	R-2	$CO_2 \leq 1000$ ppm for $\geq$ 95 % of occupied minutes with compensation	**Run**: 5 of 5 seeds on the drawn weekday, 0 of 5 at design occupancy, no-fault reference 5 of 5 throughout (§11.2)

ID	Test or experiment	Requirement	Expected result	Evidence, and whether it exists
T-27	Kill each container in turn	R-4	`BLIND` with zero fault events; recovery within one cycle	**Run** in-JVM, 23 of 23 assertions: `BLIND` in 4 cycles, 0 fault events, 0 commands on stale data, `HEALTHY` 3 cycles after recovery (§11.2); container kills **now also run** against `docker compose`: five of six rooms `BLIND` in 12 s, no diagnosis and no healthy-room command while blind, three-cycle recovery, fan held at 158.3 W with the supervisor dead; and the restart policy fires on an in-container `SIGTERM`: restart count 1, running again within 3 s (§11.6). **The one-cycle recovery expectation is missed.** It was written before the state machine was, and recovery is routed back through `WARMUP` by design, so three cycles is the floor and the harness asserts ≤ 5 cycles. R-4's acceptance criterion says nothing about recovery timing, so its verdict is unaffected; the expectation stated here is what was wrong
T-20	Rebuild a random diagnosis from the journal	R-5	Inputs, command, residual series, classification and timestamp all recovered	**Demonstrated live** in the recorded demo run: one `caseId` rebuilt against a real TimescaleDB: HTTP 200, 77 248 bytes, **445 events** (`evaluation/results/T-23-demo-run.txt`, §3 status, §11.6). The id was the one that run produced rather than a drawn one. **And now tested**: eight integration tests execute `replayCase`'s real SQL against a real PostgreSQL, including the one-hour evidence lookback pinned at −59, −60 and −61 min
T-28	Scale zones per monitor to the breaking point	R-6	The zone count where p95 cycle exceeds 60 s, and the saturated component named	**Run**: 25 600 zones at a p95 of about 6 s measured, ≈ 86 000 extrapolated, `AhuFlowModel.believedFlowTo` named (§11.2)
T-34b	Room isolation: one injected fault per run, rotating the injected room over ≥ 3 rooms	R-7	Zero events and no mode change in the other five; their CO_2 and airflow inside the healthy band	**Run**, both occupancy regimes, 540 observed rooms: all six rotated, 3 seeds, 3 configurations. Drawn weekday **0 of 270 failed**; design occupancy **231 of 270 failed** (§11.2)

ID	Test or experiment	Requirement	Expected result	Evidence, and whether it exists
T-29	Optional learned one-class contender against the CUSUM on identical seeds	R-1, R-3	Kept only if it wins	**Run**, 20 seeds and 30 operating points against a held-out fault-free week: **dropped**. To match the monitor's 0.75 detection it costs about 20× the false alarms (11.25 against 0.55 per week) and 7× the delay (518 against 74 min) (§11.2)
T-35	Classify after a probe has been judged, or at confirmation? 176 paired runs on identical seeds	R-1	Kept only if it buys classification accuracy at an acceptable delay	**Run**: **not adopted**. Detection moves in 0 of 88 pairs and the fault is named on a judged step in 28 of the 39 runs that defer against 0 before, and the settled classification is identical in all 88 pairs, because the judged step reads `MISSING` for every condition including rooms whose dampers are healthy (§7.3, §11.2)
T-36	One observation published on the real broker, consumed by the running `fault-monitor` and asserted in the real journal	R-5	The published observation reaches the journal through a process this test does not run, unchanged	**Run**, 2 tests against the deployed stack: the row carries the published wattage, the publisher's instant rather than the subscriber's, and `source = fault-monitor`; and a reading for a room outside `ZONE_COUNT` is journalled nowhere. It injects under an invented *AHU* id, which touches no room's model. Without the stack both **skip** with the reason attached
T-37	A latched diagnosis survives a `SIGKILL` and restart of its container	—	What the process concluded outlives the process, so a restart is not a back door through the one exit the design reserves for a technician	**Run live on the demo profile**, not in the suite: `evaluation/results/T-37-restart-recovery.txt`. The case id `779b28fb` and `confirmedAt` 10:09:00.798 are identical either side of the kill while `updatedAt` advances to 11:02, which a cold start cannot produce because both are minted at confirmation. `unresponsiveDampers` and the 0.15 pin return with it, and no `.pending` file is ever left behind. The round trip and the missing-document cold start are covered by unit tests; this is the deployed-container record

K.2 The state of the suite and the harness, stated plainly

A full `mvn -o clean test` run on 2026-10-11 reports **BUILD SUCCESS over all nine reactor modules: 621 tests, 0 failures, 0 errors** (`shared` 296, `physics-simulator` 63, `co2-sensor` 12, `damper-actuator` 10, `dcv-controller` 16, `fault-monitor` 97, `supervisor` 61, `dashboard` 32 and `evaluation` 34, with the root POM carrying none of its own). `evaluation` had no tests at all until T-15 gave it one worth writing. The experiment harness was the last unverified code in the tree.

No skip is a gap, and the skip count is not a fixed property of the suite. The eleven tests that can skip assume something outside the JVM is reachable: the eight journal tests that execute R-5's real SQL against a PostgreSQL (T-20), the two pipeline tests that additionally need the broker and a running `fault-monitor` to publish into (T-36), and the one reconnect test that needs the broker. Without them all eleven skip rather than fail, which is what keeps the suite runnable in seconds with nothing installed; with the stack up all eleven run and pass and the same command reports **621 tests and 0 skipped**, which is the measurement the row for T-36 above comes from. Starting anything is deliberately not the default: a suite that waited on a database (or, under `mvn -o` on a machine without the image, downloaded 2.4 GB of it) would trade away the property this subsection is about for a test better run on purpose. T-36 has no autostart path at all, and should not: it asserts on a running system, and a test that stood the system up would be asserting on one it had just configured itself.

The count moves between runs because the code is still being worked on; what matters is that nothing is red, nothing is disabled, and the suite is fast enough to run on every change, which is a direct consequence of the control layer being free of framework and transport types (Section 4.4).

What was the single largest gap in this project is now closed. `evaluation/` holds its own sources (a `Main` and **ten** experiments), and a full run on OpenJDK 25.0.3 completes in **350 s** of wall clock, writing the nine result tables Section 11.2 reports from: T-15 52.2 s, T-24 8.6 s, T-25 15.5 s, T-26 4.8 s, T-27 0.3 s, T-28 121.6 s, T-29 96.3 s, T-34b 9.2 s, T-35 41.5 s, T-22 0.0 s.

That run is also the evidence for the determinism claim in Section 13.9, and it is worth stating as a result rather than a property. Re-running the whole harness against the committed result files leaves **eight of the nine byte-identical**: T-15, T-24, T-25, T-26, T-27, T-29, T-34b and T-35 all reproduce exactly. The ninth is T-28, and it does not reproduce because it is the one experiment that measures *wall clock* rather than simulated behaviour; its cycle-time columns move with host load, which is the point of it. So "the offline harness is reproducible bit for bit" is a measured statement with one named exception, and the exception is the experiment where bit-for-bit reproduction would mean the measurement was not being taken. Every javadoc reference to "the evaluation harness measures this" now names a consumer that exists, and `fault-monitor/src/` is in git with the rest. The gaps that remain are gaps in evidence rather than in code, and Section 11.6 lists them.