

2. LIMITATIONS

2.1 SYSTEM LIMITS

The fuel system cold weather operation requirement that the fuel must contain an anti-icing additive when operating below +4 °C is no longer applicable.


2.2 SYSTEM INSTALLATION LIMITS

The Microfilters with Back-Up Fuel Supply System shall not be installed with the Divided Supply Tank Fuel System, FMS 10-31.

3. EMERGENCY AND MALFUNCTION PROCEDURES

3.1 WARNING LIGHT INDICATIONS

WARNING LIGHT INDICATIONS

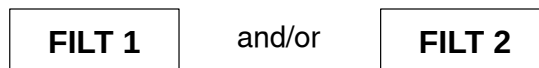

Conditions/Indications

Clogging of engine fuel filter and/or microfilter (affected engine) has begun

- **FILT** warning light (affected engine) on

Procedure

No change in the basic Flight Manual procedure.

3.2 FUEL PUMP FAILURE

Conditions/Indications

Supply tank pump failure (affected engine)

- Fuel pressure indication below 0.6 kp/cm²

Main tank pump failure (affected engine)

- Fuel pressure indication lower than usual

Procedure

1. Fuel pump sw (affected pump) – Off
2. Altitude – As noted below or less

- NOTE**
- Max altitude when operating on MIL-T-5624, grade JP-5 or ASTM D-1655 Jet A and Jet A1 14,200 ft
 - Max altitude when operating on MIL-T-5624, grade JP-4; MIL-T-83133, grade JP-8; ASTM D-1655 Jet B; or alternate fuel (AVGAS/Jet fuel mixture) 8,000 ft