

2. LIMITATIONS

2.1 SYSTEM LIMITS


Operation of the pulsed chip detector system is limited to:

- once per engine MAG PLUG warning per flight, and
- maximum of four more events on same engine within 50 hour period after first event.

3. EMERGENCY AND MALFUNCTION PROCEDURES

3.1 WARNING LIGHT INDICATIONS

WARNING LIGHT INDICATIONS

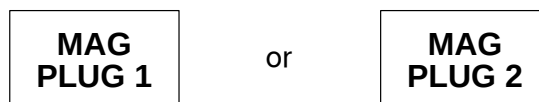

Conditions/Indications

Metal particles detected in engine oil

Procedure

WARNING A **MAG PLUG** WARNING LIGHT COMING ON TOGETHER WITH EITHER A TORQUE FLUCTUATION OR LOSS OF OIL PRESSURE SIGNIFIES AN IMPENDING ENGINE FAILURE. PERFORM SINGLE ENGINE EMERGENCY SHUTDOWN OF AFFECTED ENGINE IMMEDIATELY.

• ON GROUND

1. Single engine emergency shutdown – Perform

NOTE Do not operate the pulsed chip detector system to eliminate a **MAG PLUG** warning light when on the ground.

• IN FLIGHT

1. PULSED CHIP DET switch – On
2. Chip pulse events – Record per engine

NOTE Record the chip pulse events (operation of the PULSED CHIP DET switch) and **MAG PLUG** warning indications in the logbook for each engine separately to monitor abnormal wear behavior of the engines.

If warning light remains on or comes on again during same flight:

3. Single engine emergency shutdown – Perform