

5.4 AIRSPEED CALIBRATION

The airspeed calibration chart (see Fig. 5-4) is provided to determine Calibrated Airspeed (CAS) from Indicated Airspeed (IAS) using the pitot static system installation-error correction for level flight.

NOTE Indicated airspeed assumes zero instrument error.

The corrections apply for all practical altitudes and gross masses, and with the helicopter flown with no appreciable yaw.

EXAMPLE: (see Fig. 5-4)

Determine: **Calibrated airspeed (CAS), level flight**

Known: Indicated airspeed 90 KIAS

Solution: 1. Enter chart at known indicated airspeed (90 KIAS).
2. Move up to LEVEL FLIGHT line.
3. Move left and read calibrated airspeed = 91 KCAS.

AIRSPEED CALIBRATION CHART

CLEAN CONFIGURATION

NOTE INDICATED AIRSPEED ASSUMES ZERO INSTRUMENT ERROR.

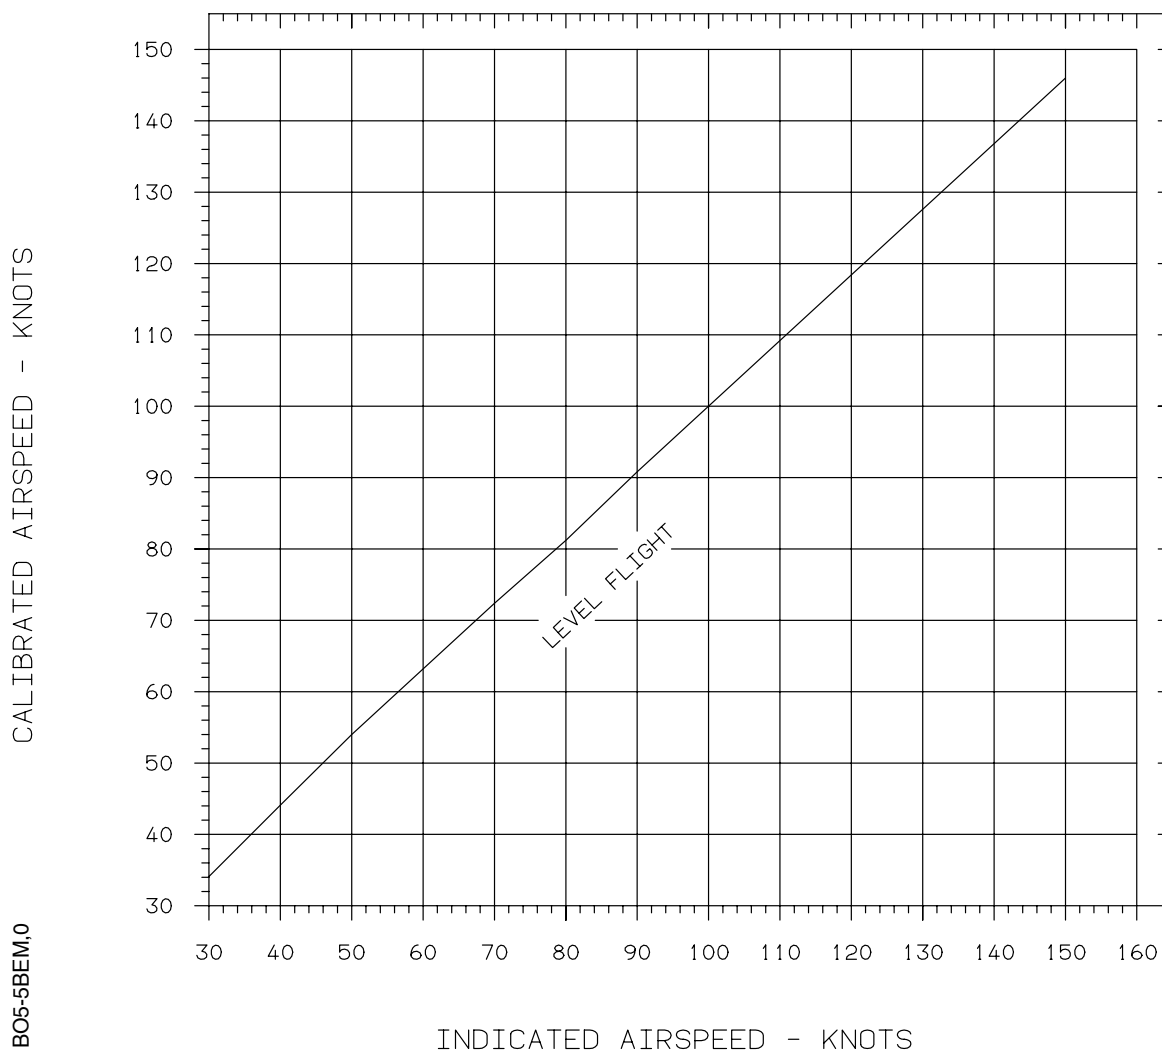


Fig. 5-4 Airspeed Calibration Chart