

Weekly Visual Check Transformer Work Instruction

First step: Inform the workshop operation content, inform the operation purpose, and sign the work ticket.




Second step: Confirm the energy level of the power transformer.



Third step: Choose the appropriate PPE (protective clothing, protective mask, arc flash-proof gloves, earplugs). PPE is required to be tested and within the validity period.




Fourth step: Please refer to the "Emergency Rescue-Electric Shock Accident" document. The guardian should have sufficient training (for example: how to rescue cardiopulmonary resuscitation, the use of automatic defibrillators).

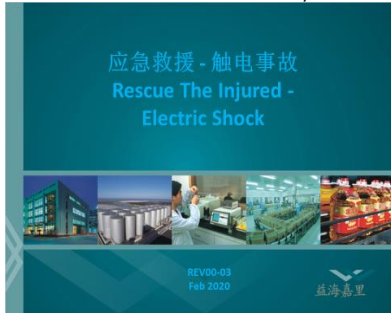

Fifth step: Make sure to cut off the power supply from MVD panel in an emergency. ("Electrical isolation point")



The sixth step: Attention should be paid to "restrict access to the boundary".

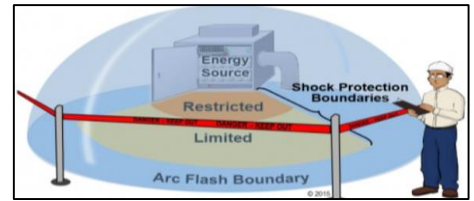

Nominal System Voltage Range, Phase to Phase*	Limited Approach Boundary*		Restricted Approach Boundary*: Includes Inadvertent Movement Adder
	Exposed Movable Conductor*	Exposed Fixed Circuit Part	
<50 V	Not specified	Not specified	Not specified
50 V-150 V ^d	3.0 m (10 ft 0 in.)	1.0 m (3 ft 6 in.)	Avoid contact
151 V-750 V	3.0 m (10 ft 0 in.)	1.0 m (3 ft 6 in.)	0.3 m (1 ft 0 in.)
751 V-15 kV	3.0 m (10 ft 0 in.)	1.5 m (5 ft 0 in.)	0.7 m (2 ft 2 in.)
15.1 kV-36 kV	3.0 m (10 ft 0 in.)	1.8 m (6 ft 0 in.)	0.8 m (2 ft 7 in.)
36.1 kV-46 kV	3.0 m (10 ft 0 in.)	2.5 m (8 ft 0 in.)	0.8 m (2 ft 9 in.)
46.1 kV-72.5 kV	3.0 m (10 ft 0 in.)	2.5 m (8 ft 0 in.)	1.0 m (3 ft 3 in.)

Seventh step: Look at the breaker indicator for recording voltage and current value from Transformer supply



Eighth step: Look carefully at oil level & temperature indicator transformer. Ensure the eyes are direct parallel to indicator and then record it.



Ninth step: Look around the transformer. Find out if there is a oil leakage at the bottom of the transformer.



Tenth step: Some the older version transformers still have a silica gel feature. Note the color of these silica gel whether its clear or dark.



Eleventh step: Listen to the noise from the transformer. Record the level of noise



The twelfth step: Inform the completion status of workshop work and inspection results.



Thirteenth step: The visual check results are recorded and archived, and maintenance plans are developed and executed. Perform summary analysis on a regular basis.

