


4. Array course control


4-1. Software Adjustments



Test Jig (GH99-36900A)

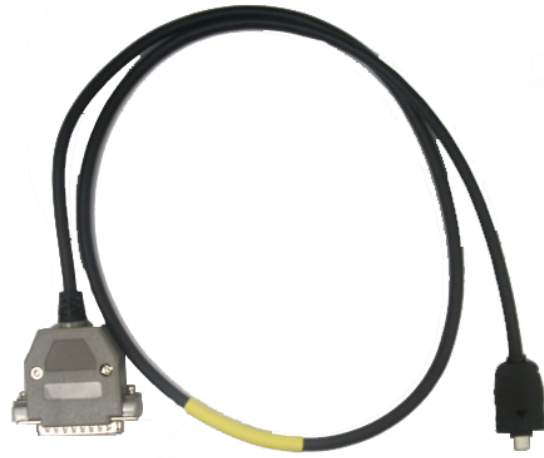

Test Cable (GH39-01290A)

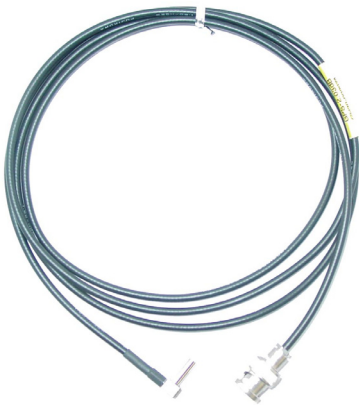

RF Test Cable (GH39-00985A)



Adapter (GH99-38251A)

4-2. Software Downloading

4-2-1. Pre-requisite for Downloading

- Downloader Program (**Optiflash Version 4.17**)
- GT-B3210 Mobile Phone
- Data Cable
- S3 file, CSC file


4-2-2. S/W Downloader Program

- To make USB connection between your PC and the Mobile phone.
Press and hold ' * ' key then connect the Data cable to Mobile phone.
(Both of PC and Mobile phone must be in Power off state)


- Load the binary download program by executing the
" **Optiflash.exe**"

1. Select Customer T: Rodeo (Intel Sibley 1024/256, USB)


Check **Code Binary** and **CSC Binary(Default)** and **Erase all Unused Regions**.

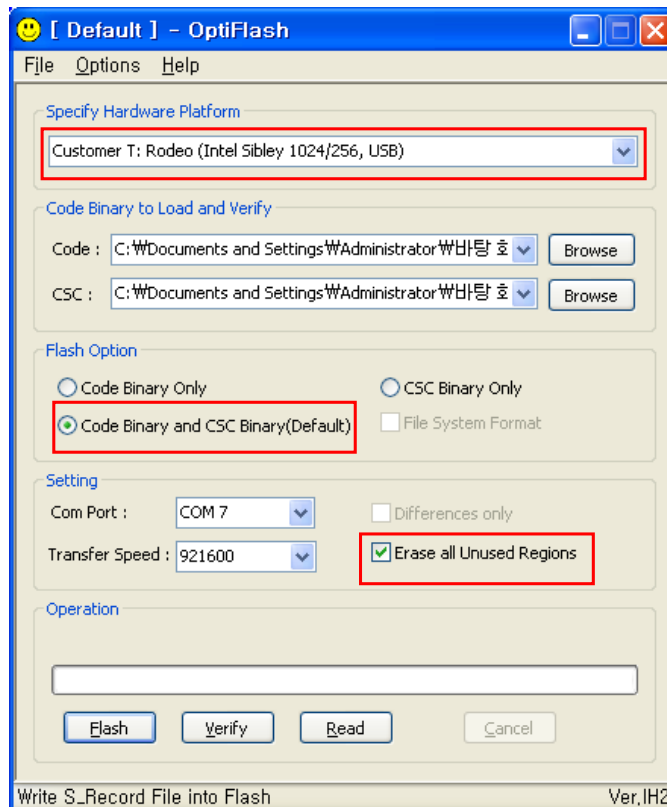


2. Select the **COM port** that the mobile phone is connected to..

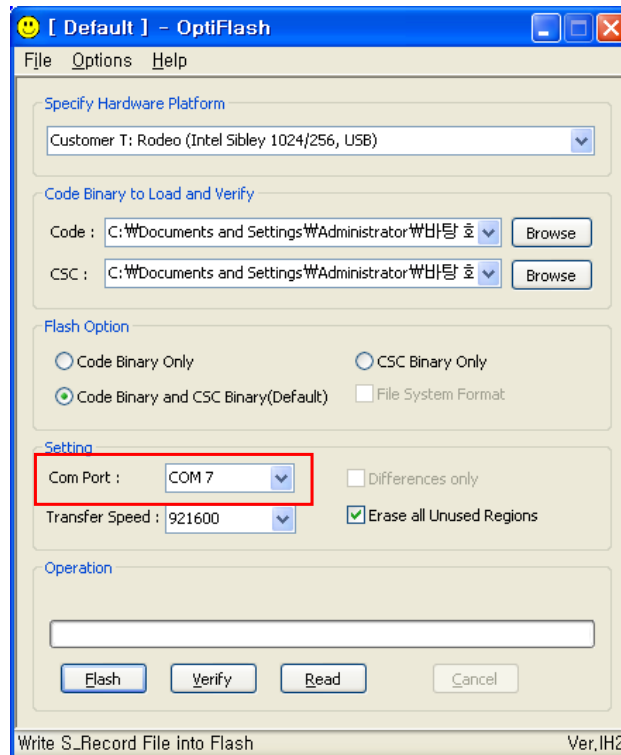


3. Click **Browse** and Select S3 file.

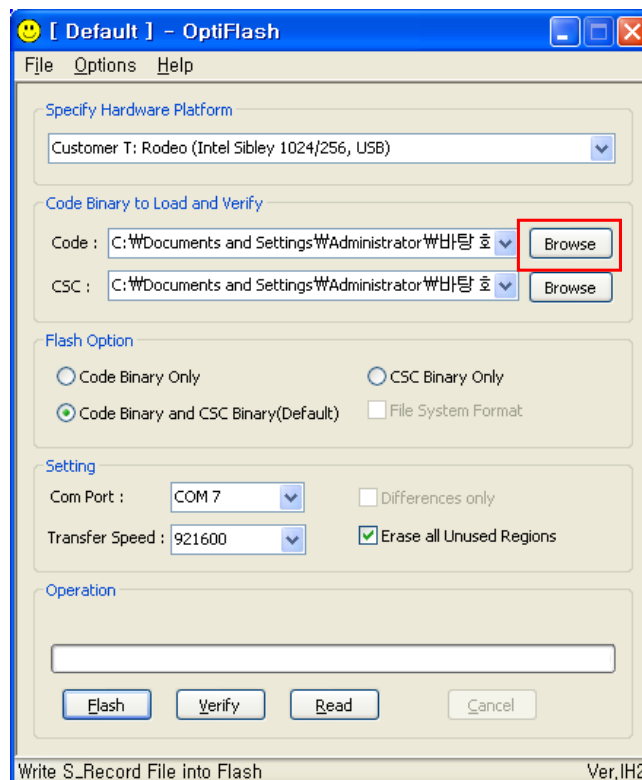


4. Click **Browse** and Select CSC file.

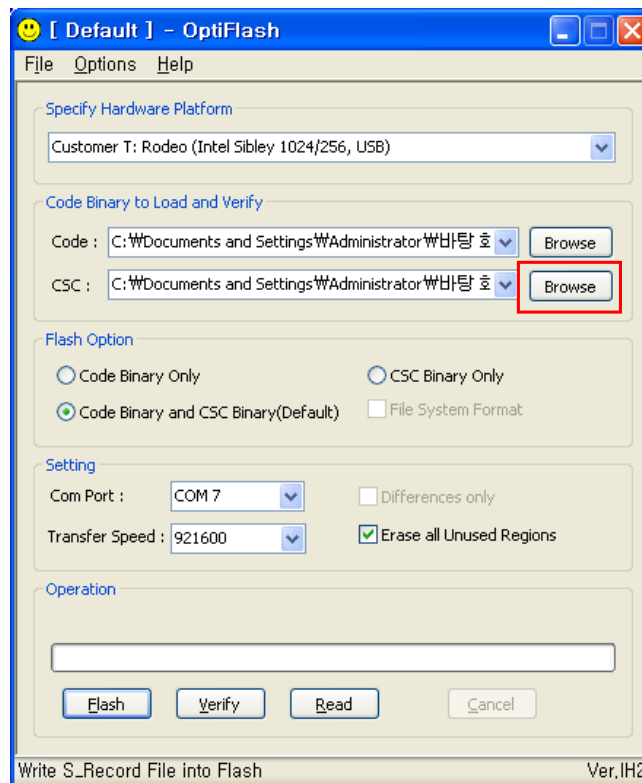


5. Click **Flash** and Type 'YES' in capital letters on the pop-up **WARNING !!!**

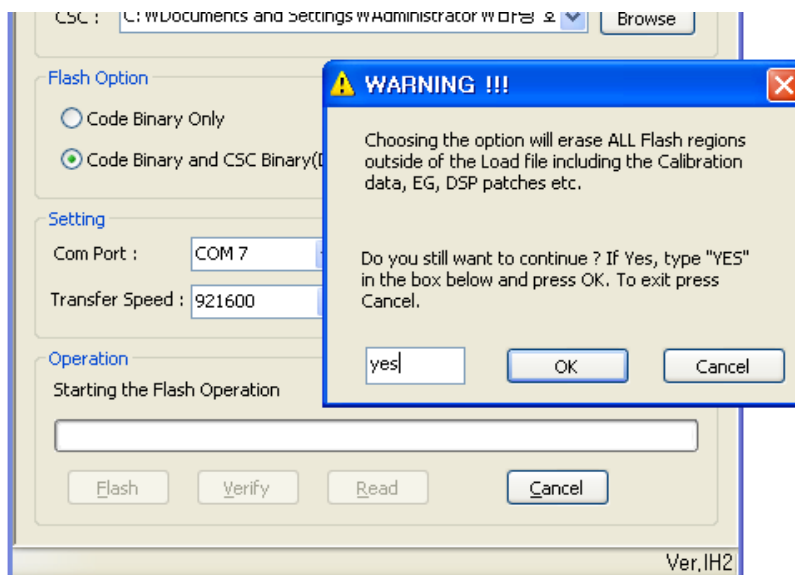

6. Click **OK** and the downloading process will be started.

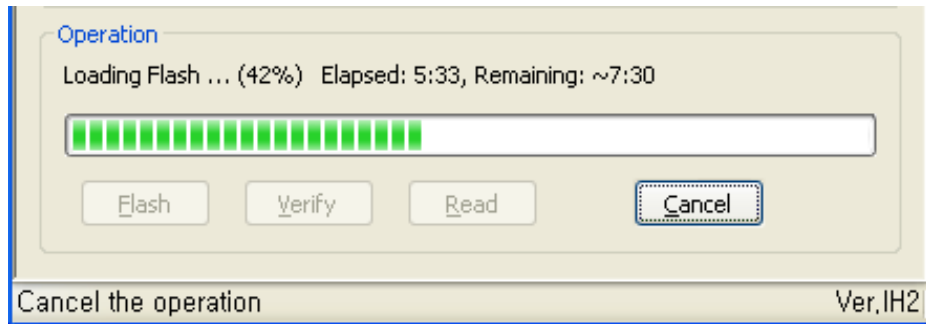

7. Wait until the message 'All is well.' displayed

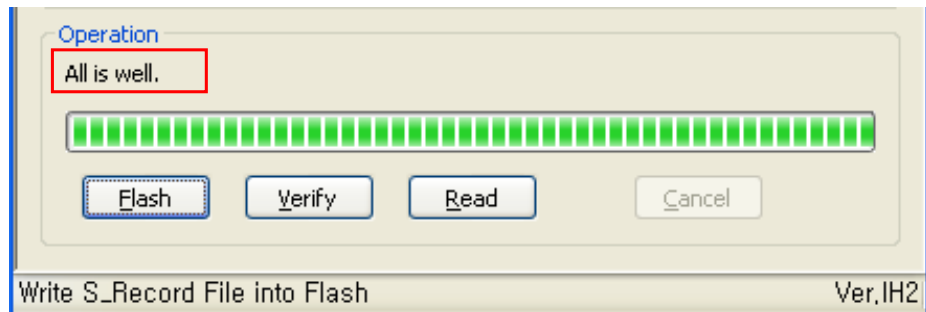

8. Confirm the downloaded version name and etc. :

***#1234#**

Full Reset :

***2767*3855#**