


# iPhone restart log analysis table


Restart data analysis method: 1:

View method: Settings-Privacy-Analysis and Improvement-Analyze Data-Find the file starting with panic Full. If there is no panic Full file, it means there is no crash information. As shown in the picture

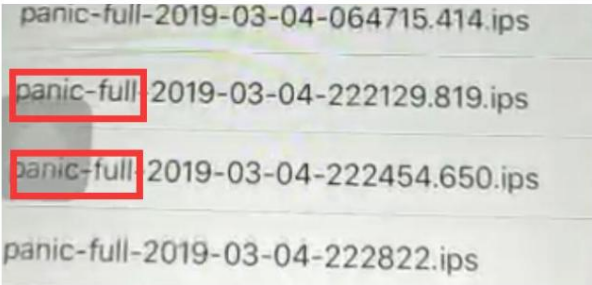

Two: Data analysis corresponds to the fault point.

After panicString:panic, compare the English in lines 1/2/3 with the English in the error message below. Example picture, the error report is in the first row (AOP PANIC)

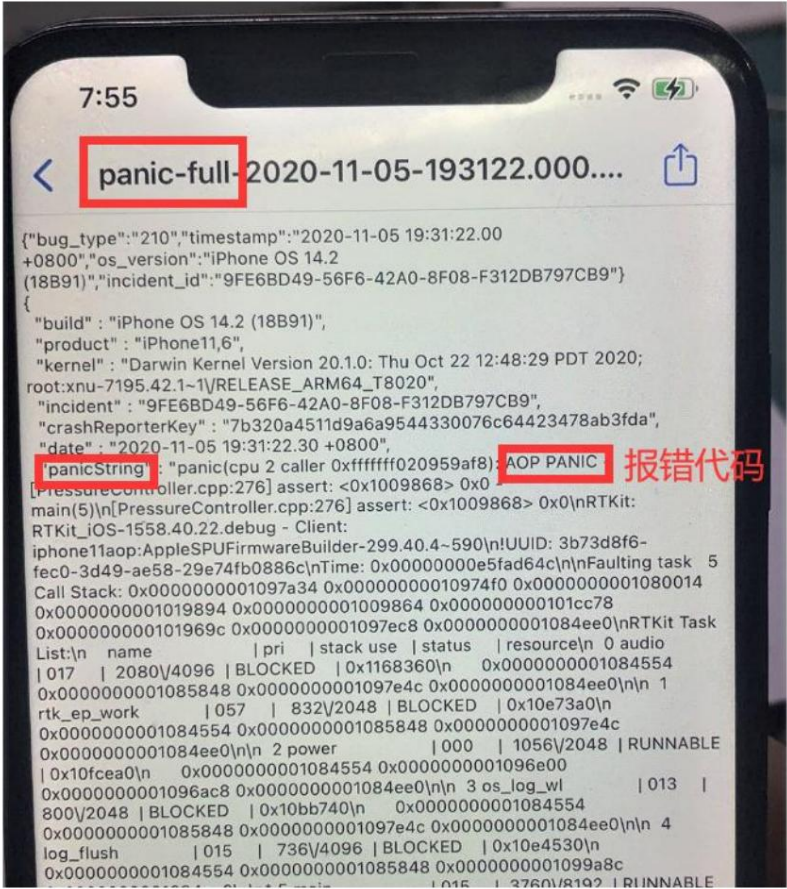

| Restart log error code | Remarks corresponding to the fault point  |  |
|------------------------|-------------------------------------------|--|
| eMemory panic          | Hard drive or hard drive related circuits |  |

|                         |                                  |                                                                                                                                                                                                                                                                                                                                                                                      |
|-------------------------|----------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| SEEPROM                 | logic chip                       |                                                                                                                                                                                                                                                                                                                                                                                      |
| SEP DATA                |                                  |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c2                    | Front cable arrangement          |                                                                                                                                                                                                                                                                                                                                                                                      |
| I2c1 (iphone 6 6P)      | U1580 U1400 U1401 U1601<br>J2118 | <p>Which I2C error is reported?</p> <p>If it's wrong, find the corresponding one</p> <p>The model I2C connected to peripherals.</p> <p>Peripherals include MIC</p> <p>vibration photosensitive hearing</p> <p>Before and after barrel arrangement</p> <p>Camera etc.</p> <p>After peripherals are excluded,</p> <p>See the motherboard correspondence</p> <p>I2C connected chip.</p> |
| I2c1(iphone6S 6SP)      | U3800 U2300 U3700 U4500          |                                                                                                                                                                                                                                                                                                                                                                                      |
| I2c1 (iphone7 7p)       | U1801 U2101 U4601                |                                                                                                                                                                                                                                                                                                                                                                                      |
| I2c1 (iphone8 8P X)     | J4300 J6400                      |                                                                                                                                                                                                                                                                                                                                                                                      |
| I2c1 (iphone xs max xr) | J4300                            |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c0 (iphone 6 6P)      | U1202 U1501 U1502 U1700          |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c0ï¿½iphone6S 6SPï¿½  | U2000 U4000 U4020                | <p>Which I2C error is reported?</p> <p>If it's wrong, find the corresponding one</p> <p>The model I2C connected to peripherals.</p> <p>Peripherals include MIC</p> <p>Vibrate photosensitive earpiece</p> <p>cables, front and rear cameras</p> <p>and other peripherals</p> <p>are eliminated.</p> <p>See the motherboard correspondence</p> <p>I2C connected chip.</p>             |
| i2c0 (iphone7 7p)       | U1801 U3703 U3701 U4001<br>U2301 |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c0ï¿½iphone8 8P Xï¿½  | U2700 U5600 U5660 U6110<br>J6400 |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c0 (iphone xs max xr) | U2700 U6110 J6400                |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c2 (iphone 6 6P)      | J1111 J2019                      |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c2ï¿½iphone6S 6SPï¿½  | J3100 J4200 U4050                | <p>Which I2C error is reported?</p> <p>If it's wrong, find the corresponding one</p> <p>The model I2C connected to peripherals.</p> <p>Peripherals include MIC</p> <p>Vibrate photosensitive earpiece</p> <p>cables, front and rear cameras</p> <p>and other peripherals</p> <p>are eliminated.</p> <p>See the motherboard correspondence</p> <p>I2C connected chip.</p>             |
| i2c2 (iphone7 7p)       | U3301 J4503                      |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c2 (iphone8 8P X)     | U3301 J4200 U5000                |                                                                                                                                                                                                                                                                                                                                                                                      |
| i2c2 (iphone xs max xr) | U5002                            |                                                                                                                                                                                                                                                                                                                                                                                      |
|                         |                                  |                                                                                                                                                                                                                                                                                                                                                                                      |

|                                                                         |                                                                                                                                                                                                                                                                                                                                                           |                                                                           |
|-------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------|
| i2c3 (iphone7 7p)                                                       | Tail plug, mic behind the display                                                                                                                                                                                                                                                                                                                         |                                                                           |
| i2c3 (iphone8 8P)                                                       | Tail plug, display seat, screen, backlight<br>Chip (8p)                                                                                                                                                                                                                                                                                                   |                                                                           |
| i2c3 (X xs max xr)                                                      | Display power, touch, touch base                                                                                                                                                                                                                                                                                                                          |                                                                           |
| i2c4(A11) series                                                        | logic chip                                                                                                                                                                                                                                                                                                                                                |                                                                           |
| SMC i2cm0(A11) series                                                   | U3100 U3300 U3400 U6200<br>J3200                                                                                                                                                                                                                                                                                                                          |                                                                           |
| SMC i2cm0(A12) series                                                   | U3300 U3400 U6200 J3200                                                                                                                                                                                                                                                                                                                                   |                                                                           |
| SMC i2cm1(A11) series                                                   | USB chip                                                                                                                                                                                                                                                                                                                                                  |                                                                           |
| SMC i2cm1(A12) series                                                   | USB chip main power                                                                                                                                                                                                                                                                                                                                       |                                                                           |
| i2c5(A10) series                                                        | logic chip                                                                                                                                                                                                                                                                                                                                                |                                                                           |
| AOP PANIC                                                               | Distance sensing, rear noise reduction MIC<br>7P boot cable arrangement<br>Check if the fingerprint is damaged                                                                                                                                                                                                                                            | MIC at the rear<br><br>Line next to the camera<br><small>superior</small> |
| AOP PANIC No pulse on                                                   | After checking the vibration-related components, check the<br><b>Audio</b><br>Check distance sensor                                                                                                                                                                                                                                                       |                                                                           |
| AOP PANIC-...prox                                                       | distance sensor                                                                                                                                                                                                                                                                                                                                           |                                                                           |
| AOP PANIC – Pressure queue blocked: Compass                             |                                                                                                                                                                                                                                                                                                                                                           |                                                                           |
| Apple BCM Wi-Fi                                                         | WiFi Bluetooth                                                                                                                                                                                                                                                                                                                                            |                                                                           |
| AOP DATA ABORT                                                          | Please rule out factors such as weak soldering of the CPU and unstable board layers first.<br>Bus abnormalities caused by wiring (water intrusion/falling), such as handset wiring,<br>Tail plug, boot strip, etc., external configuration including i2c bus will cause<br>For this fault, the motherboard part also needs to be repaired around the bus. |                                                                           |
| AOP PREFETCH ABORT                                                      |                                                                                                                                                                                                                                                                                                                                                           |                                                                           |
| AOP data, link CMD timeout; bus 0                                       | CPU down                                                                                                                                                                                                                                                                                                                                                  |                                                                           |
| Apple SocHot                                                            | The CPU is overheated and the upper cover is weakly soldered.                                                                                                                                                                                                                                                                                             |                                                                           |
| AOP PANIC K2-bosch control                                              | Gyroscope, vibration, tail plug                                                                                                                                                                                                                                                                                                                           |                                                                           |
| AOPNIMI POWER                                                           | Most power-on wiring faults                                                                                                                                                                                                                                                                                                                               |                                                                           |
| AOP PANIC-SCMto3-pearl                                                  | Handset cable (face) causes restart                                                                                                                                                                                                                                                                                                                       |                                                                           |
| AMCC Error                                                              | Light-sensitive                                                                                                                                                                                                                                                                                                                                           |                                                                           |
| Apple Tristar2:could not find i2c...corresponding<br>Codewechat:hculion | Tail plug and USB management chip                                                                                                                                                                                                                                                                                                                         |                                                                           |
| apcie(0:s3e)                                                            | harddisk                                                                                                                                                                                                                                                                                                                                                  |                                                                           |
| apcie(wlan)                                                             | WIFI chip                                                                                                                                                                                                                                                                                                                                                 |                                                                           |

|                                                                   |                                                                                                             |                                                                           |
|-------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------|
| Apple smartIO:Firmware fatal prefetch abort exception             | Firmware issues                                                                                             | Failure after flashing<br>Same bottom question<br><small>question</small> |
| Apple tristar2:could not find                                     | tail plug                                                                                                   |                                                                           |
| AppleSOC hot hot hot                                              | Pay attention to check the large audio or wifi                                                              |                                                                           |
| AppleHIDTransportProtocol                                         | Screen                                                                                                      |                                                                           |
| Apple PPM                                                         | First consider charging and discharging original components, such as<br>Charging IC battery conversion tube |                                                                           |
| Apple PMGR                                                        | Battery                                                                                                     |                                                                           |
| Apple MESA                                                        | Restart caused by fingerprint                                                                               |                                                                           |
| Apple Tristar Hydra<br>AppleHydra<br>Applekraken                  | The tail plug or USB chip is damaged                                                                        |                                                                           |
|                                                                   |                                                                                                             |                                                                           |
| AGXG10P B0 NMI                                                    | Plate layer (more common in 8, 8P, X)                                                                       |                                                                           |
| AppleBcmWian                                                      | tail plug                                                                                                   |                                                                           |
| AGXK AGXAcceleator                                                | Gyroscope accelerator coprocessor                                                                           |                                                                           |
| A kext releasing                                                  | First consider the CPU inductor                                                                             |                                                                           |
| ANS2                                                              | Hard disk circuit or board layer                                                                            |                                                                           |
| ANS                                                               | After the hard disk is excluded, there is the board layer.                                                  |                                                                           |
| PMP NMI FIQ                                                       | CPU power supply                                                                                            |                                                                           |
| Attempting to forcibly halt CPU...cpu0 fail CPU virtual soldering |                                                                                                             |                                                                           |
| Anc-postnand.c1260 asser failed link hard disk problem            |                                                                                                             |                                                                           |
| A freed zone element has been modified CPU virtual soldering      |                                                                                                             |                                                                           |
| baseband                                                          | Baseband part                                                                                               |                                                                           |
| Bad tailq elm                                                     | Main crystal oscillator or wide-angle camera                                                                |                                                                           |
| CP_COM_NORM REQUEST                                               | CPU hard disk or camera circuit                                                                             |                                                                           |
| CSL AUDIO                                                         | audio related                                                                                               |                                                                           |
| Dart-diso0 SMMU error                                             | rear camera or rear camera<br>line problem                                                                  |                                                                           |
| dart-apcie1                                                       | Hard drive communication problem                                                                            |                                                                           |
| XS                                                                | After Wdt is repaired, it still does not appear after restarting.<br>Know the code                          | Prioritize Tuo<br><small>spiral instrument</small>                        |
| Void applesynopsysMIPID SIController front cable                  |                                                                                                             |                                                                           |

|                                                           |                                                                                                                  |                            |
|-----------------------------------------------------------|------------------------------------------------------------------------------------------------------------------|----------------------------|
| Kernel data abort<br>Kerneisataahort                      | First check the charging IC and then exclude<br>CPU power supply                                                 |                            |
| Kernel Instruction forch abort                            | Fast charging IC or CPU communication failure                                                                    |                            |
| nvme                                                      | Hard drive and related                                                                                           |                            |
| Prev-next                                                 | Main crystal oscillator failure                                                                                  |                            |
| PP0                                                       | Check the tail volume bar                                                                                        |                            |
| 600 seconds                                               | harddisk                                                                                                         |                            |
| Trying to change a collection in the<br>registry          | System problem, flash the machine                                                                                |                            |
| Tglon<br>Teion                                            | Audio                                                                                                            |                            |
| LLC                                                       | Baseband circuitry, possibly audio                                                                               |                            |
| LSU                                                       | WiFi module                                                                                                      |                            |
| L2C                                                       | Consider WIFI first and then amplify ringtones                                                                   |                            |
| Lnitproc exited                                           | 24M main clock crystal oscillator                                                                                |                            |
| LLC Bus error from cpu3yFAR                               | Communication error between CPU and WiFi module                                                                  |                            |
| sks request timeout                                       | Cpu to logic code fragment disconnected                                                                          |                            |
| SCL display PMU                                           | Display or display power supply chip                                                                             |                            |
| Spmi timeout                                              | audio related                                                                                                    |                            |
| SMC PREFETCH ABORT                                        | A11 or above battery data detection pins<br>path, USB management, power supply (A12)                             |                            |
| SMC DATA ABORT                                            | CPU communication abnormality                                                                                    |                            |
| SMC PANIC                                                 | CPU power supply check inductor                                                                                  |                            |
| SMC PANIC.....Misc(2) OUTBOX...                           | Tail plug cable, barometer,<br>13Promax, the front sensor cable is broken<br><br>This is also the error reported | Enthusiastic members share |
| SEP panic:dxio/i2c                                        | Antenna problem                                                                                                  |                            |
| SEP Panic: :sars/sars                                     | Screens and related circuits                                                                                     |                            |
| Sleep/wake hang detected                                  | First consider audio related circuits, then<br>Rear CPU power supply                                             |                            |
| Stacks+routined-2019-01-29.....                           | Most iPads have battery screw posts that are too long.<br>To                                                     |                            |
| User space watchdog timeout: no successful<br>checks from | Tail plug, earpiece amplifier                                                                                    |                            |
| User space watch dog time out                             | No data on tail plug vibrator battery                                                                            |                            |
| HaltRestart Timed out                                     | Tail plug, earpiece amplifier                                                                                    |                            |

|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |                                                                                     |                                                  |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|--------------------------------------------------|
| Fatal coherency point error CP_com_NORM                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | BUCK power supply problem, CPU bypass power feel                                    |                                                  |
| fed err(parity counter overflow multi hit ICTAG) reported via error                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Cover hard drive                                                                    |                                                  |
| Failed to stop GFX FW for GPU recovery                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | GPU power supply is unstable, inductor, CPU<br><small>Air welding</small>           |                                                  |
| Fatal Coherency Point Error                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | (Cache error) Power supply from top cover                                           |                                                  |
| Fimware fatal                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | system or underlying                                                                |                                                  |
| Fed err(party counter overflow multi hit ICTAG) reported                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Upper cover, hard disk                                                              |                                                  |
| mubf_watchdog:2waiters stuck                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Hard drive problem                                                                  |                                                  |
| Releasing non_exclusive                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | CPU inductor problem                                                                |                                                  |
| Reset sequence did not finish within 5000ms                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Communication abnormality between CPU and WIFI                                      |                                                  |
| Rtunref Bad refcnt                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | harddisk                                                                            |                                                  |
| Void applesynopsysMIPIF                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | The front earpiece cable is faulty or water has entered the corrosion               |                                                  |
| Invalid kernel stack pointer (probablecorruption)<br><br>Kernel stack pointer is invalid (possibly corrupt)                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | CPU step-down inductor, upper cover power supply,<br><br><small>upper cover</small> |                                                  |
| iop_ringbuffer                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | audio related                                                                       |                                                  |
| Initproc exited                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Main crystal oscillator failure                                                     |                                                  |
| Invalid mutex                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Hard disk bottom layer                                                              |                                                  |
| Invalid queue element linkage                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Hard drive is soldered or damaged                                                   |                                                  |
| NO pulse on                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Pulse (ring vibration)                                                              |                                                  |
| WKDMD ERROR code 0x2                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Flashing error 14 hard drive                                                        |                                                  |
| WDT                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Audio decoding (large audio) to the bottom<br><br>M1C1 bias voltage problem         |                                                  |
| WDT timeout<br><br>userspace watchdog timeout<br><div><div><div><div>&lt;</div><div>panic-full-2022-09-05-162738...</div><div>&gt;</div></div><div><div><div>{"bug_type": "210", "timestamp": "2022-09-05 16:27:38.00 +0800", "os_version": "iPhone OS 15.3.1 (19D52)", "incident_id": "06DF2333-7FE6-47FD-9616-829F02B24F1D"} {<br/>  "build": "iPhone OS 15.3.1 (19D52)",<br/>  "product": "iPhone10,3",<br/>  "kernel": "Darwin Kernel Version 21.3.0: Wed Jan 5 21:44:48 PST 2022; root:xnu-8019.80.24~2/RELEASE_ARM64_T8015",<br/>  "incident": "06DF2333-7FE6-47FD-9616-829F02B24F1D",<br/>  "crashReporterKey": "28ee7ae977a7c56187de735732647f45d7241bc9",<br/>  "date": "2022-09-05 16:27:38.10 +0800",<br/>  "panicString": "panic(cpu 1 caller 0xfffffff01de459ac): userspace watchdog timeout: no successful checkins from thermalmonitord since load\nservice returned not alive with context : is_alive_func returned unhealthy : current 3fffffff, mask 67fffffff, expected 67fffffff. SD: 0 BC: 1 Missing sensor(s): TGOB TGOV\nservice: backboardd, total successful checkins since load (180 seconds ago): 19, last successful checkin: 0 seconds ago\nservice: SpringBoard, total successful checkins since load (169 seconds ago): 17, last successful checkin: 0 seconds ago\nservice: mediaserverd, total successful checkins since load (180 seconds ago): 19, last successful checkin: 0 seconds ago\nservice: logd,</div></div></div></div></div> | TT1P TT2P                                                                           | Screen                                           |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | TGOB TGOB                                                                           | Battery no data                                  |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | TP3R                                                                                | Screen to CPU<br><br><small>open circuit</small> |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | TP1A                                                                                | battery failure                                  |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Prs0                                                                                | tail plug                                        |
|                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | TP2C                                                                                | Battery                                          |

|                                                                                                                                                                                                                                                                                                                                                                           |                |                |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|----------------|
|                                                                                                                                                                                                                                                                                                                                                                           | TP2A TP3R TP4H | battery screen |
|                                                                                                                                                                                                                                                                                                                                                                           | TGOVTTSA       | tail plug      |
|                                                                                                                                                                                                                                                                                                                                                                           | MIC            | microphone     |
|                                                                                                                                                                                                                                                                                                                                                                           |                |                |
|                                                                                                                                                                                                                                                                                                                                                                           |                |                |
| WDT timeout backboard                                                                                                                                                                                                                                                                                                                                                     |                | USB chip       |
| <p>The latest system IOS15 starts to cause wireless charging cable damage, which will cause the machine to restart and no sound.</p> <p>Damage caused the black line card machine to restart</p> <p>If you don't understand, exclude the foreign parts first.</p> <p>If you have experience to share, feedback is welcome</p> <p>Customer service WeChat: 18823306625</p> |                |                |