

Service Manual

LG-LS740

Table Of Contents

1. INTRODUCTION.....	3	4. DOWNLOAD.....	100
1.1 Purpose	3	5. BLOCK DIAGRAM.....	117
1.2 Regulatory Information	3	6. CIRCUIT DIAGRAM	128
2. PERFORMANCE.....	5	7. BGA PIN MAP	152
2.1 Product Name.....	5	8. PCB LAYOUT	168
2.2 Supporting Standard.....	5	9. CALIBRATION.....	172
2.3 Functions of Major Semi-Conductors	5	10. NAM INPUT METHOD	191
2.4 HW Features	6	11. DISASSEMBLE GUIDE.....	193
2.5 SW Features	7	12. EXPLODED VIEW & REPLACEMENT PART LIST	198
2.6 Battery Bar.....	10	12.1 EXPLODED VIEW.....	198
3. TROUBLE SHOOTING	11	12.2 Replacement Parts	201
3.1 RF Component	11	12.3 Accessory	236
3.2 CDMA<E SIGNAL PATH	15		
3.3 Checking CDMA<E Block.....	16		
3.4 Checking RF Tx Level(LTE B41)	22		
3.5 Checking RF PRx Level(CDMA BC0,BC10 & LTE B26).....	25		
3.6 Checking RF DRx Level(CDMA BC0,BC10& LTE B26)	28		
3.7 Checking RF PRx Level(CDMA BC1 & LTE B25).....	30		
3.8 Checking RF DRx Level(CDMA BC1 & LTE B25).....	33		
3.9 Checking RF PRx Level(LTE B41)	36		
3.10 Checking RF DRx Level(LTE B41).....	39		
3.11 GPS/WIFI/BT Module	42		
3.12 GPS/WIFI/BT SIGNAL PATH.....	44		
3.13 FM Radio Troubleshooting.....	51		
3.14 Audio	53		
3.15 Camera	66		
3.16 LCD	69		
3.17 Power ON Troubleshooting	72		
3.18 Charging Troubleshooting.....	76		
3.19 USB Trouble shooting	81		
3.20 Touch Trouble Shooting	88		
3.21 Vibrator Troubleshooting	90		
3.22 Compass & Accelerometer Sensor troubleshooting.....	92		
3.23 Proximity/Light Sensor on/off trouble.....	94		
3.24 Hall IC Sensor troubleshooting	96		
3.25 IRRC Sensor troubleshooting.....	98		

1. INTRODUCTION

1. 1 Purpose

This manual provides the information necessary to repair, calibration, description and download the features of this model.

1. 2 Regulatory Information

A. Security

Toll fraud, the unauthorized use of telecommunications system by an unauthorized part (for example, persons other than your company's employees, agents, subcontractors, or person working on your company's behalf) can result in substantial additional charges for your telecommunications services. System users are responsible for the security of own system. There are may be risks of toll fraud associated with your telecommunications system. System users are responsible for programming and configuring the equipment to prevent unauthorized use. The manufacturer does not warrant that this product is immune from the above case but will prevent unauthorized use of common carrier telecommunication service of facilities accessed through or connected to it. The manufacturer will not be responsible for any charges that result from such unauthorized use.

B. Incidence of Harm

If a telephone company determines that the equipment provided to customer is faulty and possibly causing harm or interruption in service to the telephone network, it should disconnect telephone service until repair can be done. A telephone company may temporarily disconnect service as long as repair is not done.

C. Changes in Service

A local telephone company may make changes in its communications facilities or procedure. If these changes could reasonably be expected to affect the use of the phones or compatibility with the net work, the telephone company is required to give advanced written notice to the user, allowing the user to take appropriate steps to maintain telephone service.

D. Maintenance Limitation

Maintenance limitations on the phones must be performed only by the manufacturer or its authorized agent. The user may not make any changes and/or repairs expect as specifically noted in this manual. Therefore, note that unauthorized alternations or repair may affect the regulatory status of the system and may void any remaining warranty.

E. Notice of Radiated Emission

This model complies with rules regarding radiation and radio frequency emission as defined by local regulatory agencies. In accordance with these agencies, you may be required to provide information such as the following to the end user.

F. Pictures

The pictures in this manual are for illustrative purposes only; your actual hardware may look slightly different.

G. Interference and Attenuation

A phone may interfere with sensitive laboratory equipment, medical equipment, etc. Interference from unsuppressed engines or electric motors may cause problems.

H. Electrostatic Sensitive Devices

ATTENTION

Boards, which contain Electrostatic Sensitive Device (ESD), are indicated by the sign. information is ESD handling: Following



- Service personnel should ground themselves by using a wrist strap when exchange system boards.
- When repairs are made to a system board, they should spread the floor with anti-static mat which is also grounded.
- Use a suitable, grounded soldering iron.
- Keep sensitive parts in these protective packages until these are used.
- When returning system boards or parts like EEPROM to the factory, use the protective package as described.

2. PERFORMANCE

2.1 Product Name

LS740 : US Cellular(BC10 Support)/US PCS(EVDO Rev_0 /Rev_A) /LTE B25,B26,B41

2.2 Supporting Standard

Item	Feature	Comment
Supporting Standard	US Cellular(BC10 Support)/ US PCS/GPS LTE B25, B26, B41	
Frequency Range	US Cellular TX : 816 ~ 848.19 MHz US Cellular RX : 861~893.19 MHz US PCS TX : 1850~1910 MHz US PCS RX : 1930~1990 MHz LTE B25 TX : 1850~1915 MHz LTE B25 RX : 1930~1995 MHz LTE B26 TX : 814~849 MHz LTE B26 RX : 859~894 MHz LTE B41 TX/RX : 2496~2690 MHz GPS : 1575.42 MHz	

2.3 Functions of Major Semi-Conductors

Classification	Function
MSM8926	Digital Baseband Processor 4G
WTR1625L	4G MODEM
PM8926	PMIC
H9TKNNN8JDAPLR	Mobile SDRAM(LPDDR2)
WCN3620	BT/WLAN Tranceiver

2.4 HW Features

Item	Feature	Comment
Form Factor	DOP	
Battery	1) Capacity Standard : Li-ion, 3000mAh	
	2) Packing Type : Hard Pack	
Size	Standard : 131.6 X 66 X 10.56	
Weight	134g(Battery)	
LCD	HD Plastic OLED (6", 1280 X 720 Pixels)	
Built-in Camera	8M AF /Digital Zoom : x4	
Keypad	Full Touch Screen Home Key	Side Key : Power On, Volume up/down
ANT	Main : PIFA(Embedded)Type	
System connector	u-USB	
Ear Phone Jack	3.5Φ Ear Jack	
Memory	8Gb(SDRAM LPDDR2) + 8GB eMMC	
Speech coding	QCELP, EVRC, EVRC-B, EVRC-WB,	
Vibrator	Coin Type	
Blue Tooth	Bluetooth 4.0 BLE	
MIDI(for Buzzer Function)	SW Decoded 64Poly	
Music Player	MP3, eAC3, AAC, (e)AAC+, WMA, FLAC, AMR, EVRC, QCELP, OGG, MIDI, PCM	
Video Player	MPEG4, H.264	
Camcorder	MPEG4 or H.263	
Voice Recording	Yes	
Speaker Phone mode Support	Yes	
Travel Adapter	Yes	
CDROM	No	
Stereo Headset	No	
Data Cable	Yes	
T-Flash (External Memory)	No	

2.5 SW Features

Item	Feature	Comment
RSSI	0 ~ 6 Levels	
Battery Charging	0 ~ 21 Levels	
Key Volume	0 ~ 7 Level	
Audio Volume	0 ~ 15 Level	
Time / Date Display	Yes	
Multi-Language	Yes	English,Spanish,Korean, Chineses(CN,TW)
Quick Access Mode	Phone / Messaging / Browser / Contacts	It is editable by users.
PC Sync	No	
Speed Dial	Yes	Voice mail center -> 1 key
Profile	Yes	not same with feature phone setting
CLIP / CLIR	NO	
Phone Book	Name / Phone / Email / Address / Group / Ringtone / Vibrate type / Notification LED / Add another field	There is no limitation on the number of items. It depends on available memory amount.
Last Dial Number	Yes	There is no limitation on the number of items. It depends on available memory amount..
Last Received Number	Yes	There is no limitation on the number of items. It depends on available memory amount...
Last Missed Number	Yes	There is no limitation on the number of items. It depends on available memory amount...
Search by Number / Name	Name / Number	Email , Nick name, AIM and the other fields listed on the contacts are also searchable.

2. PERFORMANCE

Group	Yes	There is no limitation on the number of items. It depends on available memory amount.
Fixed Dial Number	No	
Service Dial Number	No	
Own Number	No	
Voice Memo	No	Only Support Voice Command
Call Reminder	No	
Network Selection	Automatic	
Mute	Yes	
Call Divert	No	
Call Barring	No	
Call Charge (AoC)	No	
Call Duration	No	
SMS (EMS)	There is no limitation on the number of items.It depends on available memory amount.	EMS does not support.
SMS Over GPRS	No	
EMS Melody / Picture	No	
Send / Receive / Save	Yes	
MMS MPEG4 Send / Receive / Save	Yes	
Long Message	MAX 924 characters	SMS 6 concatenated
Cell Broadcast	Yes	
Download	Yes	
Game	No	
Calendar	Yes	
Memo	Yes	

2. PERFORMANCE


World Clock	Yes	
Unit Convert	No	
Stop Watch	Yes	It is included on Alarm/Clock
Wall Paper	Yes	
WAP Browser	No	WAP stack and wml are not supported.
Download Melody / Wallpaper	Yes	Over web browser
SIM Lock	No	
SIM Toolkit	No	
MMS	Yes	
Camera	Yes	8M AF / Digital Zoom : x4
JAVA	No	Android do not support JAVA
Voice Dial	Yes	
IrDa	No	
Bluetooth	Yes	Bluetooth Ver. 4.0
FM radio	No	
GPRS	Yes	Class 10
EDGE	Yes	Class 10
Hold / Retrieve	Yes	
Conference Call	Yes	Max. 3
DTMF	Yes	
Memo pad	Yes	
TTY	Yes	
AMR	Yes	
SyncML	No	
IM	Yes	Hangout
Email	Yes	

2.6 Battery Bar

Battery Bar	Specification	Battery Bar	Specification
Bar 20(Full)	98%	Bar 9 -> Bar 8	43% -> 42%
Bar 20 -> Bar 19	98% -> 97%	Bar 8 -> Bar 7	38% -> 37%
Bar 19 -> Bar 18	93% -> 92%	Bar 7 -> Bar 6	33% -> 32%
Bar 18 -> Bar 17	88% -> 87%	Bar 6 -> Bar 5	28% -> 27%
Bar 17 -> Bar 16	83% -> 82%	Bar 5 -> Bar 4	23% -> 22%
Bar 16 -> Bar 15	78% -> 77%	Bar 4 -> Bar 3	18% -> 17%
Bar 15 -> Bar 14	73% -> 72%	Bar 3 -> Bar 2	13% -> 12%
Bar 14 -> Bar 13	68% -> 67%	Bar 2 -> Bar 1	8% -> 7%
Bar 13 -> Bar 12	63% -> 62%	Bar 1 -> Bar 0	3% -> 2%
Bar 12 -> Bar 11	58% -> 57%	Power off	2% -> 1%
Bar 11 -> Bar 10	53% -> 52%	Low battery pop-up	15% , 5%, 1%
Bar 10 -> Bar 9	48% -> 47%		

3. TROUBLE SHOOTING

3.1 RF Component

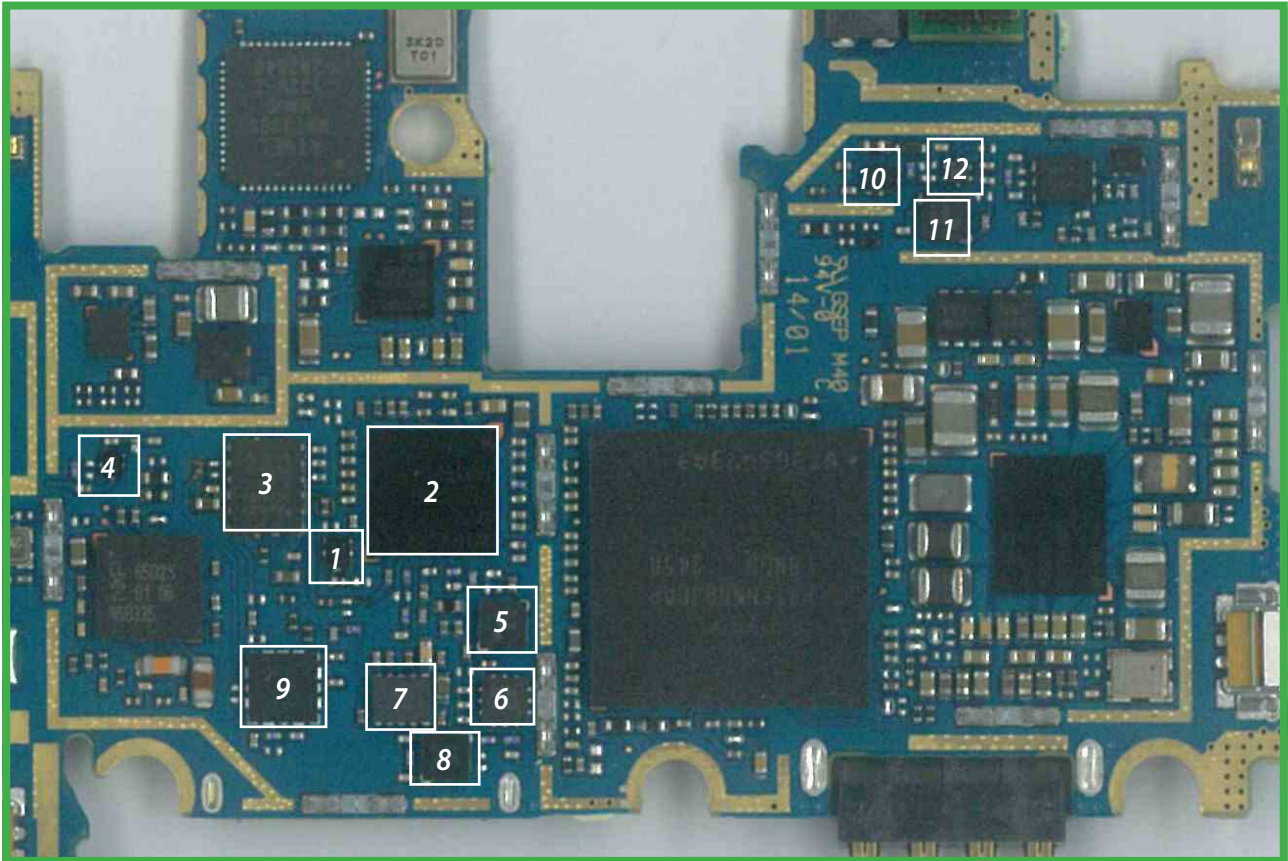

<Main Top>

1. FL1624 : BC0/BC10 B26 Tx SAW

2. U1500 : RF Transceiver

3. U1601 : BC0/BC1/BC10 B25/B26 Dual PA

4. FL1104 : BC0/B26 DRx Filter

5. U1750 : B41 PRx Filter

6. U1101 : B41 SPDT SW

7. U1751 : B41 PA

8. U1752 : B41 Tx Filter


9. U1600 : BC0/BC1/BC10 B25/B26 Quadplexer

10. FL1102 : BC1/B25 DRx Filter

11. FL1100 : B41 DRx Filter


12. FL1101 : BC1 B25/B41 DRx SPDT SW

3. TROUBLE SHOOTING

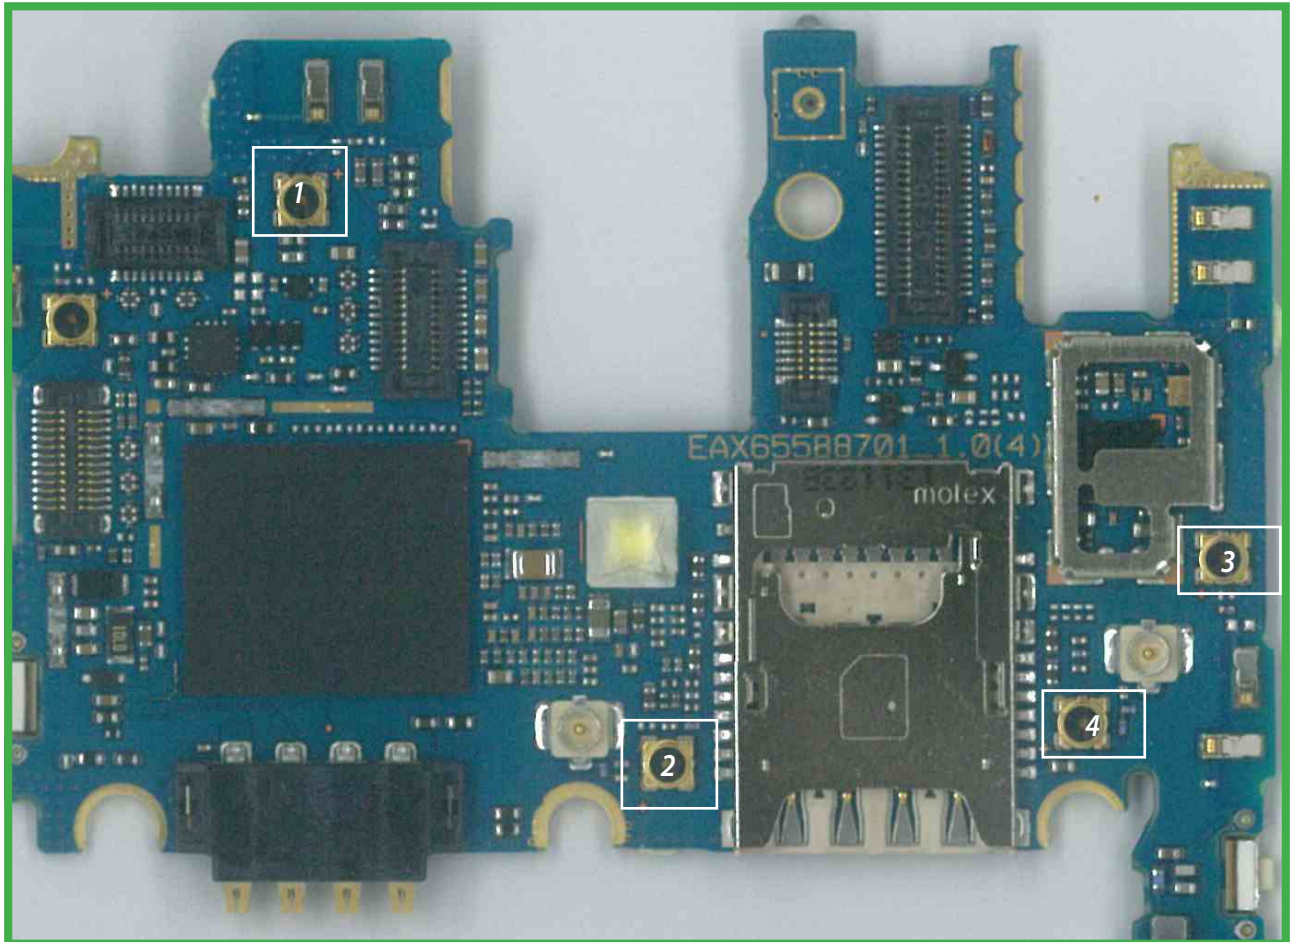

<Main Bot>

1. SW1106 : BC1 B25/B41 DRx RF Switch
2. SW1101 : B41 RF Switch
3. SW1104 : BC0/B26 DRx RF Switch
4. SW1103 : BC0/BC1/BC10 B25/B26 RF Switch

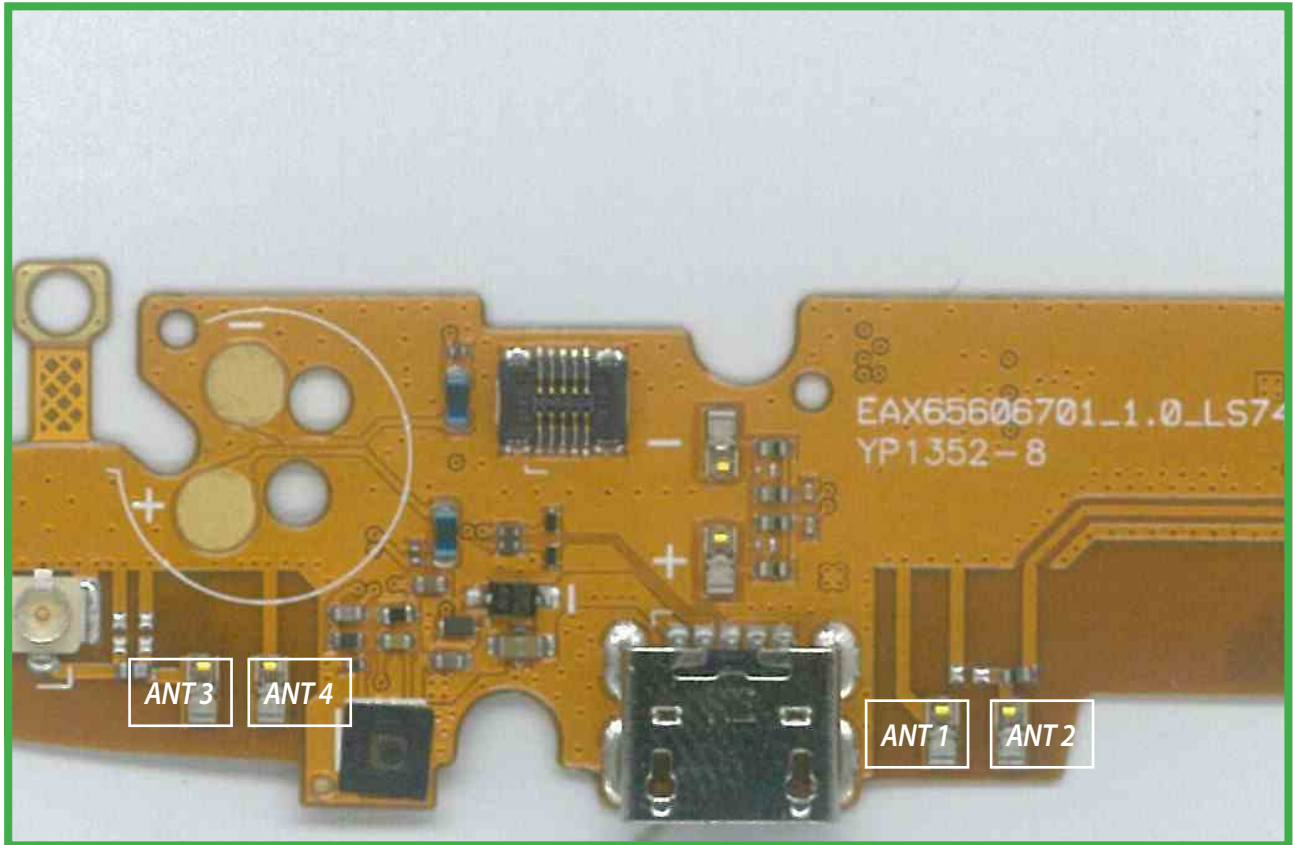


Lower FPCB (Bottom)

3. TROUBLE SHOOTING

Reference	Description
FL1100	B41 DRx Filter
FL1101	BC1/B25/B41 DRx SPDT SW
FL1102	BC1/B25 DRx Filter
FL1104	BC0/B26 DRx Filter
FL1624	BC0/BC10/B26 Tx SAW
SW1101	B41 RF Switch
SW1103	BC0/BC1/BC10/B25/B26 RF Switch
SW1104	BC0/B26 DRx RF Switch
SW1106	BC1/B25/B41 DRx RF Switch
U1100	GPS LNA
U1101	B41 SPDT SW
U1400	DC-DC Converter for PA
U1500	RF Transceiver
U1600	BC0/BC1/BC10/B25/B26 Quadplexer
U1601	BC0/BC1/BC10/B25/B26 Dual PA
U1750	B41 PRx Filter
U1751	B41 PA
U1752	B41 Tx Filter
ANT 1	BC0/BC1/BC10/B25/B26 Main ANT. Contact
ANT 2	BC0/BC1/BC10/B25/B26 Main ANT. Contact
ANT 3	B41 Main ANT. Contact
ANT 4	B41 Main ANT. Contact

3.2 CDMA<E SIGNAL PATH

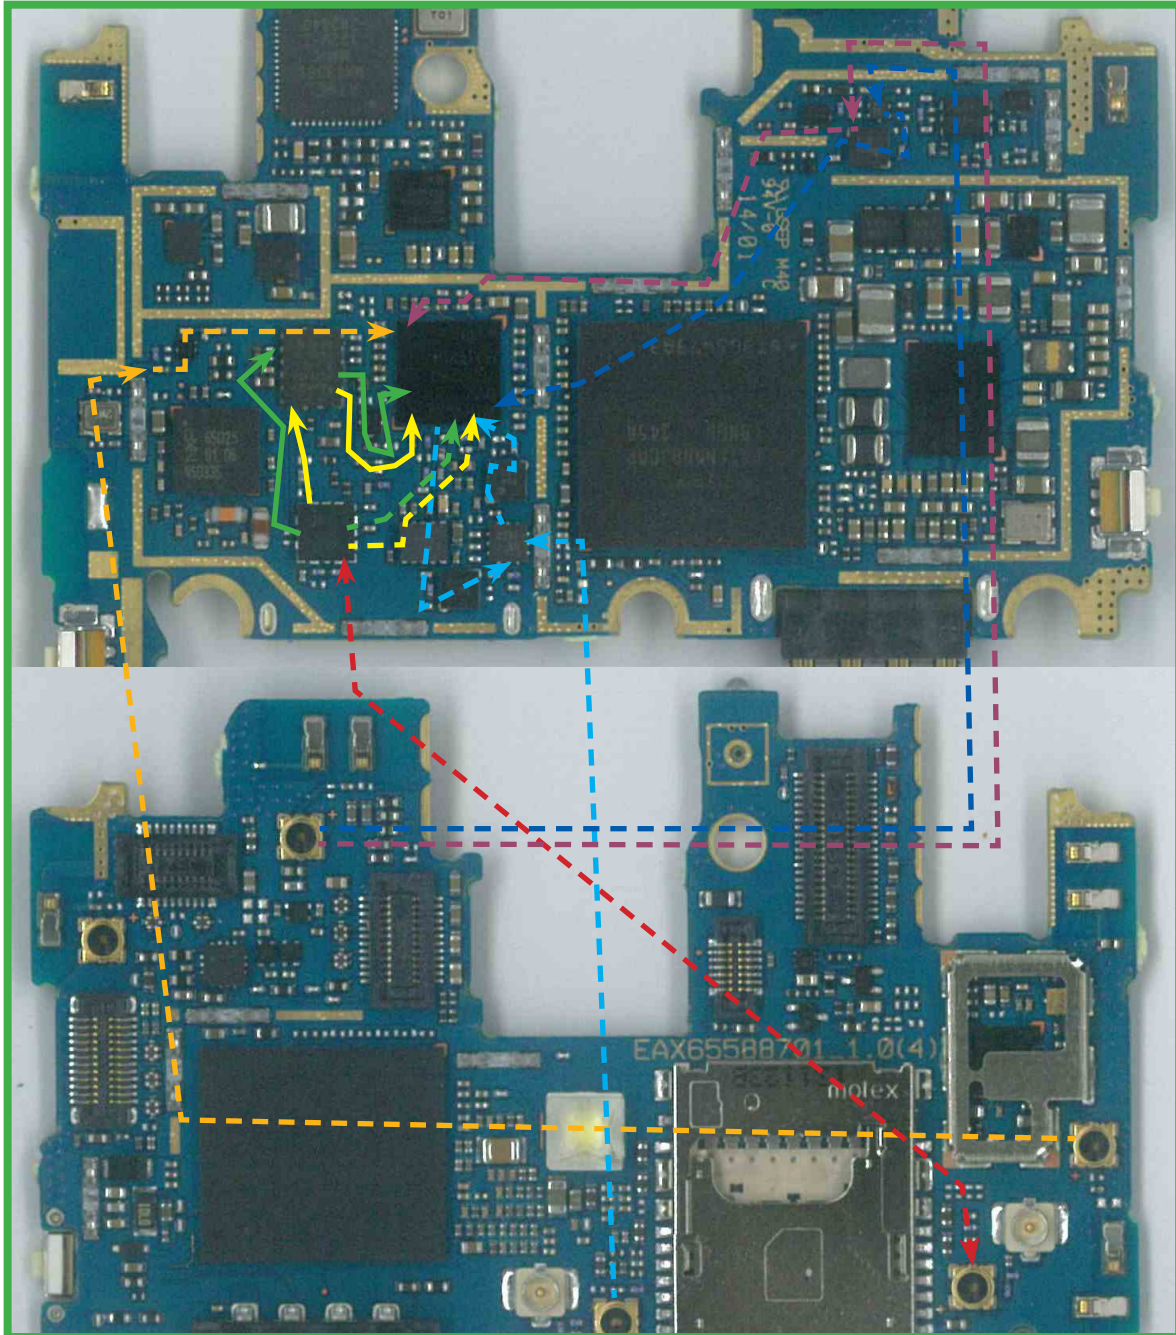

BC0,BC10,B26,BC1,B25 RTX

BC0,BC10,B26 RTX

BC1,B25 RTX


B41 RTX

BC0,BC10,B26 DRX


BC1,B25 DRX

B41 DRX

3.3 Checking CDMA<E Block

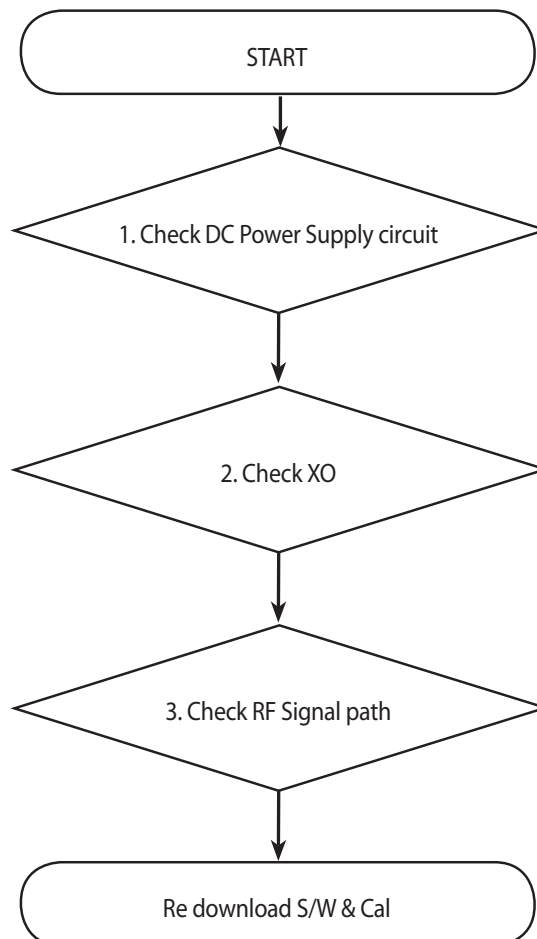


3.3.1 Checking RF Tx Level(CDMA BC0,BC10,BC1 & LTE B26,B25)

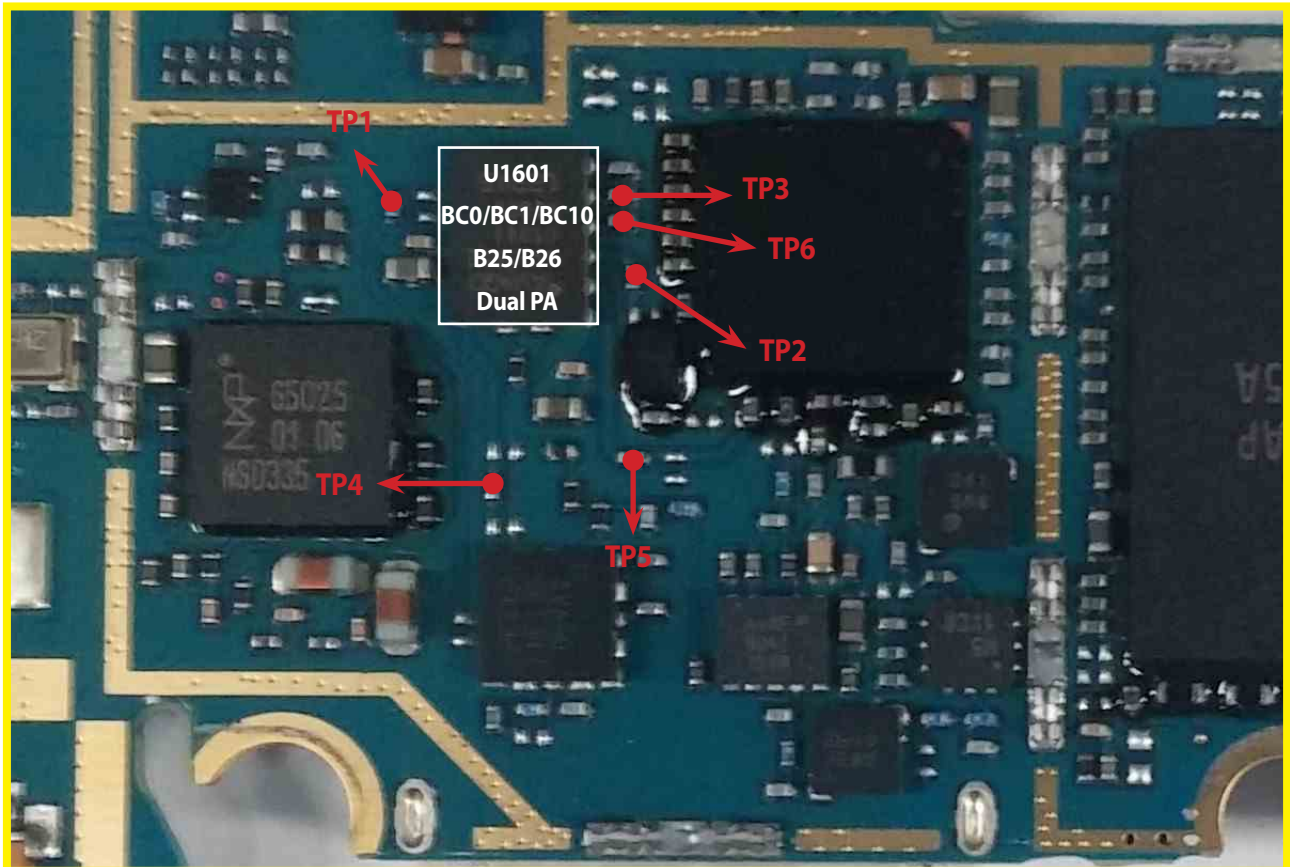

<Min Top>

3. TROUBLE SHOOTING

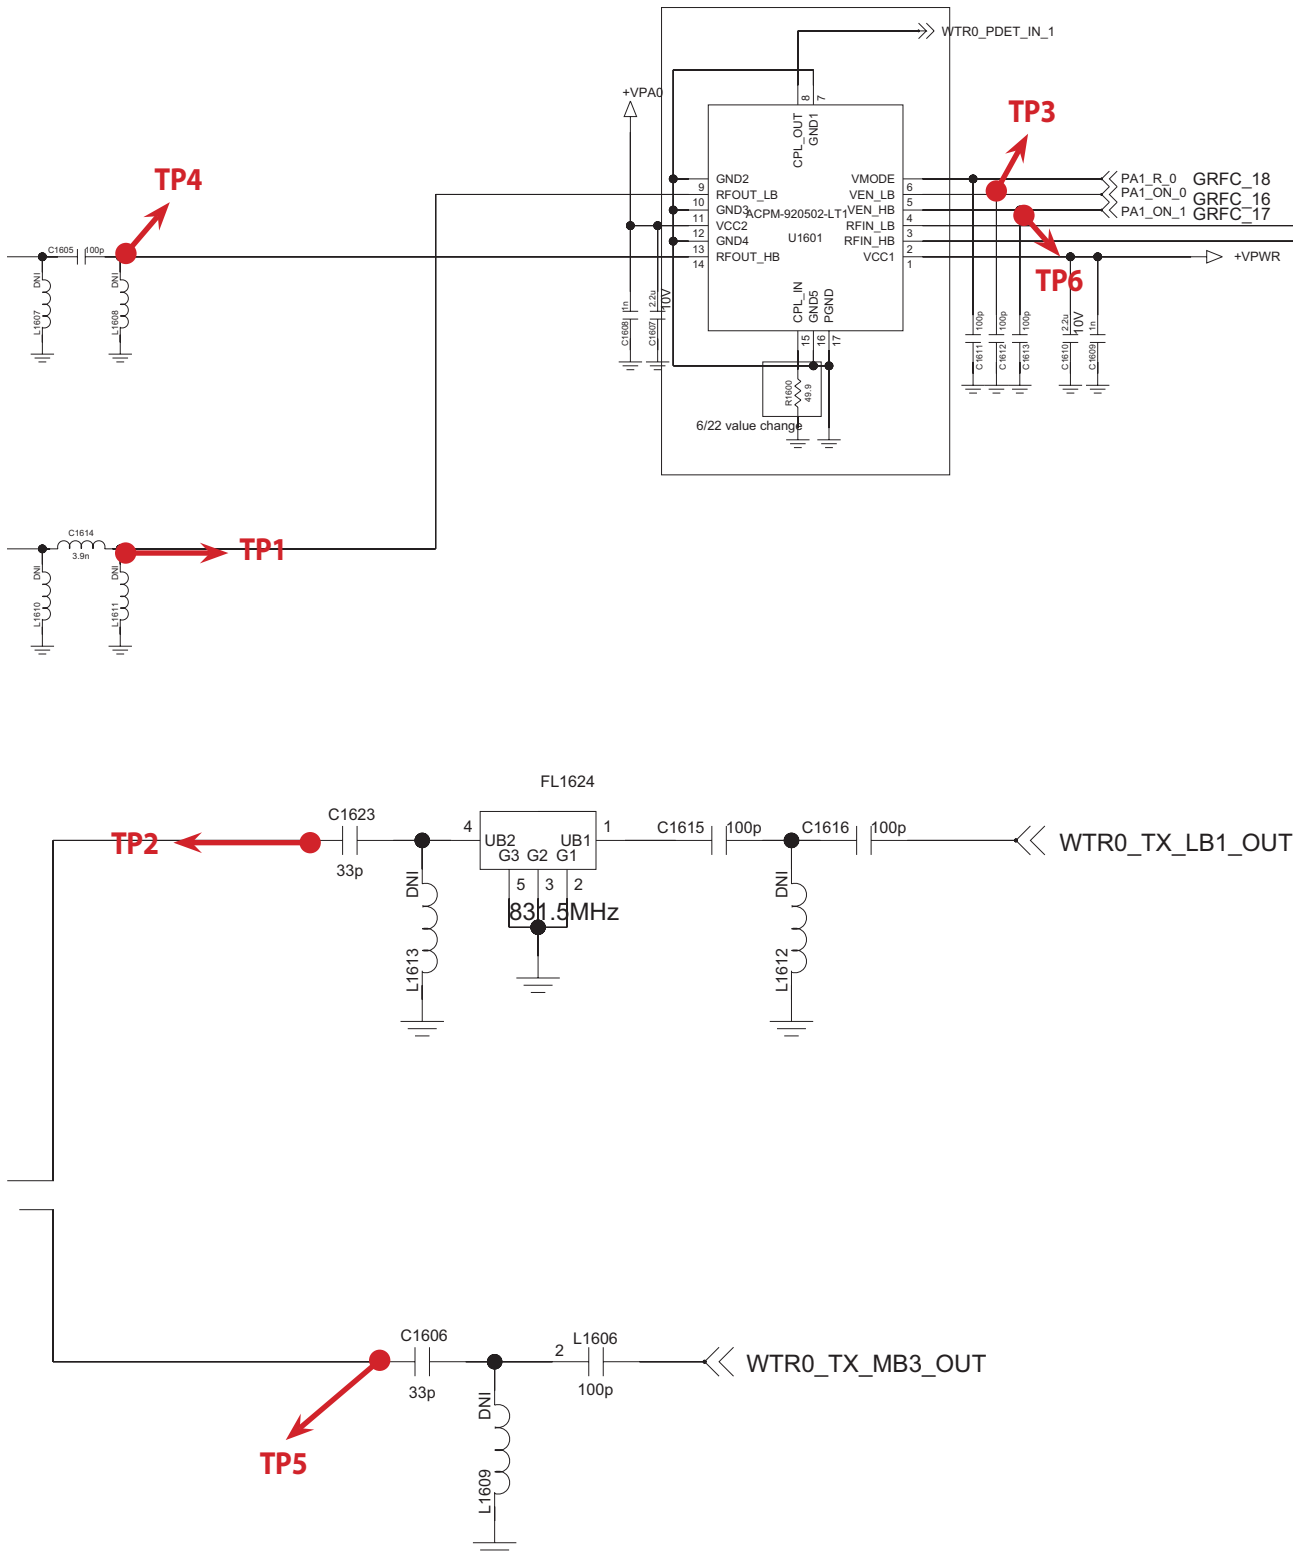

PAM control signal

PA1_ON_0 (C1612) : PAM BC0,BC10,B26 Enable (VEN_LB)


PA1_ON_1 (C1613) : PAM BC1,B25 Enable (VEN_HB)

PA1_R_0 (C1611) : PAM Gain Control (VMODE)


Operating Logic Table

Mode	Vcc1/ Vcc2	Ven_LB	Ven_HB	Vmode
LB HPM(Low Band High Power Mode)	On	H	L	H
LB HPM(Low Band Low Power Mode)	On	H	L	L
HB HPM(High Band High Power Mode)	On	L	H	L
HB HPM(High Band Low Power Mode)	On	L	H	H
PDM(Power down Mode)	On	L	L	X


3.3.2 Checking RF Tx Level(CDMA BC0,BC10 & LTE B26)

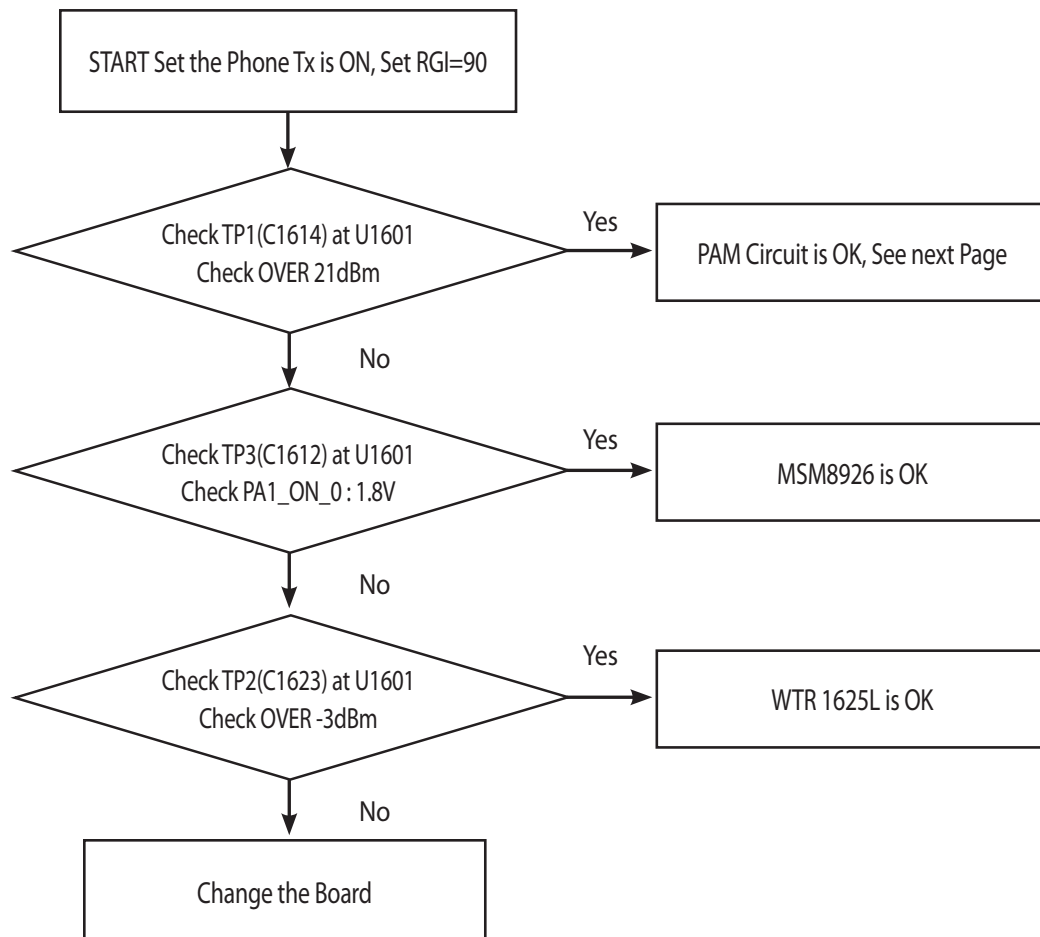

3.3.3 Checking RF Tx Level(CDMA BC1 & LTE B25)

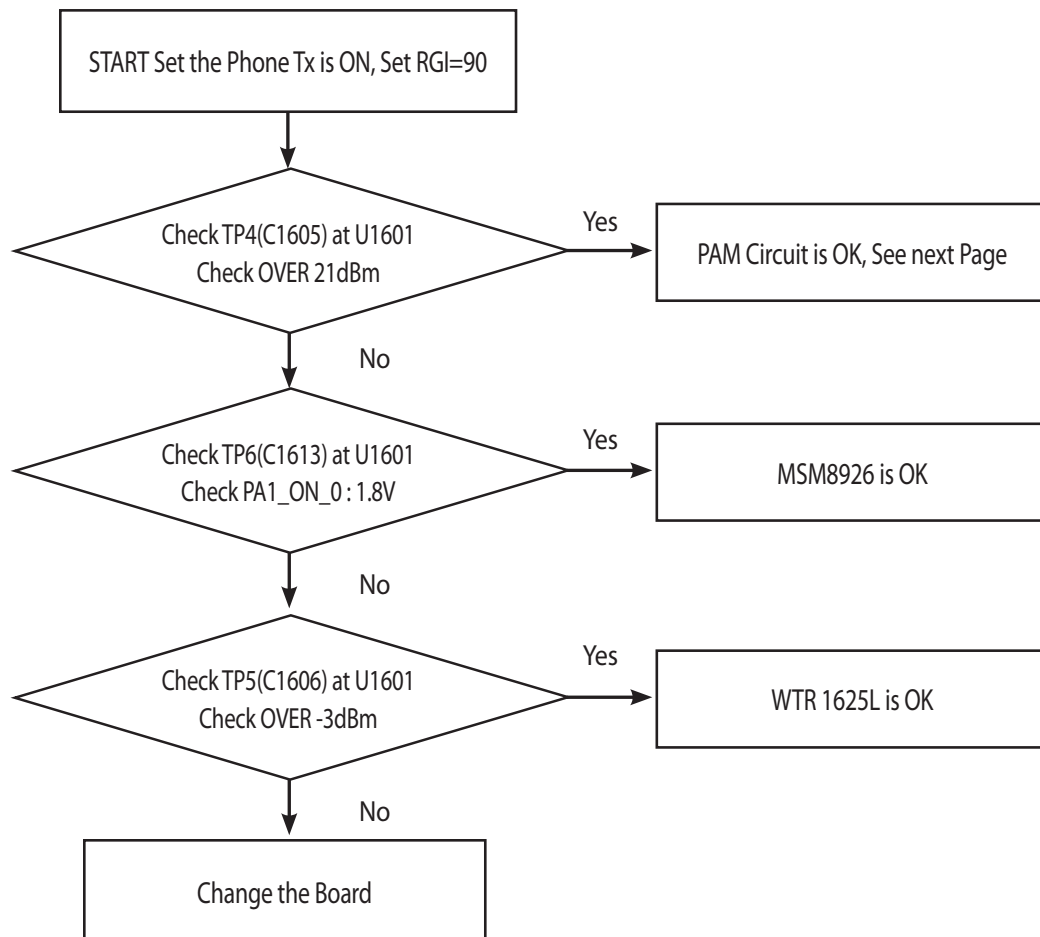

3.4 Checking RF Tx Level(LTE B41)

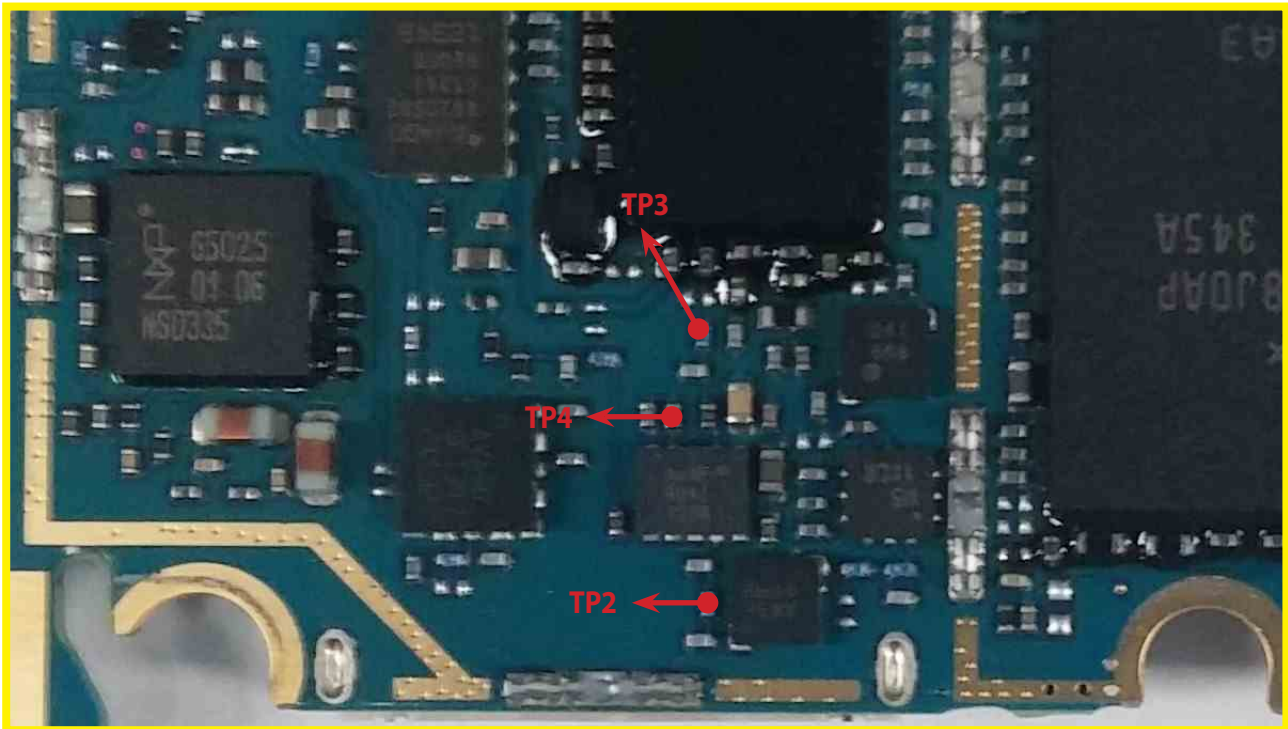


<Min Top>



<Min Bot>

3. TROUBLE SHOOTING

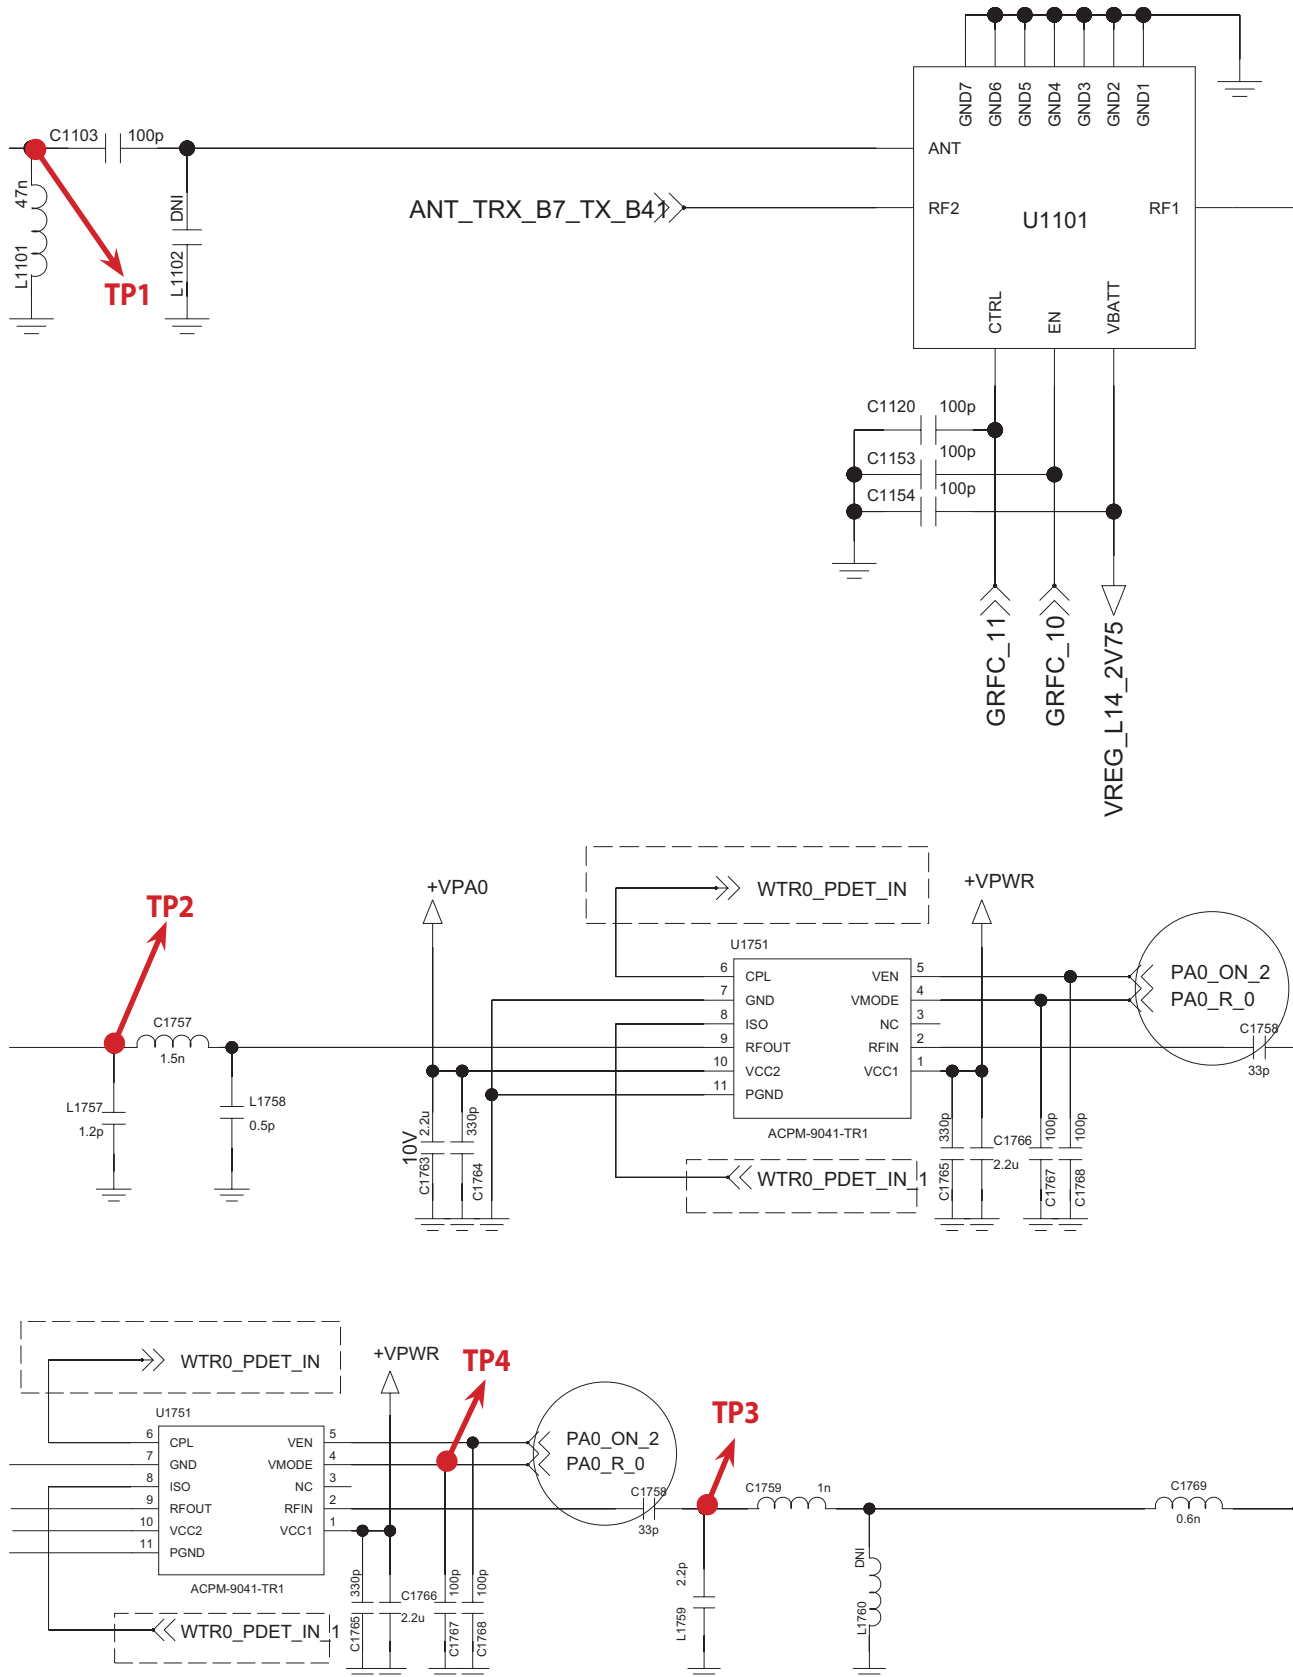


PAM control signal


PA0_ON_2 (C1768) : PAM Enable

PA0_R_0 (C1767) : PAM Gain Control


PA0_ON_2 (C1768) must be HIGH (over 2.6V)

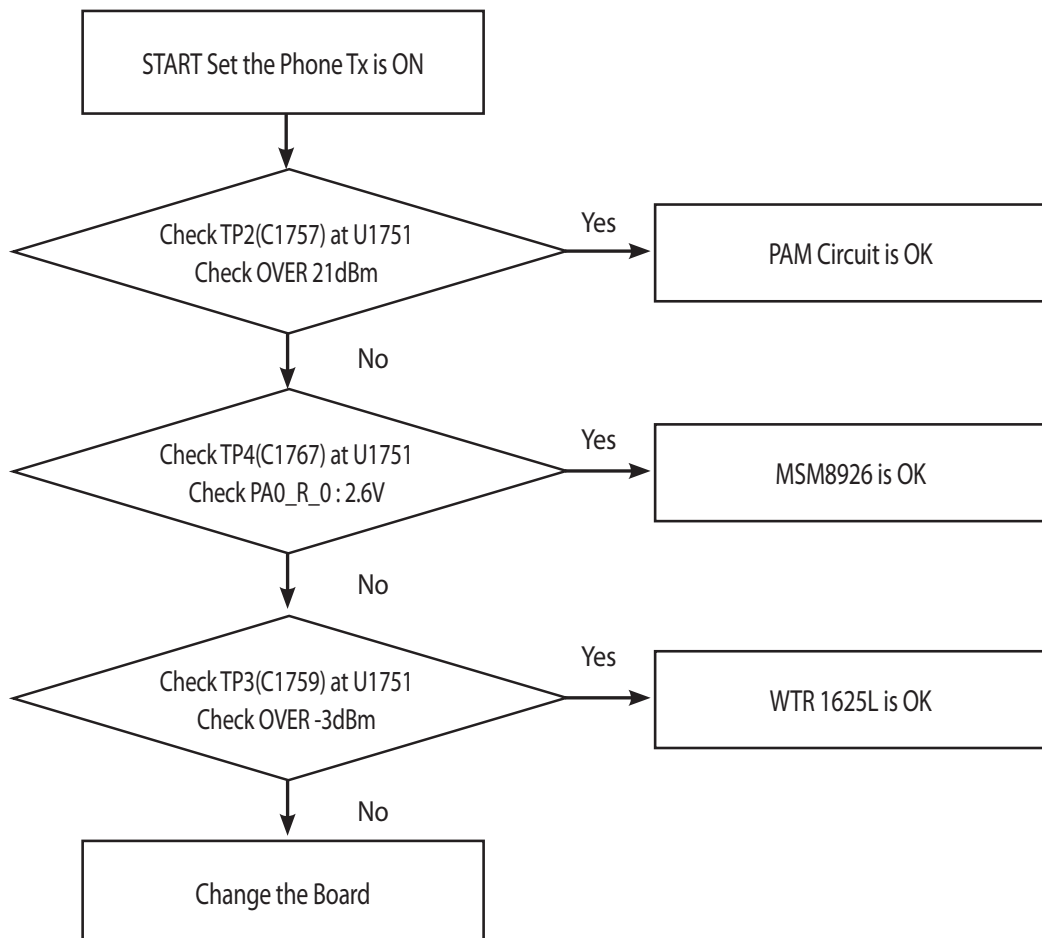


3.5 Checking RF PRx Level(CDMA BC0,BC10 & LTE B26)

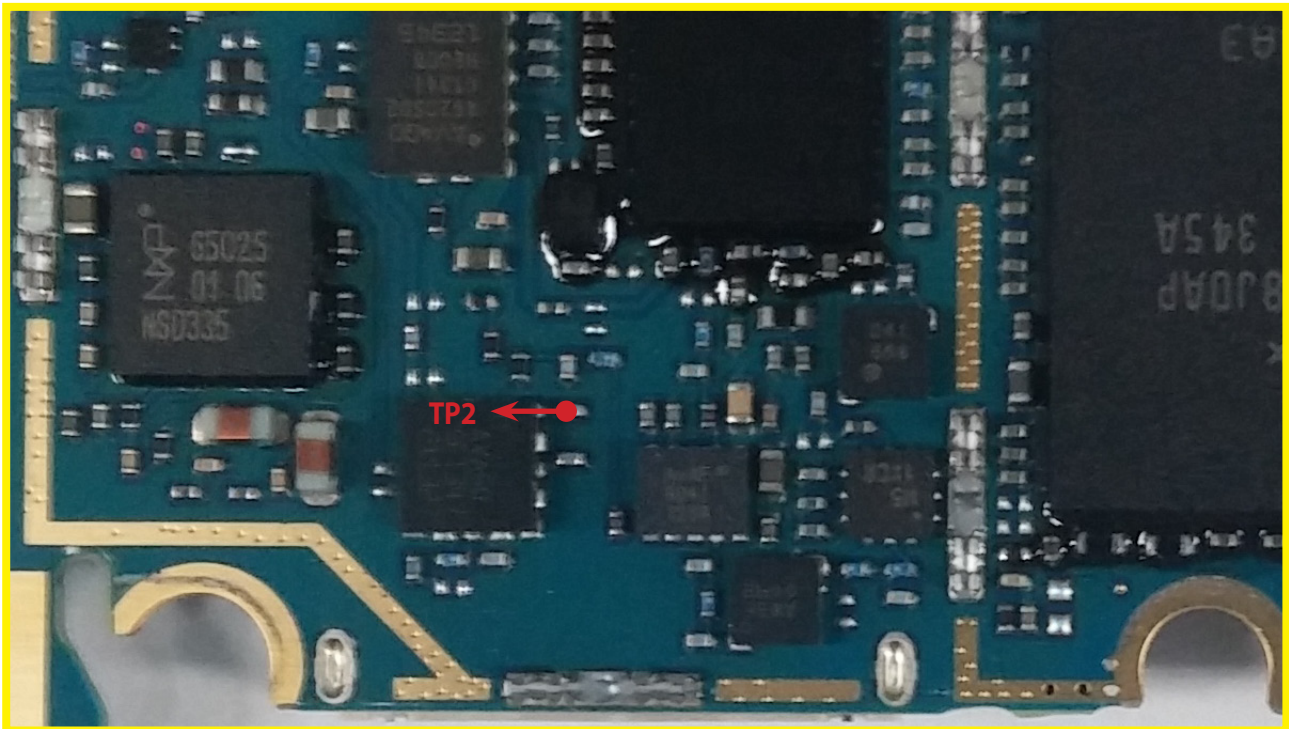


<Min Top>

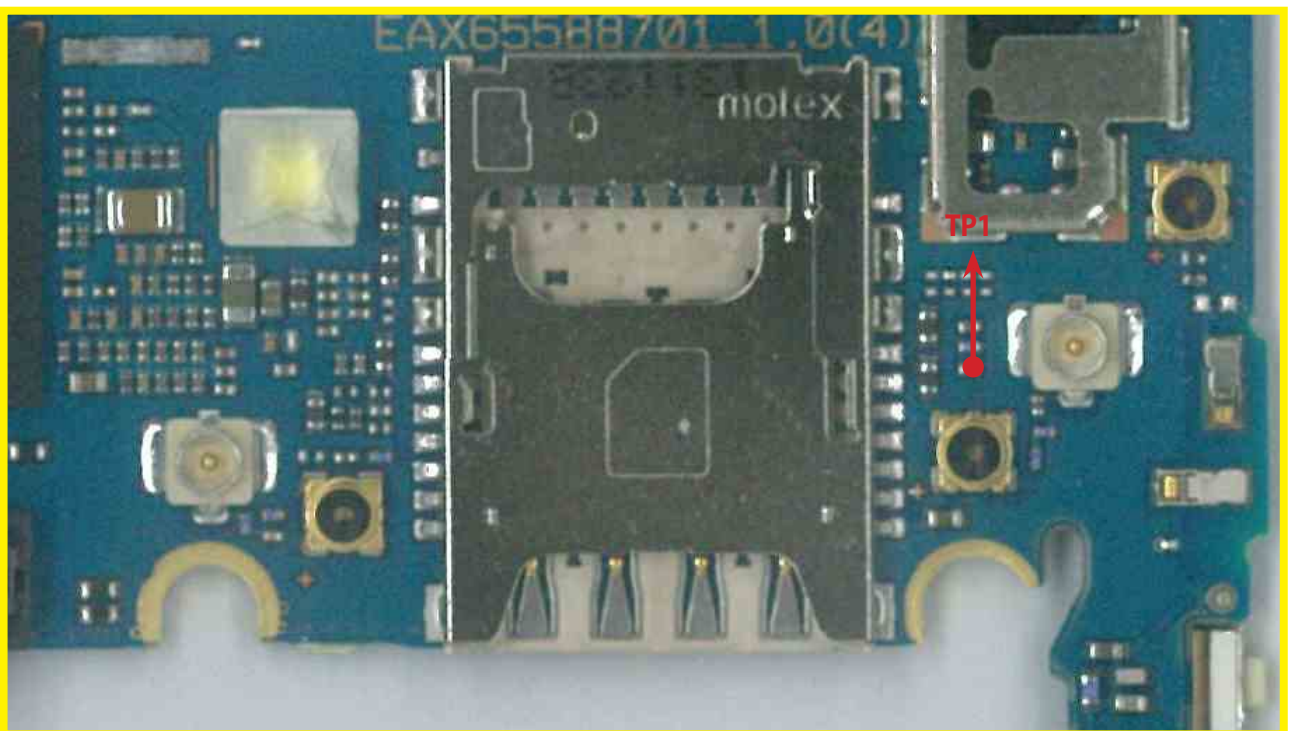


<Min Bot>

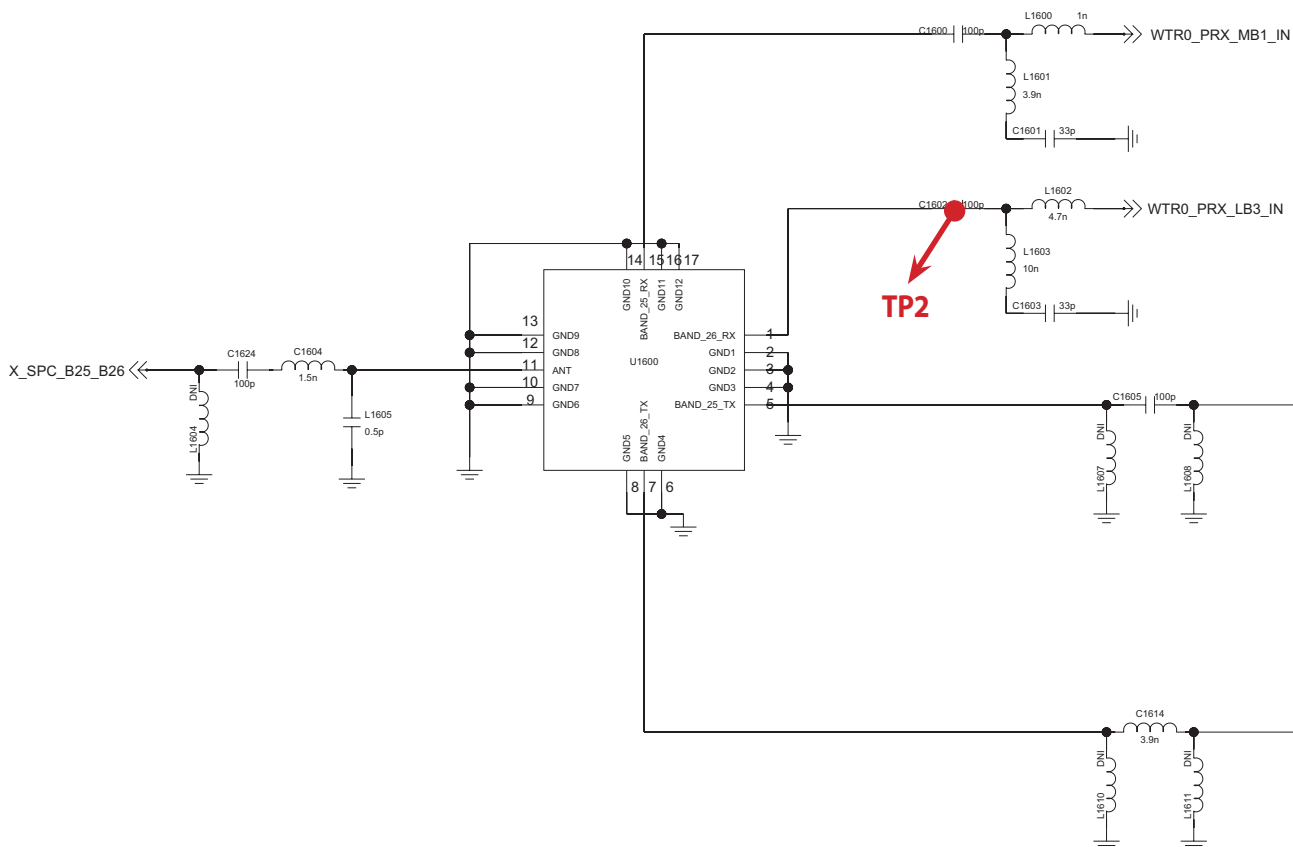


3. TROUBLE SHOOTING

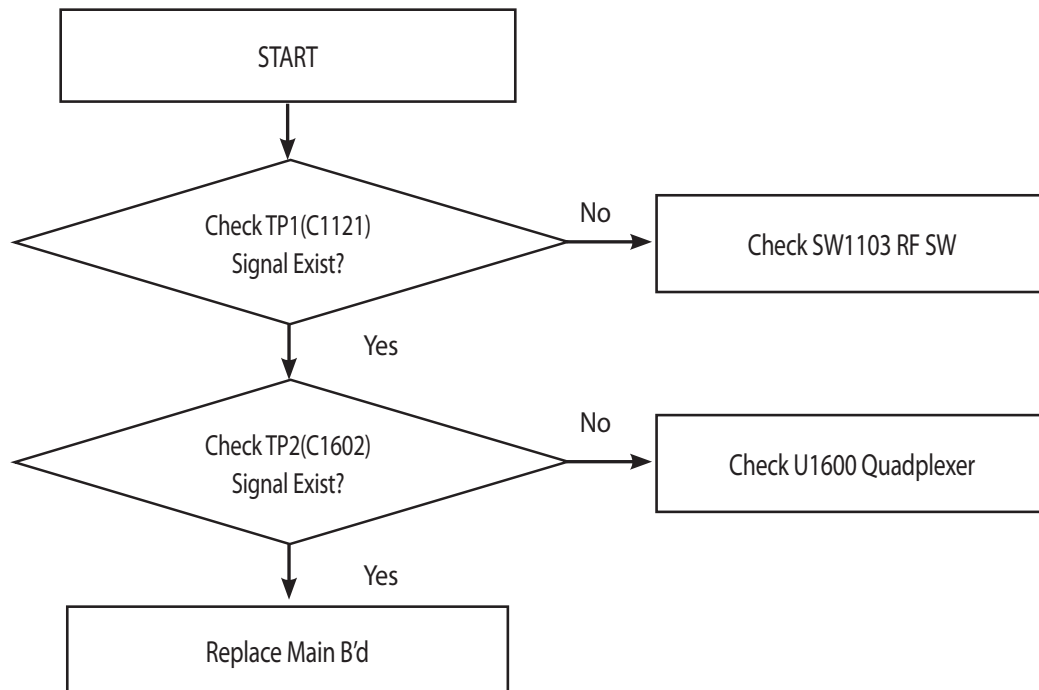


3.6 Checking RF DRx Level(CDMA BC0,BC10& LTE B26)

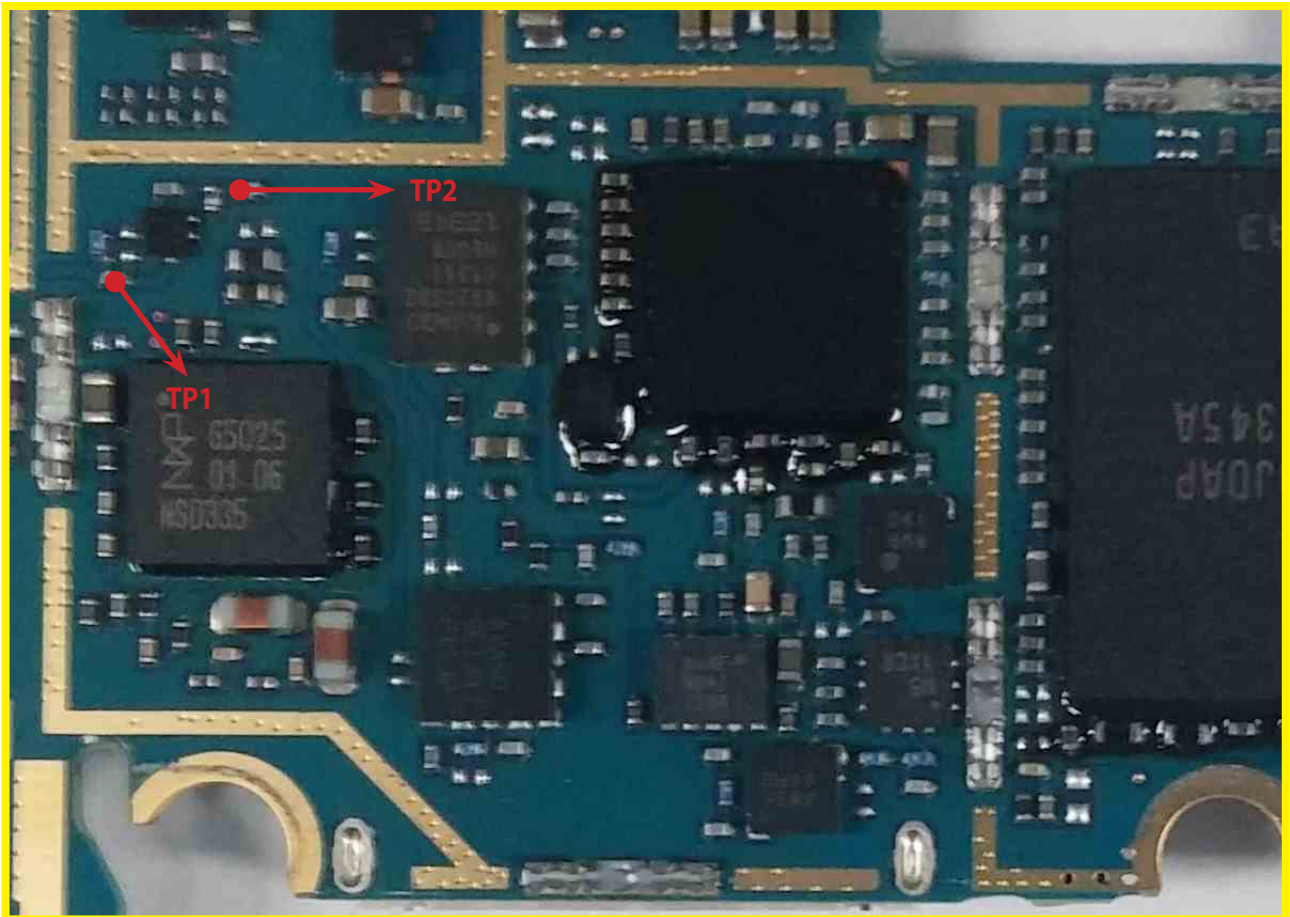


<Min Top>

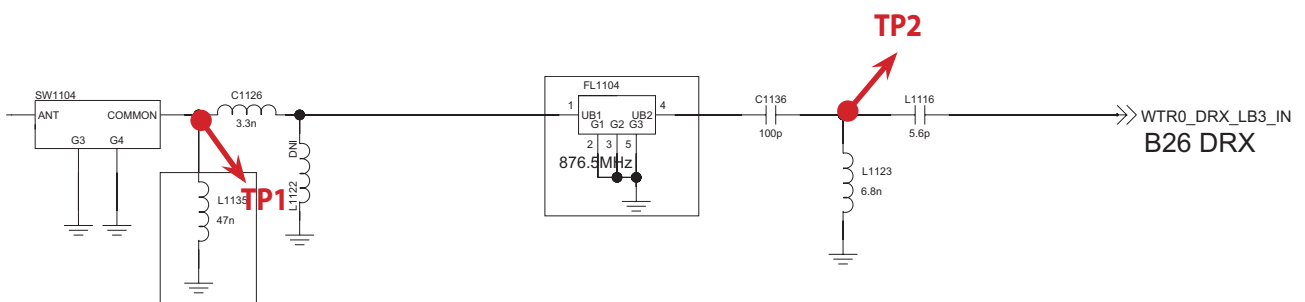


3. TROUBLE SHOOTING

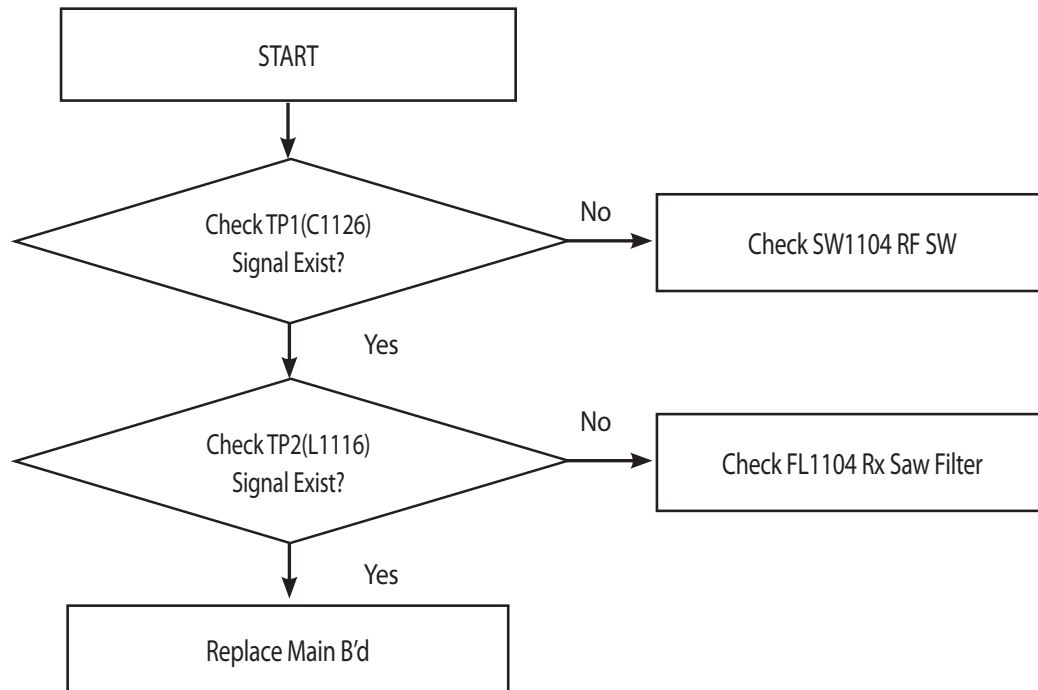

3.7 Checking RF PRx Level(CDMA BC1 & LTE B25)

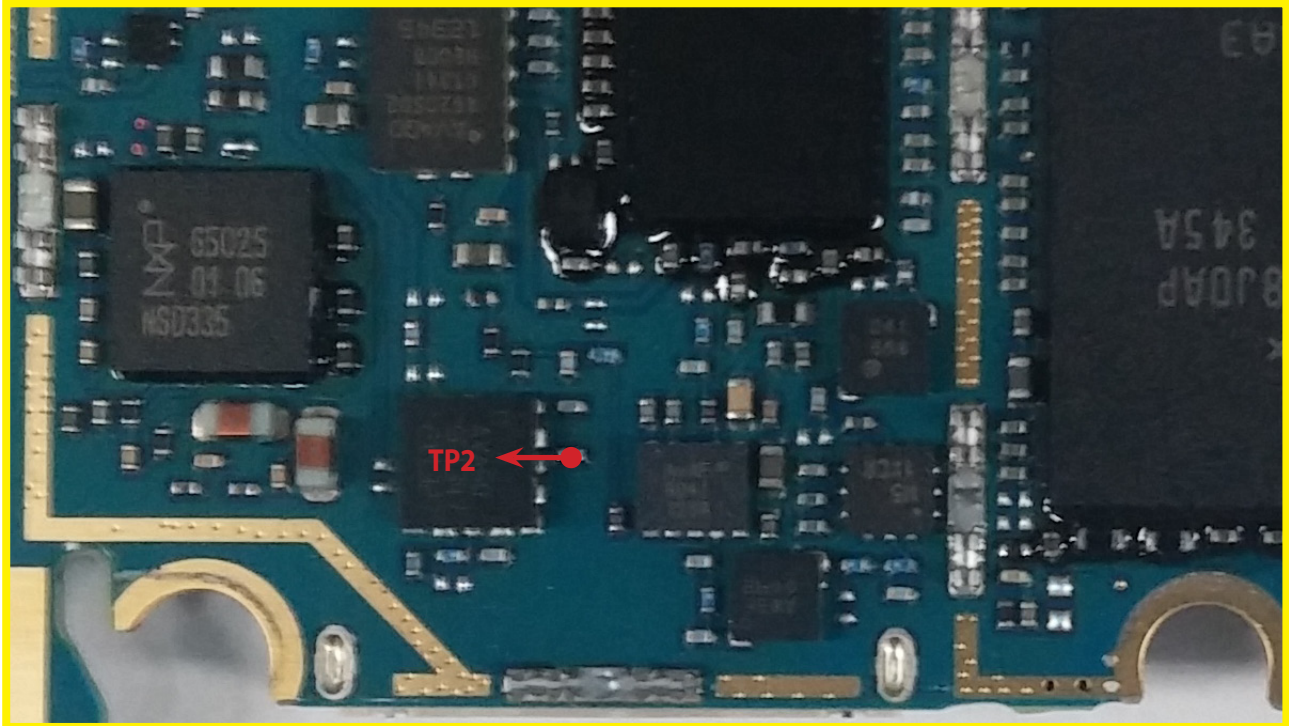


<Min Top>

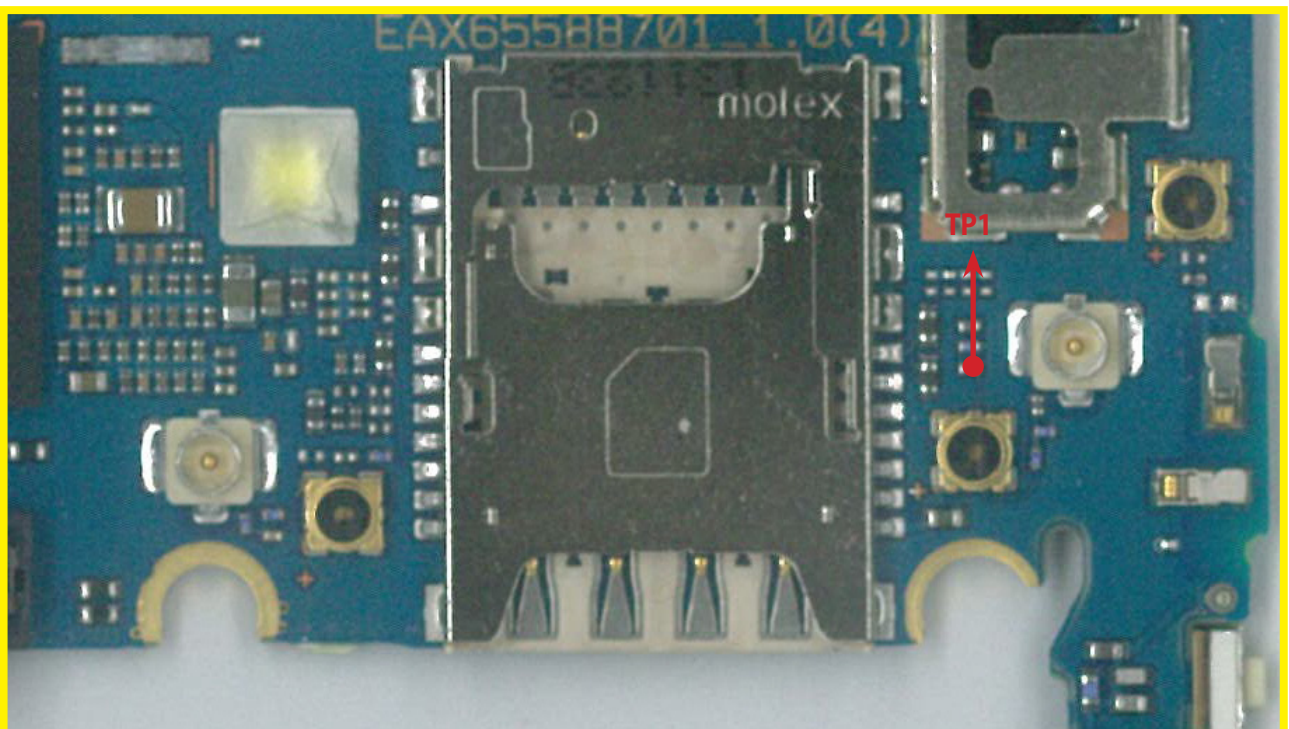


<Min Bot>


3. TROUBLE SHOOTING

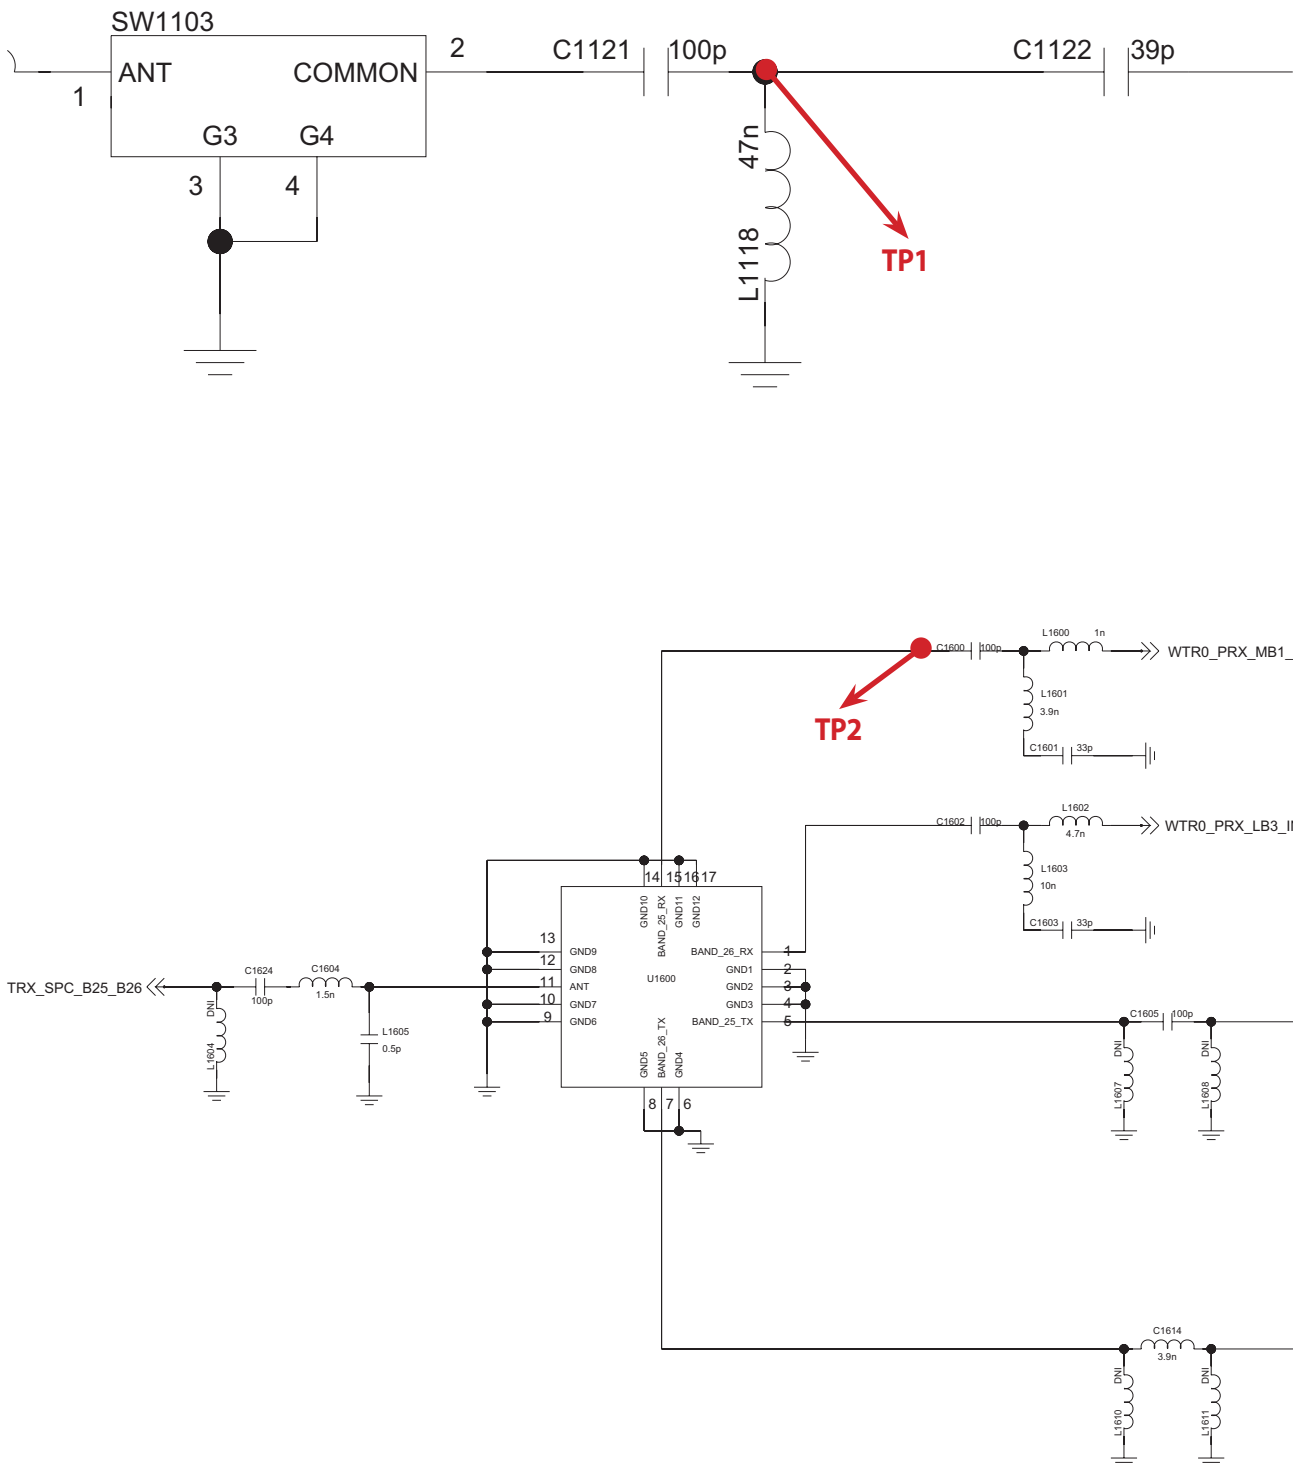


3. TROUBLE SHOOTING

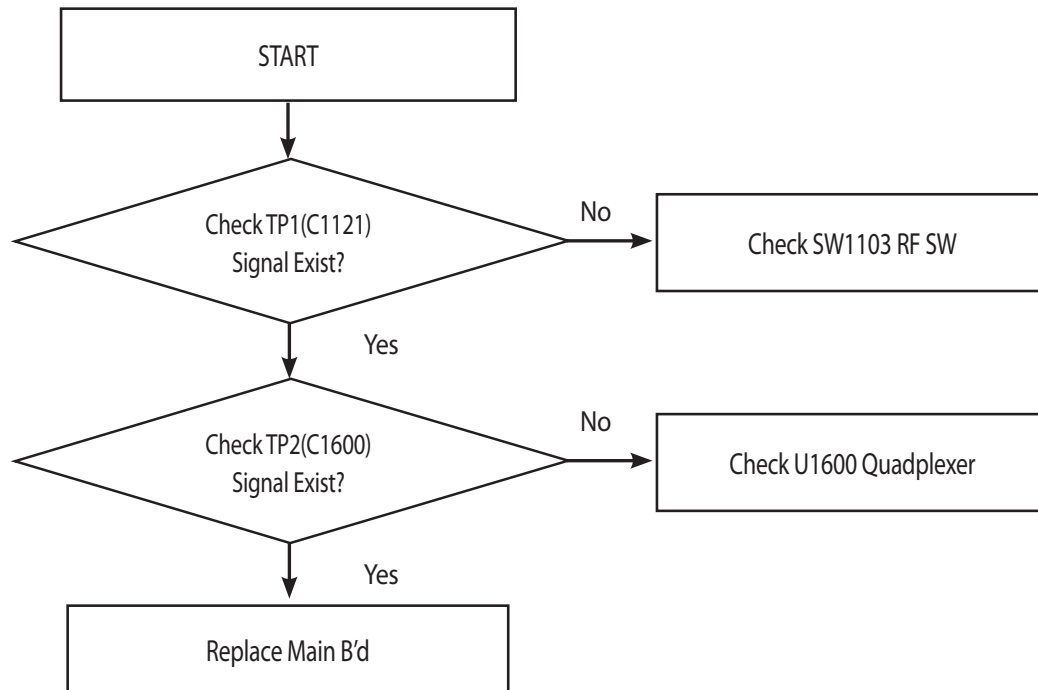

3.8 Checking RF DRx Level(CDMA BC1 & LTE B25)


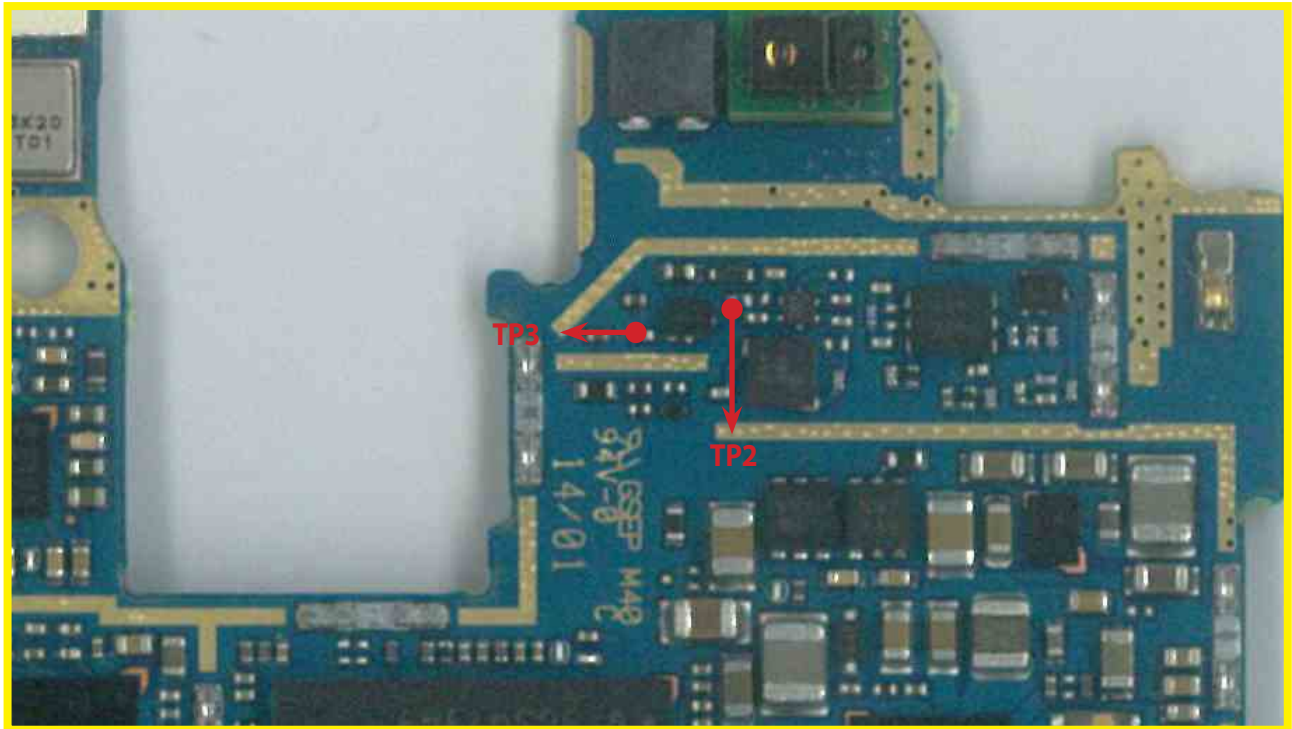


<Min Top>

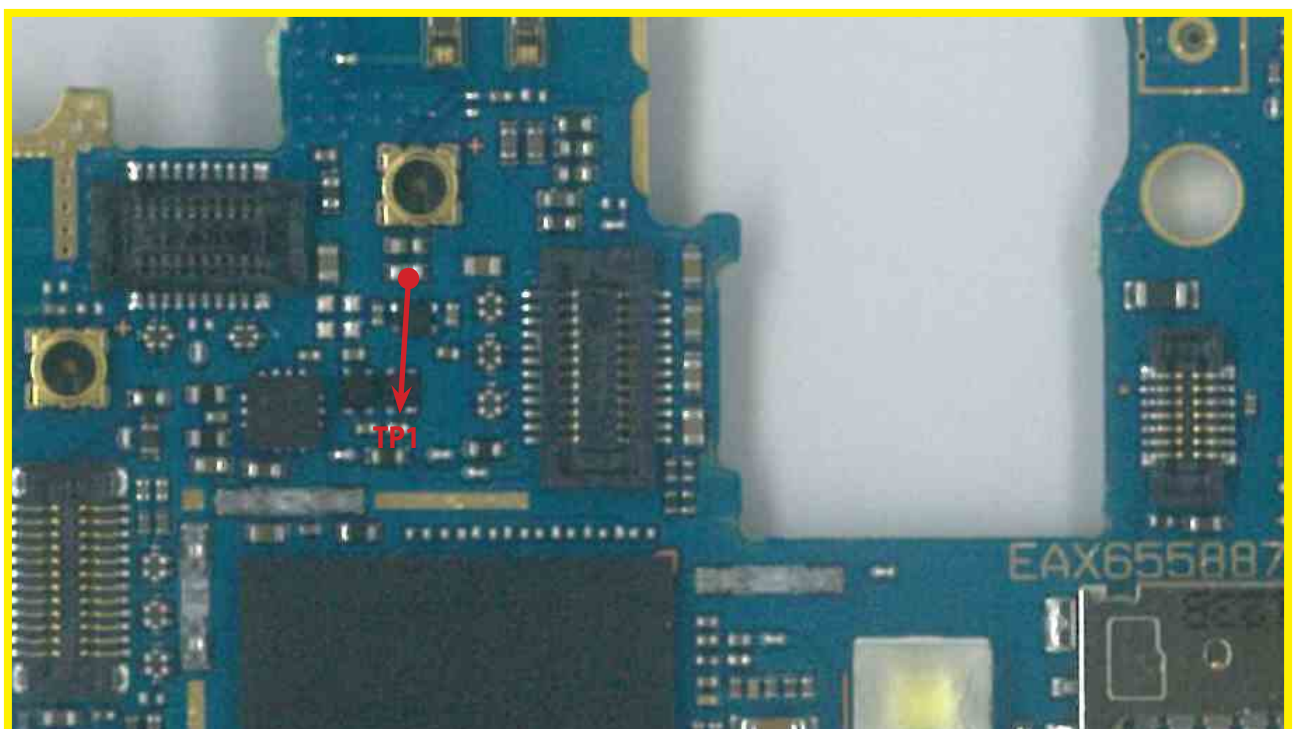


<Min Bot>


3. TROUBLE SHOOTING

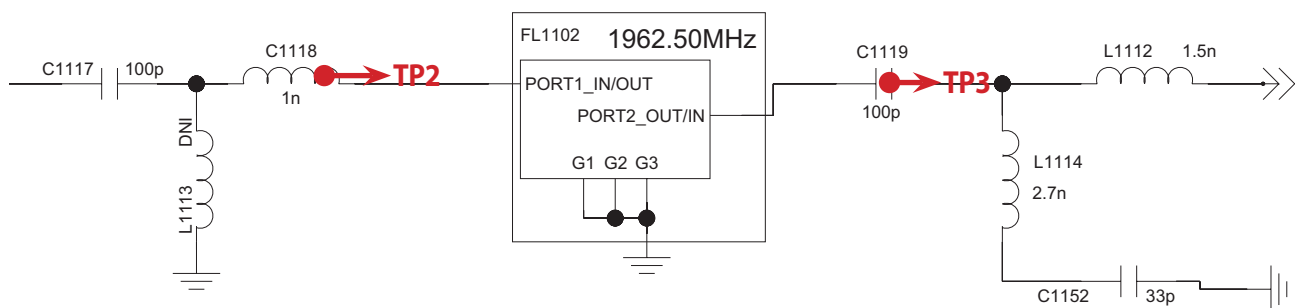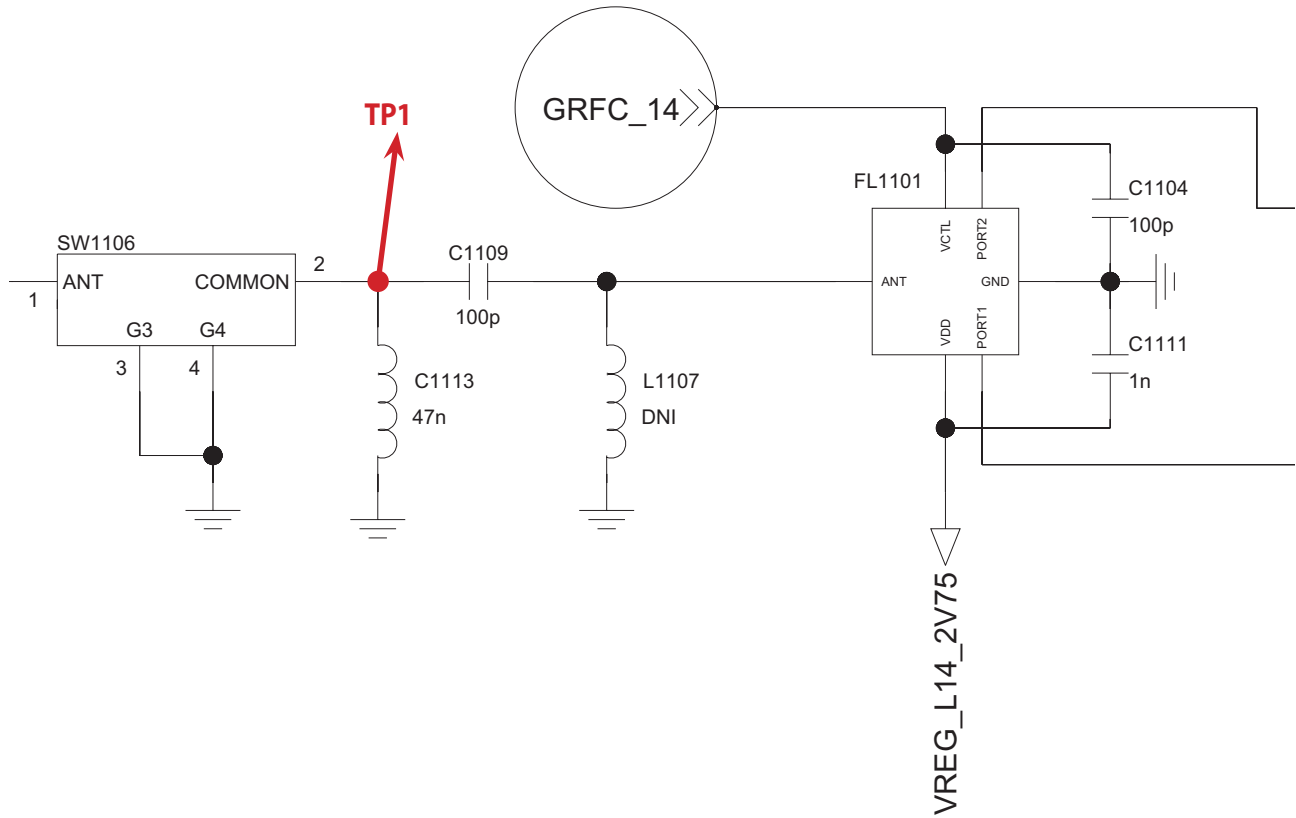

3. TROUBLE SHOOTING

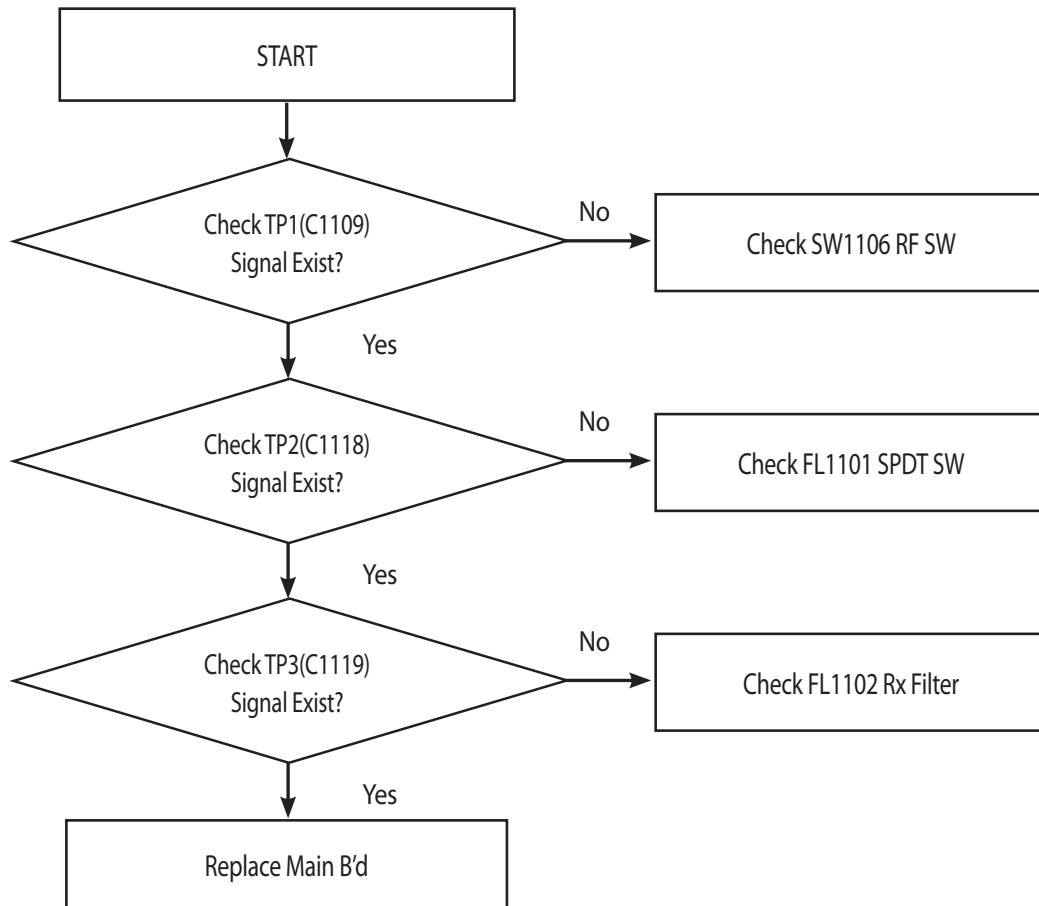

3.9 Checking RF PRx Level(LTE B41)

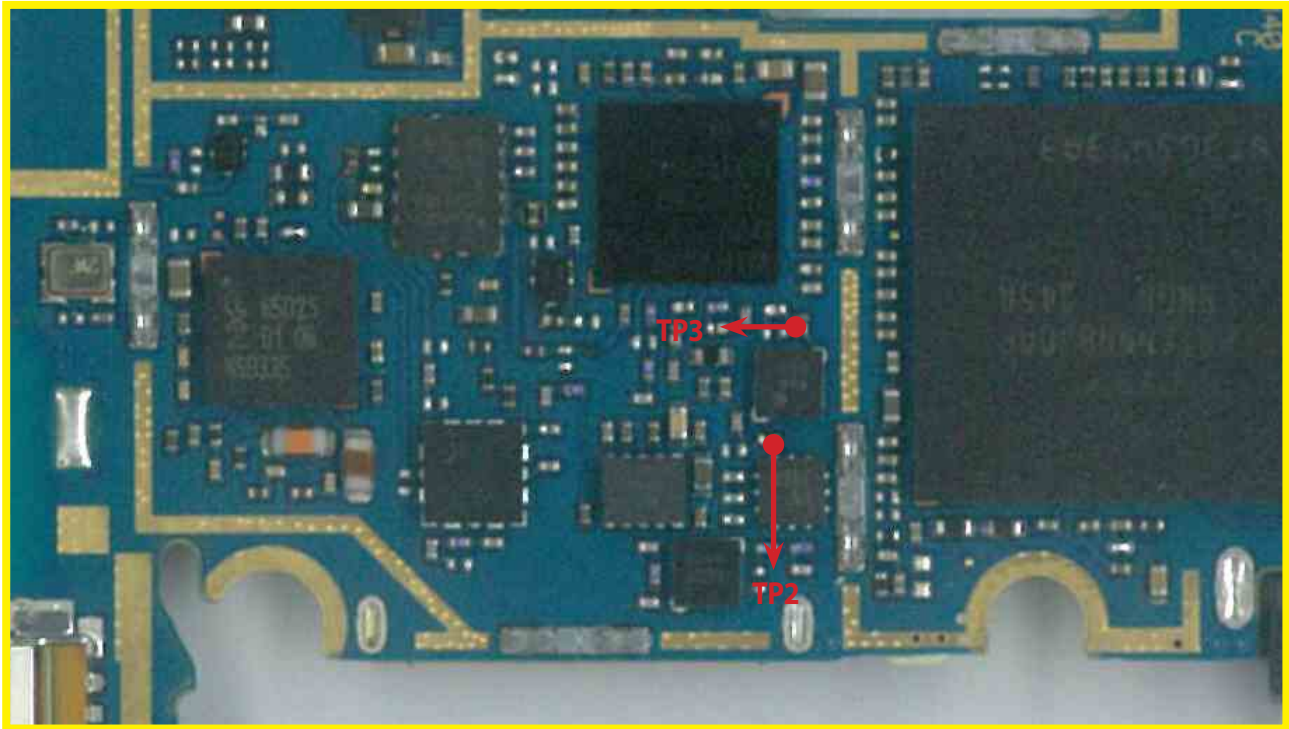


<Min Top>




<Min Bot>


3. TROUBLE SHOOTING

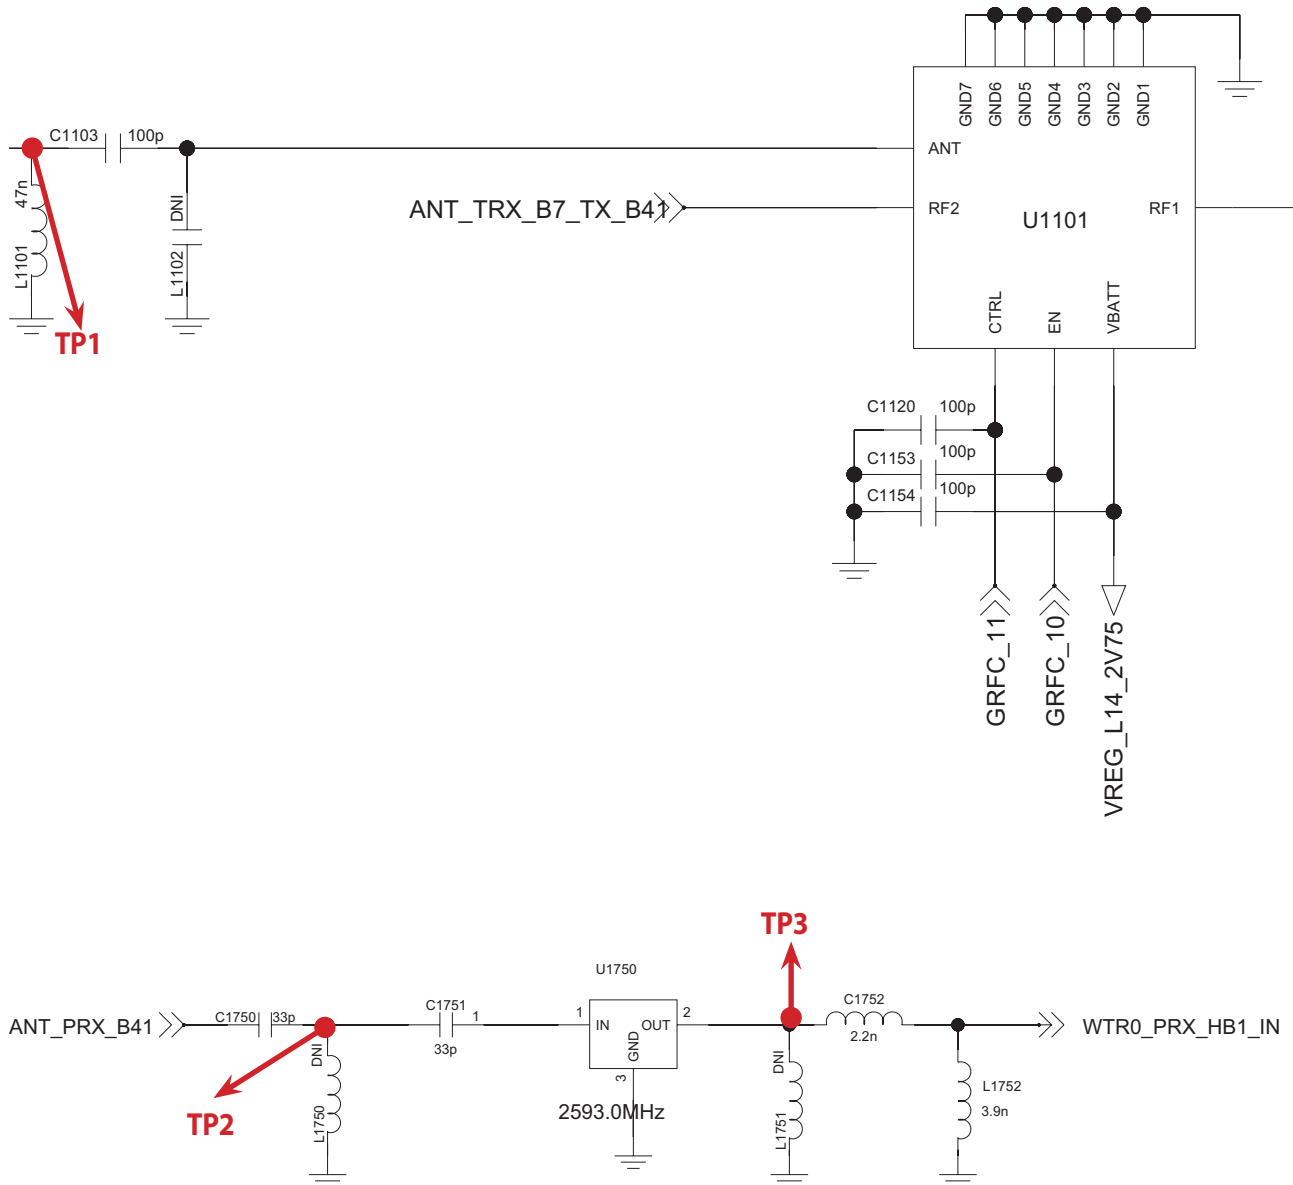


3. TROUBLE SHOOTING

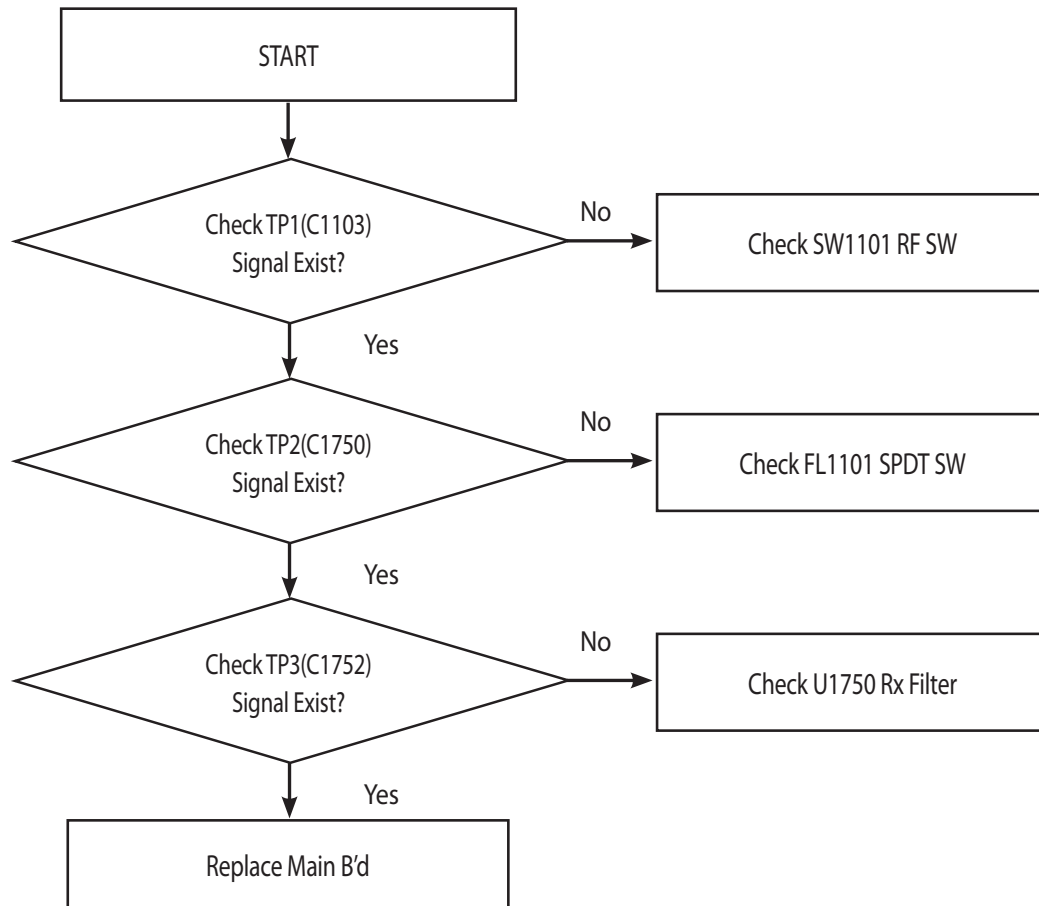

3.10 Checking RF DRx Level(LTE B41)

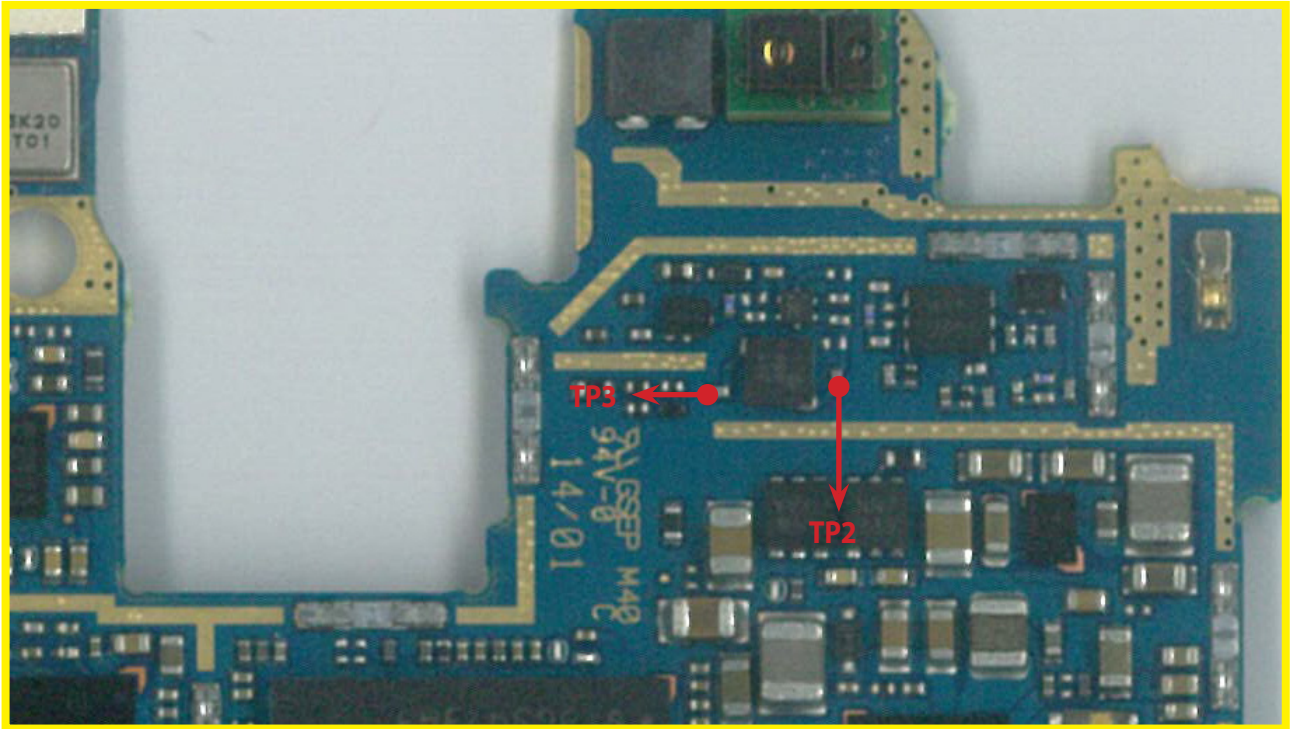


<Min Top>

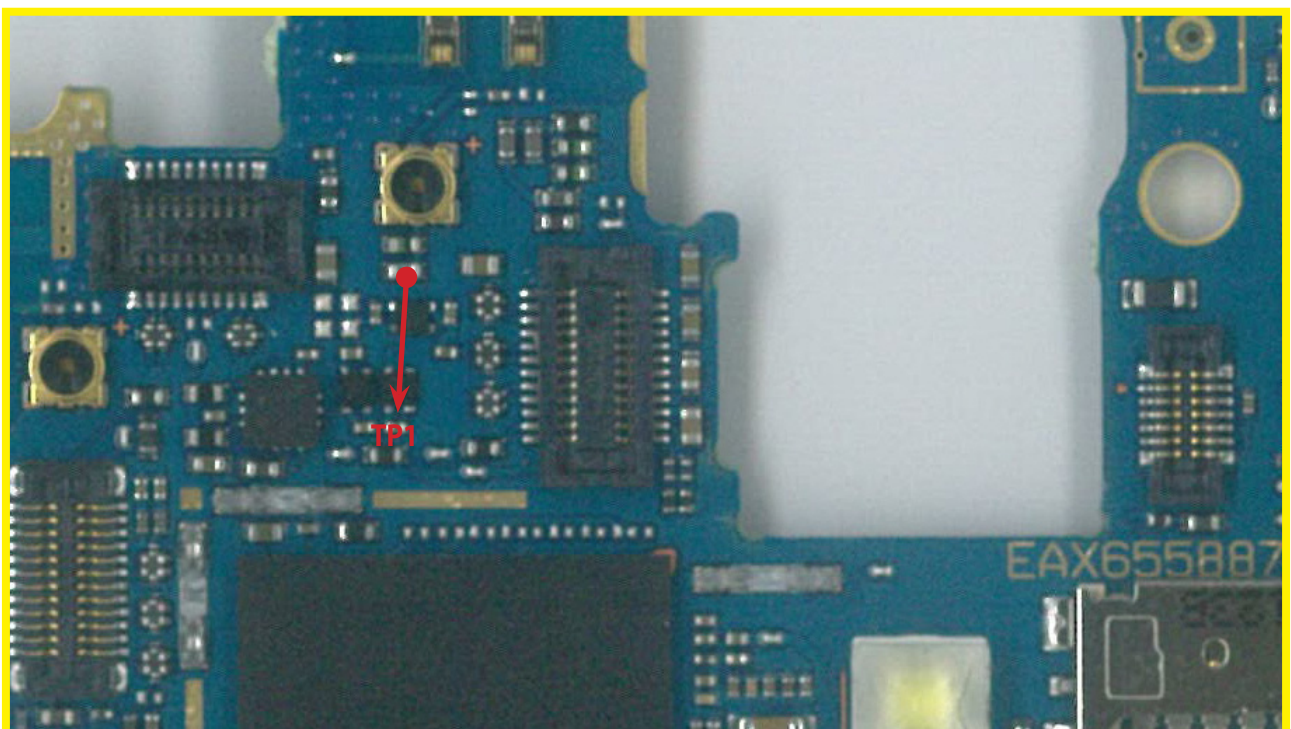


<Min Bot>

3. TROUBLE SHOOTING

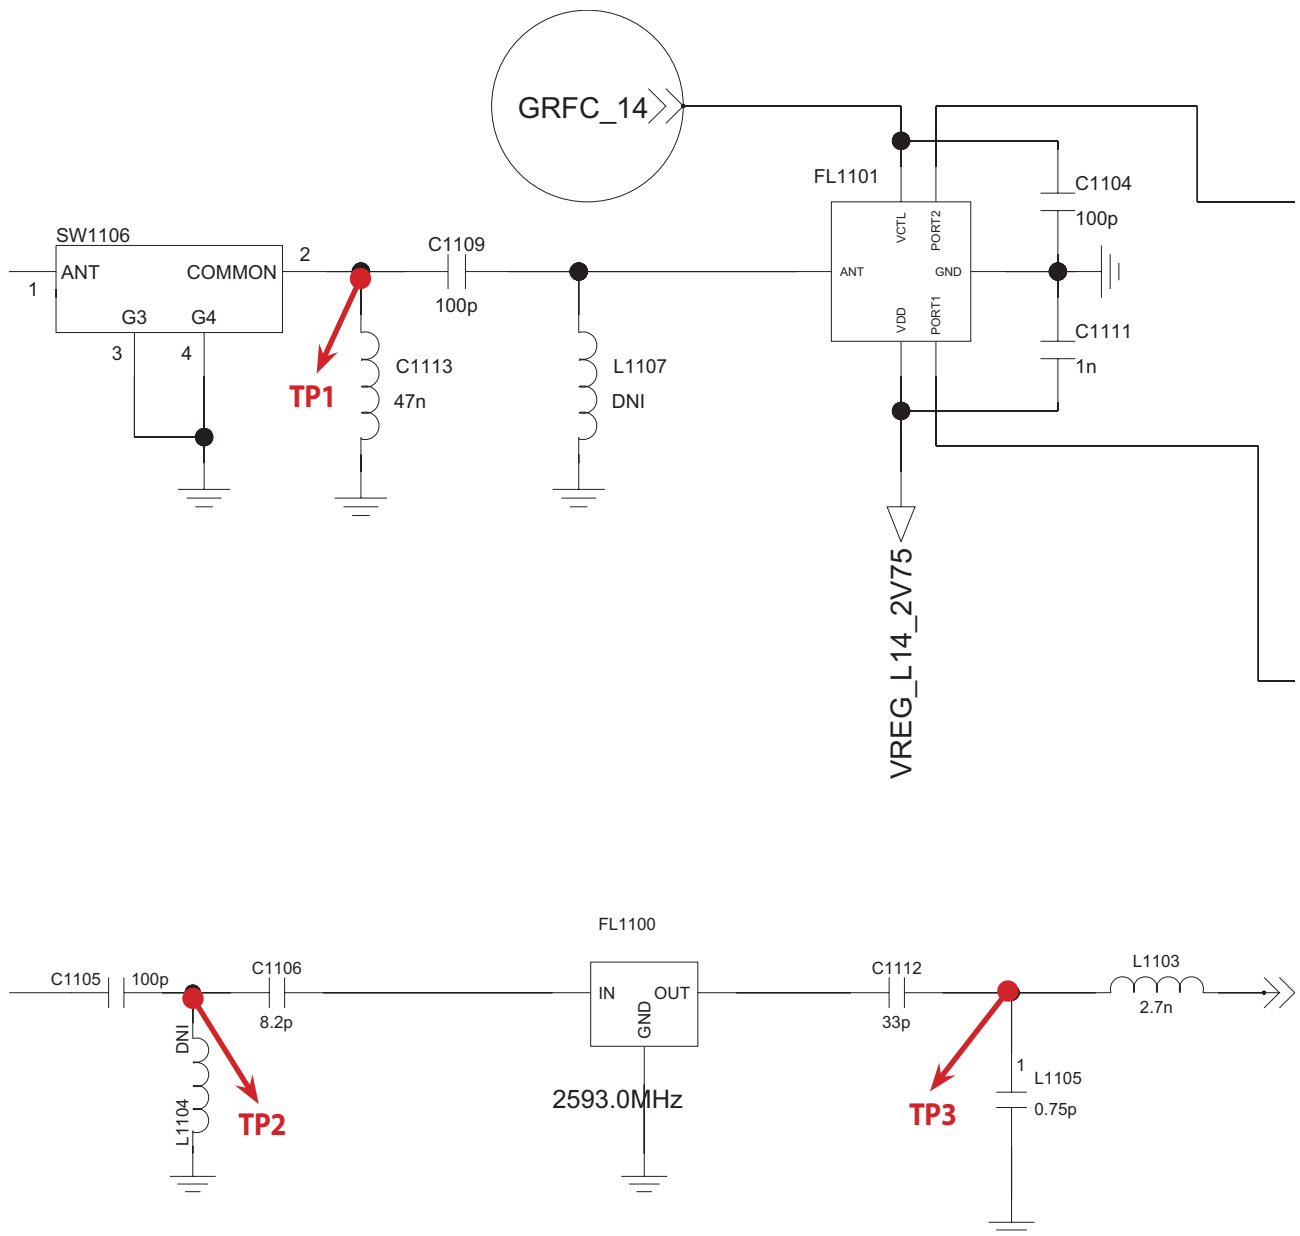


3. TROUBLE SHOOTING

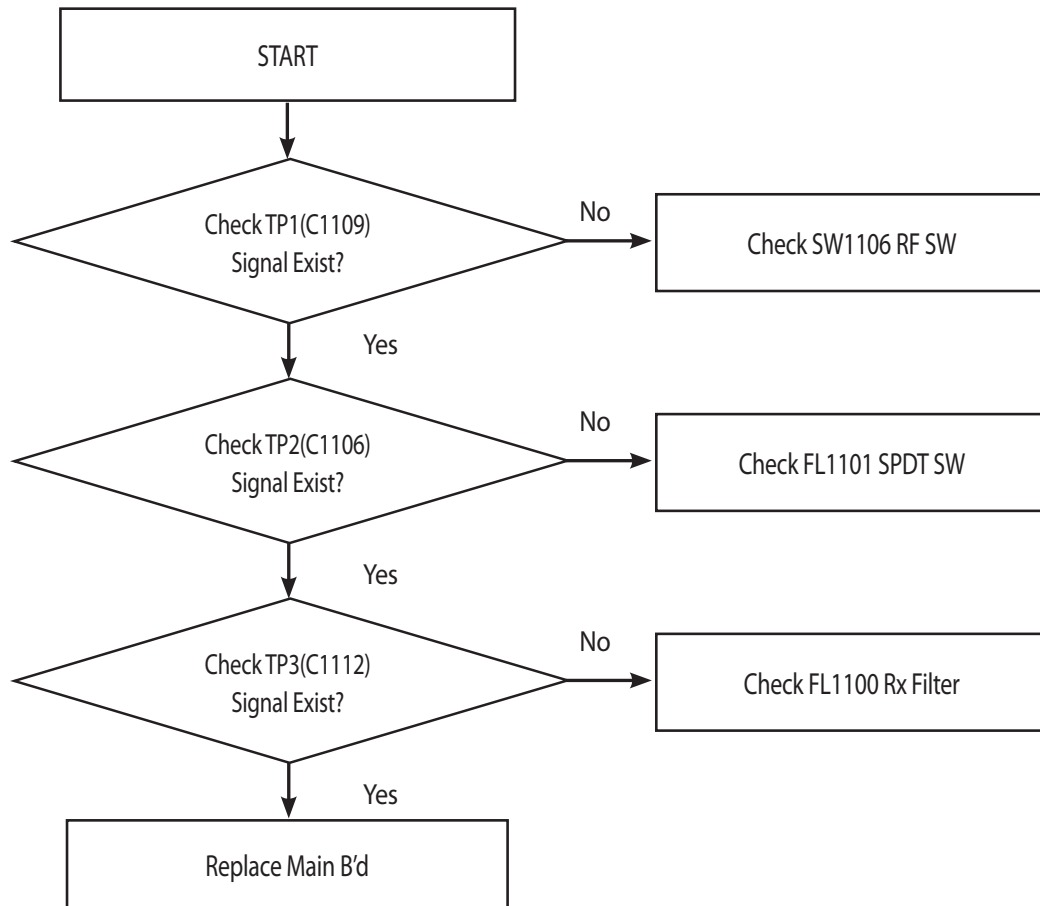

3.11 GPS/WIFI/BT Module

3.11.1 GPS Module

The WTR1605L is integrated GPS solution.

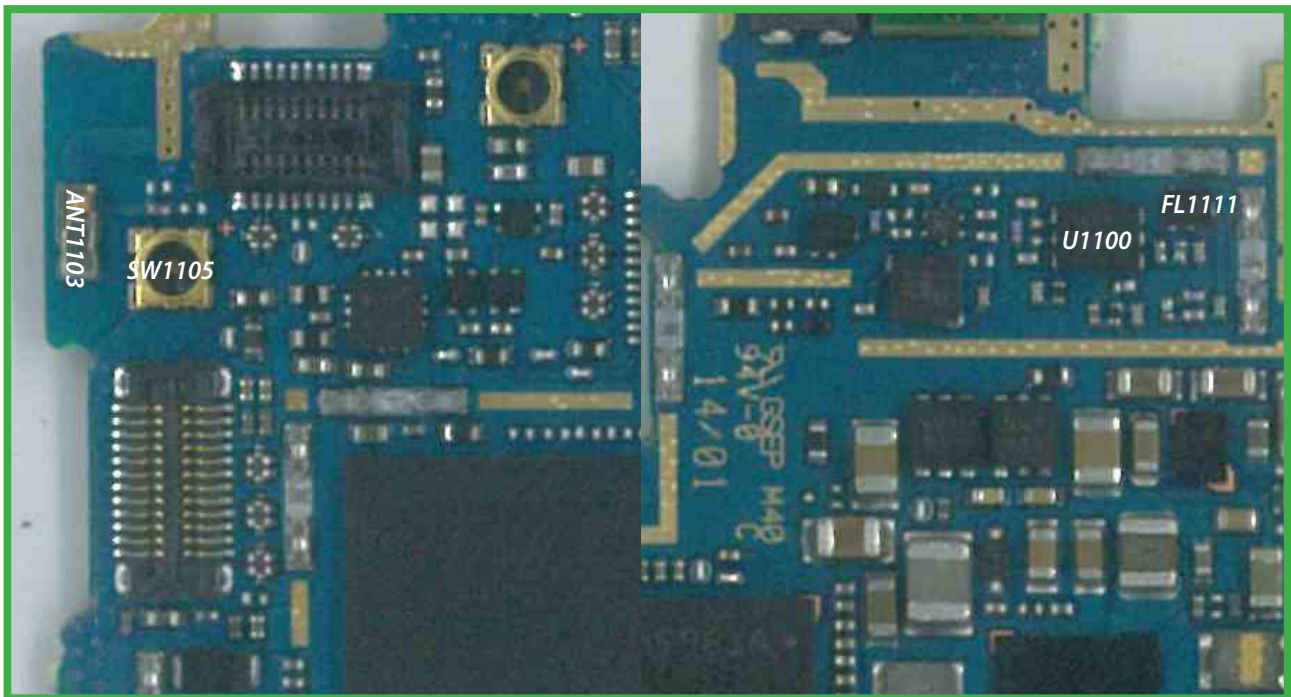


< Main Bot >

< Main Top >

Reference	Description
U1100	GPS LNA
SW1105	RF SWITCH
FL1111	SAW FILTER
ANT1103	ANTENNA CONTACT

3.11.2 WIFI,BT Module


WCN3620(Module) is the combination module that integrates WLAN(WIFI), BT and FM.

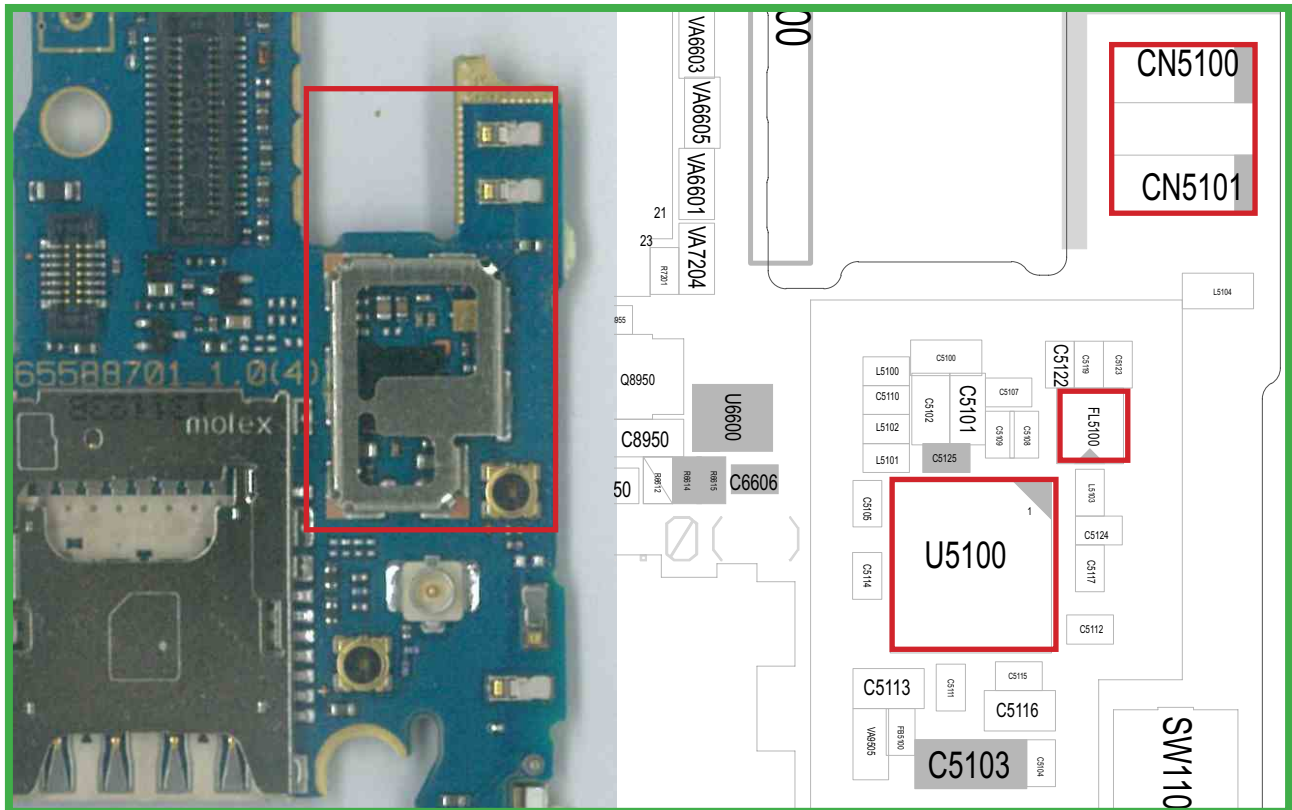

Reference	Description
CN5100, CN5101	Antenna Contact(Feeding)
FL5100	2.4GHz BPF
U5100	WiFi/BT chip

3.12 GPS/WIFI/BT SIGNAL PATH


3.12.1 GPS Signal Path

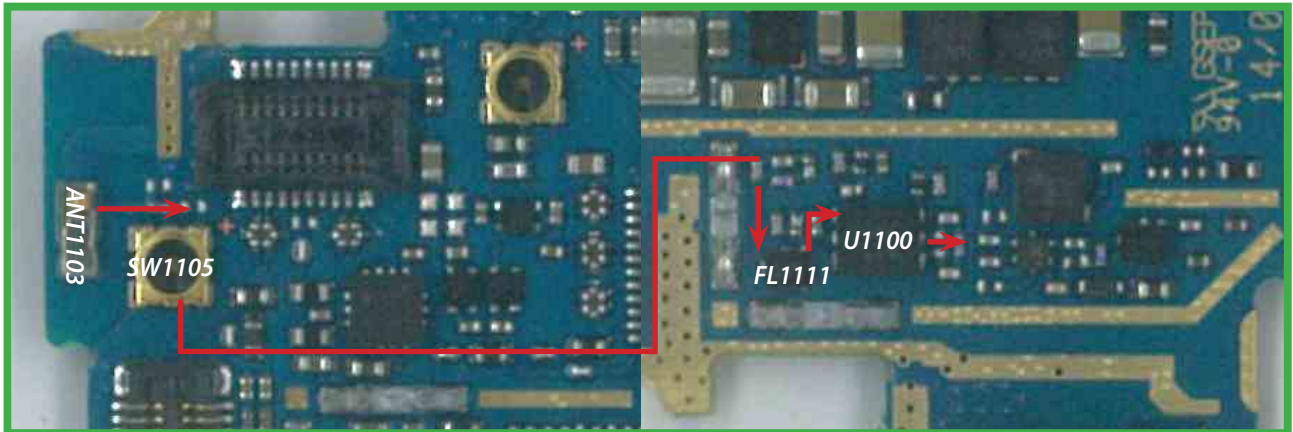


< Main Bot >

< Main Top >


3.12.2 WIFI,BT Signal Path

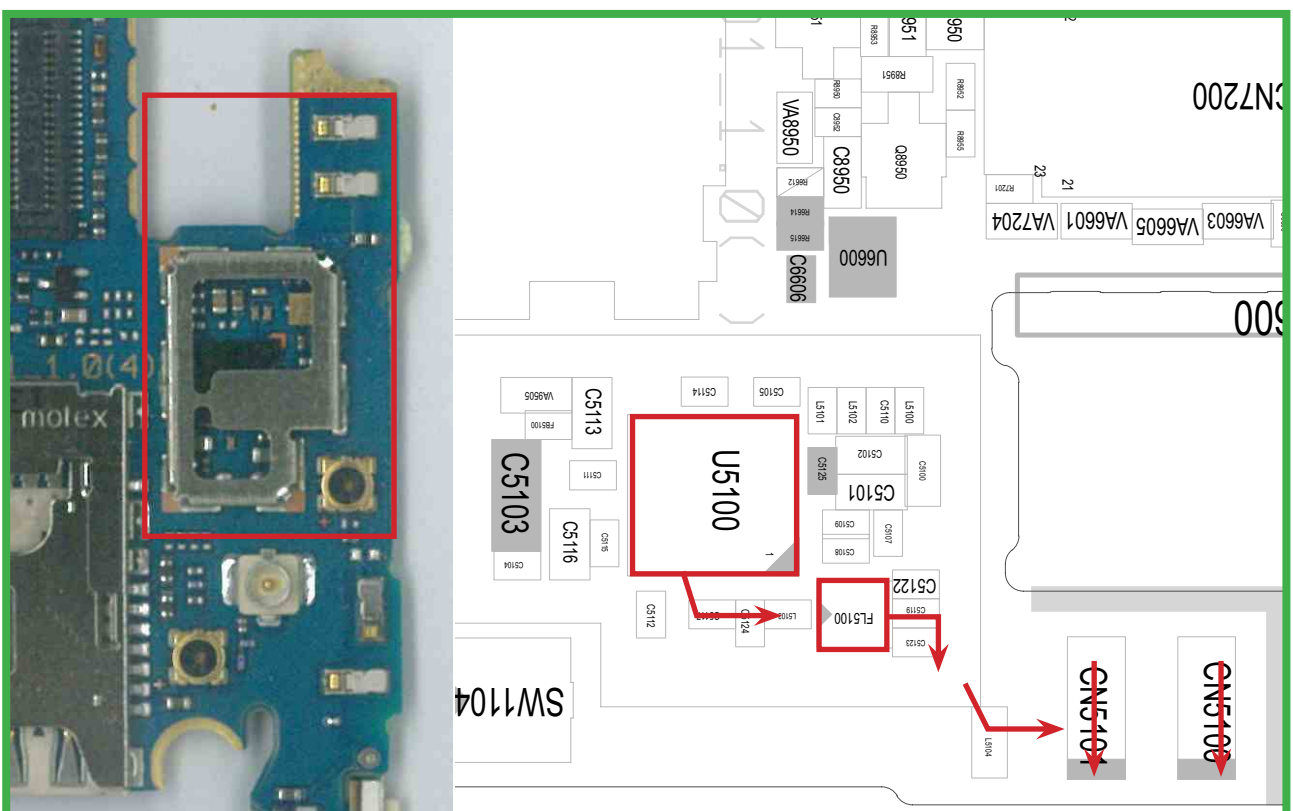

3. TROUBLE SHOOTING

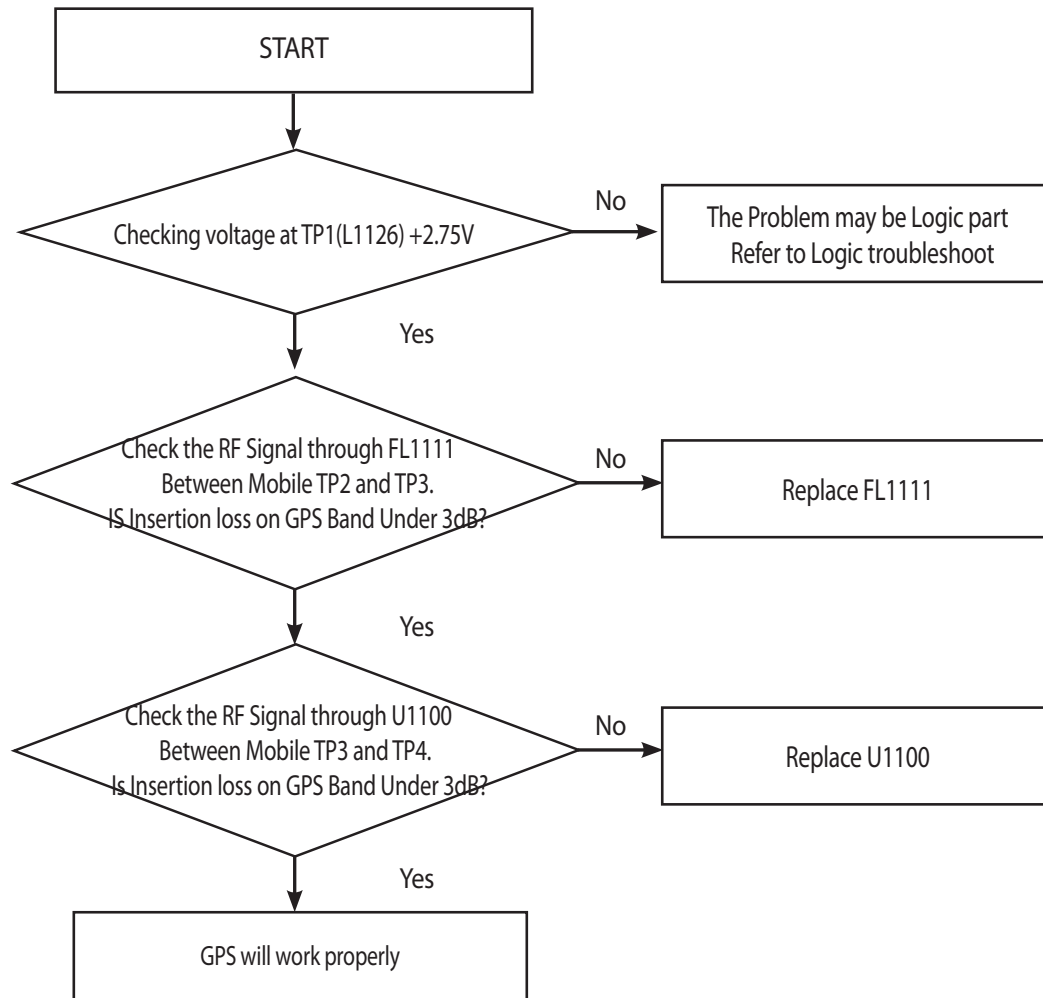


3. TROUBLE SHOOTING

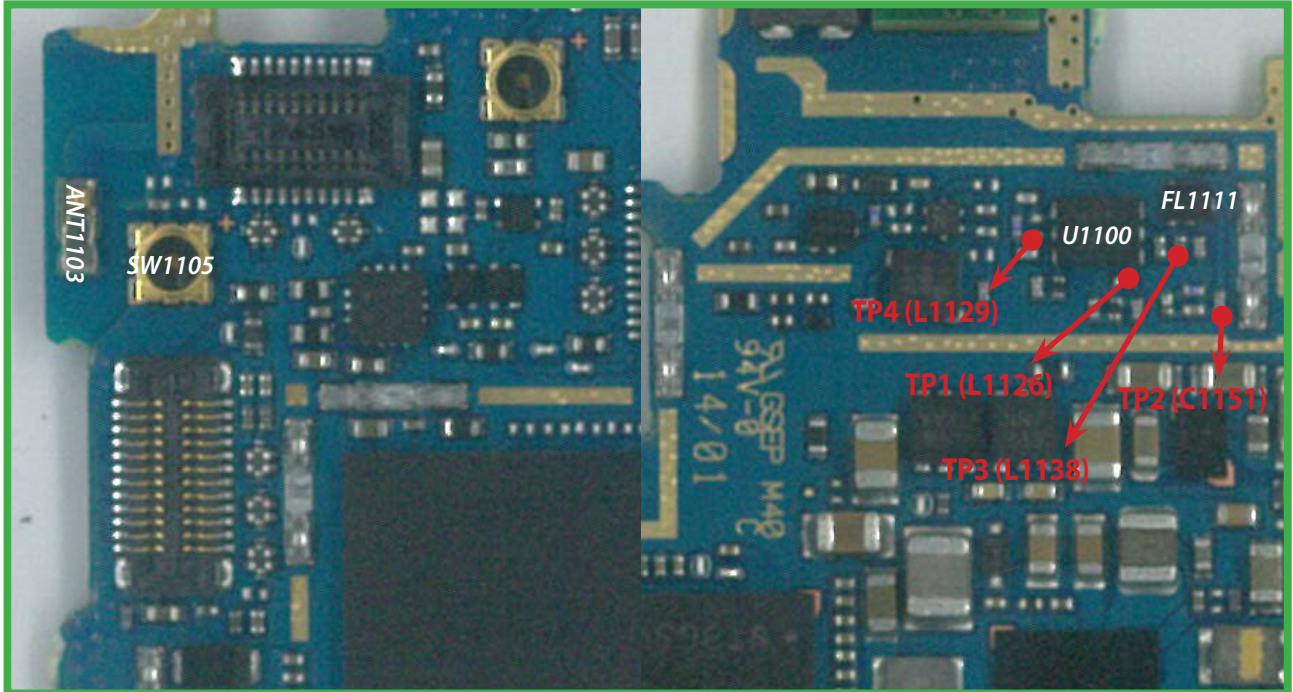

< Main Bot >


< Main Top >

3. TROUBLE SHOOTING

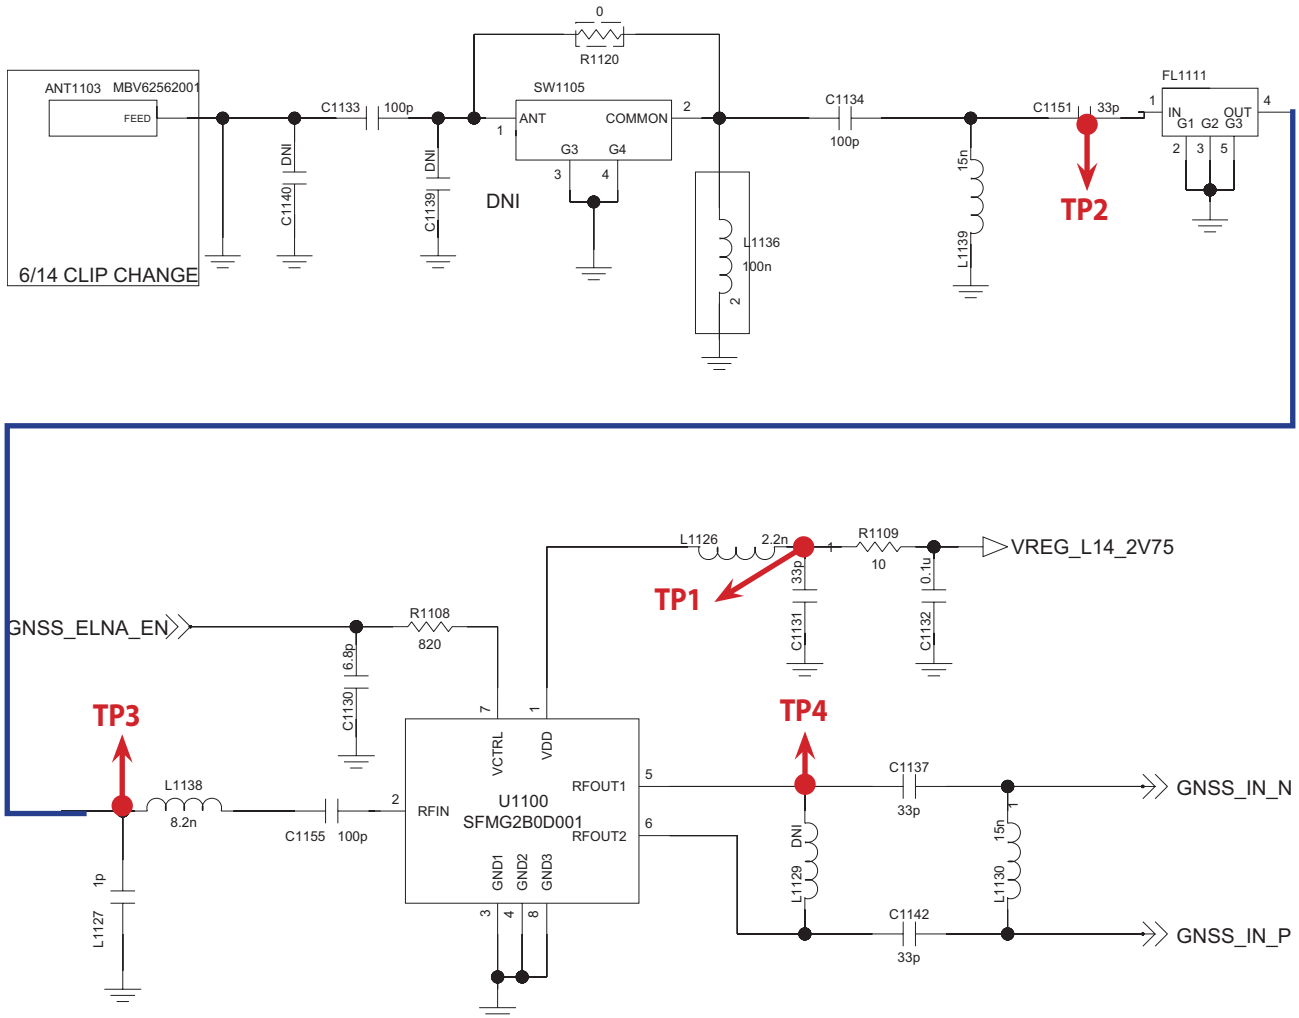

Schematic for GPS Block


3.12.3 Checking WIFI,BT

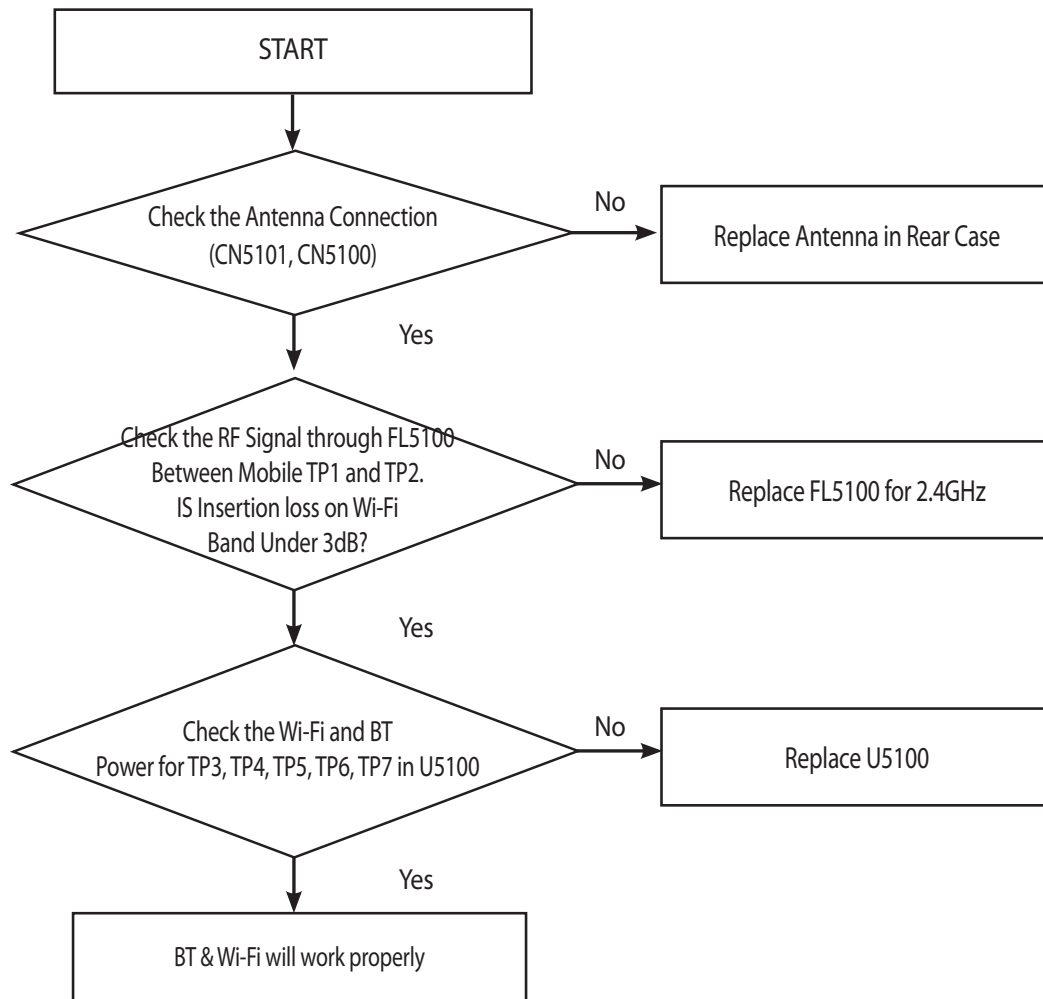





3.13 FM Radio Troubleshooting

3.13.1 FM Radio Test Point

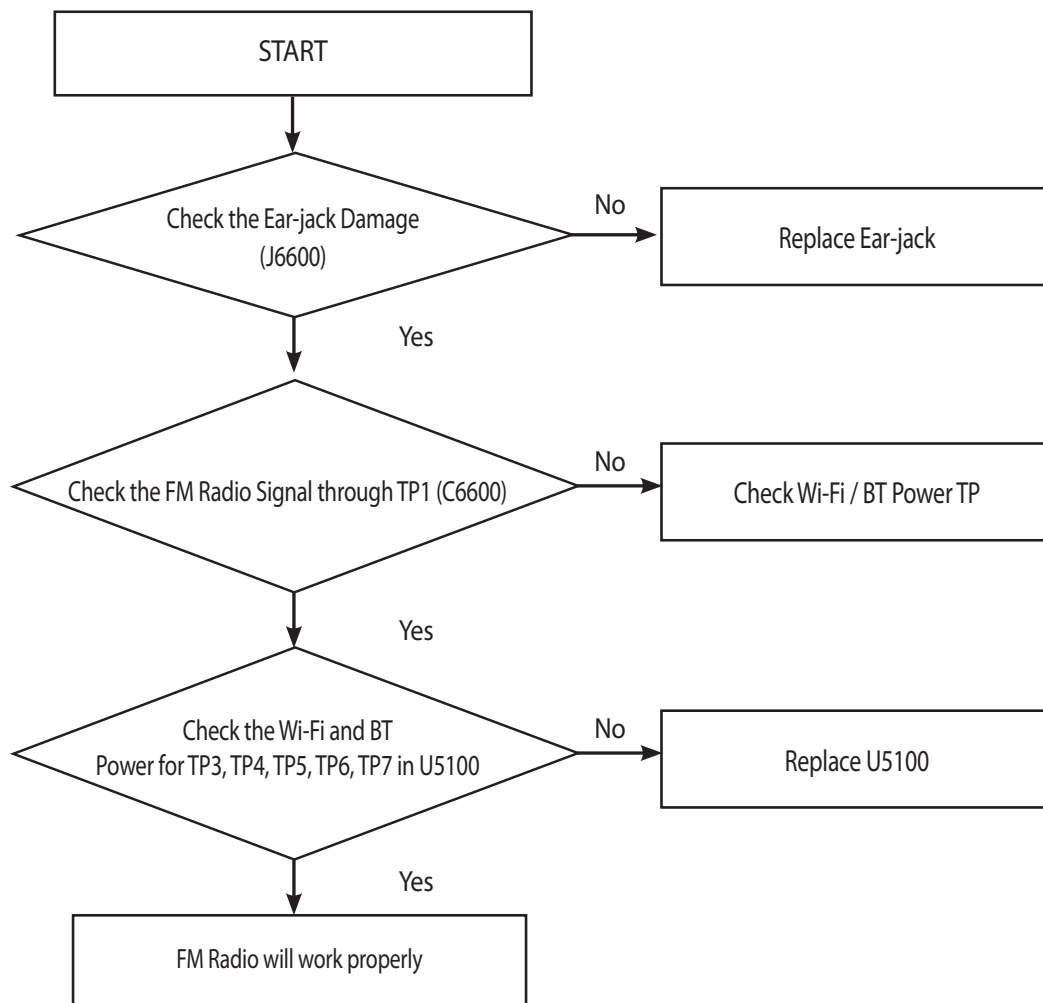

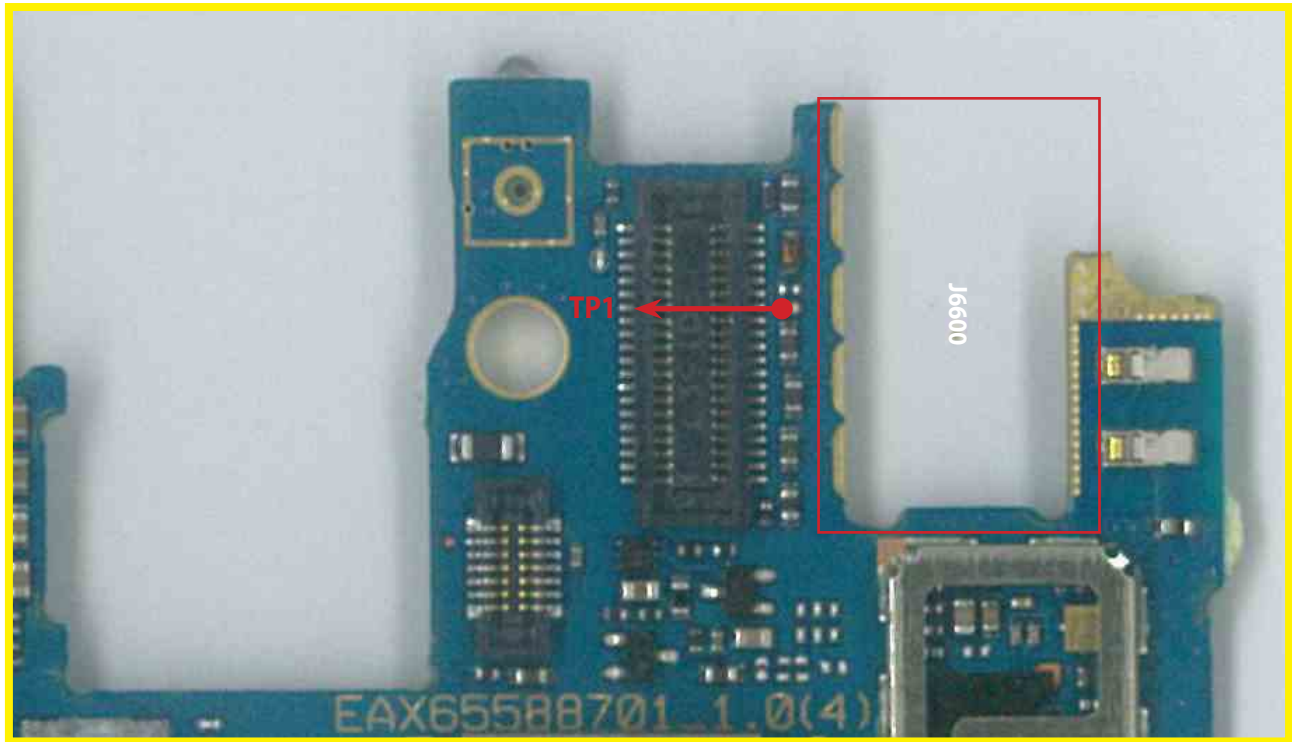


Schematic for FM Radio Block

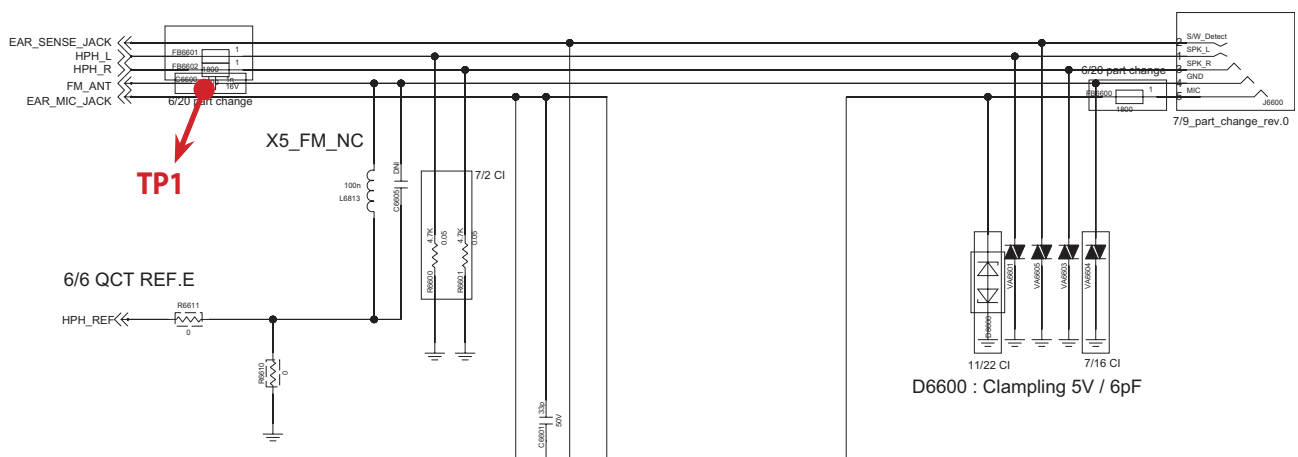

3.14 Audio


3.14.1 Overview (Block Diagram)

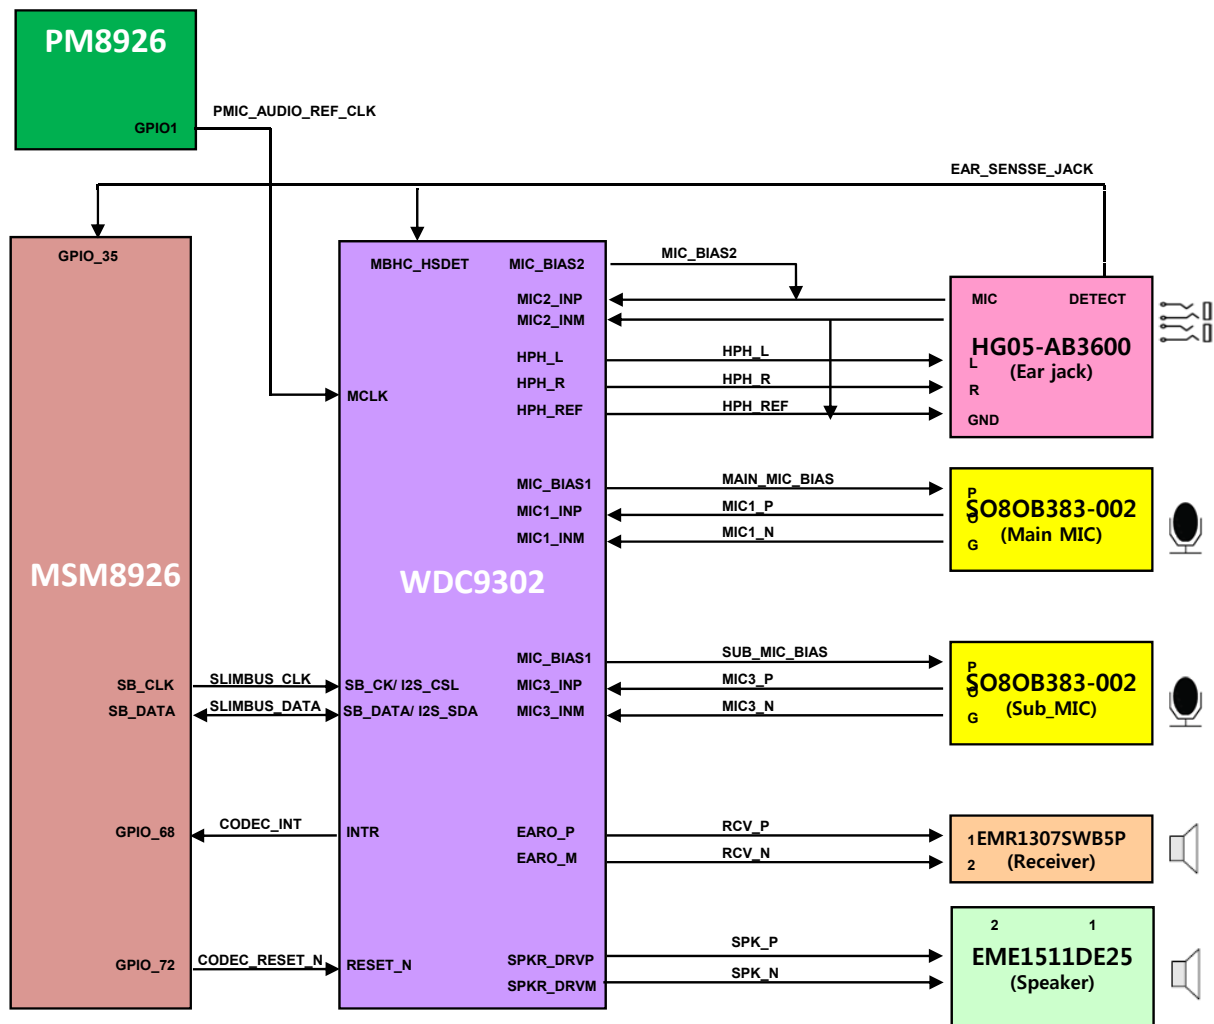

3.14.2 Speaker troubleshooting



It's trouble shooting guide for no sound case.

Speaker control signals are generate by WCD9302(U6100)


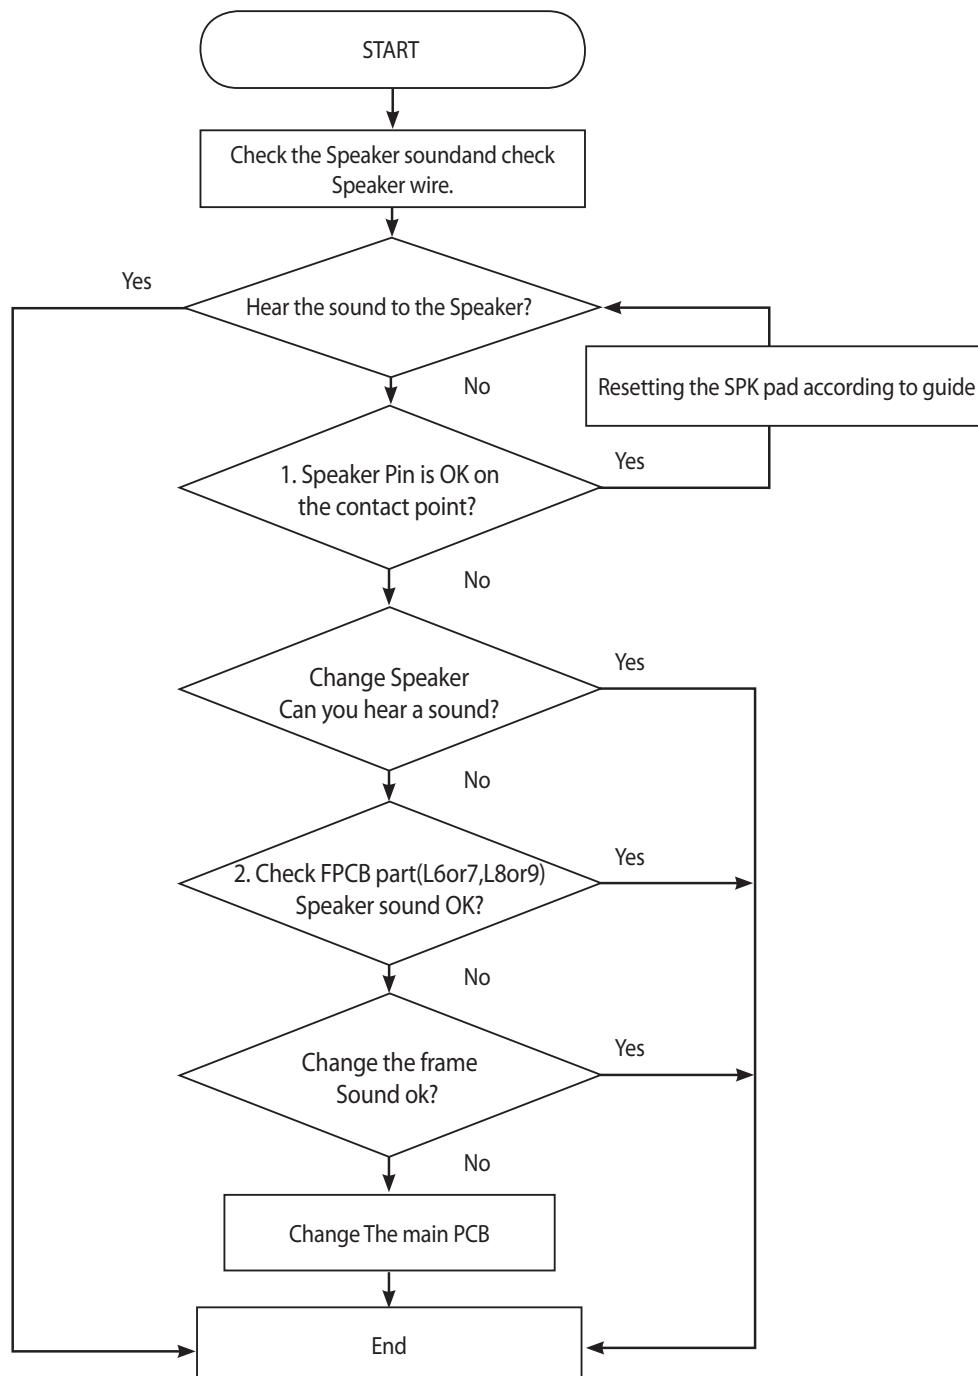


3. TROUBLE SHOOTING

1. Speaker Pin is OK on the contact point?

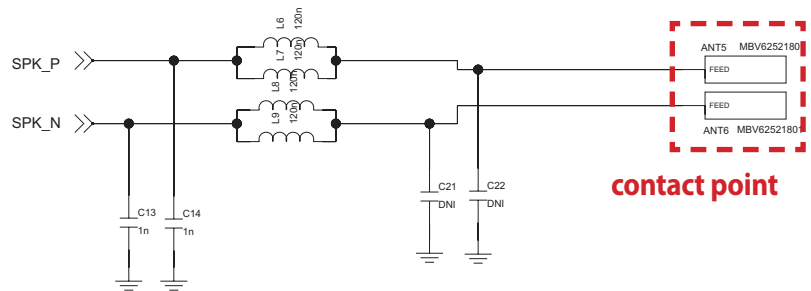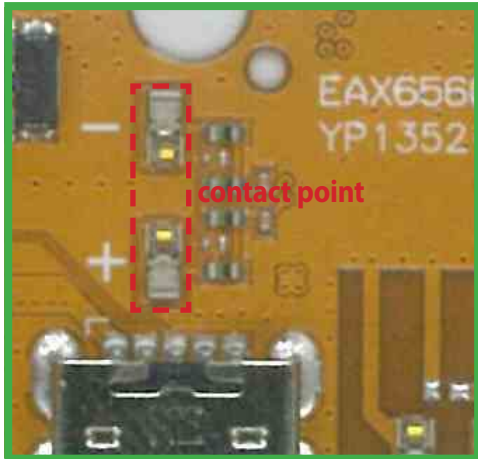

2. Check FPCB part(L6orL7,L8orL9) Speaker sound OK?

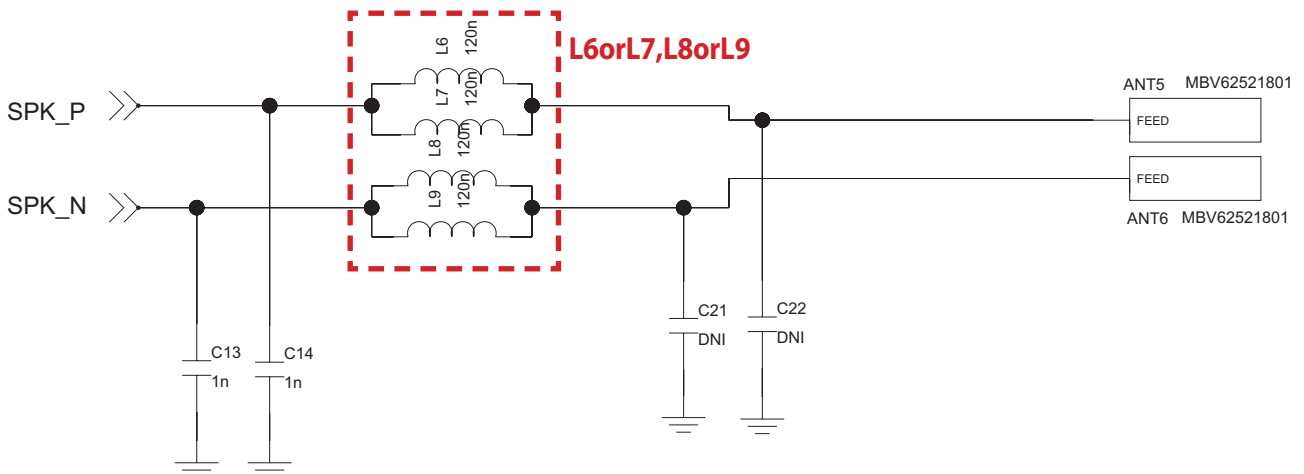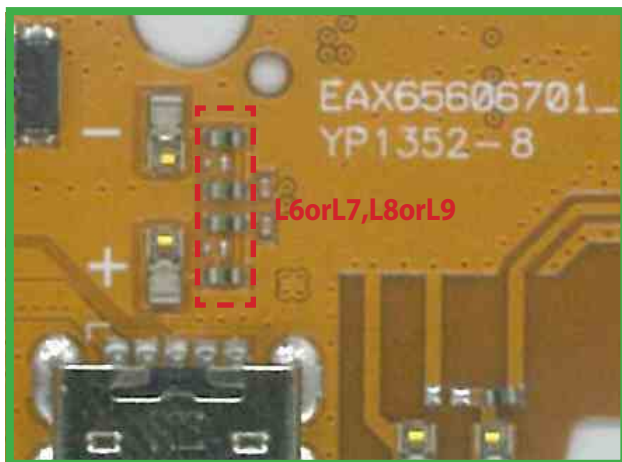


3.14.3 Receiver troubleshooting


Receiver control signals are generate by MSM8926(U2100), WCD9302(U6100)

Voice Receiver path as below :


WCD9302 -> EARO_P/EARO_N -> Receiver.

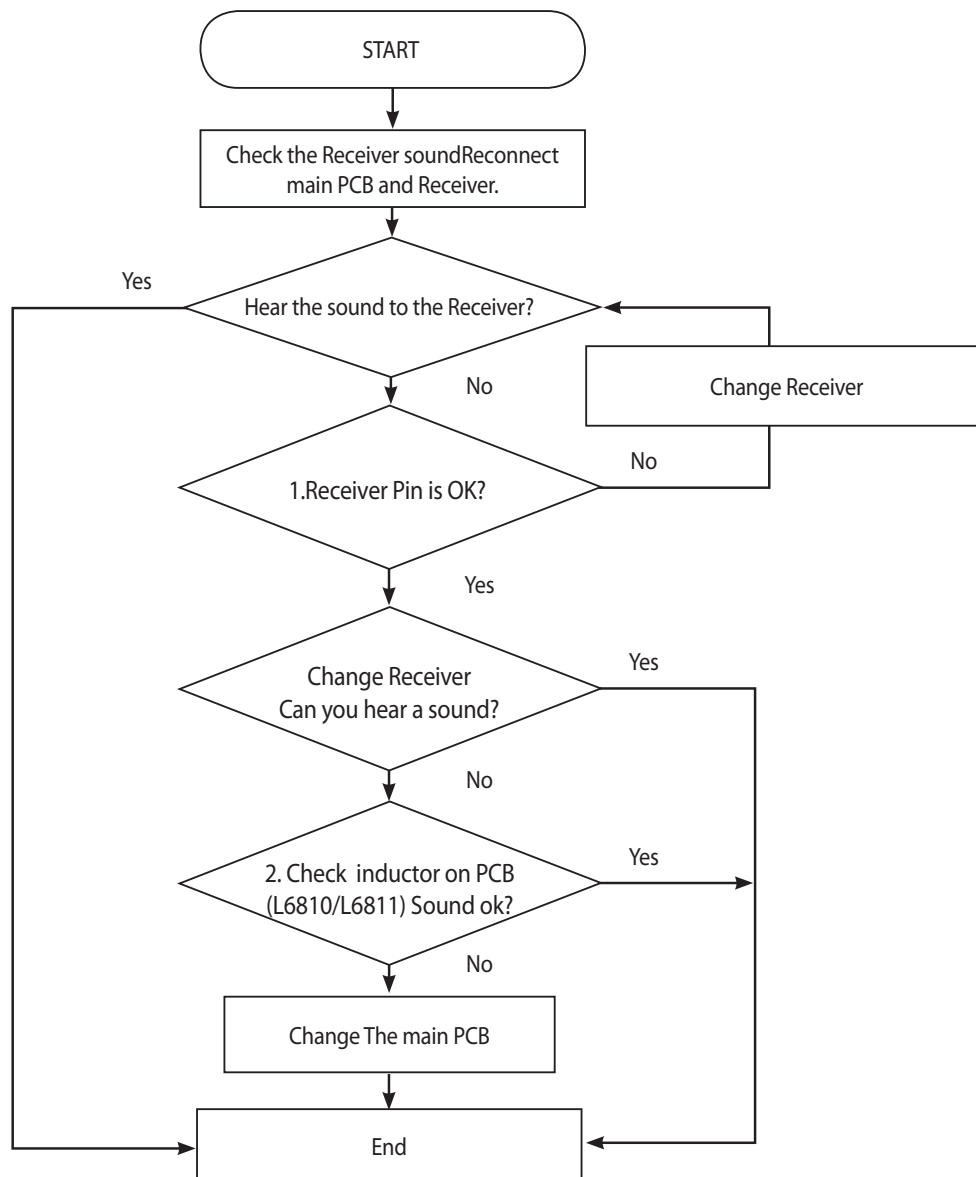

1. Receiver Pin is OK?

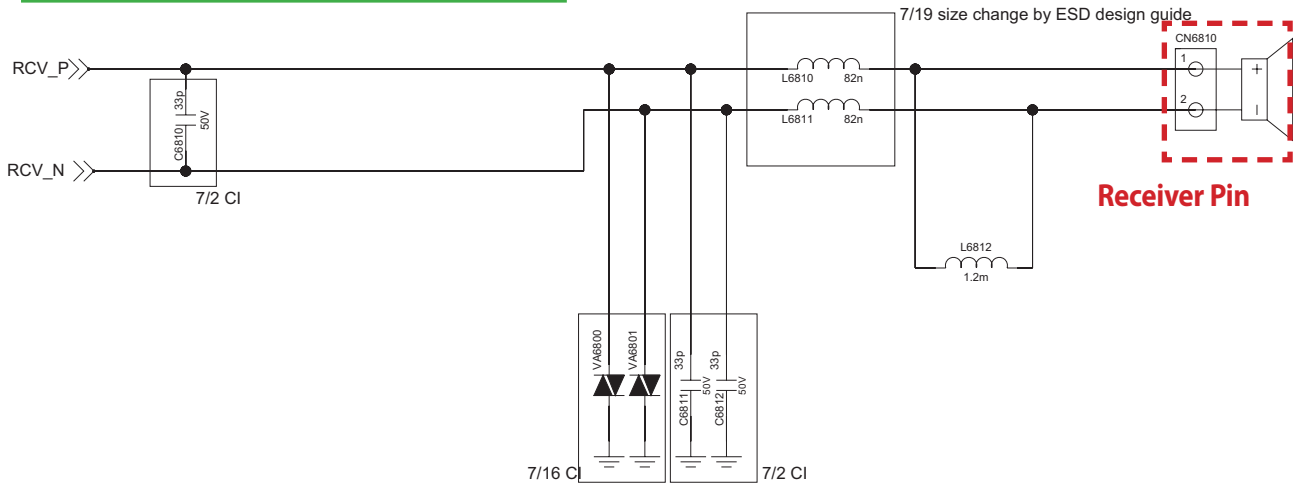

2. Check inductor on PCB (L6810 / L6811), Sound ok?

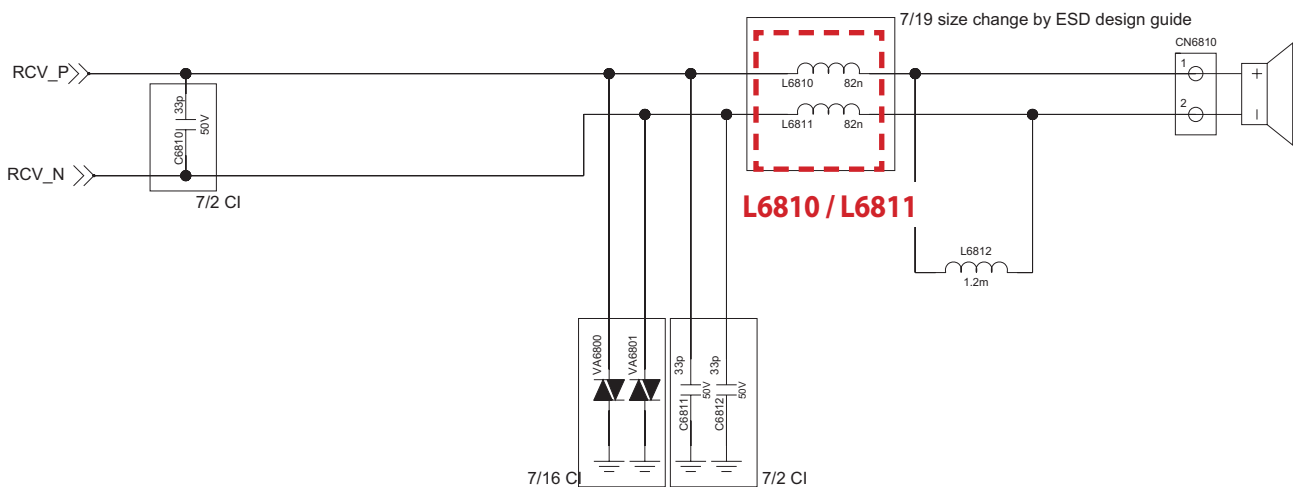


In case of No Receiver sound, not only Receiver fault but MIC fault.

You must check first voice recording test. After voice recording you can hear a recording sound, receiver path or parts is something wrong.

3.14.4 Main MIC troubleshooting


Main Mic located on FPCB.

It's operating voice call(except speakerphone), voice recording, camcorder recording


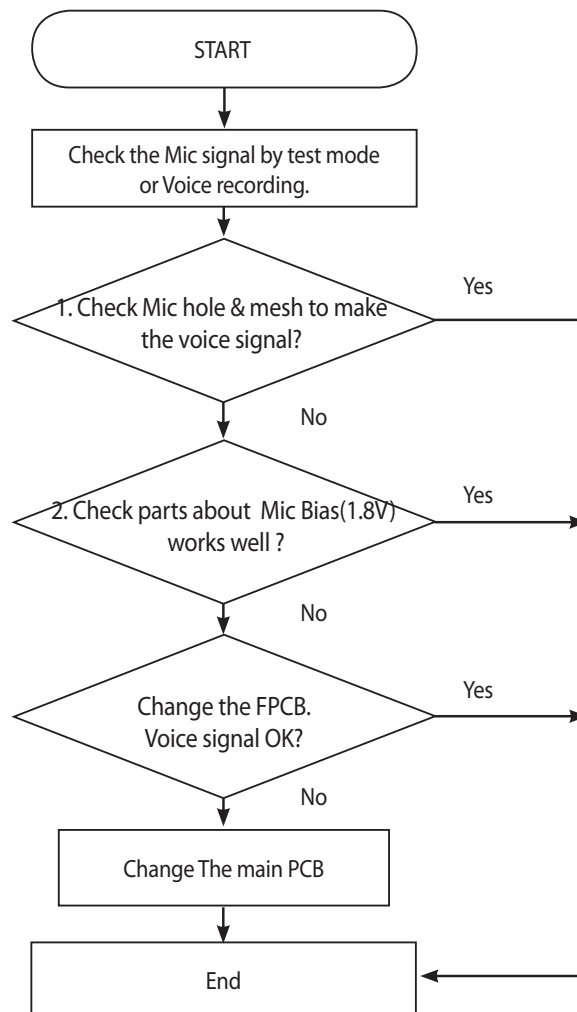


3. TROUBLE SHOOTING

1. Check Main Mic hole & mic mesh. (FPCB)

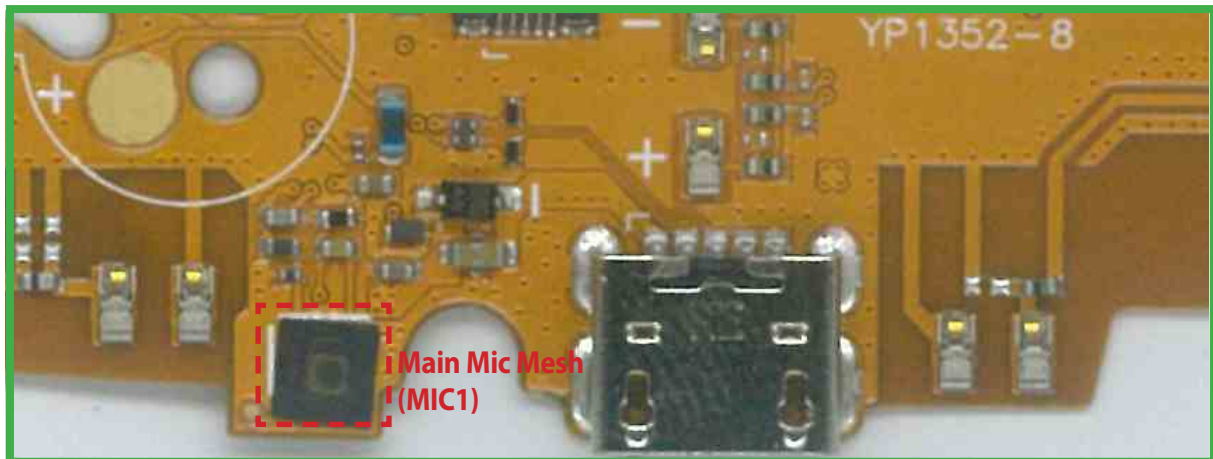


2. Check parts about Mic Bias(1.8V) works well.

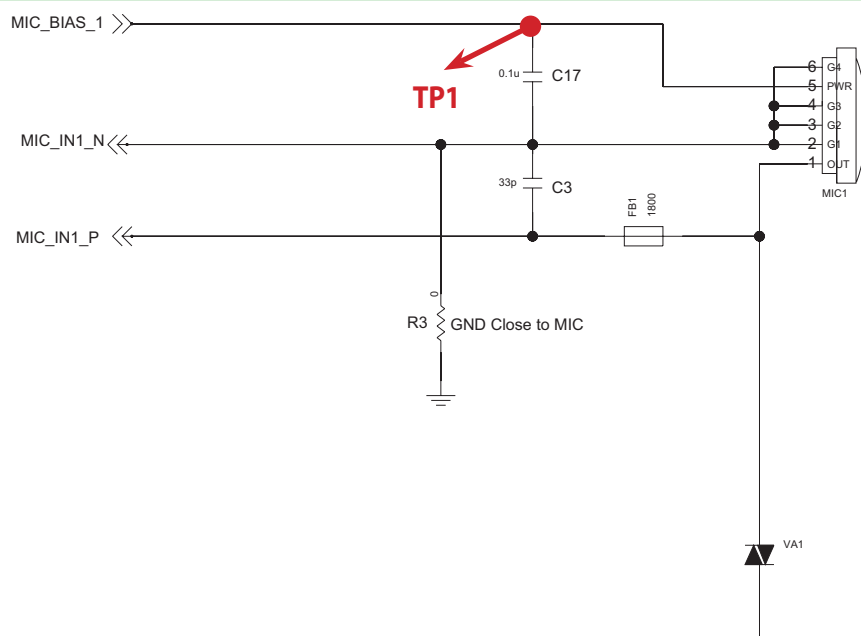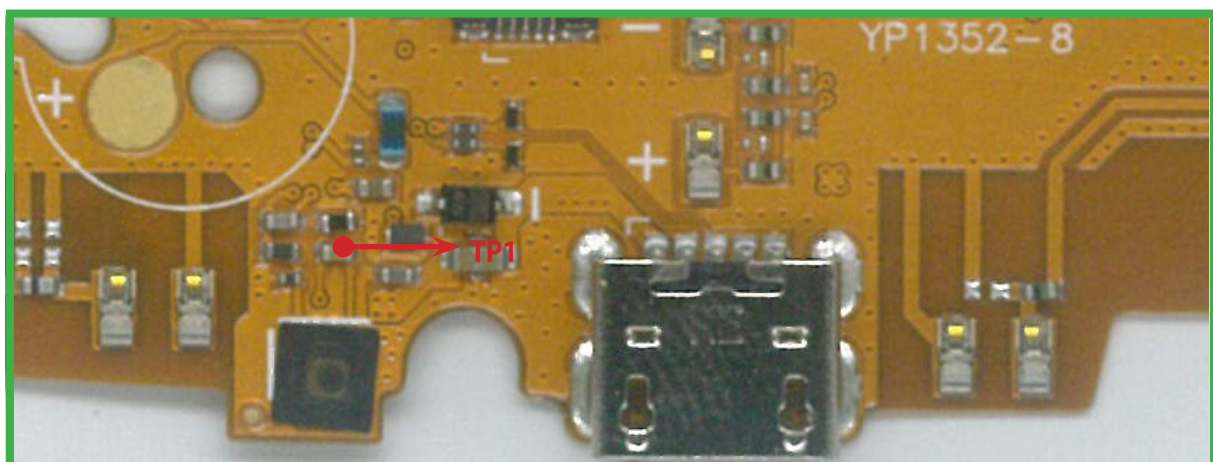

3.14.5 SUB MIC troubleshooting


Sub Mic located on Main PCB.

It's operating only speakerphone voice call.

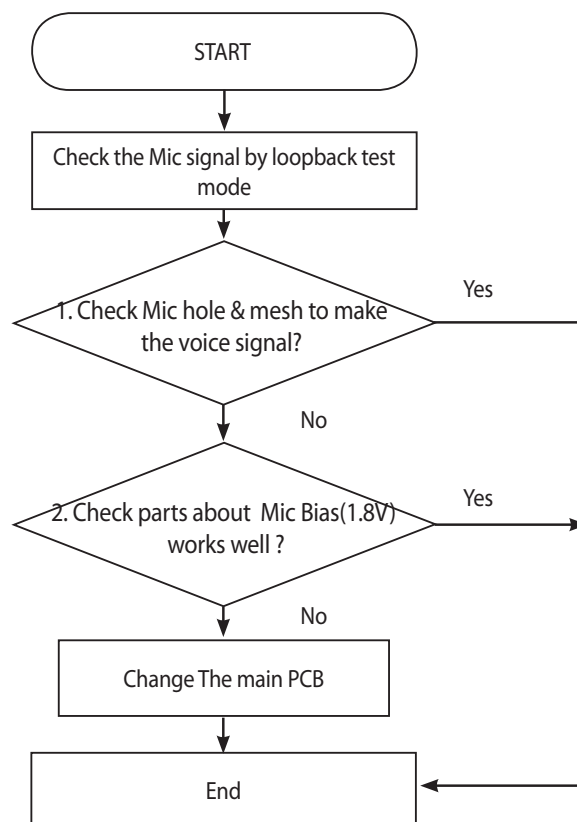


3. TROUBLE SHOOTING

1. Check Sub Mic hole & mic mesh. (PCB)

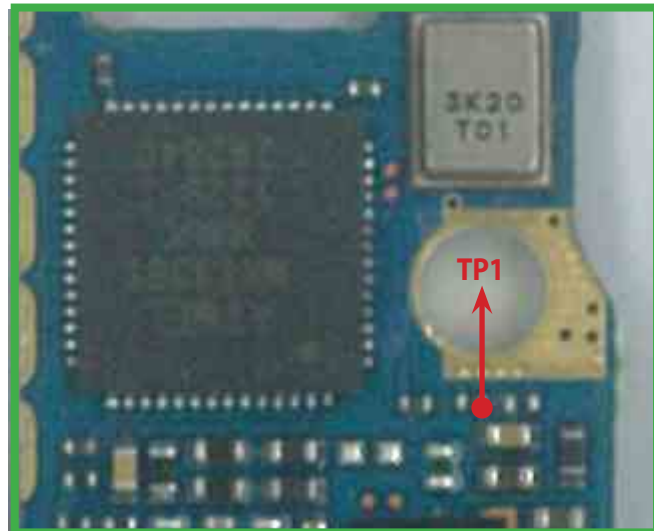


2. Check parts about Mic Bias(1.8V) works well.

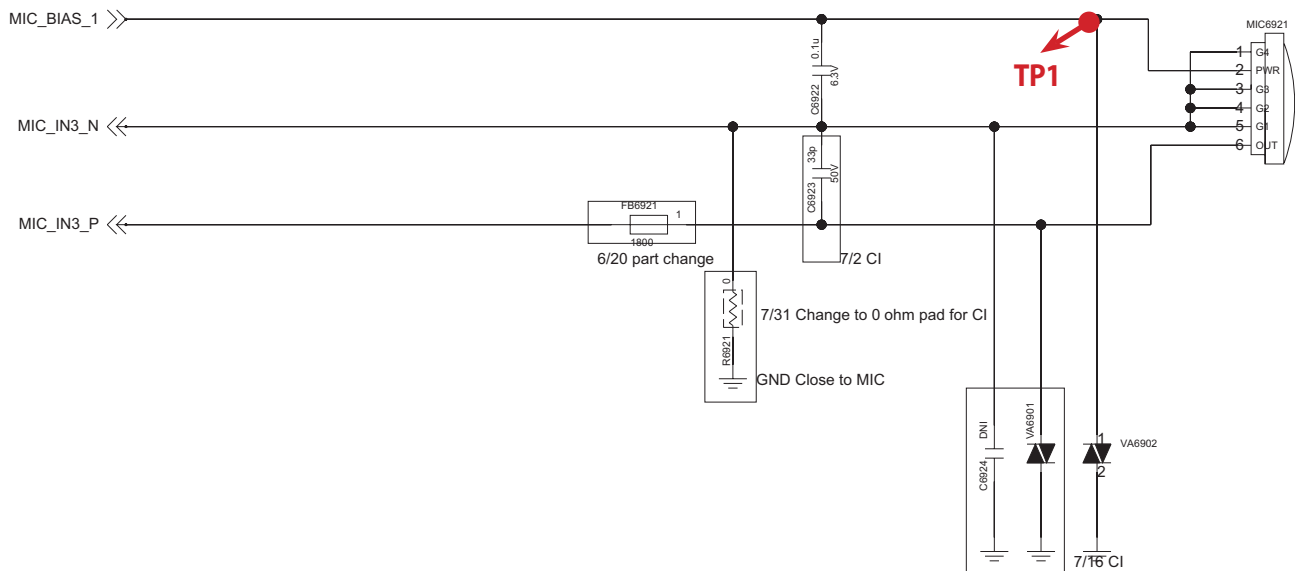

3.14.6 Ear-MIC Trouble Shooting



Ear MIC control signals are generate by WCD9302(U6100).

Case A. Disable detected headset insert.

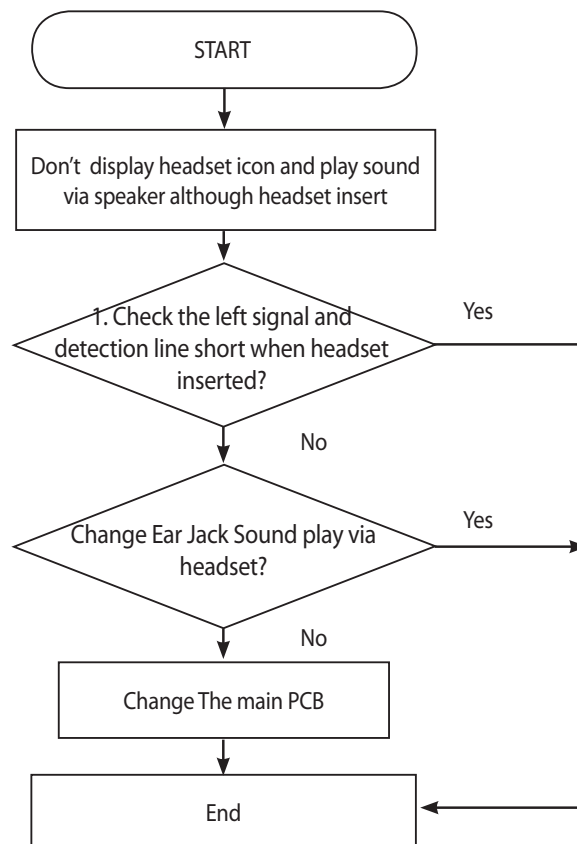


3. TROUBLE SHOOTING

1. Check the left signal and detection line short when headset inserted

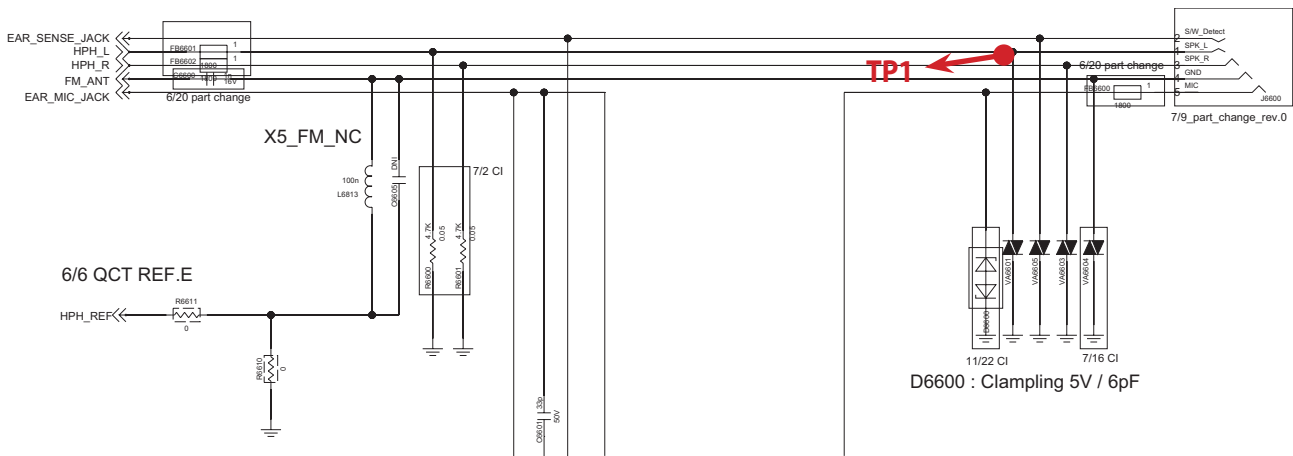
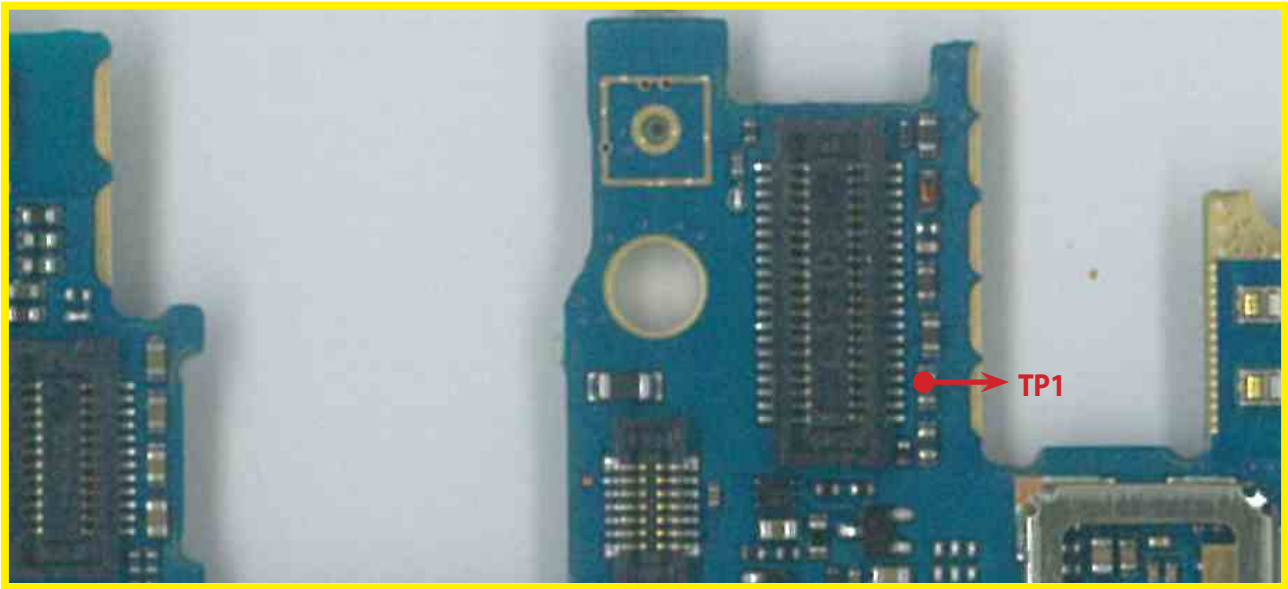


Case B. No Sound from Ear-mic

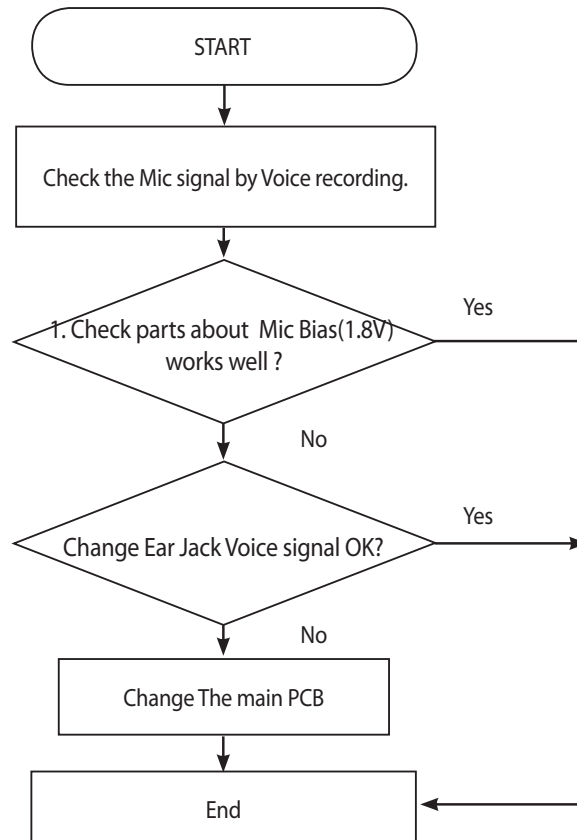

3. TROUBLE SHOOTING


1. Check parts about Mic Bias(1.8V) works well ?

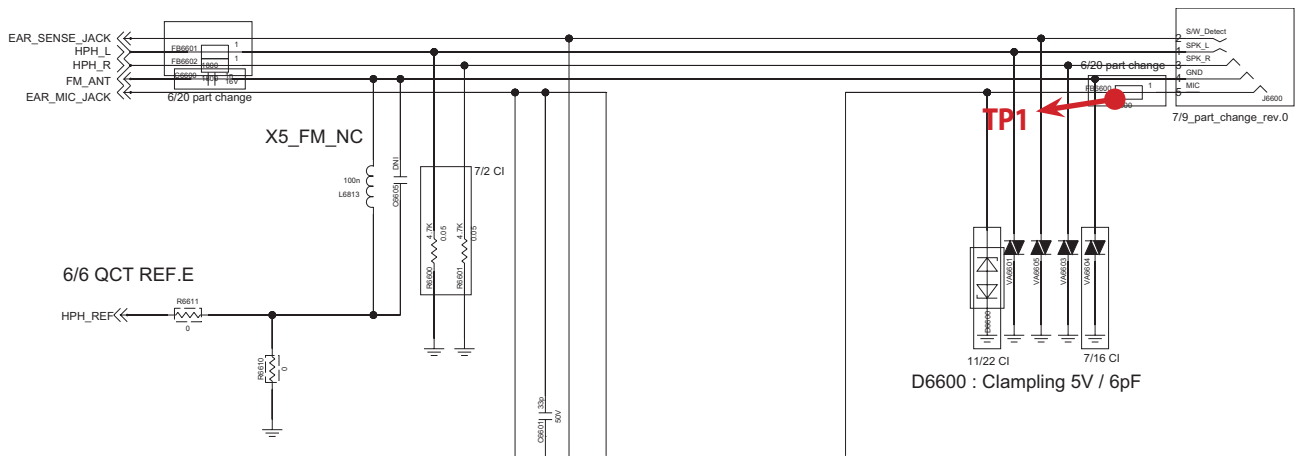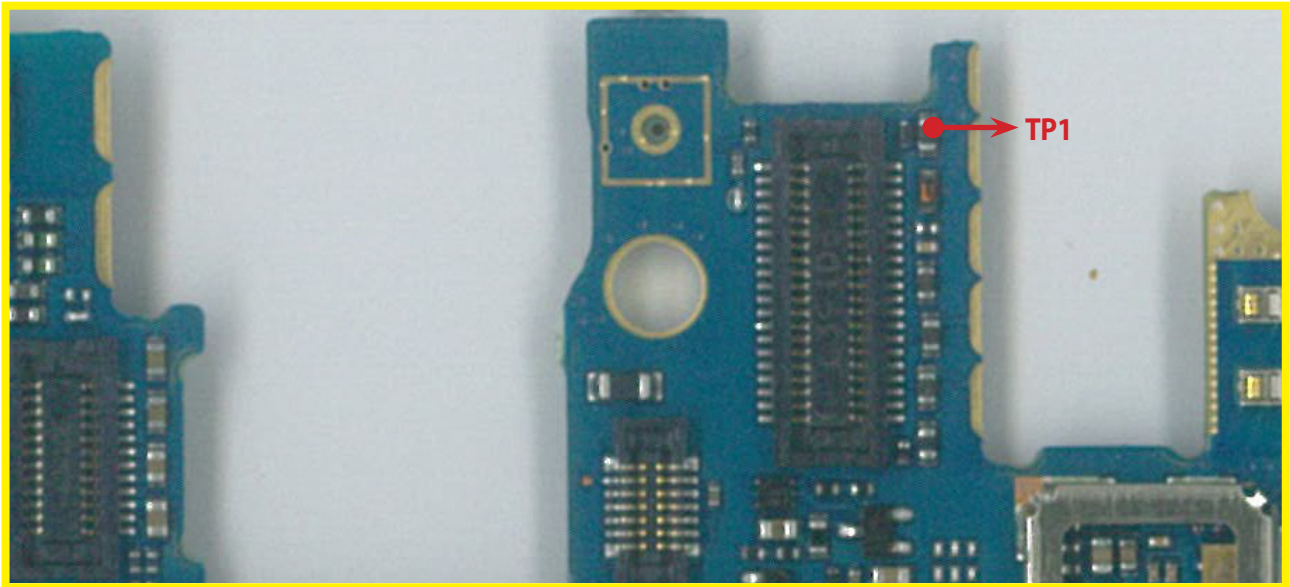

3.15 Camera


3.15.1 Camera (8M)

8M camera control signals are generated by MSM8926.


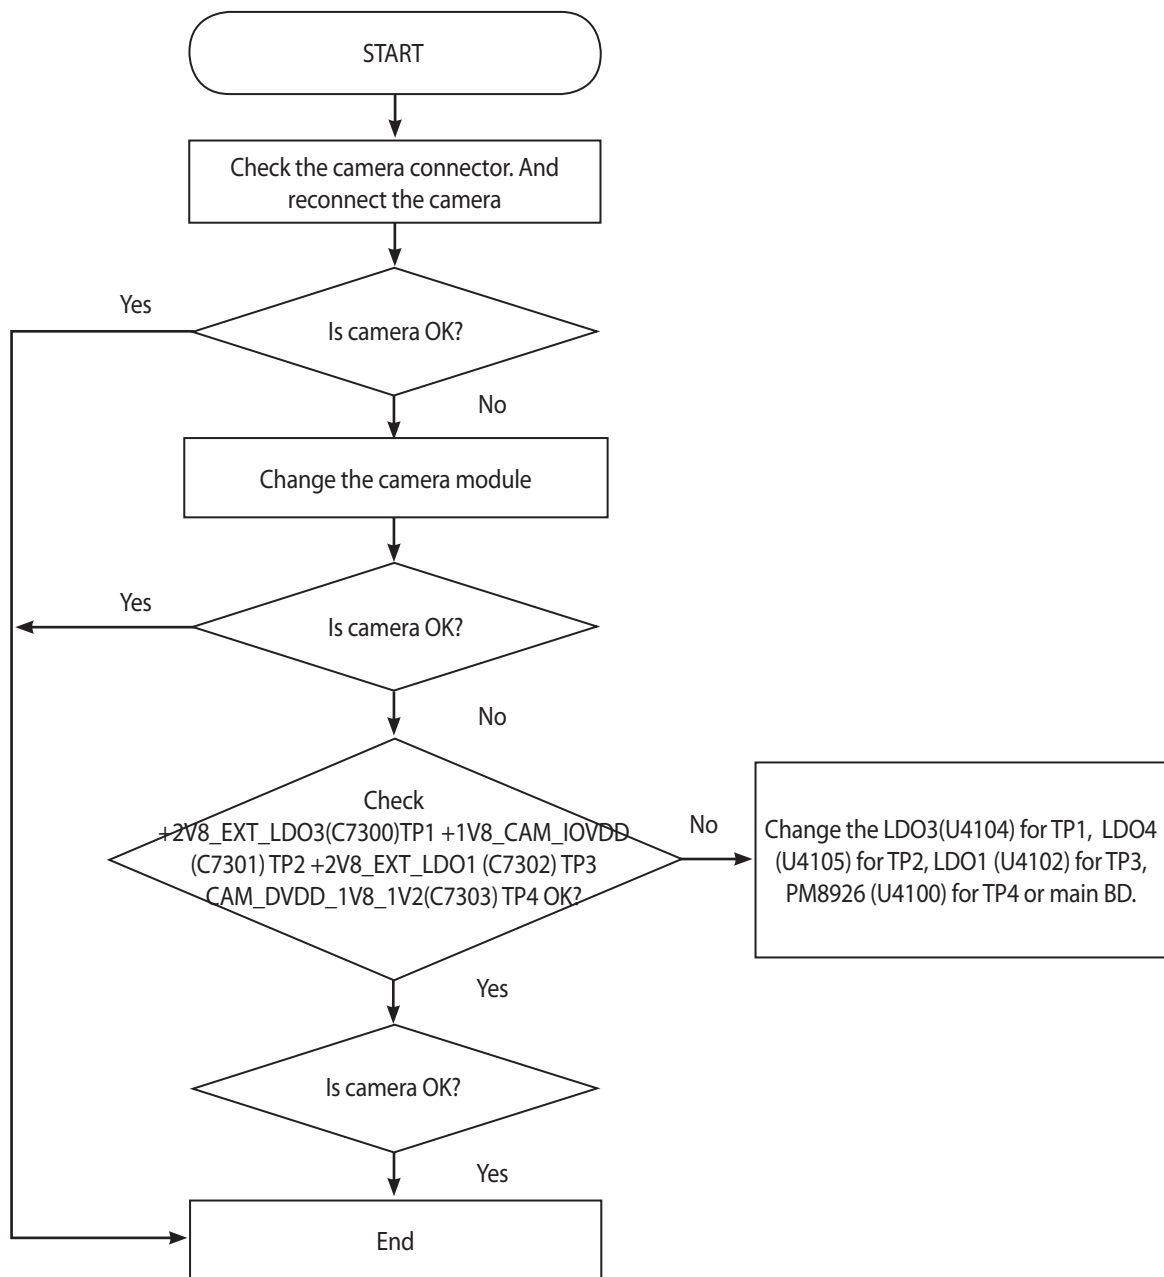


3.15.2 Camera (1.3M)

1.3M camera control signals are generated by MSM8926.

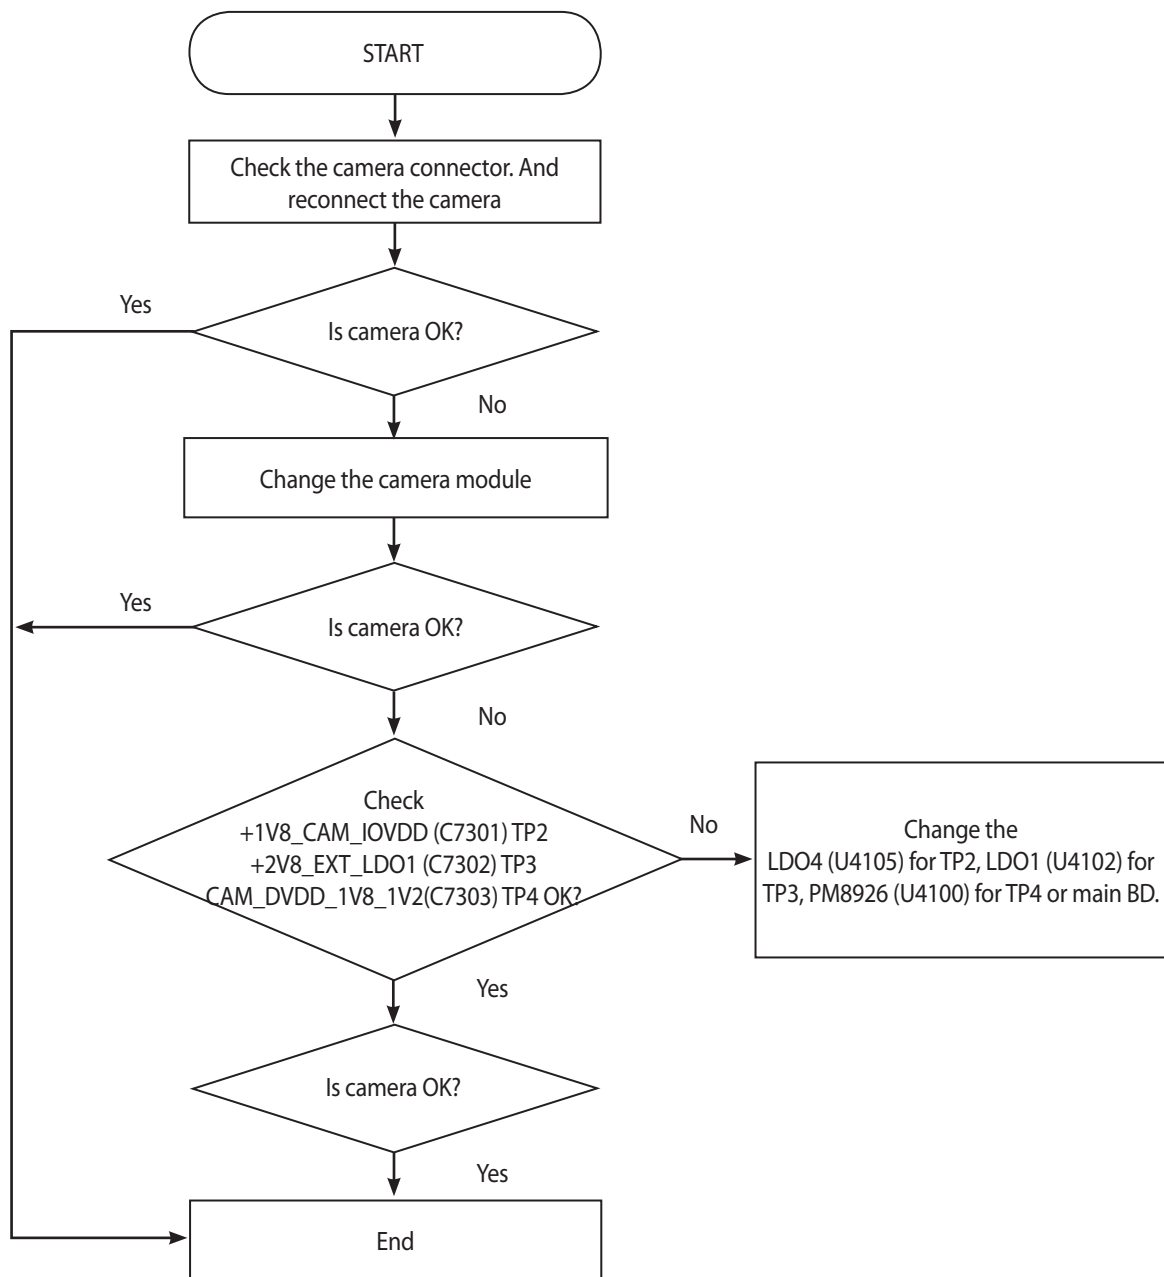

3.15.3 8M_1.3M Camera

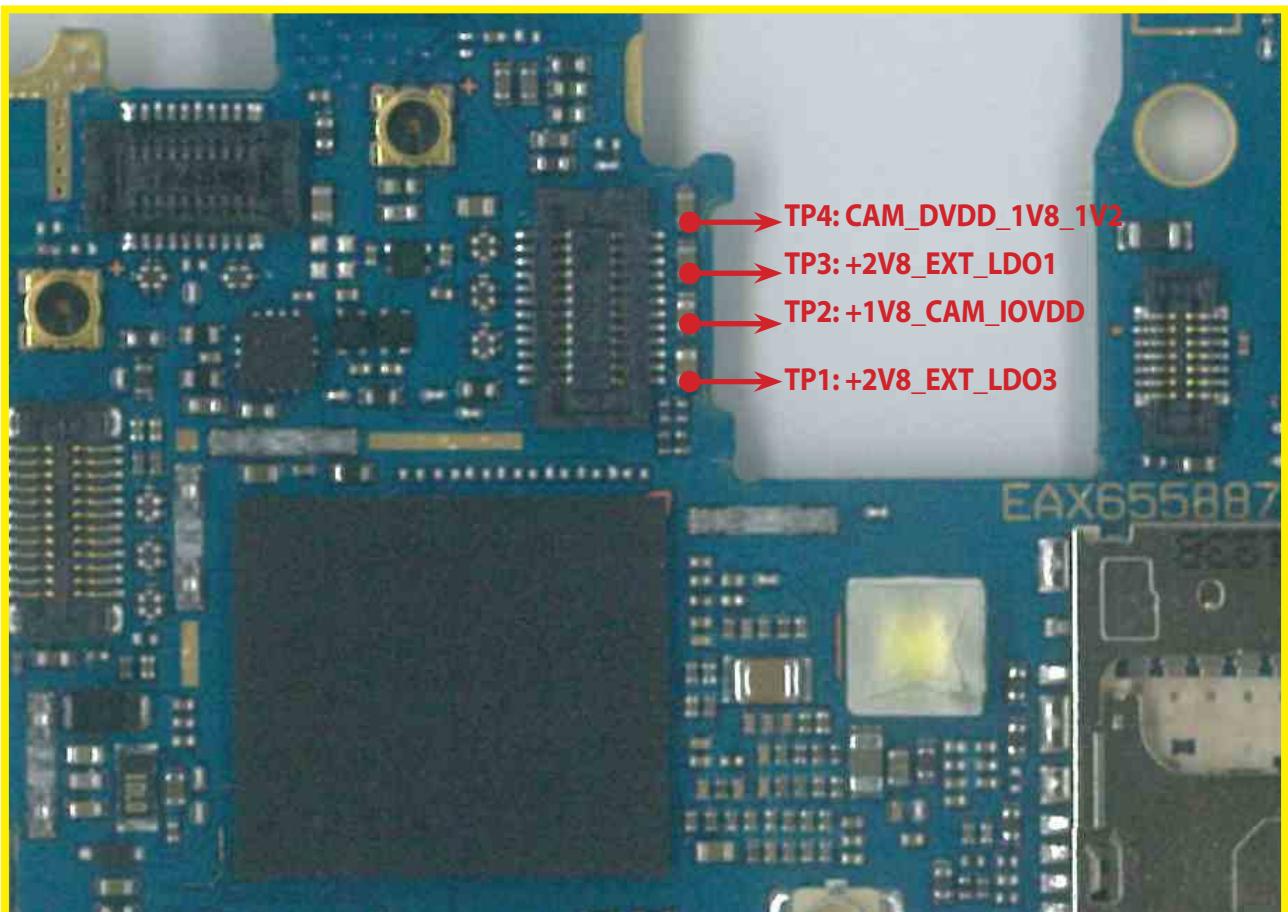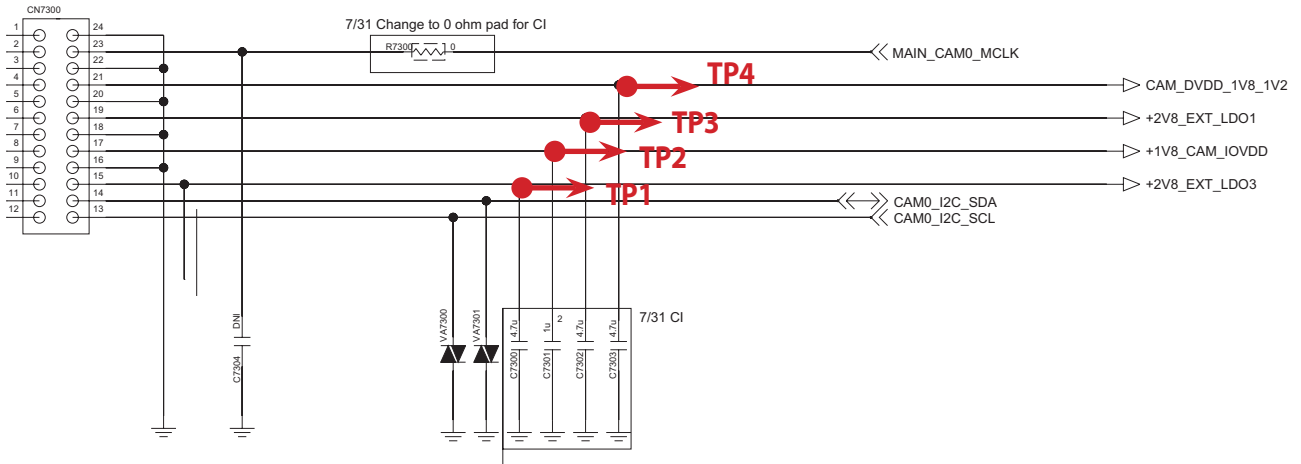


<Min Bot>


3.16 LCD

Main LCD control signals are generated by MSM8926. Those signal's path are :


MSM8926 -> LCD Module

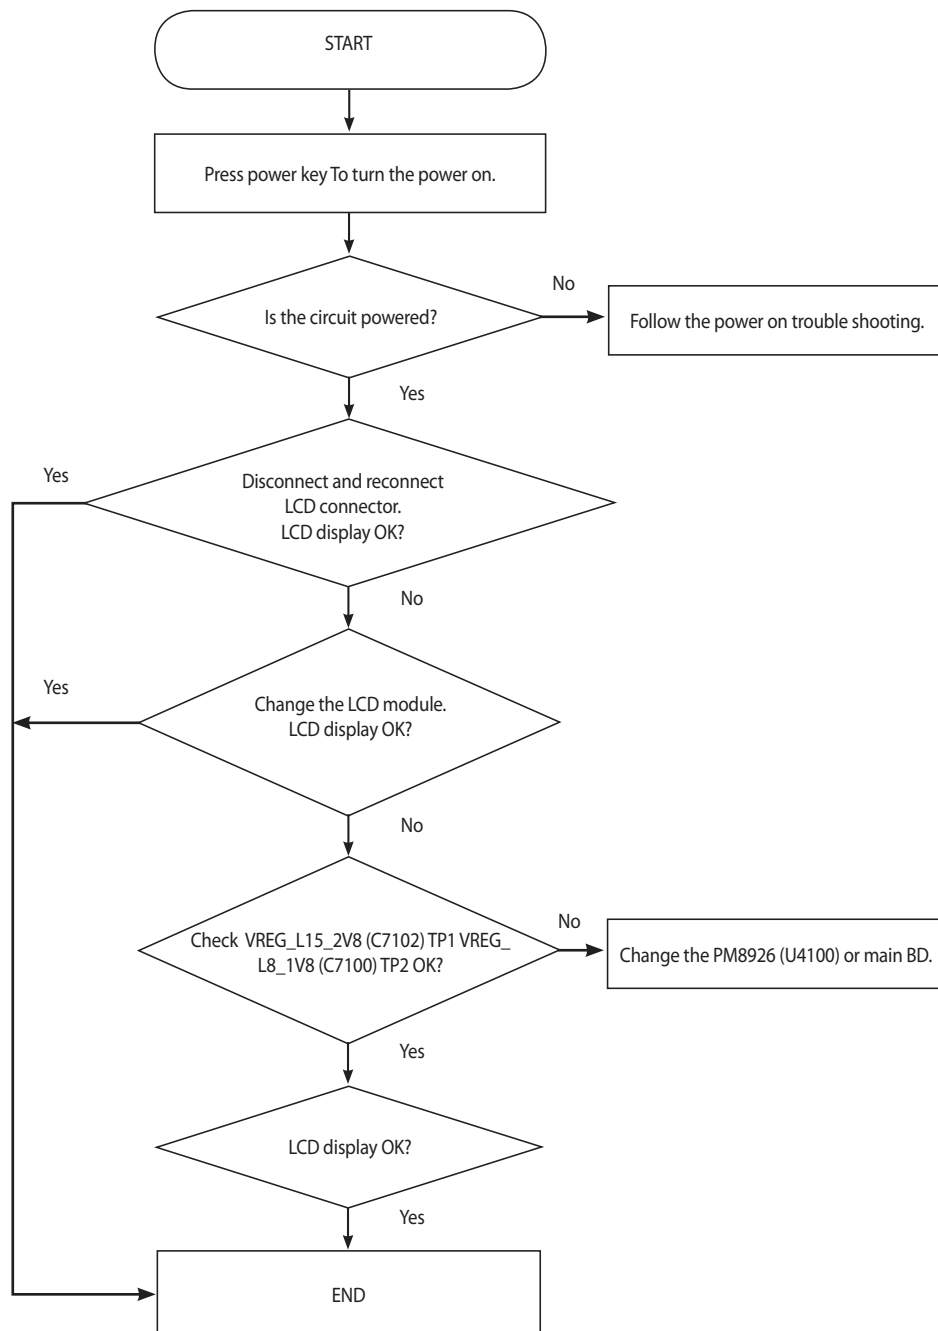


3. TROUBLE SHOOTING

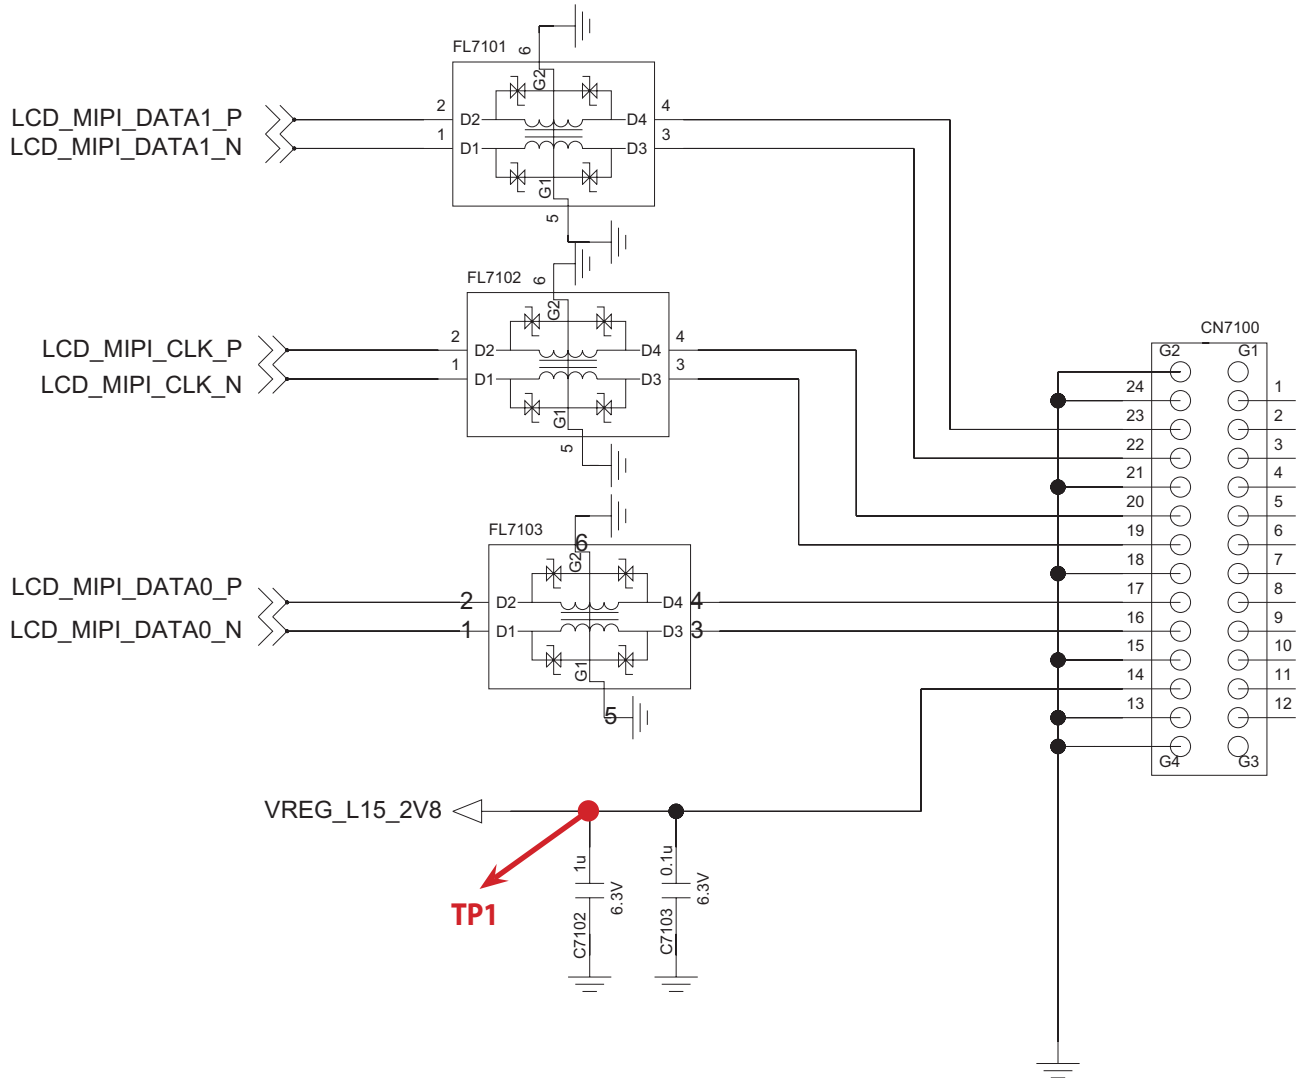

3. TROUBLE SHOOTING

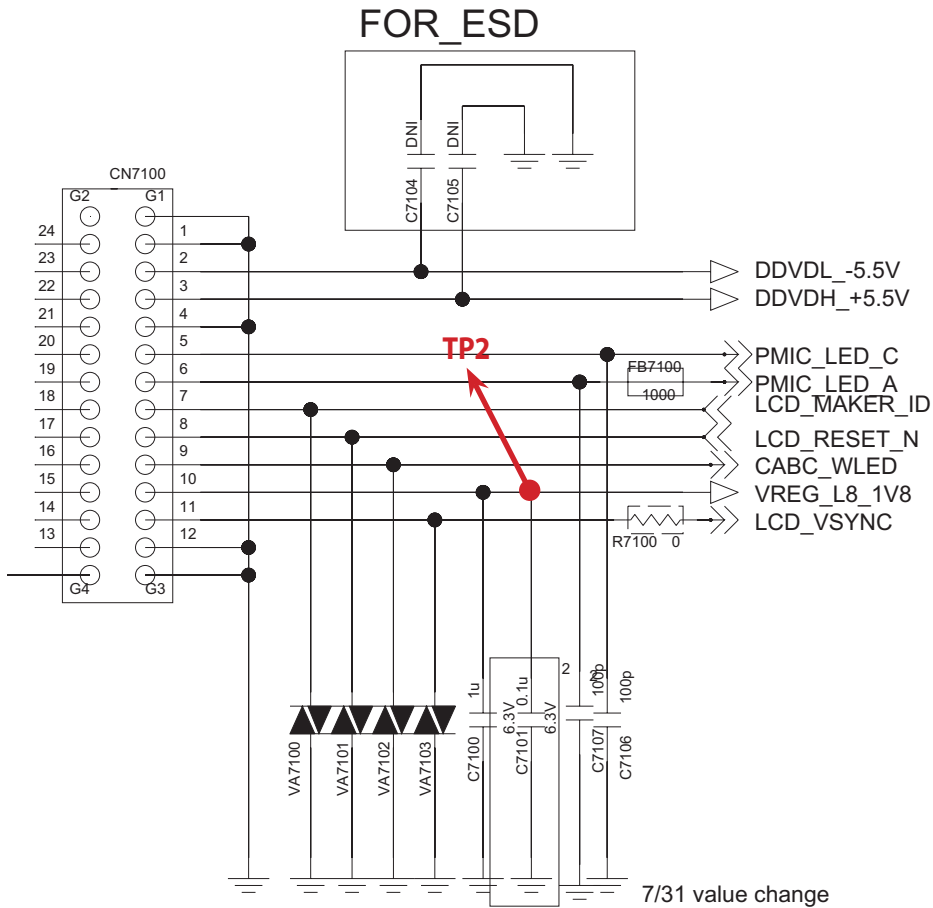

VA7100-7103 : Clamping 15.5V / 100pF

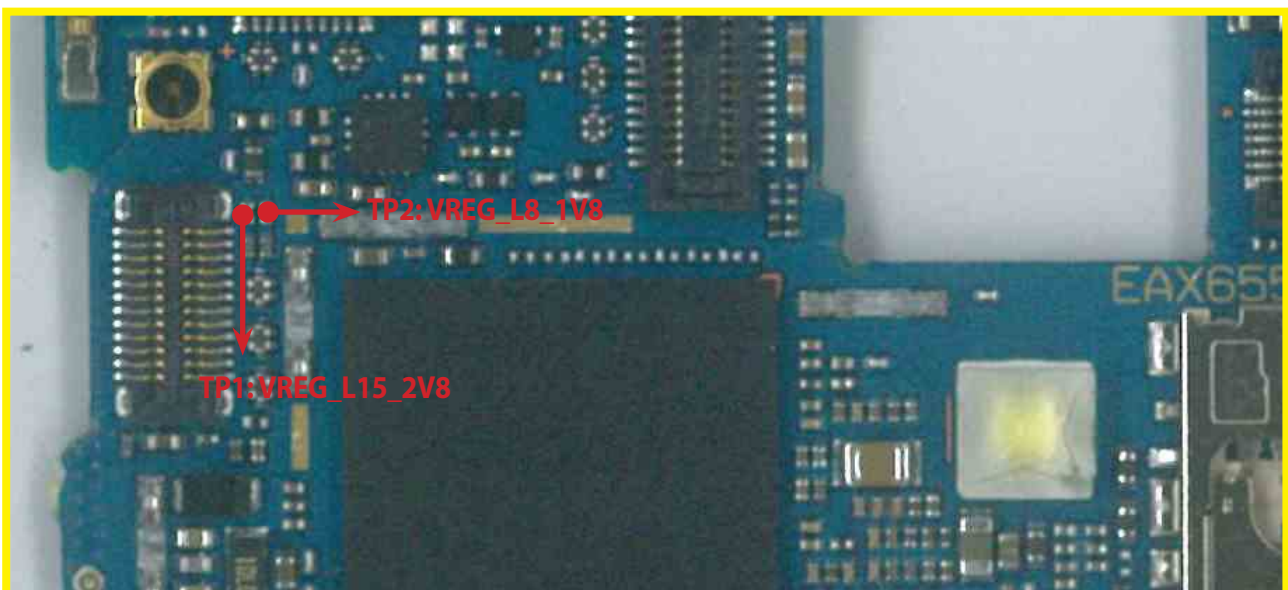

<Min Bot>


3.17 Power ON Troubleshooting

The main power source of LS740 is provided by 1 chip which is PM8926. Since MSM8926 only powers up normally when MSM8926 is properly powered therefore, PM8926 is the actual one to take look at.


Power ON sequence of LS740 is below.

1. PM8x26 receives a poweron trigger (e.g. KPD_PWR_N press).
2. The PM8x26 poweron sequence begins (PBS sequence runs). The following take place:
 - BMS OCV measurement occurs.
 - Enable boost bypass (set GPIO_8 high) to enable external supplies.
 - S3 is turned on (memory supply).
 - L3 is turned on.
 - S1 is turned on (core supply).
3. The rest of the power sequence (regulators, clocks) are enabled in several steps.
4. The PM8x26 PBS sequence completes. The PM8x26 PON module deasserts PON_RESET_N and sets the PS_HOLD timer.
5. Once PON_RESET_N is deasserted, the MSM device comes out of reset, and PBL will assert PS_HOLD. PM8x26 is on.
6. After FLCB, the secondary poweron sequence takes place.


3.17.1 Power ON Troubleshooting (MSM8926)

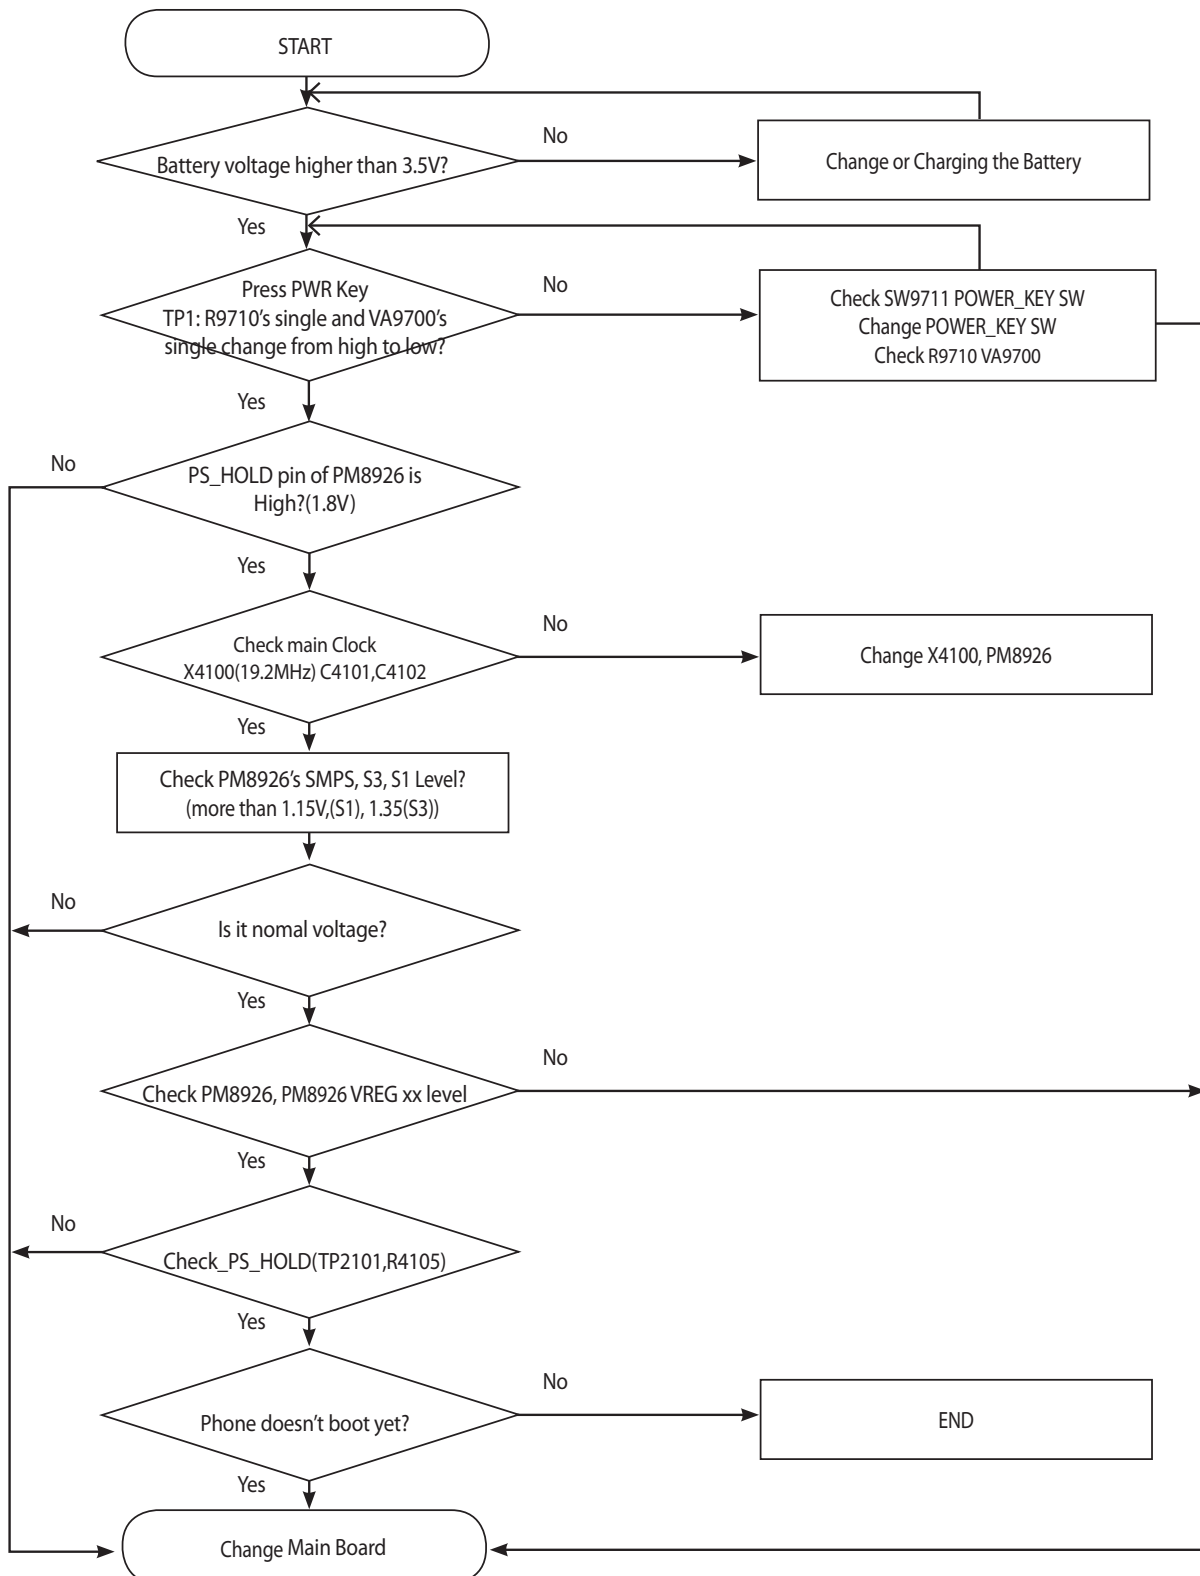

3. TROUBLE SHOOTING


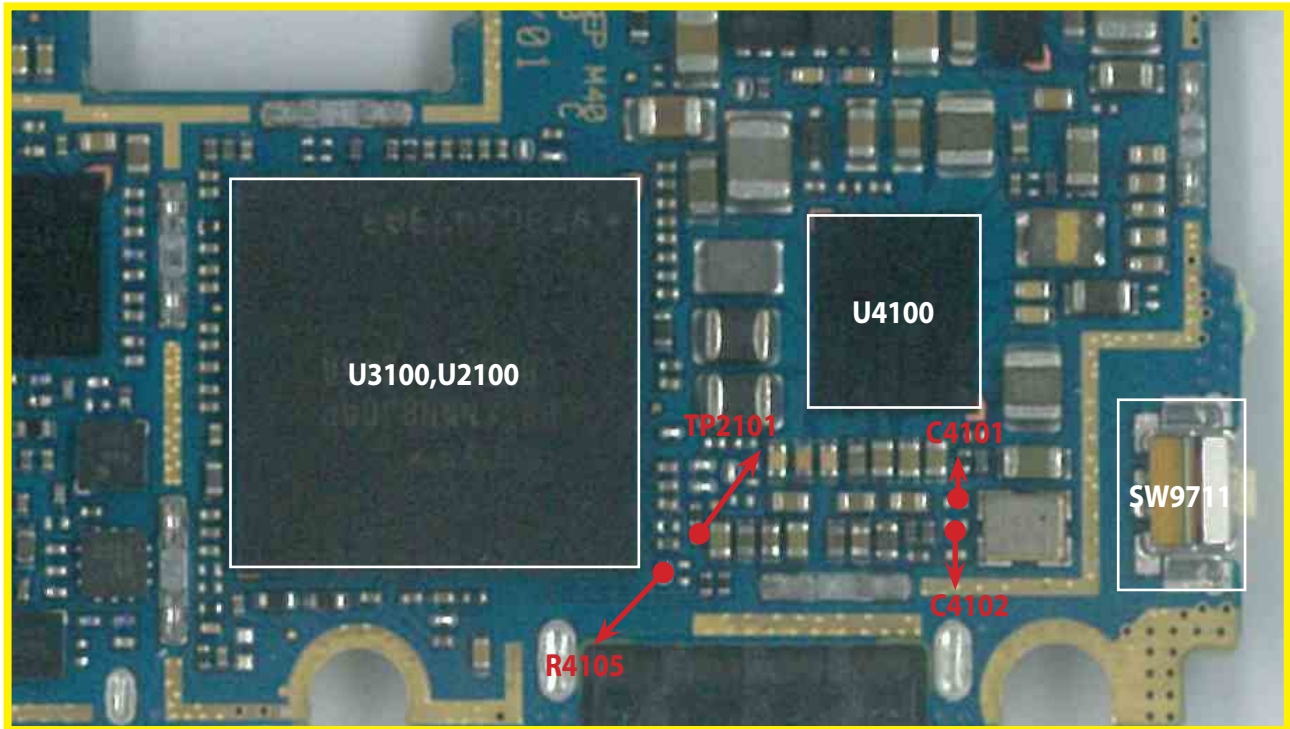


Power ON Troubleshooting (MSM8926)

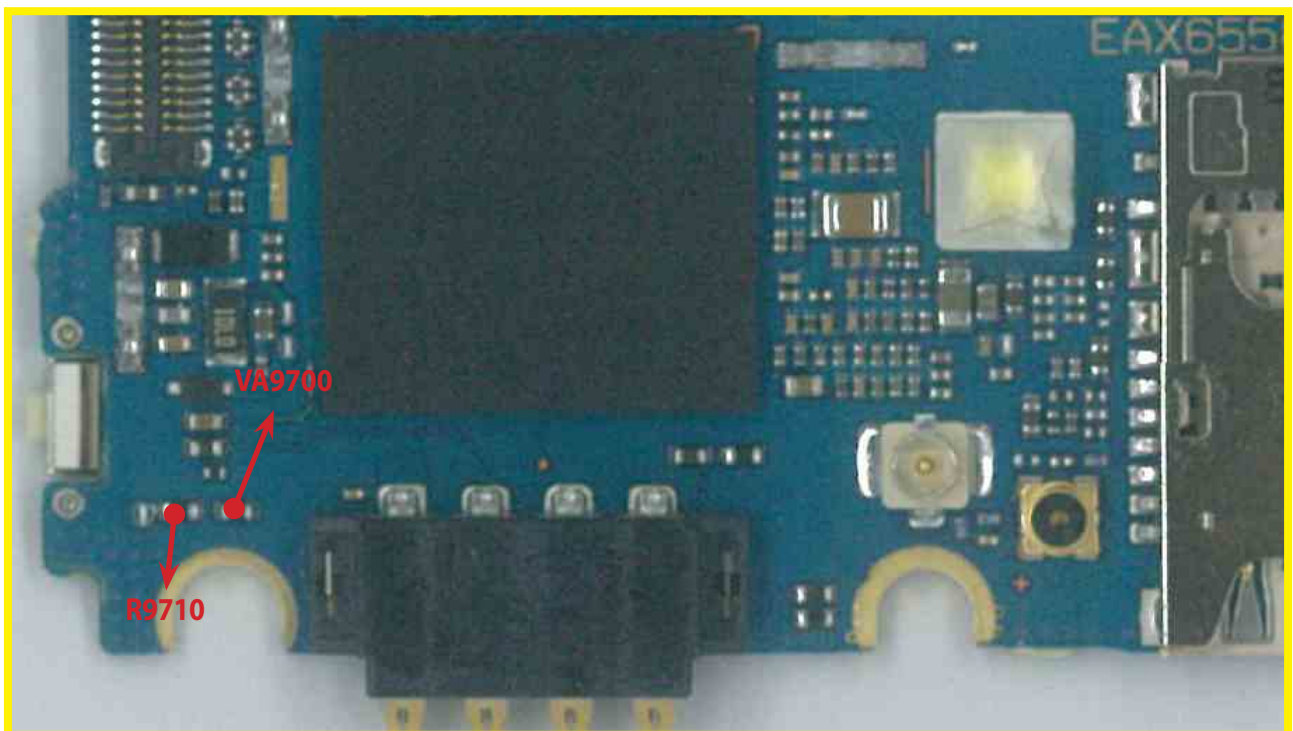


Power ON Troubleshooting (MSM8926)

3. TROUBLE SHOOTING

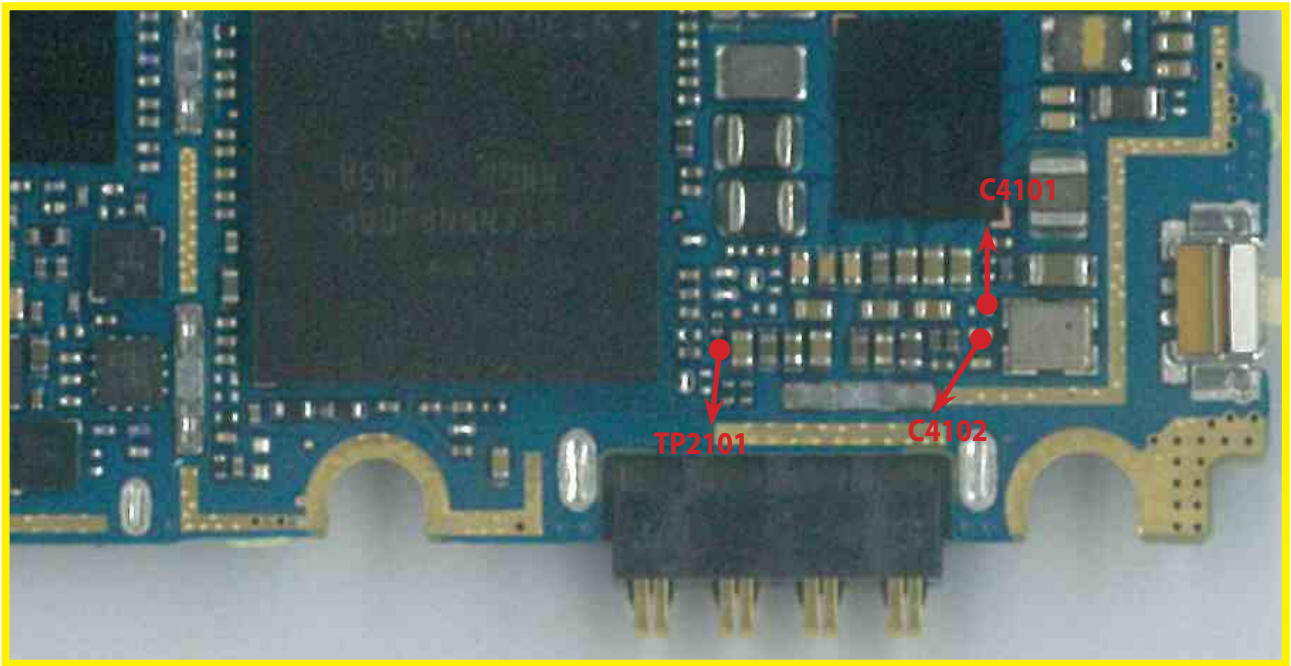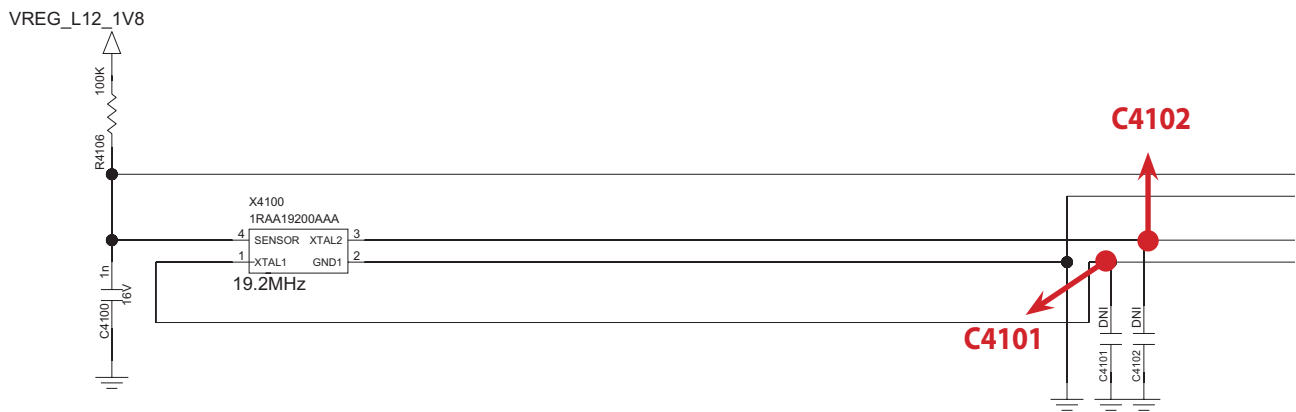

<Main Top>

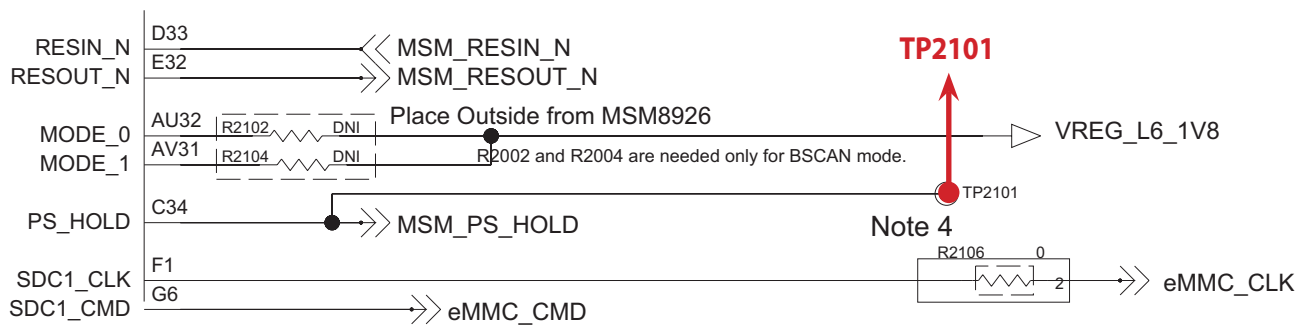

3.18 Charging Troubleshooting


LS740 uses PM8926 Internal Charge IC and External parallel OVP FET for charging control. The PM8926 circuit includes the charging P-ch MOSFET, detects the VDD and VBAT voltages, and its control driver. The PM8926 charging current is set around 1200mA, with External parallel OVP FET

Charging Procedure



- Supply the VBUS_USB_IN use a TA or u-USB cable
- PM8926 control the charging current
- Charging current flows into the main battery

Troubleshooting Check Point



- Connection of the TA or u-USB cable
- Charging current path
- Main battery

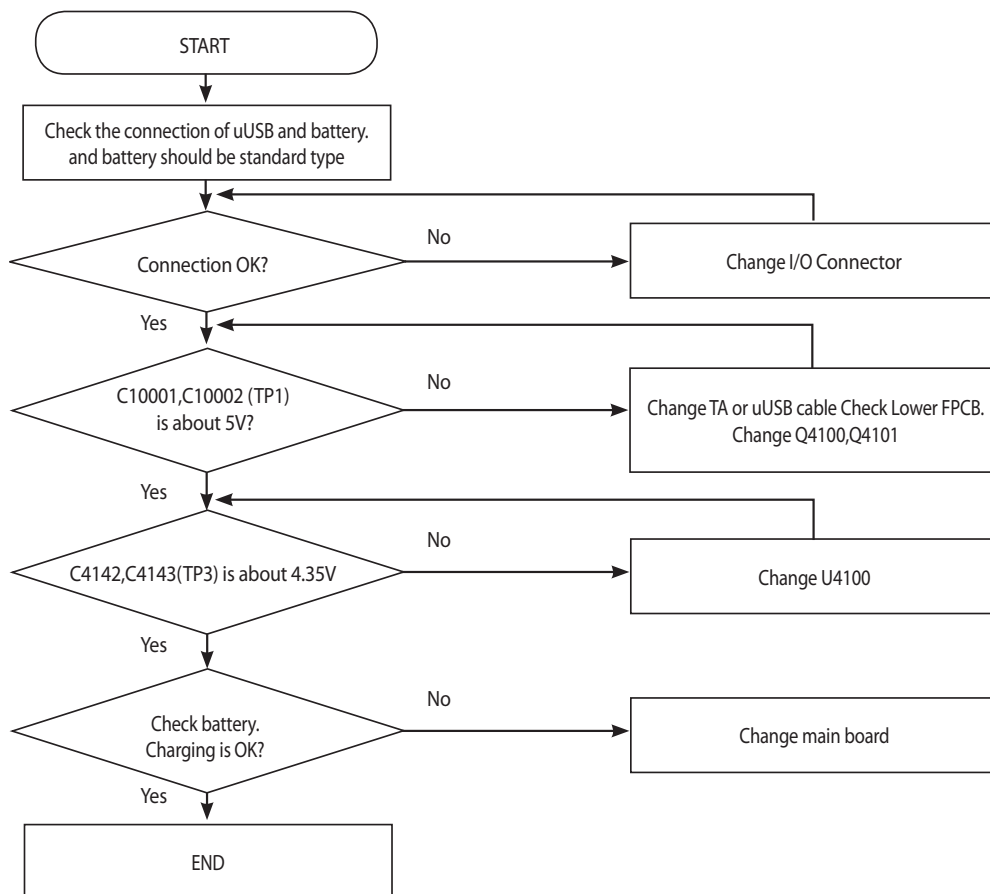

3. TROUBLE SHOOTING

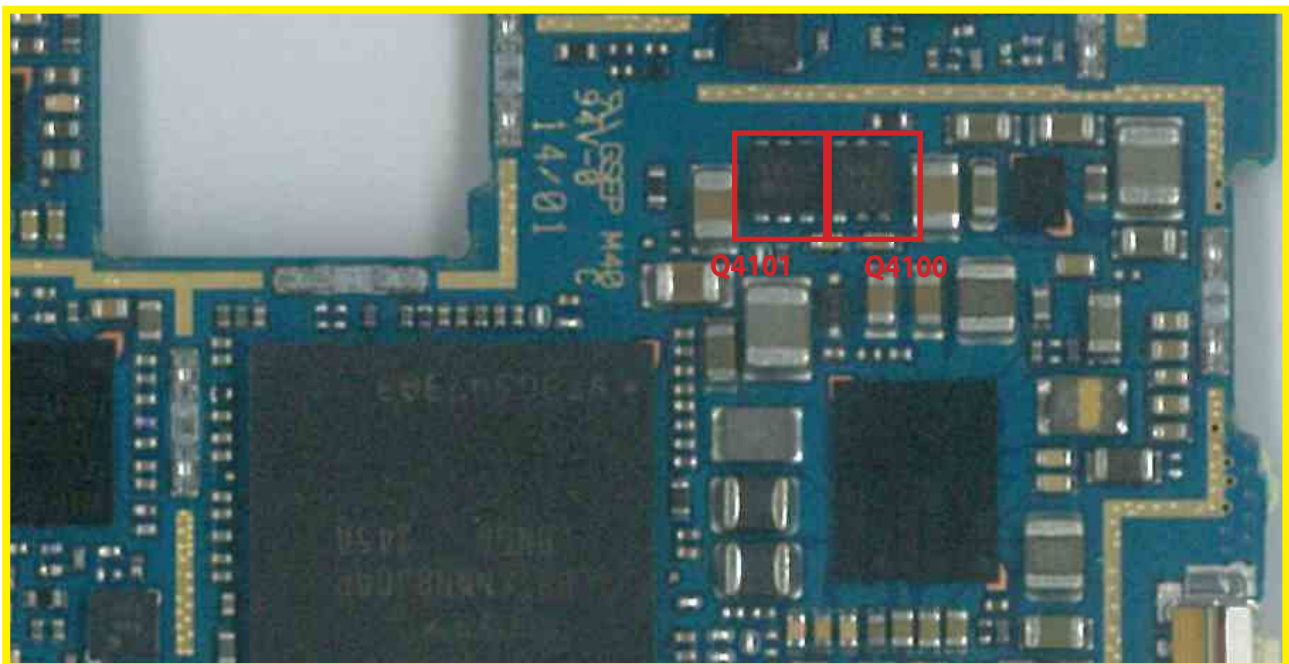
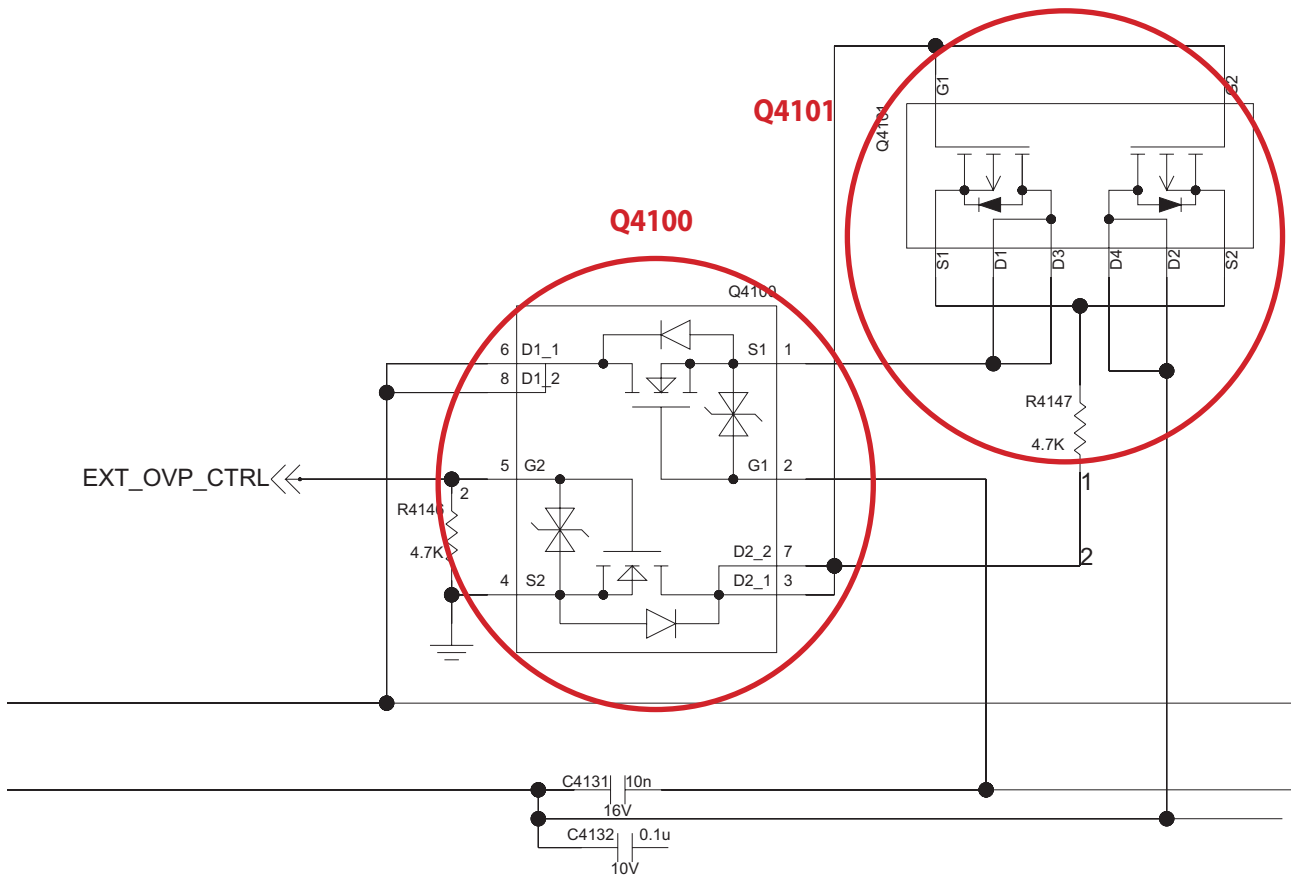


<Main Top>

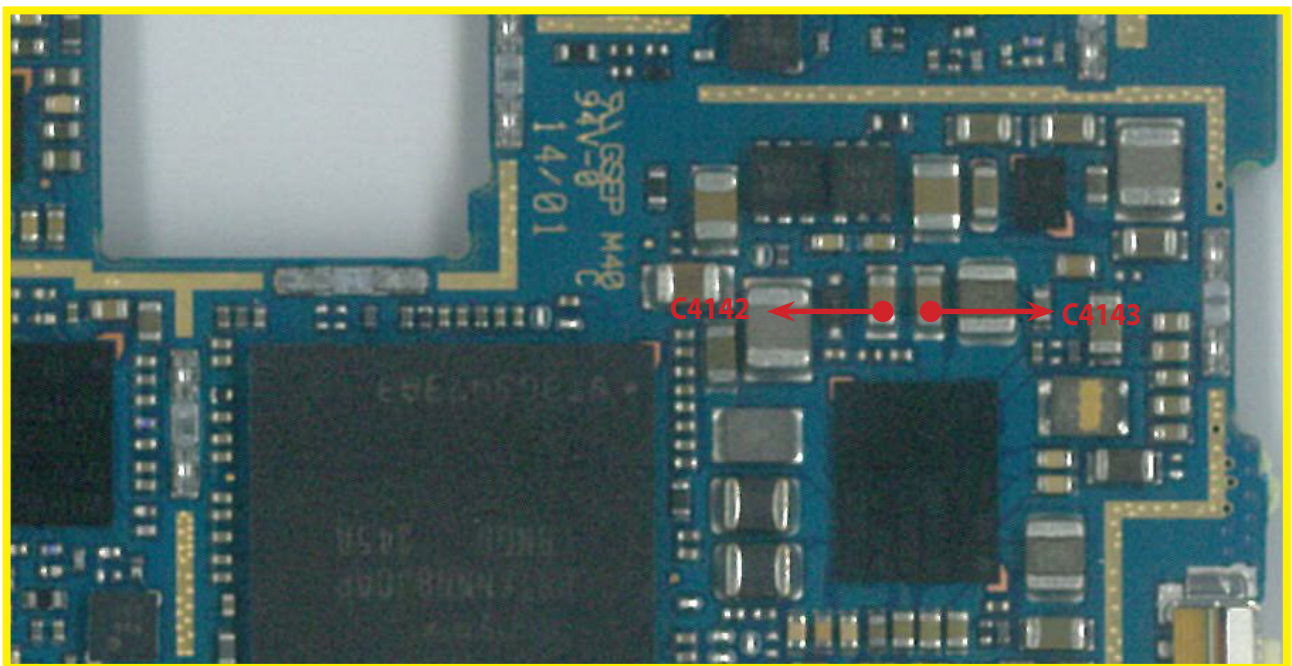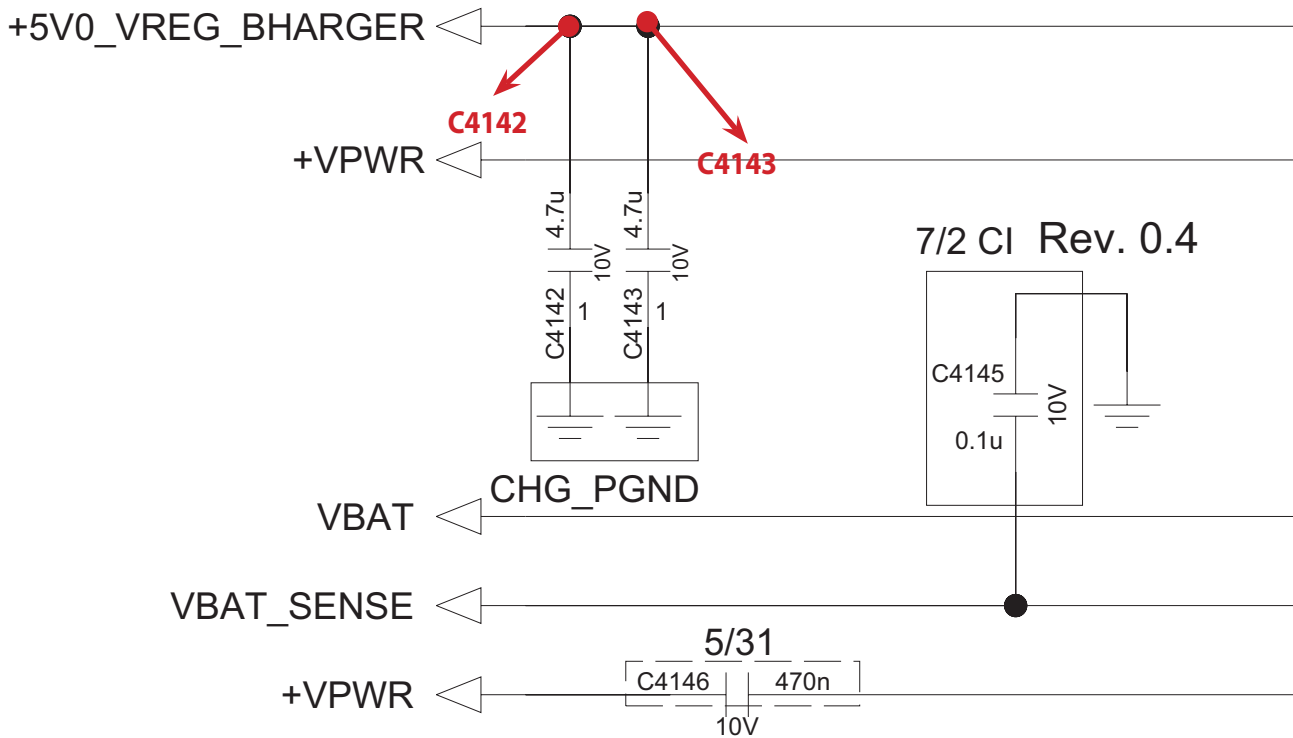


<Main Top>

3. TROUBLE SHOOTING

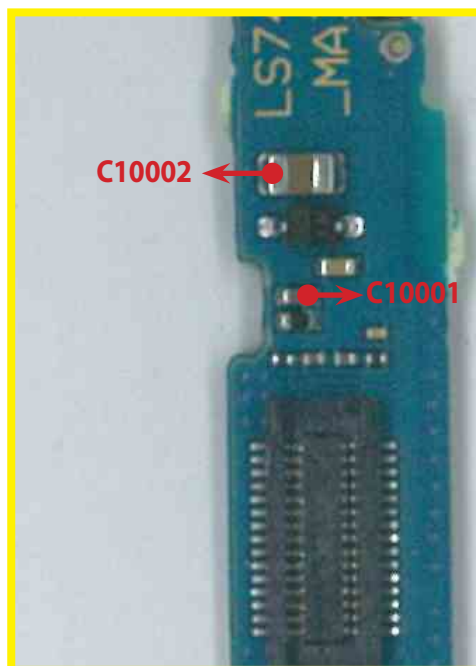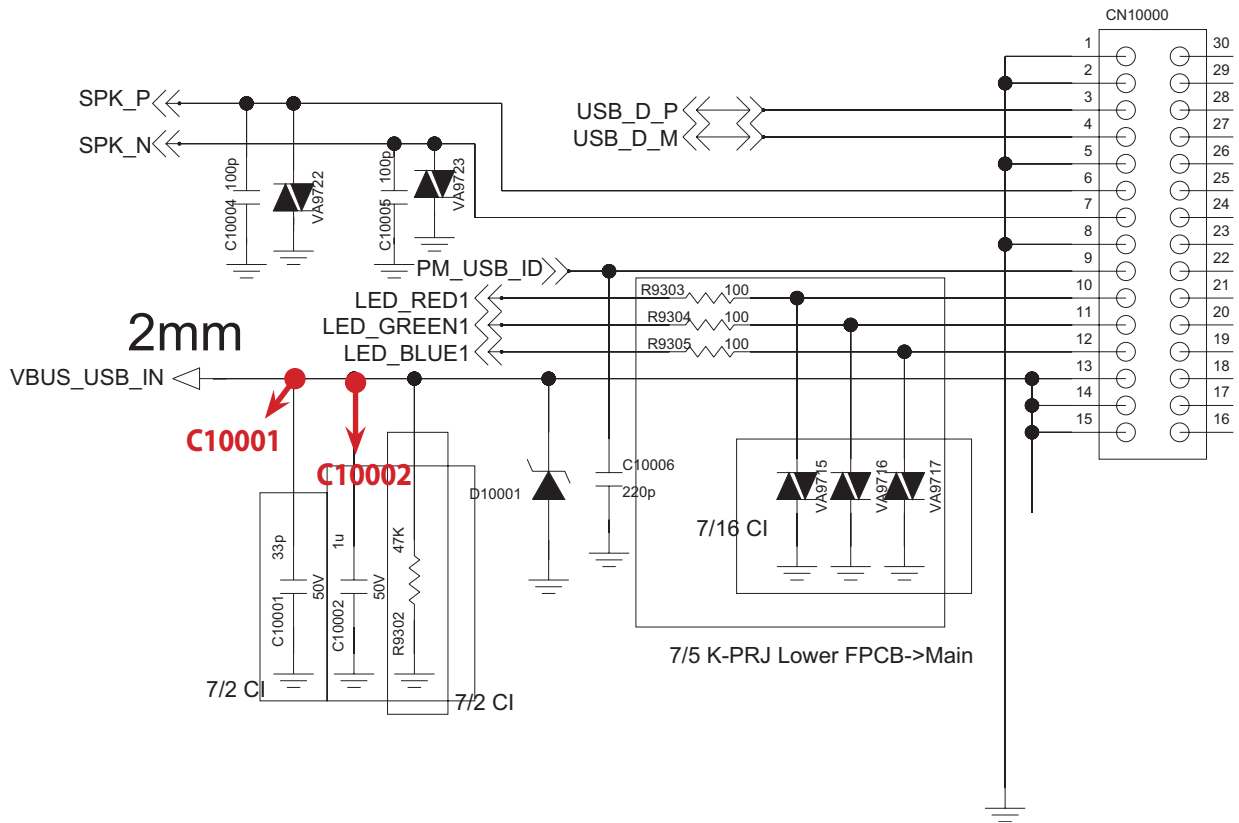


<Main Bot>

3. TROUBLE SHOOTING

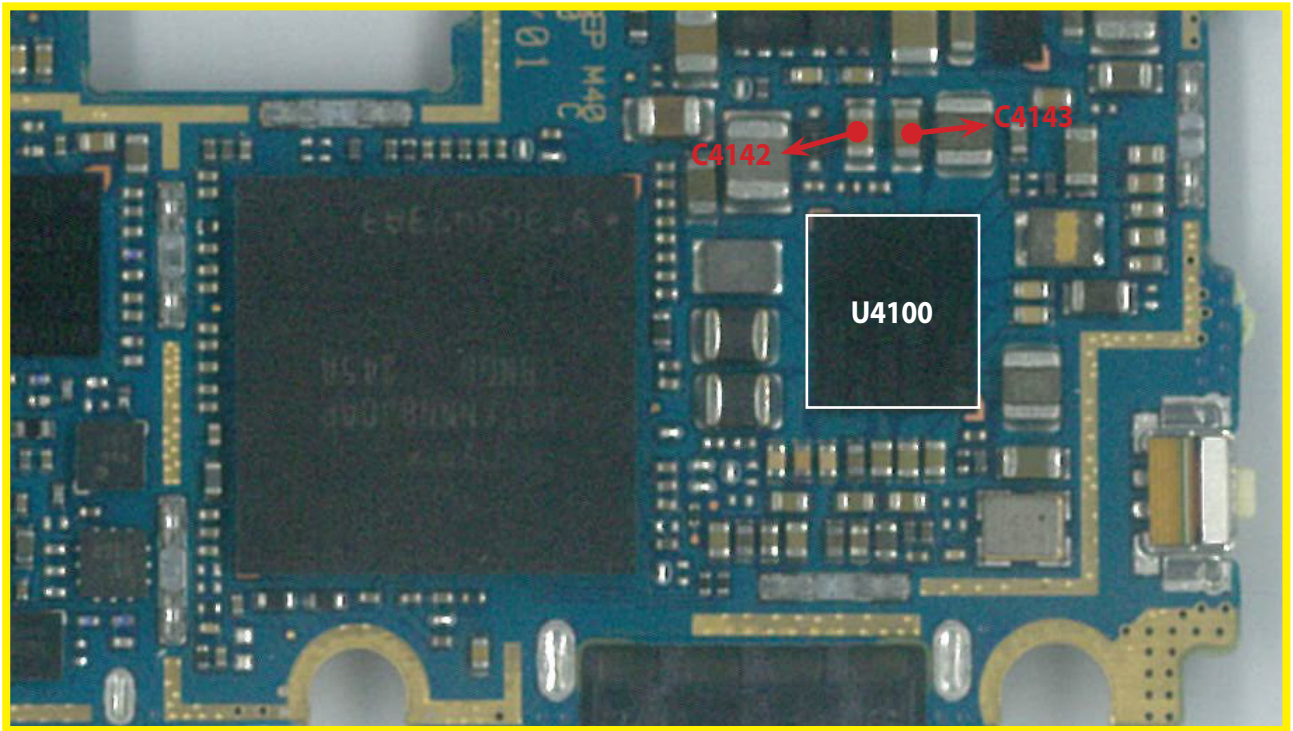

Charging Troubleshooting <Main Top>

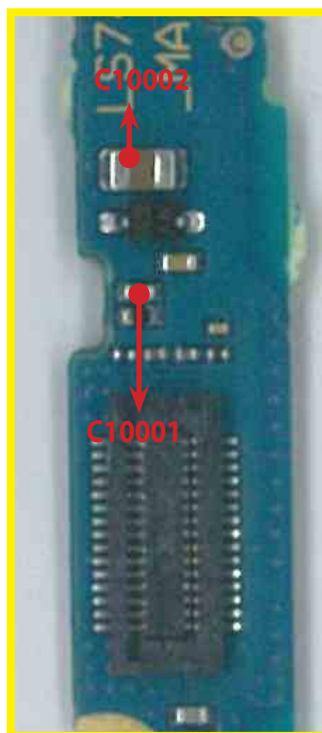


Charging Troubleshooting <Main Bot>


3.19 USB Trouble shooting

The sequence of USB connection:



USB cable is plugged into LGLS740 and host device USB_VCHG goes to 5V USB_IO_P goes to 3.05V USB_DATA is triggered USB working Block Diagram of USB connection is shown below

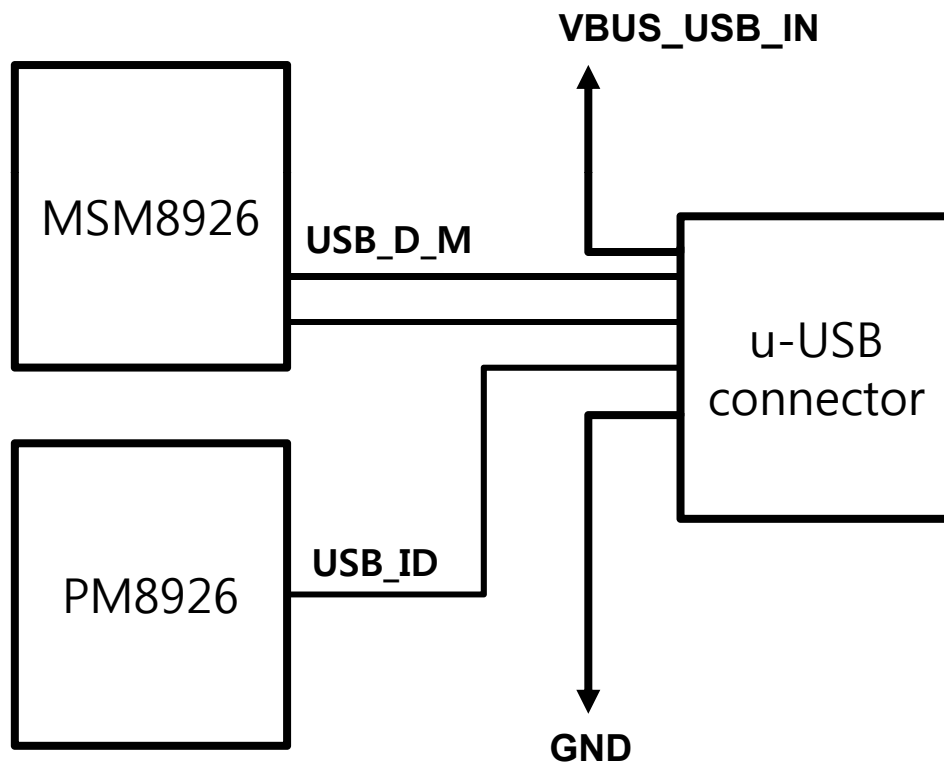

3. TROUBLE SHOOTING


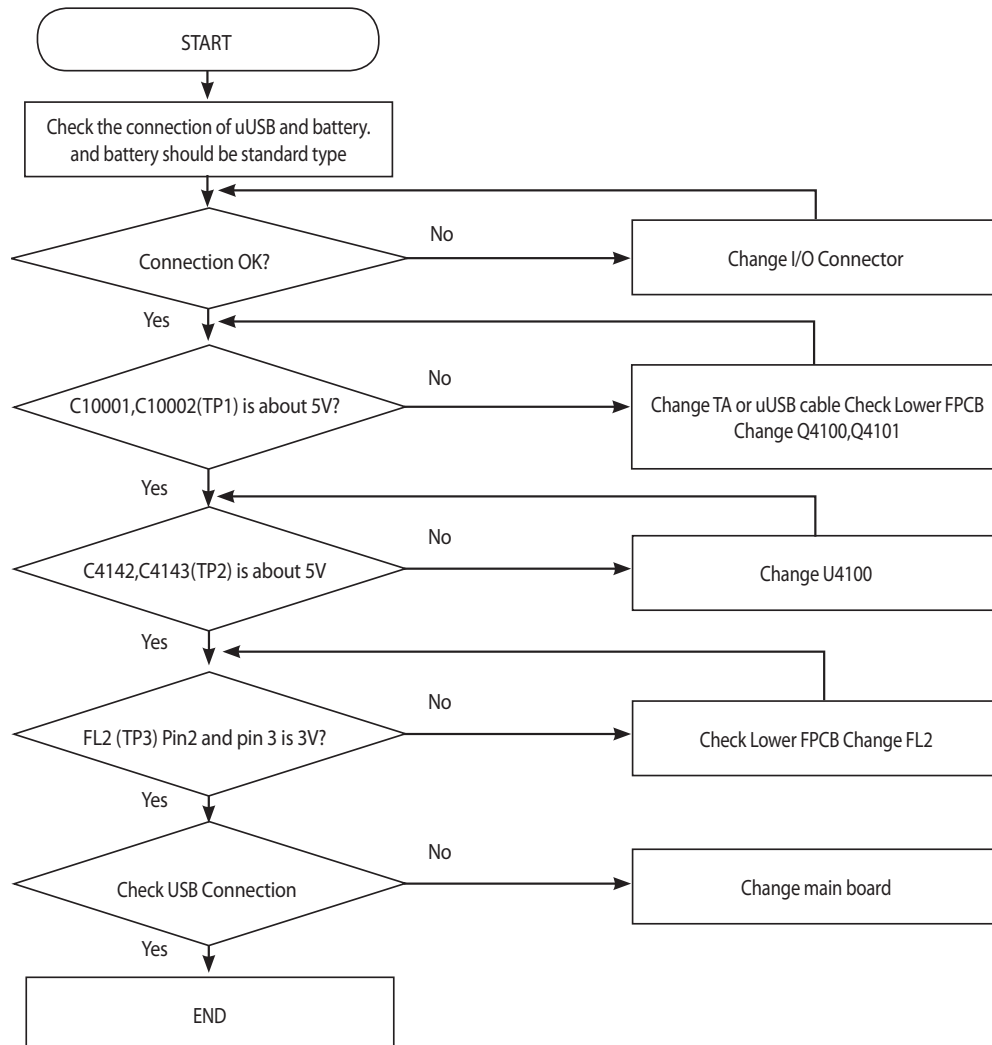


3. TROUBLE SHOOTING

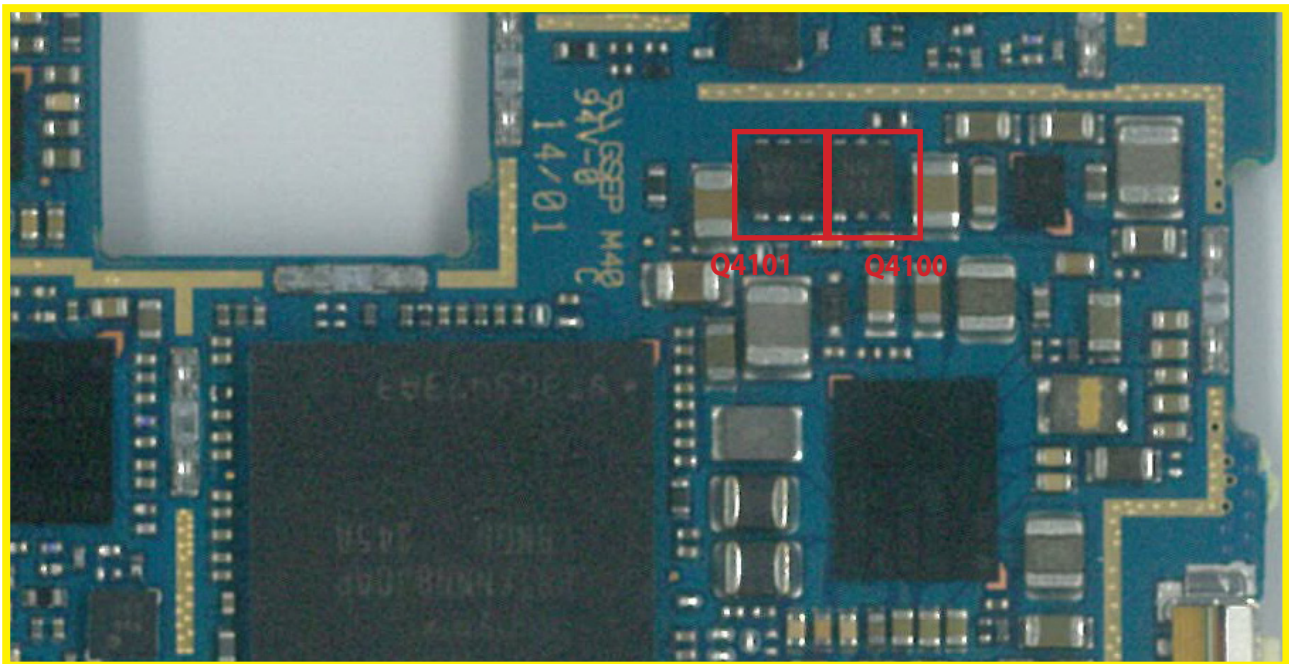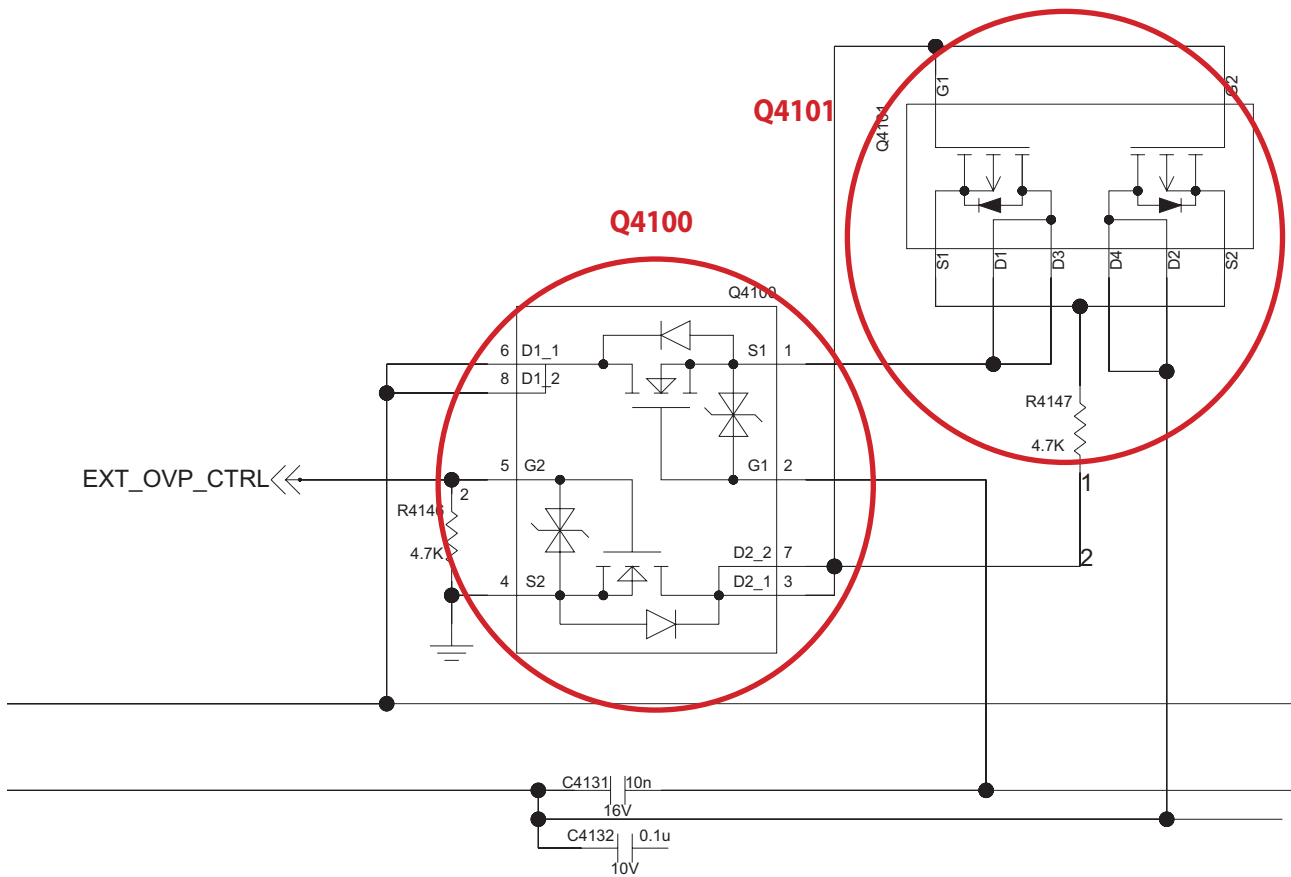



<Main Top>

3. TROUBLE SHOOTING

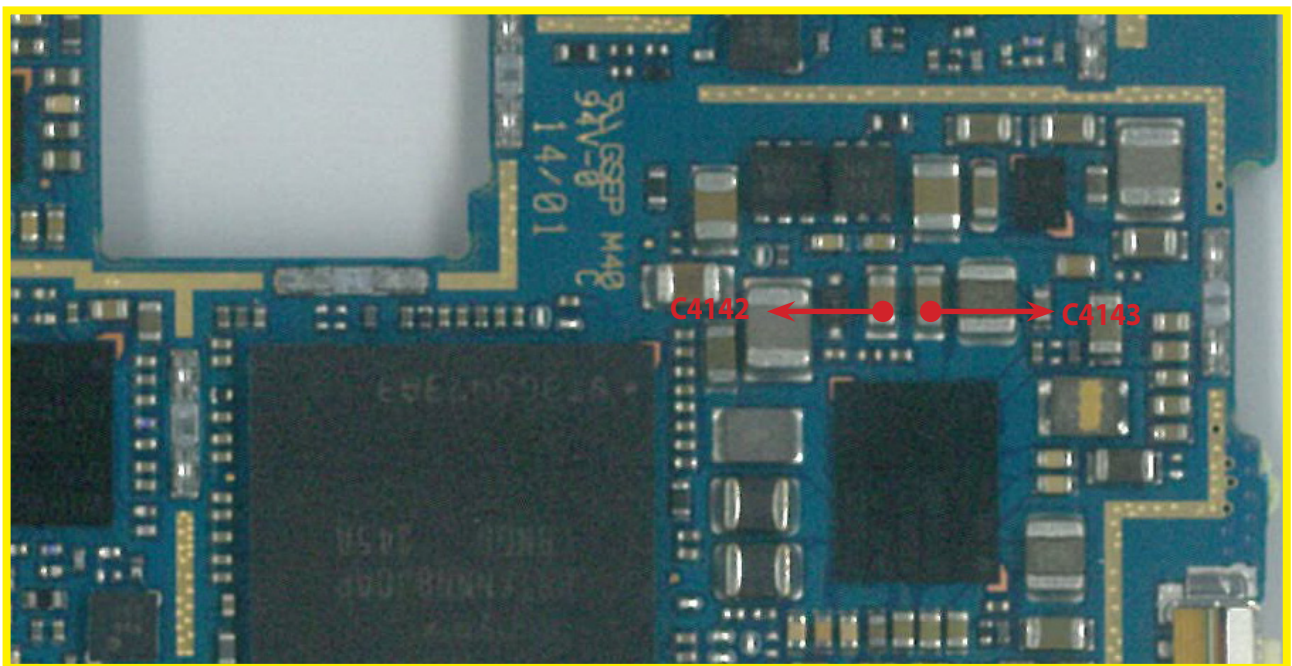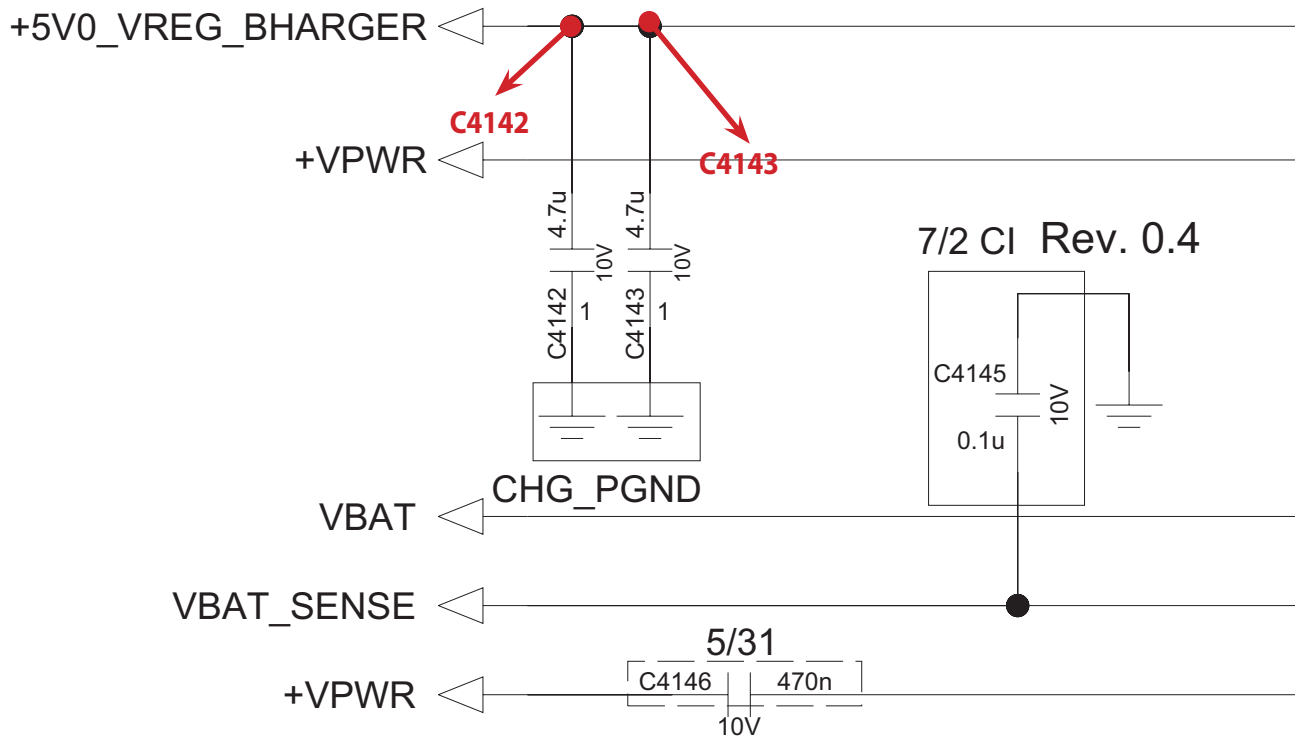


<Main Top>

3. TROUBLE SHOOTING

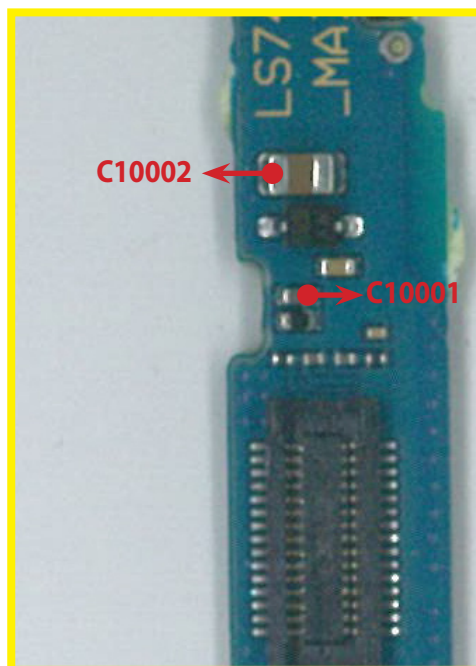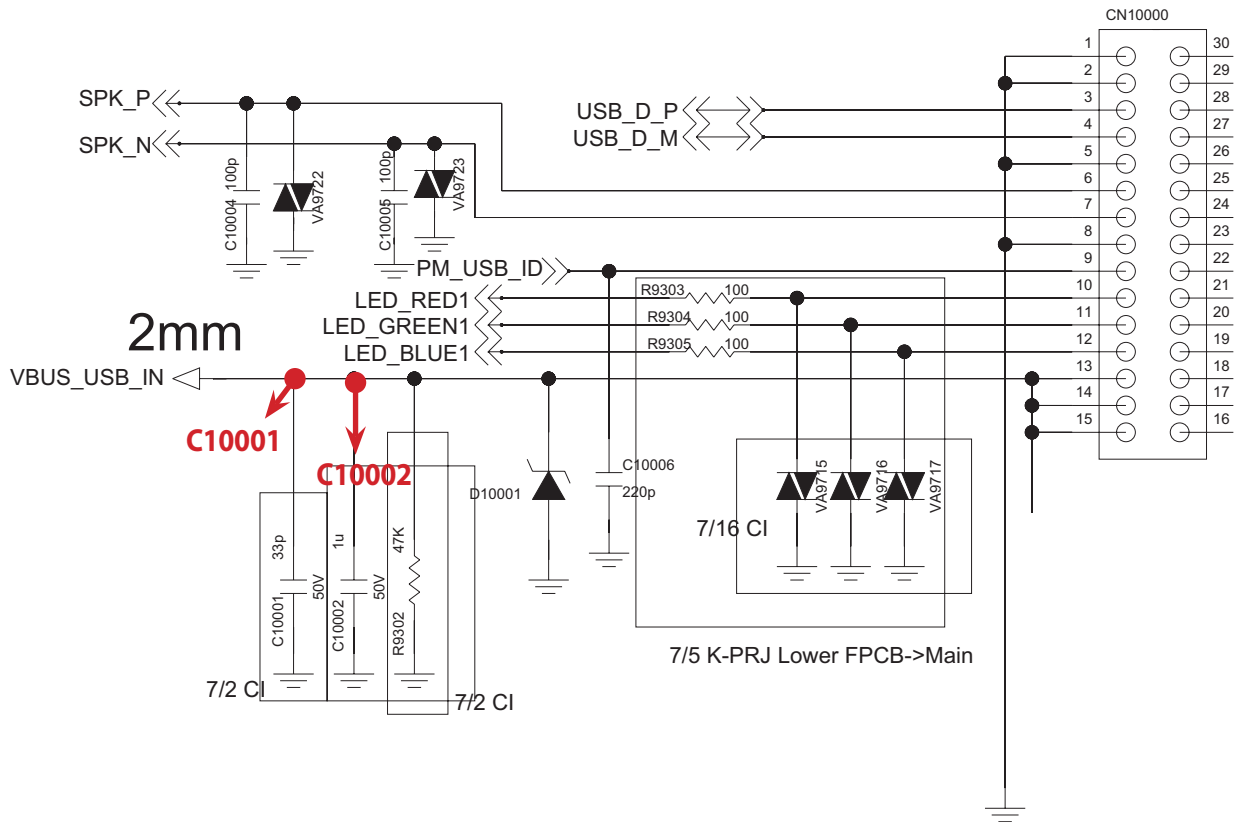


<Main Bot>

3. TROUBLE SHOOTING

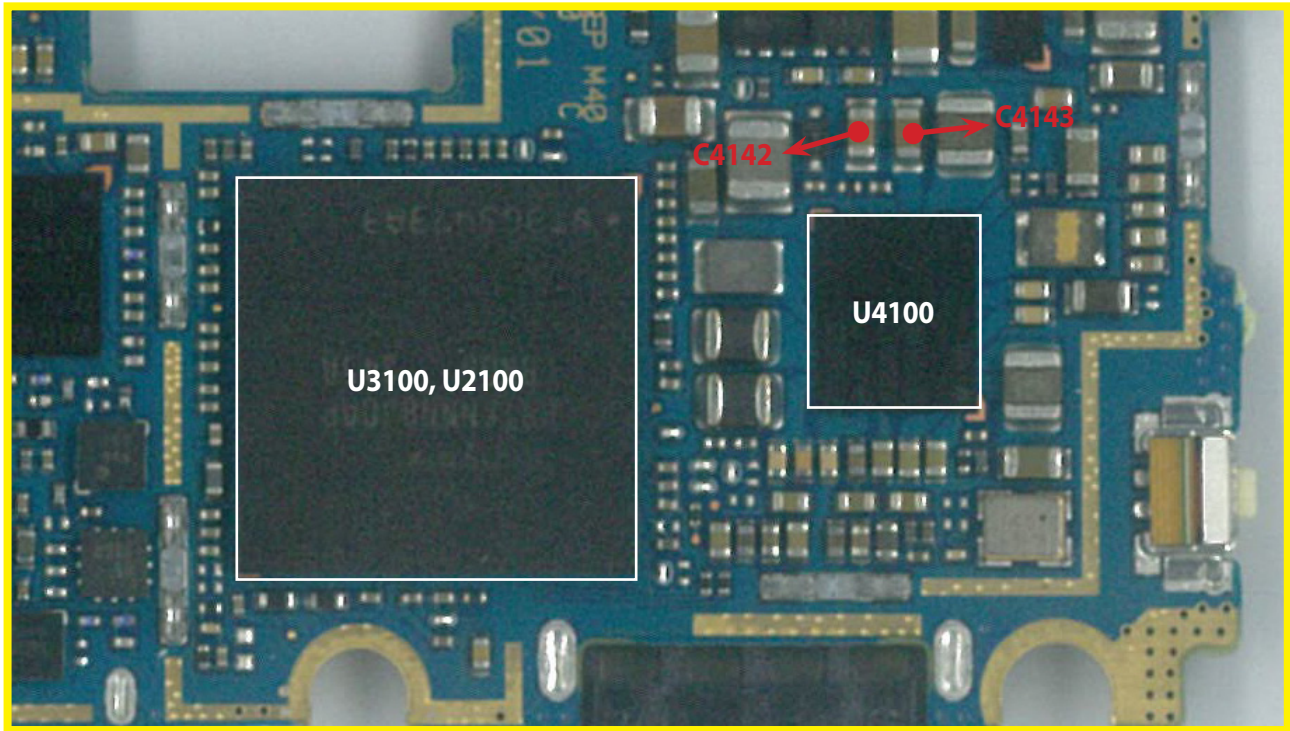


<Main Top>

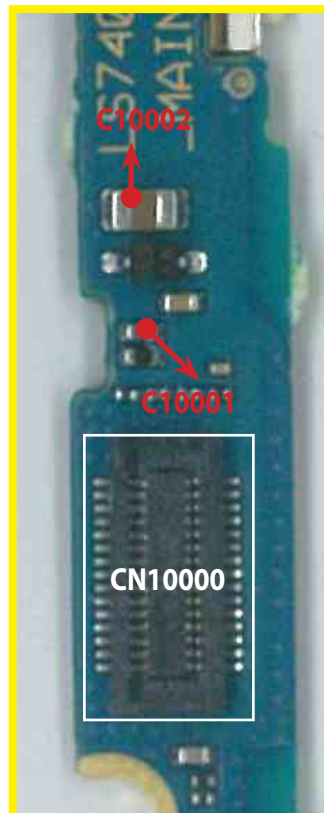


<Main Bot>

3. TROUBLE SHOOTING

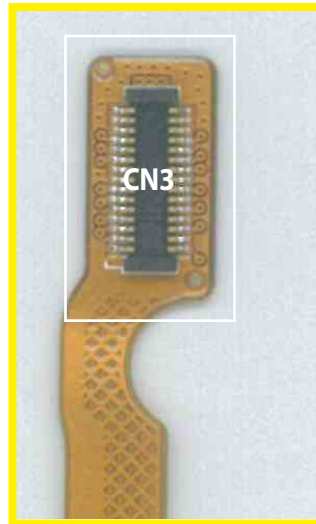


<FPCB Top>

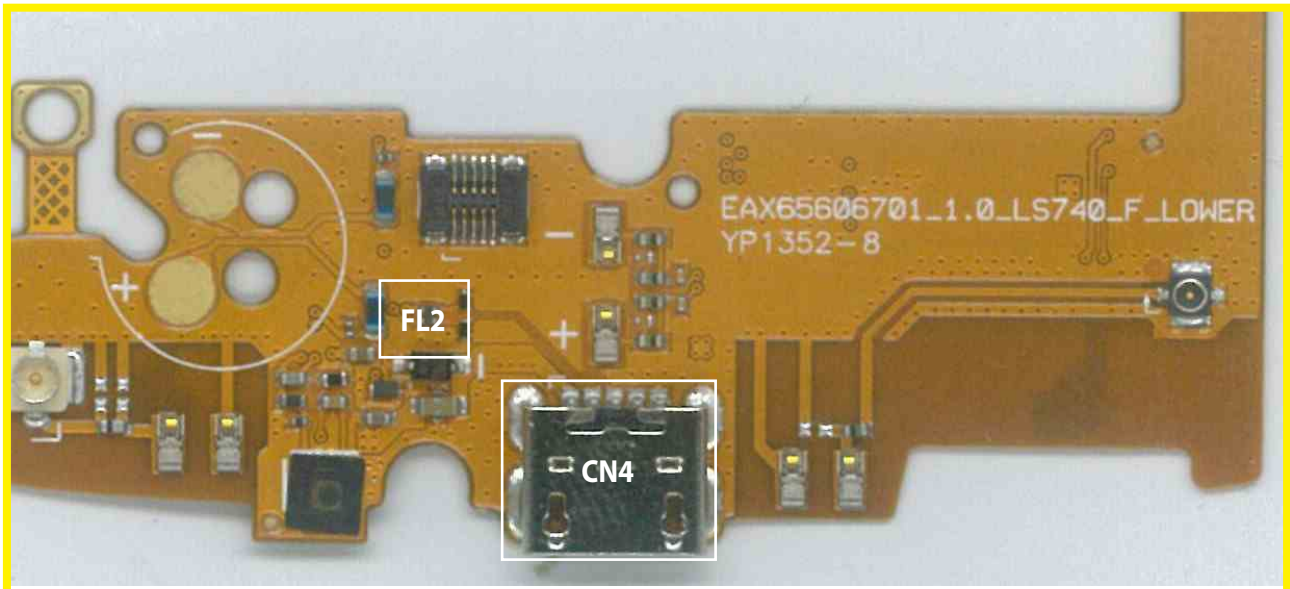



<FPCB Bot>

3.20 Touch Trouble Shooting

Touch control signals are generated by MSM8926

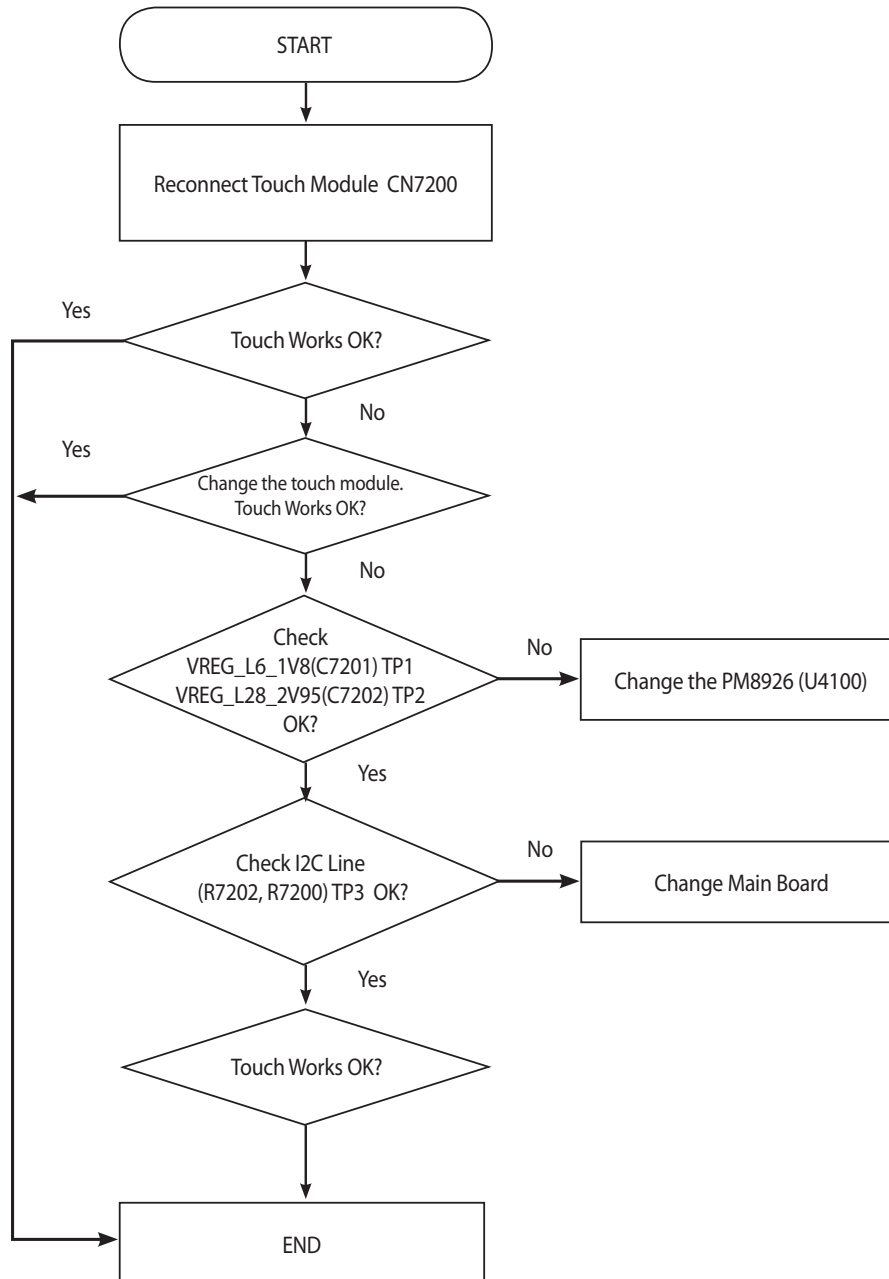


3. TROUBLE SHOOTING

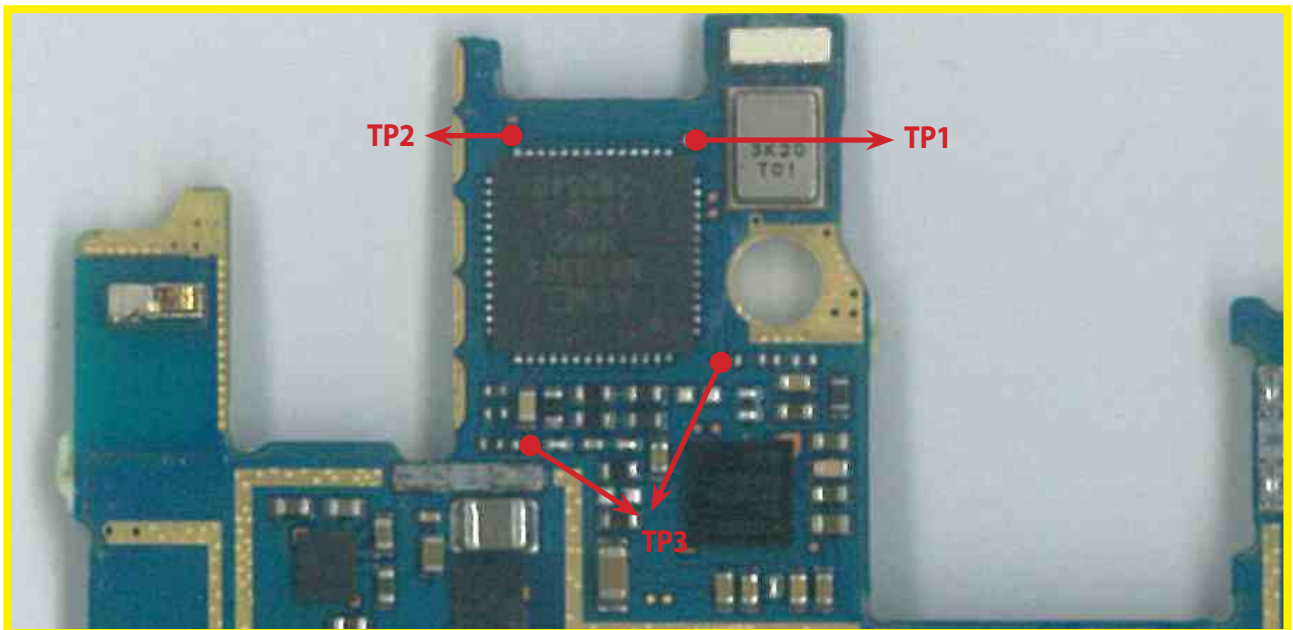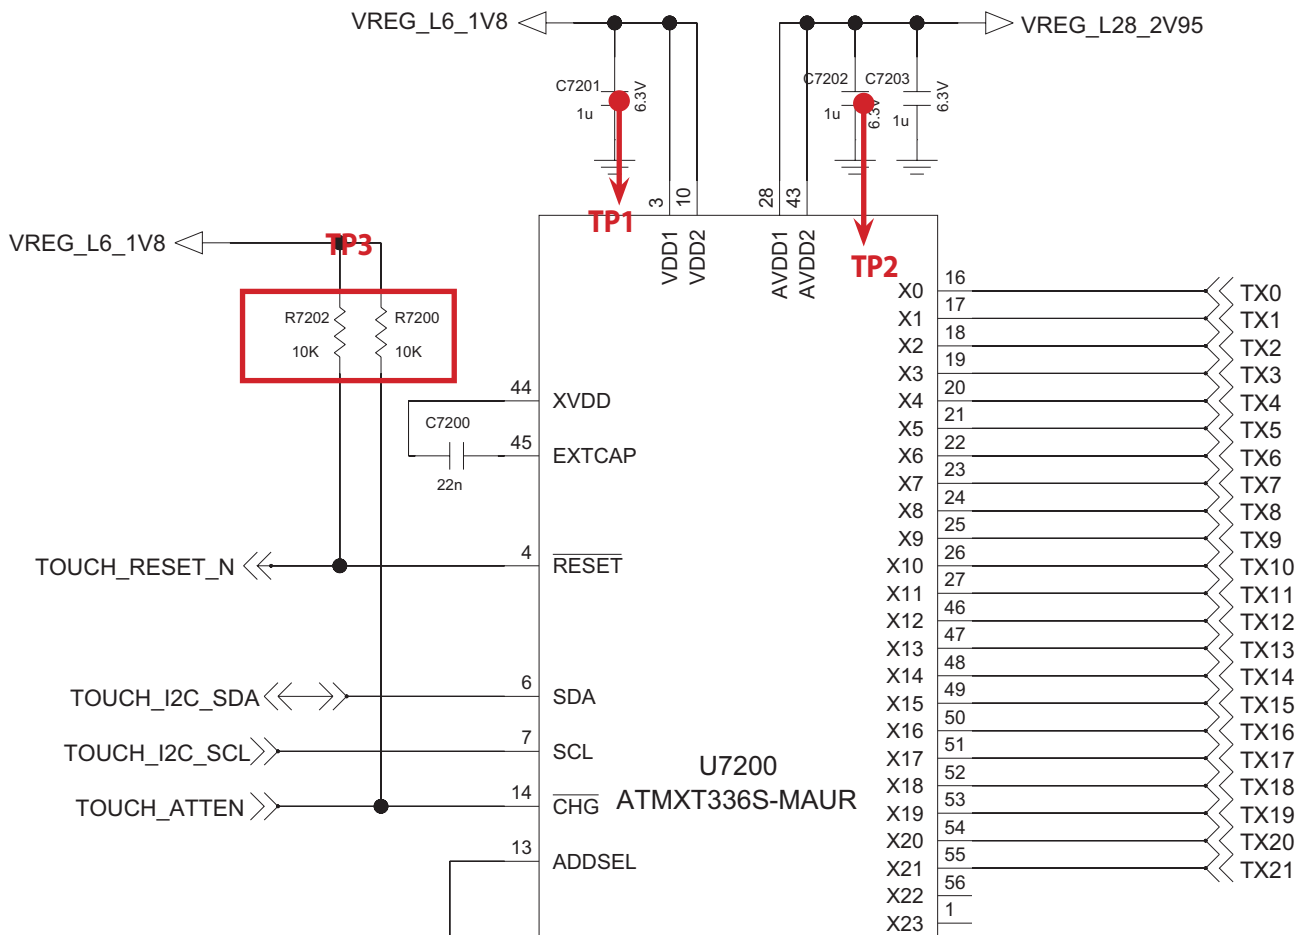



<Main Top>

3.21 Vibrator Troubleshooting

Check out the setting menu on the phone. If not, check Test points shown on the pictures.

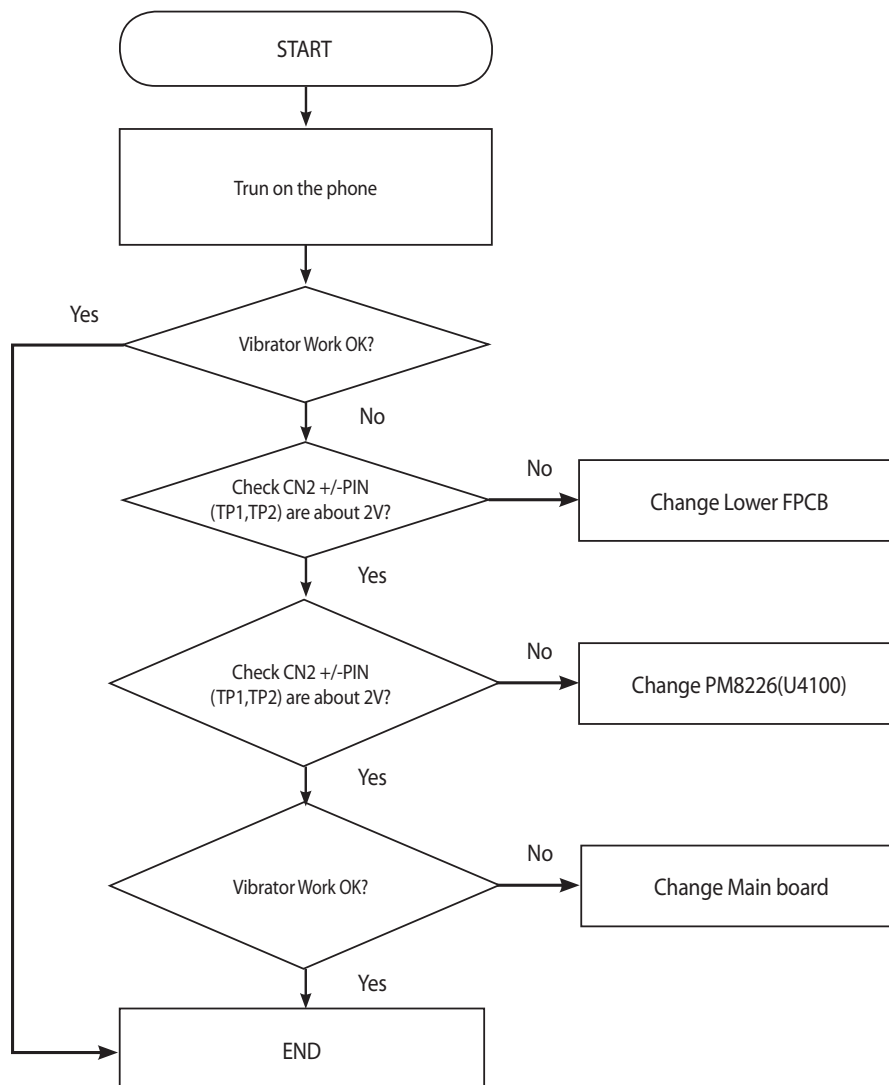


3. TROUBLE SHOOTING

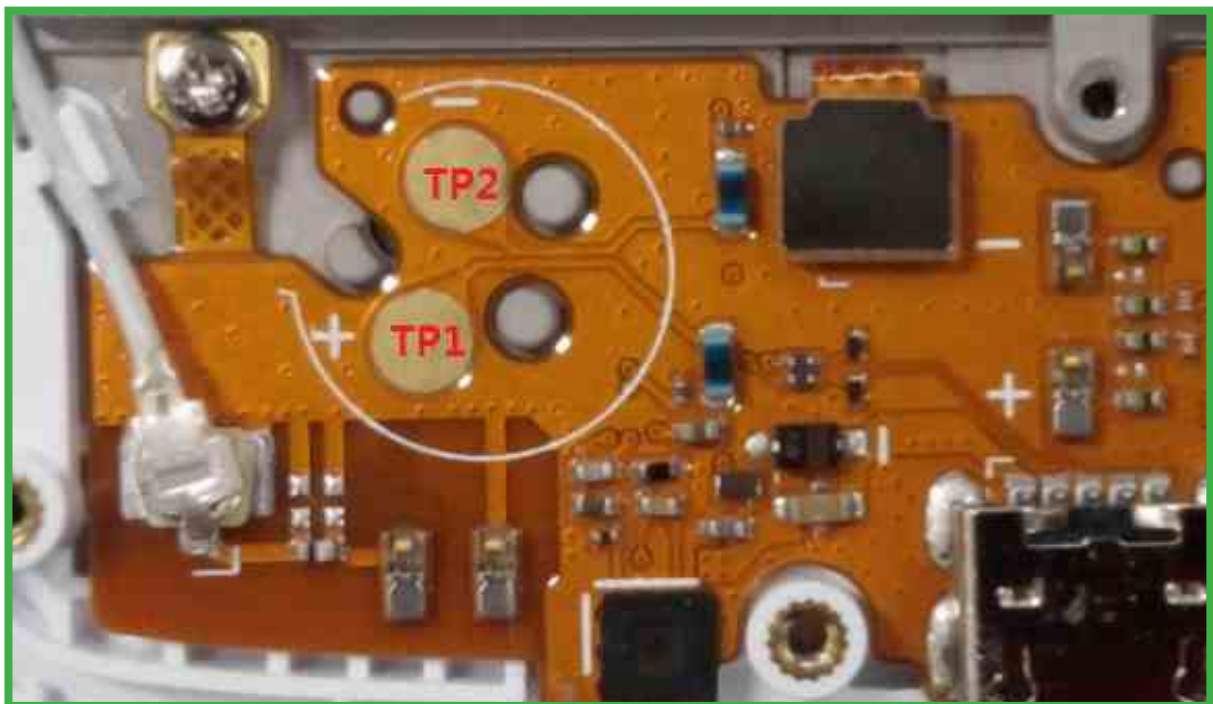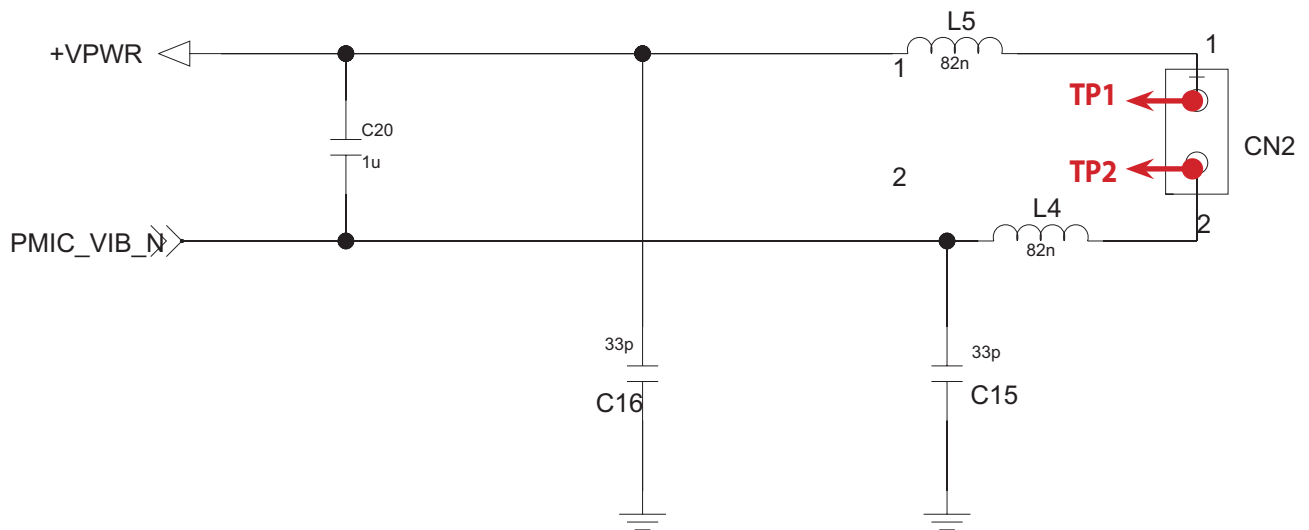



< Lower FPCB >

3.22 Compass & Accelerometer Sensor troubleshooting

When the Compass & Accelerometer sensor does not work, the problem is in chip. If the sensor IC is damaged, it will do not work even though power is supplied and MSM8926 controls normally. Therefore if the Compass & Accelerometer sensor is damaged, change the sensor IC or main board.

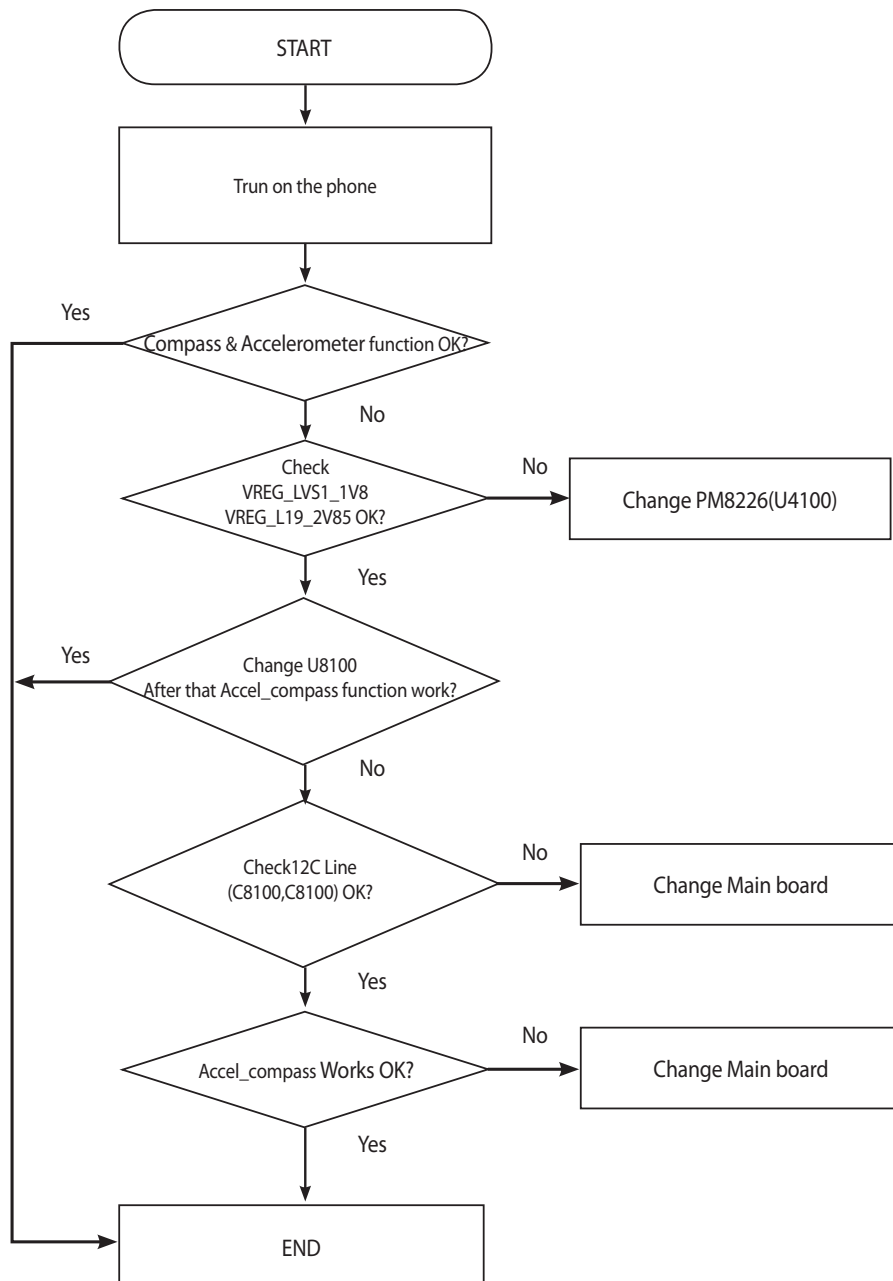

3. TROUBLE SHOOTING

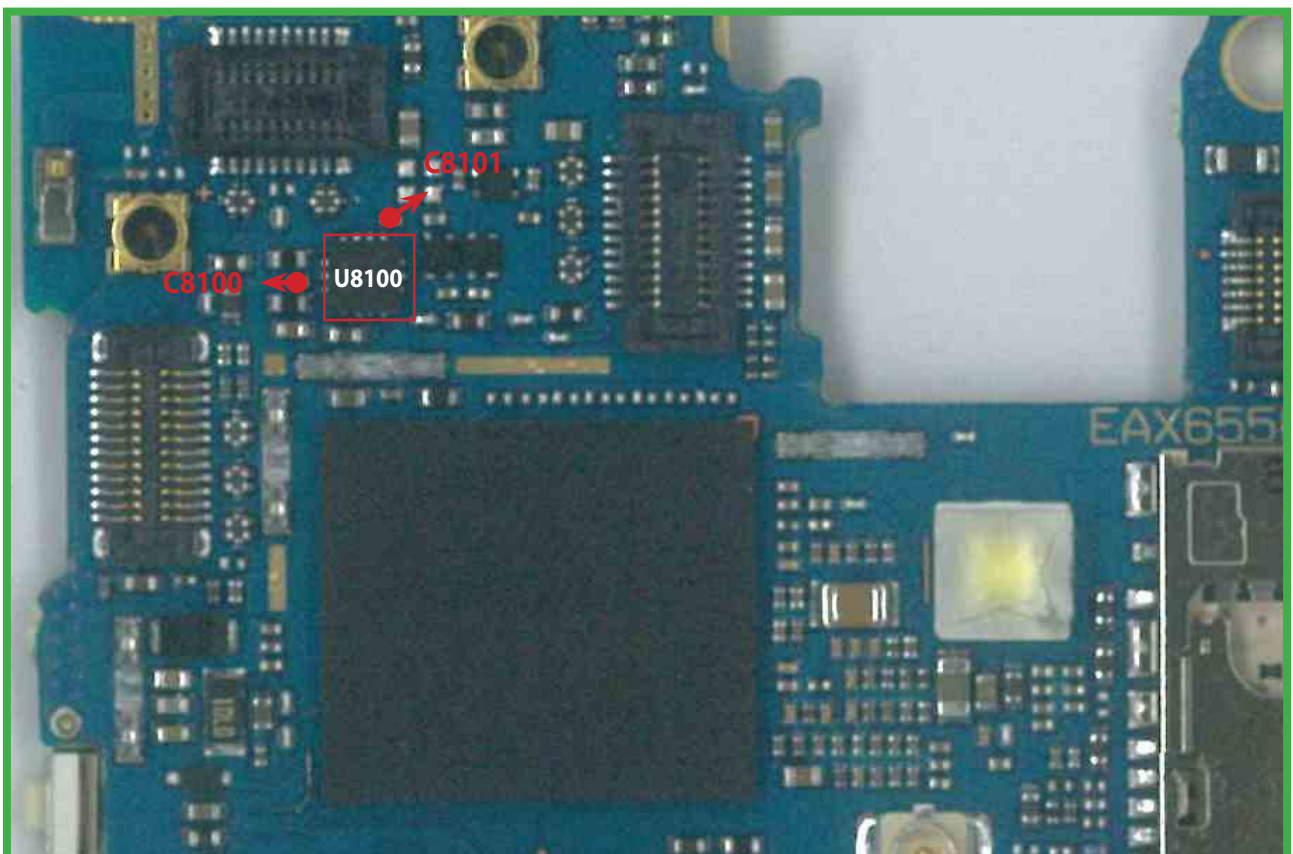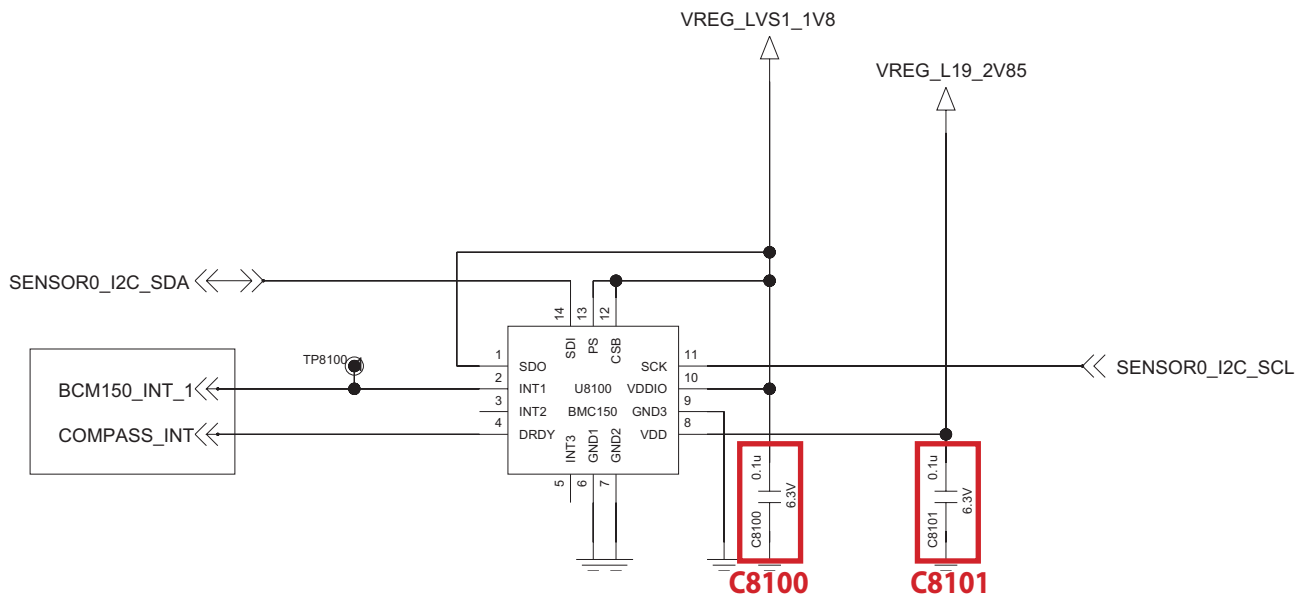



< Main Bot >

3.23 Proximity/Light Sensor on/off trouble

Proximity Sensor works as below:

Call Button click-> Phone number click -> Call connected -> Move objects in front of the sensor -> Control automatically the screen's on/off operation

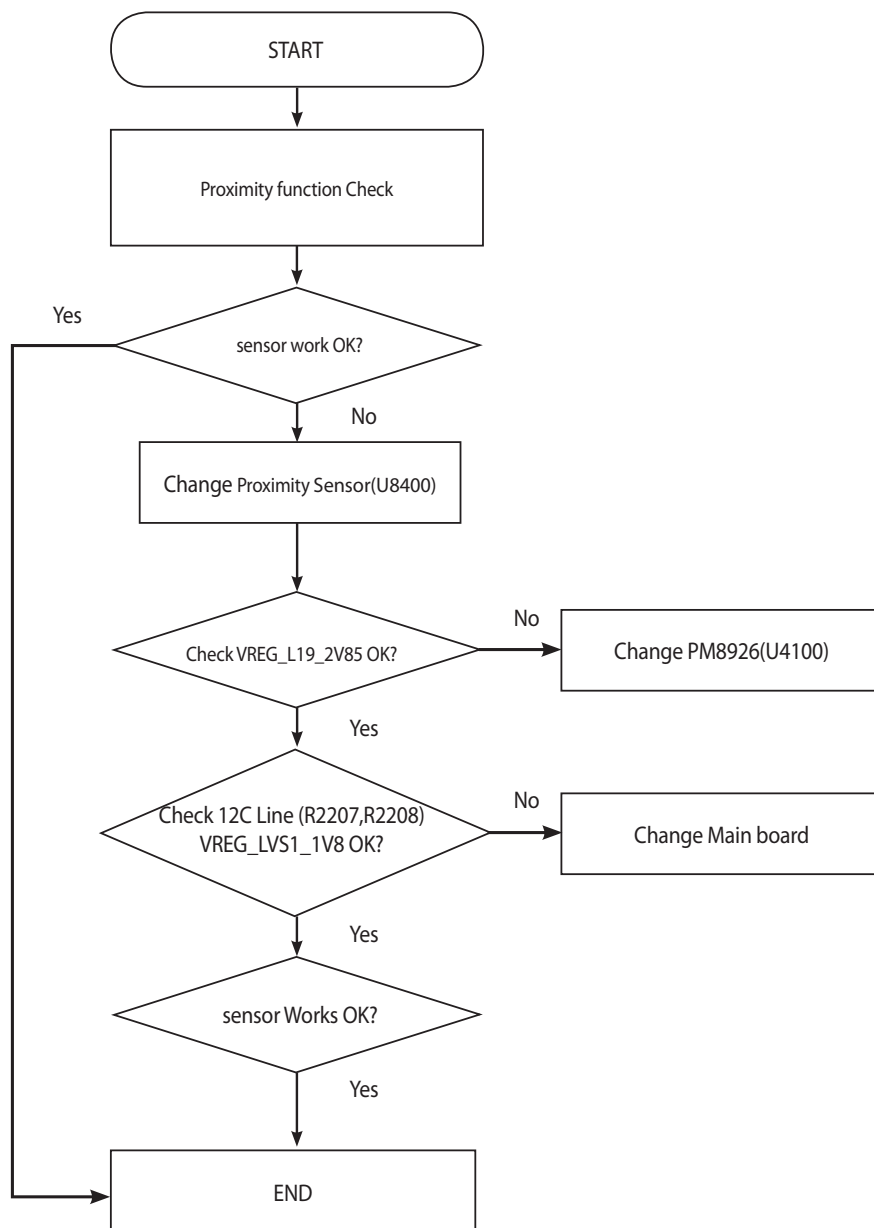


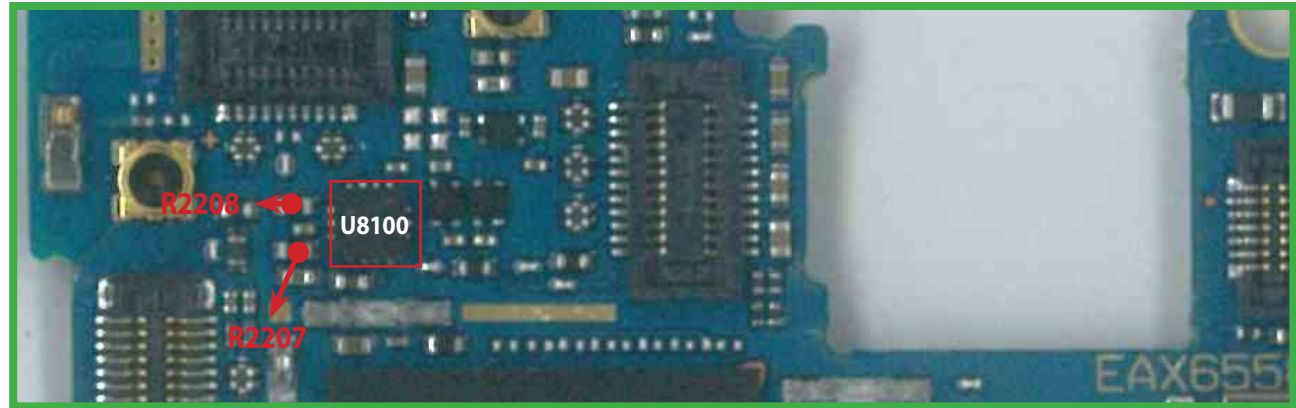


3.24 Hall IC Sensor troubleshooting

Hall IC Sensor works as below:

Quick Cover On or Magnet is attached on the screen (middle/left) -> small size of the screen displayed

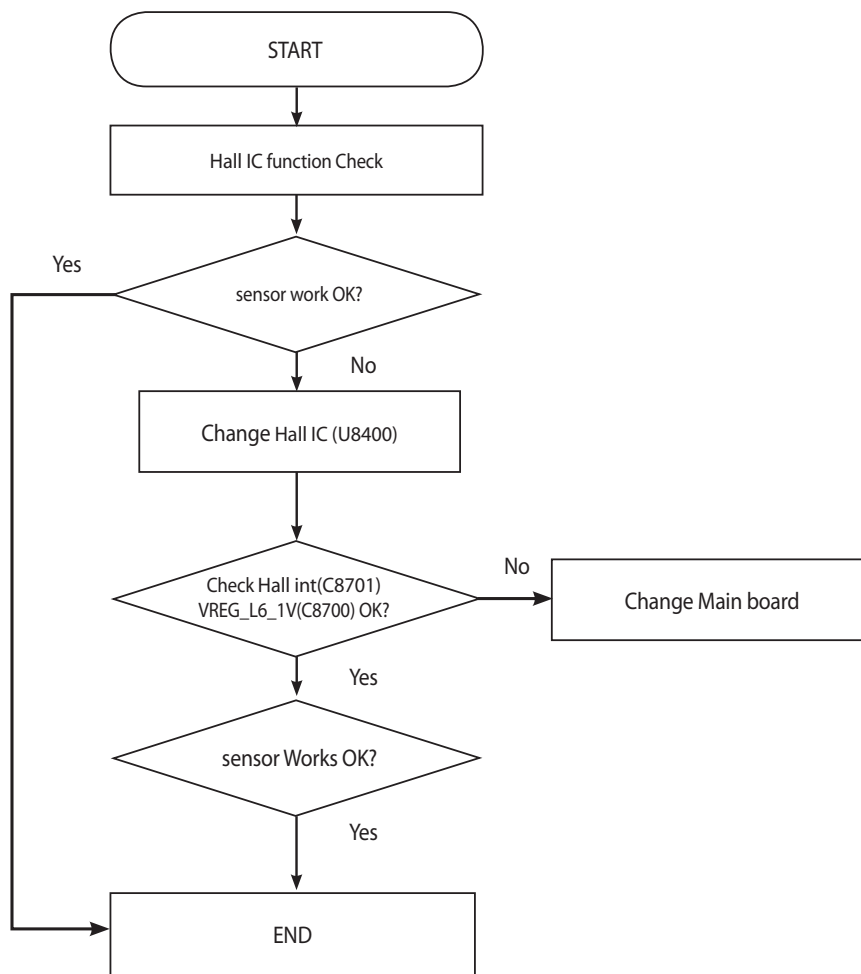


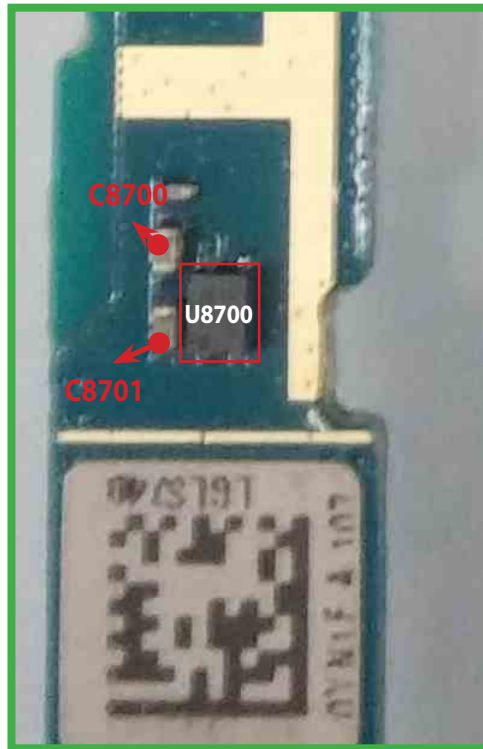


< Main Top >

3.25 IRRC Sensor troubleshooting


IRRC Sensor is a remote controller. If it does not work, the problem is in chip. So, Change irrc or main board.

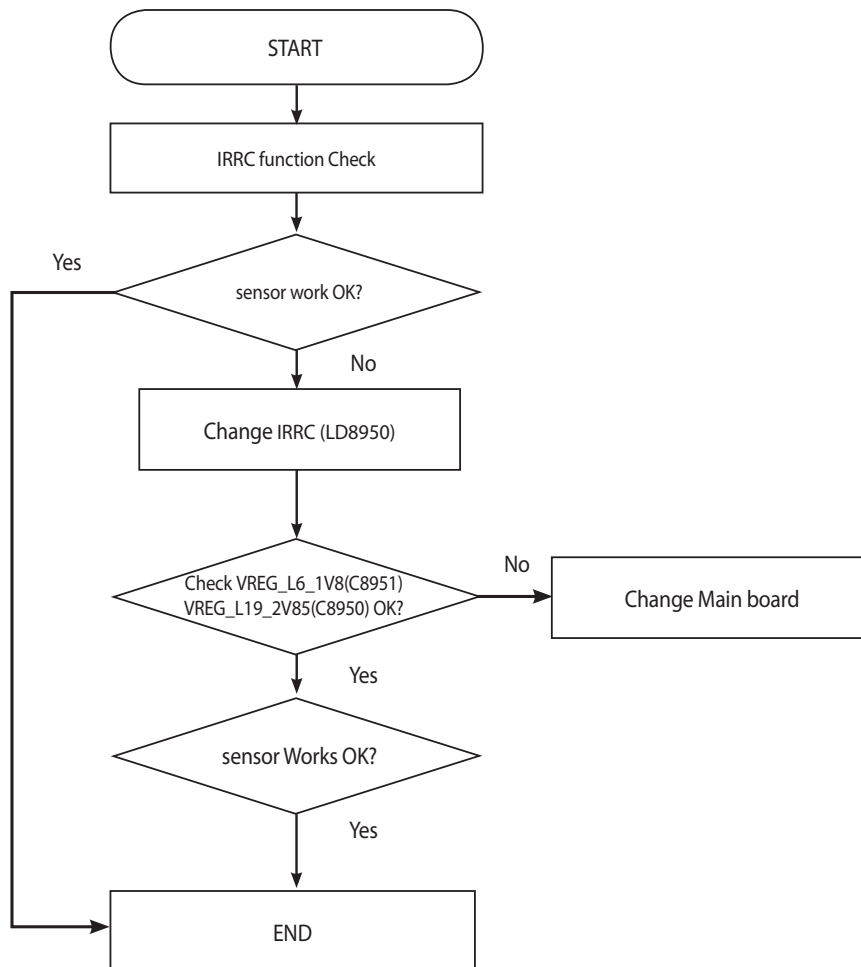

3. TROUBLE SHOOTING

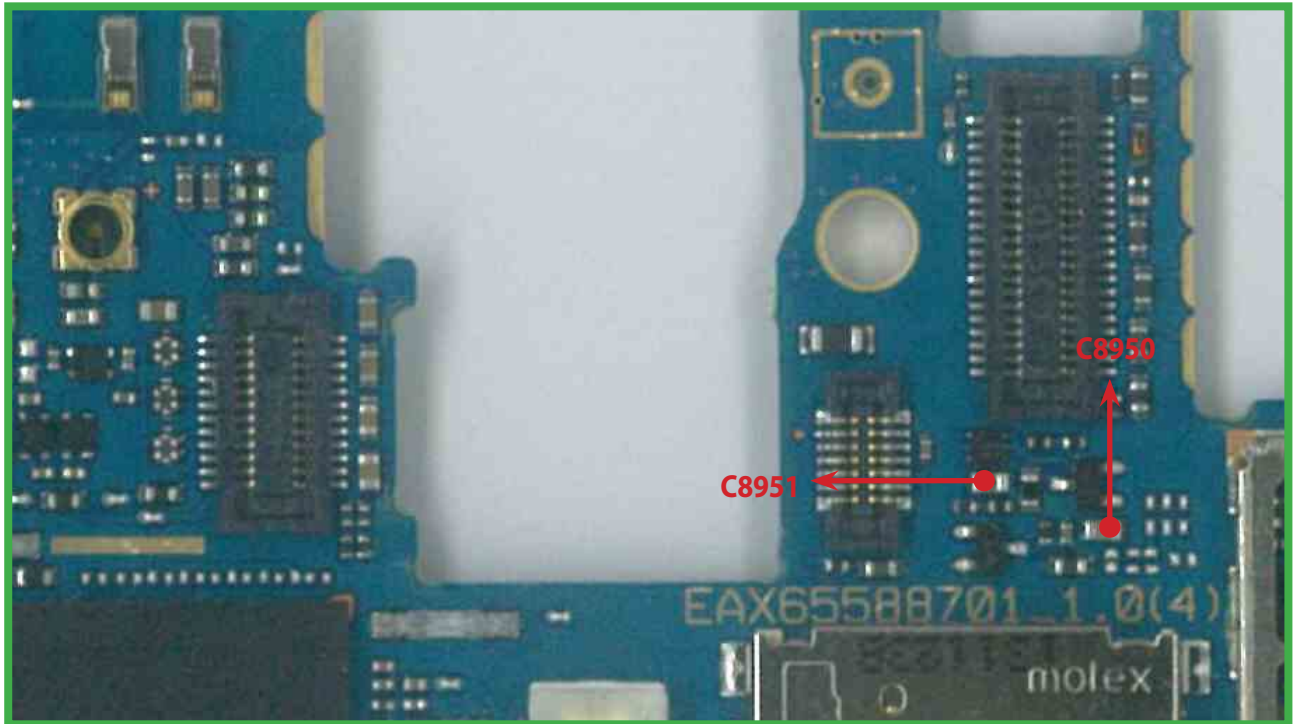


< Main Bot >

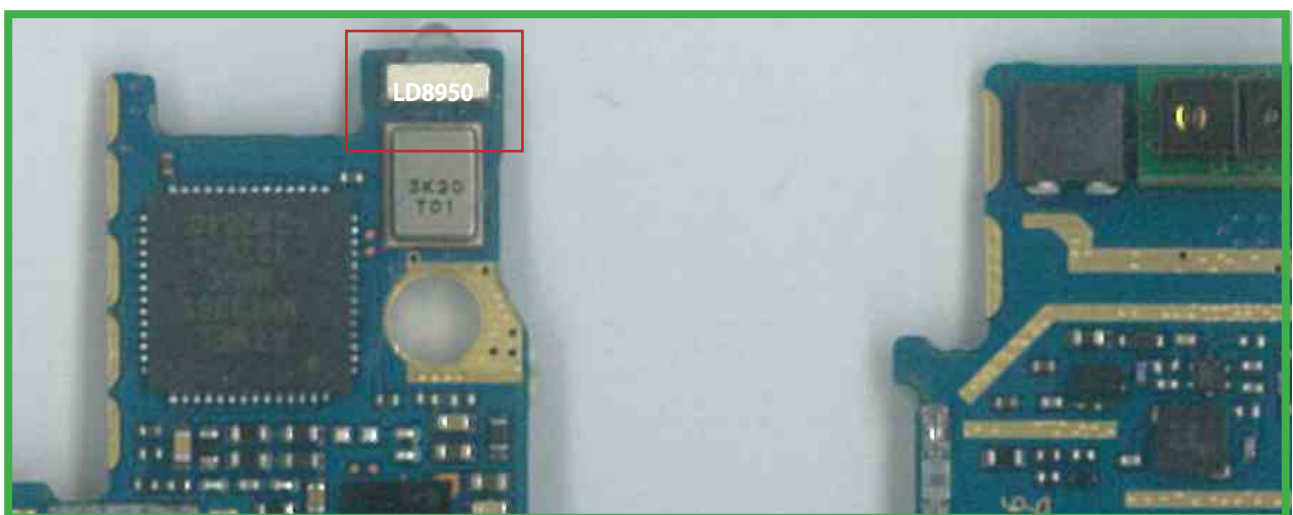



< Main Top >

4. DOWNLOAD



TOOL INFORMATION			
TOOL VERSION	DLL NAME	USB DRIVER	
LGFLASHv160	LGLS740_20140414_LGFLASHv160_ Download	LGUnitedMobileDriver_S4981MAN38AP22_ML_WHQL_ Ver_3.8.1	
Please Check the Version to “B2B”			
H/W			
	Name	Part No.	SW
D/L Cable	Micro 5P (56-open-910K) USB DLC	RAD32167835	TOT

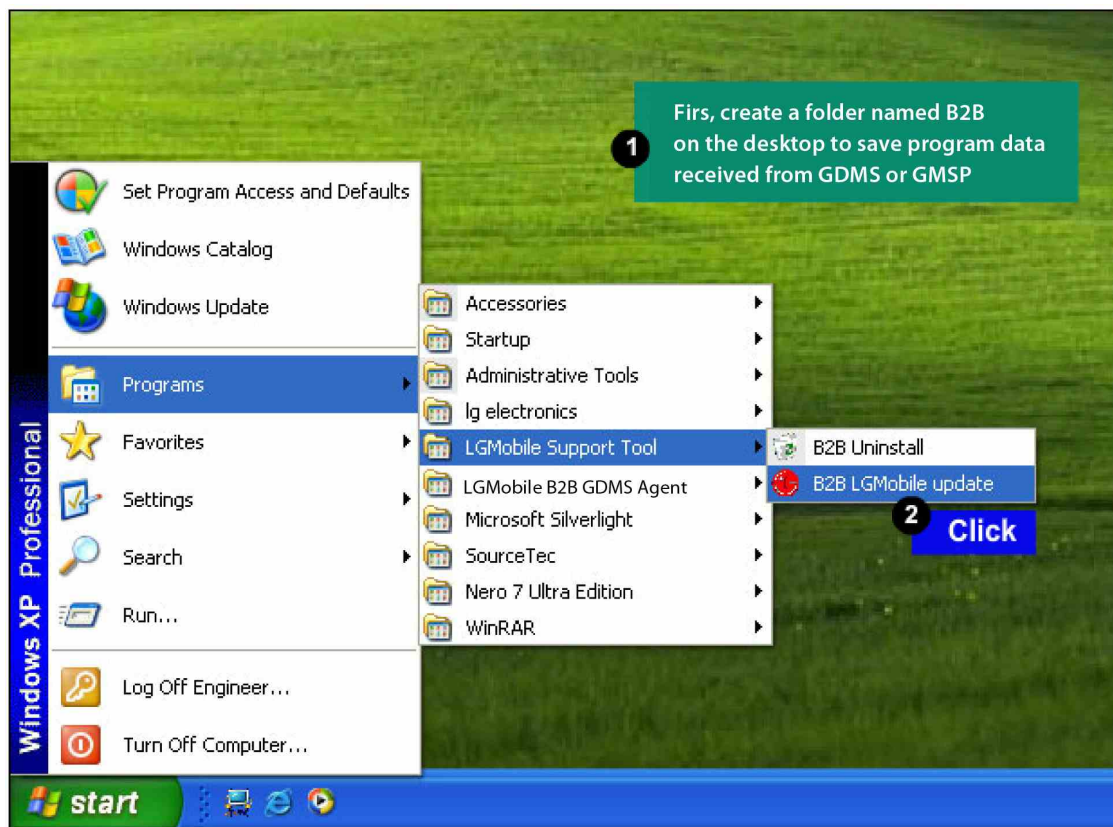



4. DOWNLOAD

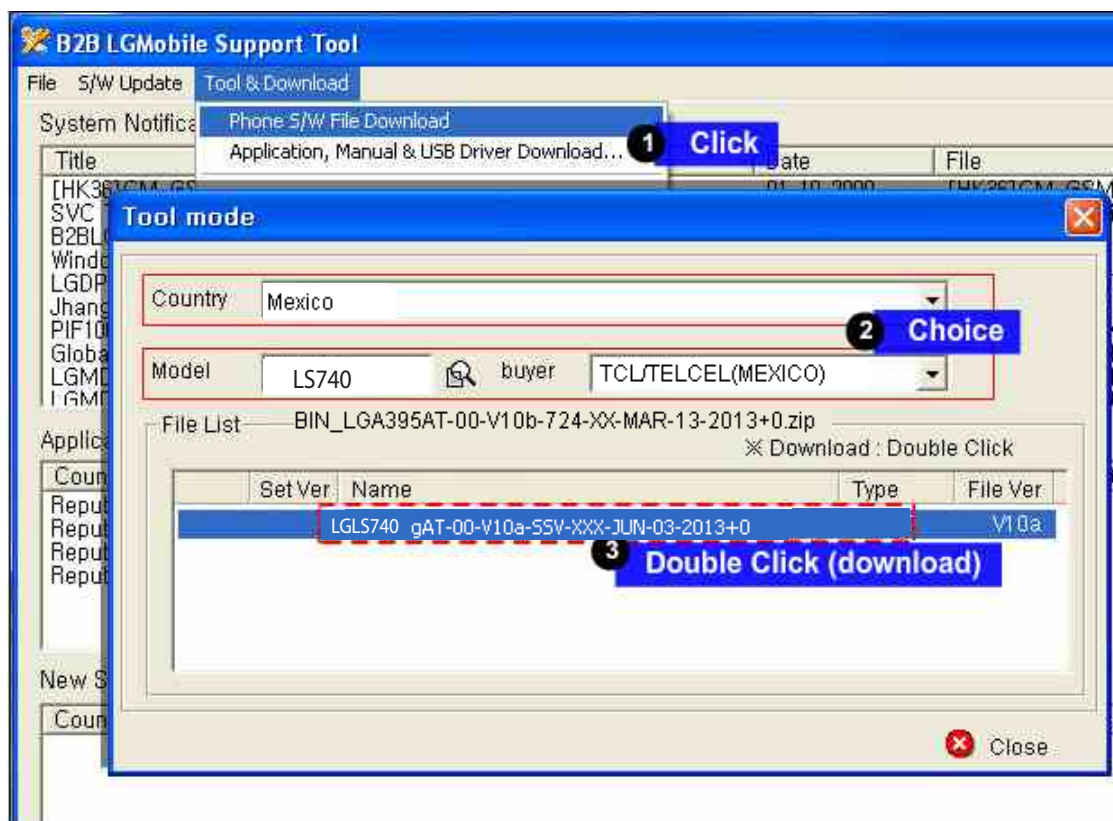
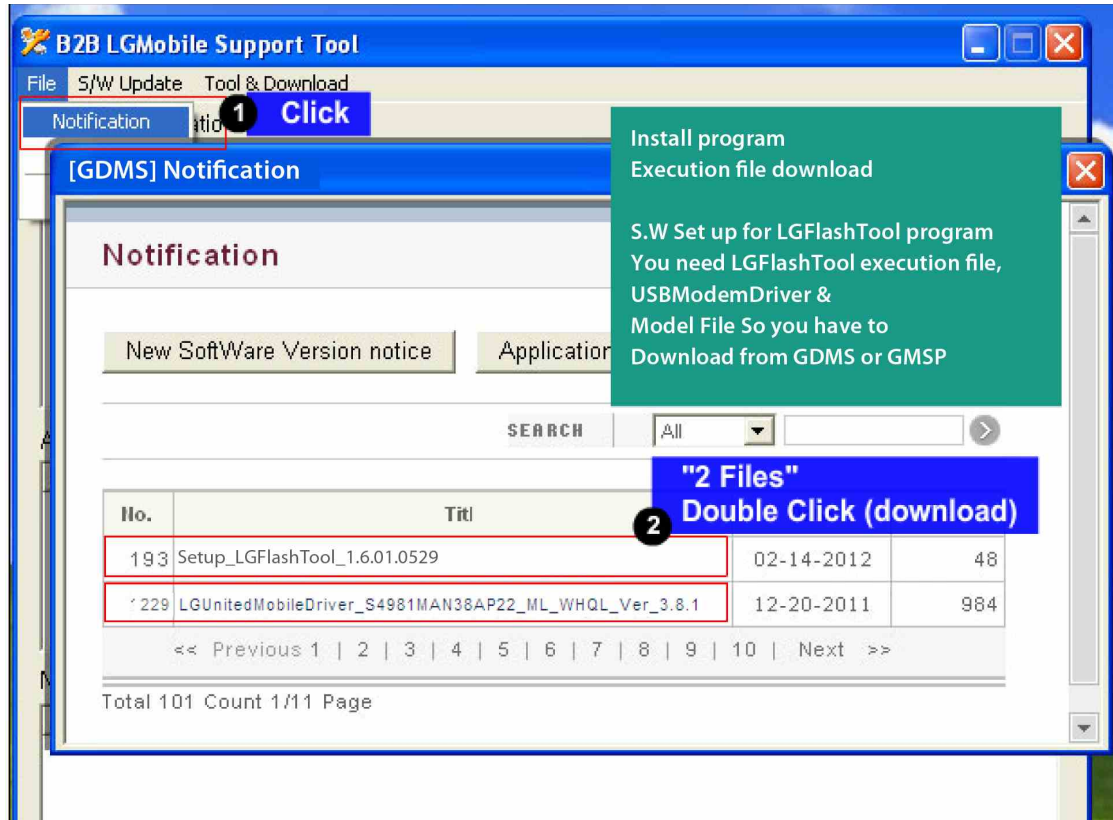


4. DOWNLOAD

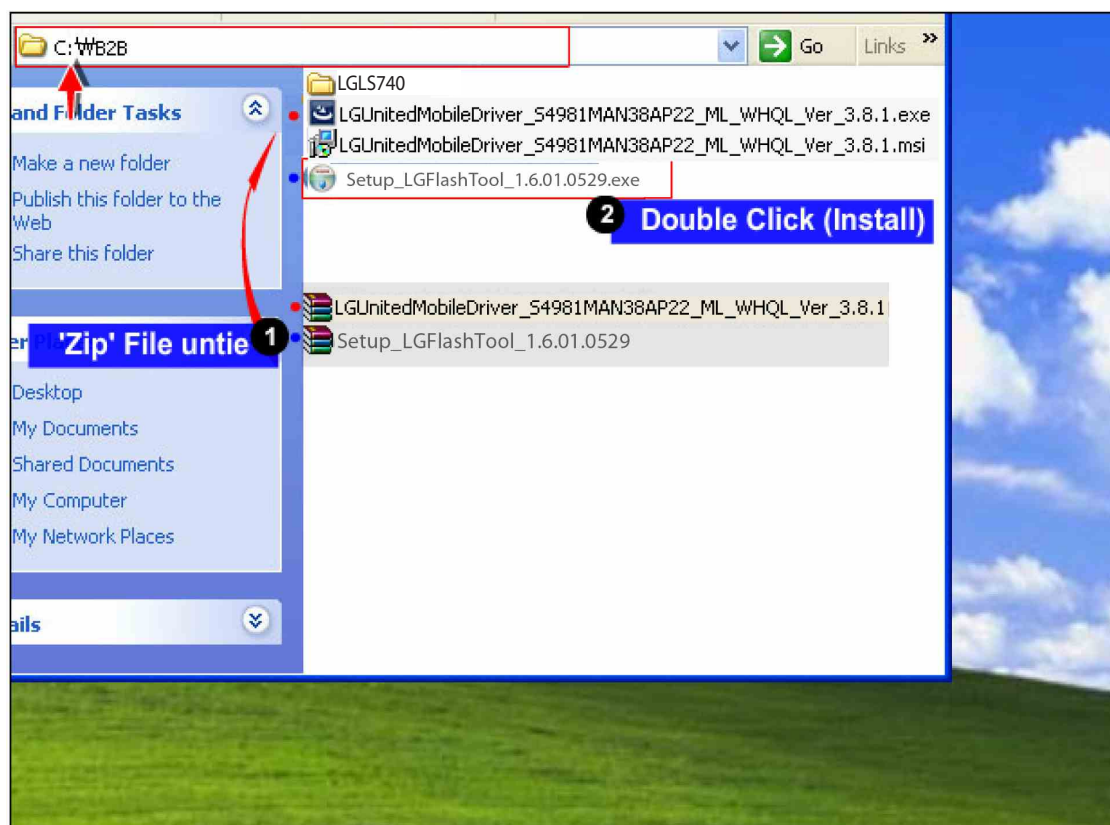
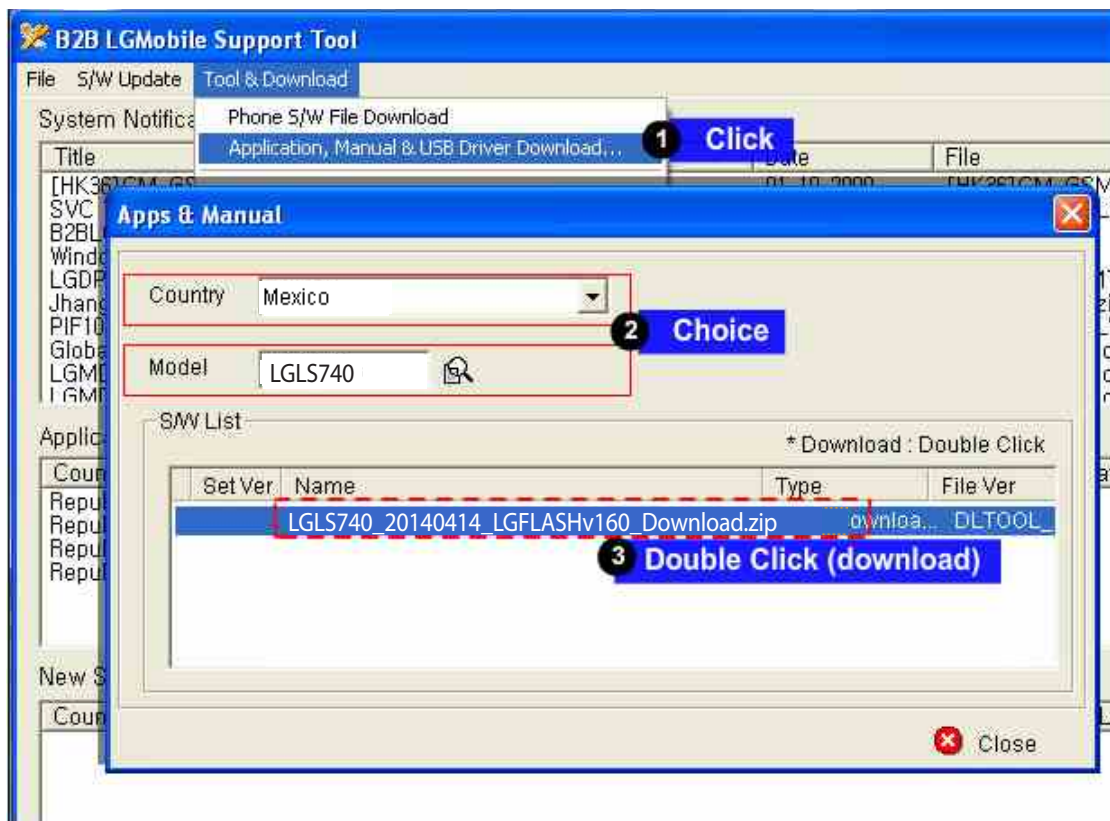


4. DOWNLOAD

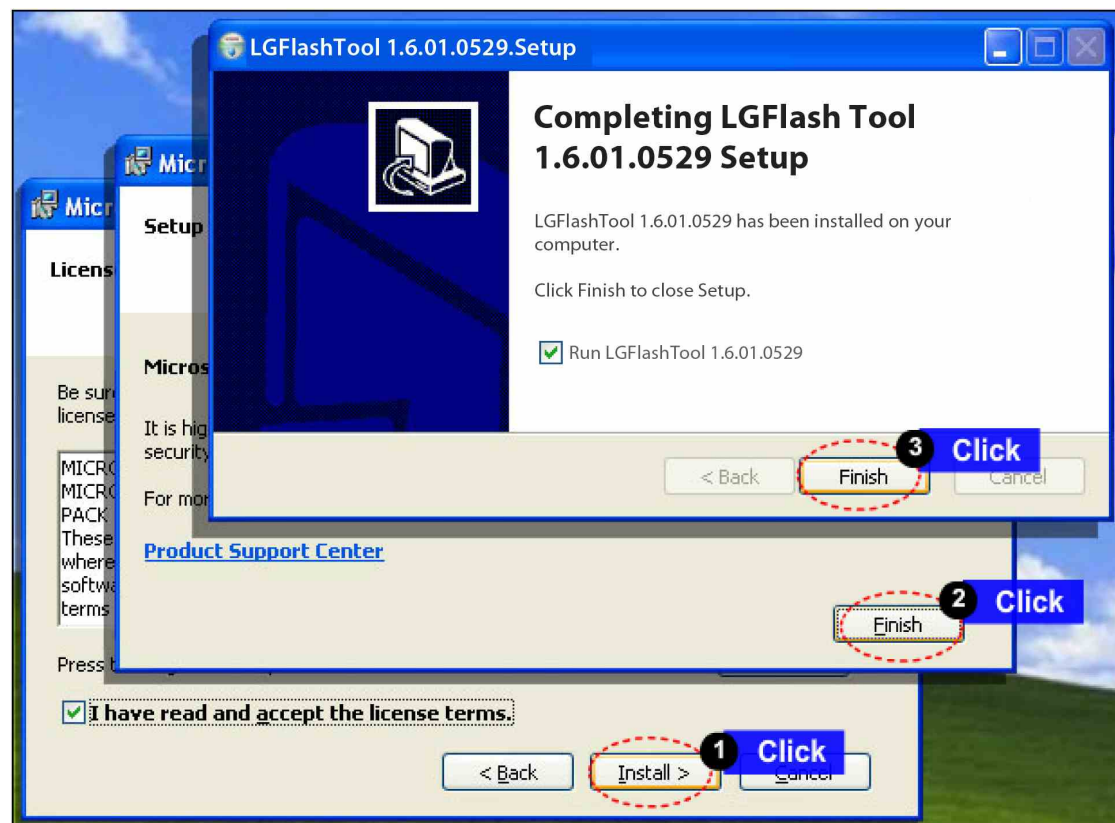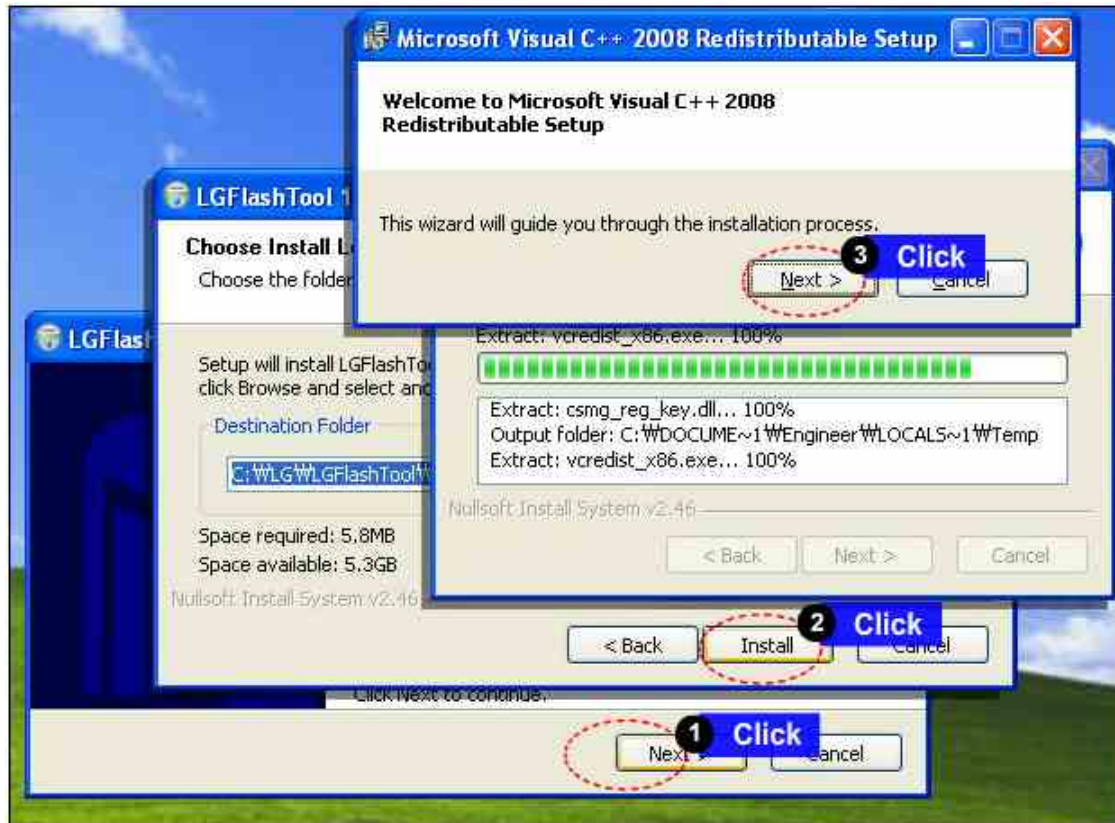

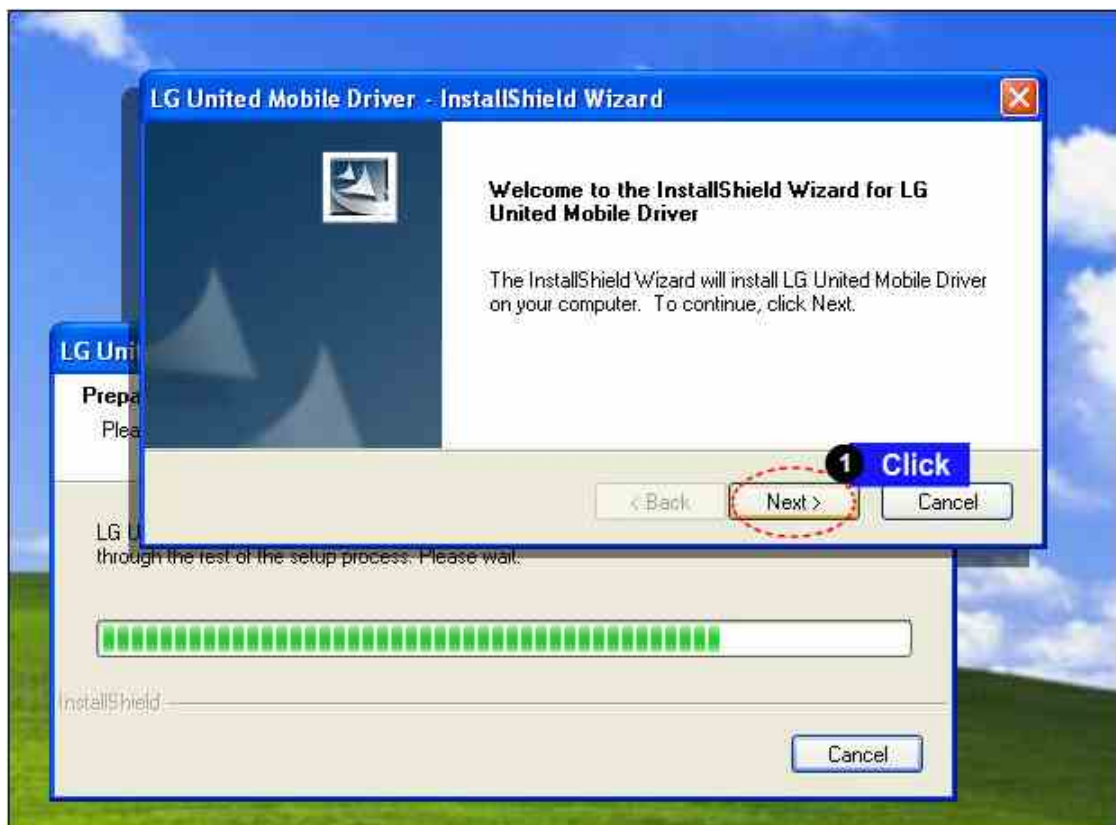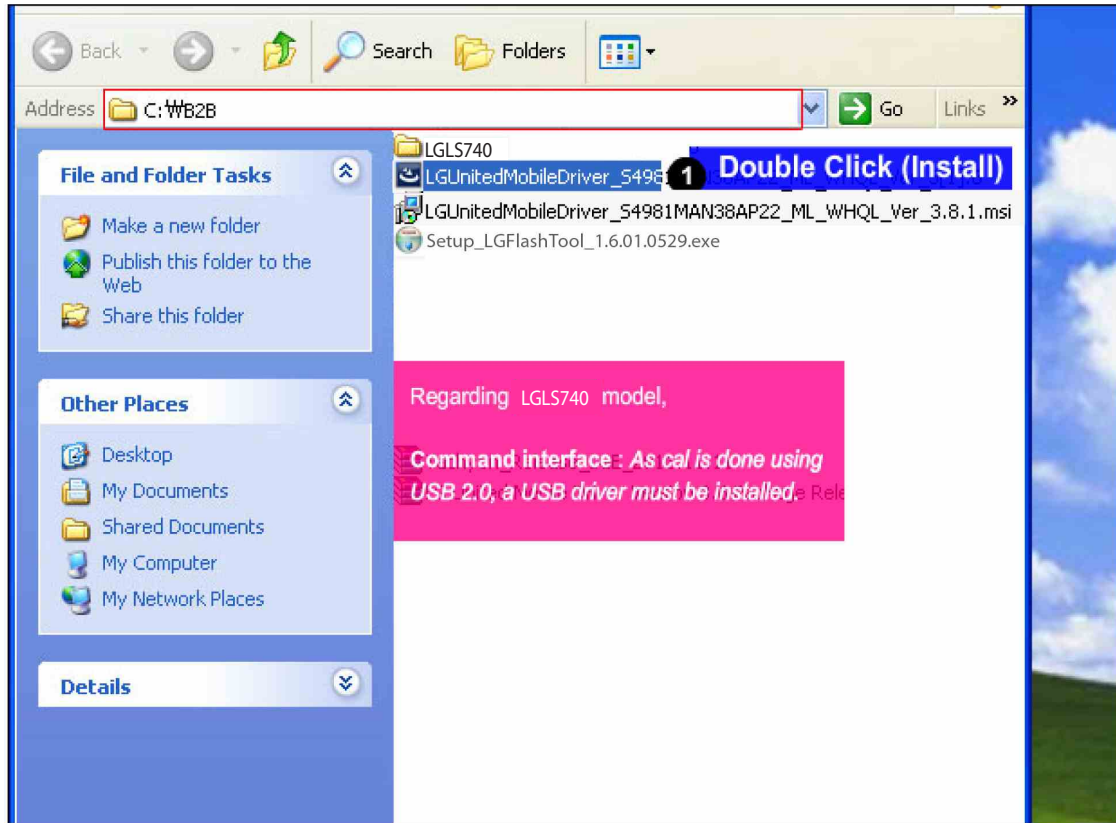



4. DOWNLOAD

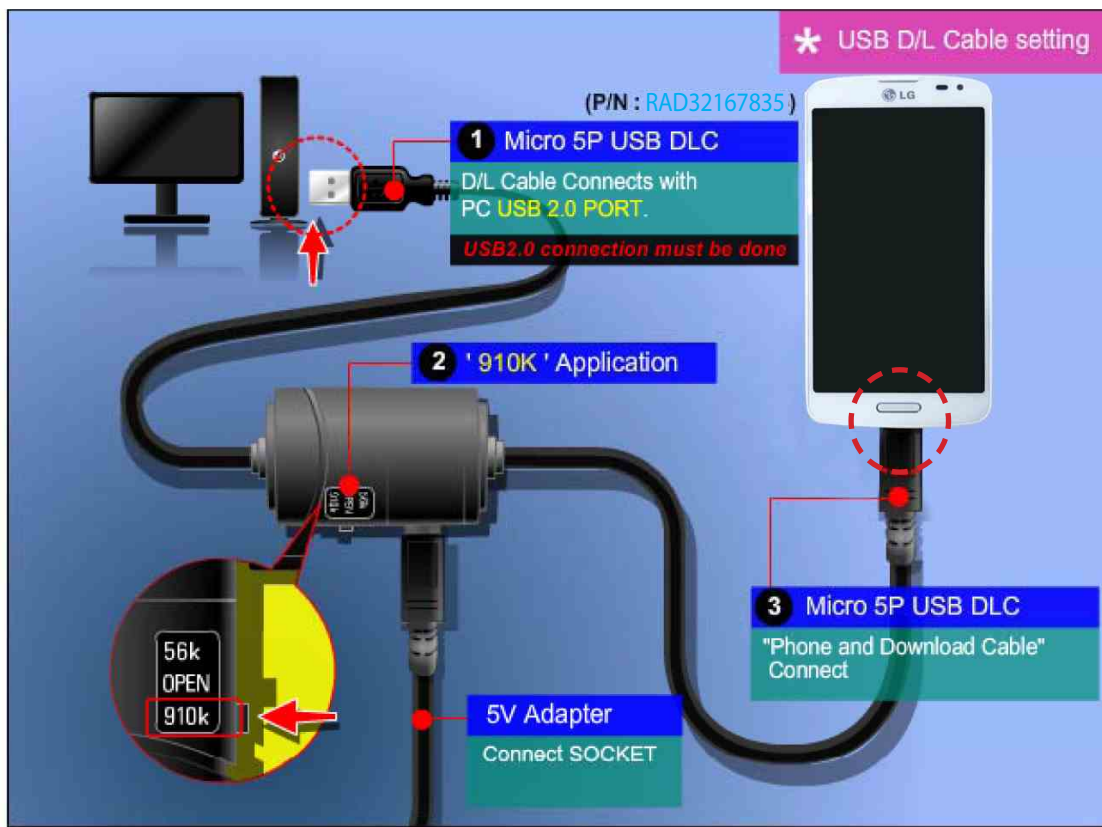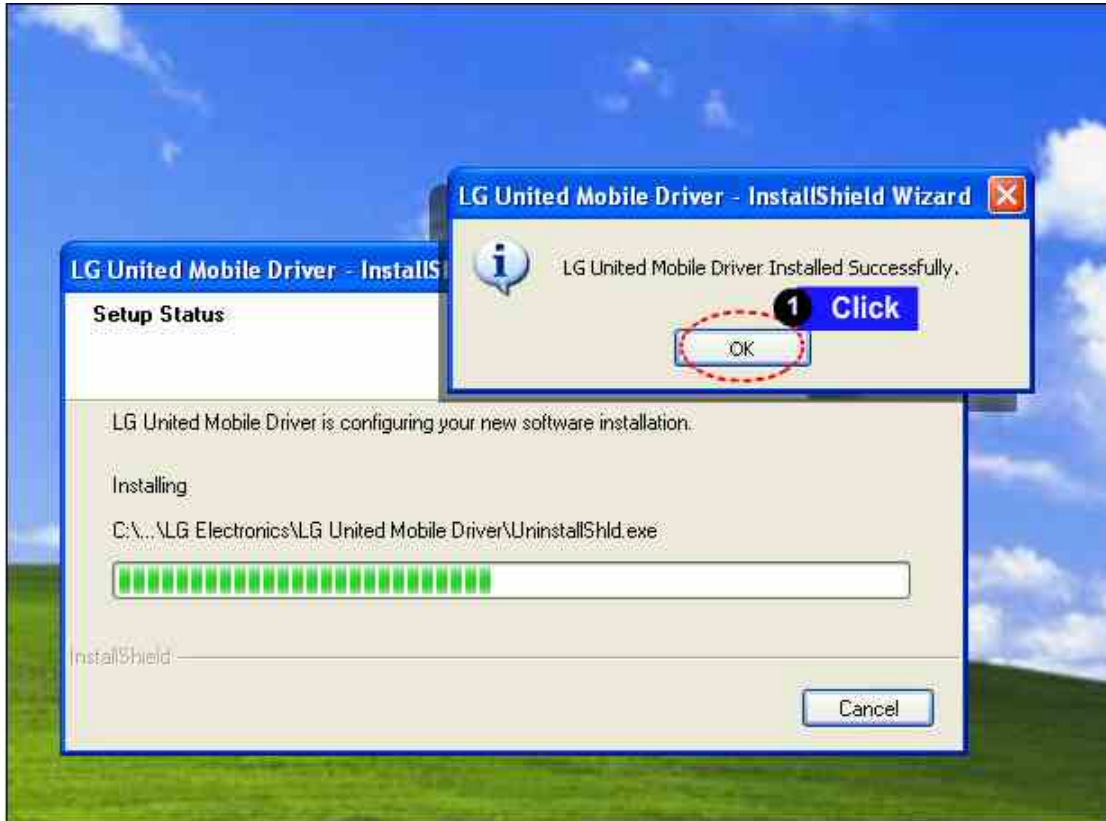



4. DOWNLOAD





4. DOWNLOAD

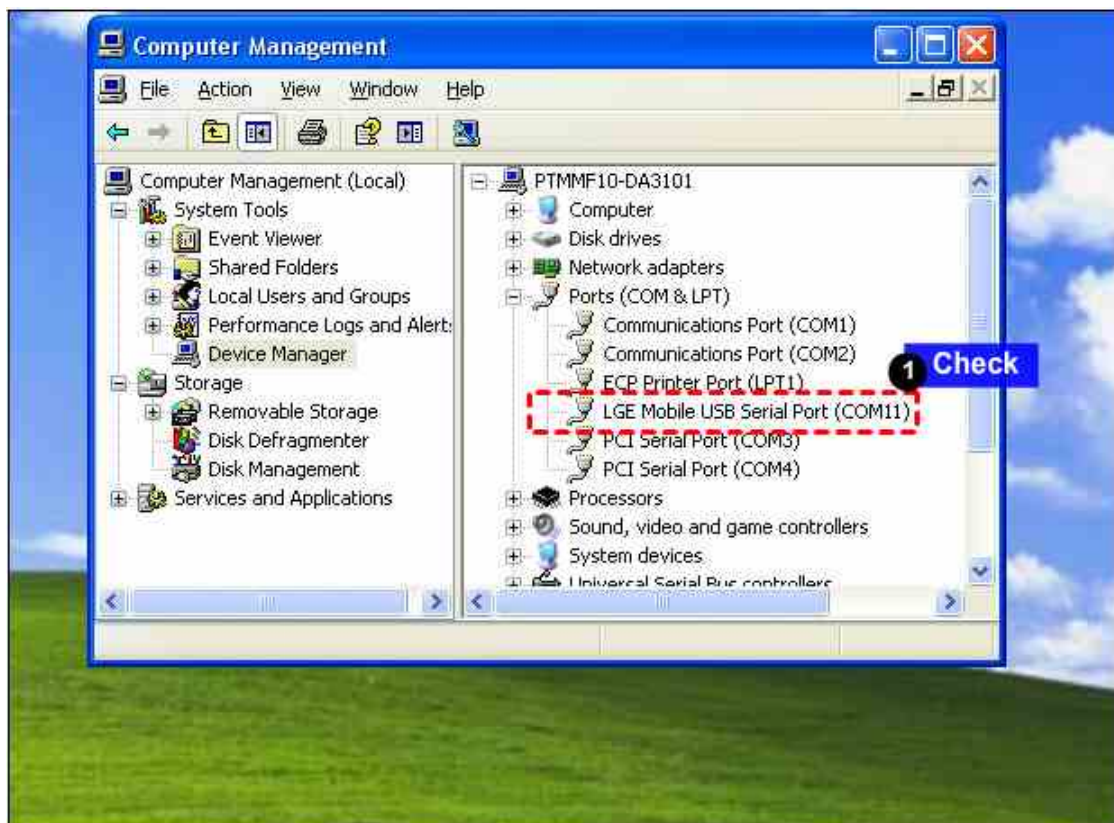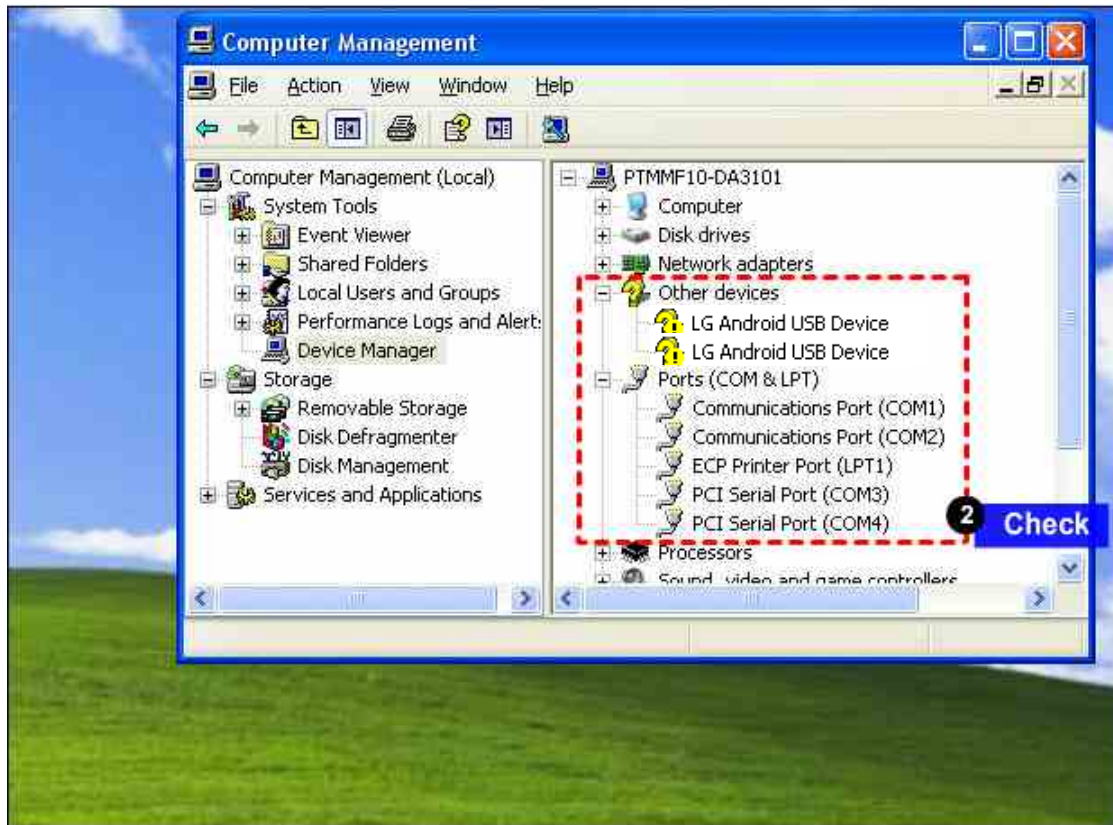



4. DOWNLOAD

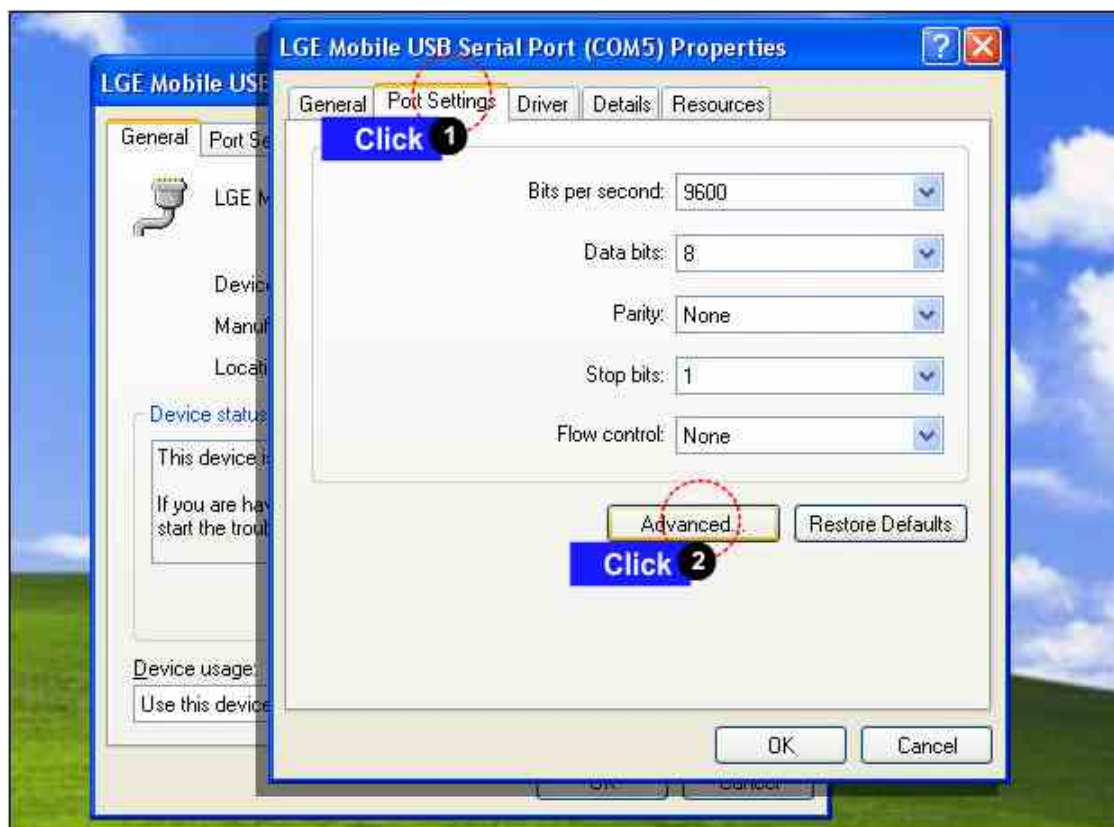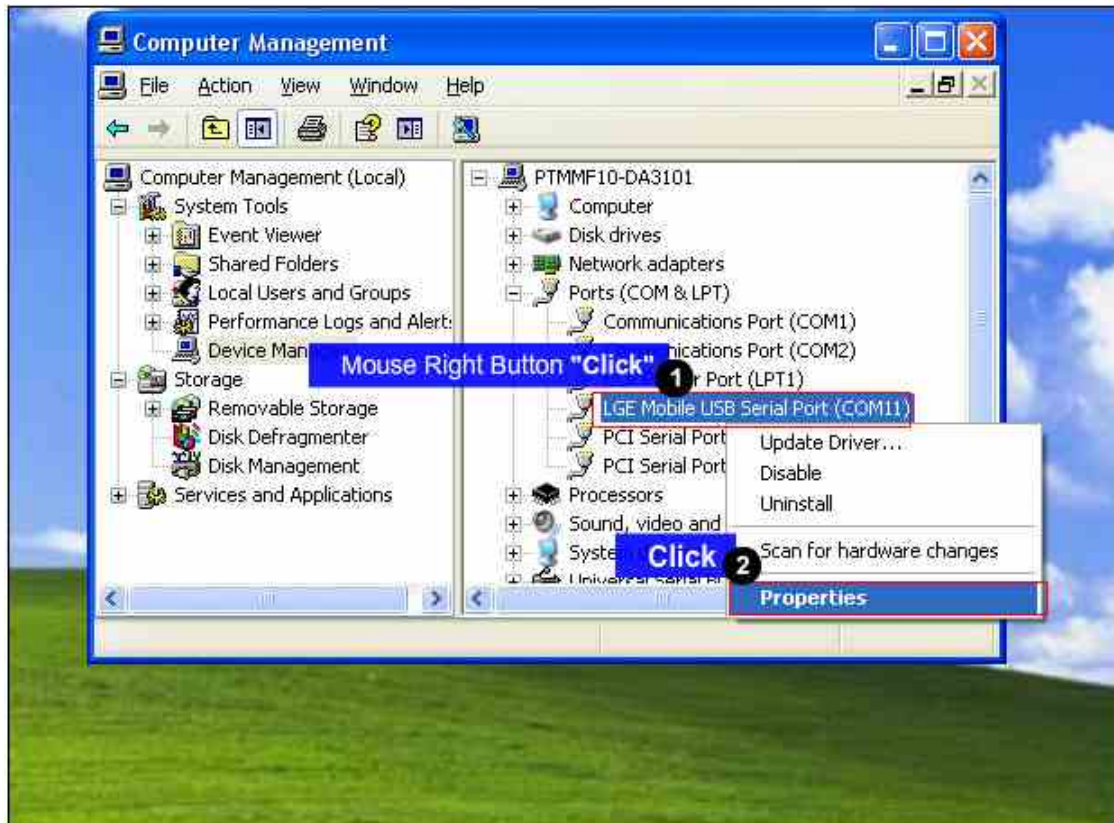



4. DOWNLOAD

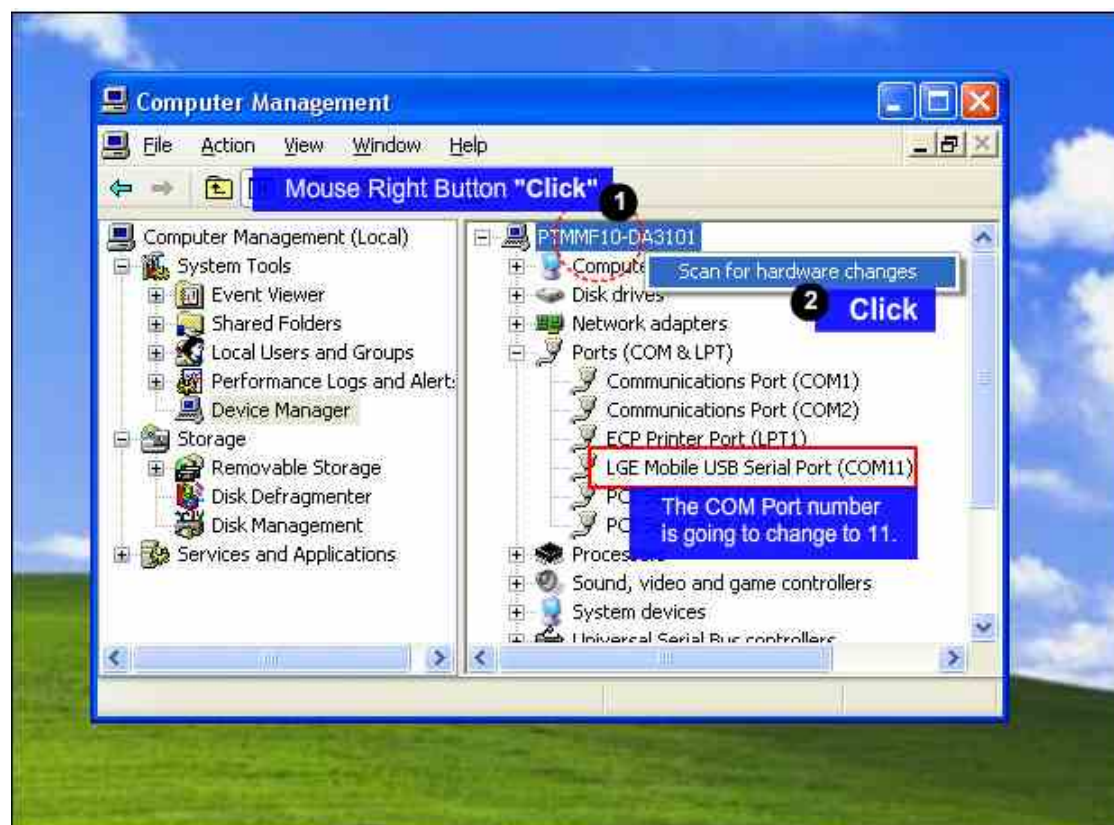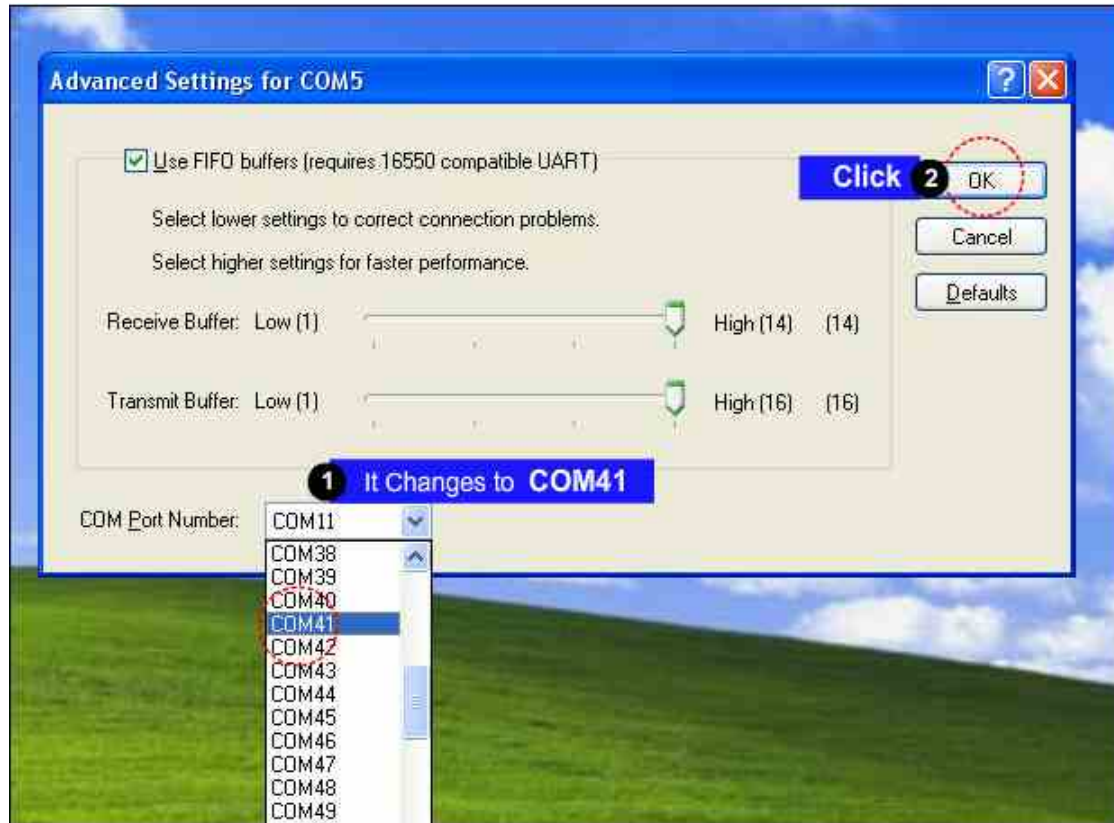



4. DOWNLOAD

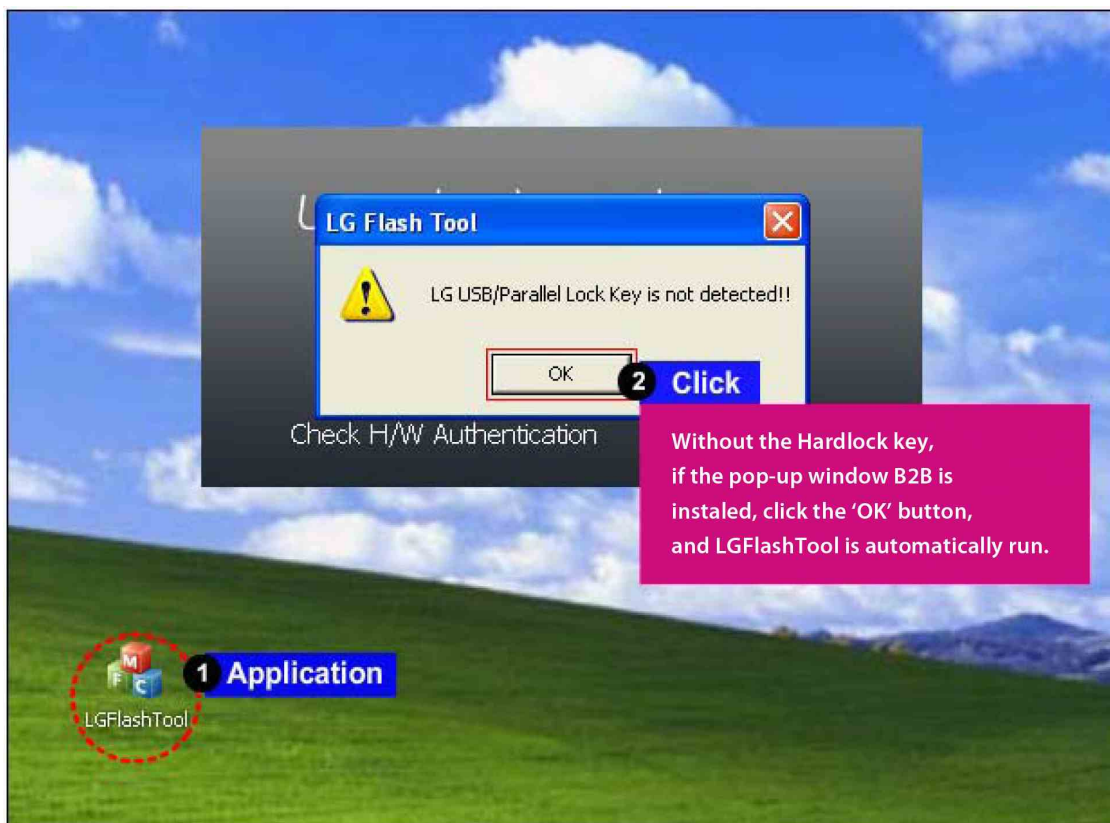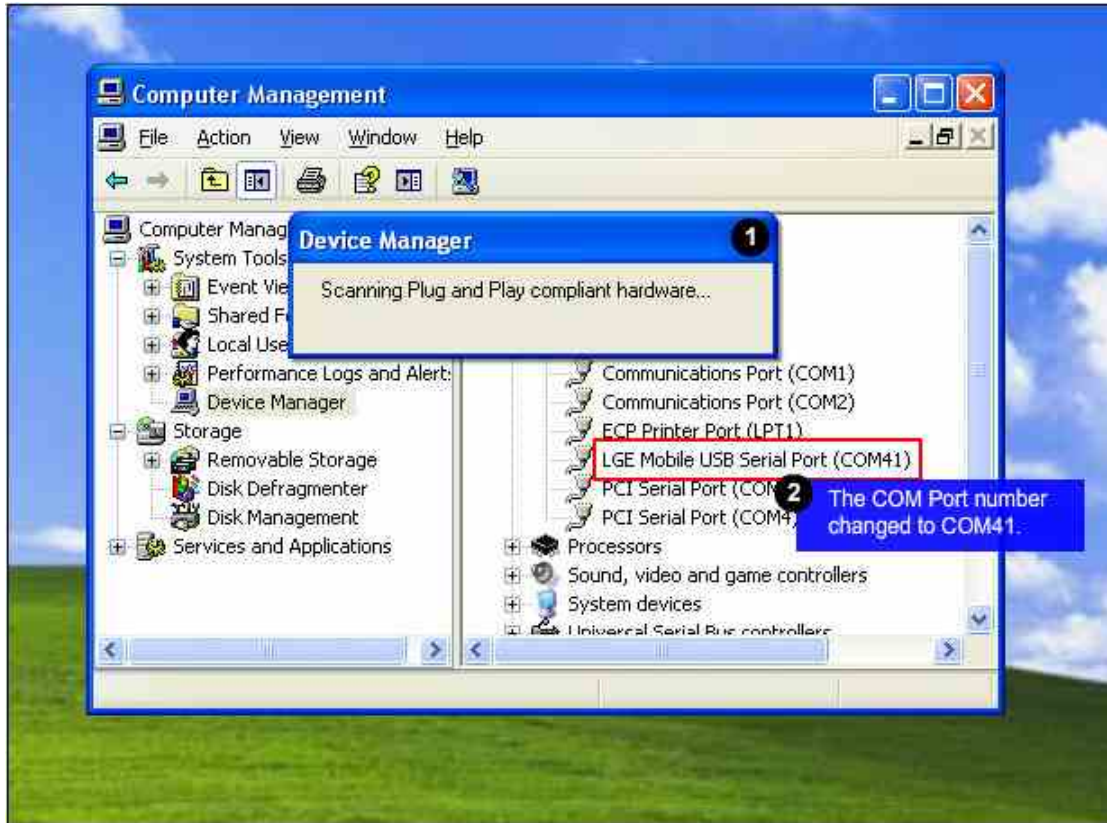



4. DOWNLOAD

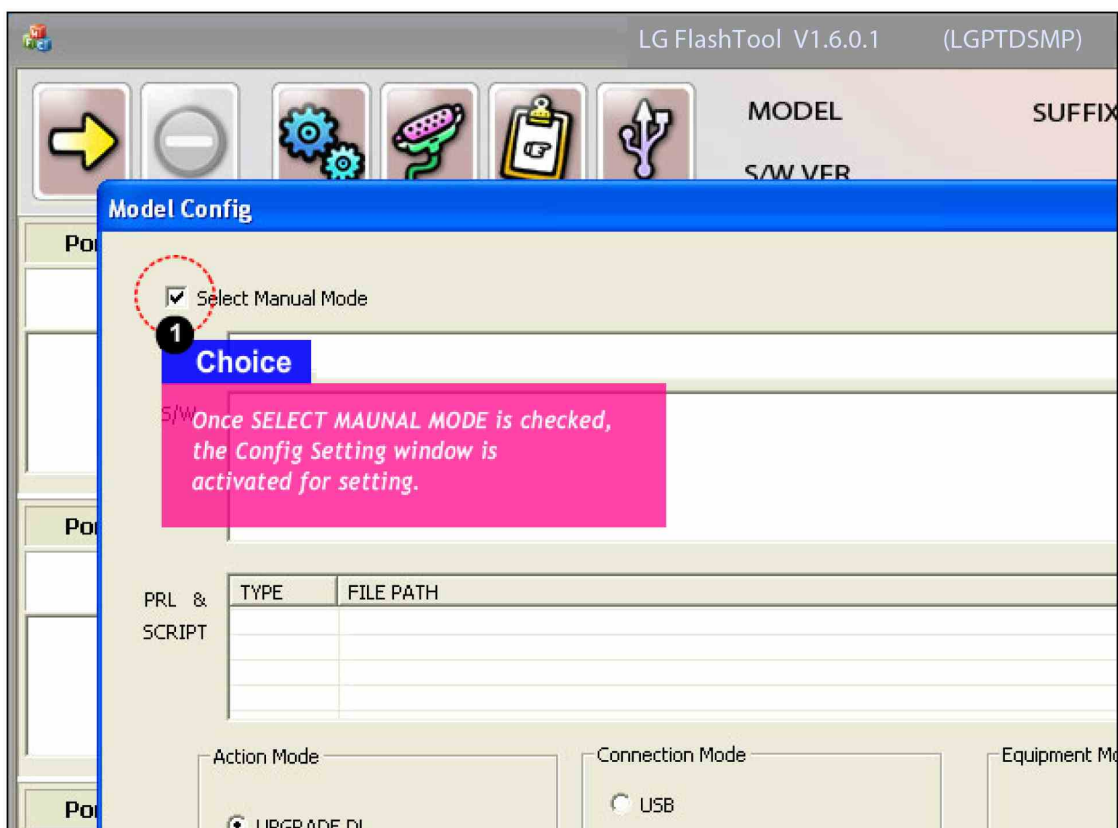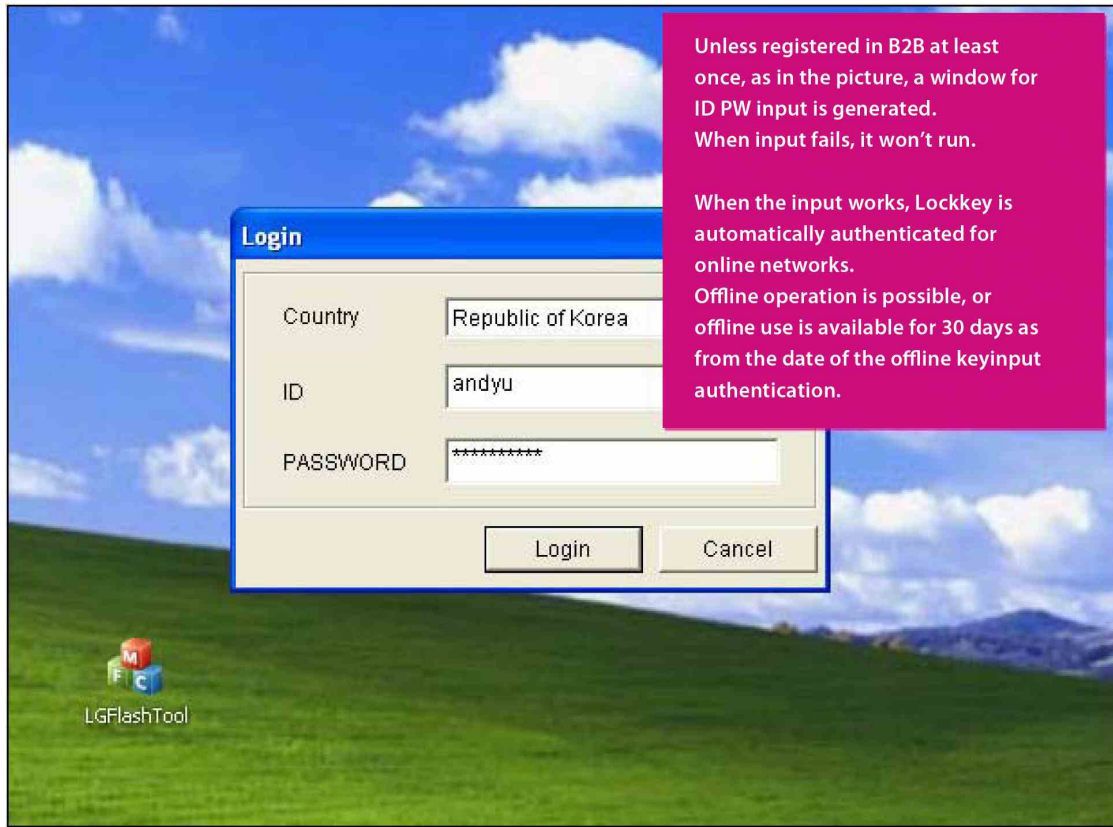


4. DOWNLOAD

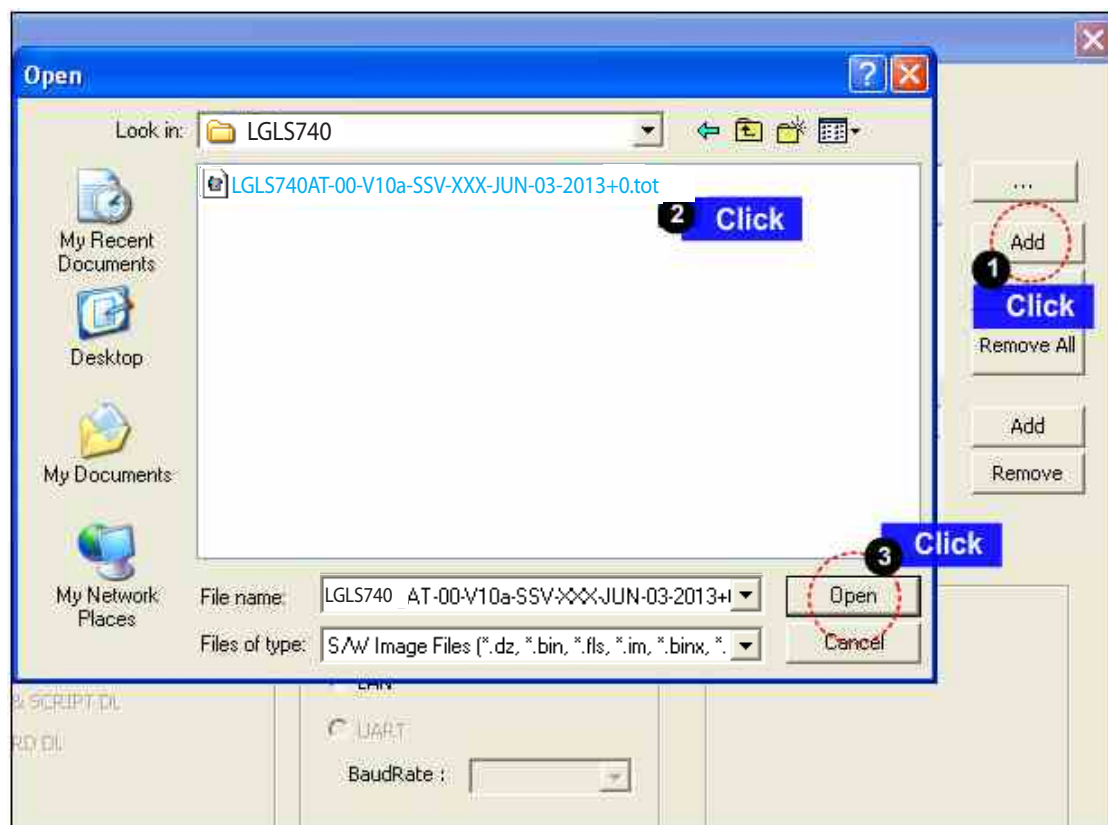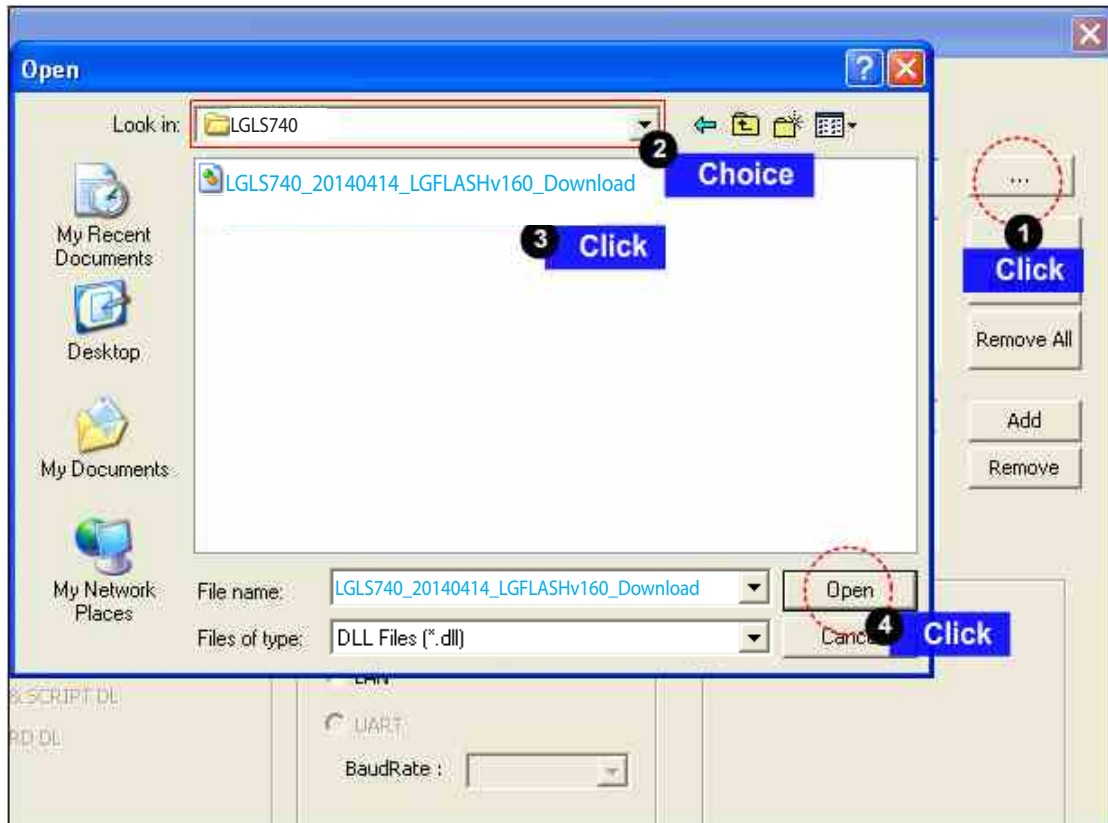



4. DOWNLOAD

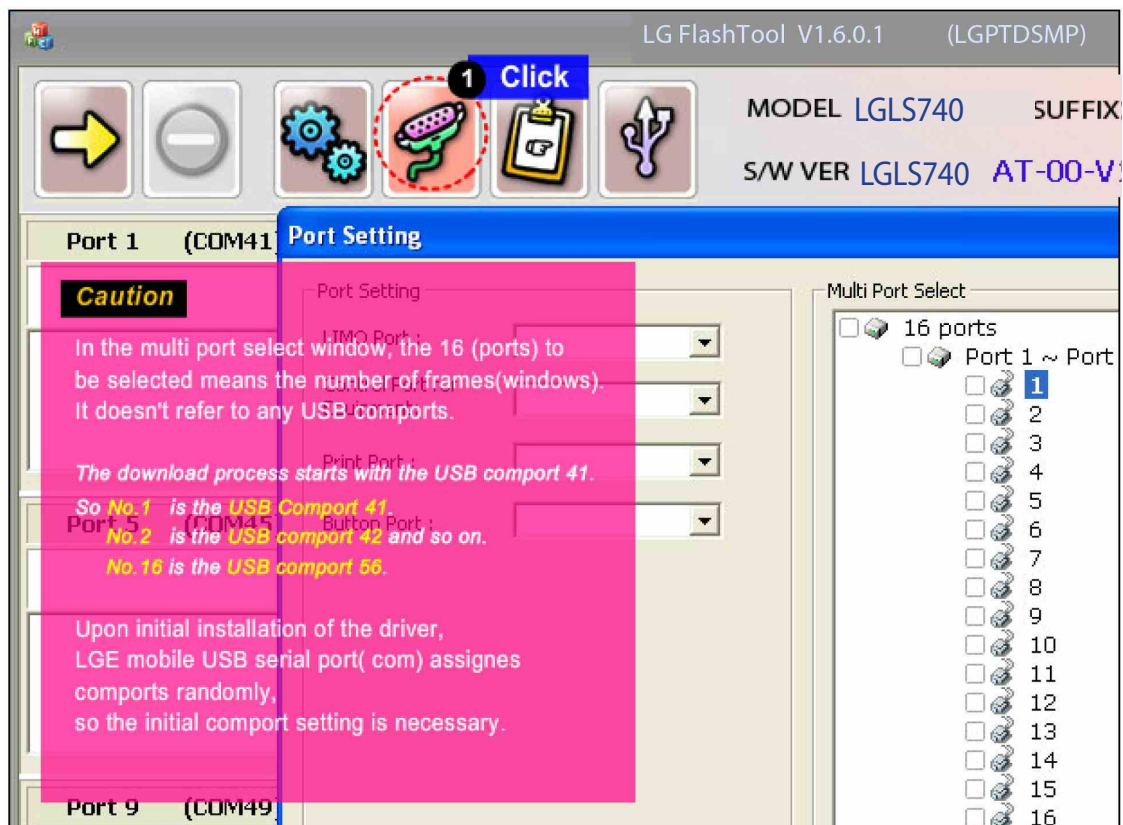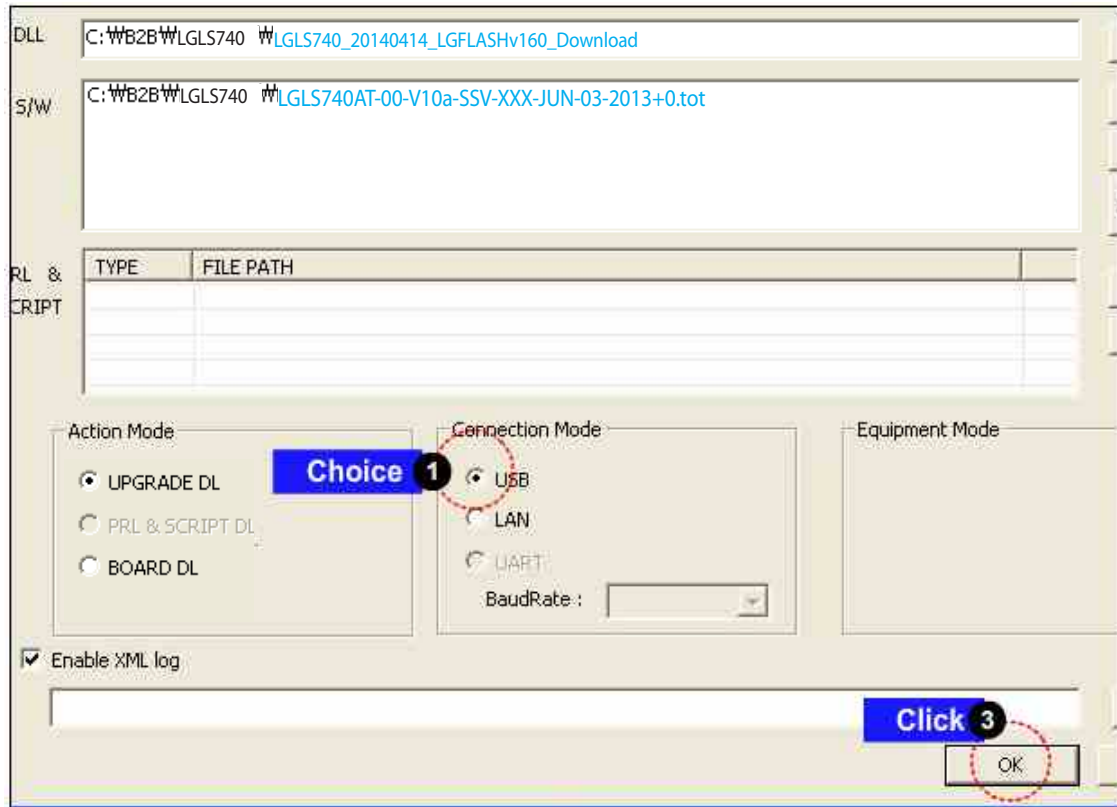


4. DOWNLOAD

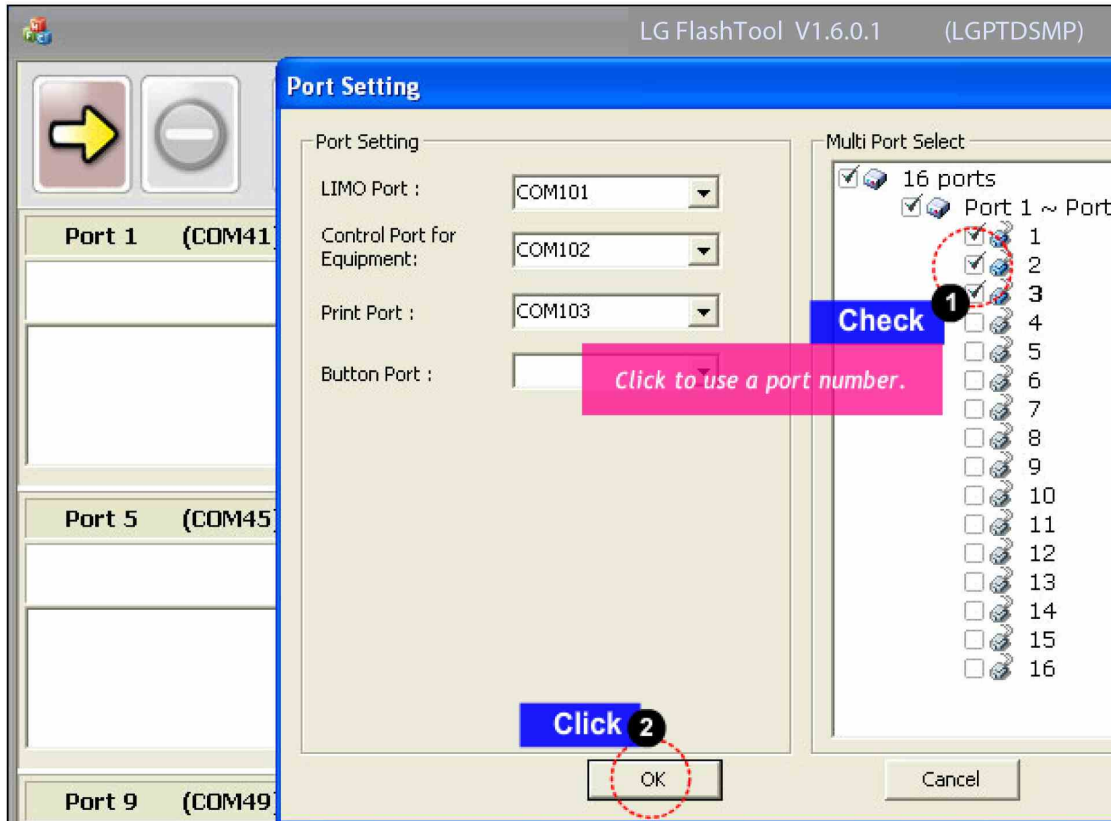

4. DOWNLOAD

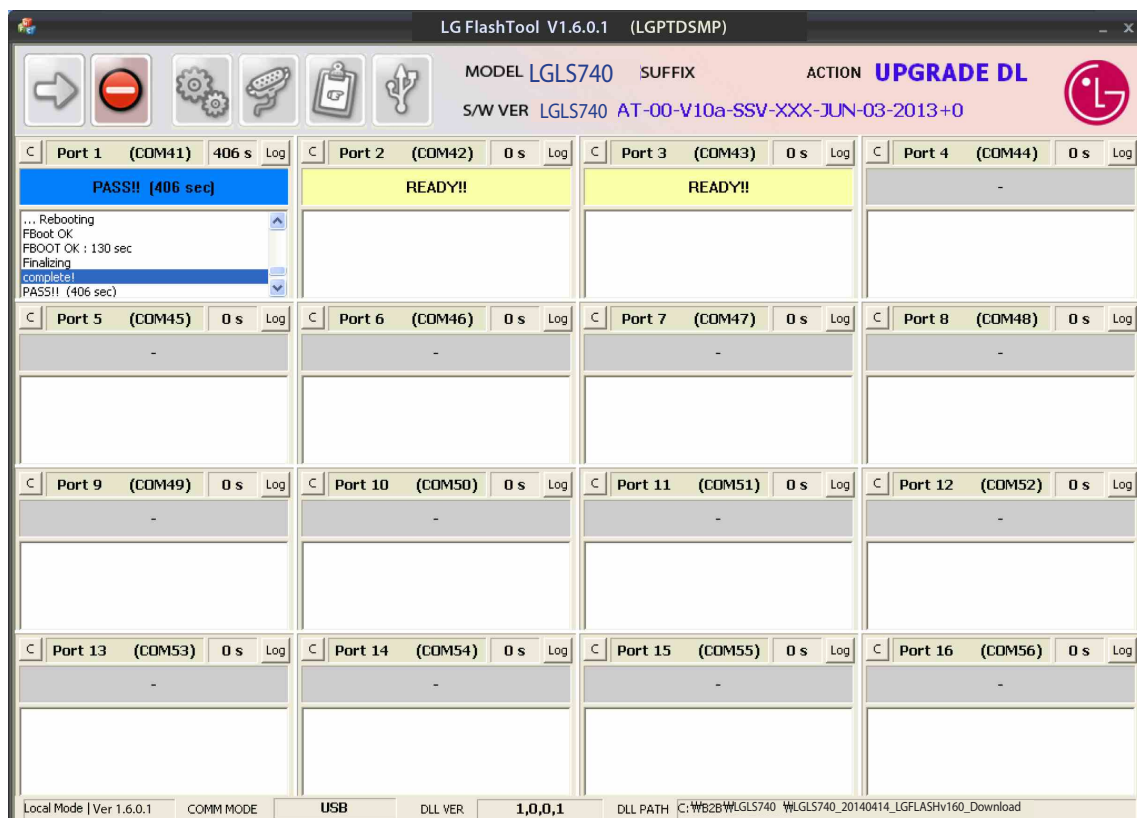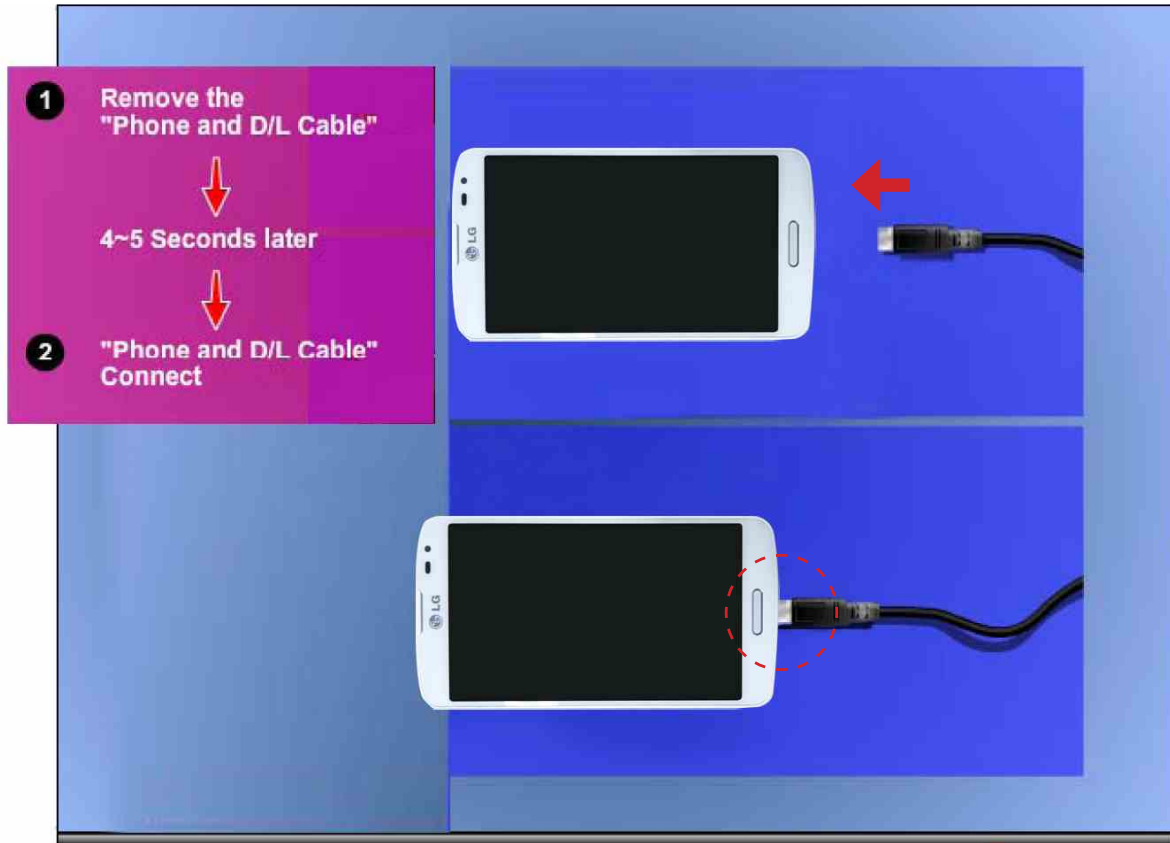


4. DOWNLOAD

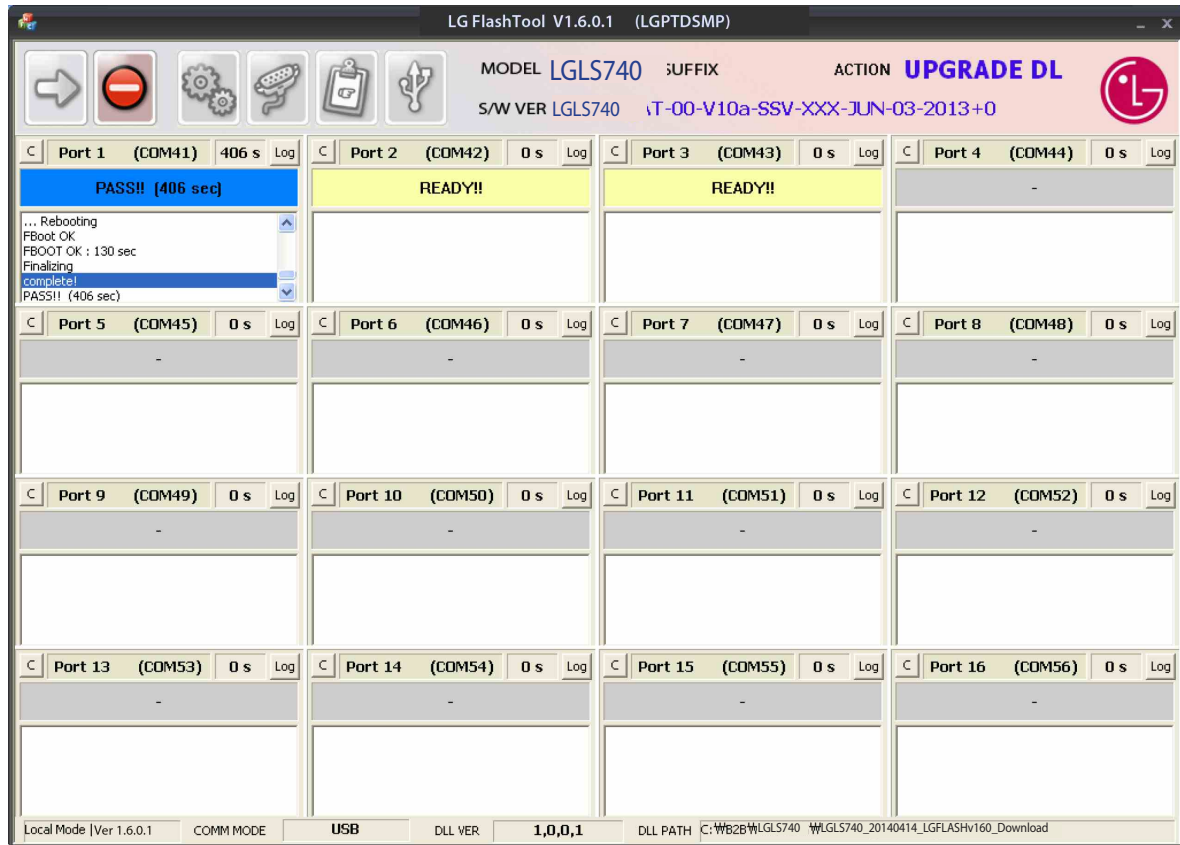


5. BLOCK DIAGRAM

[LS740] Total Block Diagram

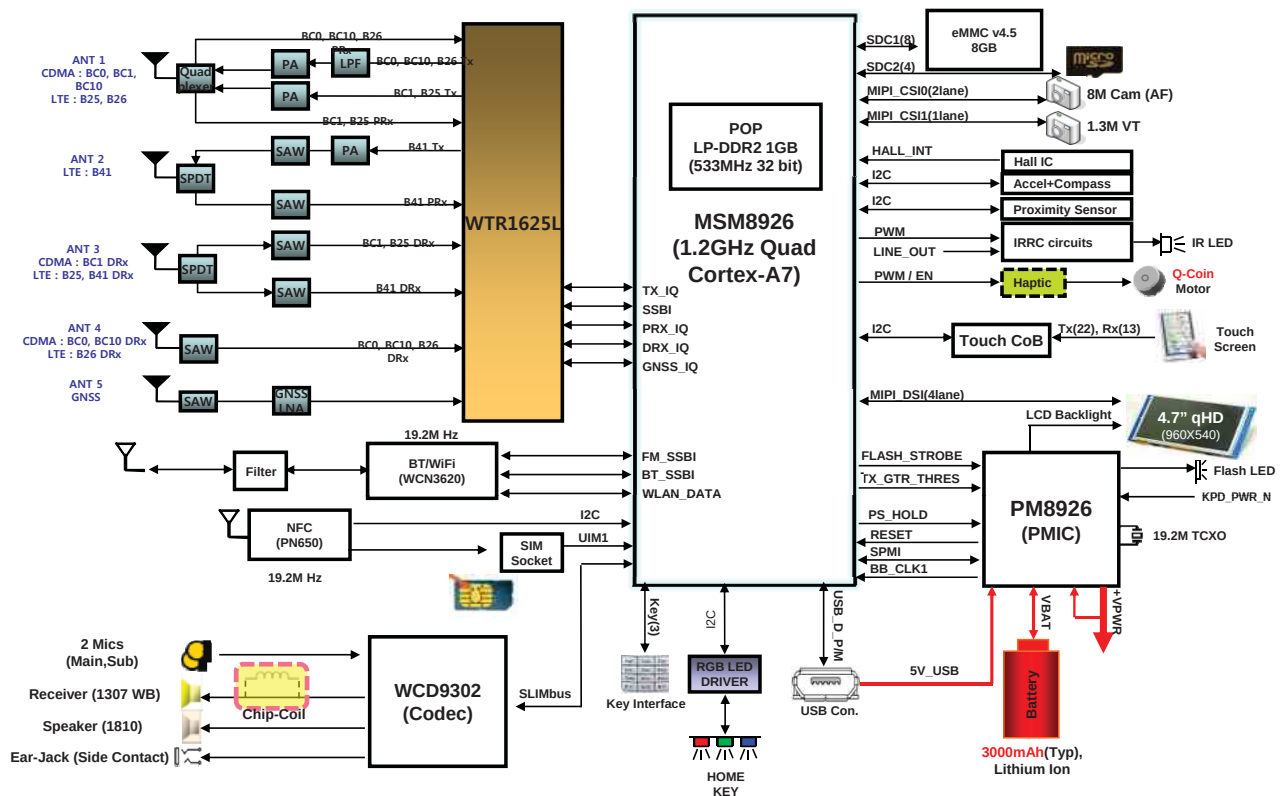


5. BLOCK DIAGRAM

[LS740] RF_CDMA/LTE Block Diagram


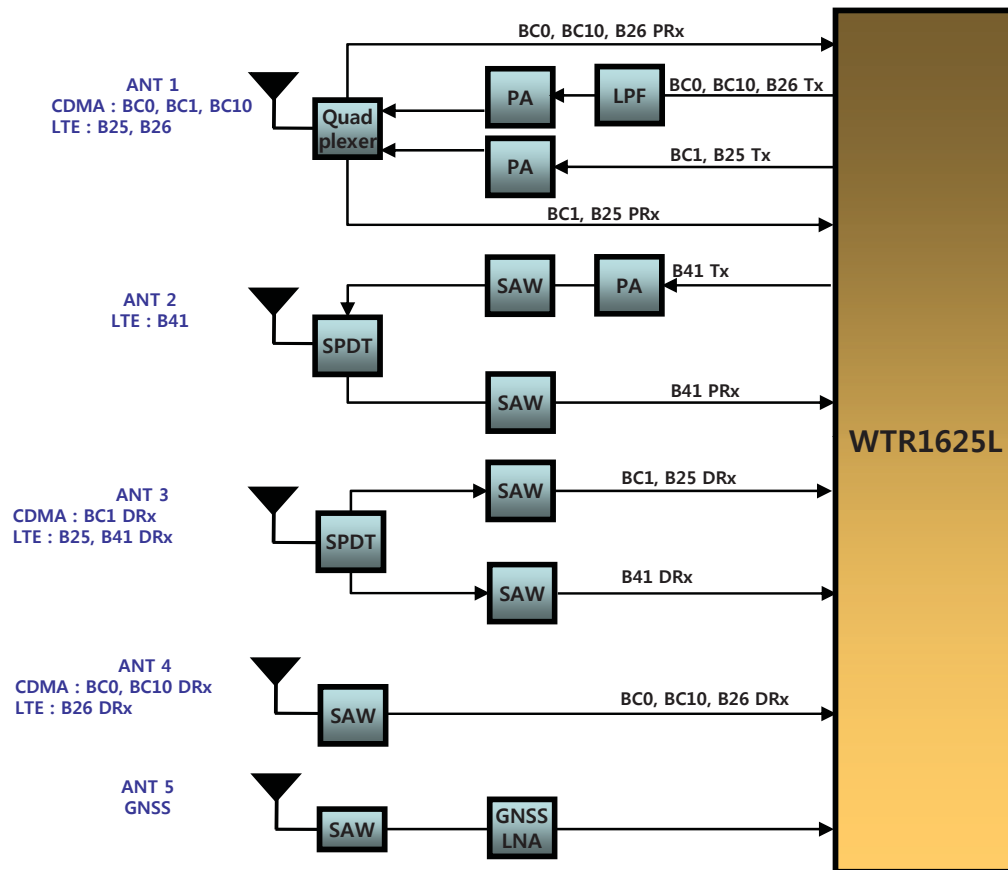


5. BLOCK DIAGRAM

[LS740] PM8926 Output Power Management

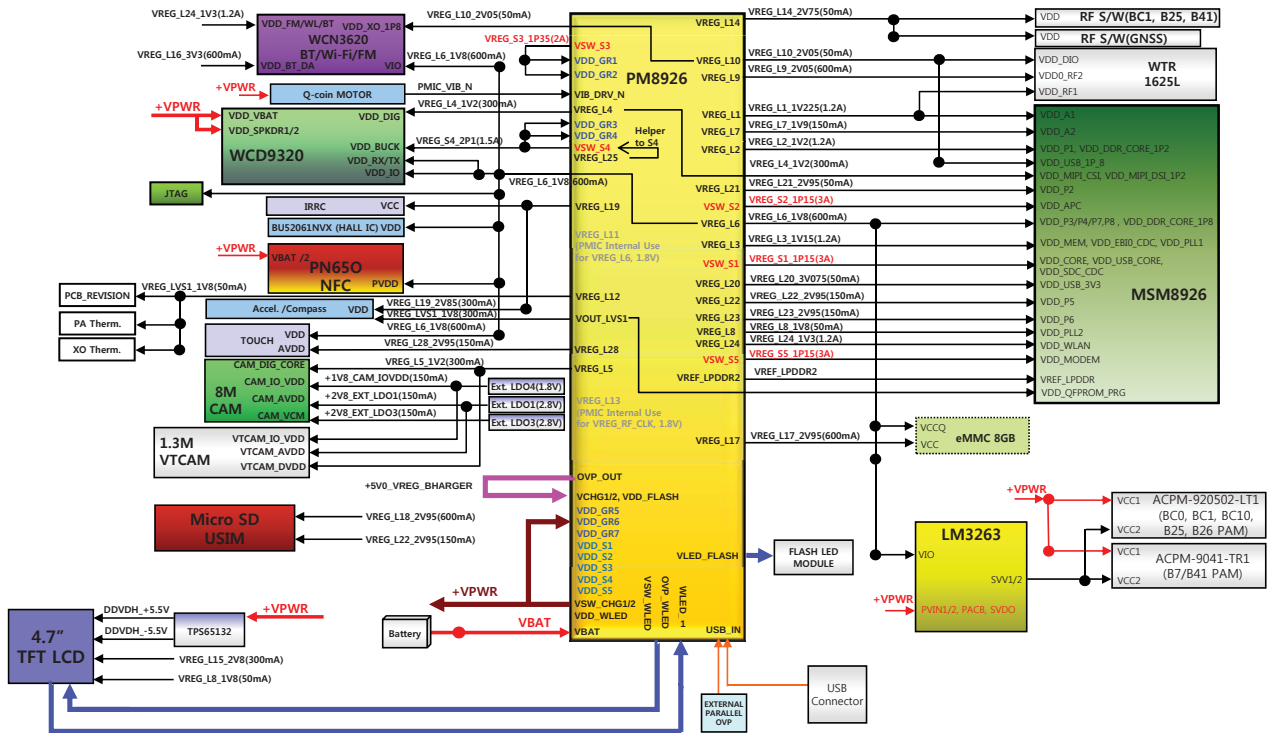


[LS740] PM8926 Input Power Management

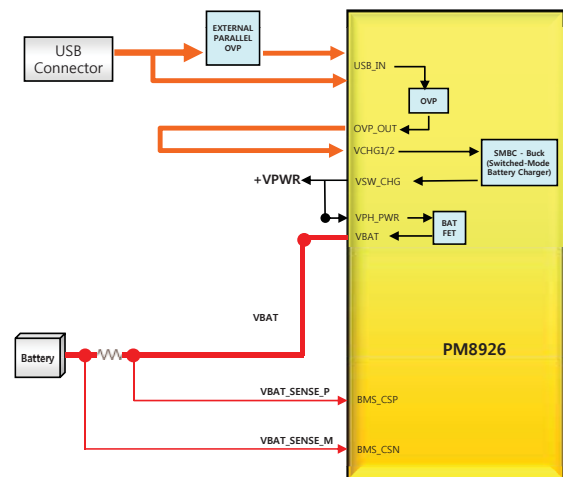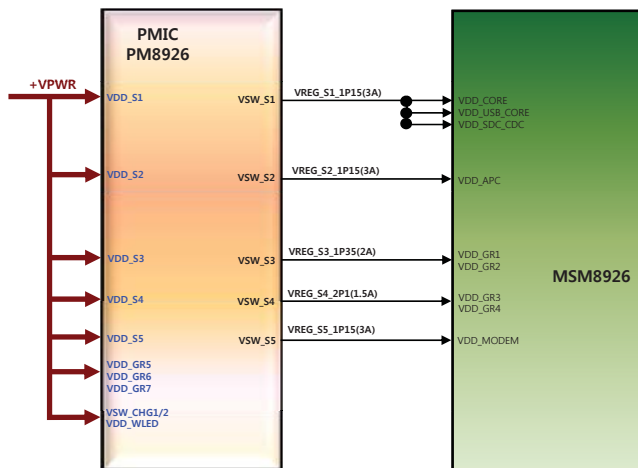


5. BLOCK DIAGRAM

[LS740] Memory I/F

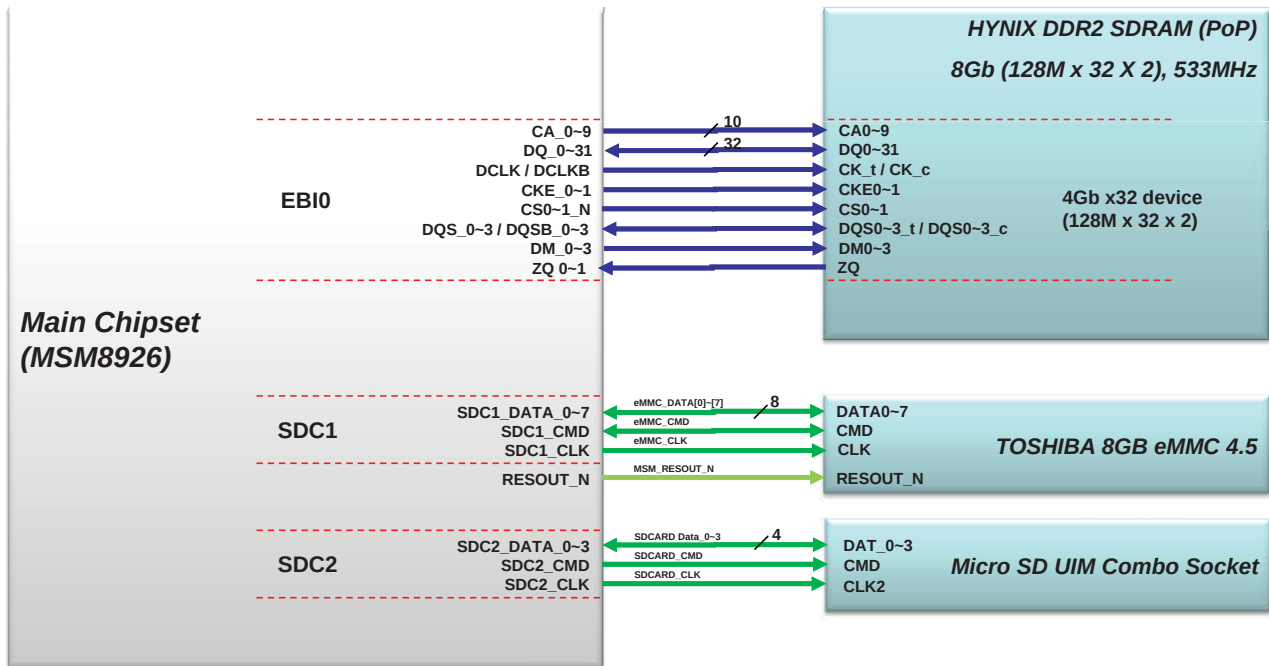


5. BLOCK DIAGRAM

[LS740] Display I/F

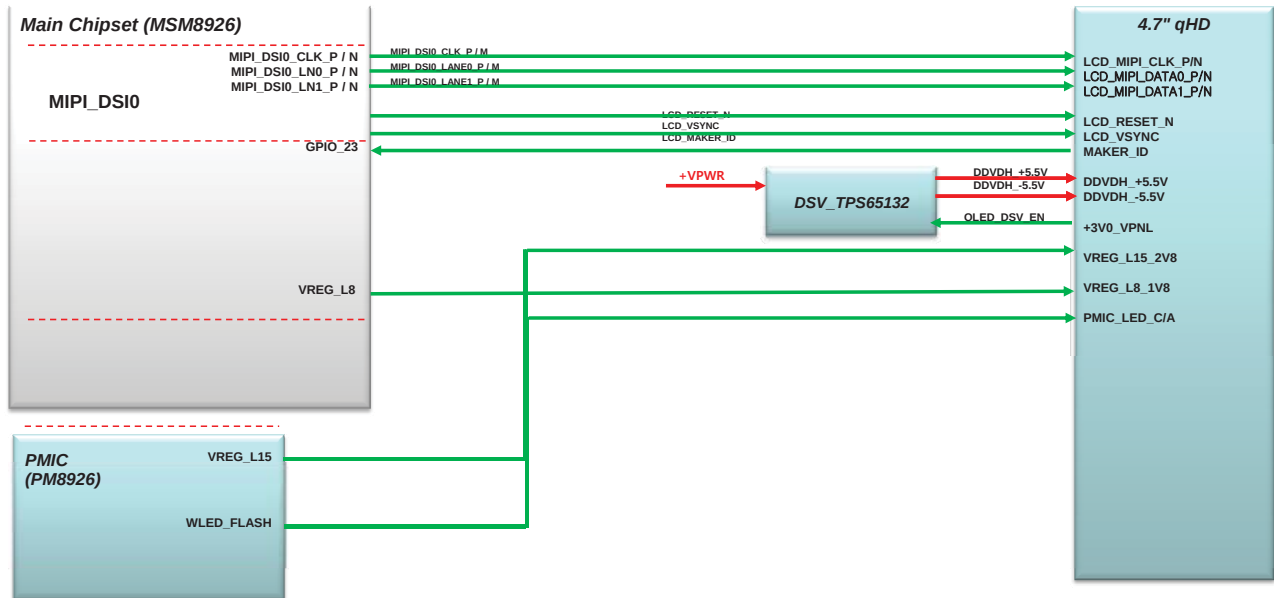


[LS740] Camera I/F

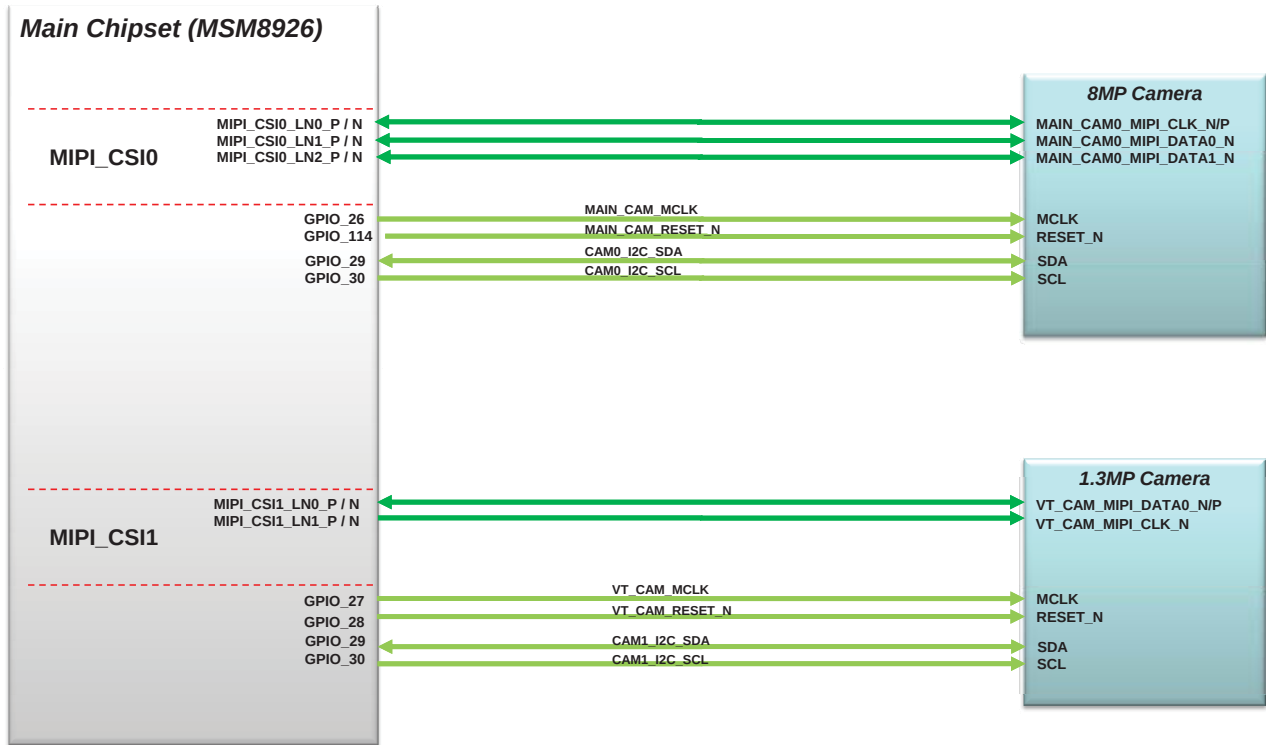


5. BLOCK DIAGRAM

[LS740] Sensor I/F

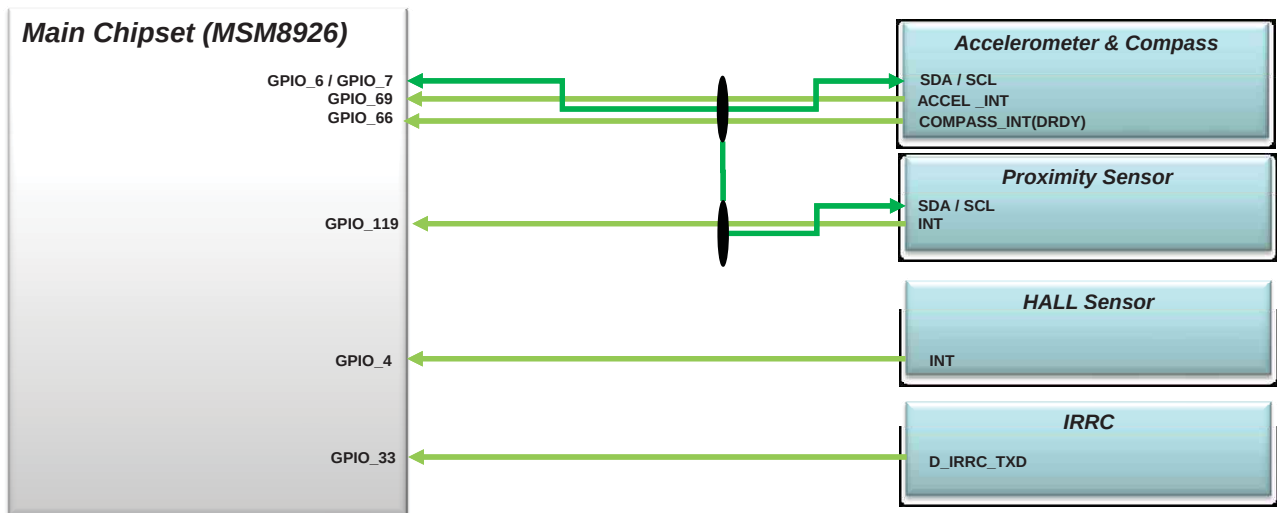


5. BLOCK DIAGRAM

[LS740] Audio

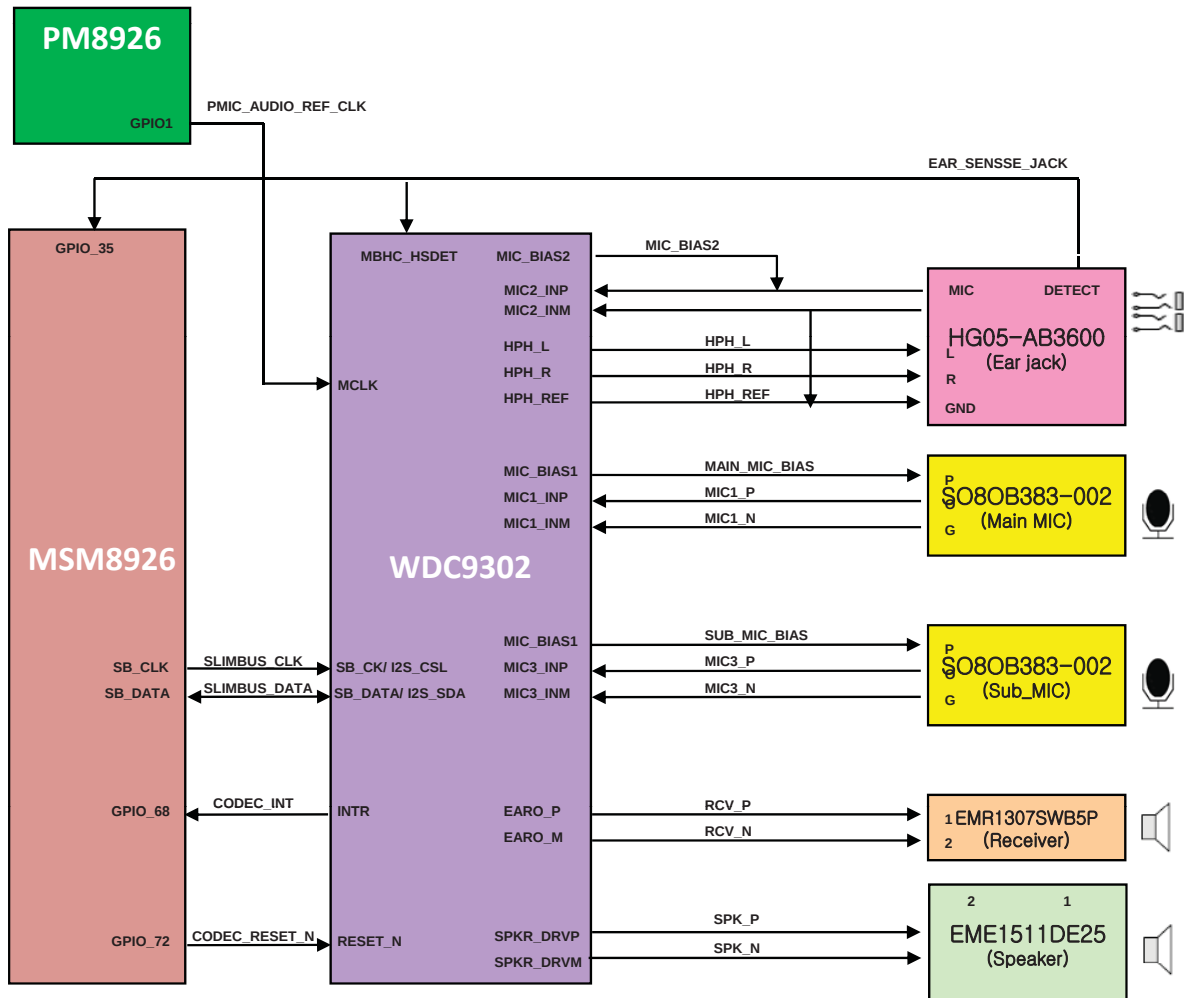


5. BLOCK DIAGRAM

[LS740] NFC

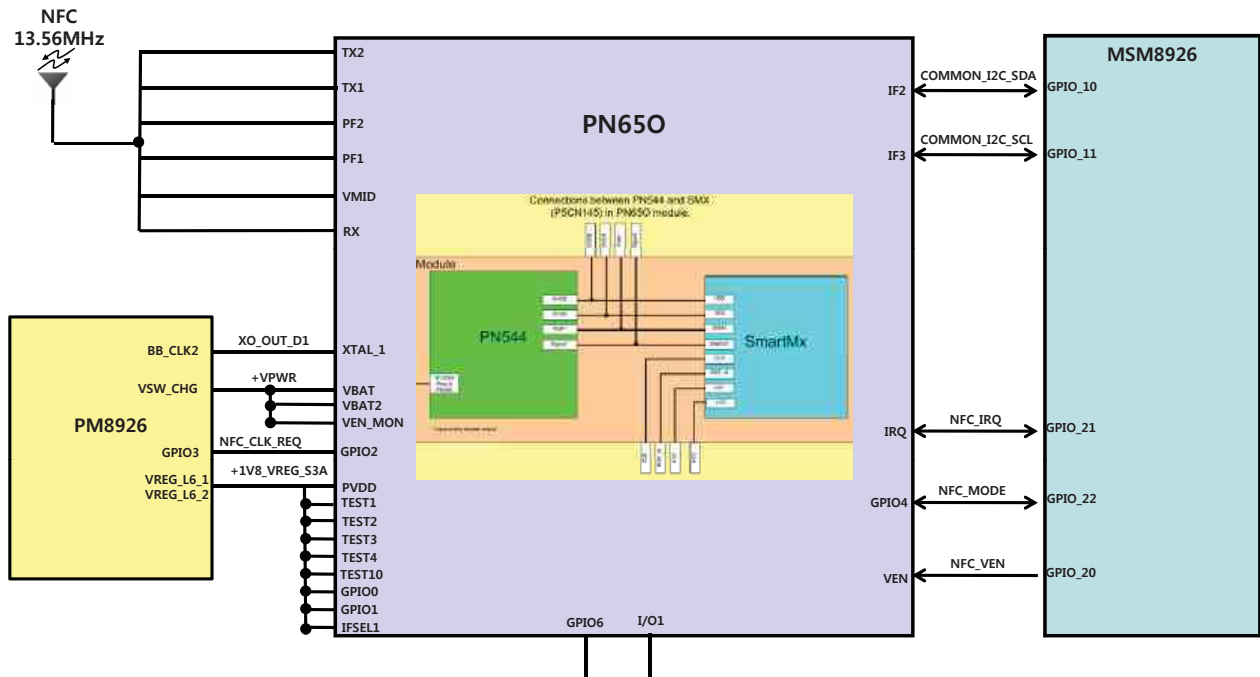


5. BLOCK DIAGRAM


[LS740] BT/Wi-Fi

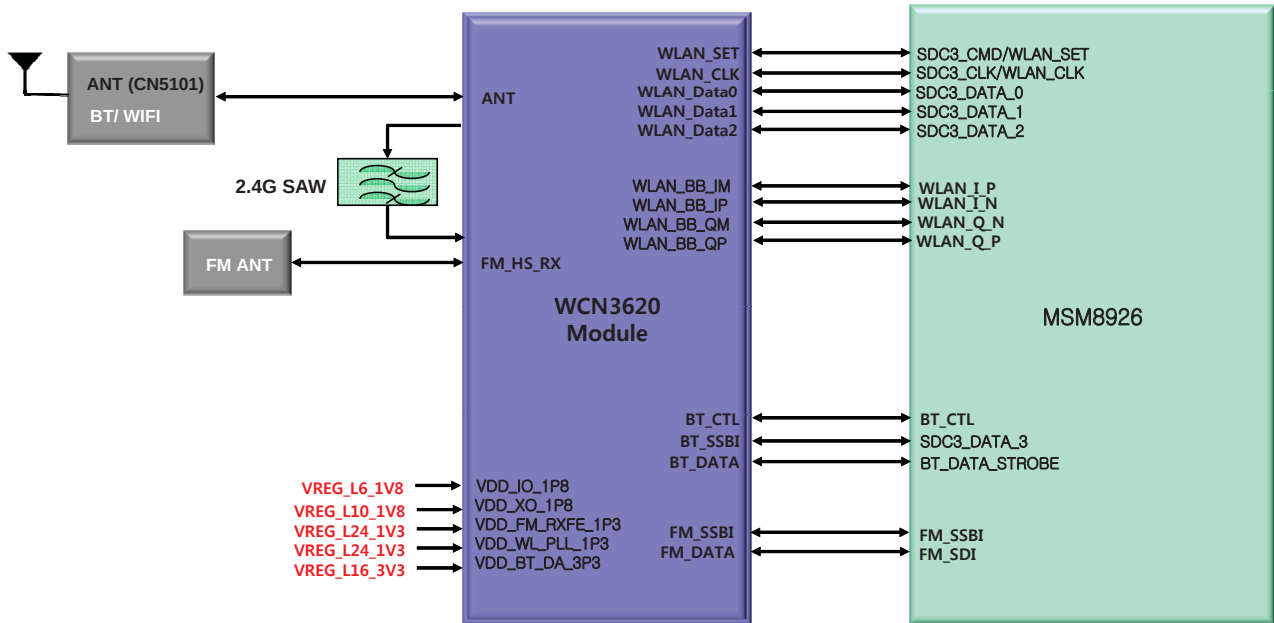

< 1-3-4-2_PT_APT_LM3263 > Rev_0.3

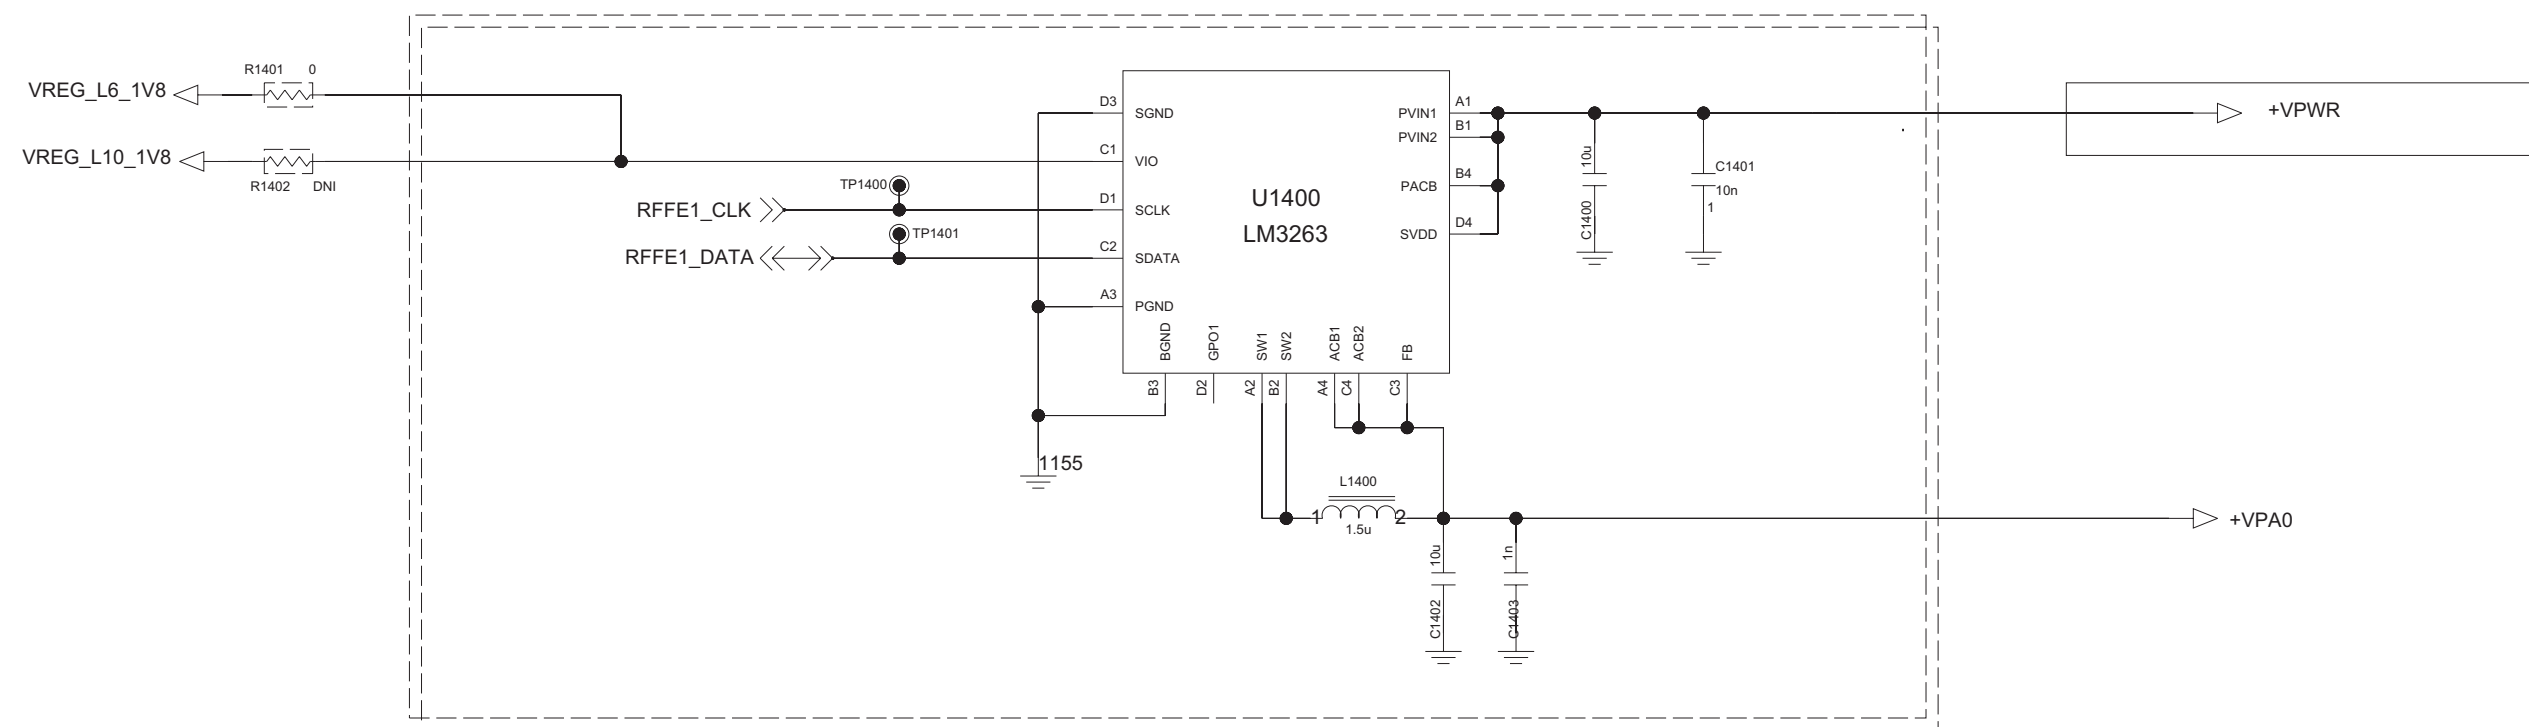


< 1-3-5-2_RFIC_SVLTE_WTR1625 > Rev_0.3

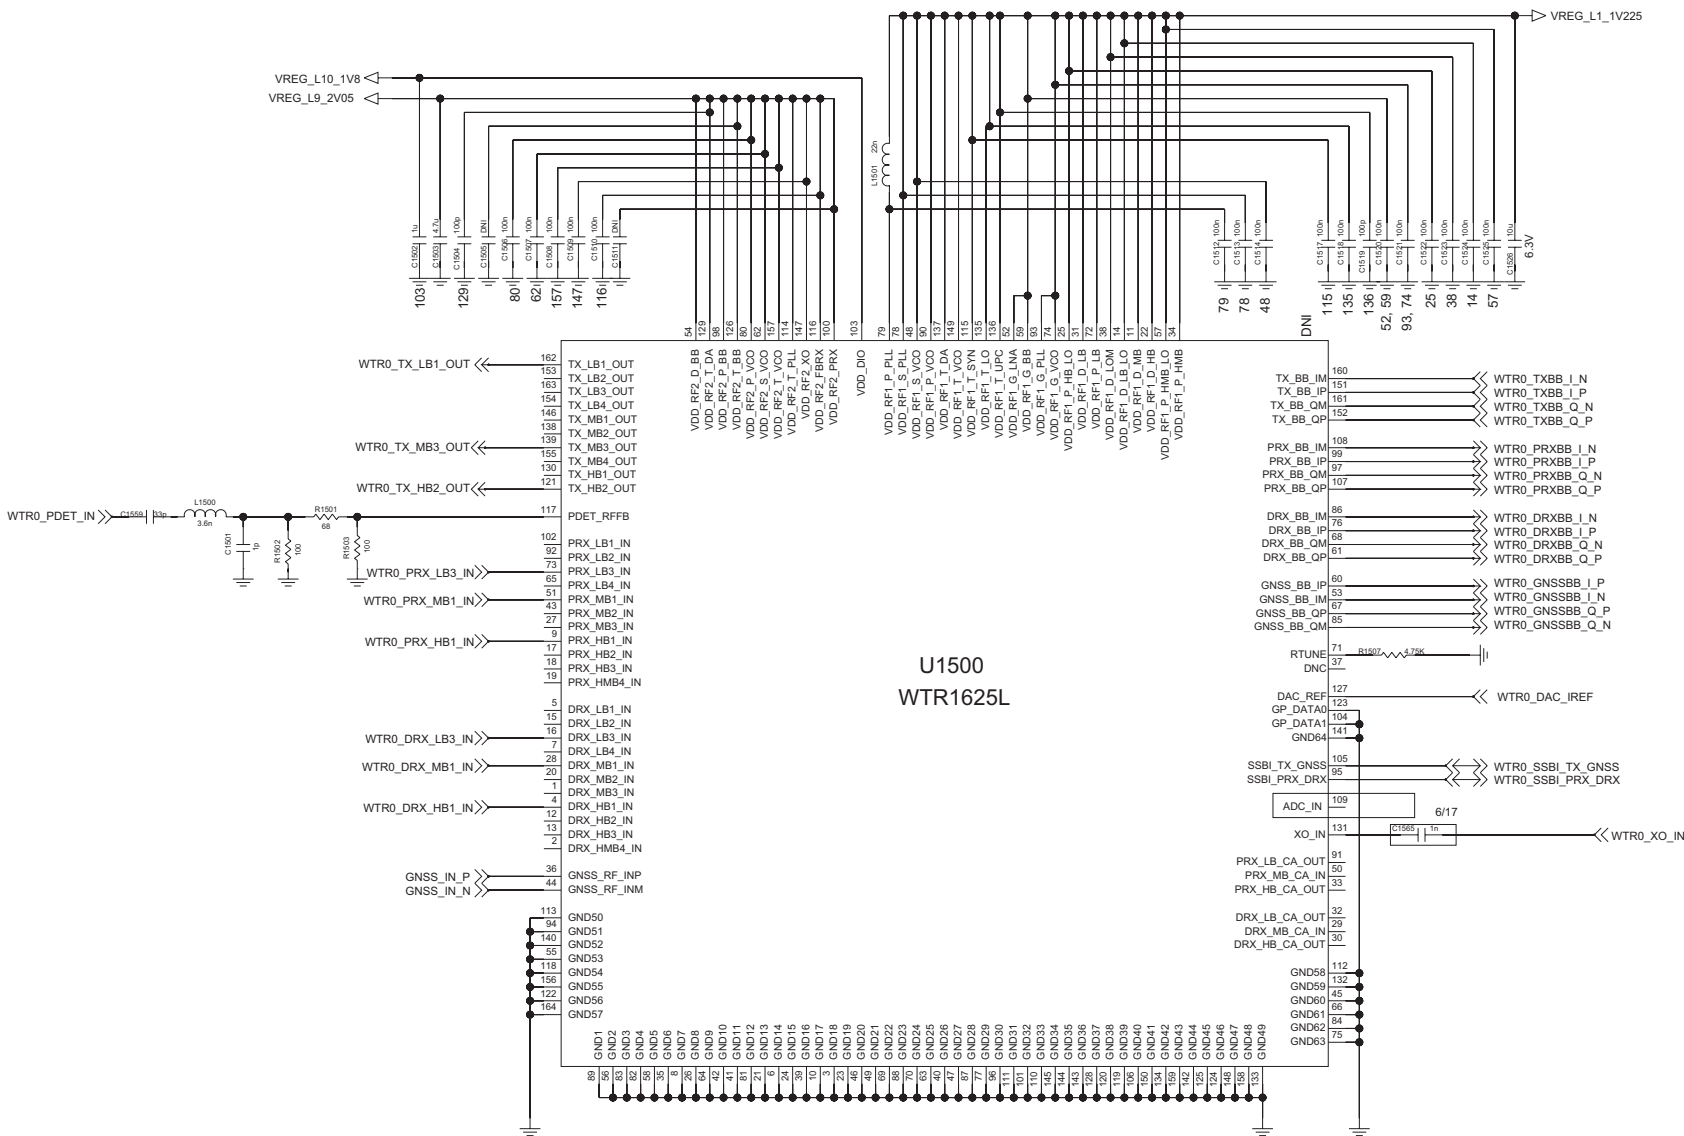



RF PORT MAP TABLE FOR WTR1625(L)+WFR2600 v01						
WTR1625 RF PORT MAPPING						
RF PORT	KR	DCM, KDDI	ATT, TMUS, SPC	EU, GLOBAL	VZW, USC	
TX, LB1, OUT	GSM, LB	GSM, LB	B5/26, BC0/10	B5/8, BC0	B5, B8	BC0
TX, LB2, OUT			GSM, LB	GSM, LB	GSM, LB	
TX, LB3, OUT	B17			B20		
TX, LB4, OUT	B5, B8	B6/18/19, BC0	B17		B12/13	
TX, MB1, OUT		B11/21		B34/39	B4	
TX, MB2, OUT	GSM, HB	GSM, HB	GSM, HB	GSM, HB	GSM, HB	
TX, MB3, OUT	B1, B2	B1, BC6	B1/2/25, BC1	B1/2	B1, B2	BC1
TX, MB4, OUT	B3, B4		B3/4	B3		
TX, HB1, OUT	B7	B41	B7	B7		
TX, HB2, OUT		B41	B41	B38/40		
PRX, LB1, IN	850, B5	B6/18/19, BC0	B29	B20		
PRX, LB2, IN	900, B8	900	900	900, B8	B8, G900	
PRX, LB3, IN			850, B5/26, BC0/10	850, B5, BC0	B5, G850	BC0
PRX, LB4, IN	B17		B17		B12/13	
PRX, MB1, IN	B2	B11/21	B2/25, BC1	B2	B4	
PRX, MB2, IN	GSM, HB	GSM, HB	GSM, HB	GSM, HB	G1800	
PRX, MB3, IN			B3	B3	B2, G1900	BC1
PRX, HB1, IN			B41	B38/40		
PRX, HB2, IN			B41	B34/39		
PRX, HB3, IN	B7		B7	B7		
PRX, HMB4, IN		B1, BC6	B1/4	B1	B1	
DRX, LB1, IN	B8		B29	B20		
DRX, LB2, IN	B5	B18/19, BC0		B8		
DRX, LB3, IN			B5/26		B5	BC0
DRX, LB4, IN	B17		B17		B12/13	
DRX, MB1, IN		B11/21	B2/25, BC1		B4	
DRX, MB2, IN				B39		
DRX, MB3, IN			B3	B3	B2	BC1
DRX, HB1, IN			B41	B38		
DRX, HB2, IN				B40		
DRX, HB3, IN	B7		B7	B7		
DRX, HMB4, IN		B1, BC6	B1/4	B1		
WFR1620 RF PORT MAPPING						
RF PORT	KR	DCM, KDDI	ATT, TMUS, SPC	EU, GLOBAL		
PRX, MB1, IN			B2/25, BC1			
PRX, MB2, IN	B3		B3			
PRX, MB3, IN	B1/4		B1/4			
DRX, MB1, IN			B2/25, BC1			
DRX, MB2, IN	B3					
DRX, MB3, IN	B1/4		B1/4			

< 1-3-6-2_TRX_SPCS_BC0_BC1 > Rev_0.1

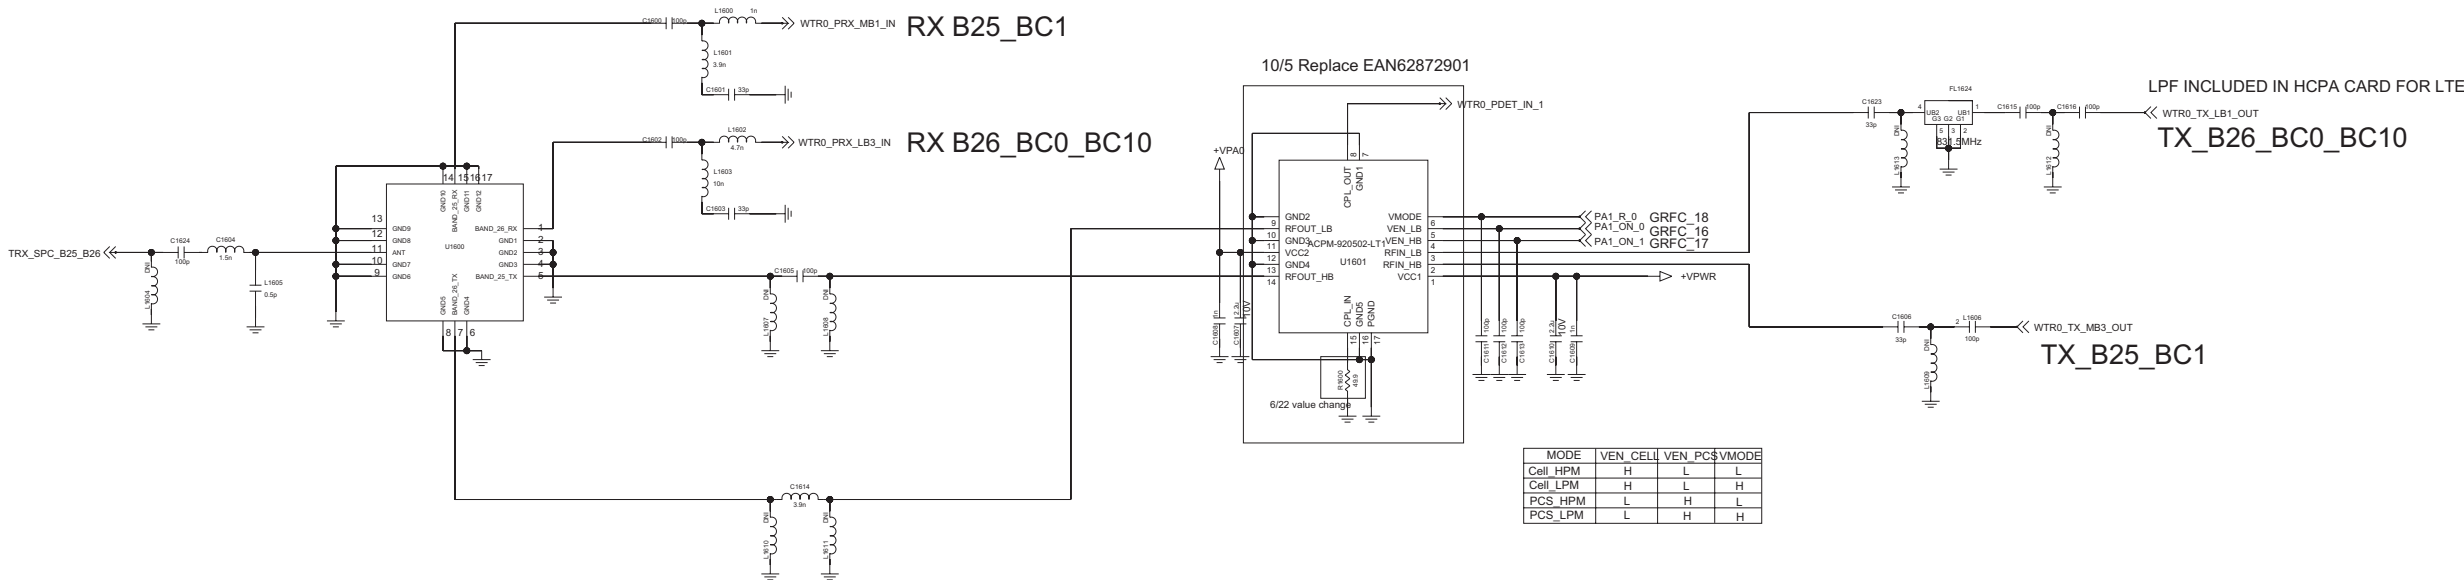

< 1-3-6-7_TRX_B7_TX_B41 > Rev_0.1

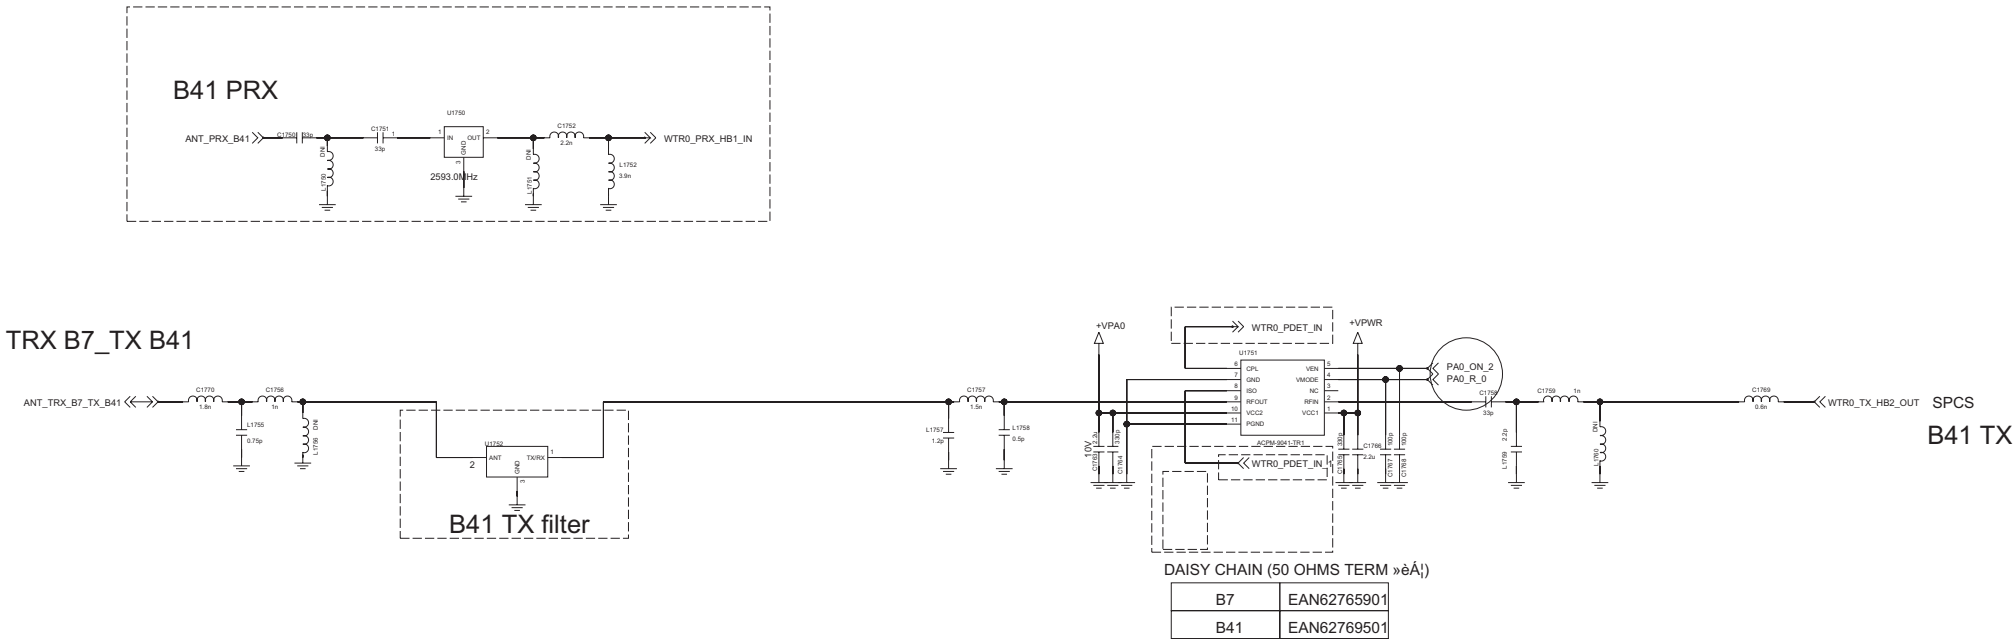


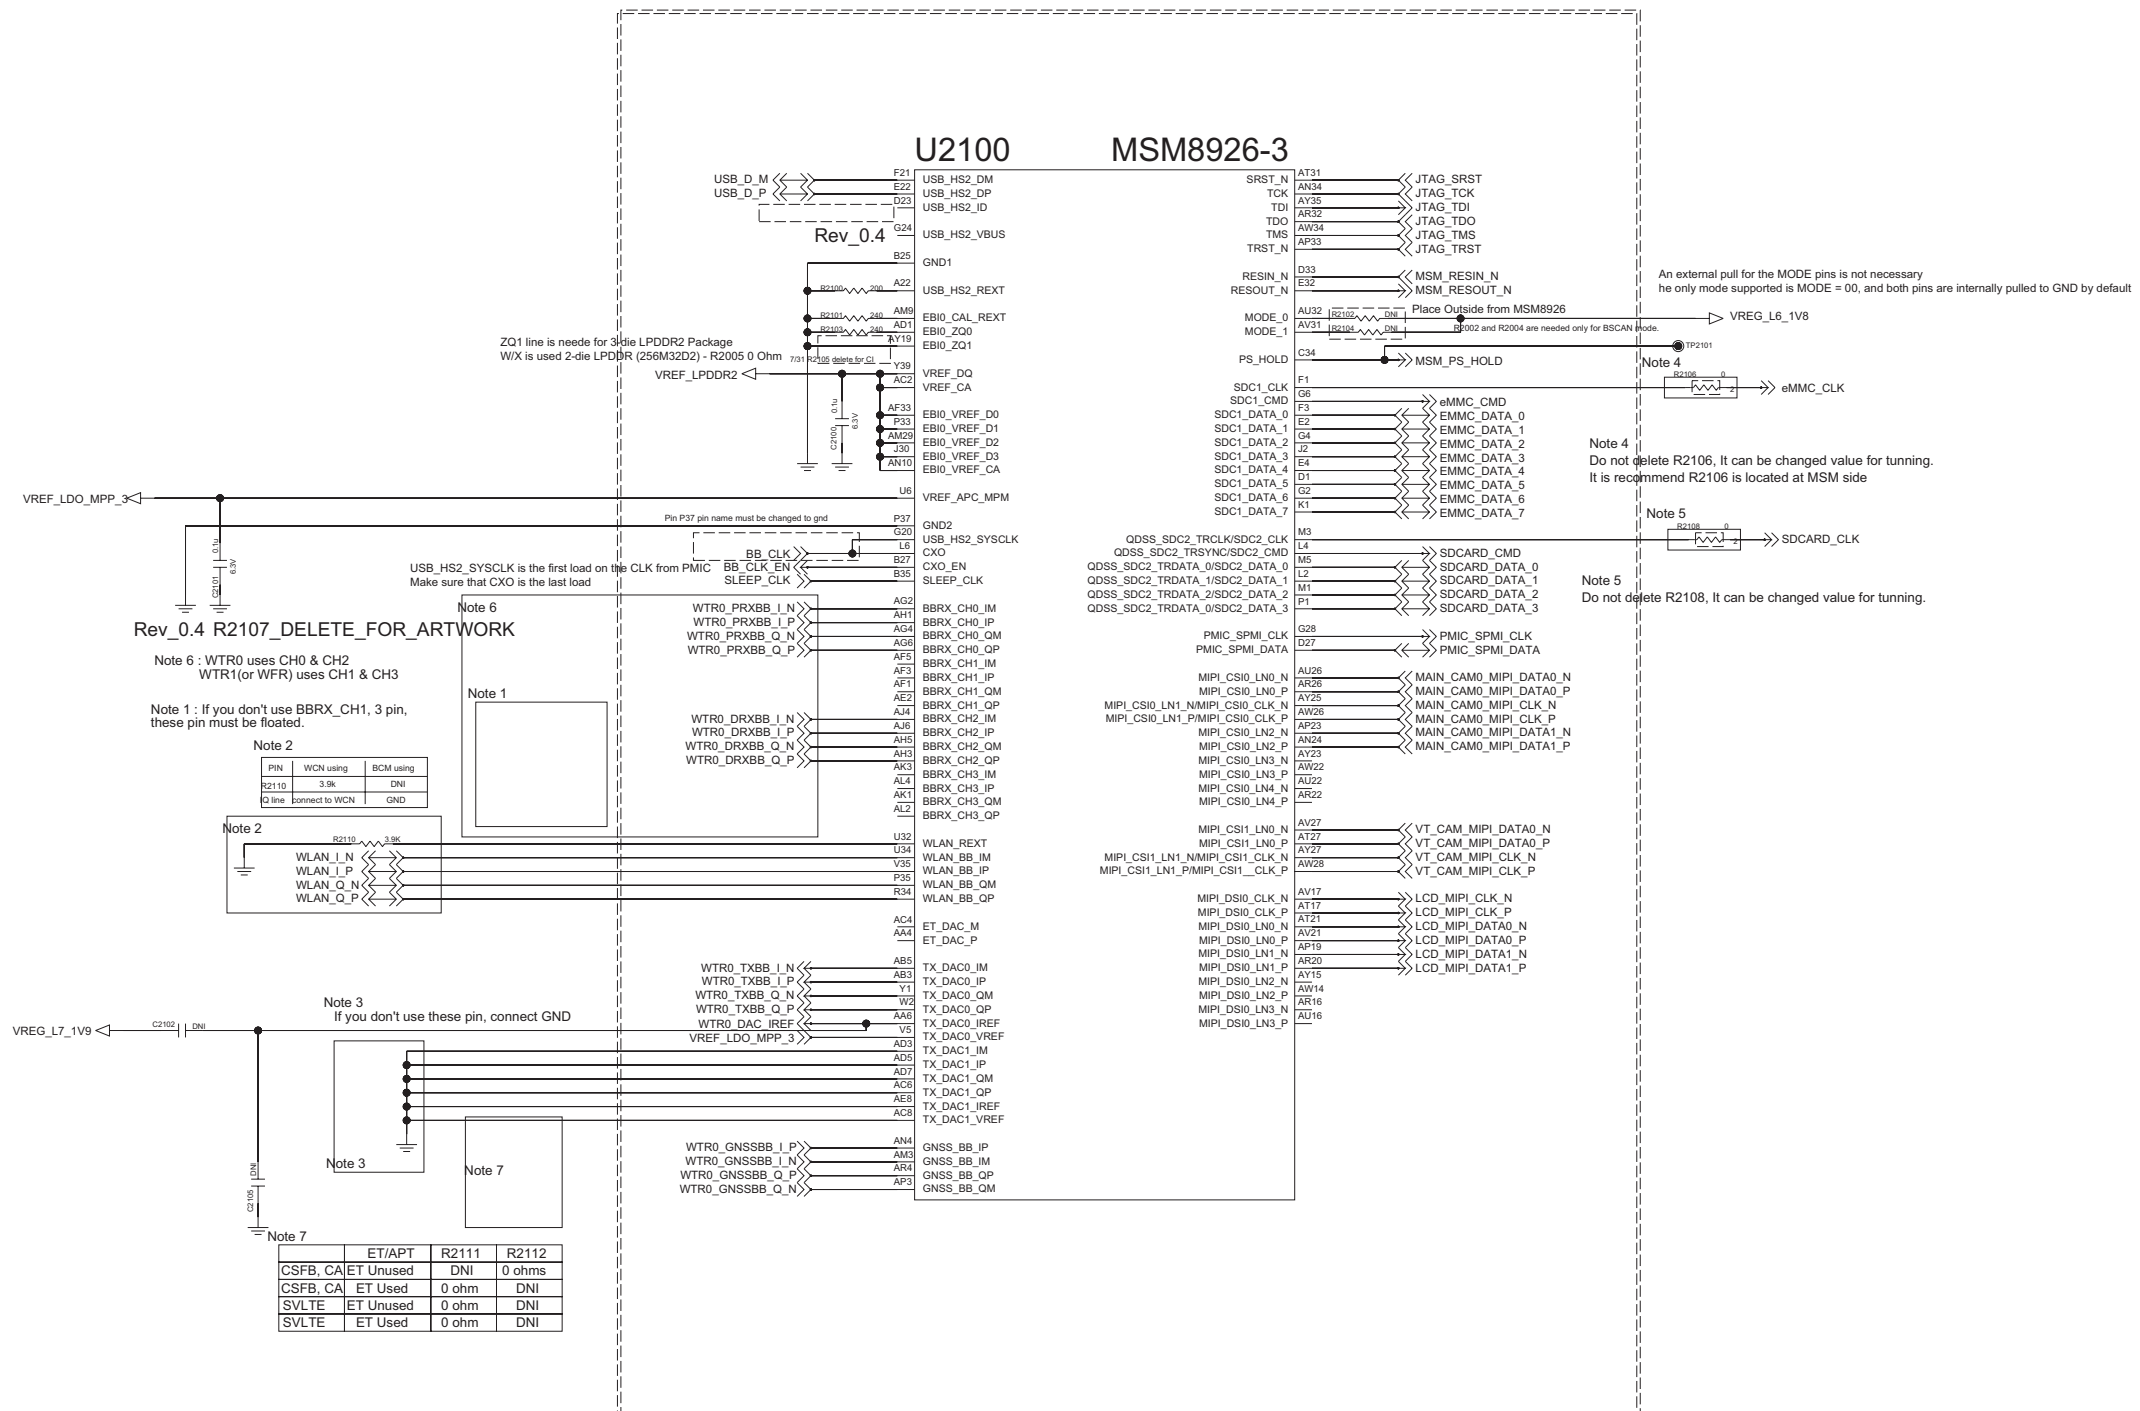




Note 8


Note 8
If you don't use TDMB, delete this box

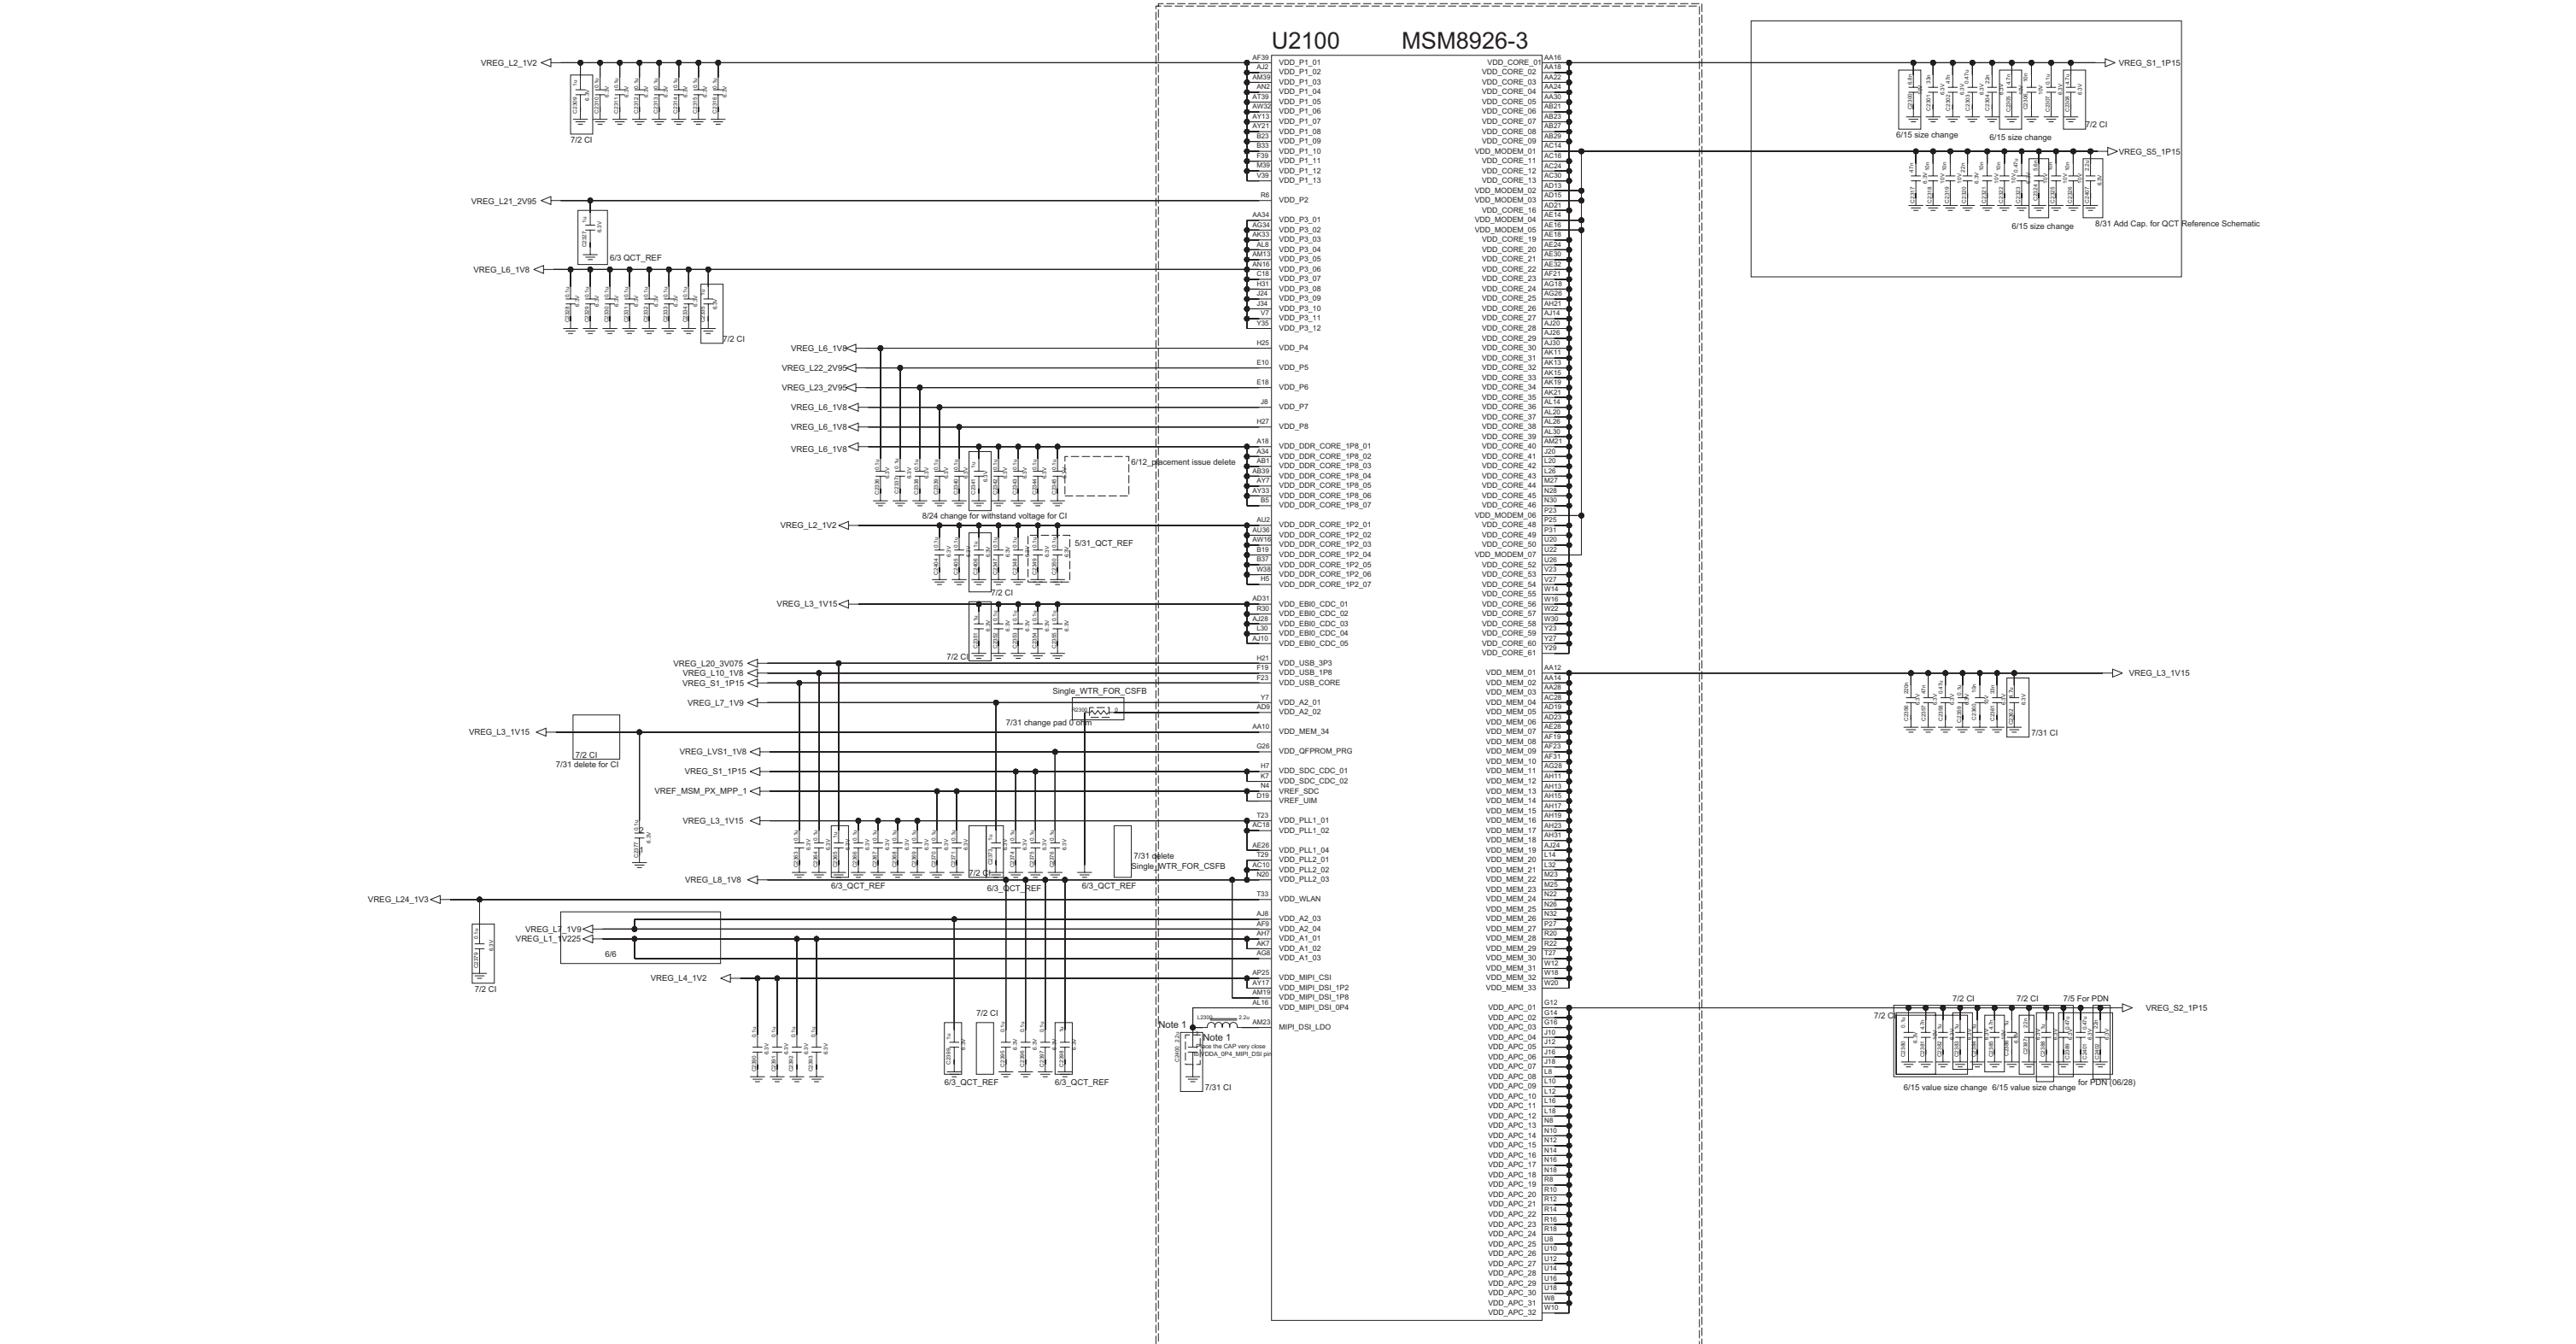


<2-1-3-5-4_MSM8926-3_GND_NC> Rev_0.3

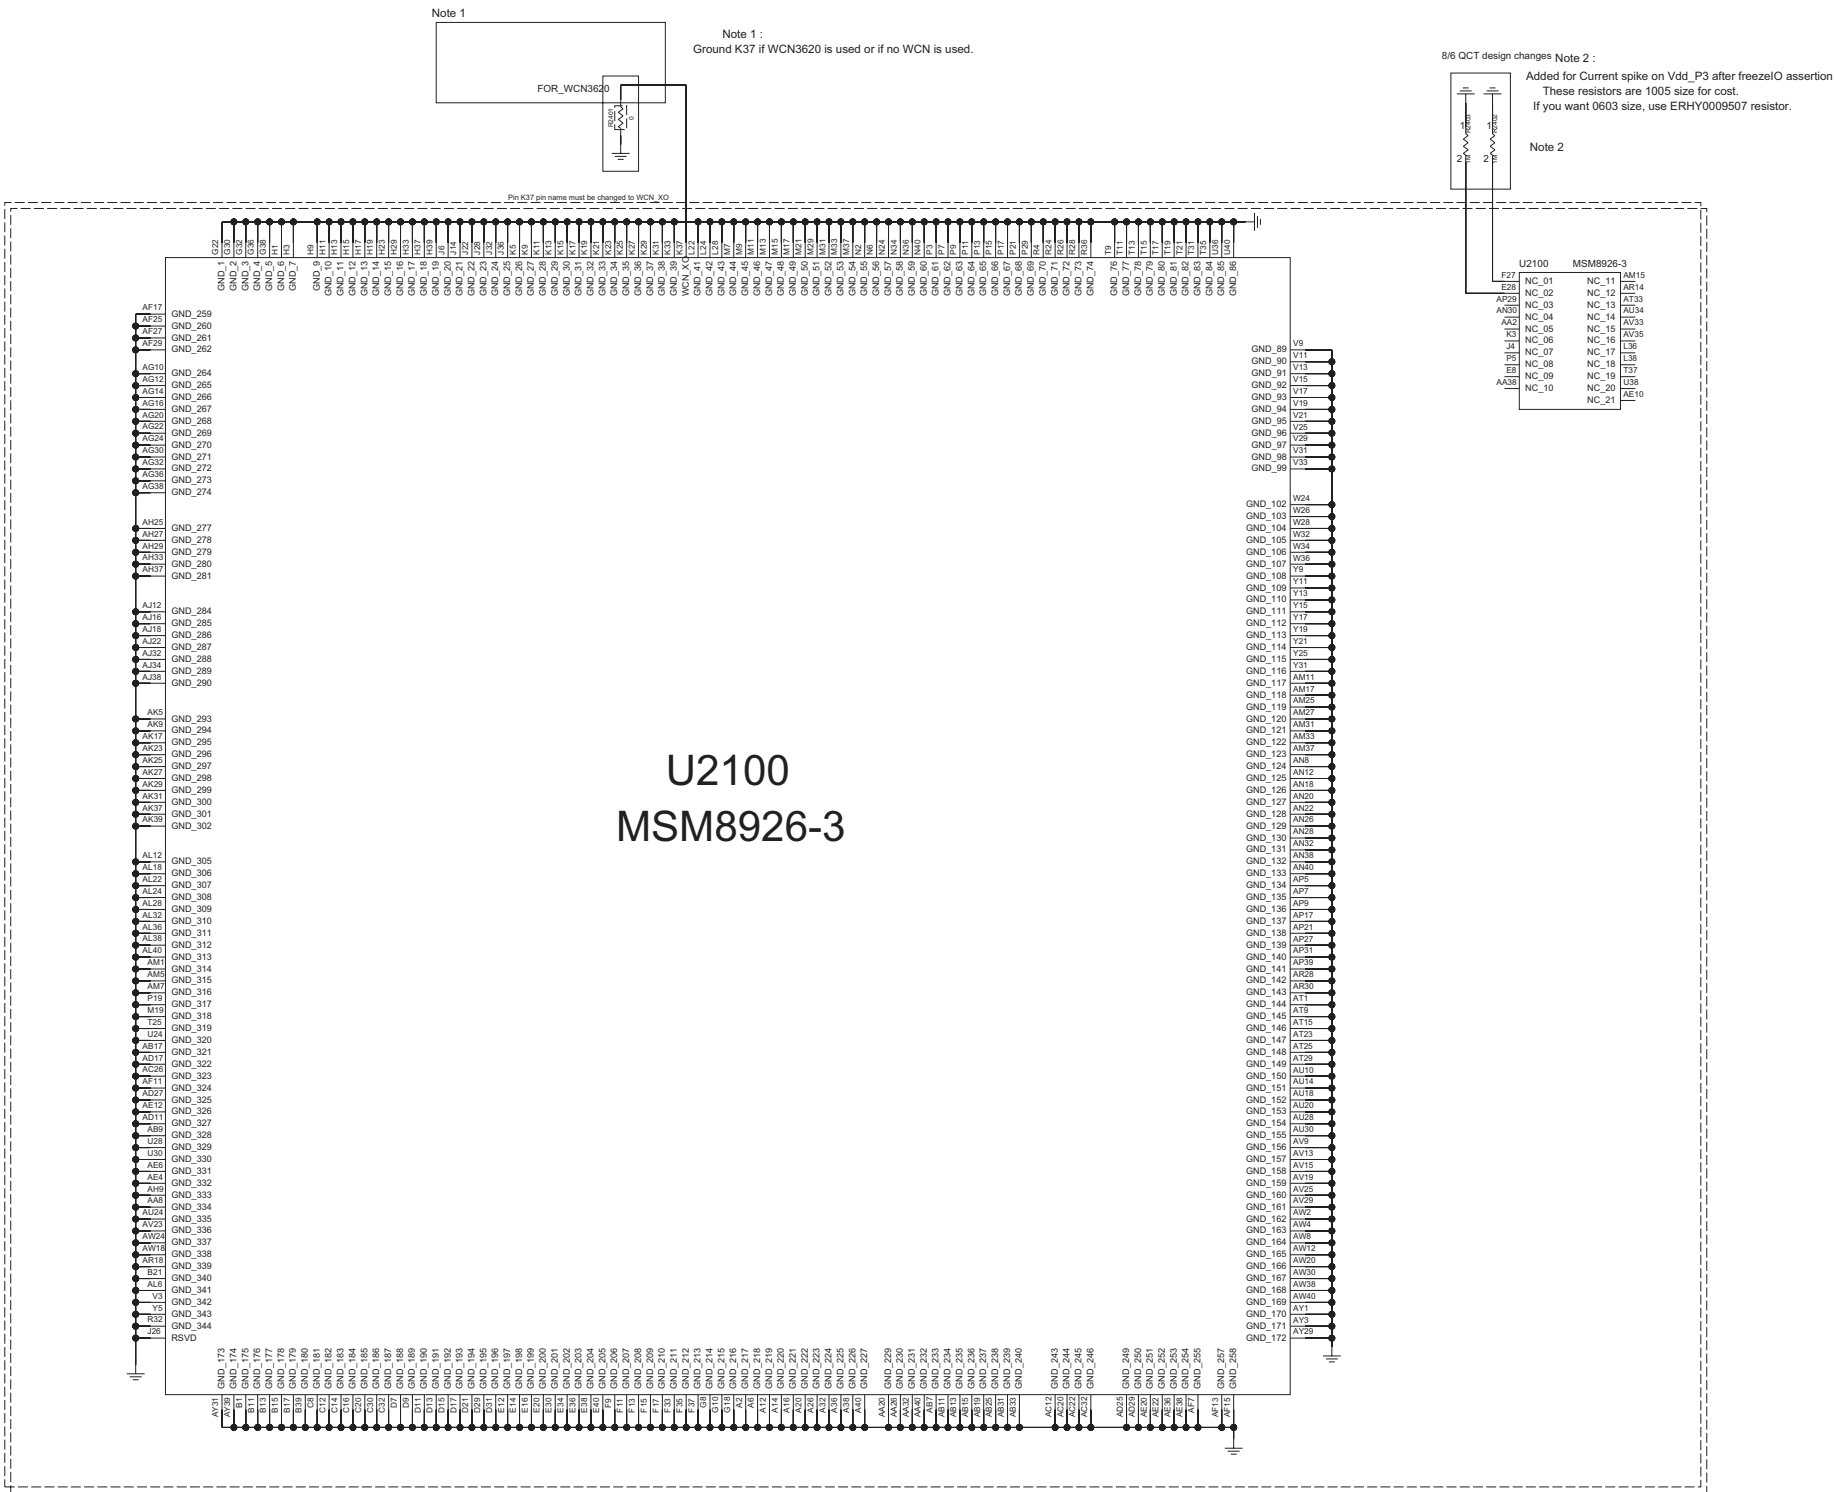


<3-1-2-3-3_LPDDR2_POP_8Gbit_Micron> Rev_0.3

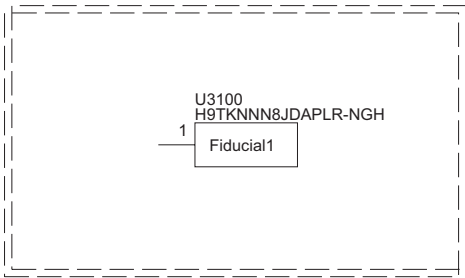


< 3-2-2-1-1_eMMC_v4_5_8GB_Toshiba > Rev_0.3

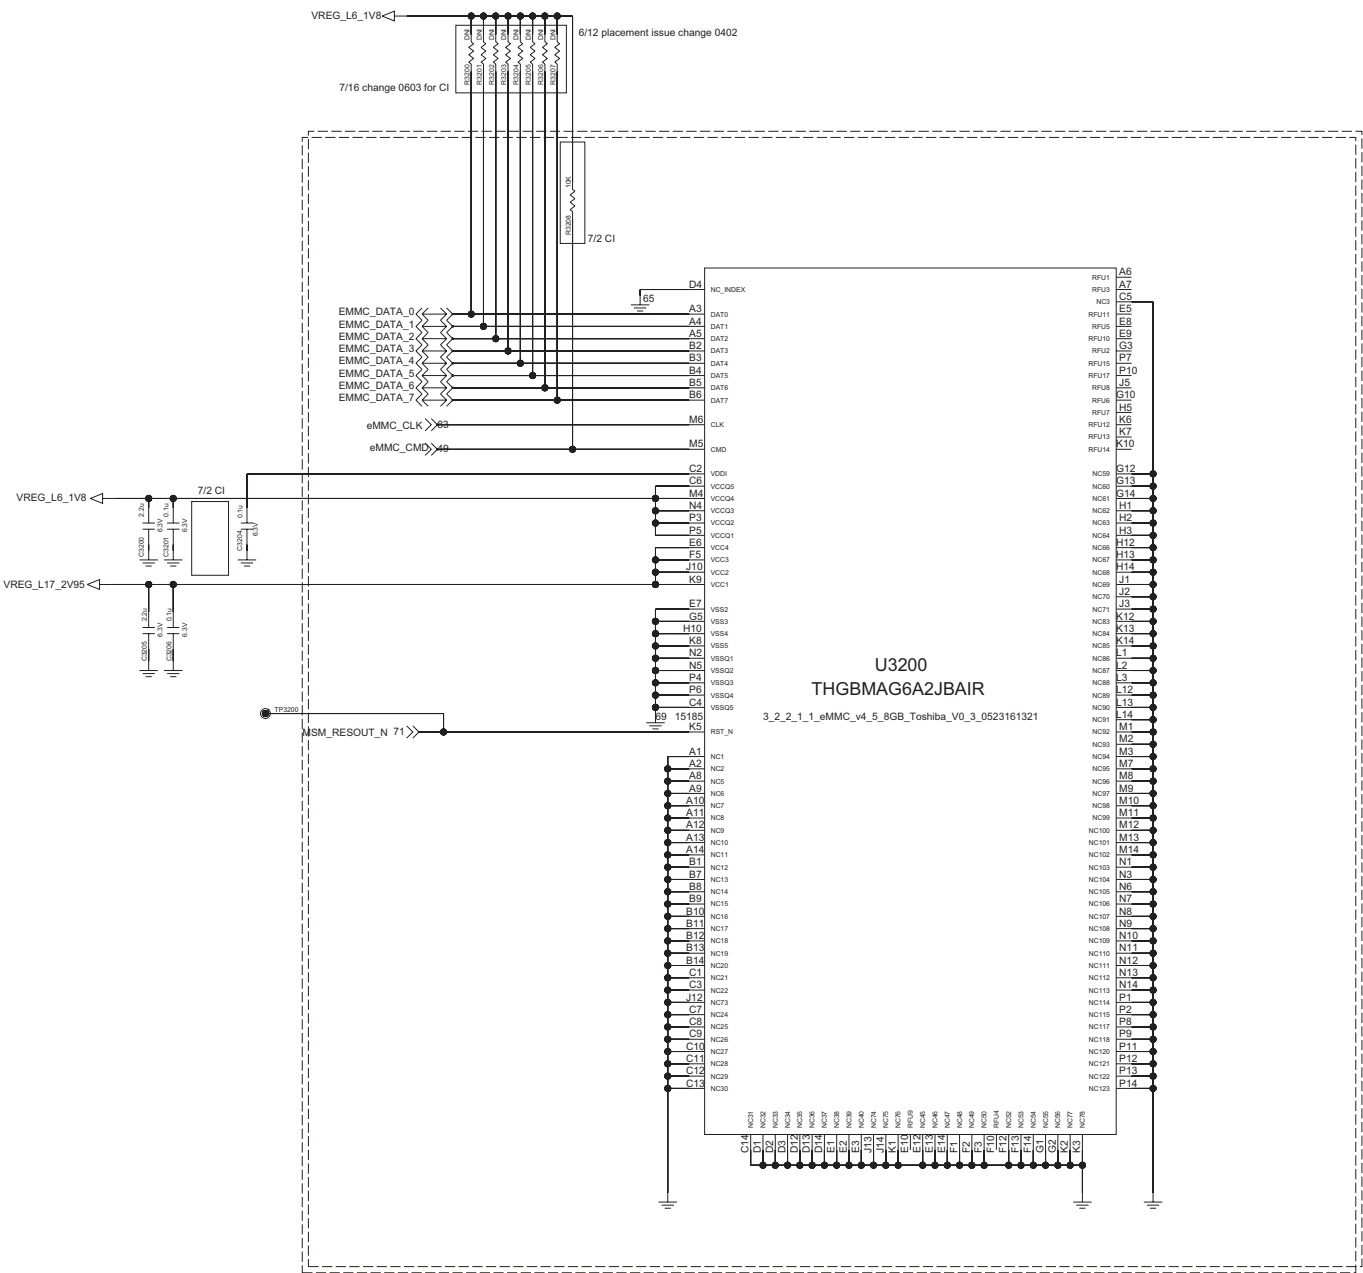




<4-1-3-2_PMIC_PM8926_POWER> Rev_0.6

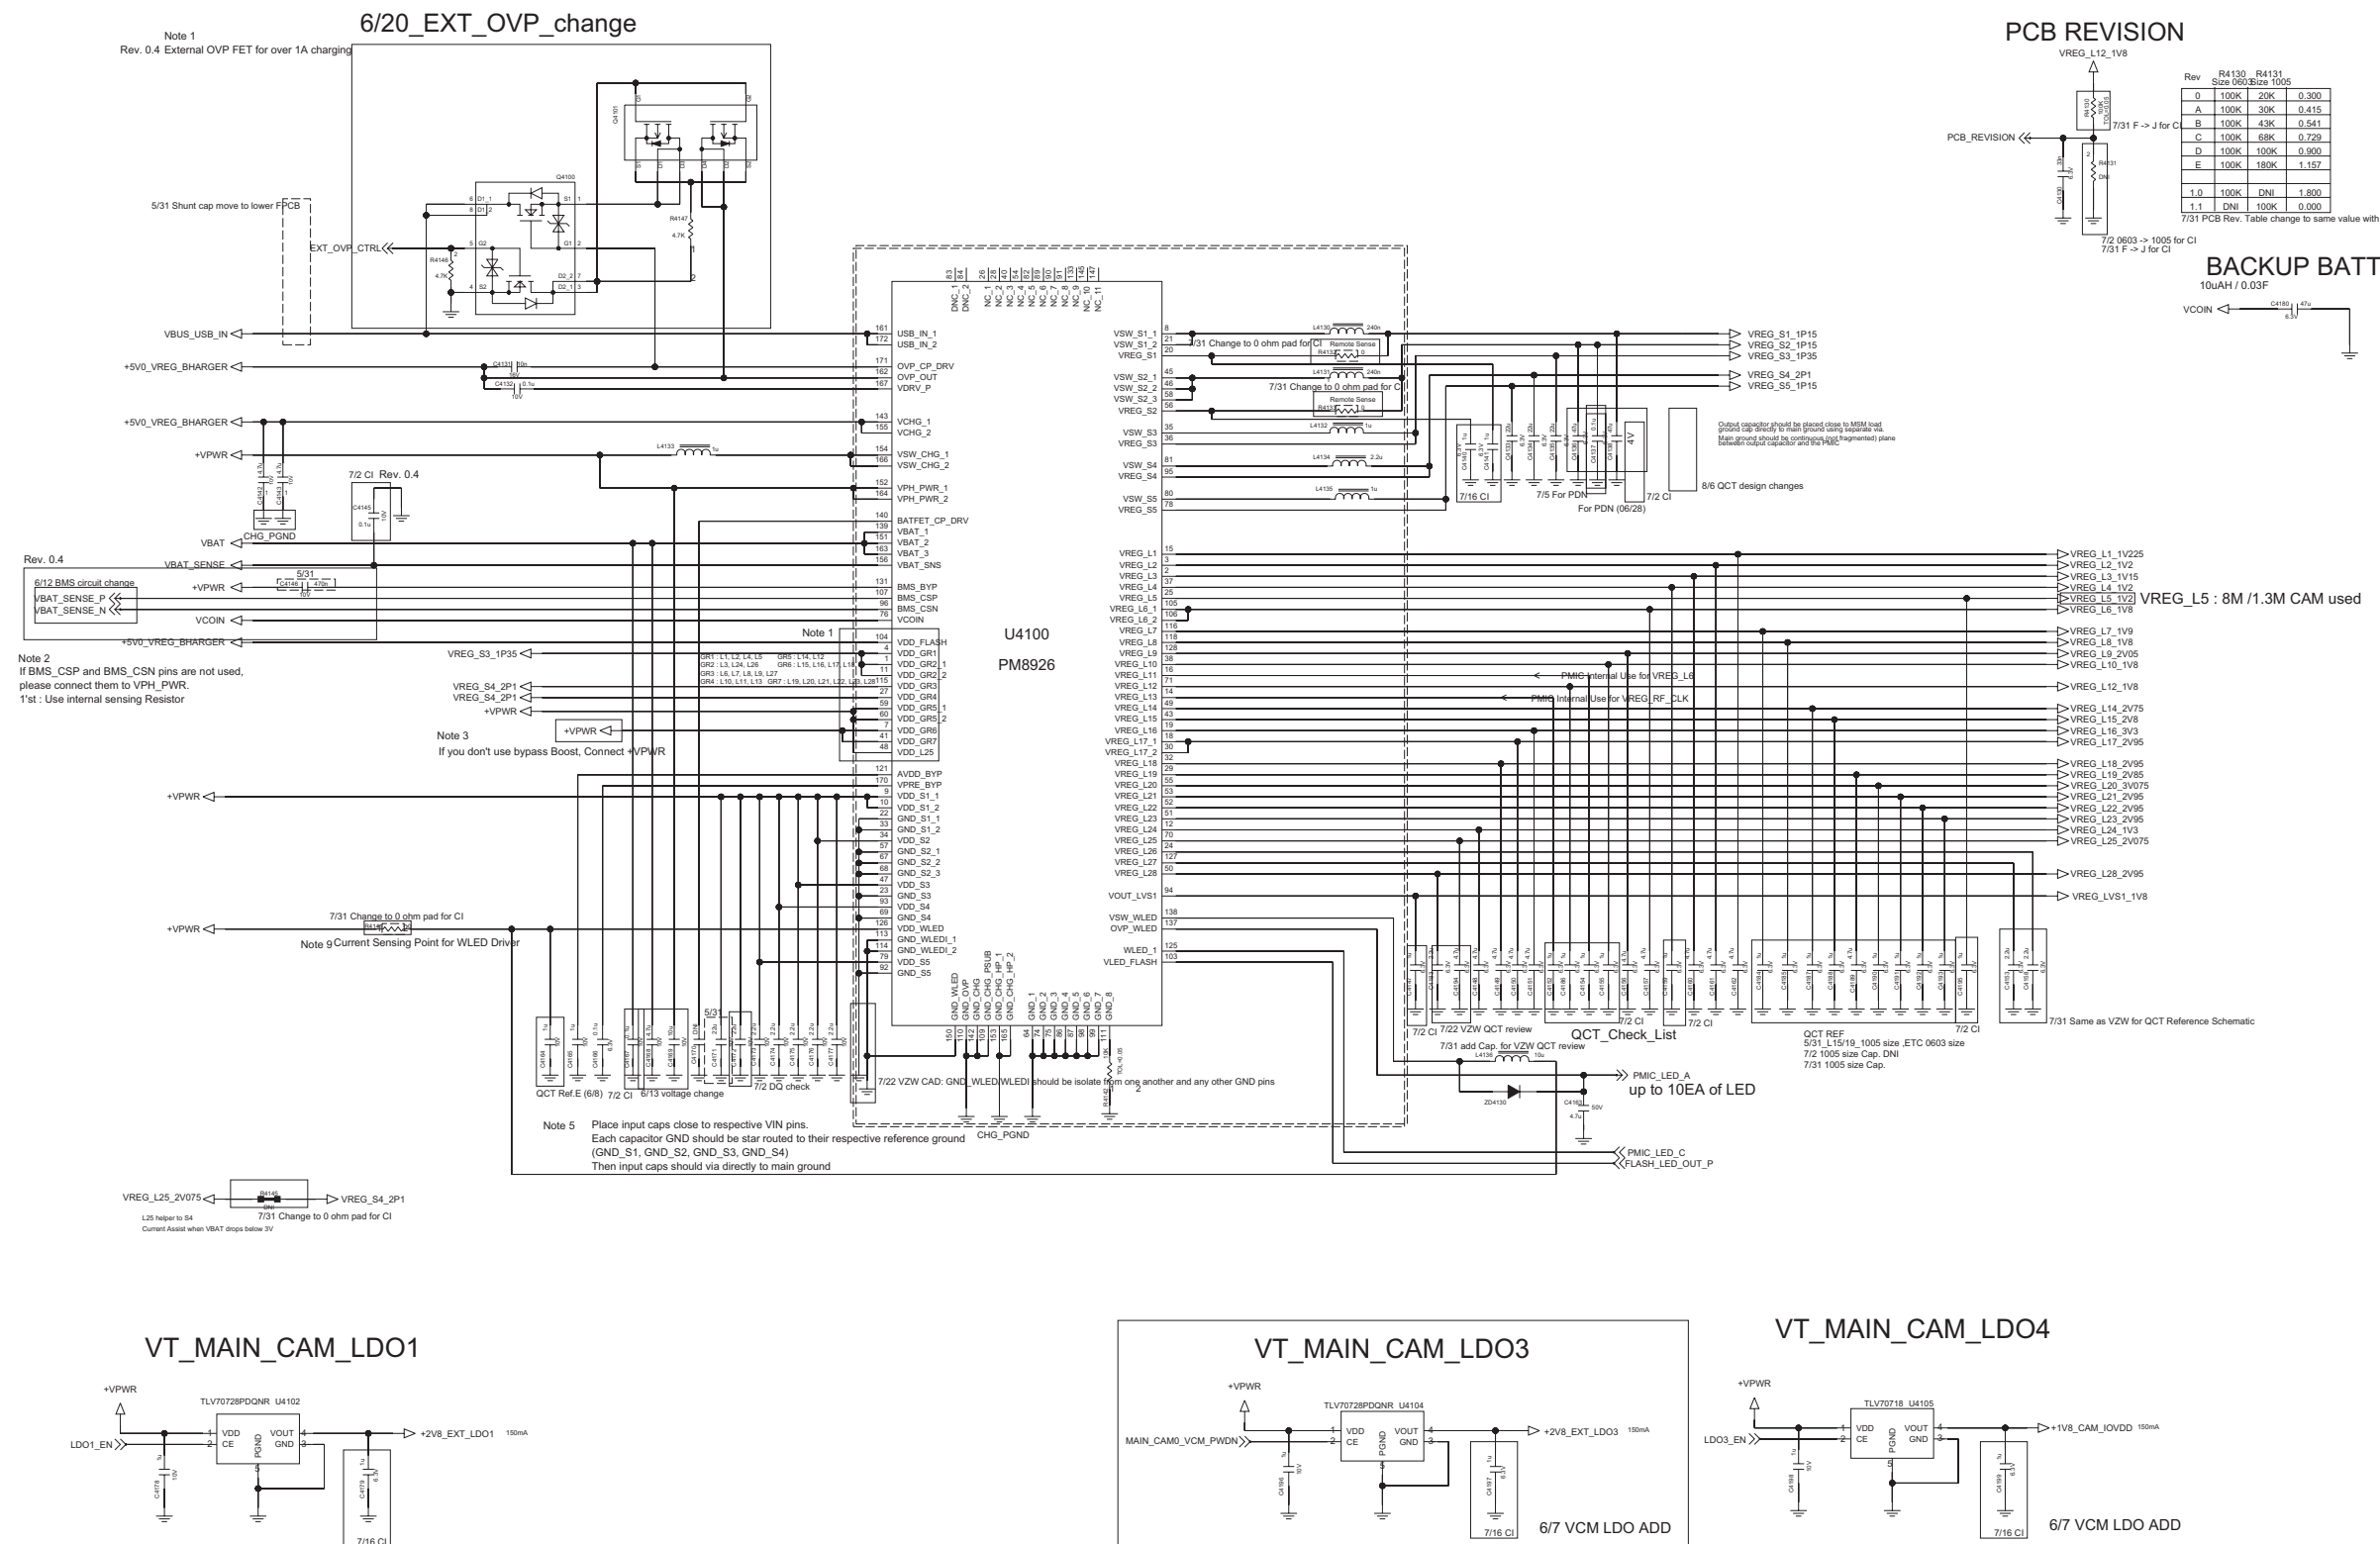


<4-6-1_LED_Driver_IC_LP5521> REV.0.4

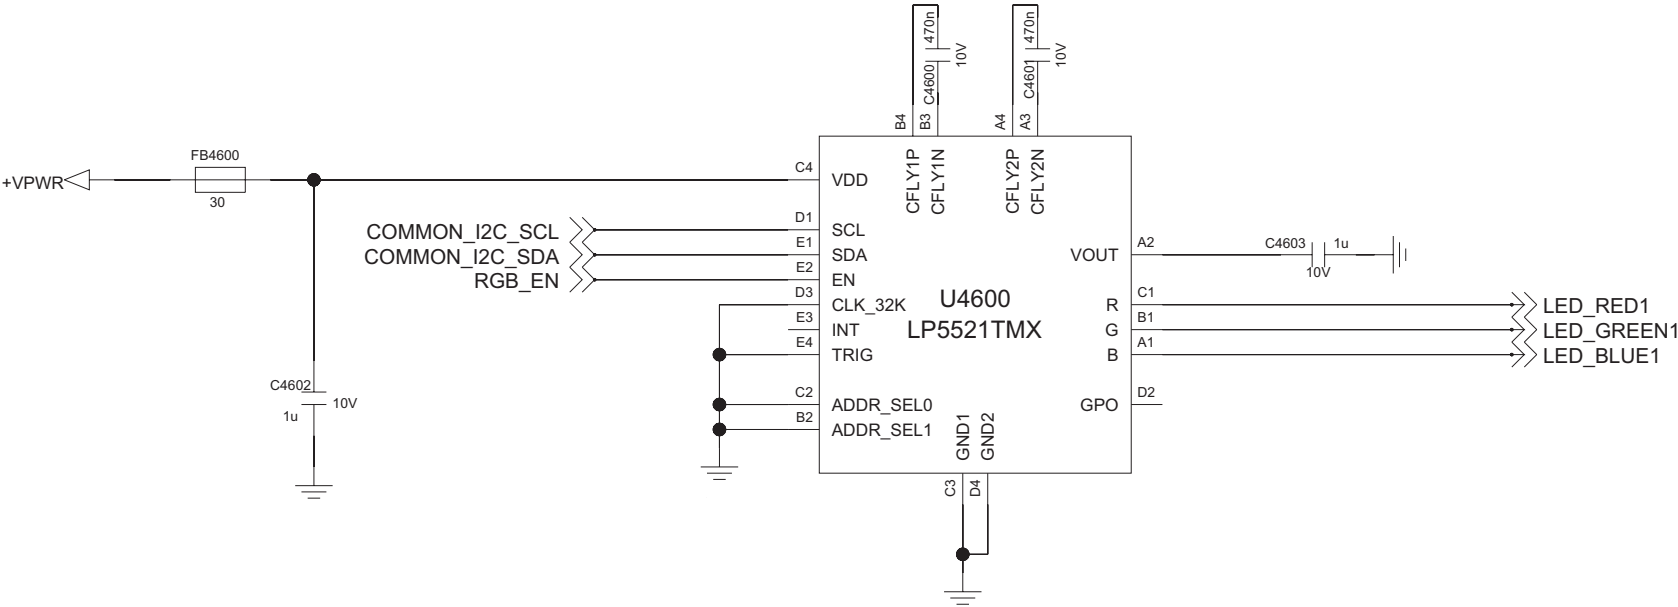


<5-1-1-4> BT/WiFi Combo_WCN3620 REV.0.4


RF Filter

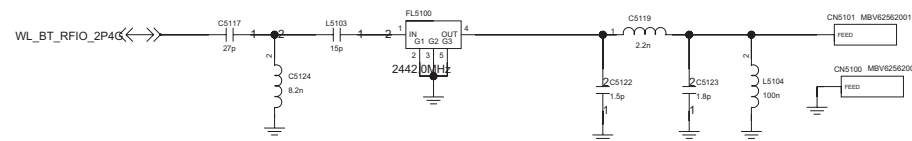


POWER/GND

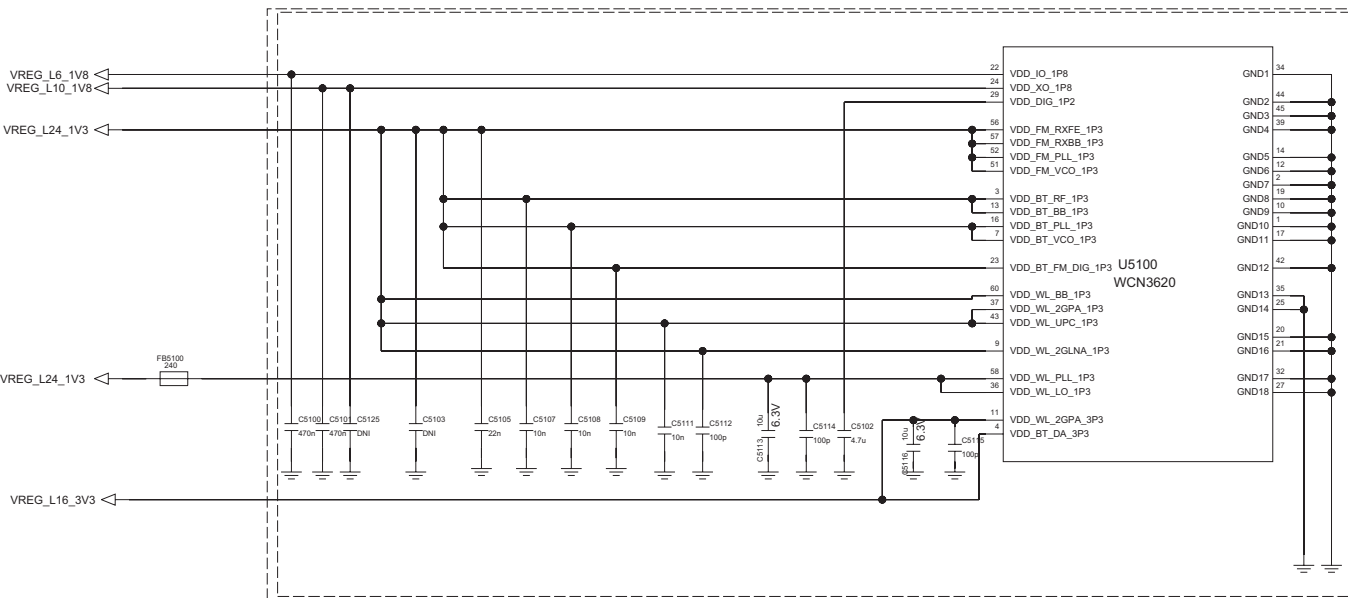


RF/CONTROL

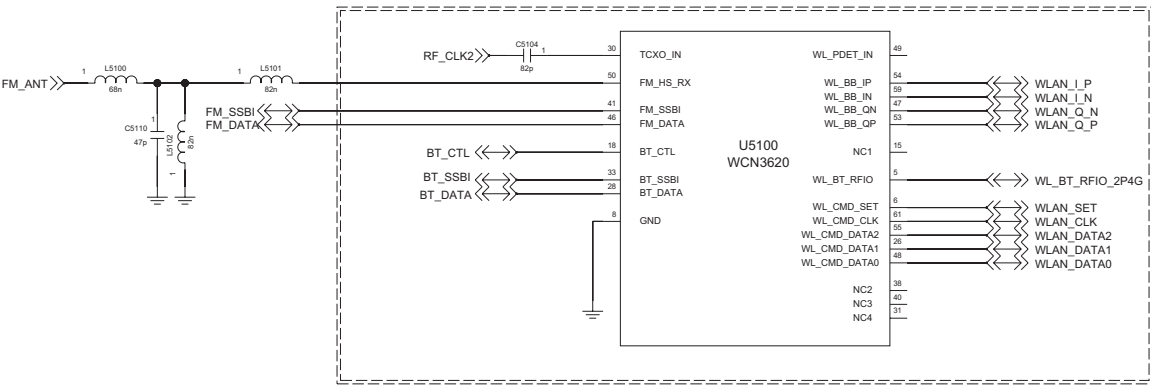


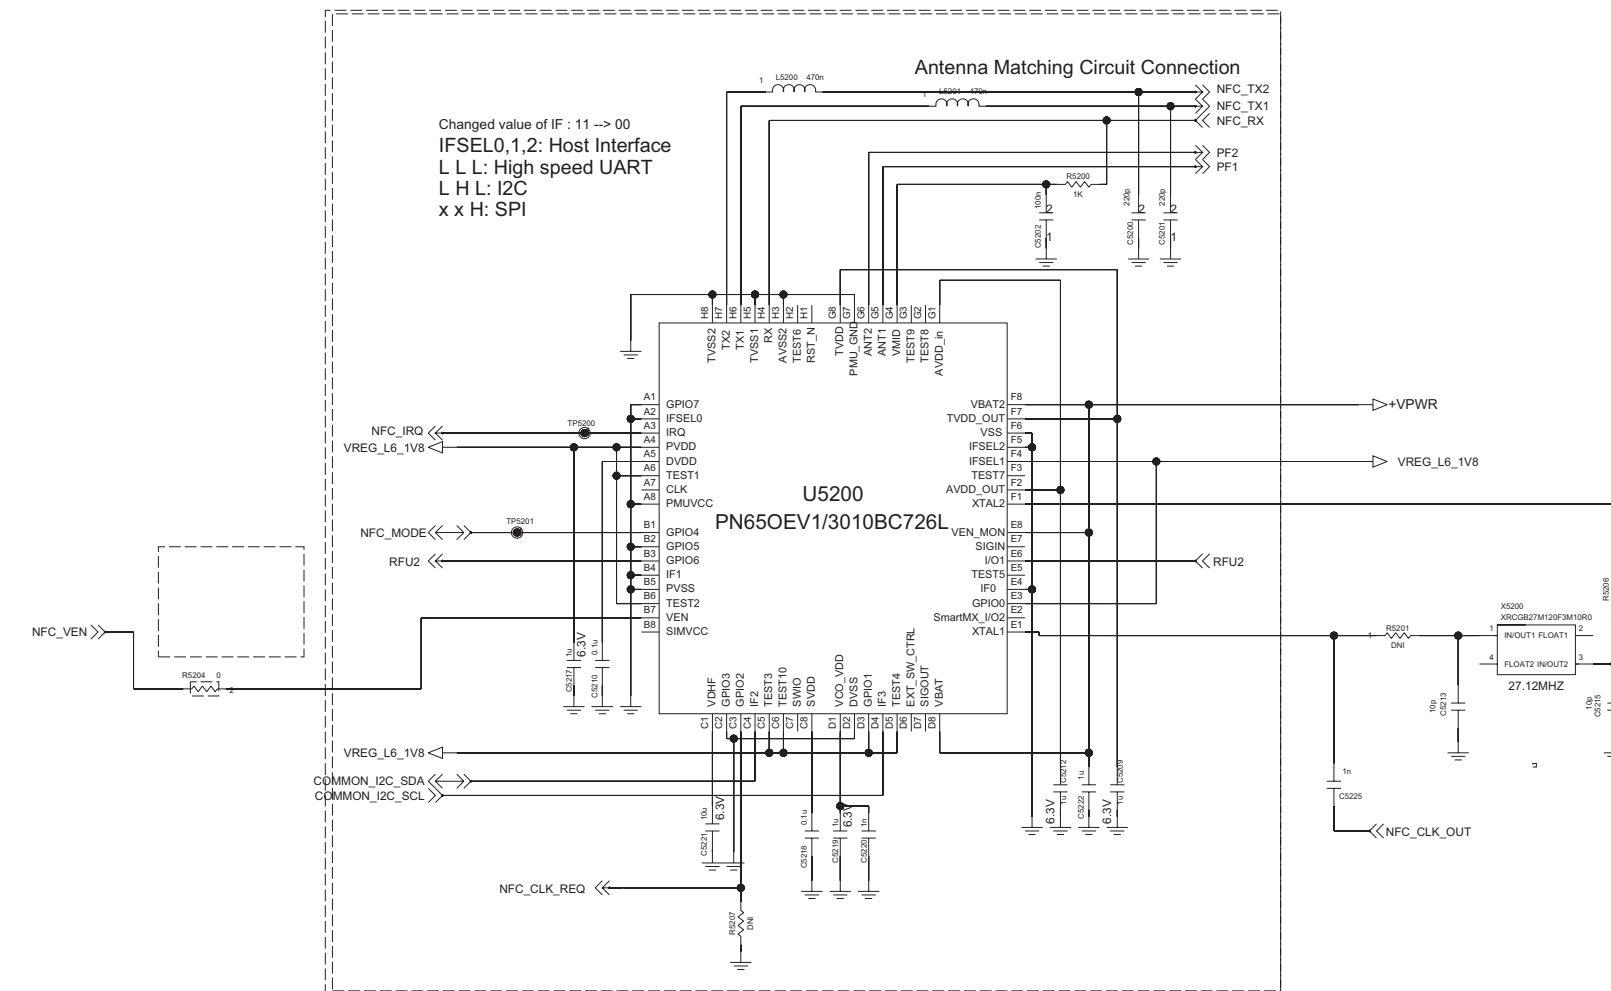

NFC Antenna

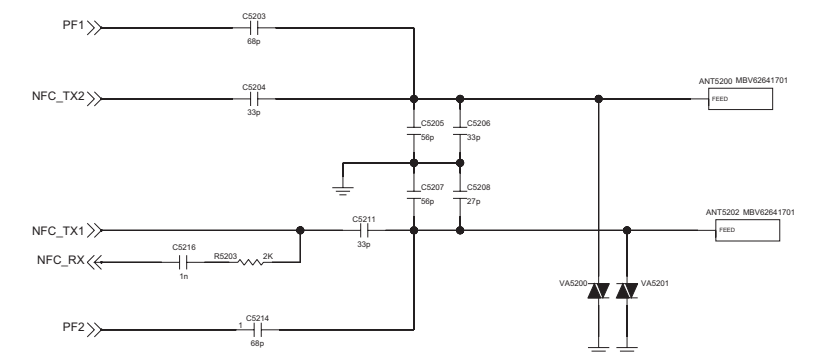


< 6-1-1-1_Codec_WCD9302 > Rev_0.3

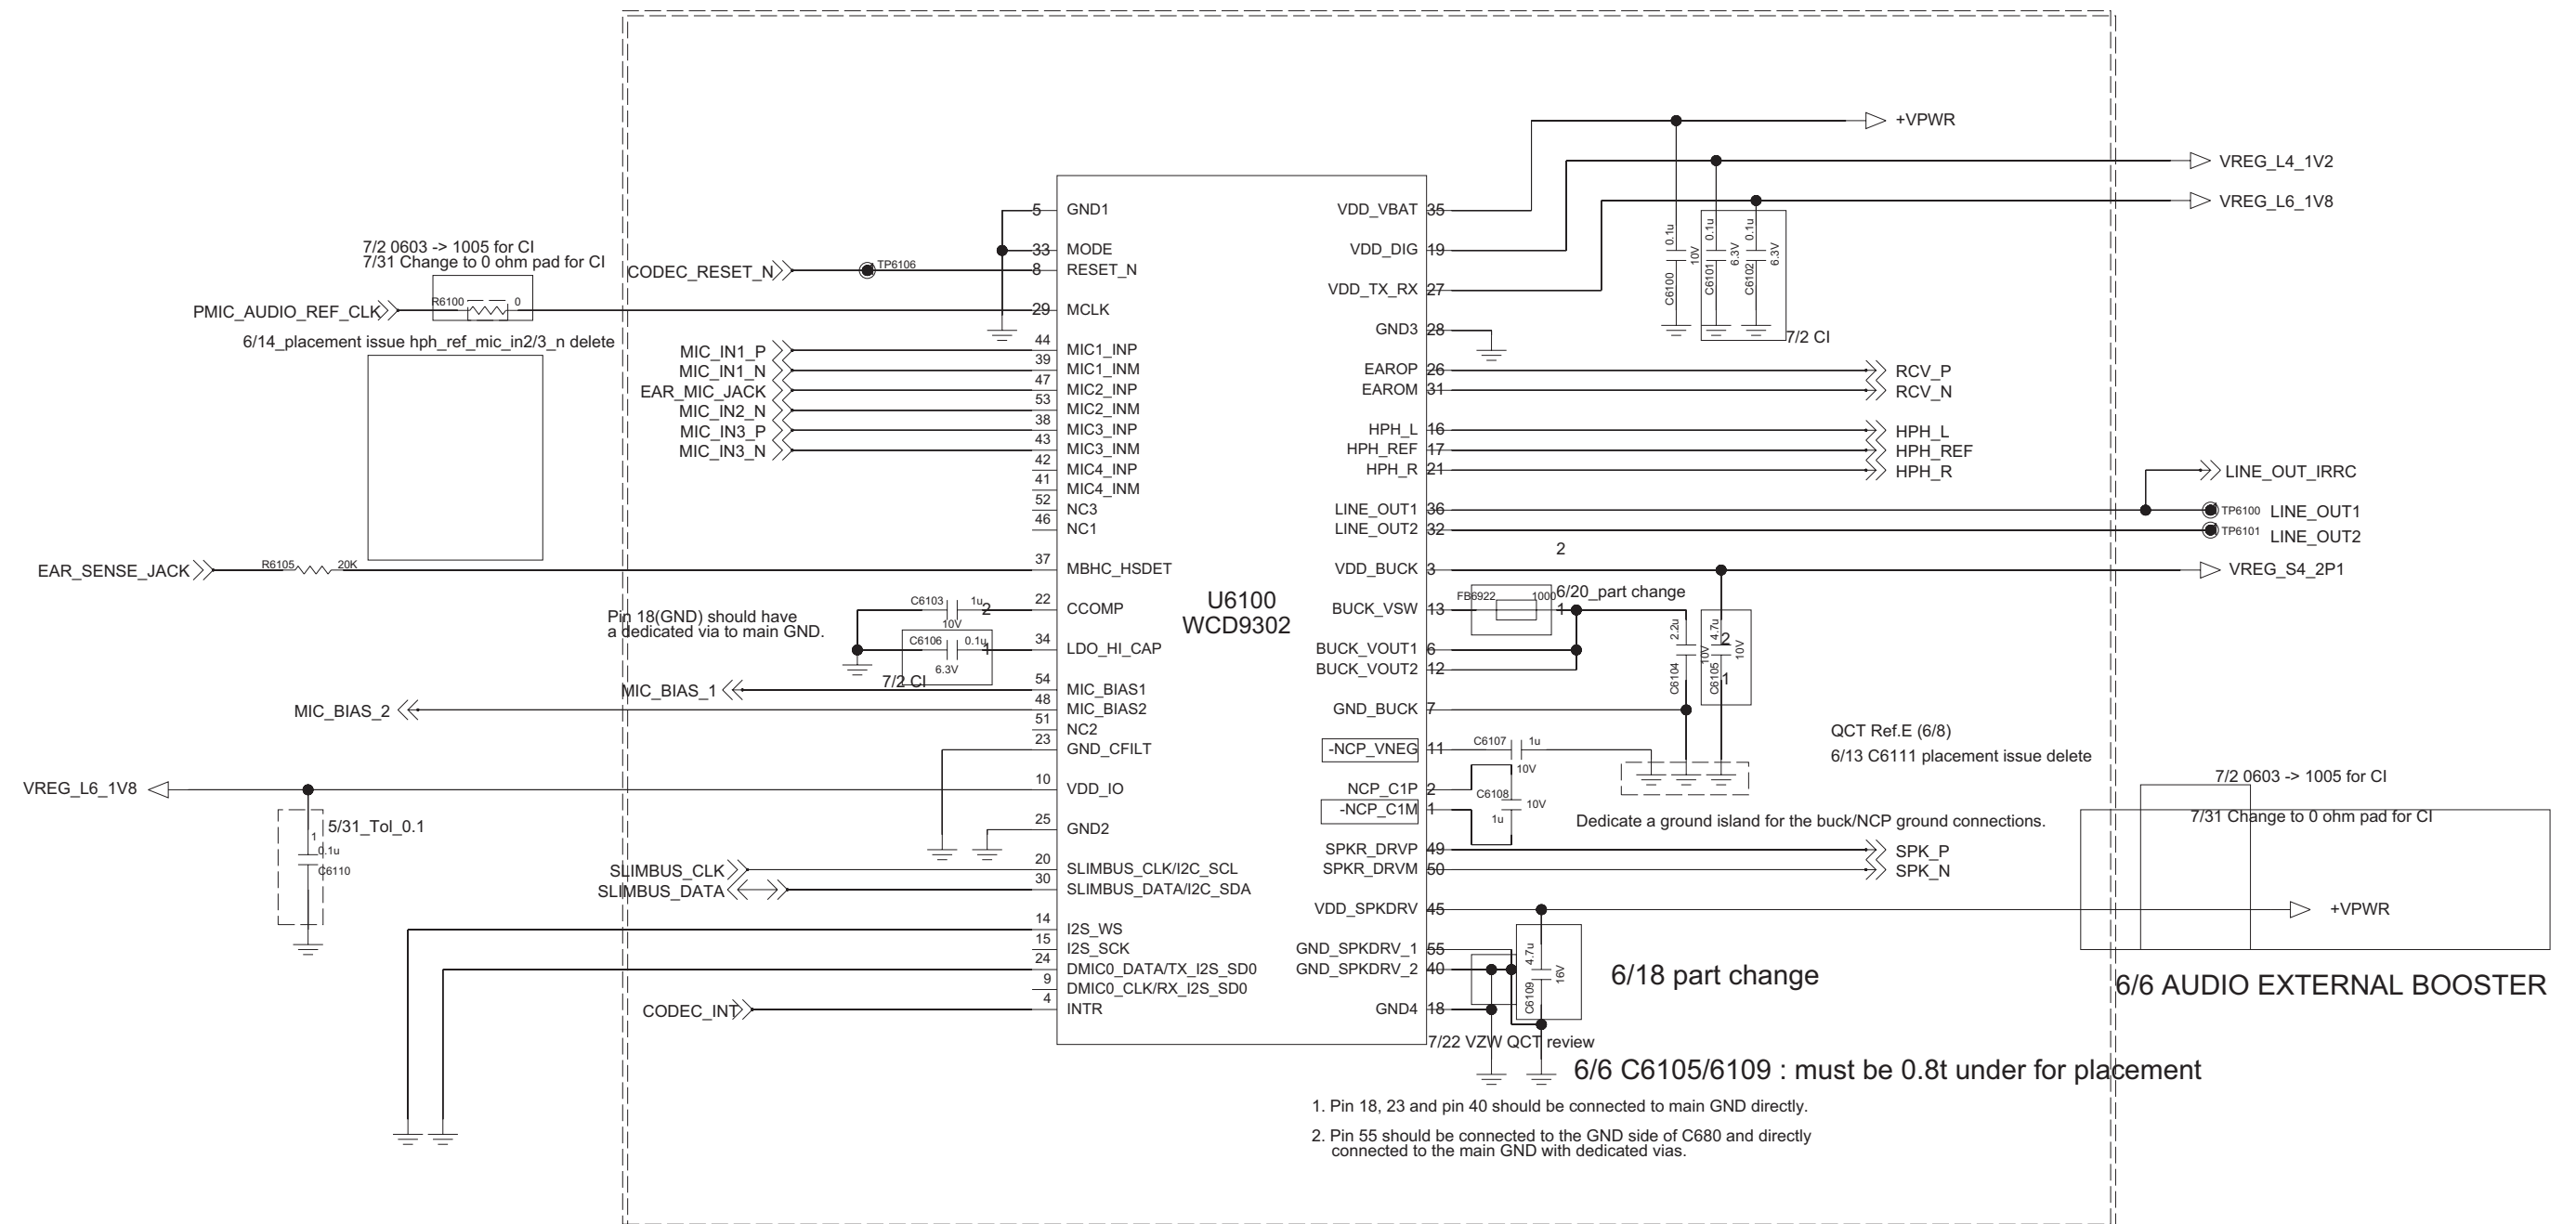

1. Pin 18, 23 and pin 40 should be connected to main GND directly.
2. Pin 55 should be connected to the GND side of C680 and directly connected to the main GND with dedicated vias.

< 6-8-1_Receiver_Only > Rev_0.4

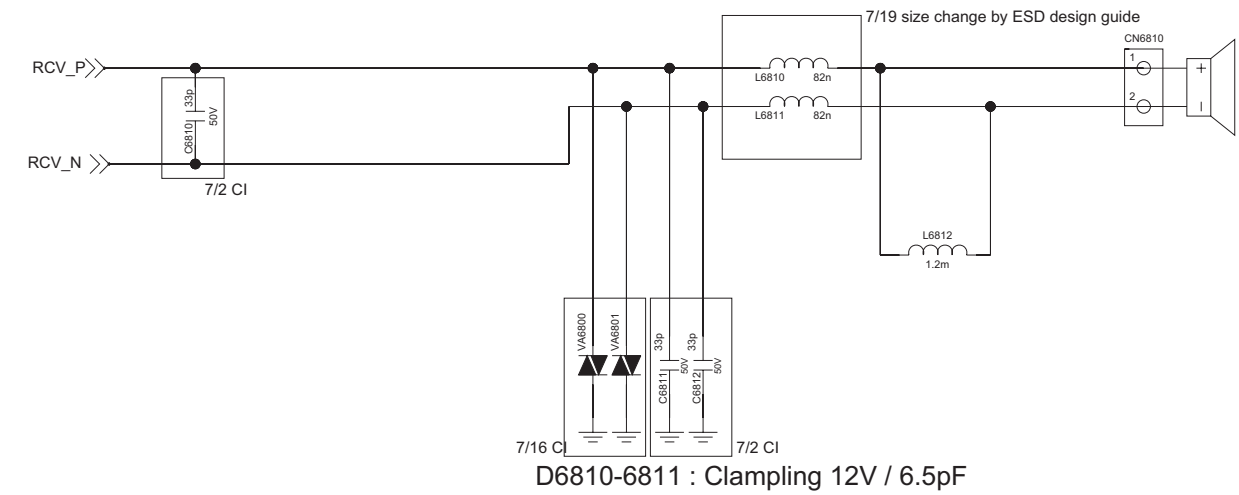


SUB_MIC_LOWER_FPCB




< 7-1-6-2-1_4.7inch_qHD > Rev_0.4

4.7" / qHD / LM468VN1A / P760

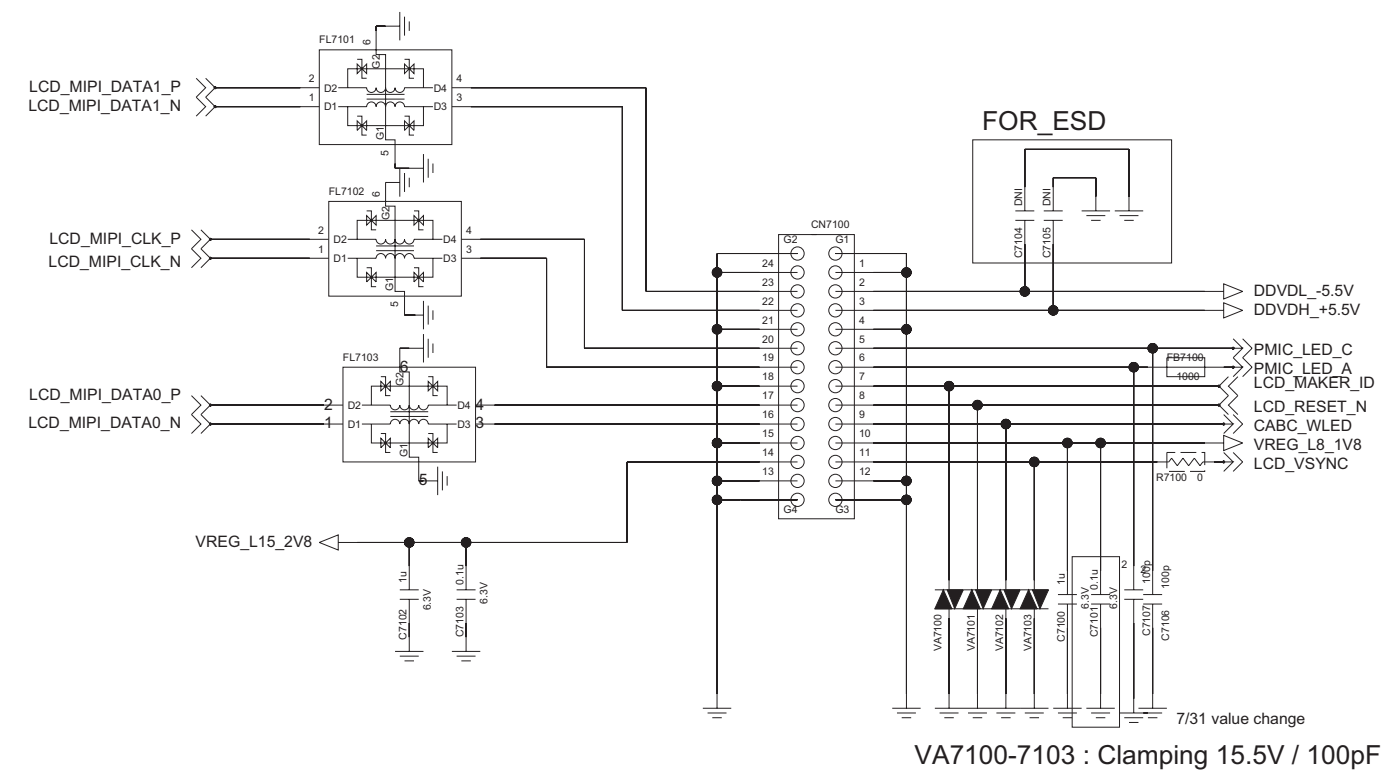


< 7-2-2-1_MMS-136_Touch_CoB_Atmel_mXT336S > Rev_0.3


TOUCH COB

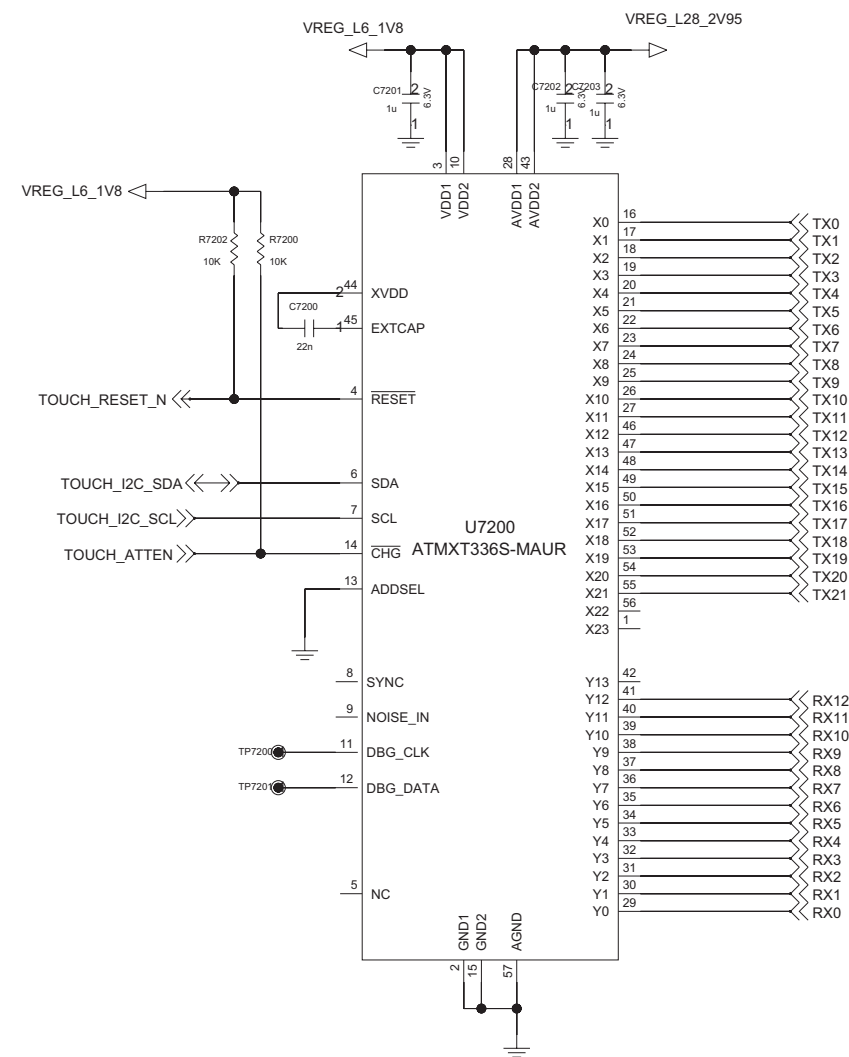


Touch Connector
(B to B type)

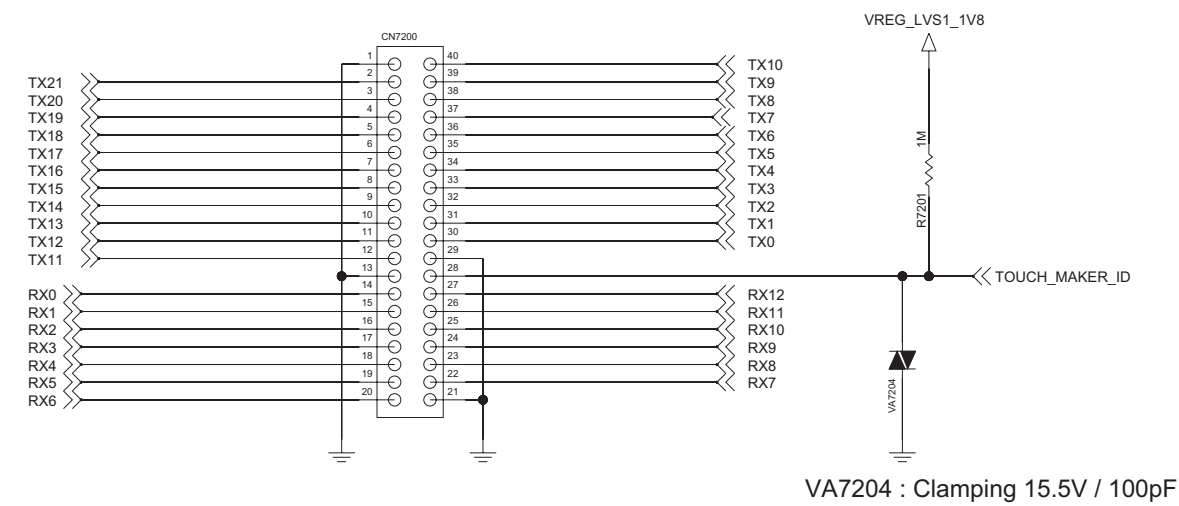


<7-5-1_DSV_TPS65132>Rev_0.3

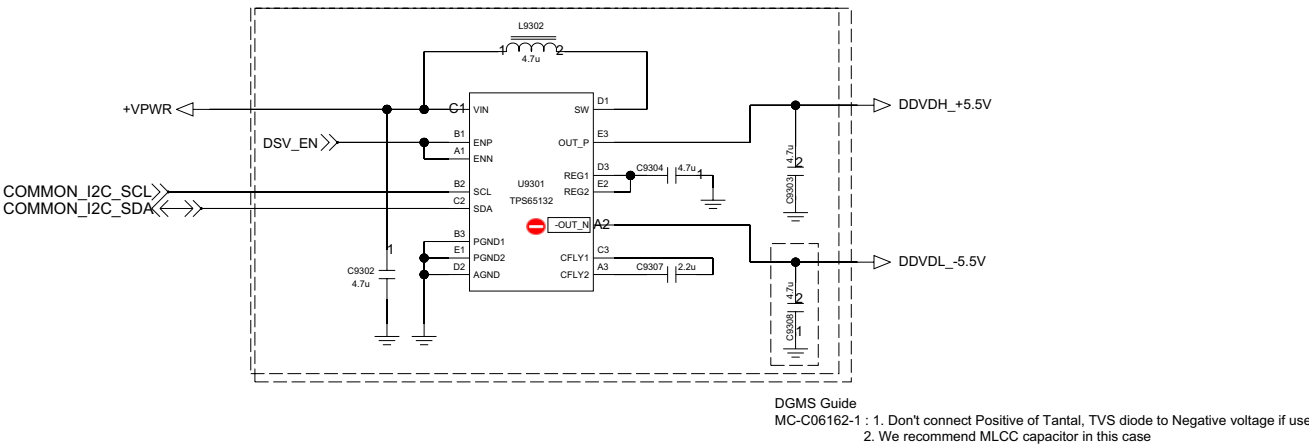


<8-1-2-1_Accel_Compass_BMC150> REV.0.4

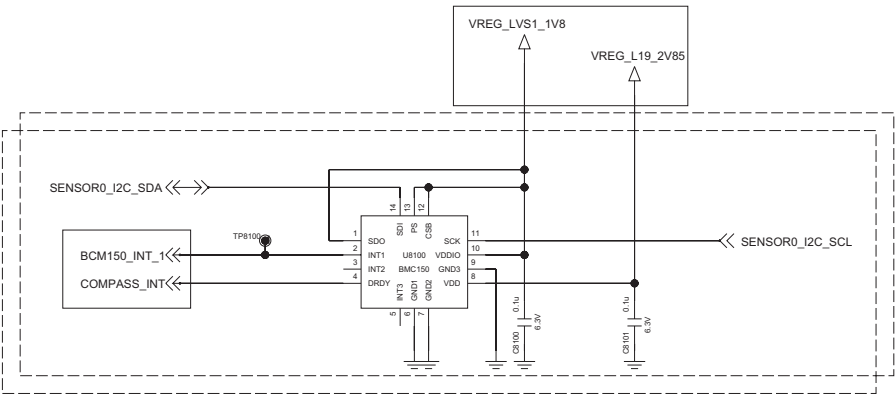


<8-4-1-1_Proximity_APDS-9130> REV.0.3

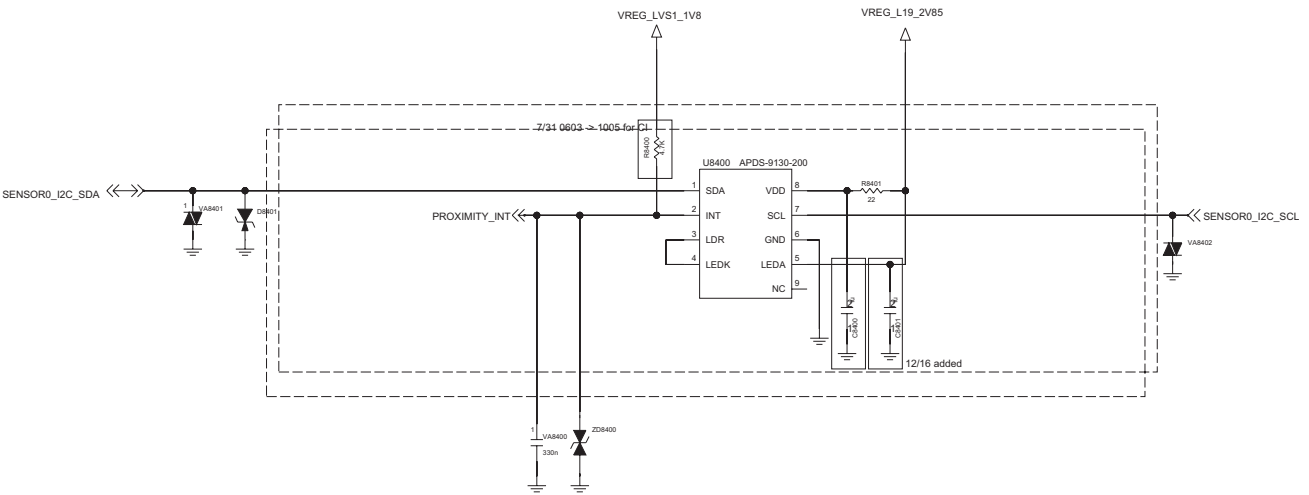


<8-7-1-1_Hall IC_BU52061NVX>Rev_0.3

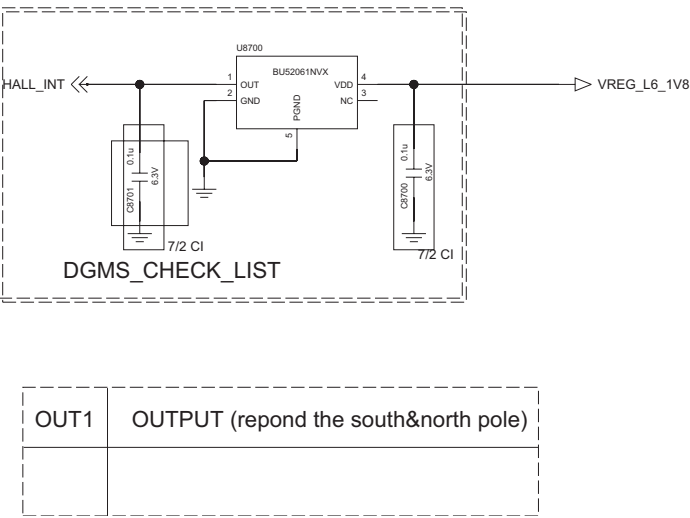


< 8-9-1-2_IRRC_w/o_driver_IC > Rev_0.4

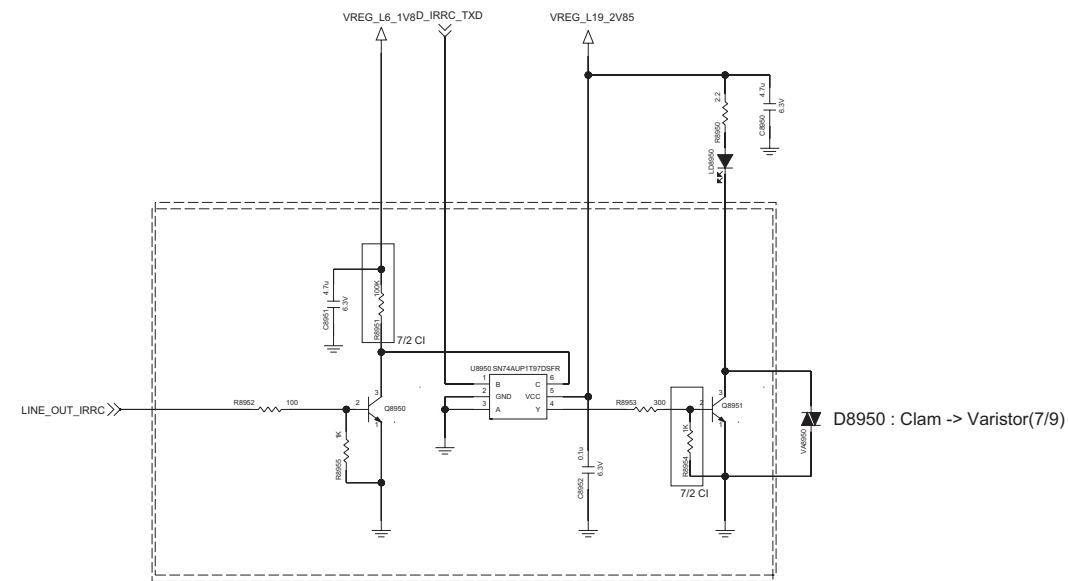


<9-1-2_Battery_CNT_4P>REV.0.4

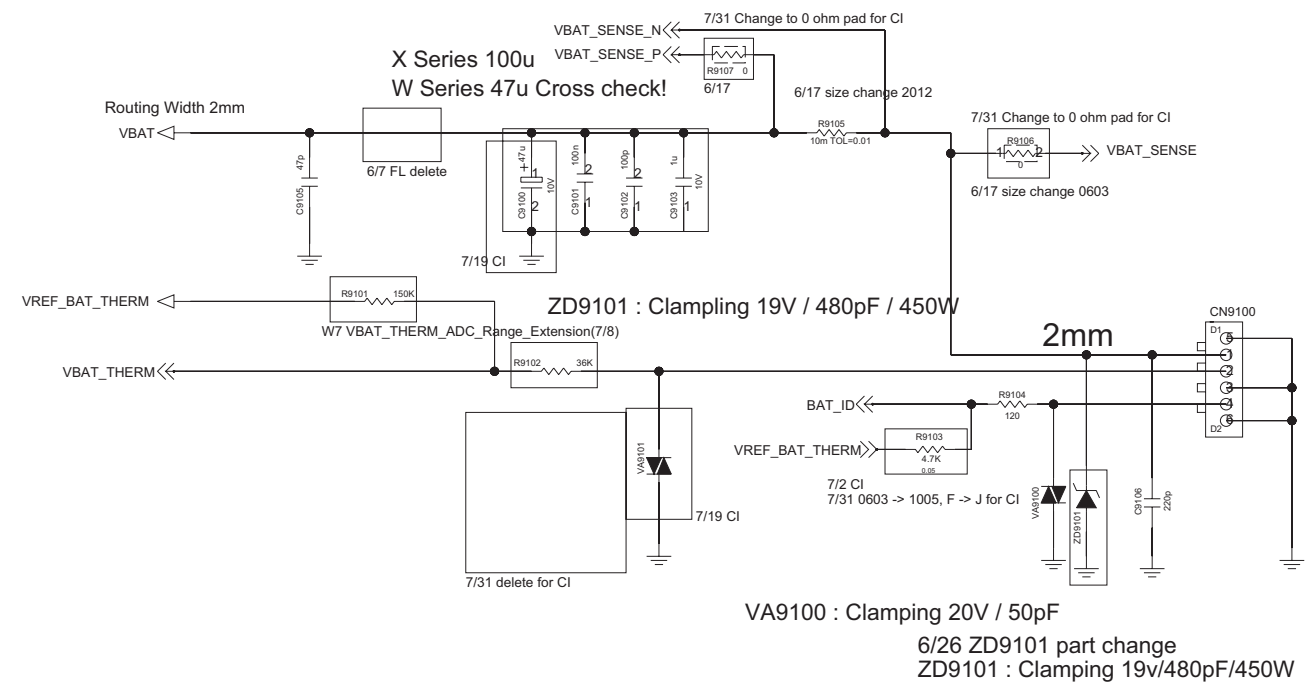

< 9-3-1_JTAG > Rev_0.4

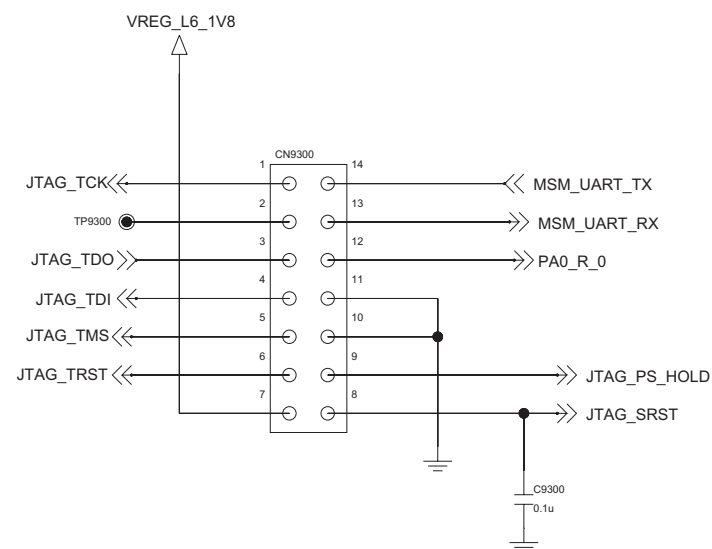


< 9-7-1_Power_Lock_Volume_Key > Rev_0.4

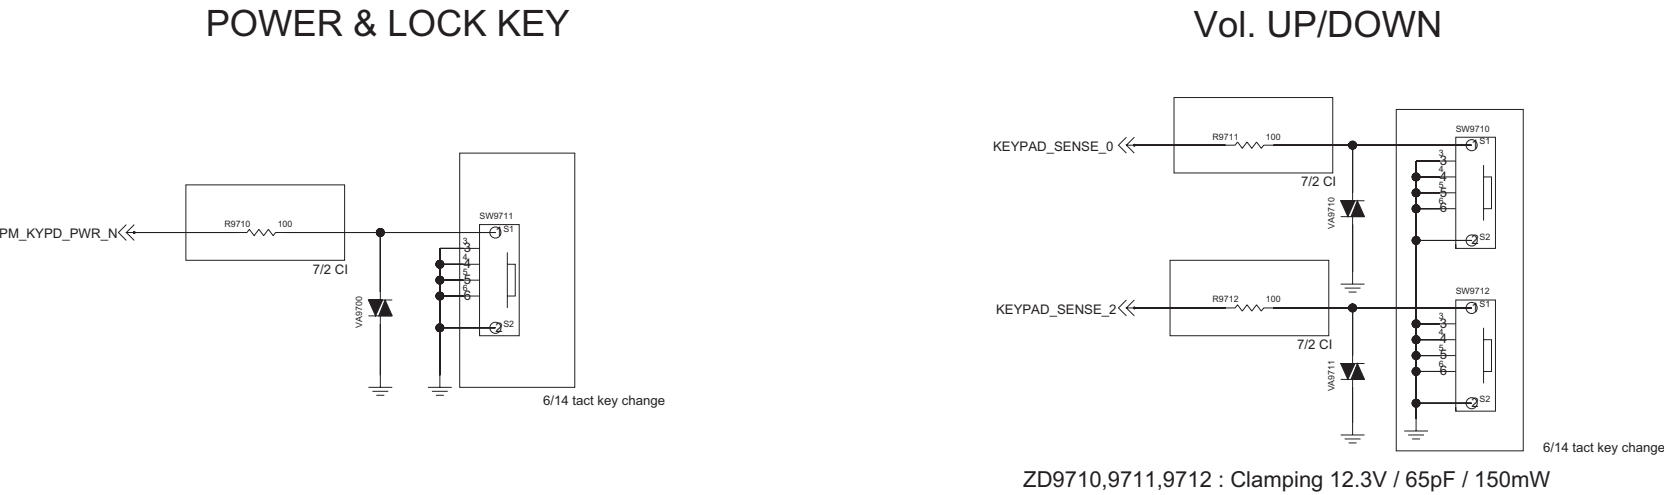


<9-8-3_Flash_LED> Rev_0.3

LED MODULE (LOW COST)

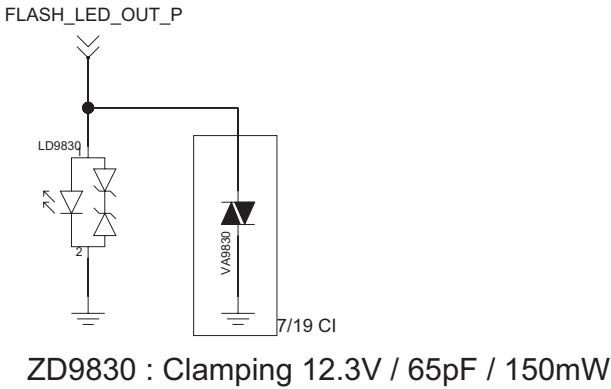

7. BGA PIN MAP


U5100- BT / Wi-Fi / FM module <TOP View>

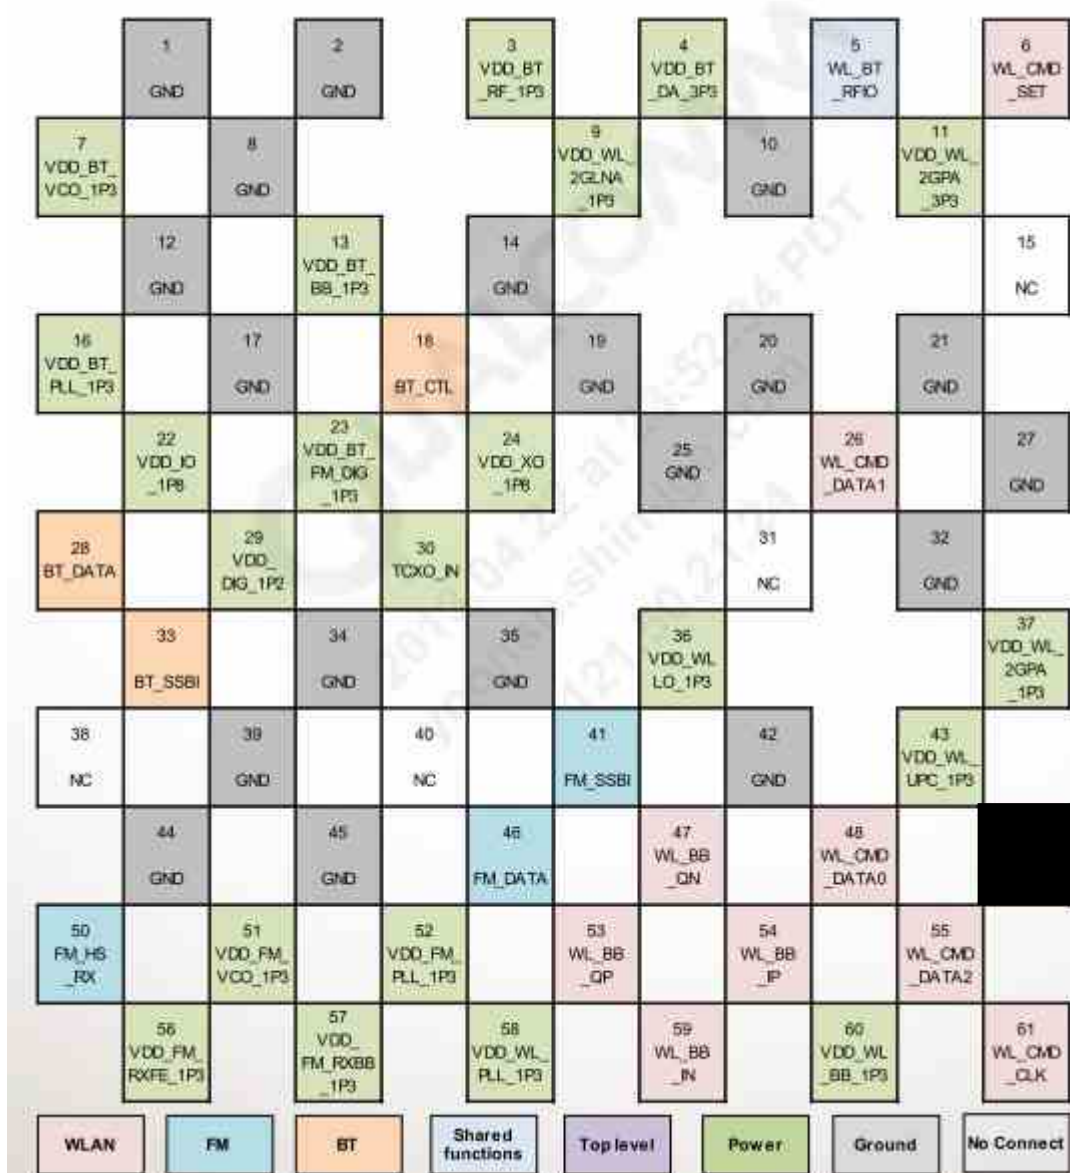

Not Used

Used

U3100- SDRAM LPDDR2 8Gbit

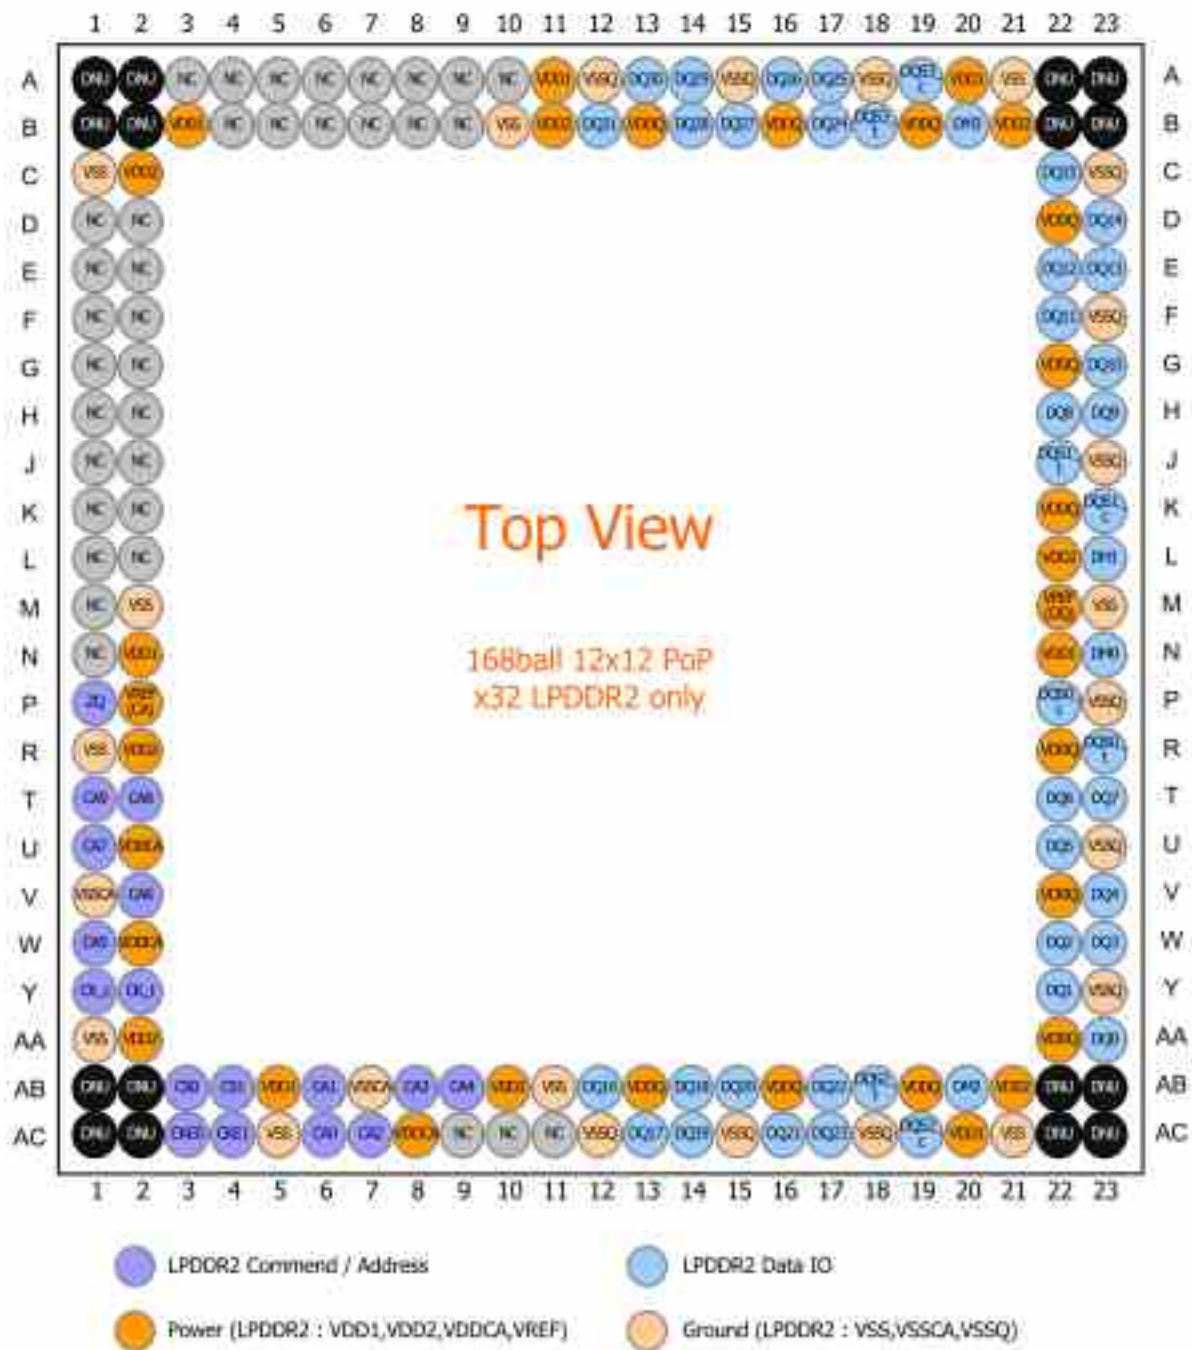

7. BGA PIN MAP

U2100-MSM8926 (Top View) – Lower Left quadrant

AA		NC				TX_DAC0_REF		GND			VDD_MEM		VDD_MEM		VDD_CORE		VDD_CORE		GND
AB	VDD_DDR1P8		TX_DAC0_IP		TX_DAC0_W		GND		GND		GND		GND		GND		GND		GND
AC		VREF_CA				TX_DAC1_QP		TX_DAC1_VREF		VDD_PLL0		GND		VDD_CORE		VDD_CORE		VDD_CORE	
AD	EBD_Z01		TX_DAC1_W		TX_DAC1_IP		TX_DAC1_QM		VDD_A1		GND		VDD_CORE		VDD_CORE		GND		VDD_MEM
AE					GND		GND		TX_DAC1_REF		NC		GND		VDD_CORE		VDD_CORE		VDD_CORE
AF							GND		VDD_A2		GND		GND		GND		GND		VDD_MEM
AG		BBRX_CH0_W		BBRX_CH0_QM		BBRX_CH0_QP		VDD_A1		GND		GND		GND		GND		VDD_CORE	
AH	BBRX_CH0_IP		BBRX_CH0_QP		BBRX_CH0_QM		VDD_A1		GND		VDD_MEM		VDD_MEM		VDD_MEM		VDD_MEM		VDD_MEM
AJ		VDD_P1			BBRX_CH2_IP		VDD_A2		VDD_EB0_C00		GND		VDD_CORE		GND		GND		VDD_CORE
AK					GND		VDD_A1		GND		VDD_CORE		VDD_CORE		VDD_CORE		GND		VDD_CORE
AL					GND		VDD_P3				GND		VDD_CORE		VDD_CORE		VDD_MPH_DSE_IP1		VDD_CORE
AM	GND		GNSS_BB_IM		GND		GND		EBD_CAL_REXT		GND		VDD_P3		NC		GND		VDD_MPH_DSE_IP1
AN		VDD_P1		GNSS_BB_IP		GPIO_B1		GND		EBD_VREF_CA		GND				VDD_P3		GND	
AP			GNSS_BB_QM		GND		GND		GND							GND		MPD_DSE_INT_N	
AQ		GPIO_B9		GNSS_BB_QP		GPIO_B9				GPIO_BE		GPIO_B1		NC				GND	
AT	GND					GPIO_B3		GND								GND		MPD_DSE_CLK_P	
AU		VDD_DDR1P2				GPIO_B3		GND				GPIO_F7		GND				GND	
AV						GPIO_B7				GND				GND		GND		MPD_DSE_CLK_N	
AW		GND		GND				GND				GND					VDD_DDR1P2		GND
AX	GND		GND			GPIO_B8		VDD_DDR1P8				VDD_P1					VDD_MPH_DSE_IP2		EBD_Z01
	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19

 Not Used
 Used

7. BGA PIN MAP

U2100-MSM8926 (Top View) - Lower Right quadrant

GND		VDD_CORE		VDD_CORE		GND		VDD_MEM		VDD_CORE		GND		VDD_P3			NC		GND	AA	
	VDD_CORE		VDD_CORE		GND		VDD_CORE		VDD_CORE		GND		GND		GPIO_27		GPIO_10		VDD_DDR1P3	AB	
GND		GND		VDD_CORE		GND		VDD_MEM		VDD_CORE		GND		GPIO_11		GPIO_26		GPIO_25		GPIO_48	AC
	VDD_CORE		VDD_MEM		GND		GND		GND		VDD_EBI1_CDC		GPIO_9				GPIO_28		GPIO_27	AD	
GND		GND		VDD_CORE		VDD_PLL1		VDD_MEM		VDD_CORE		VDD_CORE		GPIO_8			GND		GND	GPIO_24	AE
	VDD_CORE		VDD_MEM		GND		GND		GND		VDD_MEM		EBI1_VREF_D0						VDD_P1	AF	
GND		GND		GND		VDD_CORE		VDD_MEM		GND		GND		VDD_P3		GND		GND		GPIO_30	AG
	VDD_CORE		VDD_MEM		GND		GND		GND		VDD_MEM		GND		GPIO_32		GND		GPIO_29	AH	
VDD_CORE		GND		VDD_MEM		VDD_CORE		VDD_EBI1_CDC		VDD_CORE		GND		GND		GPIO_33		GND			AI
	VDD_CORE		GND		GND		GND		GND		GND		VDD_P1		GPIO_35		GND		GND	AK	
VDD_CORE		GND		GND		VDD_CORE		GND		VDD_CORE		GND		GPIO_38		GND		GND		GND	AL
	VDD_CORE		MPI_CS0_LDO		GND		GND		EBI1_VREF_D0		GND		GND		GPIO_36		GND		VDD_P1	AM	
GND		GND		MPI_CS0_LDO_P		GND		GND		NC		GND		TD0				GND		GND	AN
	GND			MPI_CS0_LDO_N		VDD_MPI_C0		GND		NC		GND		TRST_N		GPIO_17		GPIO_22		GND	AP
MPI_CS0_LDO_P							MPI_CS0_LDO_P		GND		GND		TD0					GPIO_23		GPIO_27	AR
	MPI_CS0_LDO_N		GND		GND		MPI_CS0_LDO_P		GND		GND		TRST_N		NC			GPIO_30		VDD_P1	AT
GPIO				GND			MPI_CS0_LDO_N		GND		GND		MODE_3		NC		VDD_DDR1P2			GPIO_21	AU
	MPI_CS0_LDO_P			GND		GND		MPI_CS0_LDO_N		GND		MODE_3		NC		NC				GPIO_18	AV
GND					GND		MPI_CS0_LDO_P		MPI_CS0_LDO_P		GND		VDD_P1		TD0		GPIO_19		GND		AW
	VDD_P1					MPI_CS0_LDO_N		MPI_CS0_LDO_N		GND		GND		VDD_DDR1P3		TD0		GPIO_18		GND	AY

Not Used

Used

U2100-MSM8926 (Top View) - Upper Right quadrant

	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40
A	GND		USB_HST_REXT		GPIO_120		GND		GPIO_70				GND		VDD_DDR_IP0		GND		GND		GND
B		GND		VDD_IP1		HSG_CAL		CXO_EN						VDD_IP1		SLEEP_CLK		VDD_DDR_IP0		GND	
C	GND		GPIO_118					GPIO_114		GPIO_71		GND		GND		PS_HOLD		GPIO_7			GPIO_96
D		GND				GPIO_111		PMIC_SPMI_DATA		GND		GND		RESN_N		GPIO_8					
E	GND		USB_HST_DP						NC		GND		RESOUT_N		GND		GND		GND		GND
F		USB_HST_DM		VDD_USB_CORE		GPIO_112		NC		GPIO_4				GND		GND		GND		VDD_IP1	
G	USB_HST_SYSCLOCK			GND			VDD_GPPROM_PRQ		PMIC_SPMI_CLK		GND		GND		GPIO_19		GND		GND		
H		VDD_USB_SPS		GND		VDD_IP4		VDD_IP0		GND		VDD_IP3		GND				GND		GND	
J	VDD_CORE		GND		VDD_IP2		GND		GND		EBB_VREF_D0		GND		VDD_IP0		GND		GPIO_62		GPIO_100
K		GND		GND		GND		GND		GND		GND		GND		GPIO_72		GND		GPIO_107	
L	VDD_CORE		GND		GND		VDD_CORE		GND		VDD_EBB_CDC		VDD_MEM				NC		NC		GPIO_108
M		GND		VDD_MEM		VDD_MEM		VDD_CORE		GND		GND		GND		GPIO_15		GND		VDD_IP1	
N	VDD_FLL2		VDD_MEM		GND		VDD_MEM		VDD_CORE		VDD_CORE		VDD_MEM		GND		GND		GPIO_41		GND
P		GND		VDD_CORE		VDD_CORE		VDD_MEM		GND		VDD_CORE		EBB_VREF_D1		WLAR_BB_DM		WGN_XD		GPIO_44	
R	VDD_MEM		VDD_MEM		GND		GND		GND		VDD_EBB_CDC		GND		WLAR_BB_DP		GND				GPIO_40
T		GND		VDD_FLL1		GND		VDD_MEM		VDD_FLL2		GND		VDD_WLAR		GND		NC			GPIO_42
U	VDD_CORE		VDD_CORE		GND		VDD_CORE		GND		GND		WLAR_REXT		WLAR_BB_DM		GND		NC		GND
V		GND		VDD_CORE		GND		VDD_CORE		GND		GND		GND		WLAR_BB_DP		GPIO_43		VDD_IP1	
W	VDD_MEM		VDD_CORE		GND		GND		GND		VDD_CORE		GND		GND		GND		VDD_DDR_IP0		GPIO_46
Y		GND		VDD_CORE		GND		VDD_CORE		VDD_CORE		GND		GPIO_25		VDD_IP0		GPIO_36		WREF_DQ	

☒ Not Used
☐ Used

7. BGA PIN MAP


U2100-MSM8926 (Top View) - Upper Left quadrant

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
A		GND		GPIO_58		GND						GND		GND		GND		VDD_DDR_1P8		GND
B	GND		GPIO_61		VDD_DDR_1P8		GPIO_59				GND		GND		GND		GND		VDD_DDR_1P8	
C		GPIO_113		GPIO_60		GPIO_57		GND				GND		GND		GND		VDD_P3		GND
D	SDC1_DATA_5						GND		GND		GND		GND		GND		GND		VREF_UW	
E		SDC1_DATA_1		SDC1_DATA_8				NC		VDD_P5		GND		GND		GND		VDD_P6		GND
F	SDC1_CLK		SDC1_DATA_5						GND		GND		GND		GND		GND		VDD_USB_1P8	
G		SDC1_DATA_11		SDC1_DATA_3		SDC1_CMD		GND		GND		VDD_APC		VDD_APC		VDD_APC		GND		USB_HST_EVSCLK
H	GND		GND		VDD_DDR_1P2		VDD_SDC_CDC		GND		GND		GND		GND		GND		GND	
J		SDC1_DATA_3		NC		GND		VDD_P7		VDD_APC		VDD_APC		GND		VDD_APC		VDD_APC		VDD_CORE
K	SDC1_DATA_7		NC		GND		VDD_SDC_CDC		GND		GND		GND		GND		GND		GND	
L		SDC2_DATA_1		SDC2_CMD		CX0		VDD_APC		VDD_APC		VDD_APC		VDD_MEM		VDD_APC		VDD_APC		VDD_CORE
M	SDC2_DATA_3		SDC2_DATA_5		SDC2_DATA_3		GND		GND		GND		GND		GND		GND		GND	
N		GND		VREF_SDC		GND		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_PLL2
P	SDC2_DATA_3		GND		NC		GND		GND		GND		GND		GND		GND		GND	
Q				GND		VDD_P5		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_MEM
T	GPIO_52				GPIO_115			GND		GND		GND		GND		GND		GND		GND
U		GPIO_112		GPIO_111		VREF_APC_MPM		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_APC		VDD_CORE
V			GND		TX_DACS_VREF		VDD_P3		GND		GND		GND		GND		GND		GND	
W		TX_DACS_QP						VDD_APC		VDD_APC		VDD_MEM		VDD_CORE		VDD_CORE		VDD_MEM		VDD_MEM
Y	TX_DACS_QM				GND		VDD_AE		GND		GND		GND		GND		GND		GND	

Not Used


Used

U3200- eMMC (Top View)

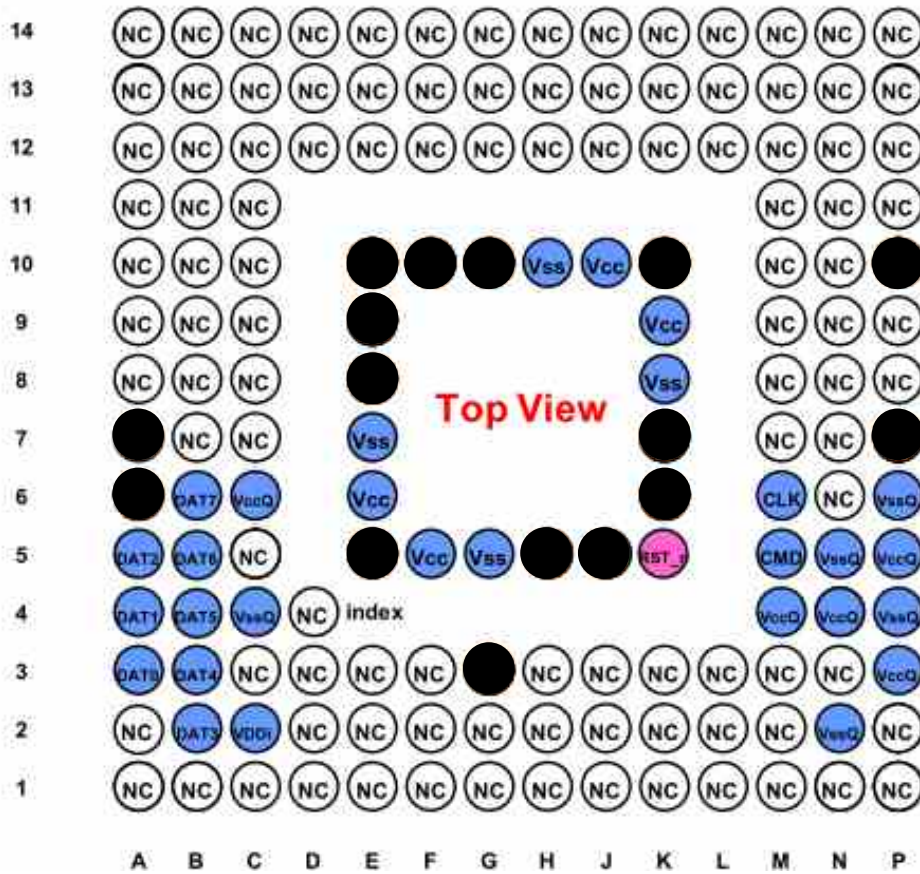


● Not Used

U1400 –IC, DC,DC Converter (Top View)

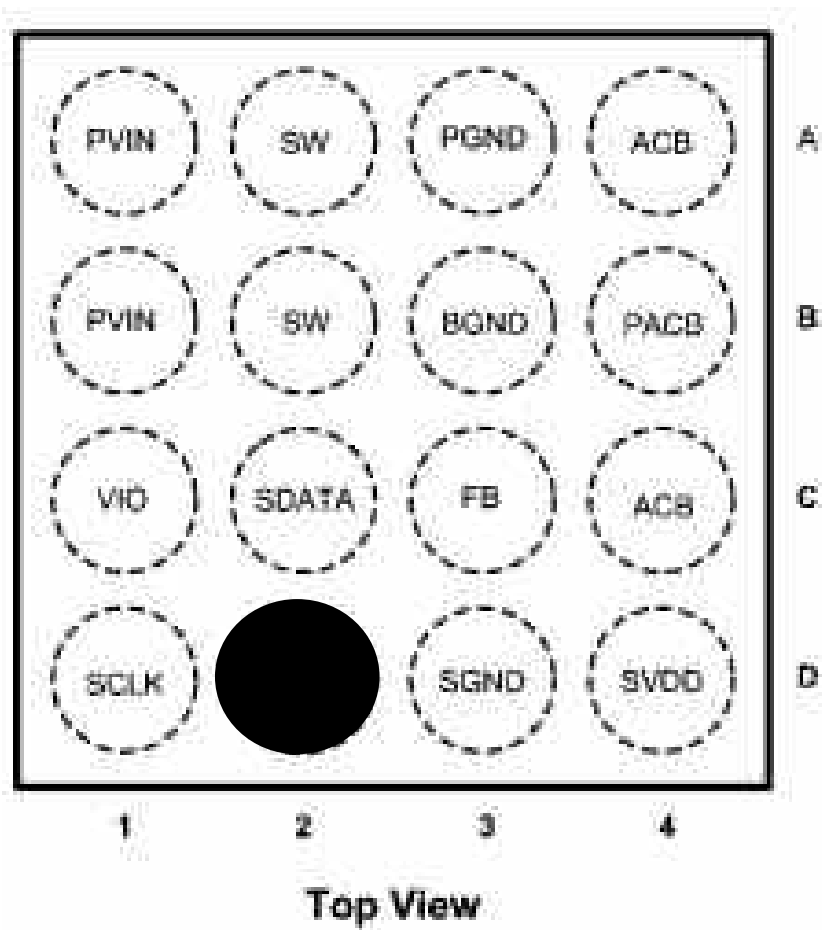

● Not Used

U9301 –IC, DC,DC Converter (Bottom View)

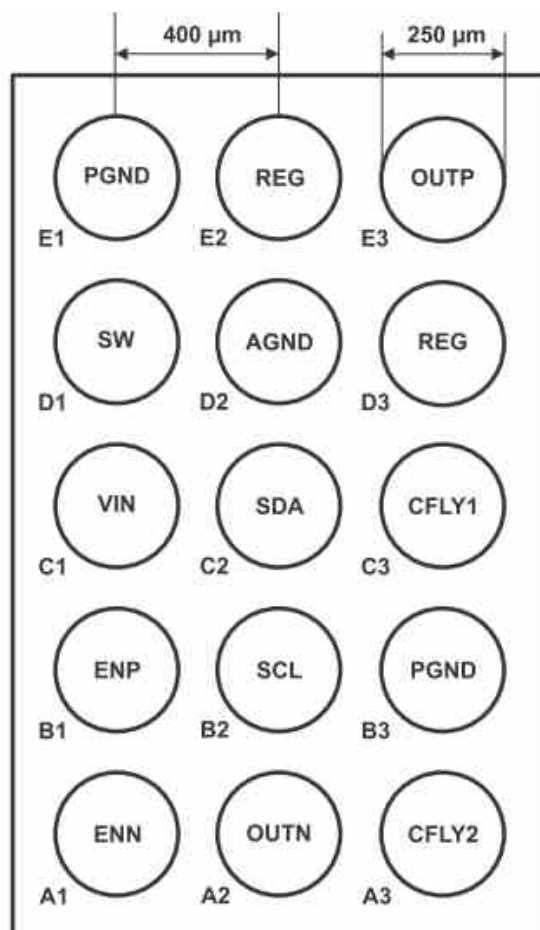

PIN		I/O	DESCRIPTION
NAME	NO.		
ENN	A1	I	Enable pin for V_{NEG} rail
OUTN	A2	O	Output pin of the negative charge pump (V_{NEG})
CFLY2	A3	I/O	Negative charge pump flying capacitor pin
ENP	B1	I	Enable pin for V_{POS} rail
SCL	B2	I/O	I ² C interface clock signal pin
PGND	B3, E1	G	Power ground
VIN	C1	I	Input voltage supply pin
SDA	C2	I/O	I ² C interface data signal pin
CFLY1	C3	I/O	Negative charge pump flying capacitor pin
SW	D1	I/O	Switch pin of the boost converter
AGND	D2	G	Analog ground
REG	D3, E2	I/O	Boost converter output pin
OUTP	E3	O	Output pin of the LDO (V_{POS})

ALL USED

7. BGA PIN MAP

U4100 –IC,PMIC (Top View)

1 VDD_ GR2	2 VREG_ L3	3 VREG_ L2	4 VDD_ GR1		5 XTAL_ 19M_IN	6 XTAL_ 19M_OUT		7 VDD_ GR6	8 VSW_ S1	9 VDD_ S1	10 VDD_ S1
11 VDD_ GR2	12 VREG_ L24	13 RF_CLK1	14 VREG_ L13	15 VREG_ L1	16 VREG_ L11	17 GND_ XO	18 VREG_ L17	19 VREG_ L16	20 VREG_ S1	21 VSW_ S1	22 GND_ S1
23 GND_ S3	24 VREG_ L26	25 VREG_ L5	26 NC	27 VDD_ GR4	28 NC	29 VREG_ L19	30 VREG_ L17	31 BB_CLK1	32 VREG_ L18	33 GND_ S1	34 VDD_ S2
35 VSW_ S3	36 VREG_ S3	37 VREG_ L4	38 VREG_ L10	39 RF_CLK2	40 NC	41 VDD_ GR7	42 BB_CLK2	43 VREG_ L15	44 BB_CLK1 _EN	45 VSW_ S2	46 VSW_ S2
47 VDD_ S3	48 VDD_ L25	49 VREG_ L14	50 VREG_ L28	51 VREG_ L23	52 VREG_ L22	53 VREG_ L21	54 NC	55 VREG_ L20	56 VREG_ S2	57 GND_ S2	58 VSW_ S2
	59 VDD_ GR5	60 VREG_ GR5	61 VREF_ LPDDR	62 GND_ XO_BUFF	63 GND_ XOADC	64 GND	65 GND_ DRV	66 VIB_ DRV_N	67 GND_ S2	68 GND_ S2	
69 GND_ S4	70 VREG_ L25	71 VREG_ L12	72 AMUX_1	73 AMUX_2	74 GND	75 GND	76 VCOIN	77 PON_ RESET_N	78 VREG_ S5	79 VDD_ S5	80 VSW_ S5
81 VSW_ S4	82 NC	83 DNC	84 DNC	85 CBL_ PWR_N	86 GND	87 GND	88 SLEEP_ CLK1	89 NC	90 NC	91 NC	92 GND_ S5
93 VDD_ S4	94 VOUT_ LVS1	95 VREG_ S4	96 BMS_ CSN	97 USB_ ID_IN	98 GND	99 GND	100 PS_HOLD	101 RESIN_ IN	102 KPD_ PWR_N	103 VLED_ FLASH	104 VDD_ FLASH
	105 VREG_ L6	106 VREG_ L6	107 BMS_ CSP	108 OPT_2	109 GND	110 GND_ OVP	111 GND	112 SPMI_ CLK	113 GND_ WLEDI	114 GND_ WLEDI	
115 VDD_ GR3	116 VREG_ L7	117 GND_ REF	118 VREG_ L8	119 OPT_1	120 XO_ THERM	121 AVDD_ BYP		123 SPMI_ DATA	124 GPIO_1	125 WLED_1	126 VDD_ WLED
127 VREG_ L27	128 VREG_ L9	129 REF_ BYP	130 MPP_7	131 BMS_ BYP	132 MPP_5	133 NC	134 GPIO_7	135 GPIO_4	136 GPIO_2	137 OVP_ WLED	138 VSW_ WLED
139 VBAT	140 BATFET_ CP_DRV		142 GND_ CHG	143 VCHG		145 NC	146 MPP_2	147 NC	148 GPIO_5	149 GPIO_3	150 GND_ WLED
151 VBAT	152 VPH_ PWR	153 GND_ CHG_HP	154 VSW_ CHG	155 VCHG	156 VBAT_ SNS		158 MPP_3	159 MPP_1	160 GPIO_6	161 USB_IN	162 OVP_ OUT
163 VBAT	164 VPH_ PWR	165 GND_ CHG_HP	166 VSW_ CHG		167 VDRV_P			169 VREF_ BAT_THM	170 VPRE_ BYP	171 OVP_CP_ DRV	172 USB_IN
Input power management	Output power management	General housekeeping	User interfaces	IC-level interfaces	MPPs and GPIOs	No connection	Power	Ground			

Not Used

Used

U2003 –WTR1605L (Top View) Lower Left quadrant

74 VDD_RF1 _G_VCO		75 GND		76 DRX_ BB_IP		77 GND		78 VDD_RF1 _S_PLL	
	84 GND		85 GNSS_ BB_QM		86 DRX_ BB_IM		87 GND		88 GND
93 VDD_RF1 _G_PLL		94 GND		95 SSBI_ PRX_DRX		96 GND		97 PRX_ BB_QM	
	103 VDD_DIO		104 GP_ DATA1		105 SSBI_ TX_GNSS		106 GND		107 PRX_ BB_QP
112 GND		113 GND		114 VDD_RF2 _T_PLL		115 VDD_RF1 _T_SYN		116 VDD_RF2 _FBRX	
	122 GND		123 GP_ DATA0		124 GND		125 GND		126 VDD_RF2 _T_BB
131 XO_IN		132 GND		133 GND				134 GND	
	140 GND		141 GND				142 GND		143 GND
147 VDD_RF2 _XO		148 GND		149 VDD_RF1 _T_VCO				150 GND	
	156 GND		157 VDD_RF2 _T_VCO		158 GND		159 GND		160 TX_ BB_IM

☐ Used

U2003 –WTR1605L (Top View) Lower Right quadrant

	79 VDD_RF1 _P_PLL		80 VDD_RF2 _P_VCO		81 GND		82 GND		83 GND
88 GND		89 GND		90 VDD_RF1 _P_VCO					
	98 VDD_RF2 _P_BB		99 PRX_ BB_IP		100 VDD_RF2 _P_RX		101 GND		
107 PRX_ BB_QP		108 PRX_ BB_IM				110 GND		111 GND	
	117 PDET_ RFFB		118 GND		119 GND		120 GND		121 TX_ HB2_OUT
126 VDD_RF2 _T_BB		127 DAC_ REF		128 GND		129 VDD_RF2 _T_DA			
	135 VDD_RF1 _T_LO		136 VDD_RF1 _T_UPC		137 VDD_RF1 _T_DA				139 TX_ MB3_OUT
143 GND				144 GND		145 GND			
	151 TX_ BB_IP		152 TX_ BB_QP						
160 TX_ BB_IM		161 TX_ BB_QM		162 TX_ LB1_OUT				164 GND	

Not Used

Used

U2003 –WTR1605L (Top View) Upper Left quadrant

					3 GND		4 DRX_ HB1_IN		
10 GND		11 VDD_RF1 _D_MB						14 VDD_RF1 _D_LB_LO	
			21 GND		22 VDD_RF1 _D_HB		23 GND		
28 DRX_ MB1_IN									
	36 GNSS_ RF_INP		37 DNC		38 VDD_RF1 _D_LOM		39 GND		40 GND
44 GNSS_ RF_INM		45 GND		46 GND		47 GND		48 VDD_RF1 _S_VCO	
	52 VDD_RF1_G _LNA		53 GNSS_ BB_IM		54 VDD_RF2 _D_BB				55 GND
59 VDD_RF1 _G_BB		60 GNSS_ BB_IP		61 DRX_ BB_QP				62 VDD_RF2 _S_VCO	
	66 GND		67 GNSS_ BB_QP		68 DRX_ BB_QM				69 GND

■ Not Used


□ Used

U2003-WTR1605L (Top Viw) Upper Right quadrant




 Not Used
 Used

U4600 – IC,LED Driver (Top View)

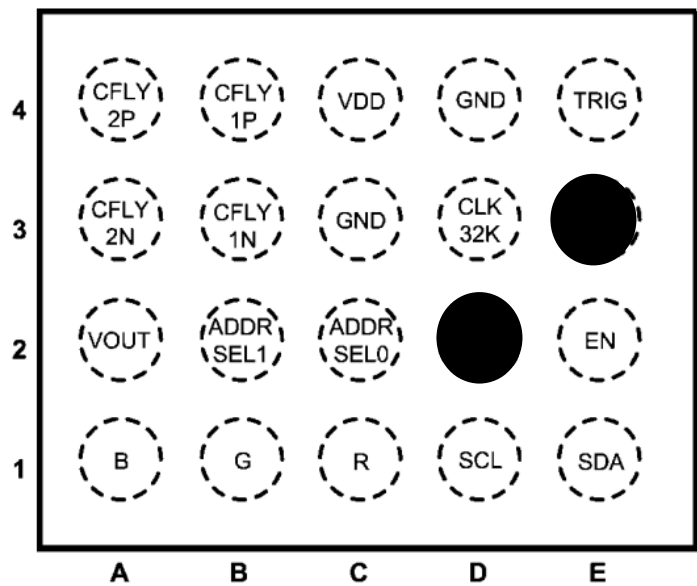


Not Used

U5200– IC,NFC (Top View)

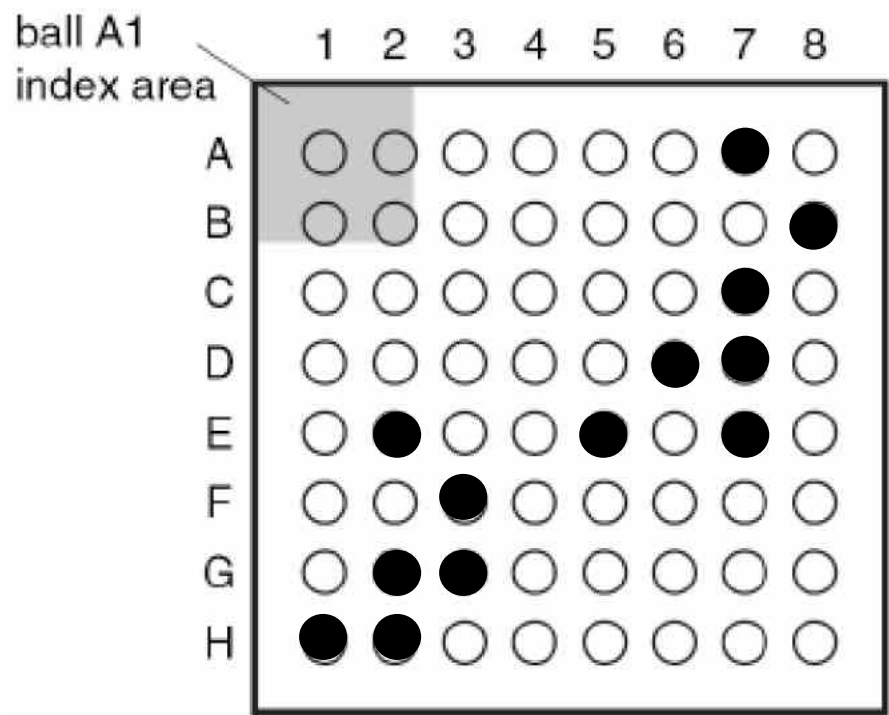


● Not Used


8. PCB LAYOUT

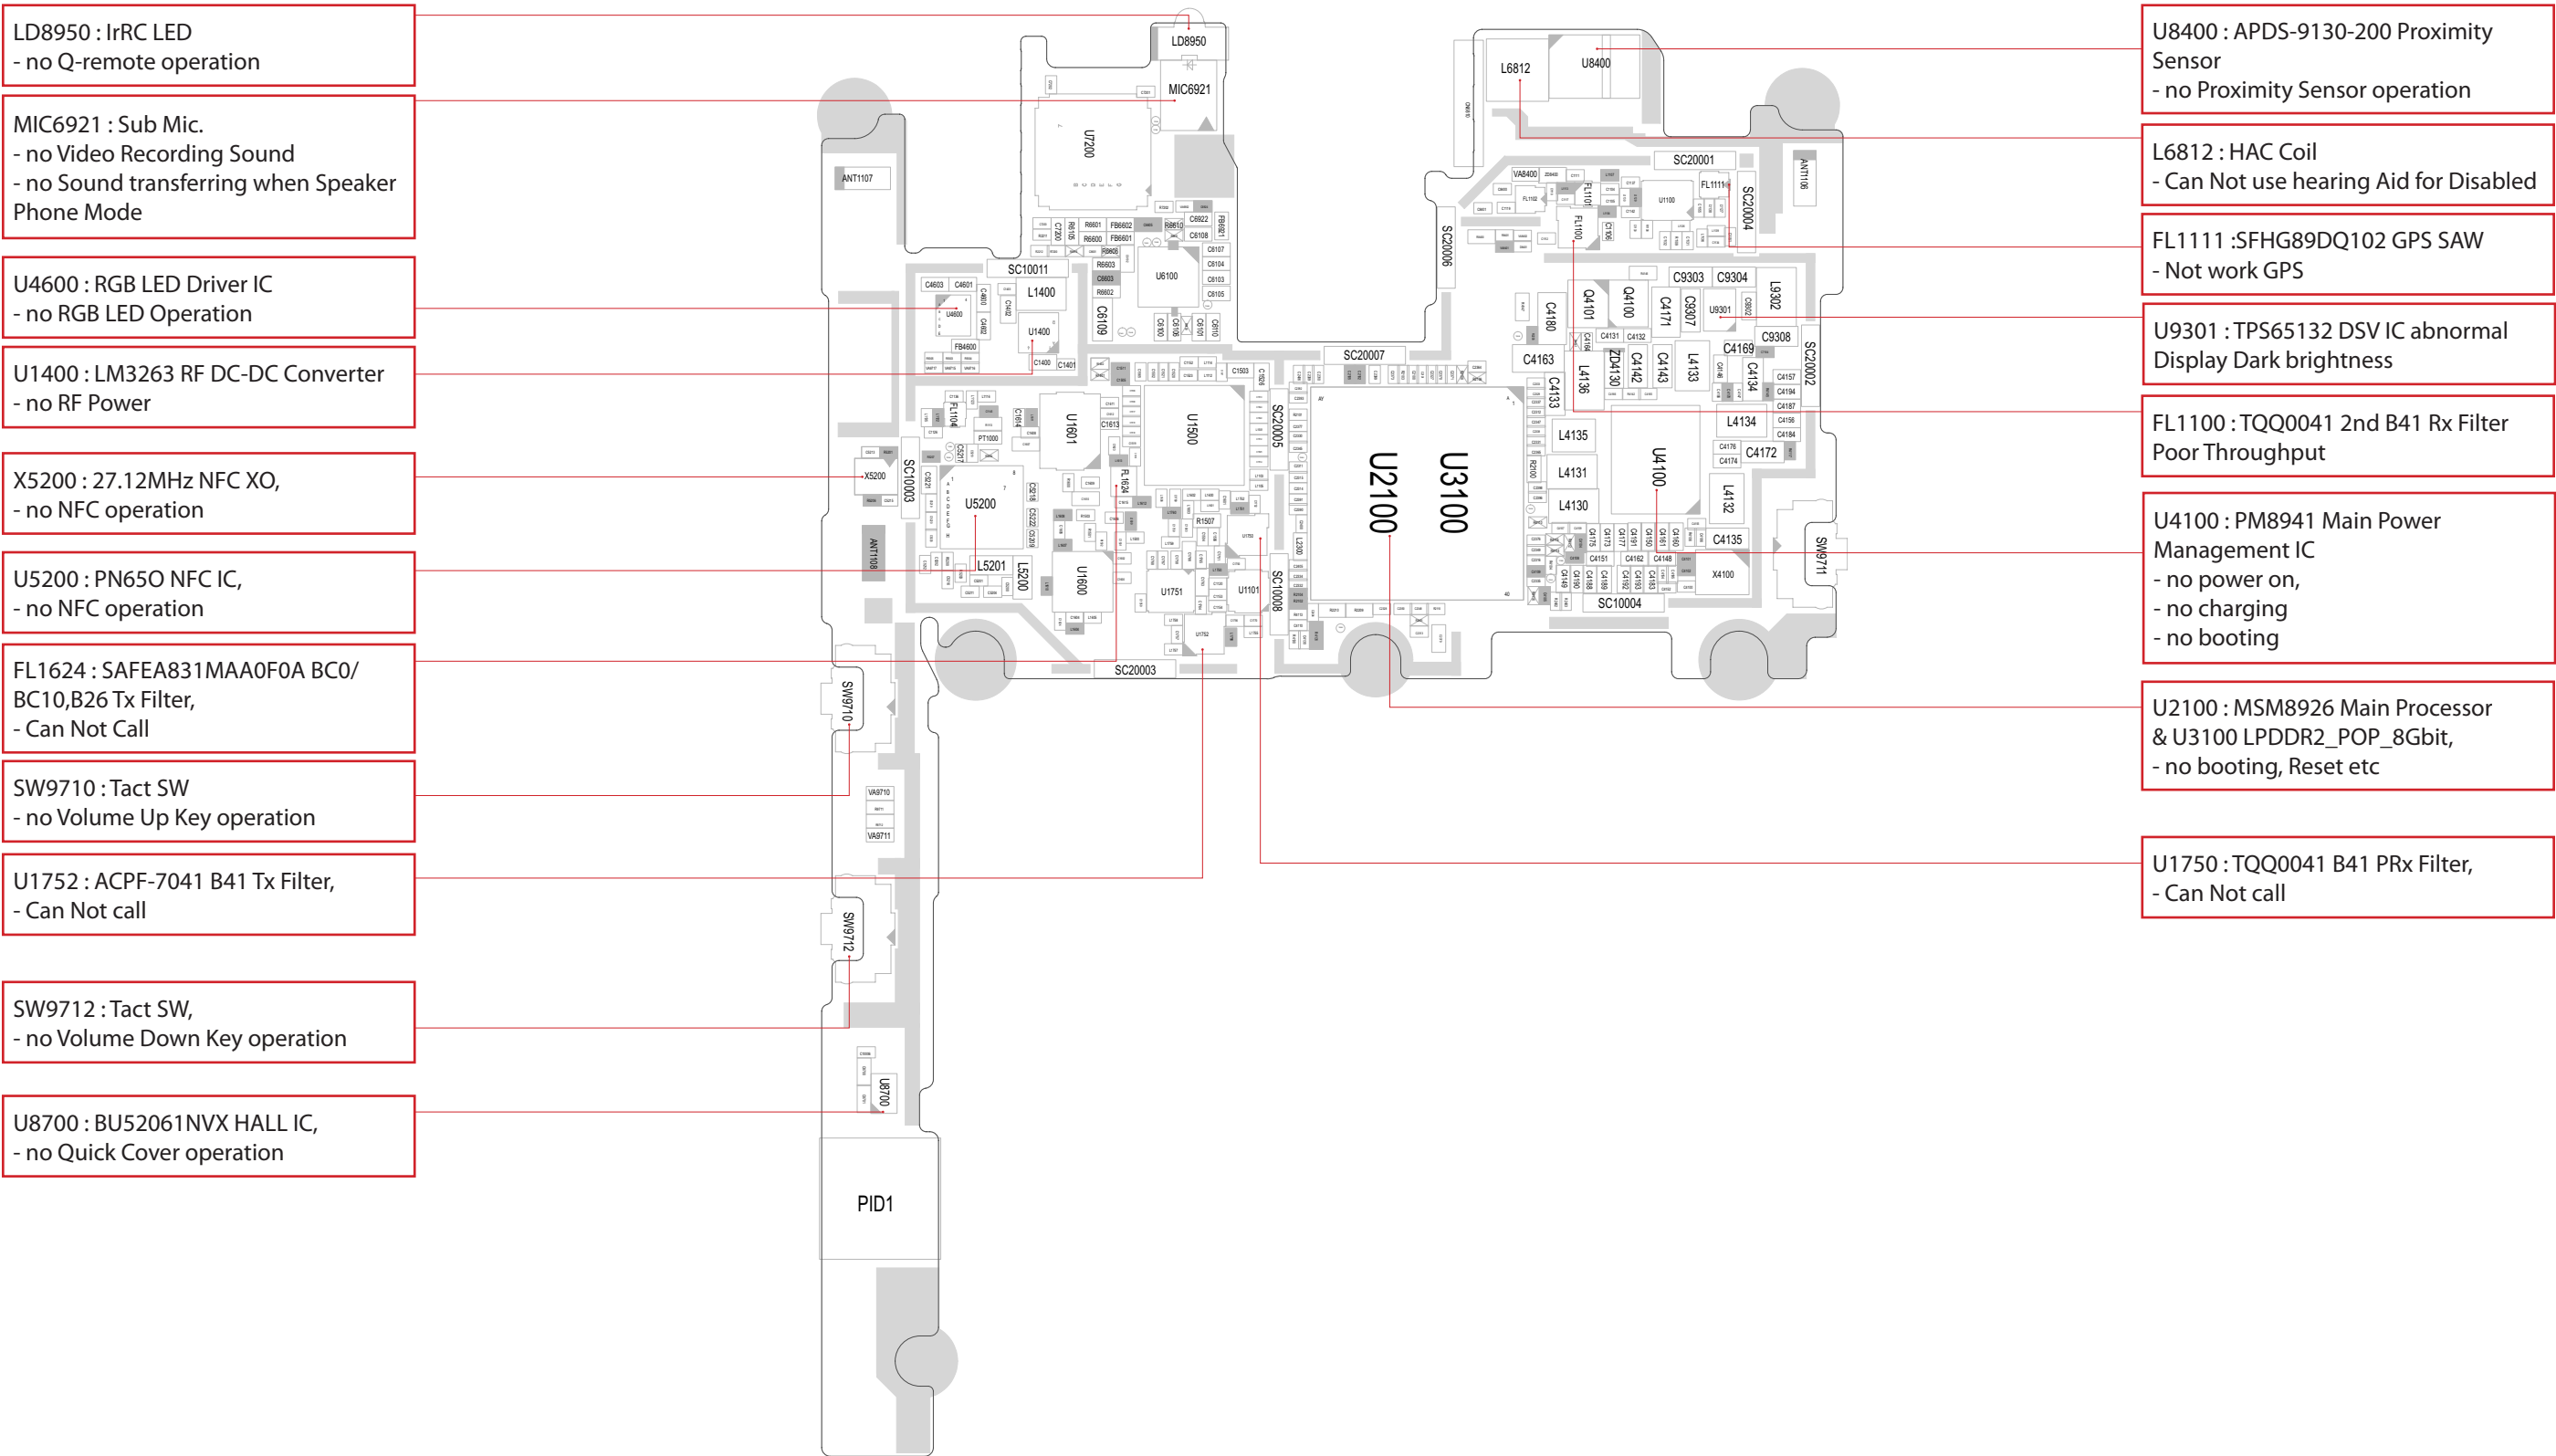

LG-LS740_MAIN_EAX65588701_1.0_TOP-1

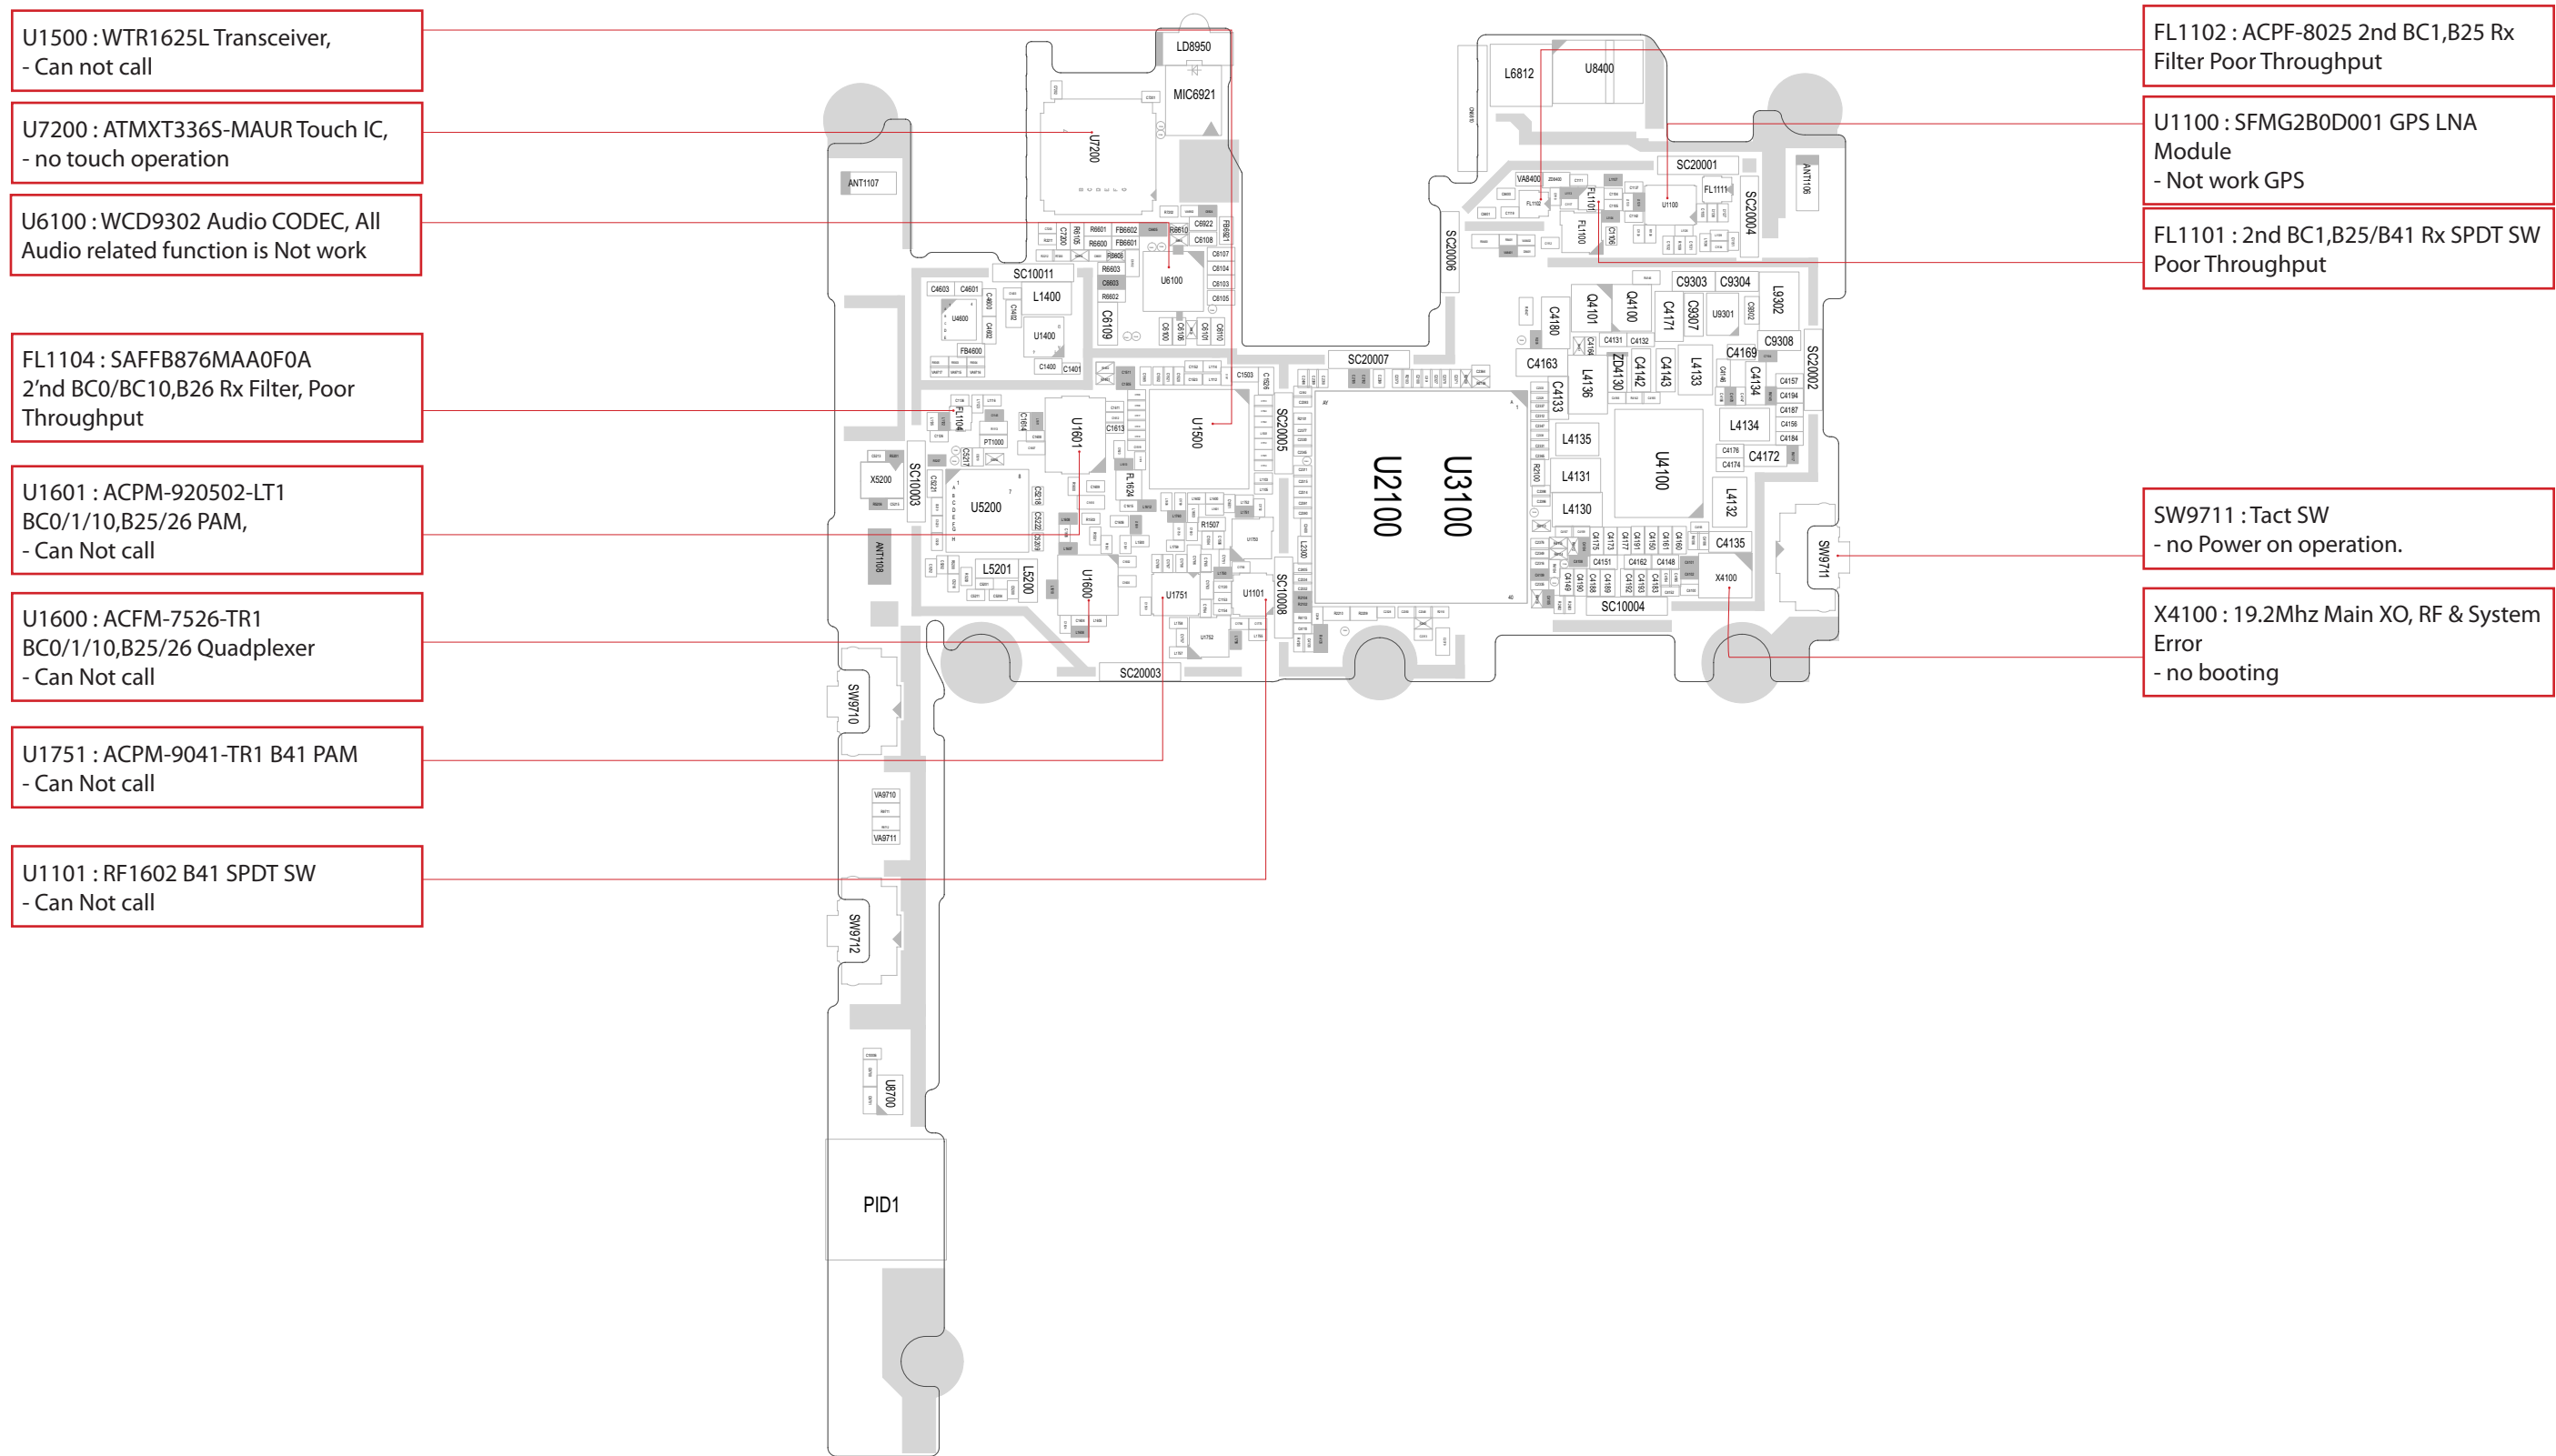




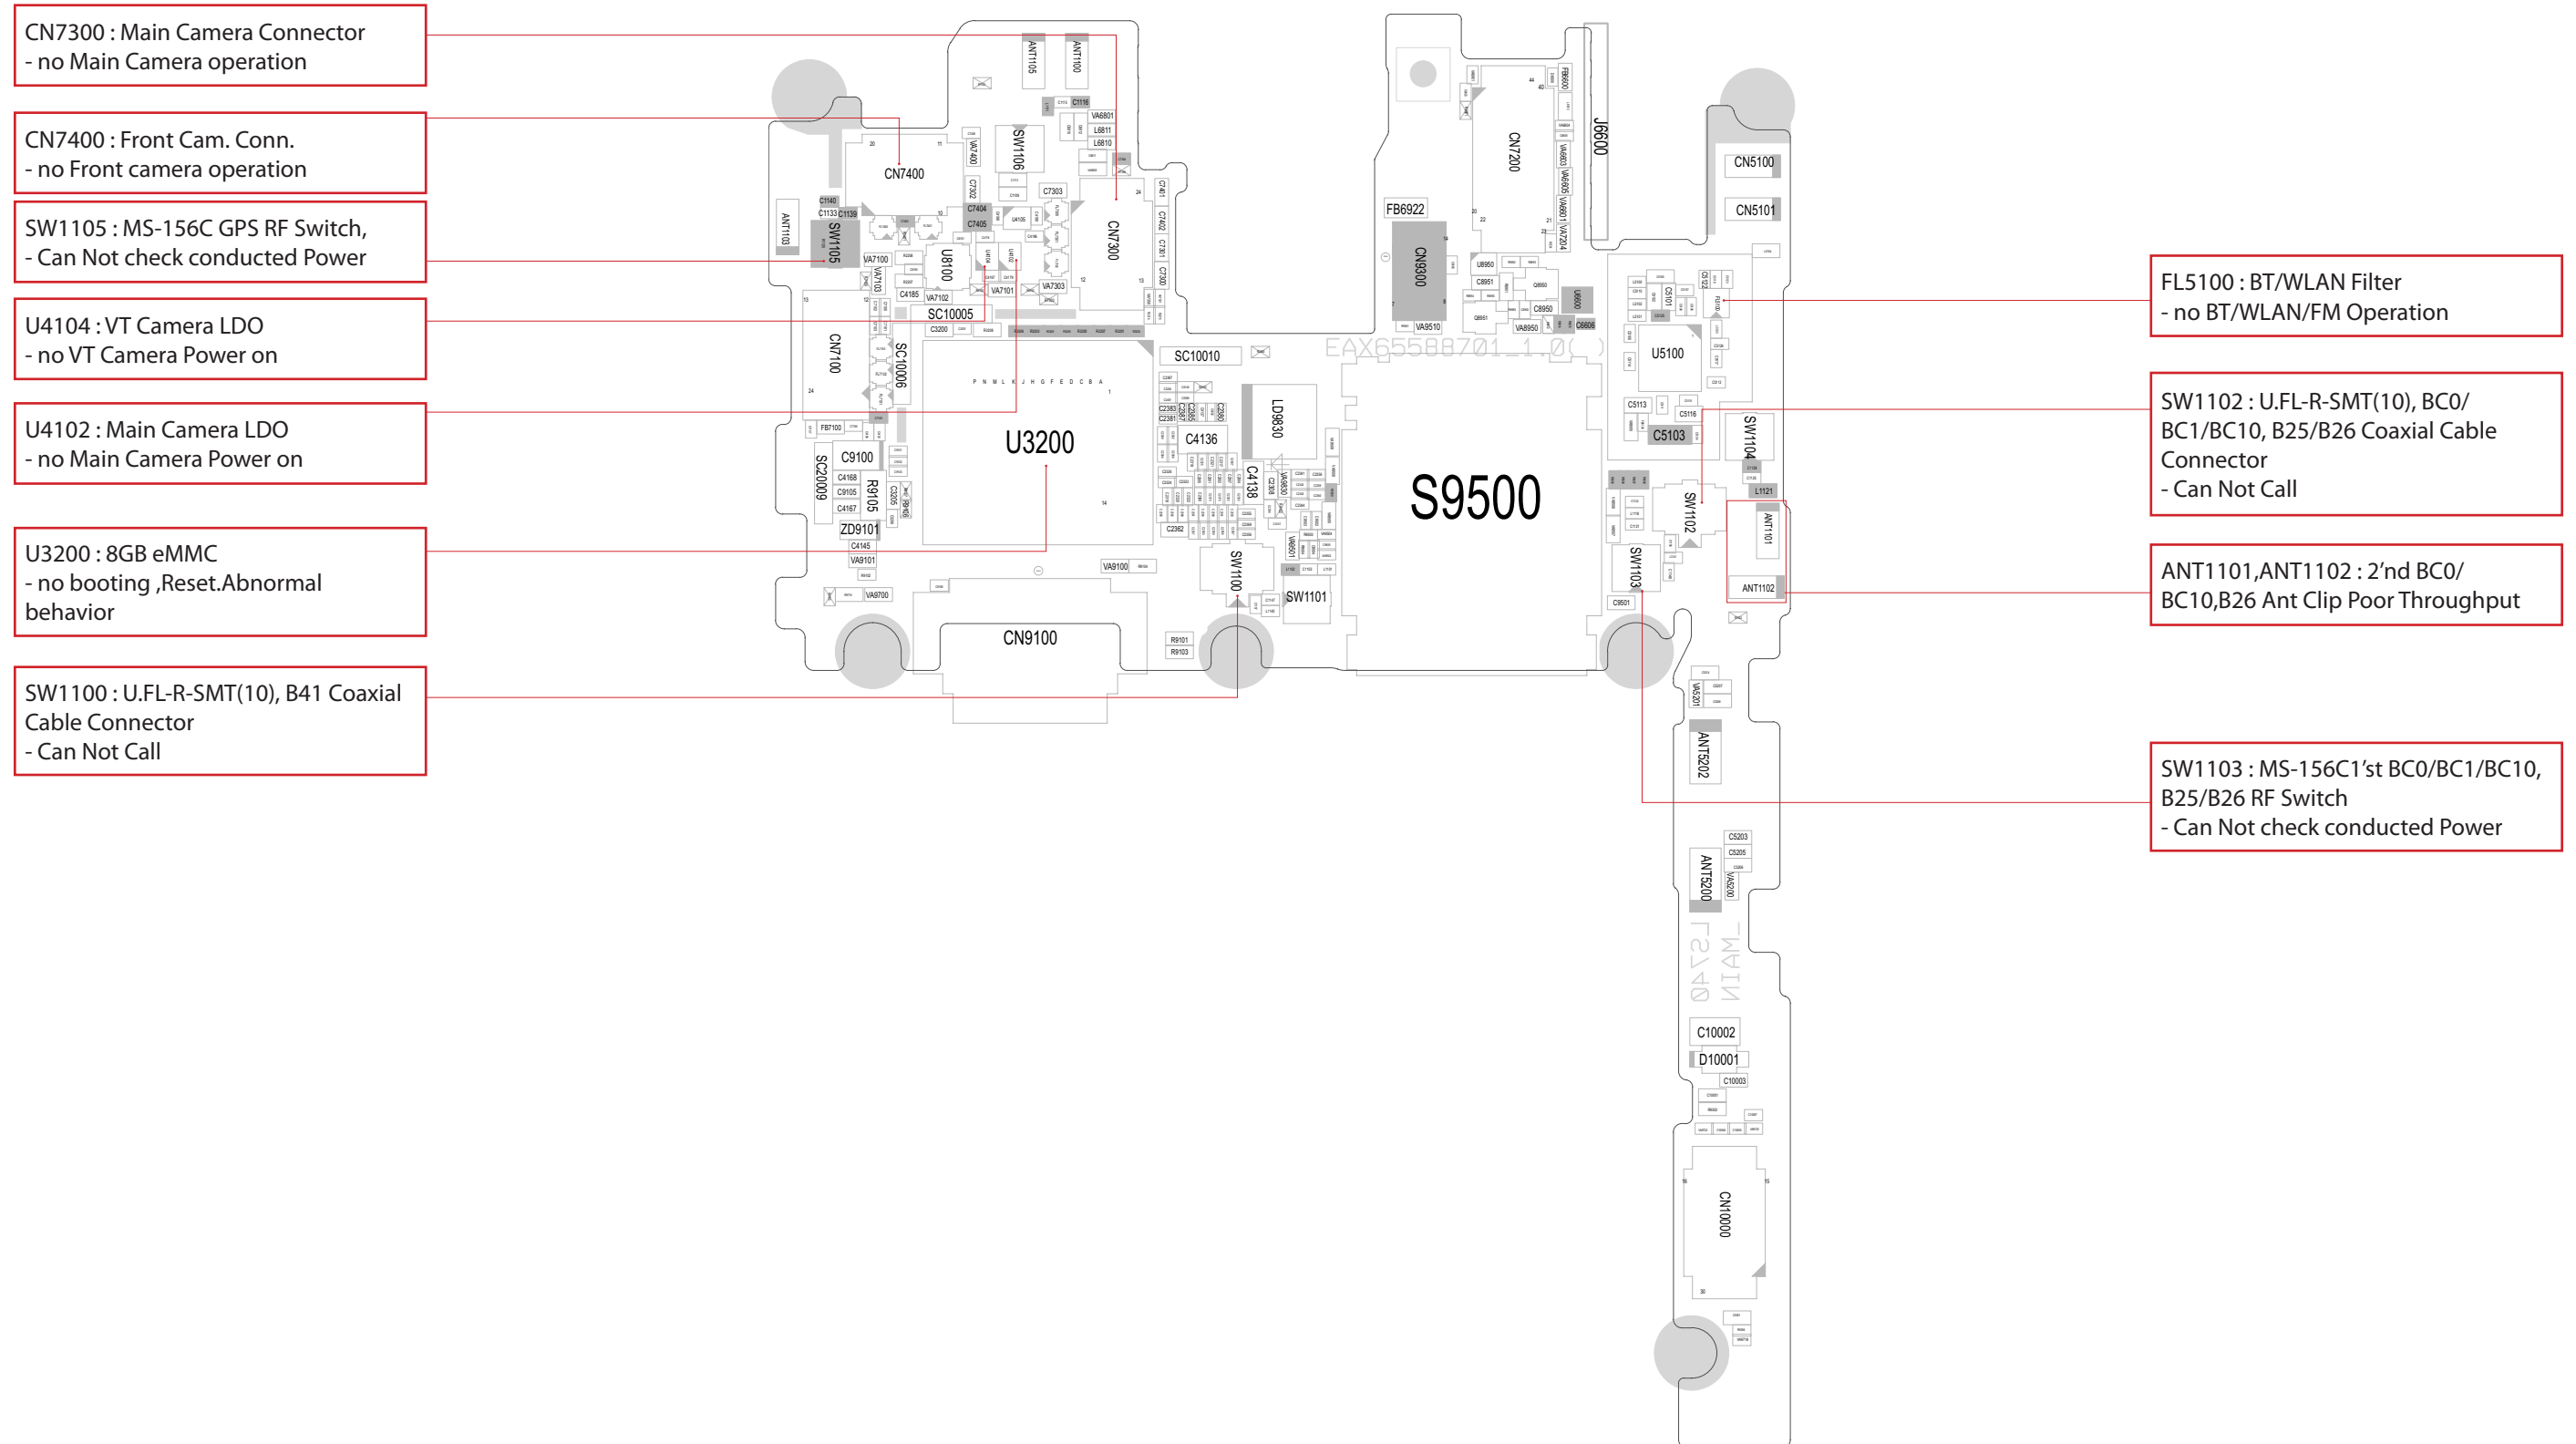




LG-LS740_MAIN_EAX65588701_1.0_BOT-2


9. CALIBRATION



CAL INFORMATION		
S/W VERSION		
[TachyonV48] LGLS740 20140417 ALL File Calibration		
Please Check the Version to "B2B"		
H/W		
	Name	Part No.
PIF	PIF200(All Type)	BJAY0024021
USB Cable	USB Cable	RAD32247898
Power Cable	DC Power Cable	RAD32247878
I/O Cable	5P E-SATA_DC_Plug	RAD32167861
RF Cable_Main	MS-156C	BJAY0024004
Power Supply_PIF	Power Supply 5.3V	
Power Supply_Phone	Power Supply 5.0V	
RF Test Equipment	CMW500, RF800A	
NOTICE	1. Use the dummy Battery (Refer to Attached image) 1) Phone states: Power off 2) If do not use the dummy battery, GSM TX fails. 2. Port Setting (Refer to Attached image) 1) Uart Port2 : Use the "LGE CDMA USB Serial Port"	
CMW500 RF Cable connection	Reference to Attached ppt -> How to connect between phone RF switch and RF 800A: It has to be connected as below -> How to connect between CMW500 and RF800A ; It has to connected as below - CMW500 [RF1COM] to RF-800A [left COM], - CMW500 [RF2COM] to RF-800A [Right COM]	



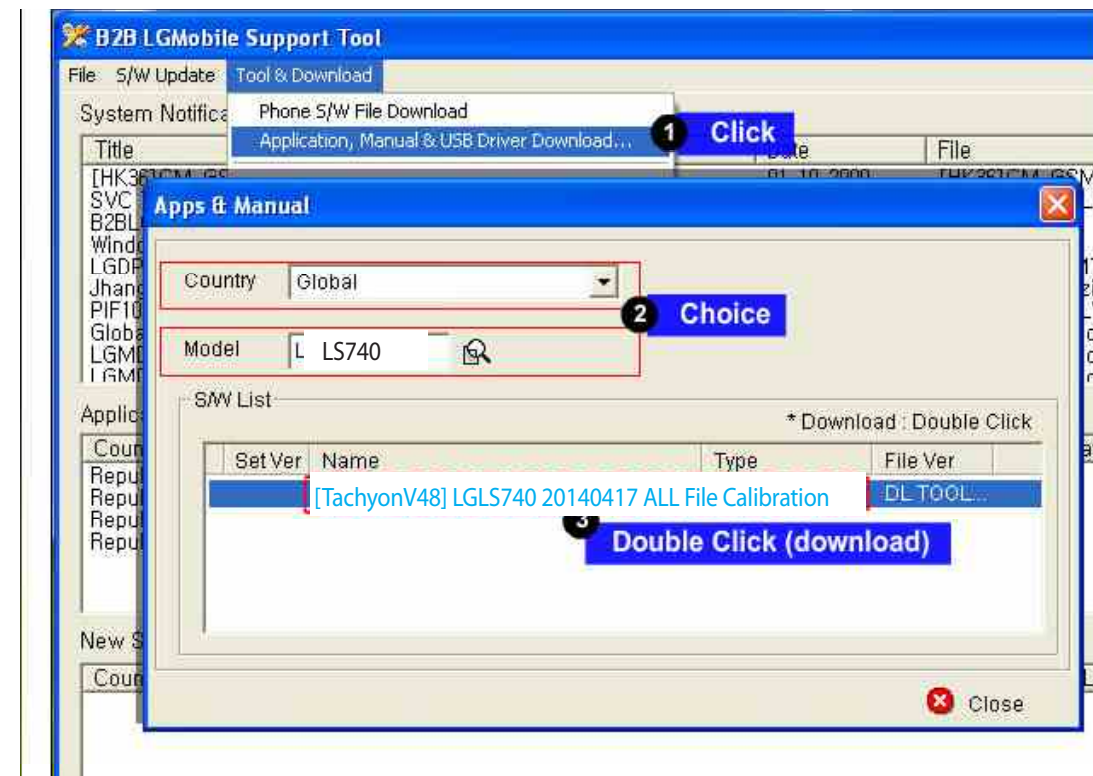
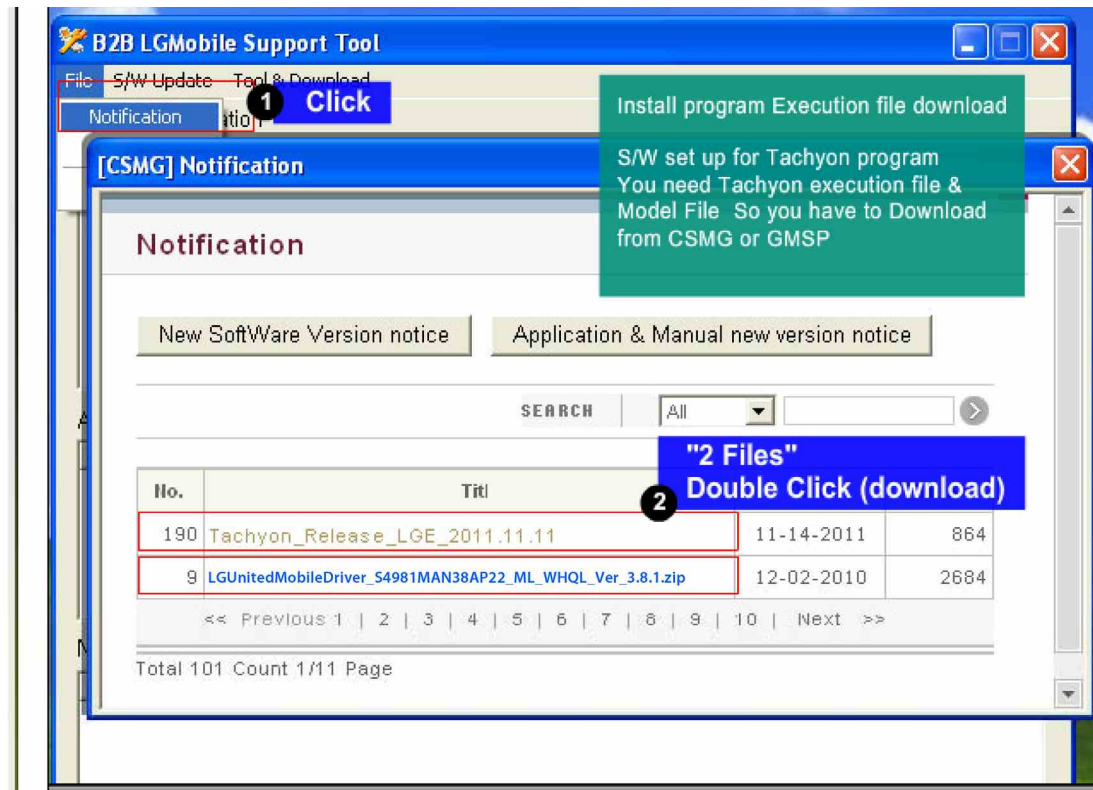


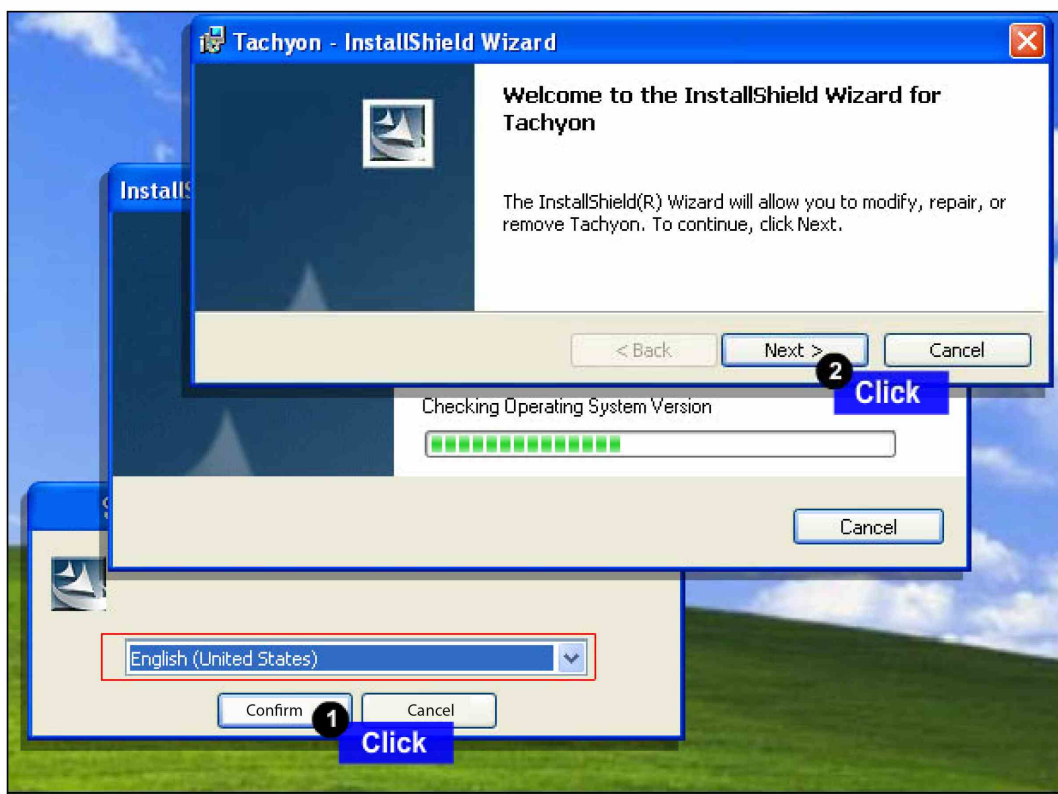
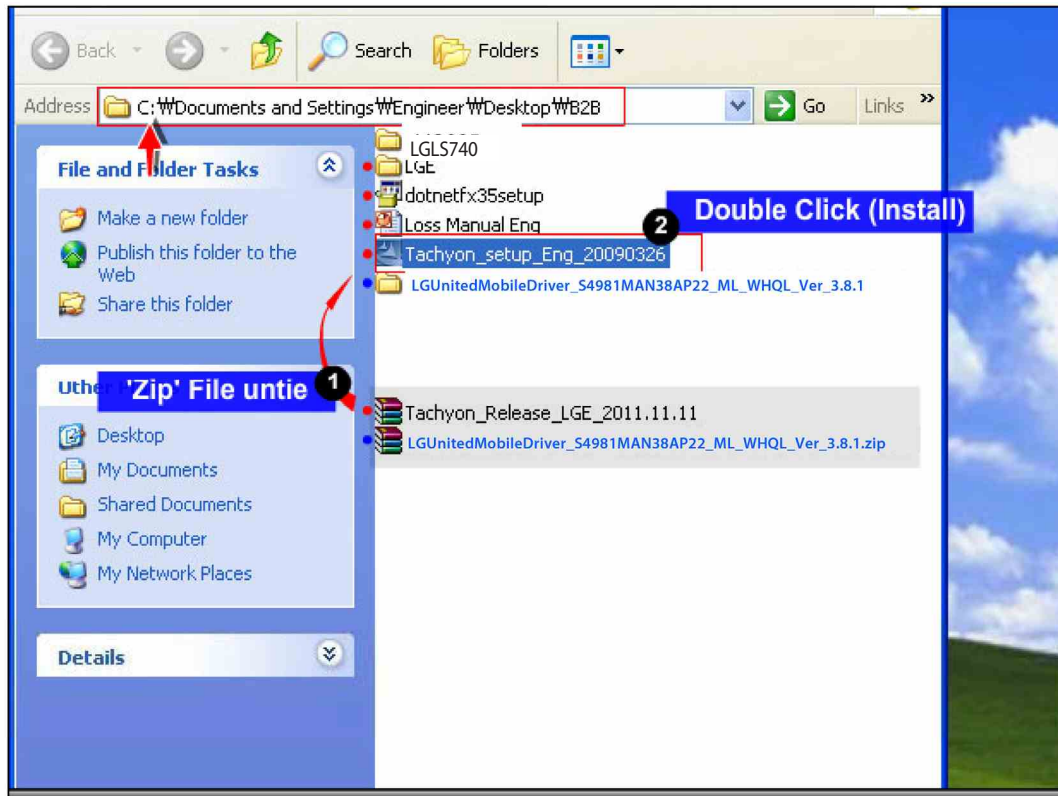


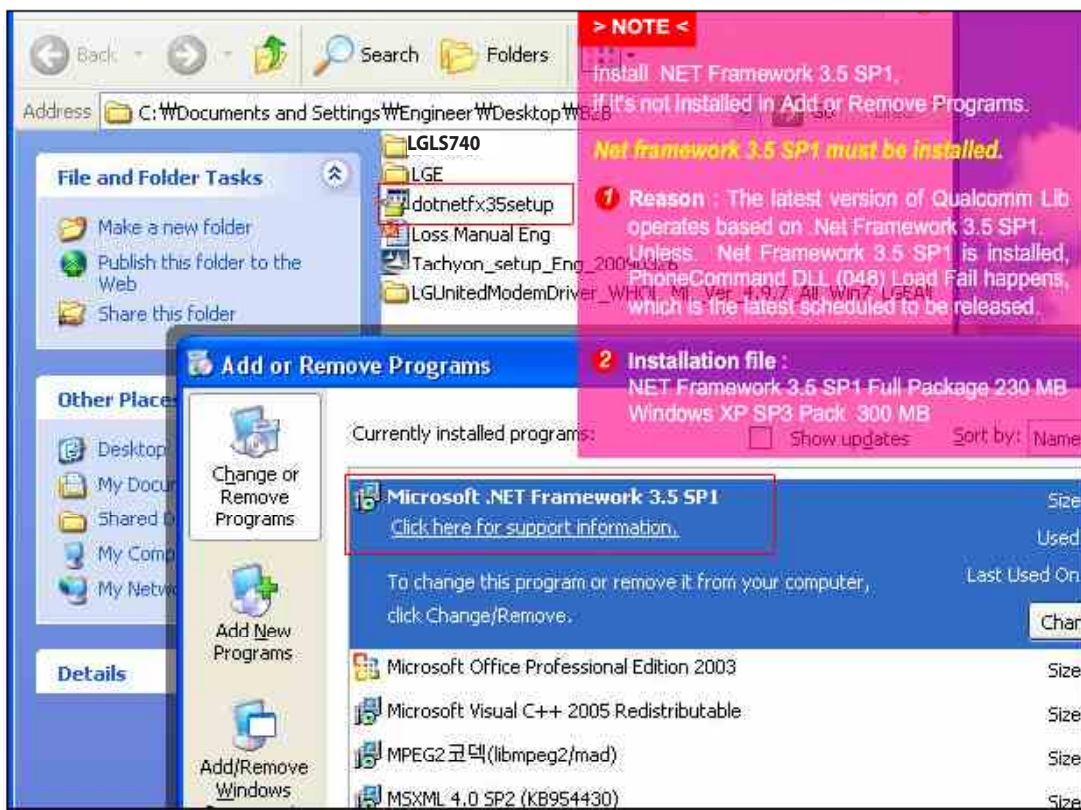

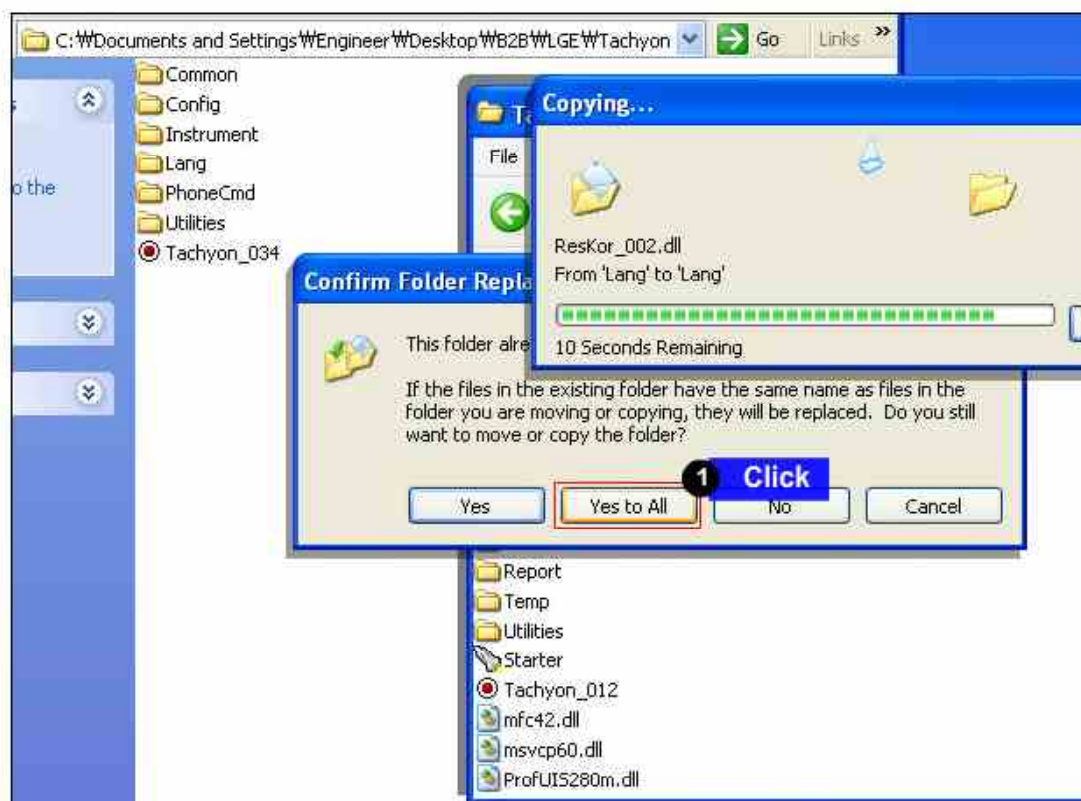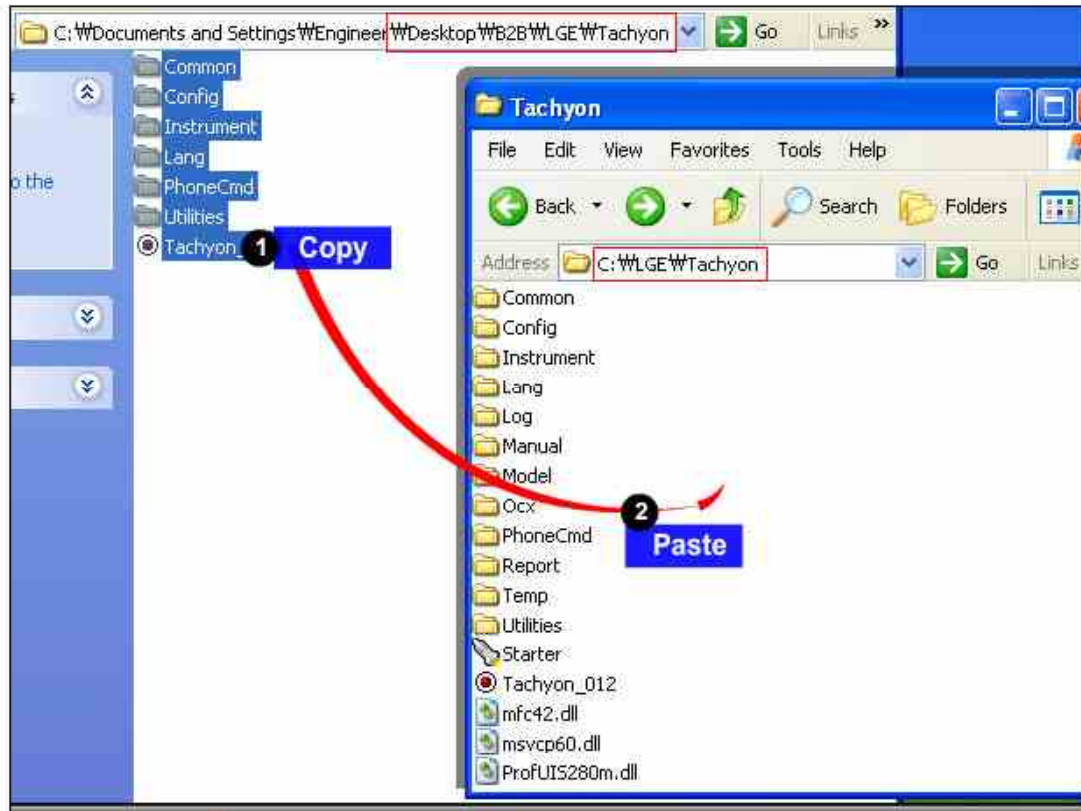


9. CALIBRATION

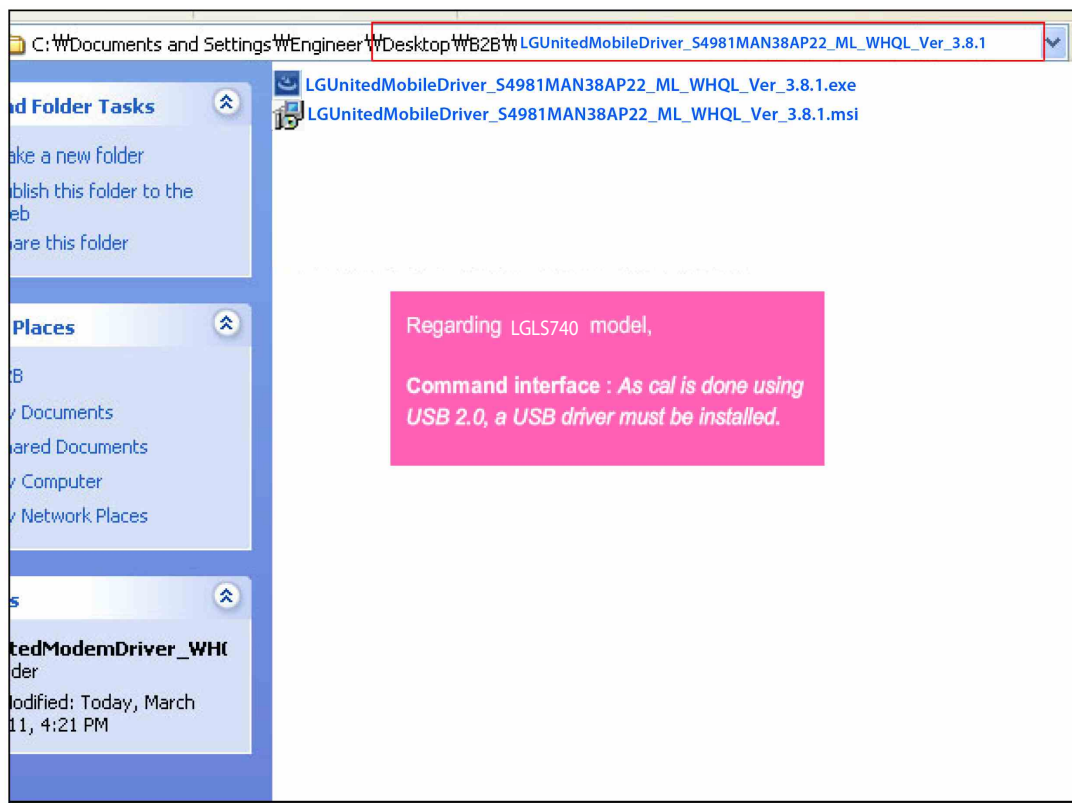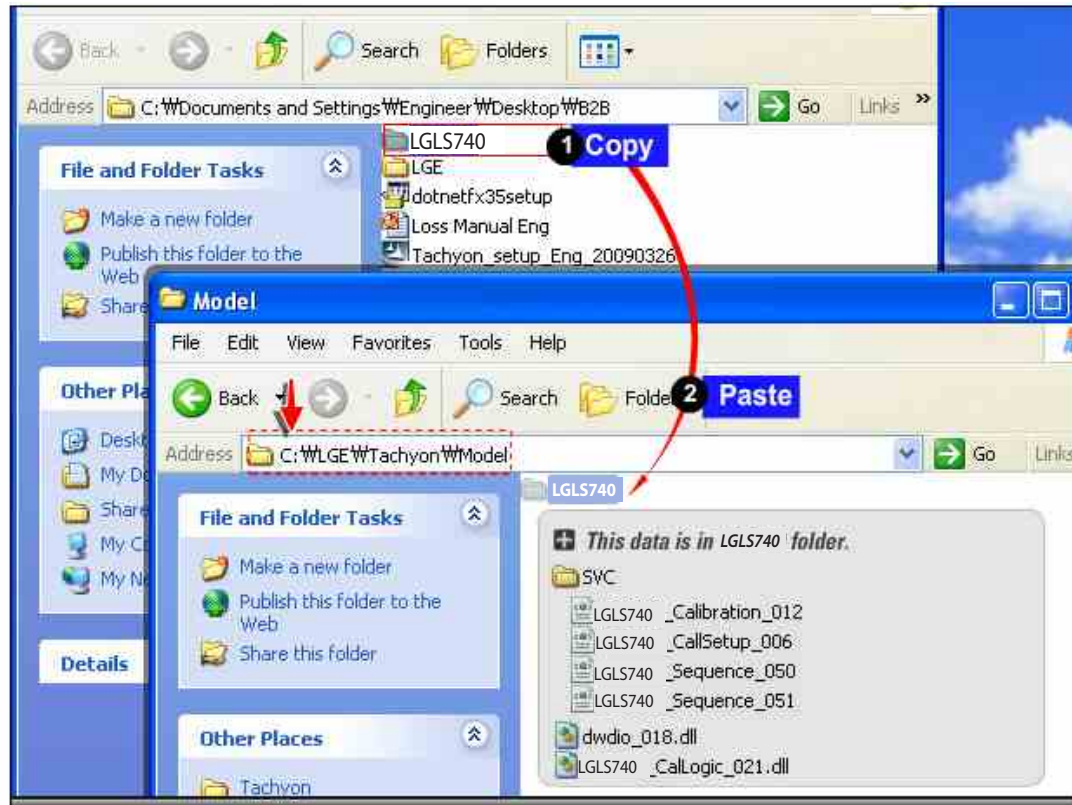


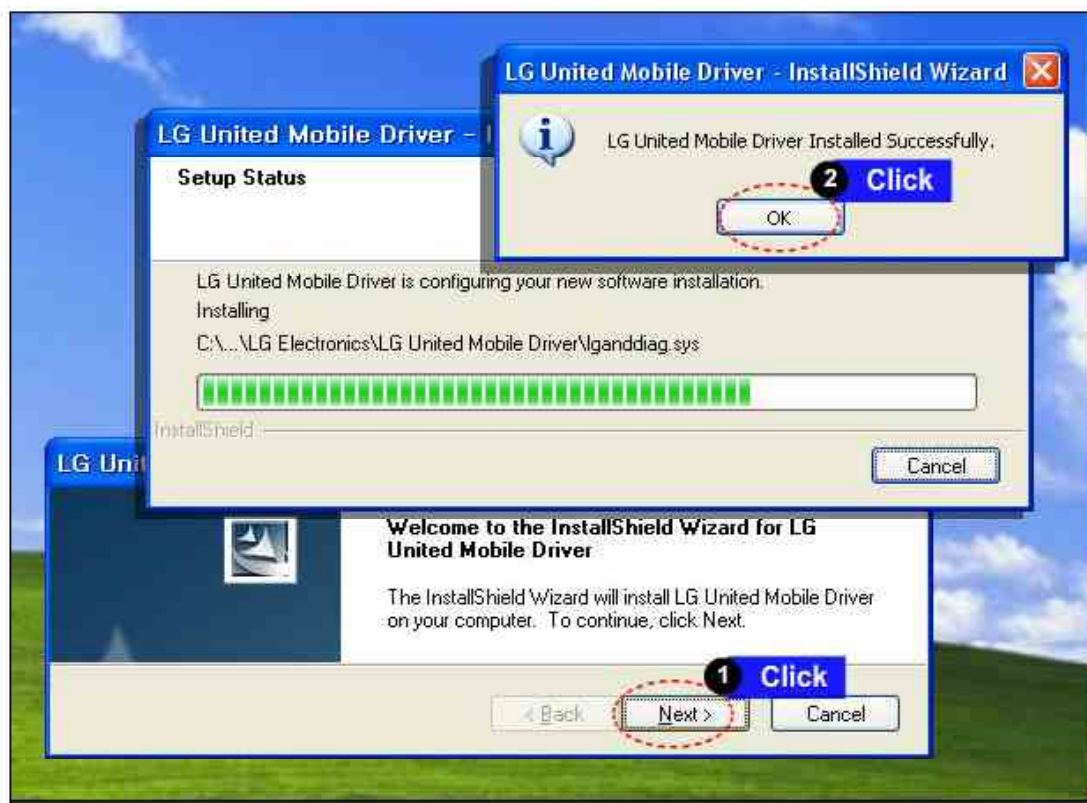
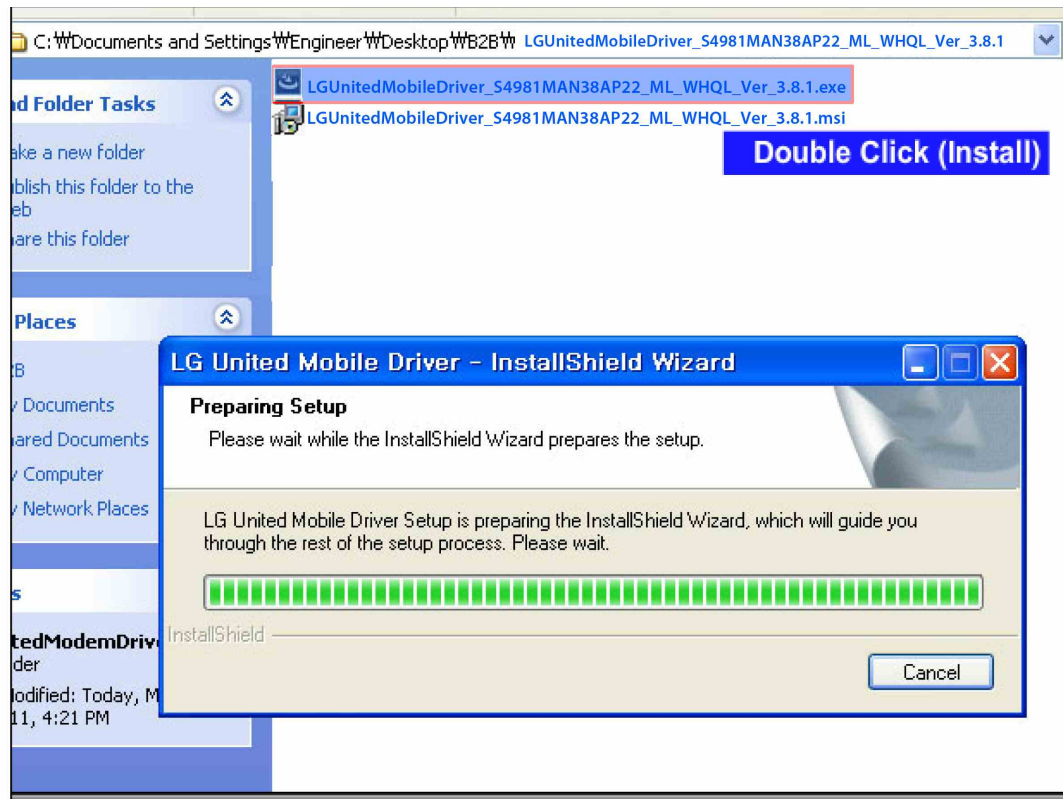



9. CALIBRATION


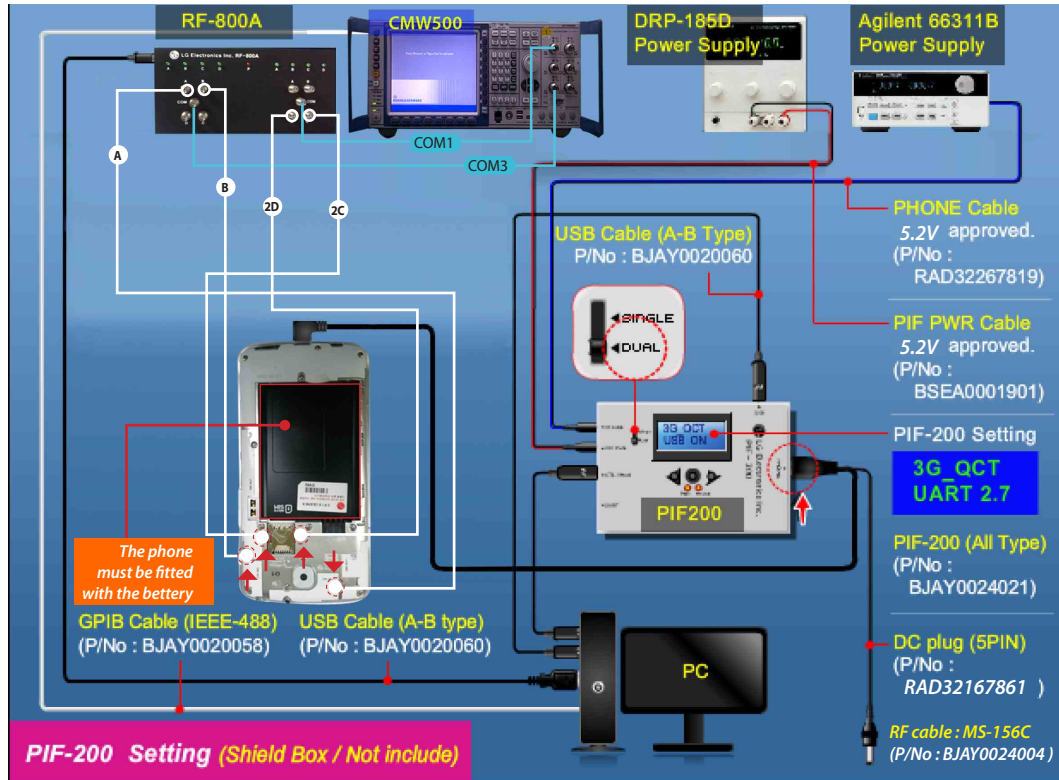


→ This is for example.
You can check "C:\LGE\Tachyon\Model\LS740\Setting Guide" ←


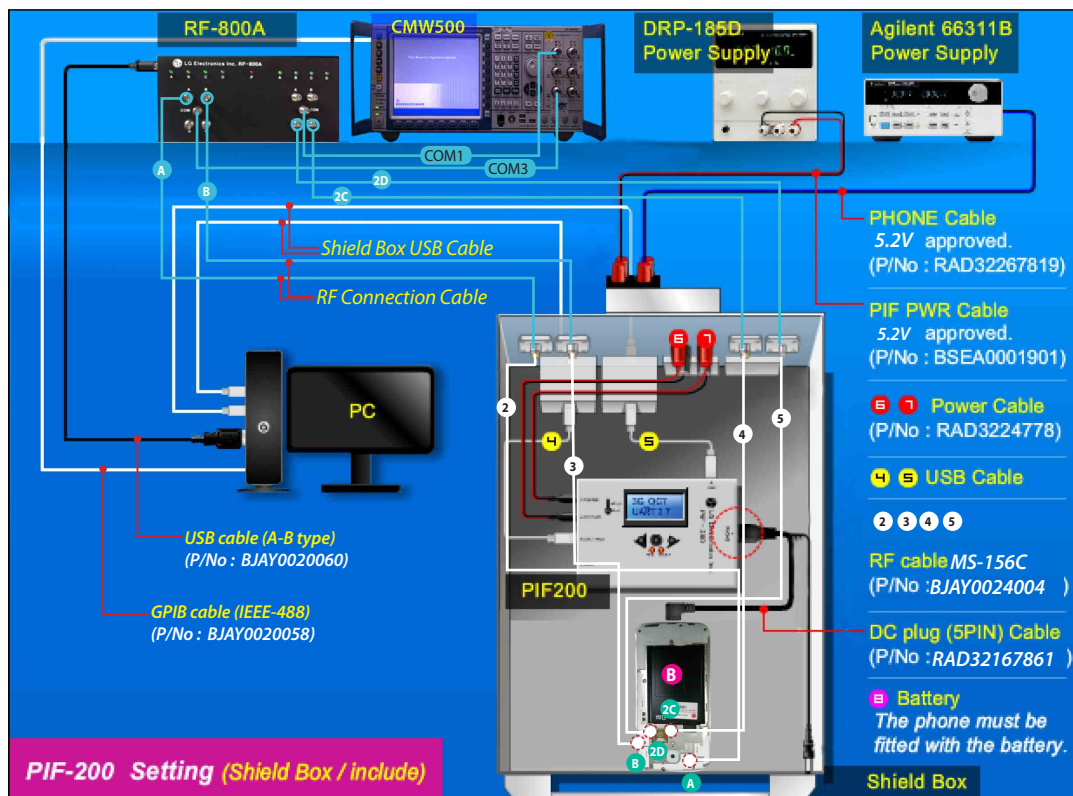


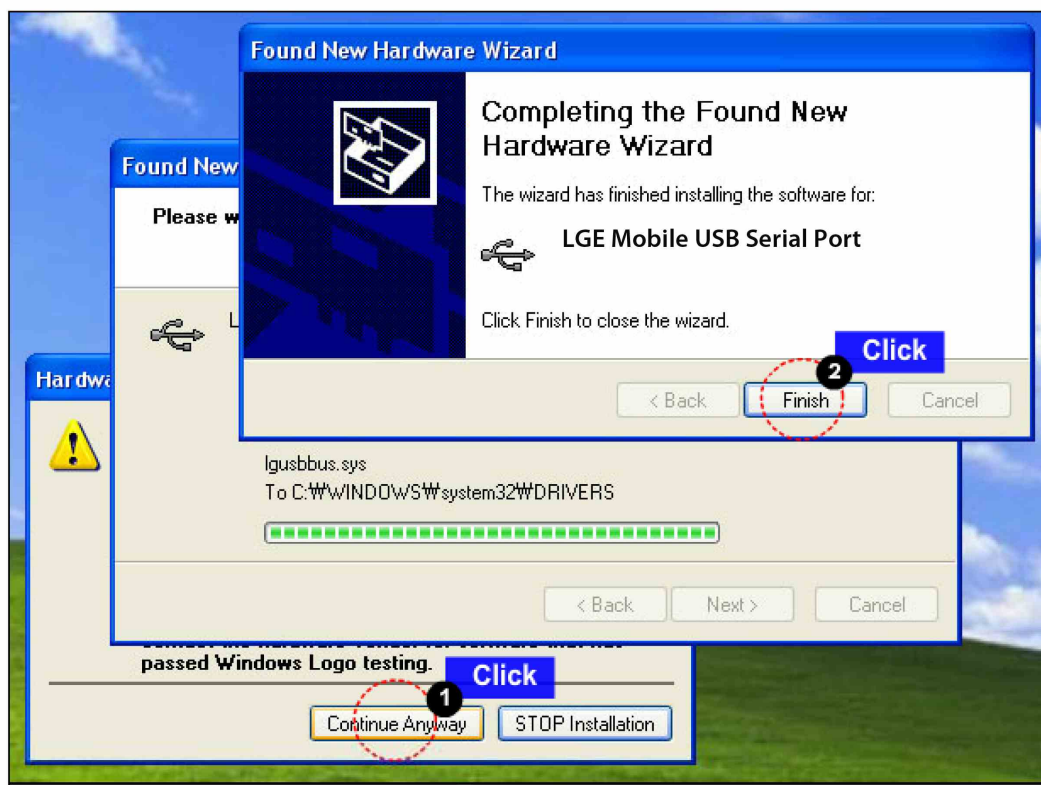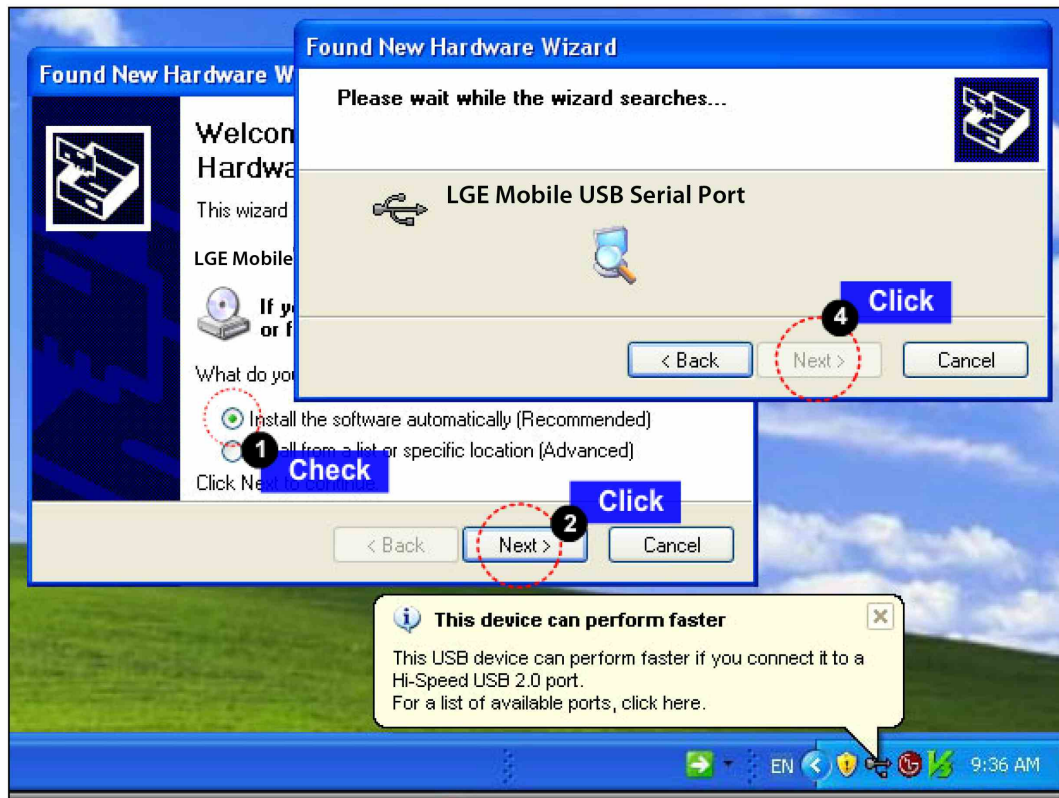


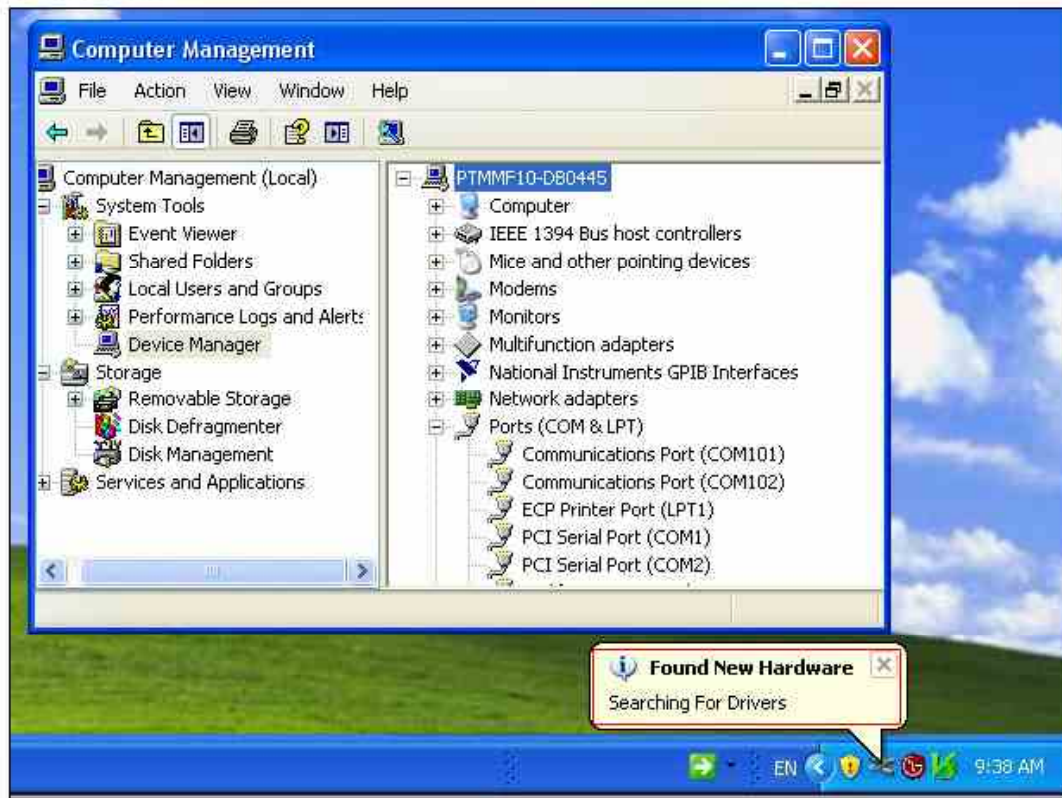


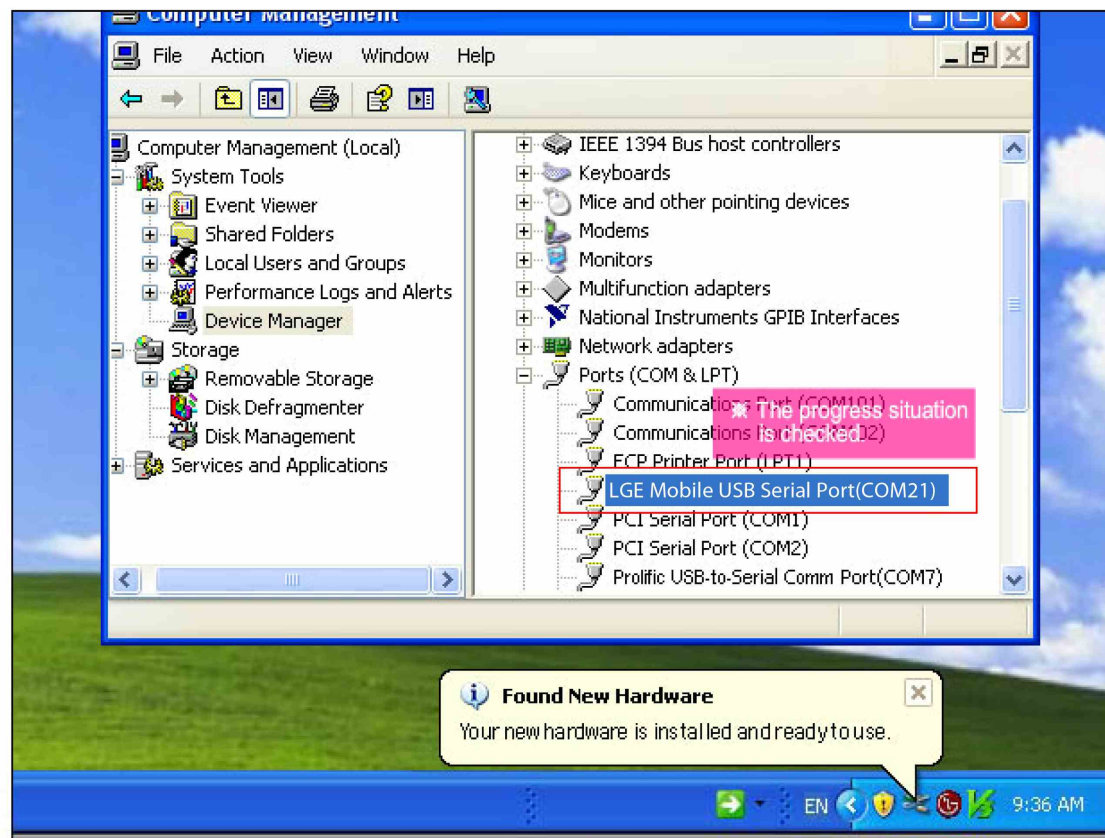
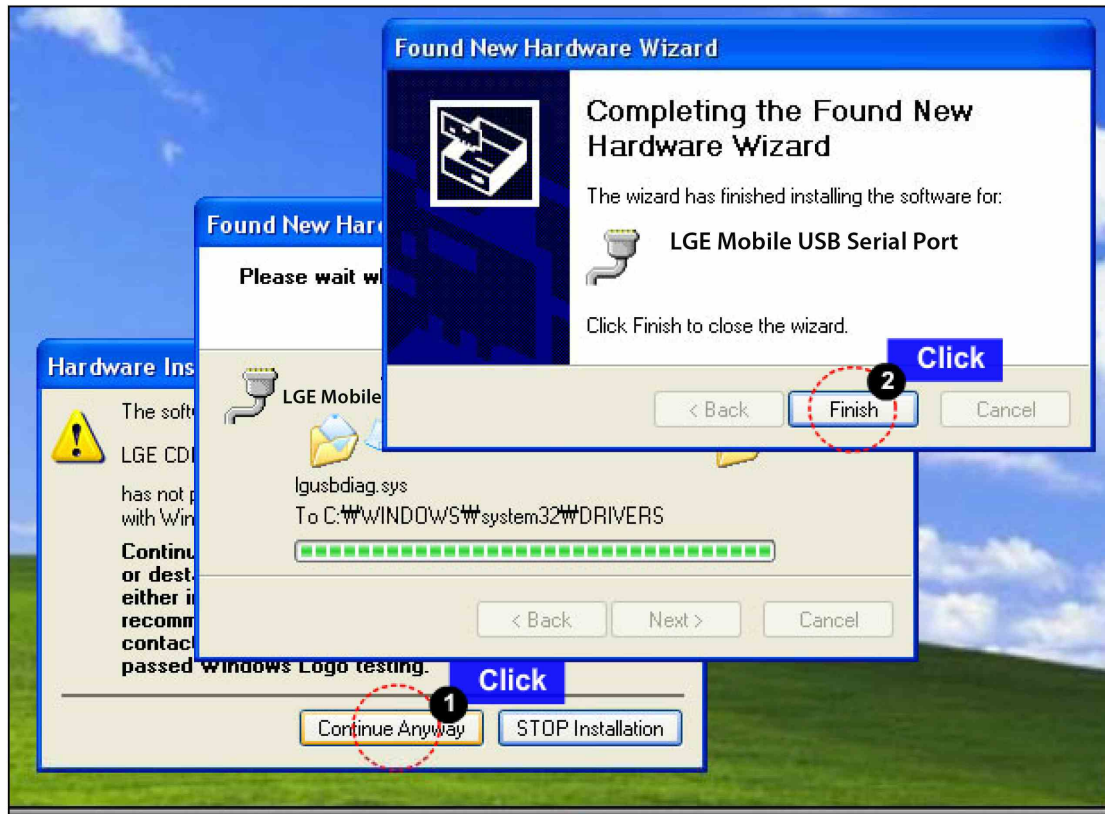




9. CALIBRATION

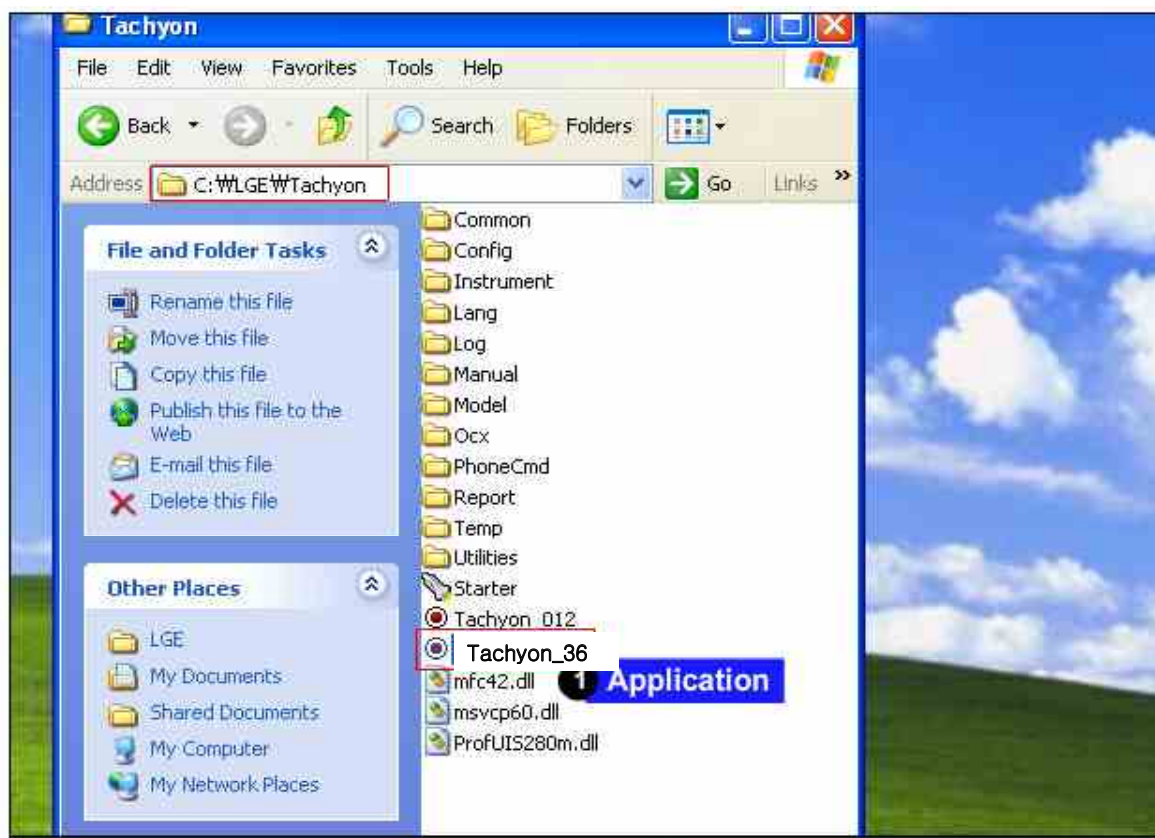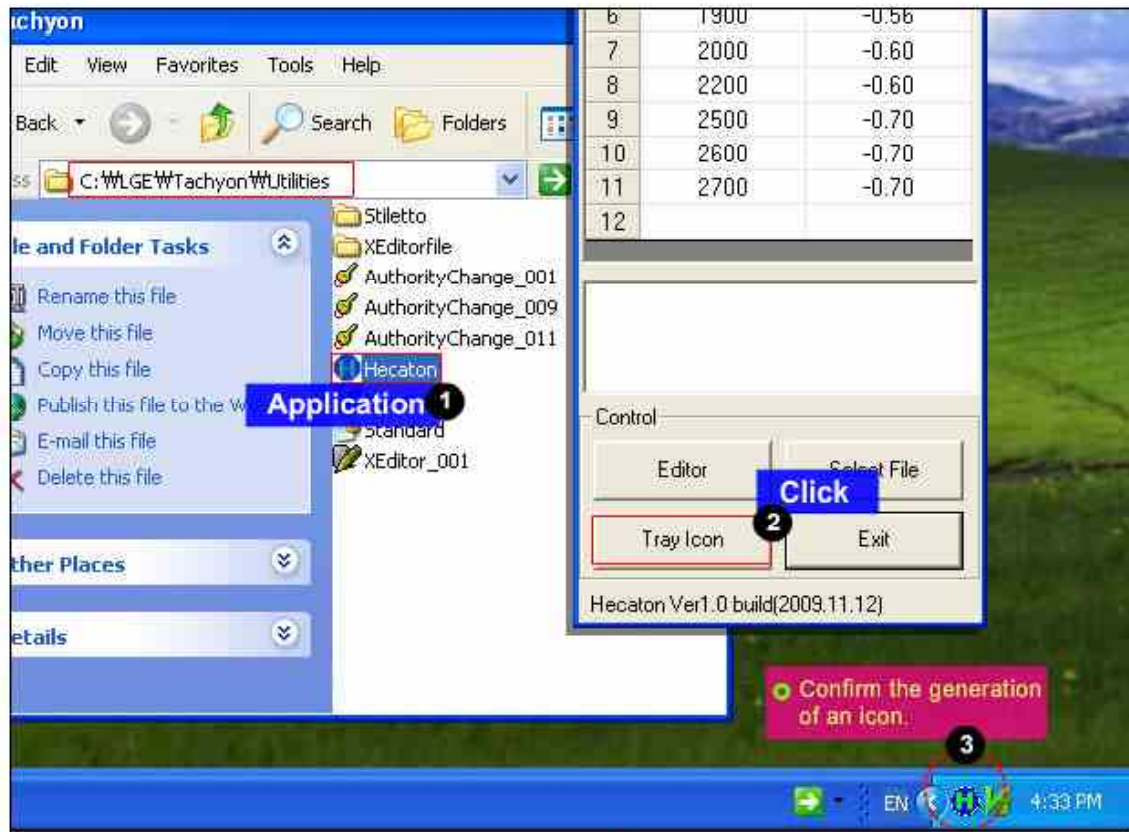



9. CALIBRATION

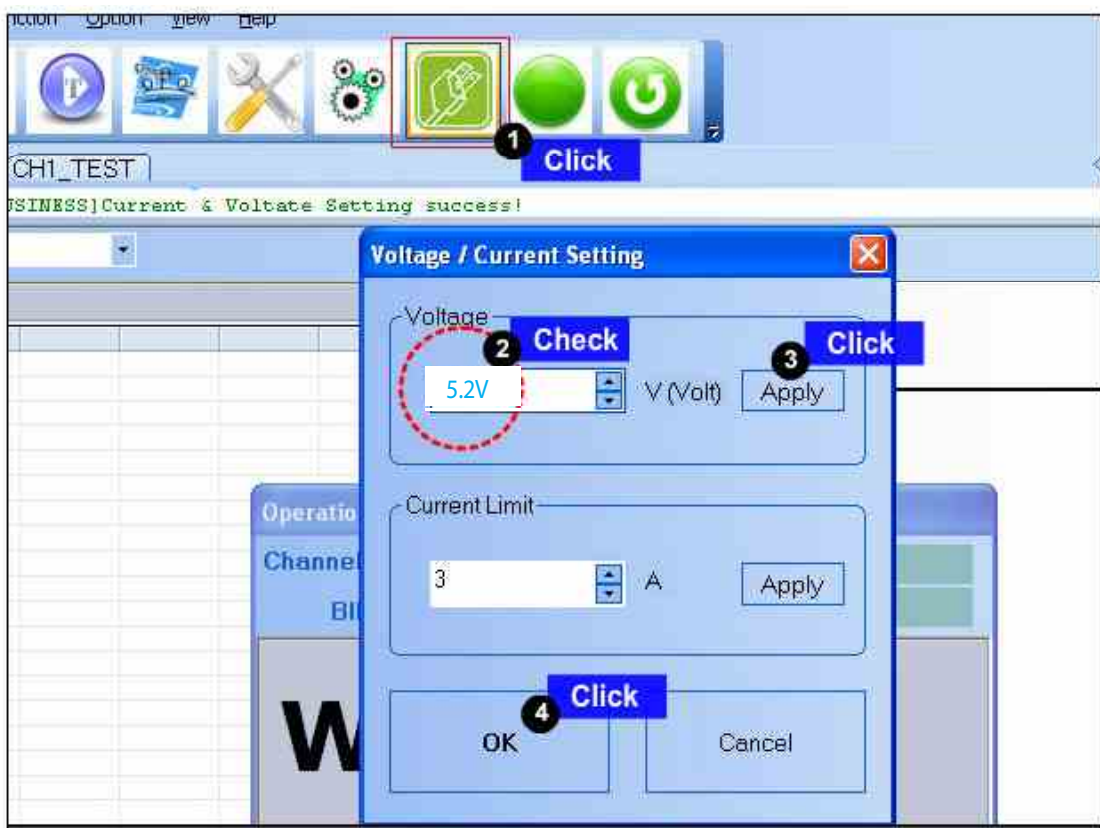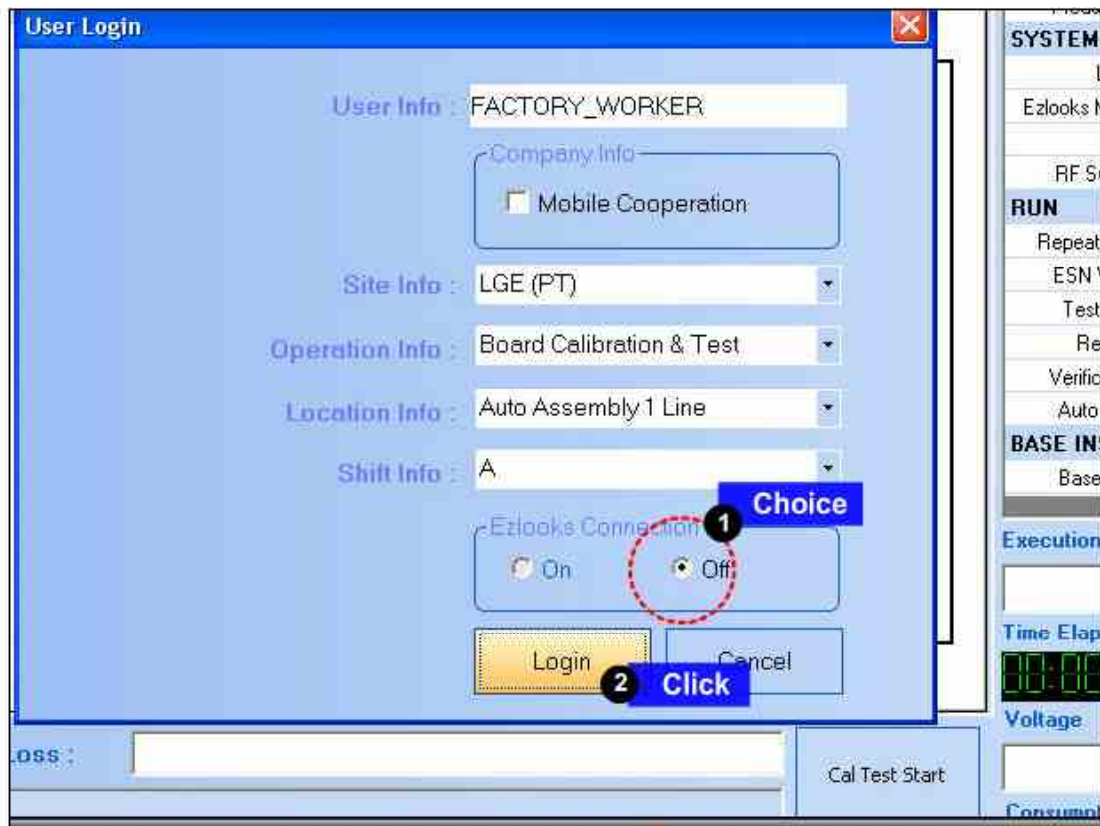

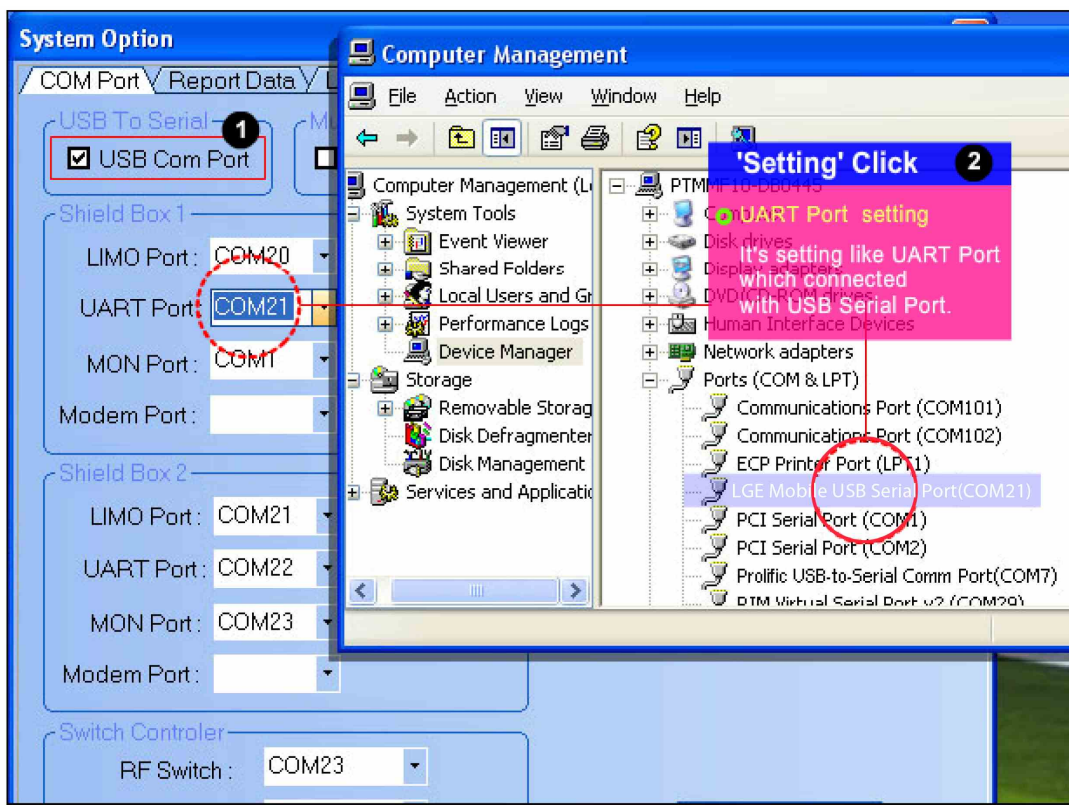
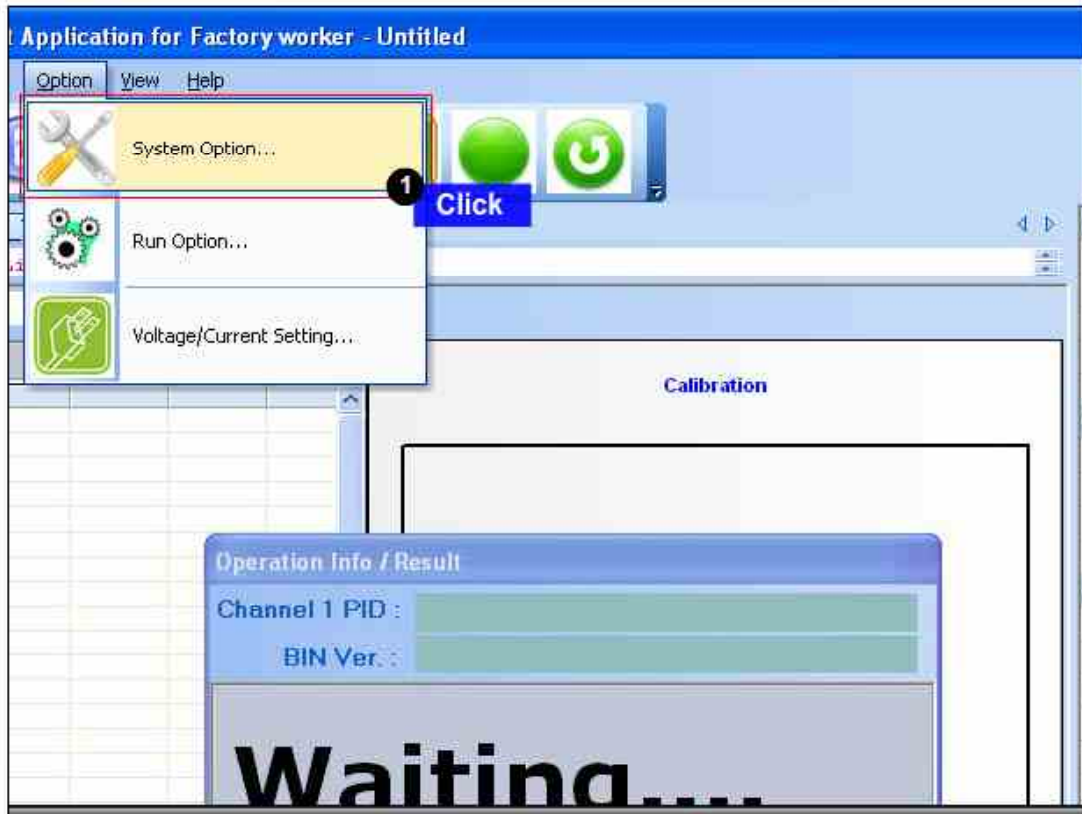


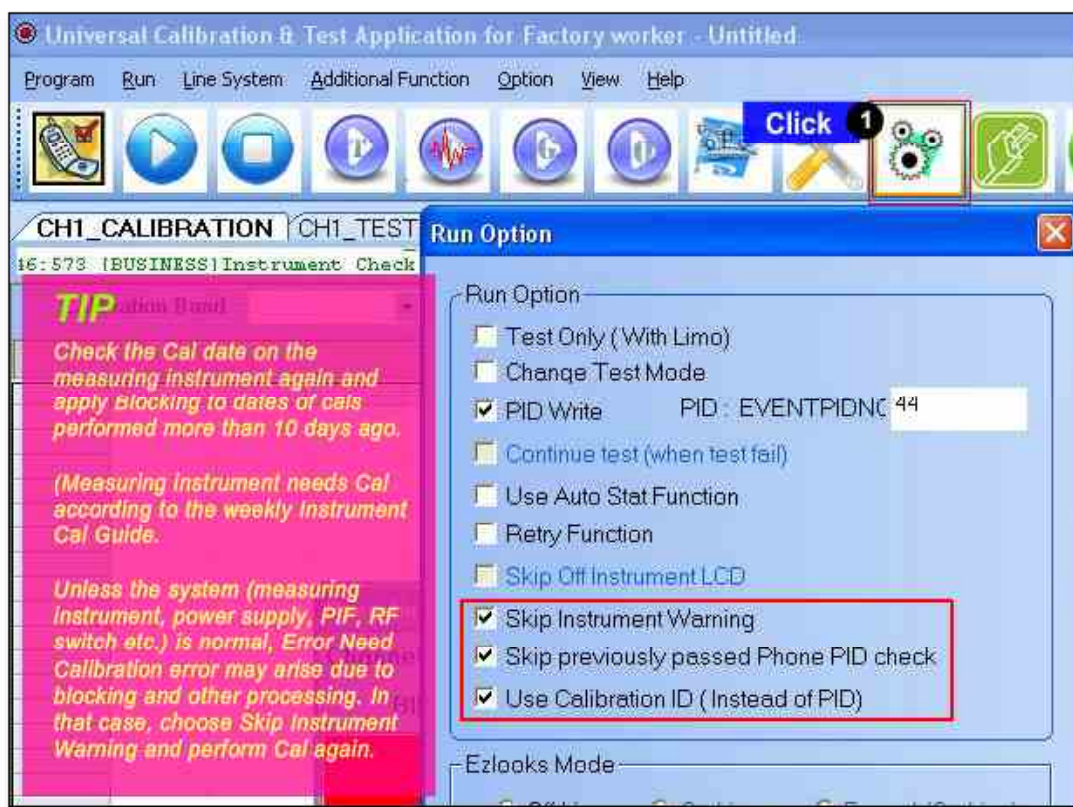
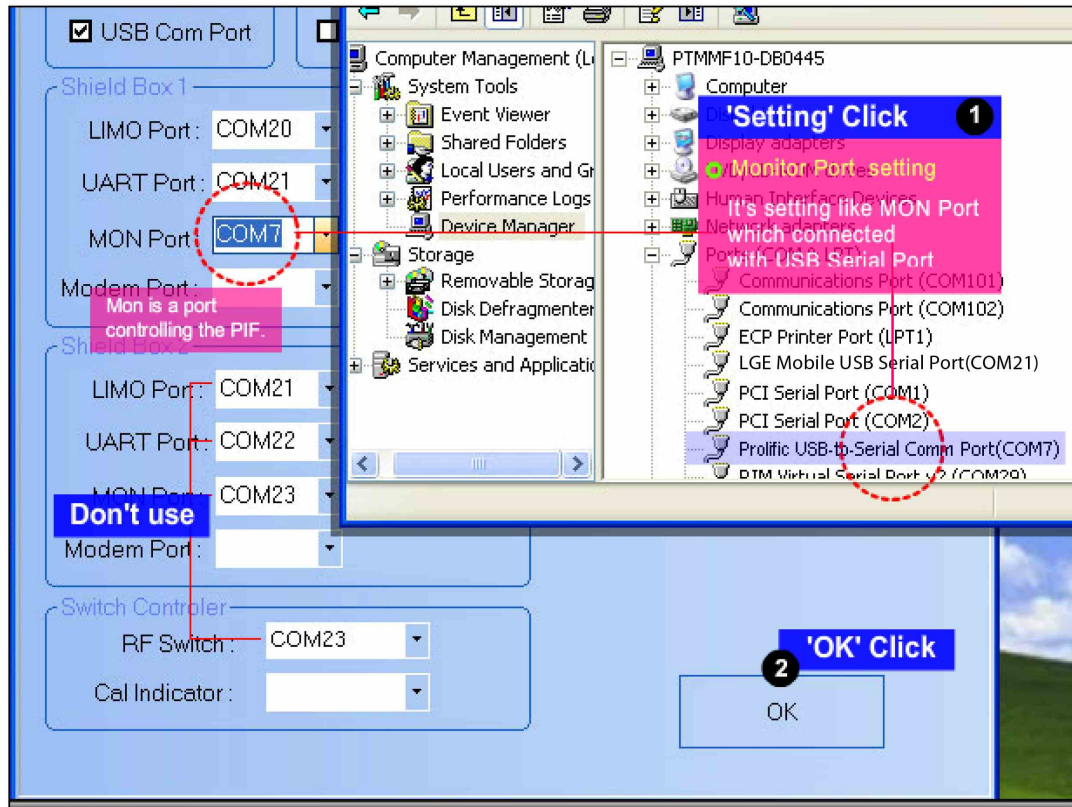


9. CALIBRATION

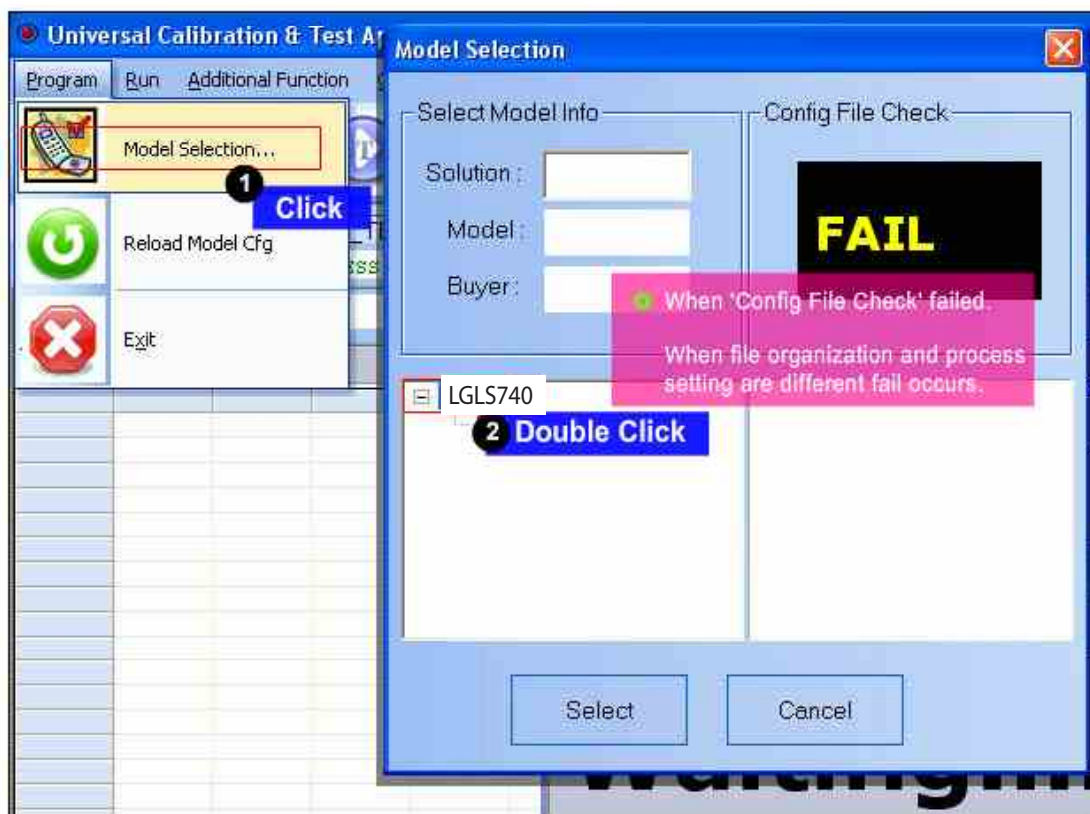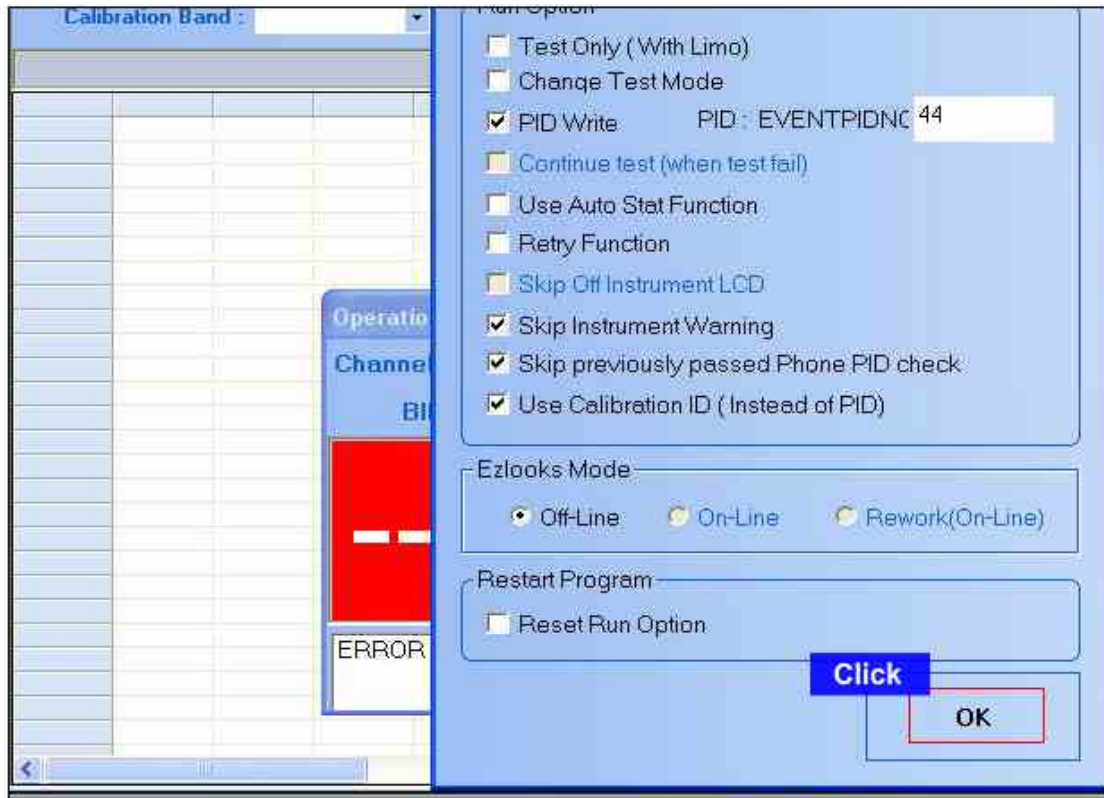

9. CALIBRATION

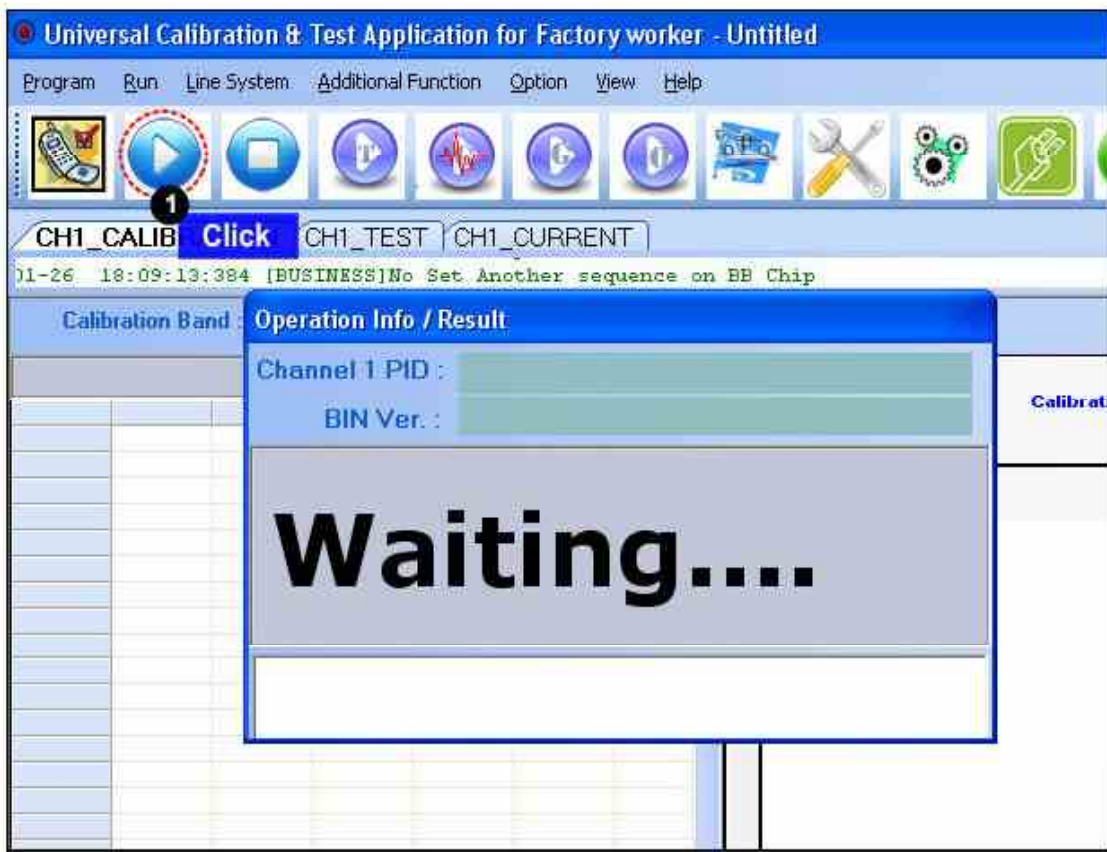
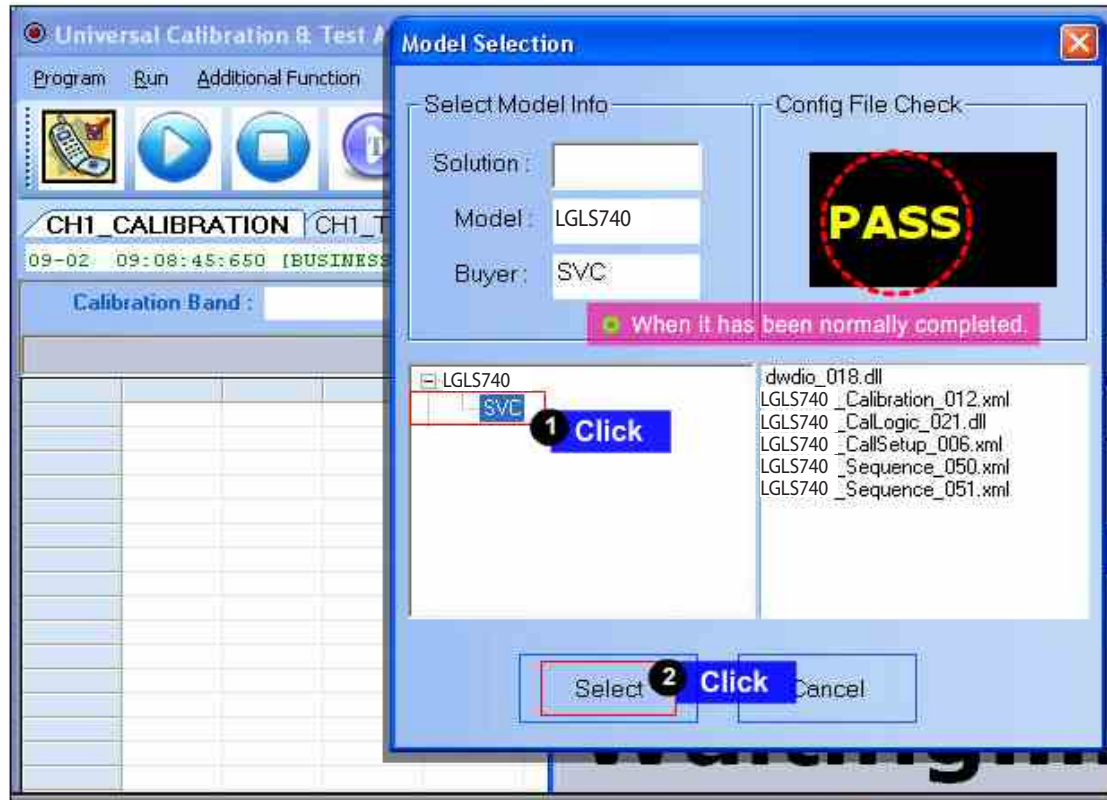


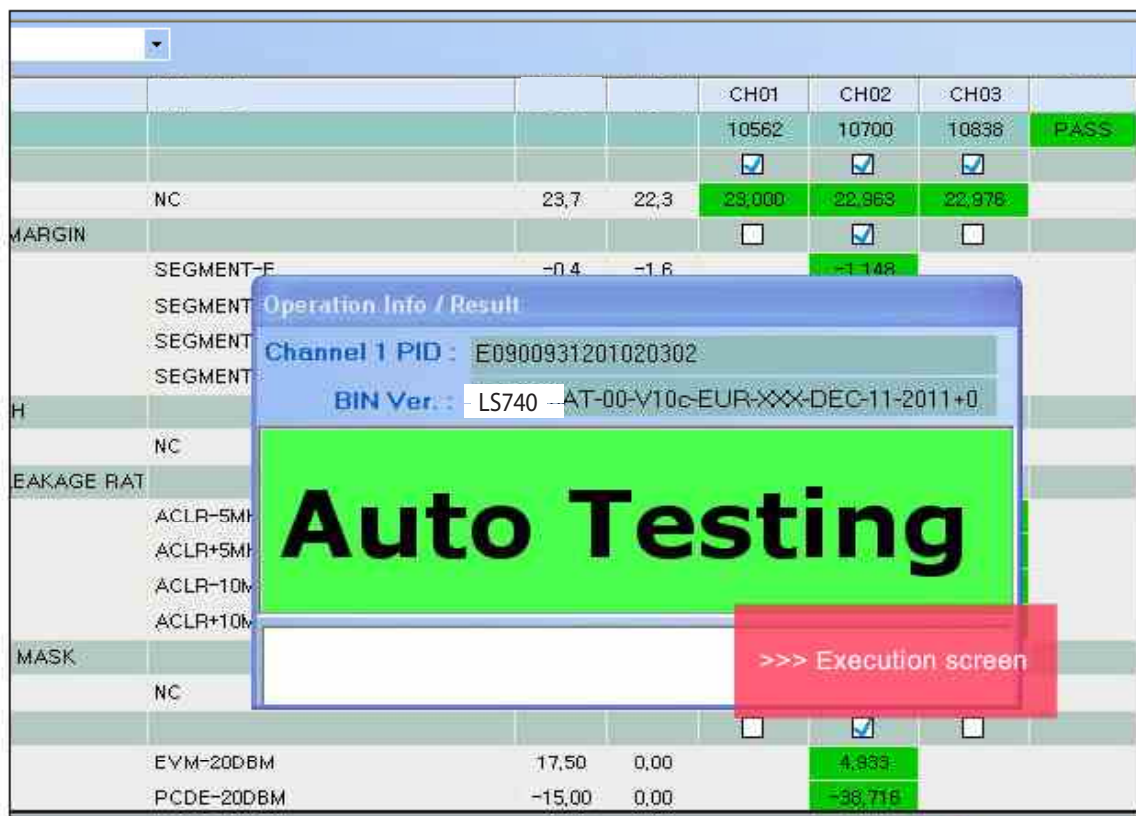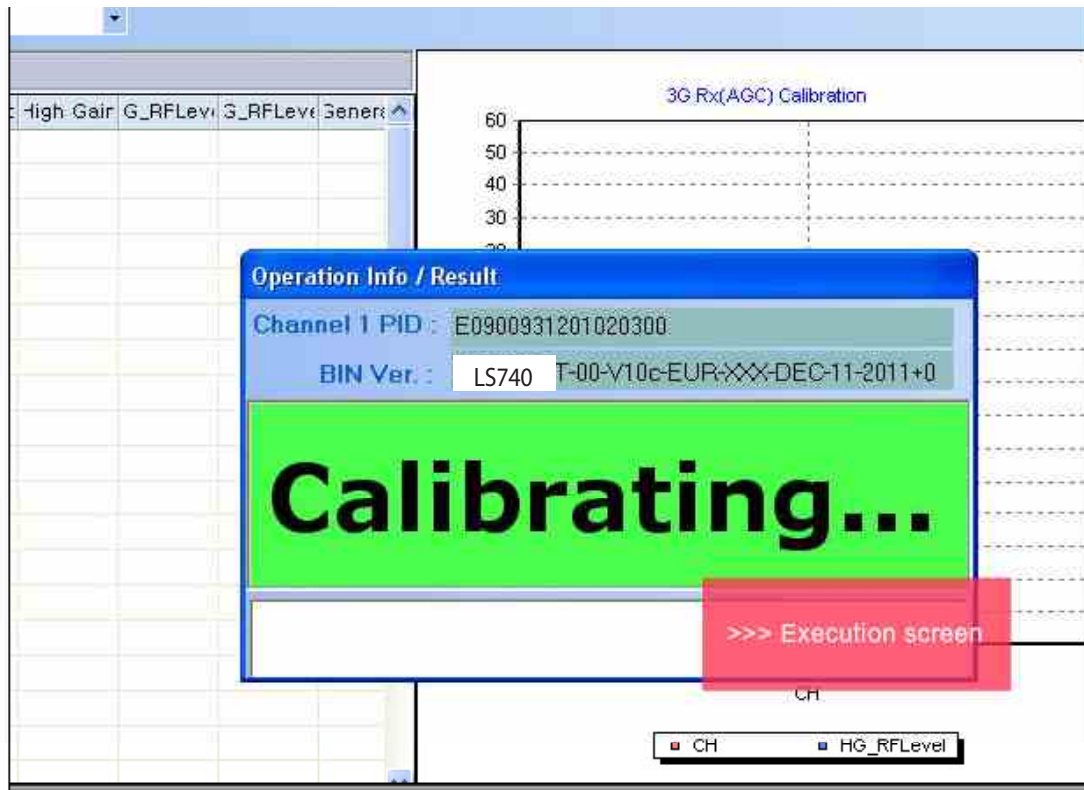



	Condition	USL	LSL	CH01	CH02	CH03	P/F
				10582	10700	10838	PASS
				☒	☒	☒	
	NC	23,7	22,3	23,065	22,963	23,013	
MARGIN				☐	☒	☐	
SEGMENT	Operation Info / Result Channel 1 PID : F09008931201020299 BIN Ver. : LS740 AT-00-V10c-EUR-XXX-DEC-11-2011+0 --- PASS ---						
SEGMENT							
SEGMENT							
SEGMENT							
OTH							
	NC						
LEAKAGE RAT							
ACLR-5M							
ACLR+5M							
ACLR-10M							
ACLR+10M							
IN MASK							
	NC	0,5	-0,5				
Y							☐
	EVM-20DBM	17,50	0,00		-4,320		
	PCDE-20DBM	-15,00	0,00		-38,441		
System Loss :		MySystem(MS).gms RF900 6C.grf					

'PASS' The End

10. NAM INPUT METHOD

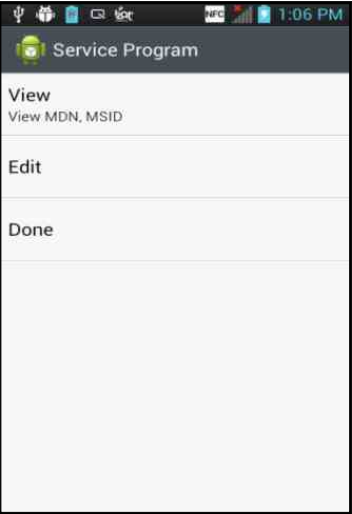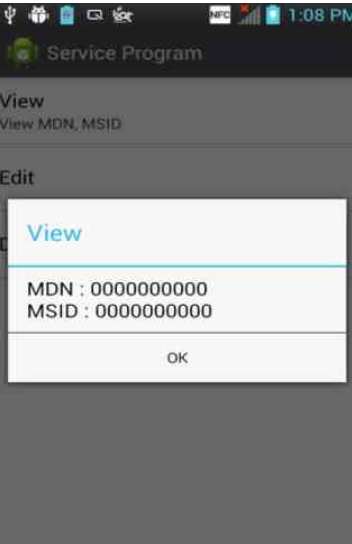 The screenshot shows the dial pad interface with the number ##000000# entered. The top bar includes icons for Dial, Call logs, Contacts, and Favorites. The keypad has standard numeric and function keys.	1. Enter ##MSL# (enter ##000000# if MSL is "000000")
 The screenshot shows the 'Service Program' menu with options: View, Edit, and Done. The 'View' option is highlighted, and a subtitle 'View MDN, MSID' is visible below it.	2. Select [View] to check MDN & MSID
 The screenshot shows the 'Service Program' menu with the 'View' option selected. A dialog box is displayed with the following text: 'View', 'MDN : 0000000000', 'MSID : 0000000000', and an 'OK' button.	3. Check MDN & MSID and Press [OK]

10. NAM INPUT METHOD

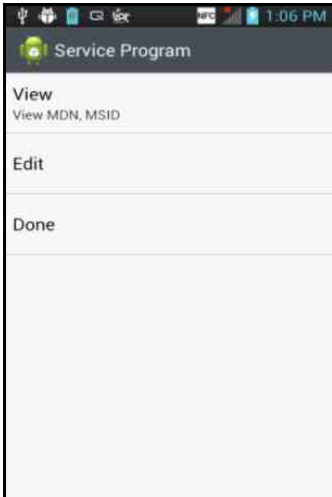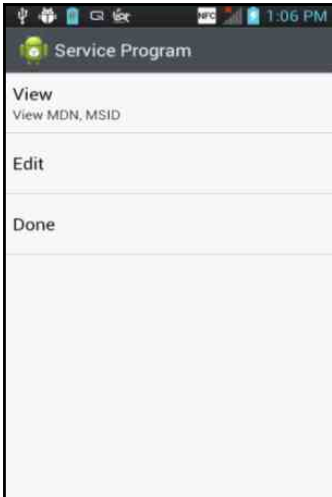	4. Select [Edit] to edit MDN & MSID	
		5. Edit MDN & MSID and Press OK
	6. Select [Done], reboot	

11. DISASSEMBLE GUIDE

1. Disassemble Rear Cover



1) Disassemble the Rear Screws.
(Screw Point : 11 Points)




2) Unhook in the side of Cover rear using a wide spatula.

* Unhook direction

Start
Point




2. Disassemble main PCB

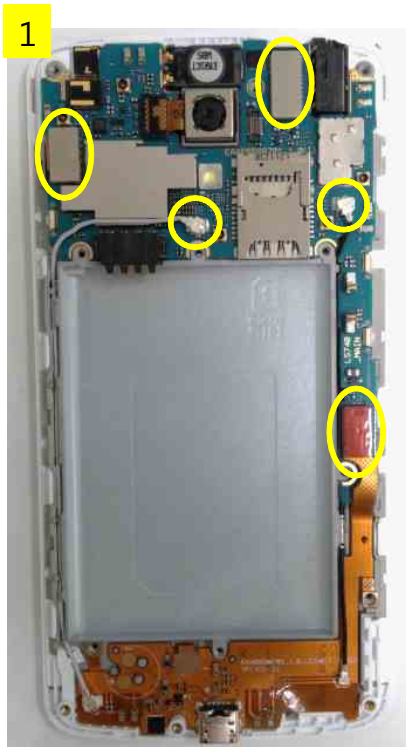

- 1) Disconnect FPCB Connectors & RF cable heads and pull in main PCB.
- 2) Disassemble mail PCB



3. Disassemble Lower FPCB (Antenna FPCB)

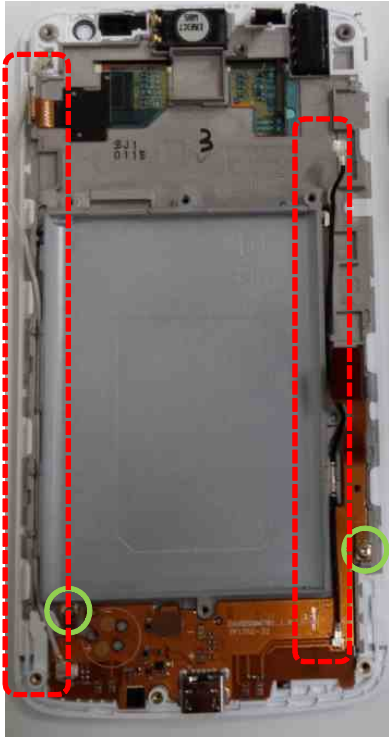

After remove main PCB, unscrew 2 screws and pull out two cables gently, then lift up Lower FPCB completely.

○ Screw : 2 pointsZ

□ Cable : White
Black



4. Disassemble the other components




Disassemble the components from the disassembled Set.
(Receiver & Rubber (Cap Sensor) & Earjack)

5. Complete disassembling LG-LS740




12. EXPLODED VIEW & REPLACEMENT PART LIST

12.1 EXPLODED VIEW(SBOM)

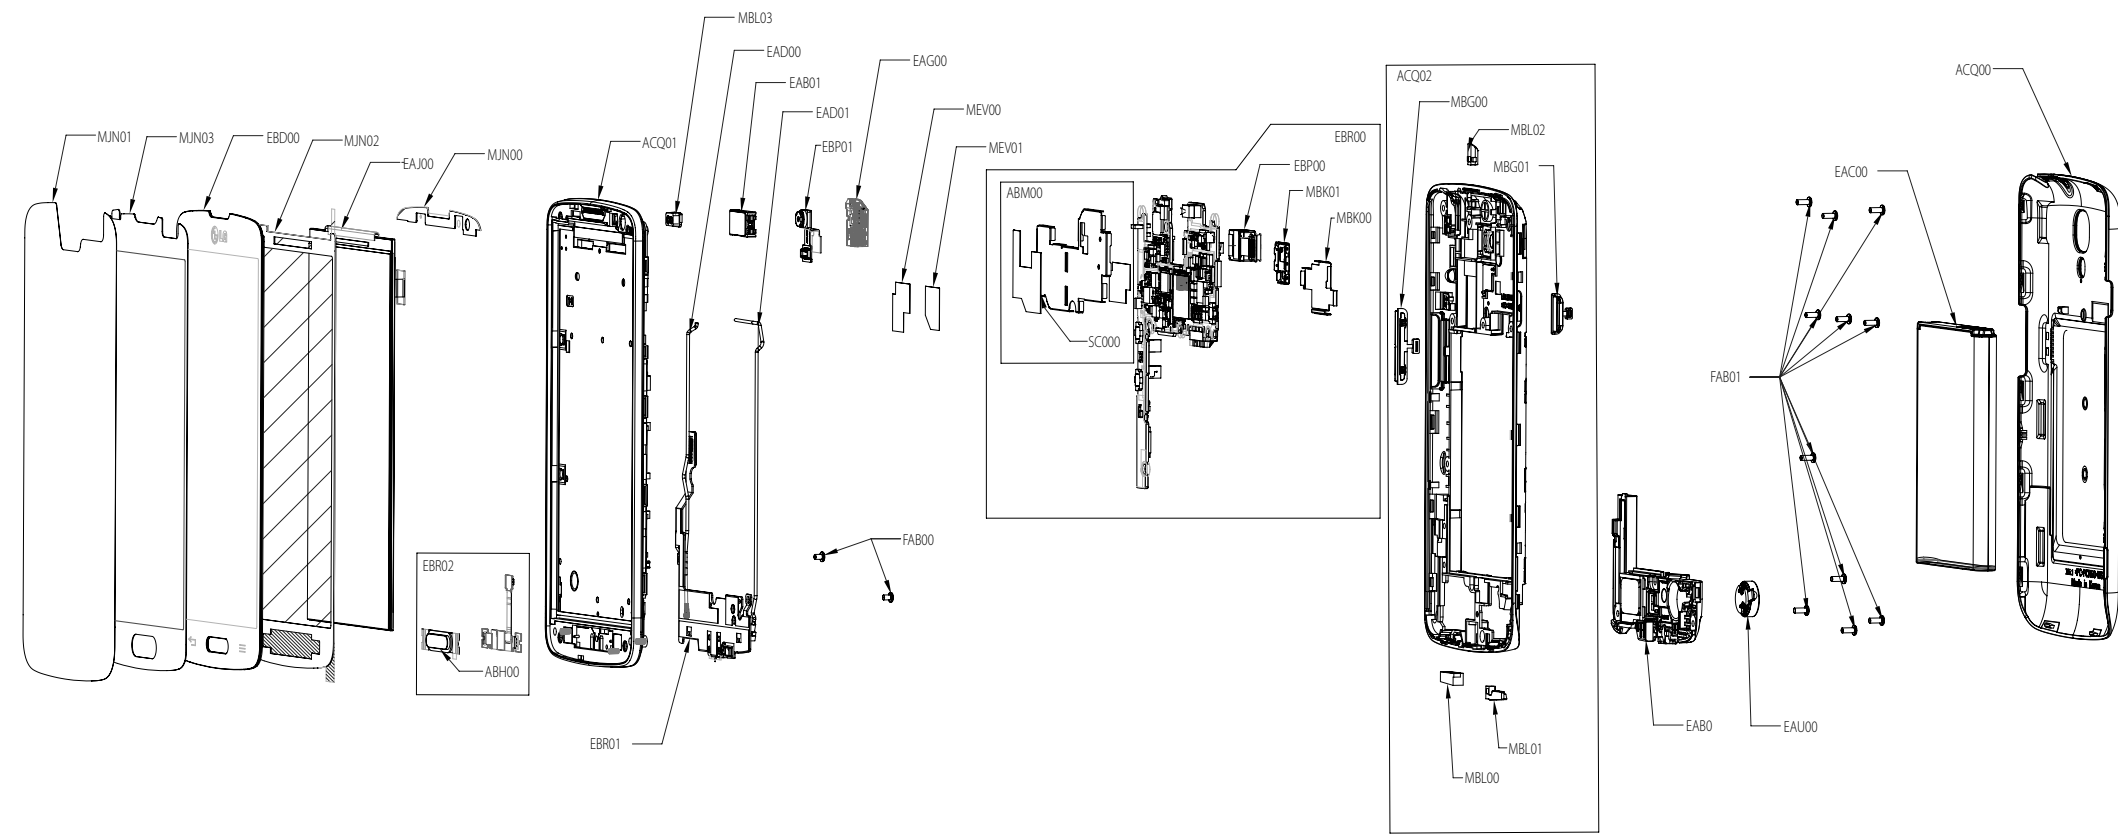

Location	Description
MJN03	Tape,USP Film
EBR00	PCB Assembly,Main
EBP00	Camera Module
MBK00	Can,Shield
MBK01	Can,Shield
ABM00	Can Assembly,Shield
SC000	Can,Shield
MBL00	Cap
EAU00	Motor,DC
EAB00	Speaker Module
ACQ02	Cover Assembly,Rear(SVC)
MBL01	Cap
MBG00	Button
MBG01	Button
MBL02	Cap
EBP01	Camera Module
EBR01	PCB Assembly,Flexible
EBR02	PCB Assembly,Flexible
ABH00	Button Assembly
ACQ01	Cover Assembly,Front
FAB00	Screw,Machine
MBL03	Cap
MEV00	Insulator
MEV01	Insulator
MJN02	Tape,Window
MJN01	Tape,Protect
MJN00	Tape
EAJ00	LCD Module
EAG00	Jack,Phone
EAD00	Cable,Assembly
EAD01	Cable,Assembly
EAB01	Receiver
EBD00	Touch Window Assembly
FAB01	Screw,Machine
ACQ00	Cover Assembly,Battery
EAC00	Rechargeable Battery,Lithium Ion


EXPLODED VIEW(ASSY)

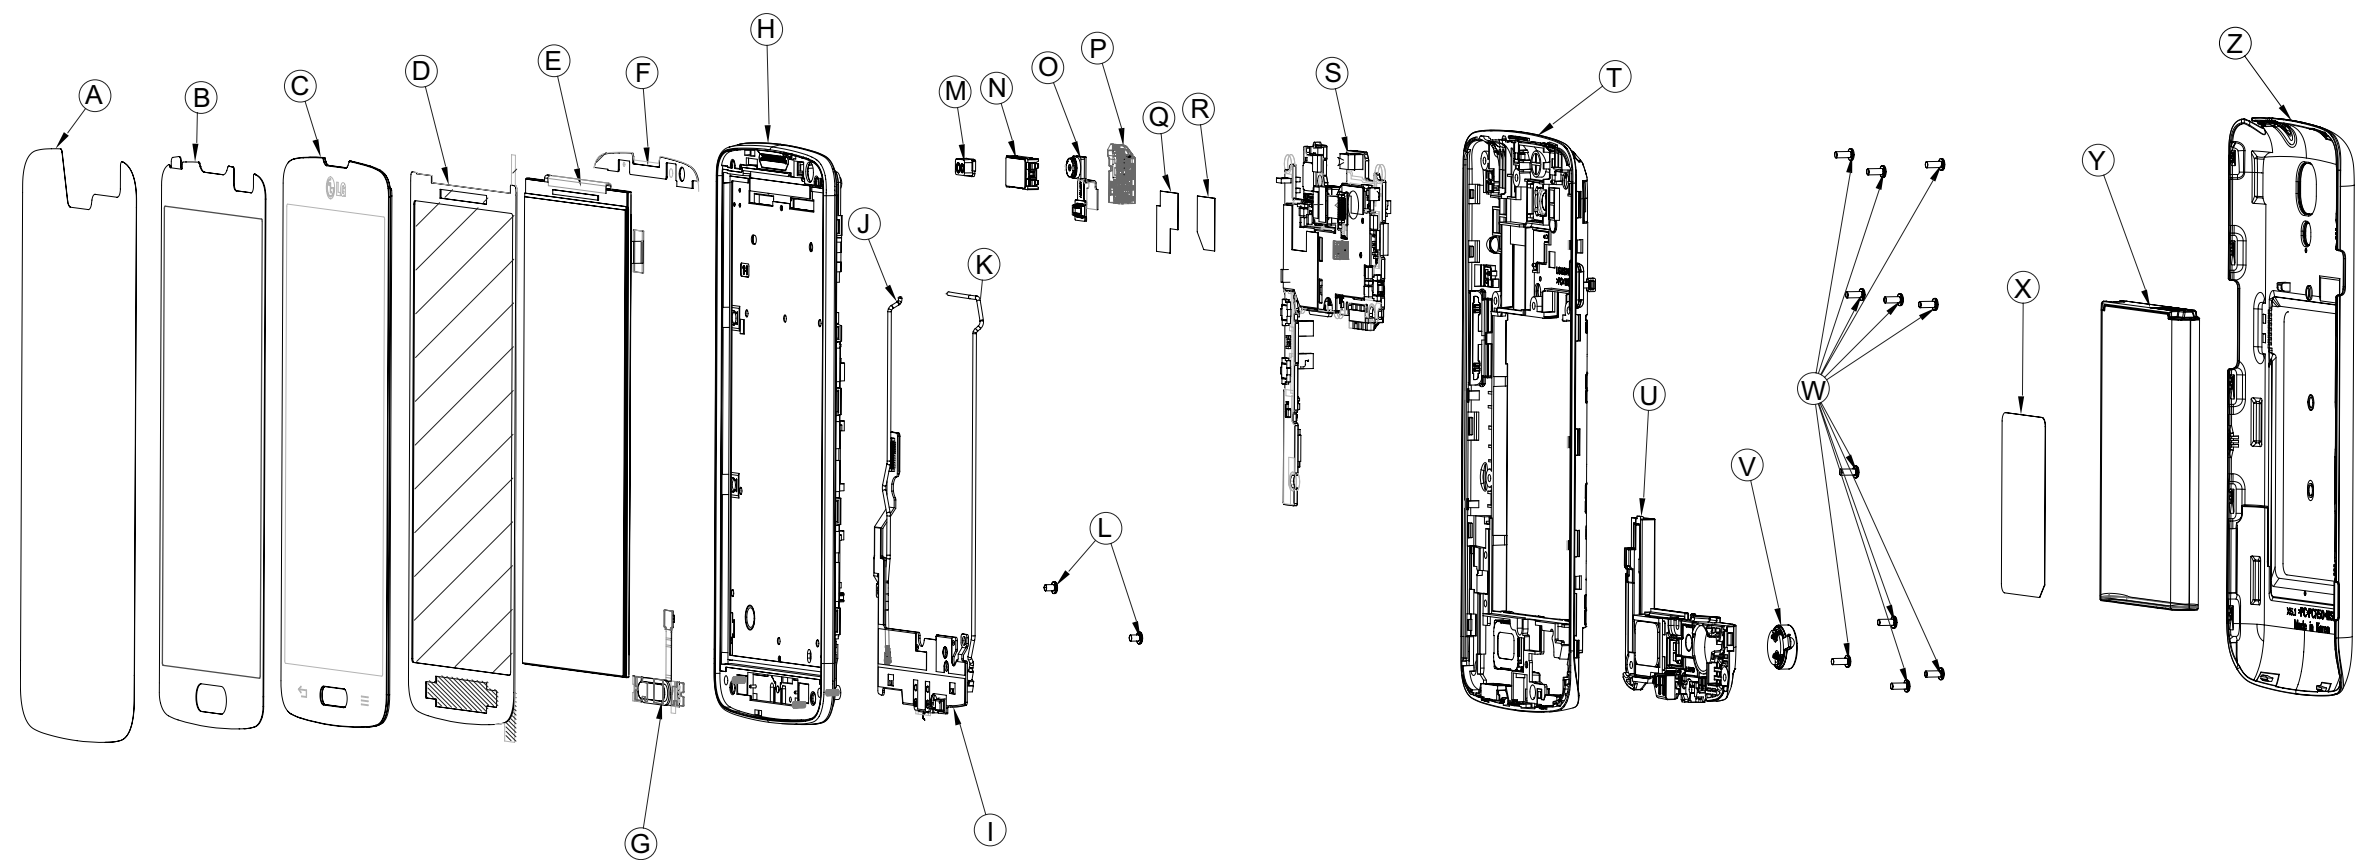

NO	Part Name	Part Number	Q'ty
A	TAPE PROTECTION BAR	MJN68649201	1
B	USP FILM	NJN68649301	1
C	TOUCH WINDOW	EBD61726101	1
D	TAPE WINDOW BOTTOM	MJN68649101	1
E	LCD	EAJ62569501	1
F	TAPE WINDOW TOP	MJN68691901	1
G	HOME BUTTON	EBR78394401	1
H	COVER ASSY, FRONT	ACQ86836702	1
I	LOWER FPCB	EBR77959301	1
J	CABLE, BLACK	EAD62865601	1
K	CABLE, WHITE	EAD62865501	1
L	SCREW	GMEY0010401	2
M	CAP, SENSOR	MBL65677401	1
N	RECEIVER	EAB63128601	1
O	CAMERA, VT	EBP61641902	1
P	EARJACK	EAG63550001	1
Q	INSULATOR, RIGHT	MEV64678001	1
R	INSULATOR, LEFT	MEV64731701	1
S	PCB ASSY, MAIN	EBR77958502	1
T	COVER ASSY, REAR(SVC)	ACQ87110702	1
U	MODULE, SPEAKER	EAB63108301	1

NO	Part Name	Part Number	Q'ty
V	MOTOR, DC	EAU62003401	1
W	SCREW	GMEY0014301	11
X	LABEL, APPROVAL	MEZ65023201	1
Y	BATTERY	EAC62238406	1
Z	COVER ASSY, BATTERY	ACQ86837302	1

EXPLODED VIEW(TOTAL)

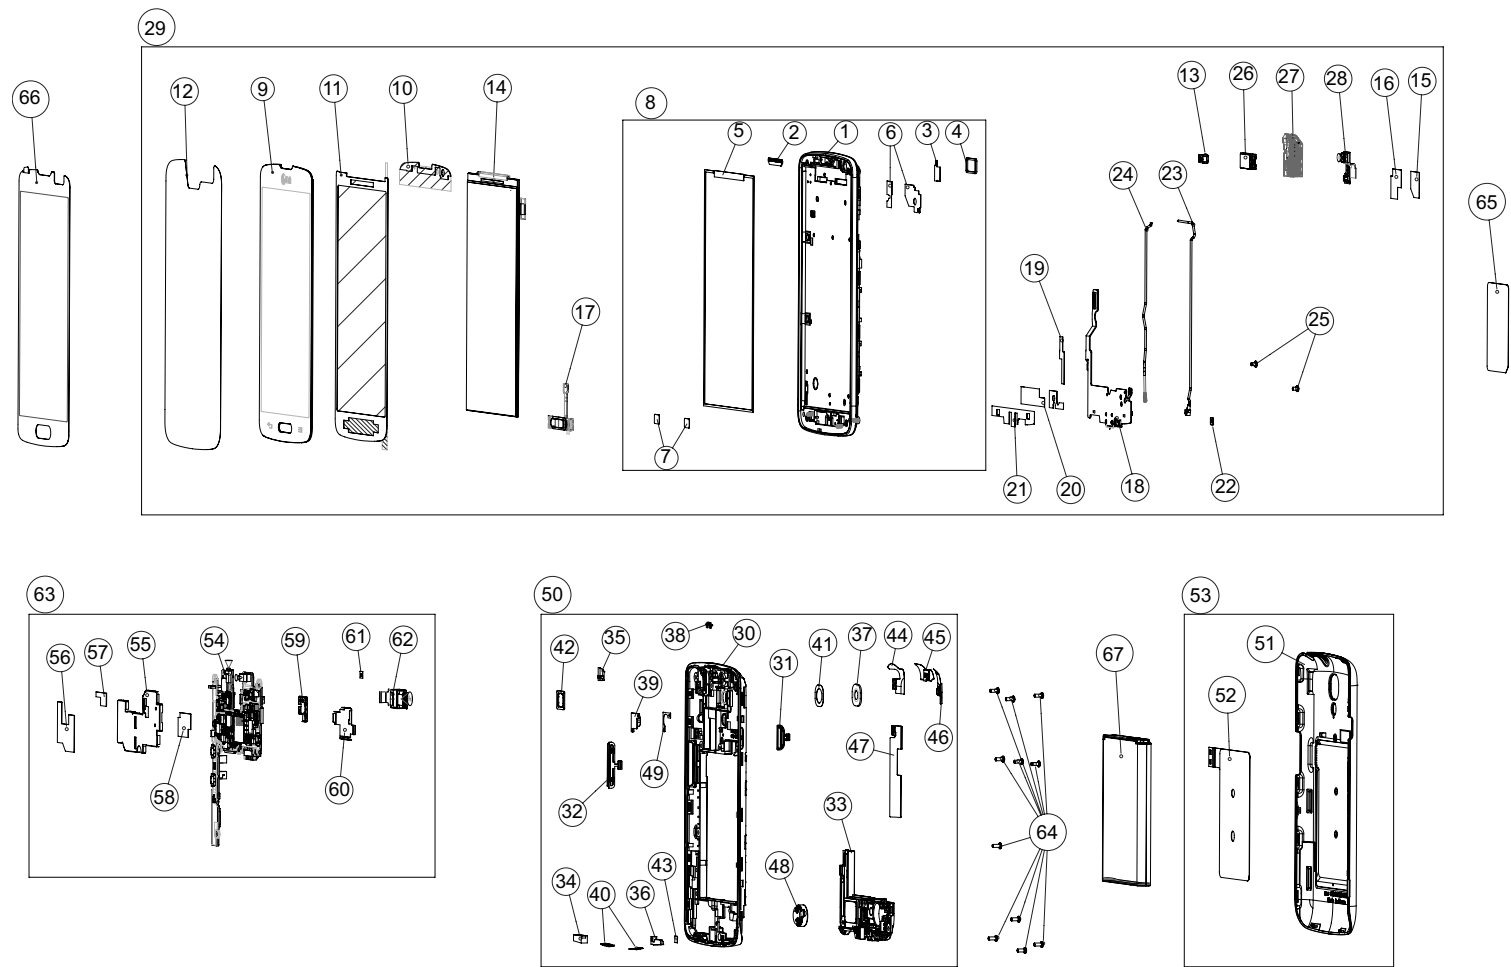

67	Rechargeable Battery, Lithium Ion	EAC62238406	1	
66	Tape, USP Film	MJN68649301	1	
65	Label, Approval	MEZ65023201	1	
64	Screw, Machine	GMEY0014301	11	
63	PCB Assembly, Main	EBR77958502	1	
62	Camera Module	EBP61602105	1	
61	Filter	MDJ63844701	1	
60	Can Shield	MBK63633001	1	
59	Can Shield	MBK63632801	1	
58	Insulator	MEV64633701	1	
57	Gasket	MDS64472101	1	
56	Gasket	MDS64452401	1	
55	Can Shield	MBK63632701	1	
54	PCB Assy, Main, SMT	EBR77958702	1	
53	Cover Assembly, Battery	ACQ86837302	1	
52	PIFA Antenna, Multiple	EAA63125301	1	
51	Cover, Battery	MCK67909402	1	
50	Cover Assembly, Rear	ACQ86812902	1	
49	Tape	MJN68648501	1	
48	Motor, DC	EAU62003401	1	
47	PIFA Antenna, Multiple	EAA63145201	1	
46	PIFA Antenna, GPS	EAA63125201	1	
45	PIFA Antenna, Multiple	EAA63145101	1	
44	PIFA Antenna, Multiple	EAA63145301	1	
43	Label, After Service	MLAB0004801	1	
42	Damper, Camera	MCQ67507101	1	
41	Tape	MJN68648401	1	
40	Deco Assmely	ACW74257302	2	
39	Lens, Flash	MFB63252901	1	
38	Window, IRDA	MKC64778801	1	
37	Window, Camera	MKC64719302	1	
36	Cap	MBL65677701	1	
35	Cap	MBL65717101	1	
34	Cap	MBL65677501	1	
33	Speaker Module	EAB63108301	1	
32	Button	MBG64963902	1	
31	Button	MBG64943402	1	
30	Cover, Rear	MCK67888102	1	
29	Cover Assembly, Bar	ACQ86875102	1	
28	Camera Module	EBP61641902	1	
27	Jack, Phone	EAG63550001	1	
26	Receiver	EAB63128601	1	
25	Screw, Machine	GMEY0010401	2	
24	Cable, Assembly	EAD62865601	1	
23	Cable, Assembly	EAD62865501	1	
22	Filter	MDJ63844701	1	
21	Tape	MJN68728501	1	
20	Gasket	MDS64452301	1	
19	Gasket	MDS64452201	1	
18	PCB Assembly, Flexible	EBR77959301	1	
17	PCB Assembly, Flexible	EBR78394401	1	
16	Insulator	MEV64678001	1	
15	Insulator	MEV64731701	1	
14	LCD Module	EAJ62569501	1	
13	Cap	MBL65677401	1	
12	Tape, Protect	MJN68649201	1	
11	Tape, Window	MJN68649101	1	
10	Tape	MJN68691901	1	
9	Touch Window Assembly	EBD61726101	1	
8	Cover Assembly, Front	ACQ86836702	1	
7	Sheet	MHK64269301	2	
6	Gasket	MDS64372001	1	
5	Damper, LCD	MCQ67507901	1	
4	Damper	MCQ67507601	1	
3	Tape	MJN68649001	1	
2	Deco Assembly	ACW74417001	1	
1	Cover Assembly, Front (Sub)	ACQ86812802	1	
No	Part Name	Part Number	Q'ty	Remark

12. EXPLODED VIEW & REPLACEMENT PART LIST

12.2 Replacement Parts <Mechanic component>

Note: This Chapter is used for reference, Part order is ordered by SBOM standard on GCSC

Level	Location No.	Description	Part Number	Spec	Remark
1	AGQ000000	Phone Assembly	AGQ87651701	LGLS740.ABMUBL BL:BLUE BLUE -	
2	MJN03	Tape, USP Film	MJN68649301	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	B,66
2	MEZ002100	Label, Approval	MEZ65023201	PRINTING LGLS720.ASPRTS ZZ:Without Color -	X,65
2	ACQ100400	Cover Assembly, EMS	ACQ87257401	LGLS740.ABMUBL BL:BLUE BLUE -	
5	MDJ000000	Filter	MDJ63844701	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	61,22
5	MBK00	Can, Shield	MBK63633001	PRESS STS 0.15 LGLS740.AVGMWH ZZ:Without Color -	
5	MBK01	Can, Shield	MBK63632801	PRESS STS 0.15 LGLS740.AVGMWH ZZ:Without Color -	59
5	ABM00	Can Assembly, Shield	ABM74136201	LGLS740.AVGMWH ZZ:Without Color -	
6	MBK070300	Can, Shield	MBK63632701	PRESS STS 0.15 LGLS740.AVGMWH ZZ:Without Color -	55
6	MEV000000	Insulator	MEV64633701	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	58
6	MDS000001	Gasket	MDS64472101	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	57
6	MDS000000	Gasket	MDS64452401	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	56
6	SC10005 SC10006 SC10010 SC20009	Clip	MBV62321701	PRESS STS 301 0.15 LGLU6200.ALGTBK BK:Black -	
6	ANT1106 ANT1107	Clip	MBV62561601	COMPLEX LGF320L.ALGTBK ZZ:Without Color -	
6	PID1	Label	MEZ65049701	COMPLEX LGLS720.ASPRTS ZZ:Without Color PID label	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	ANT1100 ANT1101 ANT1102 ANT1103 ANT1105 CN5100 CN5101	Clip	MBV62562001	PRESS BECU 1.4 LGF300L.ALGTWH ZZ:Without Color -	
6	SC10005 SC10006 SC10010 SC20009	Clip	MBV62321701	PRESS STS 301 0.15 LGLU6200.ALGTBK BK:Black -	
6	SC000	Can,Shield	MBK63713001	PRESS STS 0.2 LGLS740.AVGMWH ZZ:Without Color -	
3	ACQ063300	Cover Assembly,Rear	ACQ86812902	LGLS740.ABMUBL BL:BLUE BLUE -	50
4	MBL00	Cap	MBL65677501	MOLD SILICON LGLS740.AVGMWH ZZ:Without Color -	34
4	ACQ02	Cover Assembly Rear(SVC)	ACQ87110702	LGLS740.ABMUBL BL:BLUE BLUE -	T
5	MBL01	Cap	MBL65677701	MOLD SILICONE RUBBER LGLS740.AVGMWH BK:BLACK BLACK -	36
5	MBG00	Button	MBG64963902	MOLD PC LGLS740.AVGMWH BK:Black -	32
5	MBG01	Button	MBG64943402	MOLD PC LGLS740.AVGMWH BK:Black -	31
5	ACW000000	Decor Assembly	ACW74257302	LGLS740.ABMUBL BL:BLUE BLUE -	40
6	MJN020800	Tape,Decor	MJN68648201	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	
6	MCR000000	Decor	MCR65287902	PRESS STEEL 0.2 LGLS740.AVGMWH IB:Indigo Blue -	
5	MBL02	Cap	MBL65717101	MOLD SILICON LGLS740.AVGMWH ZZ:Without Color -	35
5	MEZ000900	Label,After Service	MLAB0004801	COMPLEX LG-LB3300 LGT ZZ:Without Color -	43
5	MKC041800	Window,IRDA	MKC64778801	MOLD ABS LGLS740.AVGMWH ZZ:Without Color -	38
5	MKC009400	Window,Camera	MKC64719302	CUTTING ACRYL LGLS740.AVGMWH BK:Black -	37

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
5	MJN000001	Tape	MJN68648501	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	49
5	MJN000000	Tape	MJN68648401	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	41
5	MFB029600	Lens,Flash	MFB63252901	MOLD PC LGLS740.AVGMMWH ZZ:Without Color -	39
5	MCQ009400	Damper,Camera	MCQ67507101	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	42
5	MCK063300	Cover,Rear	MCK67888102	MOLD LUPOY LGLS740.AVGMMWH BK:Black -	30
3	ACQ003400	Cover Assembly,Bar	ACQ86875102	LGLS740.ABMUBL BL:BLUE BLUE -	29
6	MDJ000000	Filter	MDJ63844701	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	60
6	MDS000000	Gasket	MDS64452201	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	19
6	MDS000001	Gasket	MDS64452301	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	20
6	MJN000000	Tape	MJN68728501	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	21
7	ANT1 ANT2 ANT3 ANT4 ANT5 ANT6	Clip	MBV62521801	COMPLEX LGF320L.ALGTBK ZZ:Without Color -	
6	ABH00	Button Assembly	ABH74779702	LGLS740.AVGMMWH BK:BLACK BLACK K-pjt_BK	
6	MJN000000	Tape	MJN68692701	CUTTING TAPE LGLS740.AVGMMWH ZZ:Without Color -	
6	MJN000001	Tape	MJN68692801	CUTTING TAPE LGLS740.AVGMMWH BK:BLACK BLACK -	
4	ACQ01	Cover Assembly,Front	ACQ86836702	LGLS740.ABMUBL BL:BLUE BLUE LS740 FRONT COVER	H,8
5	MCQ043300	Damper,LCD	MCQ67507901	COMPLEX LGLS740.AVGMMWH ZZ:Without Color -	5

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
5	MCQ000000	Damper	MCQ67507601	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	4
5	MDS000000	Gasket	MDS64372001	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	6
5	MHK000000	Sheet	MHK64269301	CUTTING PC LGLS740.AVGMWH WA:White -	7
5	ACW000000	Decor Assembly	ACW74417001	LGLS740.AVGMWH ZZ:Without Color -	2
6	MCR000000	Decor	MCR65247401	PRESS STEEL 0.1 LGLS740.AVGMWH SV:SILVER SILVER -	
6	MJN000000	Tape	MJN68691801	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	
5	ACQ033200	Cover Assembly Front(Sub)	ACQ86812802	LGLS740.ABMUBL BL:BLUE BLUE -	1
6	MCK032700	Cover,Front	MCK67888002	MOLD LUPOY LGLS740.AVGMWH ZZ:Without Color LS740 FRONT COVER - MOLD	
6	MDQ000000	Frame	MDQ63657001	CASTING MG LGLS740.AVGMWH ZZ:Without Color LS740 FRONT COVER - FRAME	
6	MET099500	Insert,Nut	MICE0016906	COMPLEX MECH_COMMON ZZ:Without Color -	
5	MJN000000	Tape	MJN68649001	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	3
4	FAB00	Screw,Machine	GMEY0010401	GMEY0010401 BH + 1.4mm 2mm MSWR NI PLT N - LG ELECTRONICS INC.	L,25
4	MBL03	Cap	MBL65677401	MOLD SILICON LGLS740.AVGMWH ZZ:Without Color -	M,13
4	MEV00	Insulator	MEV64678001	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	Q,16
4	MEV01	Insulator	MEV64731701	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	R,15
4	MJN02	Tape,Window	MJN68649101	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	D,11
4	MJN01	Tape,Protect	MJN68649201	COMPLEX LGLS740.AVGMWH ZZ:Without Color -	A,12

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
4	MJN00	Tape	MJN68691901	COMPLEX LGLS740.AVGMDWH ZZ:Without Color -	F,10
4	MEZ000000	Label	MLAZ0038301	COMPLEX LG-VX6000 ZZ:Without Color PID Label 4 Array PRINTING,	
3	FAB01	Screw,Machine	GMEY0014301	GMEY0014301 BH + 1.4mm 3.5mm MSWR NI PLT N - KUMGANG SCREW CO., LTD	W,64
1	AGF000000	Package Assembly	APAY0091588	LGLS740.ABMUBL ZZ:Without Color LGLS740 BMU Package(480)	
2	MHK000000	Sheet	MHK63312314	COMPLEX LG272.ABMUTG ZZ:Without Color LG272_Inner Artcard	
2	MEZ003500	Label,Barcode	MLAC0004555	COMPLEX LGVP200.AVGMBK ZZ:Without Color C-hub(4*1.5 inch) Virgin U/B Label(Mojo)	
2	MEZ047200	Label,Master Box	MLAJ0004305	COMPLEX LG-LX160 SPRGR ZZ:Without Color COMPLEX, PCX COMPLEX	
2	MGA000000	Pallet	MPCY0005202	COMPLEX LG-TM520 ZZ:Without Color -	
2	MFZ005502	Packing,Blister	MPAE0004141	COMPLEX LGLS740.ABMUBLH MS:Metal Silver LS740 BMU Clamshell (Top)_	
2	MFZ005503	Packing,Blister	MPAE0004142	COMPLEX LGLS740.ABMUBLH MS:Metal Silver LS740 BMU Clamshell (Bottom)_	
2	MCQ000001	Damper	MPBZ0001222	COMPLEX SP3100 ZY:Color Unfixed 70x70x7t(1070mm) COMPLEX,	
2	MCQ000000	Damper	MPBZ0036890	COMPLEX LGVP200.AVGMBK ZZ:Without Color Head Space Sheet	
2	MAY047100	Box,Master	MBEE0046006	COMPLEX LGVP200.AVGMBK MS:Metal Silver Virgin (5EA)Prepaid Pack	
2	MAY055900	Box,Pad(Inner)	MAY65155801	COMPLEX LGVP200.AVGMBK ZZ:Without Color Slip Seet	
2	MAY084000	Box,Unit	MAY64927820	COMPLEX LGLS740.ABMUBLH RD:Red LS740 BMU Unit box_	
2	MCK000000	Cover	MCJZ0059328	COMPLEX LGVM701.AVGMDDB ZZ:Without Color Virgin_C-hub Pallet Cover(4x6 Solid Stacked Pallet : 480EA/Pallet)	
2	MLAZ00	Label	MLAZ0050901	COMPLEX KU990.AGBRBK ZZ:Without Color Battery Warning Label (Lithium ion Battery Label)	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
1	AAD000000	Addition Assembly	AAD86554402	LGLS740.ABMUBL BL:BLUE BLUE -	
2	MAF086500	Bag,Vinyl	MAF63749401	COMPLEX LGLS740.ABMUBLH ZZ:Without Color LS740 BMU RECYCLE BAG	
2	ACQ00	Cover Assembly,Battery	ACQ86837302	LGLS740.ABMUBL BL:BLUE BLUE -	Z,53
3	MCK004100	Cover,Battery	MCK67909402	MOLD PC LGLS740.AVGMWH BK:Black -	51

12. EXPLODED VIEW & REPLACEMENT PART LIST

12.2 Replacement Parts <Main component>

Note: This Chapter is used for reference, Part order is ordered by SBOM standard on GCSC

Level	Location No.	Description	Part Number	Spec	Remark
3	EBR00	PCB Assembly Main	EBR77958502	LGLS740.ABMUBL 1.0 Main	S,63
4	EBR071500	PCB Assembly Main,Insert	EBR77958901	LGLS740.AVGMWH 1.1 Main	
5	EBP00	Camera Module	EBP61602105	C8AA-Y412G C8AA-Y412G 8M AF, Sony(1/4") BSI, 8.5x8.5x4.75t, MIPI, FPCB, 90 degree, Bluefilter LG INNOTEK CO., LTD	62
5	RAA050101	Resin,PC	BRAH0001304	UF2040 or 3075BHF . . NONE	
5	RAA050100	Resin,PC	BRAH0001303	UF2040 or 3075BHF . . NONE	
4	EBR071800	PCB Assembly Main,SMT	EBR77958702	LGLS740.ABMUBL 1.0 Main	54
5	SAD010000	Software,Mobile	SAD34672201	Android KK Base LS740ZV3_17 - NORTH AMERICA QCT -	
5	EBR071700	PCB Assembly Main,SMT Top	EBR77959101	LGLS740.AVGMWH 1.1 Main	
6	L4135	Inductor,Wire Wound,Chip	EAP62187401	MAKK2016T1R0M 1UH 20% - 2.2A 2.2 2.45 0.075OHM - - SHIELD 2.0X1.6X1.0MM - R/TP TAIYO YUDEN CO.,LTD	
6	L1123	Inductor Multilayer,Chip	EAP62227601	LG HK 0603 6N8J-T 6.8NH 5% - 250mA - - 0.39OHM 3.9GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	L1116	Capacitor (High Frequency) Ceramic,Chip	EAE62884301	GRM0335C1H5R6C_H 5.6pF 0.25PF 50V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	C1106	Capacitor (High Frequency) Ceramic,Chip	EAE62946901	GRM0335C1E8R2B_H 8.2pF 0.1PF 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	L1500	Inductor Multilayer,Chip	EAP61747501	LQP03TN3N6B02D 3.6NH 0.1NH - 400mA - - 0.3OHM 6GHZ 14 SHIELD NONE 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C4142 C4143	Capacitor Ceramic,Chip	ECCH0007802	CL10A475KP8NNNC 4.7uF 10% 10V X5R - 55TO+85C 1608 R/TP - - SAMSUNG ELECTRO- MECHANICS CO., LTD.	
6	EAX010000	PCB,Main	EAX65588701	LGSL740.AVGMWH 1.0 FR-4 Multi 10 0.65 Main	
6	C1126	Inductor Multilayer,Chip	EAP62246001	LG HK 0603 3N3S-T 3.3NH 0.3NH - 320mA - - 0.23OHM 6.7GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	C2306 C2318 C2319 C2321 C2322 C2325 C2326 C2360 C5107 C5108 C5109 C5111	Capacitor Ceramic,Chip	ECCH0009106	C0603X7R1C103KT 10nF 10% 10V X7R - 55TO+125C 0603 R/TP - TDK CORPORATION	
6	L4130 L4131	Inductor Multilayer,Chip	EAP62545901	MIPSZ2016DR24FHS 240NH 20% - 4A 4 4 0.022OHM 0HZ - SHIELD - 2.0X1.6X1.0 MM R/TP FDK CORPORATION.	
6	C1559 C1606 C1623 C1750 C1758 C4107 C5204 C5211	Capacitor Ceramic,Chip	ECZH0025916	GRM0335C1E330J 33pF 5% 25V NP0 - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C10004 C10005 C1103 C1115 C1121 C1125 C1133 C5112 C5114 C5115 C7106 C7107 C9102	Capacitor Ceramic,Chip	ECCH0009103	C0603C0G1H101JT00NN 100pF 5% 50V C0G - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	C2341 C2351 C2382 C2383 C2384 C2386 C2388 C4140 C4141 C4179 C4197 C4199 C7100 C7102 C7400 C9503	Capacitor Ceramic,Chip	ECCH0017301	CL03A105MQ3CSNH 0.000001F 20% 6.3V X5R - 45TO+85C 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R1120 R1122 R1123 R2300 R4102 R4103 R4105 R4132 R4133 R6921 R7100 R7300 R7303 R7401 R9106 R9107	Wire Pad,Short	SAFP0000401	AX3100 ATL SV_SHIPBACK,MAIN,A	
6	C9101	Capacitor Ceramic,Chip	EAE62286801	CL03A104KP3NNNC 0.0000001F 10% 10V X5R - 55TO+85C 0603 R/TP 0.3 - SAMSUNG ELECTRO-MECHANICS CO., LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C2307 C2336 C2339 C2340 C2342 C2343 C2344 C2352 C2353 C2354 C2355 C2359 C2363 C2366 C2367 C2368	Capacitor Ceramic,Chip	ECCH0009101	C0603X5R0J104KT00NN 0.1uF 10% 6.3V X5R - 55TO+85C 0603 R/TP - TDK CORPORATION	
6	C2369 C2374 C2375 C2380 C2395 C2397 C3201 C3204 C3206 C4137 C7101 C7103 C8100 C8101 C8952 C9300	Capacitor Ceramic,Chip	ECCH0009101	C0603X5R0J104KT00NN 0.1uF 10% 6.3V X5R - 55TO+85C 0603 R/TP - TDK CORPORATION	
6	C1118 C1756 C1759 L1600	Inductor Multilayer,Chip	EAP62225901	LQP03TG1N0C02D 1NH 0.2NH - 600mA - - 0.15OHM 6GHZ 12 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C1400 C1402 C4169	Capacitor Ceramic,Chip	EAE62502901	CL05A106MP5NUNC 10uF 20% 10V X5R - 55TO+85C 1005 R/TP 0.55T max. SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	U4100	IC,PMIC	EAN62739601	PM8926 2.5 to 4.5V adj 0W CSP R/TP 172P - QUALCOMM INCORPORATED.	
6	C2379 C6101 C6102 C6106 C6922 C8700 C8701	Capacitor Ceramic,Chip	ECCH0002001	C1005JB0J104KT000F 0.1uF 10% 6.3V X5R - 30TO+85C 1005 R/TP - - TDK CORPORATION	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	L4136	Inductor,Wire Wound,Chip	EAP62106301	1239AS-H-100N=P2 10UH 30% 30V 700mA 1 0.7 0.46OHM - - SHIELD 2.5X2.0X1.2MM NONE R/TP TOKO, INC.	
6	C2308 C2362 C7300 C7302 C7303 C8950 C8951	Capacitor Ceramic,Chip	ECCH0017601	CL05A475MQ5NRNC 4.7uF 20% 6.3V X5R - 55TO+85C 1005 R/TP 0.5MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	C10003	Capacitor Ceramic,Chip	EAE62962301	GRM155R61A225KE95 2.2uF -10TO+10% 10V X5R -55TO+85C 1005 R/TP 0.5 L:1.0+-0.05 W:0.5+-0.05 T:0.5+-0.05 MURATA MANUFACTURING CO.,LTD.	
6	U8700	IC,Hall Effect Switch	EAN62682901	BU52061NVX Hall IC 1.2X1.6 SSON R/TP 4P - ROHM Semiconductor KOREA CORPORATION	
6	C4180	Capacitor Ceramic,Chip	ECCH0009603	CE JMK212 BJ476MG-T 47uF 20% 6.3V X5R - 55TO+85C 2012 R/TP 1.25mm - TAIYO YUDEN CO.,LTD	
6	L1130 L1139	Inductor Multilayer,Chip	EAP62226601	LQP03TG15NJ02D 15NH 5% - 170mA - - 1.9OHM 3.1GHZ 11 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	VA6601 VA6603 VA6605 VA6800 VA6801 VA7100 VA7101 VA7102 VA7103 VA7204 VA7303 VA7400 VA8950 VA9100 VA9101 VA9501 VA9700 VA9830	Varistor	SEVY0003601	ICVL0505101V150FR 5.6V 0% 100pF 1.0*0.5*0.55 NONE SMD R/TP INNOCHIPS TECHNOLOGY	
6	R9303 R9304 R9305	Resistor,Chip	ERHY0009301	MCR006YZPF1000 100OHM 1% 1/20W 0603 R/TP - ROHM.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C1604 C1757	Inductor Multilayer,Chip	EAP62107901	LQP03TG1N5C02D 1.5NH 0.2NH - 600mA - - 0.15OHM 6GHZ 13 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C4185 C7301	Capacitor Ceramic,Chip	ECCH0004904	GRM155R60J105K 1uF 10% 6.3V X5R -55TO+85C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	L1757	Capacitor (High Frequency) Ceramic,Chip	EAE62945901	GRM0335C1E1R2B_H 1.2pF 0.1PF 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	C7200	Capacitor Ceramic,Chip	ECCH0000179	GRM155R71C223K 22nF 10% 16V X7R - 55TO+85C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	L4134	Inductor,Wire Wound,Chip	EAP62366601	TFM201610GHM-2R2M 2.2UH 20% - 1.9A 2.4 1.9 0.152OHM - - SHIELD 2.0X1.6X1.0MM - R/TP TDK KOREA COOPERATION	
6	L1400	Inductor,Wire Wound,Chip	EAP62286801	1285AS-H-1R5M 1.5UH 20% - 1.8A 1.8 1.9 0.144OHM - - SHIELD 2.0X1.6X1.0MM - R/TP TOKO, INC.	
6	U8400	IC,Proximity	EAN62646301	APDS-9130-200 High T Proximity Sensor 3.36X4.94X3.45 COB R/TP 8P - AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	C9307	Capacitor Ceramic,Chip	ECCH0005602	GRM188R61C225K 2.2uF 10% 16V X5R - 55TO+85C 1608 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	D8401	Diode,TVS	EAH62033201	UCLAMP3311Z 3.3V 3.65V min. 7.5V 4A 30W SLP0603P2X3A R/TP 2P 1 SEMTECH INTERNATIONAL AG	
6	X4100	Crystal	EAW62063901	1RAA19200AAQ 19.2MHZ 10PPM 7pF 2520 SMD R/TP DAISHINKU CORPORATION.	
6	C6600	Capacitor Ceramic,Chip	ECZH0025920	GRM033R71C102K 1nF 10% 16V X7R - 55TO+125C 0603 R/TP - - MURATA MANUFACTURING CO.,LTD.	
6	L6812	Inductor,Wire Wound,Chip	EAP62368801	LQH3NMN122M03E 1.2mH 20% - 80mA - - 46.8OHM - - SHIELD 3.0X3.0X1.5MM - R/TP MURATA MANUFACTURING CO.,LTD.	
6	LD8950	LED,Chip	EAV62092201	IR26-71C/L447/S63/TR8 CLEAR 1.15~1.6V 65mA 8.5 920~960nm 100mW 3012 R/TP 2P - EVERLIGHT ELECTRONICS CO., LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	FB6600	Filter,Bead	SFBH0008102	BLM15HD182SN1D 1800 ohm 1.0X0.5X0.5 25% 2.2 ohm 0.2A SMD R/TP 2P 0 MURATA MANUFACTURING CO.,LTD.	
6	L9302	Inductor,Wire Wound,Chip	EAP62107801	1269AS-H-4R7M=P2 4.7UH 20% - 1A 1.3 1.0 0.3OHM - - SHIELD 2.5X2.0X1.0 MM - R/TP TOKO, INC.	
6	C1607 C1610 C1763	Capacitor Ceramic,Chip	ECCH0007804	CL05A225MP5NSNC 2.2uF 20% 10V X5R - 55TO+85C 1005 R/TP 0.5MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R8952 R9306	Resistor,Chip	ERHY0009503	MCR006YZPJ101 100OHM 5% 1/20W 0603 R/TP - ROHM.	
6	C4133 C4134 C4135	Capacitor Ceramic,Chip	ECCH0017501	CL10A226MQ8NRNE 22uF 20% 6.3V X5R - 55TO+85C 1608 R/TP 0.8MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R8401	Resistor,Chip	EBC61856101	RC0201JR-0722RL 22OHM 5% 1/20W 0603 R/TP - YAGEO CORPORATION	
6	R8954 R8955	Resistor,Chip	ERHY0009504	MCR006YZPJ102 1KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	R2213 R2214	Resistor,Chip	ERHY0009522	MCR006YZPJ332 3.3KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	R2110	Resistor,Chip	EBC62581801	RC0603F392CS 3.9KOHM 1% 1/20W 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	C4146 C4600 C4601	Capacitor Ceramic,Chip	ECZH0001210	C1005Y5V1A474ZT000F 470nF -20TO+80% 10V Y5V -30TO+85C 1005 R/TP - TDK KOREA COOPERATION	
6	L1759	Capacitor (High Frequency) Ceramic,Chip	EAE62946201	GRM0335C1E2R2C_H 2.2pF 0.25PF 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	U5200	IC,NFC	EAN62678401	PN650EV1/3010BC726L VFBGA 4.5x4.5x0.9 VFBGA R/TP 64P NXP Semiconductors	
6	C4178 C4196 C4198 C9103	Capacitor Ceramic,Chip	EAE62762301	CL03A105MP3NSNC 1uF 20% 10V X5R - 55TO+85C 0603 R/TP 0.33 MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	C4131	Capacitor Ceramic,Chip	ECCH0000155	MCH153CN103KK 10nF 10% 16V X7R - 55TO+125C 1005 R/TP - ROHM Semiconductor KOREA CORPORATION	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	R6602	Resistor,Chip	ERHY0003201	MCR01MZP5F1001 1KOHM 1% 1/16W 1005 R/TP - ROHM.	
6	C6923 C9502	Capacitor Ceramic,Chip	ECCH0009104	C0603C0G1H330JT00NN 33pF 5% 50V C0G - 55TO+125C 0603 R/TP - TDK CORPORATION	
6	C6100 C6110	Capacitor Ceramic,Chip	ECZH0003103	GRM36X7R104K10PT 100nF 10% 10V X7R - 55TO+125C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	FL1100 U1750	Filter,Saw	EAM63050401	TQQ0041 2593.0MHz 2.0x2.0x0.9t SMD R/TP 3P TRIQUINT SEMICONDUCTOR INC.	
6	U1500	IC,RF Transceiver,4G	EAN62697301	WTR1625L WTR1625L 2G/3G/4G GSM/GPRS/EDGE,1X, 1xEV-DO ,WCDMA , TD-SCDMA , HSPA+/DC-HSPA+ , LTE (FDD) ,TD-LTE, 164pin CSP R/TP 164P QUALCOMM INCORPORATED.	
6	U7200	IC,Capacitive Touch Sensor	EAN62953601	ATMXT336S-MAUR mXT336S_3v0_AX, 336 channels56pin UQFN 6x6x0.6mm, 0.35mm pin 6X6X0.6 UQFN R/TP 56P - ATMEL SARL	
6	R4104 R4142 R7200 R7202	Resistor,Chip	ERHY0009505	MCR006YZPJ103 10KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	C1403 C1565 C1608 C1609 C5216	Capacitor Ceramic,Chip	EAE62282201	GRM033R71E102KA01D 0.000000001F 10% 25V X7R -55TO+125C 0603 R/TP 0.3+/-0.03 MM - MURATA MANUFACTURING CO.,LTD.	
6	L1101 L1118	Inductor Multilayer,Chip	EAP62108901	LQP03TN47NJ02D 47NH 5% - 100mA - - 3.6OHM 1.3GHZ 9 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C6109 C9303 C9304 C9308	Capacitor Ceramic,Chip	EAE63067401	GRM188R61C475KAAJ 4.7uF -10TO+10% 16V X5R -55TO+85C 1608 R/TP Max 0.95T L:1.6+-0.15 W:0.8+-0.15 T:0.8+-0.15 MURATA MANUFACTURING CO.,LTD.	
6	R6612	Wire Pad,Open	SAFO0000401	AX3100 ATL SV_SHIPBACK,MAIN,A,0OHM DNI	
6	R2101 R2103	Resistor,Chip	EBC61856201	RC0201FR-07240RL 240OHM 1% 1/20W 0603 R/TP - YAGEO CORPORATION	
6	C1501 L1127	Capacitor (High Frequency) Ceramic,Chip	EAE62945801	GRM0335C1E1R0C_H 1pF 0.25PF 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	FL1104	Filter,Saw	EAM62930601	SAFFB876MAA0F0A 876.5MHz 1.1x0.9x0.5t SMD R/TP 5P MURATA MANUFACTURING CO.,LTD.	
6	R1113	Resistor,Chip	ERHZ0000204	MCR01MZP5F1003 100KOHM 1% 1/16W 1005 R/TP - ROHM.	
6	Q4100	FET	EBK62031701	SSM6N57NU N-CHANNEL MOSFET 30V +-12 4A 0.063OHM 1W DFN R/TP 6P TOSHIBA ELECTRONICS KOREA CORPORATION	
6	VA6604 VA6901 VA9718 VA9722 VA9723	Varistor	SEVY0008101	EVLC5S01033 EVLC5S01033 EVLC5S01033,5.5 V, ,SMD ,Vdc 5.5, Vb 10~15.6, Cp 17.9 at 1MHz, 0.6*0.3*0.33 , ,5.5 , ,23.1~42.9 ,0.6*0.3*0.33 ,[empty] ,SMD ,R/TP AMOTECH CO., LTD. AMOTECH CO., LTD.	
6	C9501	Capacitor Ceramic,Chip	ECZH0001215	C1005X5R1A105KT000F 1uF 10% 10V X5R - 55TO+85C 1005 R/TP - TDK KOREA COOPERATION	
6	C1764 C1765	Capacitor Ceramic,Chip	ECCH0009109	C0603X7R1H331KT00NN 330pF 10% 50V X7R - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	U6100	IC,Audio Codec	EAN62691301	WCD9302 999 999W WLCSP R/TP 55P MSM8226 Reference QCT CODEC QUALCOMM INCORPORATED.	
6	R9710	Resistor,Chip	ERHY0003301	MCR01MZP5J101 100OHM 5% 1/16W 1005 R/TP - ROHM.	
6	L1602	Inductor Multilayer,Chip	EAP62246101	LG HK 0603 4N7S-T 4.7NH 0.3NH - 280mA - - 0.3OHM 5.3GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	C5113 C5116	Capacitor Ceramic,Chip	ECCH0007805	CL05A106MQ5NUNC 10uF 20% 6.3V X5R - 55TO+85C 1005 R/TP 0.5+-0.05 - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	U1100	IC,RF Amplifier	EAN62581401	SFMG2B0D001 1.5~3.1V 0 0 0W 0W 0 0 MCM R/TP 8P Gain : 17.2dB NF : 0.85dB WISOL.CO.,LTD	
6	C4163	Capacitor Ceramic,Chip	EAE62762501	GRM21BR61H475KE51 4.7uF 10% 50V X5R - 55TO+85C 2012 R/TP 1.4T max. - MURATA MANUFACTURING CO.,LTD.	
6	R9103	Resistor,Chip	ERHY0000254	MCR01MZP5J472 4.7KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	R7201 R9501	Resistor,Chip	ERHY0009507	MCR006YZPJ105 1MOHM 5% 1/20W 0603 R/TP - ROHM.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	FL1102	Filter,Saw	EAM62870701	ACPF-8025 1962.50MHz 1.4x1.1x0.8t SMD R/TP 5P AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	VA8400	Capacitor Ceramic,Chip	EAE62944801	GRM155R60J334K 330nF -10TO+10% 6.3V X5R - 55TO+85C 1005 R/TP 0.5T L:1.0+-0.05 W:0.5+-0.05 T:0.5+-0.05 MURATA MANUFACTURING CO.,LTD.	
6	L1112	Inductor Multilayer,Chip	EAP62227101	LG HK 0603 1N5S-T 1.5H 0.3NH - 430mA - - 0.13OHM 10GHZ 4 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	MIC6921	Microphone Condenser	EAB62830801	S08OB383-002 -38DB 150OHM OMNI 1.5 TO 3.6V 3.76 * 2.95 * 1.1T SMD GoerTek Inc.	
6	C4172	Capacitor Ceramic,Chip	EAE62522101	CL10A226MP8NUNE 22uF 20% 10V X5R - 55TO+85C 1608 R/TP 1.05T max. - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	U1752	Filter,Saw	EAM62810001	ACPF-7041 2593MHz 2.0x2.0x0.9t SMD R/TP 3P AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	R1108	Resistor,Chip	EBC62236101	RC0603J821C 820OHM 5% 1/20W 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R4113	Resistor,Chip	ERHY0009547	MCR006YZPF2003 200KOHM 1% 1/20W 0603 R/TP - ROHM.	
6	FL1624	Filter,Saw	EAM63130001	SAFEA831MAA0F0A 831.5MHz 1.4x1.1x0.5t SMD R/TP 5P MURATA MANUFACTURING CO.,LTD.	
6	C4168 C5102	Capacitor Ceramic,Chip	EAE62506501	CL05A475MP5NRNC 4.7uF 20% 10V X5R - 55TO+85C 1005 R/TP - - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	L1105 L1755	Capacitor (High Frequency) Ceramic,Chip	EAE62962201	GRM0335C1ER75W_H 0.75pF 0.05PF 25V C0G - 55TO+125C 0603 R/TP 0.3 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	U1601	IC,Power Amplifier	EAN62872901	ACPM-920502-LT1 3.2V to 4.35V 0 0 0W 0W 0 2 SMD R/TP 16P Dual PAM, 3x4size, UMTS B2/5, LTE B25/26 AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	R6603	Resistor,Chip	ERHZ0000211	MCR01MZP5F1201 1.2KOHM 1% 1/16W 1005 R/TP - ROHM.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	U1600	Filter,Duplexer	EAM62812101	ACFM-7526-TR1 876.5MHz / 1962.5MHz 859to894 / 1930.25to1994.75 831.5MHz / 1882.5MHz 814to849 / 1850.25to1914.75 3.6dB@B26 / 3.8dB@B25 3.2dB@B26 / 3.3dB@B25 3.0x3.0x1.05t QUAD SMD R/TP 17P AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	SW9710 SW9711 SW9712	Switch,Tact	EBF61974601	LS12P2E-T 1C1P 12VDC 0.02A HORIZONTAL 160GF R/TP Side Tact Switch (offset) CITIZEN	
6	R2207 R2208	Resistor,Chip	ERHZ0000465	MCR01MZP5J332 3.3KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	FL1111	Filter,Saw	EAM62633001	SFHG89DQ102 1575.42@GPS/1601.72@GLONASS 1.4x1.1x0.5t SMD R/TP 5P WISOL.CO.,LTD	
6	U4600	IC,LED Driver	EAN62632301	LP5521TM X 2.7V to 5.5V 4.55 0W MICRO SMD R/TP 20P - - TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	
6	L1103 L1114	Inductor Multilayer,Chip	EAP62245901	LG HK 0603 2N7S-T 2.7NH 0.3NH - 340mA - - 0.21OHM 7.7GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	L4132 L4133	Inductor,Wire Wound,Chip	EAP62526501	TFM201610GHM-1R0MTAA 1UH 20% - 3A 3.6 3 0.06OHM - - SHIELD 2.0X1.6X1.0 MM - R/TP TDK KOREA COOPERATION	
6	R1600	Resistor,Chip	ERHY0042409	RC0201FR-0749R9L 49.9OHM 1% 1/20W 0603 R/TP - YAGEO CORPORATION	
6	U3100	IC,Mobile SDRAM	EAN62949701	H9TKNNN8JDAPLR-NGH 8GBIT LPDDR2 1.14VTO1.3V 533MHz 5500ns FBGA TR 168P - HYNIX SEMICONDUCTOR	
6	U1400	IC,DC,DC Converter	EAN62788501	LM3263 2.7V to 5.5V 0.4V to 3.6V 0W MICRO SMD R/TP 16P MIPI RFFE, 2G/3G/4G, 2.5A Max.(PWM), 2.7 MHz (typ.), 16-bump micro SMD TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	
6	C2301 C2361	Capacitor Ceramic,Chip	ECCH0009203	GRM033R60J333KE01D+A01 33nF 10% 6.3V X5R -55TO+85C 0603 R/TP - - MURATA MANUFACTURING CO.,LTD.	
6	U2100	IC,Digital Baseband Processor,4G	EAN62887701	MSM8926-3 784 pNSP, Quad CA7 1.2GHz,28nm LP,12x12 PoP,1x600MHz LPDDR3, CAT4(no CA), EVDO, HSPA+(42/11Mbps),TD-SCDMA,1080p@30fps,Adreno 305 NSP R/TP 784P QUALCOMM INCORPORATED.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C1770	Inductor Multilayer,Chip	EAP62546201	LQP03TN1N8B02D 1.8NH 0.1NH - 600mA - - 0.15OHM 15GHZ 14 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	PT1000	Thermistor,NTC	EBG61306601	NTCG104EF104FT 100KOHM 1% 35V 35A 4.25MK SMD R/TP - TDK CORPORATION	
6	Q4101	FET	EBK62032201	SIA929DJ P-CHANNEL MOSFET -30V +-12 -4.5A 0.12OHM 1.2W DFN R/TP 6P VISHAY INTERTECHNOLOGY ASIA PTE LTD	
6	C10007 C9106	Capacitor Ceramic,Chip	ECCH0009102	C0603X7R1H221KT 220pF 10% 50V X7R - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	U1101	Filter,Separator Switch	EAM62251001	RF1602 0.5 30 38 SPDT, High IIP3 typ. 74dBm, 1bit control 1.8V RF MICRO DEVICES INC	
6	FL1101	Filter,Separator,Swi tch	EAM62730001	XMSS1R6G0PA-001TMP 0.2~0.5dB 17~35dB 20dBm - MURATA MANUFACTURING CO.,LTD.	
6	R4130	Resistor,Chip	ERHY0009506	MCR006YZPJ104 100KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	FB4600	Filter,Bead	SFBH0011301	BLM15PD300SN1D 30 ohm 1.0X0.5X0.5 25% 0.035 ohm 2.2A SMD R/TP 2P 0 MURATA MANUFACTURING CO.,LTD.	
6	L2300	Inductor Multilayer,Chip	EAP62447401	MLP1005V2R2T_ 2.2UH 20% - 50mA 0.05 0.350 1.3OHM 0HZ - SHIELD - 1.0X0.5X0.55MM R/TP TDK KOREA COOPERATION	
6	C1614	Inductor Multilayer,Chip	EAP62226101	LQP03TG3N9C02D 3.9NH 0.2NH - 350mA - - 0.35OHM 6GHZ 13 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	R5203	Resistor,Chip	ERHY0009592	MCR006YZPJ202 2KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	R1507	Resistor,Chip	EBC62236701	RC0402FR-074K75L 4.75KOHM 1% 1/16W 1005 R/TP 0.4T max. YAGEO CORPORATION	
6	C4183	Capacitor Ceramic,Chip	EAE62986101	CGB2A1X5R0J225M 2.2uF -20TO20% 6.3V X5R - 55TO+85C 1005 R/TP Max 0.33T L:1.00+-0.15 W:0.5+-0.15 T:0.3+-0.03 TDK KOREA COOPERATION	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C1130	Capacitor Ceramic,Chip	ECCH0042007	GRM0335C1E6R8BD01D 6.8 pF,25V,B,C0G,TC,0603,R/TP,0.00000000000068,0. 1PF,25V,C0G,-55TO+125C,0603,R/TP,0.3 mm MURATA MANUFACTURING CO.,LTD.	
6	U9301	IC,DC,DC Converter	EAN62731801	TPS65132 2.5V to 5.5V +4.0V to +6.0V, -4.0V to - 6.0V 0W WCSP R/TP 15P Dual Output LCD Bias, Output Current: 80mA Max., 15-Ball CSP Package TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	
6	L1140	Capacitor Ceramic,Chip	ECCH0009208	GRM0335C1ER50C 0.5pF 0.25PF 25V X7R - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	U1751	IC,Power Amplifier	EAN62769501	ACPM-9041-TR1 3.2V to 4.5V 0 0 0W 0W 0 1 SMD R/TP 10P 2520size, Band41, 2mode, GPIO, CPL AVAGO TECHNOLOGIES INTERNATIONAL SALES PTE. LIMITED	
6	R2100	Resistor,Chip	ERHZ0000235	MCR01MZP5F2000 200OHM 1% 1/16W 1005 R/TP - ROHM.	
6	R6105	Resistor,Chip	ERHZ0000237	MCR01MZP5F2002 20KOHM 1% 1/16W 1005 R/TP - ROHM.	
6	C4171	Capacitor Ceramic,Chip	EAE62542701	CL21A226MPCLRNC 22uF 20% 10V X5R - 55TO+85C 2012 R/TP 0.95T max. - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	ZD4130	Diode,Switching	EDSY0019201	KDS160ERTK/H 1.2V 85V 300mA 2A 4NSEC 150mW ESC R/TP 2P 1 KEC CORPORAITION	
6	C4145 C4167	Capacitor Ceramic,Chip	ECCH0000182	GRM155R61A104K 0.1uF 10% 10V X5R - 55TO+85C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	R4106	Resistor,Chip	ERHY0009536	MCR006YZPF1003 100KOHM 1% 1/20W 0603 R/TP - ROHM.	
6	C1752 L1126	Inductor Multilayer,Chip	EAP62227301	LG HK 0603 2N2S-T 2.2NH 0.3NH - 360mA - - 0.19OHM 8.8GHZ 4 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	ZD8400	Diode,TVS	EDTY0012501	UCLAMP3311T.TCT 3.3V 3.5V min. 6.5V 5A - SLP1006P2T R/TP 2P 1 SEMTECH CORPORATION	
6	C1147 C1148	Inductor Multilayer,Chip	EAP62109001	LQP03TN0N6B02D 600PH 0.1NH - 850mA - - 0.07OHM 6GHZ 14 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	L1136	Inductor Multilayer,Chip	EAP61866601	LG HK0603 R10J-T 100NH 5% - 60mA - - 3.74OHM 900MHZ 4 SHIELD 0 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	L1501	Inductor Multilayer,Chip	EAP62108601	LQP03TG22NJ02D 22NH 5% - 140mA - - 2.85OHM 2.5GHZ 9 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C5124	Inductor Multilayer,Chip	EAP62227701	LG HK 0603 8N2J-T 8.2NH 5% - 230mA - - 0.45OHM 3.4GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	R9504	Resistor,Chip	ERHY0009502	MCR006YZPJ100 10OHM 5% 1/20W 0603 R/TP - ROHM.	
6	L5200 L5201	Inductor,Wire Wound,Chip	EAP61967501	SDWL1608CR47JSTFM01 470NH 5% - 75mA - - 70HM 700MHZ 30 SHIELD 1.80X1.12X1.02MM NONE R/TP SHENZHEN SUNLORD ELECTRONICS CO., LTD.	
6	C2407 C4153 C4158	Capacitor Ceramic,Chip	EAE62726601	CL03A225MQ3CRNC 2.2uF -20TO20% 6.3V X5R - 55TO+85C 0603 R/TP 0.3T - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	L1601 L1752	Inductor Multilayer,Chip	EAP62227401	LG HK 0603 3N9S-T 3.9NH 0.3NH - 300mA - - 0.27OHM 6GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	L1603	Inductor Multilayer,Chip	EAP62246201	LG HK 0603 10NJ-T 10NH 5% - 220mA - - 0.51OHM 2.9GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	R1501	Resistor,Chip	EBC62115901	RC0603J680CS 68OHM 5% 1/20W 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
5	EBR071600	PCB Assembly Main,SMT Bottom	EBR77959201	LGLS740.AVGMWH 1.0 Main	
6	C1122	Capacitor Ceramic,Chip	ECCH0009226	GRM0335C1E390J 39pF 5% 25V X7R - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C2307 C2336 C2339 C2340 C2342 C2343 C2344 C2352 C2353 C2354 C2355 C2359 C2363 C2366 C2367 C2368	Capacitor Ceramic,Chip	ECCH0009101	C0603X5R0J104KT00NN 0.1uF 10% 6.3V X5R - 55TO+85C 0603 R/TP - TDK CORPORATION	
6	C2369 C2374 C2375 C2380 C2395 C2397 C3201 C3204 C3206 C4137 C7101 C7103 C8100 C8101 C8952 C9300	Capacitor Ceramic,Chip	ECCH0009101	C0603X5R0J104KT00NN 0.1uF 10% 6.3V X5R - 55TO+85C 0603 R/TP - TDK CORPORATION	
6	FL7101 FL7102 FL7103 FL7300 FL7301 FL7302 FL7400 FL7401	Filter,EMI/Power	EAM62570201	ICMEF062P900MFR COMMON MODE NOISE FILTER - 0.0000000000017F 0H SMD R/TP - INNOCHIPS TECHNOLOGY	
6	L1101 L1118	Inductor Multilayer,Chip	EAP62108901	LQP03TN47NJ02D 47NH 5% - 100mA - - 3.6OHM 1.3GHZ 9 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	U4102 U4104	IC,LDO Voltage Regulator	EAN62669801	TLV70728PDQNR V2 to V5.5 V2.8 0W QFN R/TP 4P - TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C2341 C2351 C2382 C2383 C2384 C2386 C2388 C4140 C4141 C4179 C4197 C4199 C7100 C7102 C7400 C9503	Capacitor Ceramic,Chip	ECCH0017301	CL03A105MQ3CSNH 0.000001F 20% 6.3V X5R - 45TO+85C 0603 R/TP - SAMSUNG ELECTRO- MECHANICS CO., LTD.	
6	R1120 R1122 R1123 R2300 R4102 R4103 R4105 R4132 R4133 R6921 R7100 R7300 R7303 R7401 R9106 R9107	Wire Pad,Short	SAFP0000401	AX3100 ATL SV_SHIPBACK,MAIN,A	
6	C2306 C2318 C2319 C2321 C2322 C2325 C2326 C2360 C5107 C5108 C5109 C5111	Capacitor Ceramic,Chip	ECCH0009106	C0603X7R1C103KT 10nF 10% 10V X7R - 55TO+125C 0603 R/TP - TDK CORPORATION	
6	VA7300 VA7301 VA9502 VA9504	Varistor	SEVY0008102	EVLC5S01015 5.5V 0% 15pF 0.6*0.3*0.33 NONE SMD R/TP AMOTECH CO., LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C9504	Capacitor (High Frequency) Ceramic,Chip	EAE63024201	RMTMK063CG100JT-F_H 10pF 5% 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03, W:0.3+-0.03, T:0.3+-0.03 KOREA TAIYO YUDEN.CO., LTD.	
6	L1141	Inductor Multilayer,Chip	EAP62108701	LQP03TN27NJ02D 27NH 5% - 140mA - - 2.3OHM 2GHZ 12 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C2302 C2317 C2357	Capacitor Ceramic,Chip	ECCH0009201	GRM033R60J473KE19D 47nF 10% 6.3V X5R - 55TO+85C 0603 R/TP - - MURATA MANUFACTURING CO.,LTD.	
6	C2300	Capacitor Ceramic,Chip	ECCH0009207	GRM033R71A682K 6.8nF 10% 10V X7R - 55TO+125C 0603 R/TP - - MURATA MANUFACTURING CO.,LTD.	
6	VA6601 VA6603 VA6605 VA6800 VA6801 VA7100 VA7101 VA7102 VA7103 VA7204 VA7303 VA7400 VA8950 VA9100 VA9101 VA9501 VA9700 VA9830	Varistor	SEVY0003601	ICVL0505101V150FR 5.6V 0% 100pF 1.0*0.5*0.55 NONE SMD R/TP INNOCHIPS TECHNOLOGY	
6	C2303 C2323 C2358 C2389 C2401	Capacitor Ceramic,Chip	ECCH0034801	CL03A474MQ3NNNH 0.47uF -20TO20% 6.3V X5R -55TO+85C 0603 R/TP 0.3+-0.03 - SAMSUNG ELECTRO-MECHANICS CO., LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C10004 C10005 C1103 C1115 C1121 C1125 C1133 C5112 C5114 C5115 C7106 C7107 C9102	Capacitor Ceramic,Chip	ECCH0009103	C0603C0G1H101JT00NN 100pF 5% 50V C0G - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	C9100	Capacitor,TA Conformal	EAE62748401	F981A476MSAFZH 47uF 20% 10V 9.4UA - 55TO+125C 50HM 2.2X1.25X0.9MM NONE SMD R/TP 0.9T max. UNITEL ELECTRONICS CO. LTD.	
6	R9504	Resistor,Chip	ERHY0009502	MCR006YZPJ100 100HM 5% 1/20W 0603 R/TP - ROHM.	
6	C2407 C4153 C4158	Capacitor Ceramic,Chip	EAE62726601	CL03A225MQ3CRNC 2.2uF -20TO20% 6.3V X5R - 55TO+85C 0603 R/TP 0.3T - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	U8950	IC,Gate	EAN62415501	SN74AUP1T97DSFR 0~3.6V 0.000004 LEVEL SHIFTER SON-6 R/TP 6P Configurable Gate Logic TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	
6	C10007 C9106	Capacitor Ceramic,Chip	ECCH0009102	C0603X7R1H221KT 220pF 10% 50V X7R - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	D10001	Diode,TVS	EAH61872601	PESD12VS1UA 12V 13.3V min. 19V 22.5A 360mW SOD323 R/TP 2P 1 NXP Semiconductors	
6	C2308 C2362 C7300 C7302 C7303 C8950 C8951	Capacitor Ceramic,Chip	ECCH0017601	CL05A475MQ5NRNC 4.7uF 20% 6.3V X5R - 55TO+85C 1005 R/TP 0.5MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	C10003	Capacitor Ceramic,Chip	EAE62962301	GRM155R61A225KE95 2.2uF -10TO+10% 10V X5R -55TO+85C 1005 R/TP 0.5 L:1.0+-0.05 W:0.5+-0.05 T:0.5+-0.05 MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	SW1101 SW1103 SW1104 SW1106	Connector,RF	ENWY0008701	MS-156C NONE STRAIGHT SOCKET SMD T/REEL AU 50OHM 400mDB HIROSE KOREA CO.,LTD	
6	R9104	Resistor,Chip	ERHZ0000411	MCR01MZP5J121 120OHM 5% 1/16W 1005 R/TP - ROHM.	
6	R2213 R2214	Resistor,Chip	ERHY0009522	MCR006YZPJ332 3.3KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	C5208	Capacitor Ceramic,Chip	ECCH0000117	CL05C270JB5NNNC 27pF 5% 50V NP0 - 55TO+125C 1005 R/TP 0.5 SAMSUNG ELECTRO- MECHANICS CO., LTD.	
6	U3200	IC,MCP,eMMC	EAN62740501	THGBMAG6A2JBAIR 8Gbyte 2.7VTO3.6V,1.7VTO1.95V 11.5x13.0x1.0 TR 153P MLC NAND FBGA 8GB eMMC v4.5 (19nm 32Gb MLC x 2/11.5x13.0/91.0%), MSL3 TOSHIBA ELECTRONICS KOREA CORPORATION	
6	L6813	Inductor Multilayer,Chip	ELCH0001444	0402AF-101XJEW 100NH 5% - 900mA - - 0.16OHM 1.4GHZ 8 NON SHIELD NONE 1.12X0.66X0.66MM R/TP COILCRAFT SINGAPORE PTE LTD.	
6	C4168 C5102	Capacitor Ceramic,Chip	EAE62506501	CL05A475MP5NRNC 4.7uF 20% 10V X5R - 55TO+85C 1005 R/TP - - SAMSUNG ELECTRO- MECHANICS CO., LTD.	
6	L6810 L6811	Inductor Multilayer,Chip	ELCH0003841	LQG15HS82NJ02D 82NH 5% - 150mA 1.2OHM 700MHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	C4138	Capacitor Ceramic,Chip	EAE62927201	ADK107BBJ476MA 47uF -20TO20% 4V X5R - 55TO+85C 1608 R/TP 0.8T +0.2 L:1.6+0.2 W:0.8+0.2 T:0.8+0.2 KOREA TAIYO YUDEN.CO., LTD.	
6	C10001 C5206 C6810 C6811 C6812	Capacitor Ceramic,Chip	ECZH0000830	C1005C0G1H330JT000F 33pF 5% 50V NP0 - 55TO+125C 1005 R/TP - TDK KOREA COOPERATION	
6	C5113 C5116	Capacitor Ceramic,Chip	ECCH0007805	CL05A106MQ5NUNC 10uF 20% 6.3V X5R - 55TO+85C 1005 R/TP 0.5+-0.05 - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	Q8950 Q8951	TR,Bipolar	EQBN0020501	KTC4075E NPN 5V 60V 50V 150mA 100NA 700 100mW ESM R/TP 3P KEC CORPORAITION	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C3200 C3205 C7401 C7402	Capacitor Ceramic,Chip	ECCH0000198	CL05A225MQ5NSNC 2.2uF 20% 6.3V X5R - 55TO+85C 1005 R/TP . SAMSUNG ELECTRO- MECHANICS CO., LTD.	
6	C10002	Capacitor Ceramic,Chip	ECCH0017401	CL21B105KBFNNNE 1uF 10% 50V X7R - 55TO+125C 2012 R/TP 1.25MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R2207 R2208	Resistor,Chip	ERHZ0000465	MCR01MZP5J332 3.3KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	CN7100	Connector,BtoB	EAG63232601	BM10NB(0.8)-24DS-0.4V(43) 24P 0.40MM STRAIGHT SOCKET SMD R/TP 800mM - HIROSE KOREA CO.,LTD	
6	CN7400	Connector,BtoB	ENBY0039601	GB042-20S-H10-E3000 20P 0.4MM STRAIGHT SOCKET SMD R/TP 1M - LS Mtron Ltd.	
6	FB6600	Filter,Bead	SFBH0008102	BLM15HD182SN1D 1800 ohm 1.0X0.5X0.5 25% 2.2 ohm 0.2A SMD R/TP 2P 0 MURATA MANUFACTURING CO.,LTD.	
6	CN7300	Connector,BtoB	ENBY0034201	GB042-24S-H10-E3000 24P 0.40MM STRAIGHT SOCKET SMD R/TP 1M - LS Mtron Ltd.	
6	C5104	Capacitor Ceramic,Chip	ECCH0009105	C0603C0G1H820JT00NN 82pF 5% 50V NP0 - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	CN9100	Connector Terminal Block	EAG62832301	04-9254-004-037-829+ 4P 2.50MM ANGLE SMD T/REEL - KYOCERA ELCO KOREA SALES CO.,LTD.	
6	C5124	Inductor Multilayer,Chip	EAP62227701	LG HK 0603 8N2J-T 8.2NH 5% - 230mA - - 0.45OHM 3.4GHZ 5 SHIELD - 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	VA9500 VA9505 VA9506 VA9507 VA9508 VA9509	Varistor	SEVY0005101	ICVL0518050FR 18V 0% 5F 1.0*0.5*0.55 NONE SMD R/TP INNOCHIPS TECHNOLOGY	
6	CN7200	Connector,BtoB	ENBY0036001	GB042-40S-H10-E3000 40P 0.4MM STRAIGHT SOCKET SMD R/TP 1M ENGINEERING PLASTIC UL94V-0 AU OVER NI LS Mtron Ltd.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	VA6604 VA6901 VA9718 VA9722 VA9723	Varistor	SEVY0008101	EVLC5S01033 EVLC5S01033 EVLC5S01033,5.5 V, ,SMD ,Vdc 5.5, Vb 10~15.6, Cp 17.9 at 1MHz, 0.6*0.3*0.33 , ,5.5 , ,23.1~42.9 ,0.6*0.3*0.33 ,[empty] ,SMD ,R/TP AMOTECH CO., LTD. AMOTECH CO., LTD.	
6	R7201 R9501	Resistor,Chip	ERHY0009507	MCR006YZPJ105 1MOHM 5% 1/20W 0603 R/TP - ROHM.	
6	D6600	Diode,TVS	EAH62073701	PESD5V0V1BDSF 5V 6V min. 12.8V 2A 20W DSN0603-2 R/TP 2P 1 NXP Semiconductors	
6	R9500	Resistor,Chip	ERHY0042402	RC0201JR-0715KL 15KOHM 5% 1/20W 0603 R/TP - YAGEO CORPORATION	
6	R9101	Resistor,Chip	ERHZ0000222	MCR01MZF5F1503 150KOHM 1% 1/16W 1005 R/TP - ROHM.	
6	C5203 C5214	Capacitor Ceramic,Chip	ECCH0033301	GRM1555C1H680F 68pF 1% 50V C0G - 55TO+125C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	L5101 L5102	Inductor Multilayer,Chip	EAP61866701	LG HK0603 82NJ-T 82NH 5% - 70mA - - 3.37OHM 1GHZ 4 SHIELD 0 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	FL5100	Filter,Saw	EAM62970201	885032 2442.0MHz 1.4x1.2x0.46mm SMD R/TP 5P TRIQUINT SEMICONDUCTOR INC.	
6	C2304 C2320 C2402 C5105	Capacitor Ceramic,Chip	ECCH0009110	C0603X7R0J223KT 22nF 10% 6.3V X7R - 55TO+125C 0603 R/TP - - TDK CORPORATION	
6	L5100	Inductor Multilayer,Chip	EAP61767601	HK0603 68NJ-T 68NH 5% - 80mA - - 2.66OHM 1.1GHZ 4 SHIELD NONE 0.6X0.3X0.3MM R/TP TAIYO YUDEN CO.,LTD	
6	R8952 R9306	Resistor,Chip	ERHY0009503	MCR006YZPJ101 100OHM 5% 1/20W 0603 R/TP - ROHM.	
6	C5100 C5101	Capacitor Ceramic,Chip	ECZH0001217	GRM155R60J474K 470nF 10% 6.3V X5R - 25TO+70C 1005 BK-DUP - MURATA MANUFACTURING CO.,LTD.	
6	L5104	Inductor Multilayer,Chip	ELCH0003842	LQG15HSR10J02D 100NH 5% - 150mA - - 1.25OHM 600MHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	U5100	IC,WiFi	EAN62698901	WCN-3620-0-61WLNSP WiFi(11bgn)+BT4.0+FM IC for QMC 28nm BB, 3.32*3.55*0.63, 0.4pitch WLCSP R/TP 61P QUALCOMM INCORPORATED.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C2356	Capacitor Ceramic,Chip	ECCH0032801	GRM033R60J224M 0.00000022F 20% 6.3V X5R - 55TO+85C 0603 R/TP 0.3MM MURATA MANUFACTURING CO.,LTD.	
6	C1147 C1148	Inductor Multilayer,Chip	EAP62109001	LQP03TN0N6B02D 600PH 0.1NH - 850mA - - 0.07OHM 6GHZ 14 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	ANT5200 ANT5202	C-Clip	EAG63651801	MBV62641701 1P ANT TERMINAL STRAIGHT SMD T/REEL AU 3.4 X 1.5 X 4.0(L X W X H) SERVEONE CO., LTD.	
6	R9105	Resistor,Chip	ERHY0035601	PMR10EZPFU10L0 0.01OHM 1% 1/2W 2012 R/TP - ROHM.	
6	C6923 C9502	Capacitor Ceramic,Chip	ECCH0009104	C0603C0G1H330JT00NN 33pF 5% 50V C0G - 55TO+125C 0603 R/TP - TDK CORPORATION	
6	C1156 C5117	Capacitor Ceramic,Chip	ECCH0009506	MCH032A270JK 27pF 5% 25V NP0 -55TO+125C 0603 R/TP - ROHM.	
6	R8954 R8955	Resistor,Chip	ERHY0009504	MCR006YZPJ102 1KOHM 5% 1/20W 0603 R/TP - ROHM.	
6	C5122	Capacitor Ceramic,Chip	ECCH0009502	GRM0335C1E1R5CD01D+A02 1.5pF 0.25PF 25V NP0 -55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	C4178 C4196 C4198 C9103	Capacitor Ceramic,Chip	EAE62762301	CL03A105MP3NSNC 1uF 20% 10V X5R - 55TO+85C 0603 R/TP 0.33 MM - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R8951	Resistor,Chip	ERHZ0000406	MCR01MZP5J104 100KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	U8100	IC,Acceleration Sensor	EAN62637201	BMC150 Accelerometer with Geomagnetic Sensor 2.2X2.2X1.0 LGA R/TP 14P Accelerometer with Geomagnetic Sensor BOSCH SENSORTTEC GMBH	
6	C2301 C2361	Capacitor Ceramic,Chip	ECCH0009203	GRM033R60J333KE01D+A01 33nF 10% 6.3V X5R -55TO+85C 0603 R/TP - - MURATA MANUFACTURING CO.,LTD.	
6	S9500	Card Socket	EAG63310801	1041681610 Micro-SD, UIMDupliSocket 16P STRAIGHT DIP T/REEL - MOLEX	
6	C4185 C7301	Capacitor Ceramic,Chip	ECCH0004904	GRM155R60J105K 1uF 10% 6.3V X5R -55TO+85C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C2324	Capacitor Ceramic,Chip	ECCH0042004	GRM033R61A562KA01D 5.6nF 10% 10V X5R - 55TO+85C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	U4105	IC,LDO Voltage Regulator	EAN62496301	TLV70718 V2 to V5.5 V1.8 0W QFN R/TP 4P EUSY0355501 RP103K181D ,Richo Pin to Pin TEXAS INSTRUMENTS KOREA LTD, HONGKONG BRANCH.	
6	C9505	Capacitor Ceramic,Chip	ECCH0009514	MCH032A(AN)100DK 10pF 0.5PF 25V X7R - 55TO+125C 0603 R/TP - ROHM.	
6	FB7100	Filter,Bead	EAM62630901	BLM15AX102SN1D_ 1000 1.0x0.5x0.5 25% 0.49 0.35 SMD R/TP 0P - MURATA MANUFACTURING CO.,LTD.	
6	VA5200 VA5201	Varistor	SEVY0010501	IECS0505C040FR 10V 0% 4E-12F 1.0x0.5x0.3 IEC61000-4-1 (ESD) level #4 SMD R/TP INNOCHIPS TECHNOLOGY	
6	R9103	Resistor,Chip	ERHY0000254	MCR01MZP5J472 4.7KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	C9101	Capacitor Ceramic,Chip	EAE62286801	CL03A104KP3NNNC 0.0000001F 10% 10V X5R - 55TO+85C 0603 R/TP 0.3 - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	C5205 C5207	Capacitor Ceramic,Chip	ECZH0000841	C1005C0G1H560JT000F 56pF 5% 50V NP0 - 55TO+125C 1005 R/TP - TDK KOREA COOPERATION	
6	L1140	Capacitor Ceramic,Chip	ECCH0009208	GRM0335C1ER50C 0.5pF 0.25PF 25V X7R - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	R8950	Resistor,Chip	ERHY0009544	RC0603J2R2CS 2.2OHM 5% 1/20W 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	SW1100 SW1102	Connector,RF	ENWY0003901	U.FL-R-SMT(10) 1.90MM STRAIGHT SOCKET SMD T/REEL CU 50OHM 300mDB HIROSE KOREA CO.,LTD	
6	LD9830	Module,Assembly	EAT61875501	LXCL-MN07-4002 LO Type Flash module LUMILEDS LIGHTING U.S.,LLC	
6	C5119	Inductor Multilayer,Chip	EAP62108001	LQP03TG2N2C02D 2.2NH 0.2NH - 450mA - - 0.25OHM 6GHZ 13 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	FB5100	Filter,Bead	EAM62471001	BLM03AX241SN1D 240 ohm 0.6X0.3X0.33 25% 0.38 ohm 0.35A SMD R/TP 2P 0 MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C1109 C9301	Capacitor Ceramic,Chip	ECZH0000813	C1005C0G1H101JT 100pF 5% 50V C0G - 55TO+125C 1005 R/TP - TDK KOREA COOPERATION	
6	VA9510	Varistor	SEVY0007901	ICVS0505481FR 5.6V 0% 480F 1.0*0.5*0.55 NONE SMD R/TP INNOCHIPS TECHNOLOGY	
6	C4145 C4167	Capacitor Ceramic,Chip	ECCH0000182	GRM155R61A104K 0.1uF 10% 10V X5R - 55TO+85C 1005 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	C2305 C2381 C2385	Capacitor Ceramic,Chip	ECCH0009228	GRM033R61A472K 4700pF 10% 10V X5R - 55TO+85C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	C9501	Capacitor Ceramic,Chip	ECZH0001215	C1005X5R1A105KT000F 1uF 10% 10V X5R - 55TO+85C 1005 R/TP - TDK KOREA COOPERATION	
6	R6612	Wire Pad,Open	SAFO0000401	AX3100 ATL SV_SHIPBACK,MAIN,A,0OHM DNI	
6	R9302	Resistor,Chip	ERHZ0000486	MCR01MZP5J473 47KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	C4136	Capacitor Ceramic,Chip	EAE62767801	JDK212BBJ476MD 47uF -20TO20% 6.3V X5R - 55TO+85C 2012 R/TP 0.85T - TAIYO YUDEN CO.,LTD	
6	C1157	Inductor Multilayer,Chip	EAP62186301	LQP03TG1N8C02D 1.8NH 0.2NH - 500mA - - 0.2OHM 6GHZ 13 SHIELD - 0.6X0.3X0.3MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	L5103	Capacitor Ceramic,Chip	ECCH0009520	MCH032A150JK 15pF 5% 25V X7R -55TO+125C 0603 R/TP - ROHM.	
6	R9710	Resistor,Chip	ERHY0003301	MCR01MZP5J101 100OHM 5% 1/16W 1005 R/TP - ROHM.	
6	C9105	Capacitor Ceramic,Chip	ECCH0000122	MCH155A470JK 47pF 5% 50V NP0 -55TO+125C 1005 R/TP - ROHM Semiconductor KOREA CORPORATION	
6	C6600	Capacitor Ceramic,Chip	ECZH0025920	GRM033R71C102K 1nF 10% 16V X7R - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	FB6922	Filter,Bead	EAM62870101	MPZ1608S102A 1000 1.6x0.8x0.8 25% 0.3 0.8 SMD R/TP 2P - TDK CORPORATION	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
6	C1113	Inductor Multilayer,Chip	ELCH0003827	LQG15HS47NJ02D 47NH 5% - 200mA 0.72OHM 1GHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP MURATA MANUFACTURING CO.,LTD.	
6	R3208	Resistor,Chip	ERHZ0000405	MCR01MZP5J103 10KOHM 5% 1/16W 1005 R/TP - ROHM.	
6	C5123	Capacitor (High Frequency) Ceramic,Chip	EAE62946001	GRM0335C1E1R8C_H 1.8pF 0.25PF 25V C0G - 55TO+125C 0603 R/TP 0.3+-0.03 L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	CN10000	Connector,BtoB	ENBY0040701	GB042-30S-H10-E3000 30P 0.4MM STRAIGHT FEMALE SMD R/TP 1M - LS Mtron Ltd.	
6	C5110	Capacitor Ceramic,Chip	ECZH0025917	GRM0335C1E470J 47pF 5% 25V NP0 - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
6	C2387	Capacitor Ceramic,Chip	EAE63070001	GRM033R60J223JE01 22nF -5 to +5% 6.3V X5R - 55TO+85C 0603 R/TP Max 0.33T L:0.6+-0.03 W:0.3+-0.03 T:0.3+-0.03 MURATA MANUFACTURING CO.,LTD.	
6	R9102	Resistor,Chip	EBC62235801	RC0603F363CS 36KOHM 1% 1/20W 0603 R/TP - SAMSUNG ELECTRO-MECHANICS CO., LTD.	
6	R8953	Resistor,Chip	EBC62575901	RC0201FR-07300RL 300OHM 1% 1/20W 0603 R/TP - YAGEO CORPORATION	
6	ZD9101	Diode,Zener	EDNY0013602	EDZVT2R5.1B 4.98V 4.98TO5.2V 80OHM 150mW EMD2 R/TP 2P 1 ROHM Semiconductor KOREA CORPORATION	
4	EAU00	Motor,DC	EAU62003401	TLE-1030F 2V 40mA 0A 12KRPM 0RPM 60mSEC 0GF.CM 17OHM 푸난현특립전자유한공사	V,48
4	EAB00	Speaker Module	EAB63108301	EME1511DE19 Nd Fe B 700mW 8OHM 90DB 1.074KHZ 66.48x47.19x5.03 FPCB EM-TECH	U,33
5	EAA030103	PIFA Antenna Multiple	EAA63145201	BSF13A006 MULTI -5DB 5:1 FPCB Type - MRD Tape AT&C CO.,LTD	47
5	EAA030101	PIFA Antenna Multiple	EAA63145101	BGF13A005 MULTI -5DB 5:1 FPCB Type - MRD Tape AT&C CO.,LTD	45
5	EAA030102	PIFA Antenna GPS	EAA63125201	BGF13A007 SINGLE -5DB 5:1 FPCB Type - GPS Tape AT&C CO.,LTD	46

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
5	EAA030100	PIFA Antenna Multiple	EAA63145301	BWF13A008 MULTI -5DB 5:1 FPCB Type - WLAN+BT Tape AT&C CO.,LTD	44
4	EBP01	Camera Module	EBP61641902	CW1346-APQH5 CW1346-APQH5 1.3M Sony 1/7.8 HD, 0deg, FPCB 5mm, Con. Top COWELL ELECTRONICS CO.,LTD	O,28
4	EBR01	PCB Assembly Flexible	EBR77959301	LGLS740.AVGMMWH 1.0 Flexible	I,18
5	EBR070100	PCB Assembly Flexible,Insert	EBR78888901	LGLS740.AVGMMWH 1.0 Flexible	
5	EBR070400	PCB Assembly Flexible,SMT	EBR77959801	LGLS740.AVGMMWH 1.0 Flexible	
6	EBR070300	PCB Assembly Flexible,SMT Top	EBR77959901	LGLS740.AVGMMWH 1.0 Flexible	
7	EAX010700	PCB,Flexible	EAX65606701	LGLS740.ABMUBL 1.0 POLYI Multi 6 0.45 Flexible	
7	LD1 LD2	LED,Chip	EDLH0014803	SSC-WH107 WHITE 2.7~3.1 20mA 100~230mcd x, y 64mW 1608 R/TP 2P - SEOUL SEMICONDUCTOR CO.,LTD	
7	MIC6921	Microphone Condenser	EAB62830801	S08OB383-002 -38DB 150OHM OMNI 1.5 TO 3.6V 3.76 * 2.95 * 1.1T SMD GoerTek Inc.	
7	R2101 R2103	Resistor,Chip	EBC61856201	RC0201FR-07240RL 240OHM 1% 1/20W 0603 R/TP - YAGEO CORPORATION	
7	CN3	Connector,BtoB	ENBY0040601	GB042-30P-H10-E3000 - 0.40MM STRAIGHT MALE SMD R/TP - - LS Mtron Ltd.	
6	EBR070200	PCB Assembly Flexible SMT Bottom	EBR77960001	LGLS740.AVGMMWH 1.0 Flexible	
7	L2	Inductor Multilayer,Chip	ELCH0001404	LL1005-FHL1N5S 1.5NH 0.3NH - 400mA 0.13OHM 15GHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP TOKO, INC.	
7	D10001	Diode,TVS	EAH61872601	PESD12VS1UA 12V 13.3V min. 19V 22.5A 360mW SOD323 R/TP 2P 1 NXP Semiconductors	
7	L6 L7 L8 L9	Inductor Multilayer,Chip	ELCH0003843	LQG15HSR12J02D 120NH 5% - 150mA - - 1.3OHM 600MHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP MURATA MANUFACTURING CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
7	FB6600	Filter,Bead	SFBH0008102	BLM15HD182SN1D 1800 ohm 1.0X0.5X0.5 25% 2.2 ohm 0.2A SMD R/TP 2P 0 MURATA MANUFACTURING CO.,LTD.	
7	D8 D9	Diode,TVS	EAH61995401	RClamp0521Z.TNT 5V 6V min. 25V 4A 100W SLP0603P2X3 R/TP 2P 1 SEMTECH INTERNATIONAL AG	
7	CN4	Connector,I/O	EAG63090001	04-5161-005-100-868 7P 0.90MM ANGLE RECEPTACLE DIP R/TP Normal New IO Connector KYOCERA ELCO KOREA SALES CO.,LTD.	
7	C1559 C1606 C1623 C1750 C1758 C4107 C5204 C5211	Capacitor Ceramic,Chip	ECZH0025916	GRM0335C1E330J 33pF 5% 25V NP0 - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
7	ZD1	Diode,TVS	EDTY0012102	PESD5V0V1BL 5V 5.8V min. 12.5V 4.8A 45W SOD-882 R/TP 2P 1 STC CORP.	
7	FL2	Filter,LCR	EAM62890001	ACFT4A2G900E COMMON MODE NOISE FILTER 0HZ 0F 0H SMD R/TP 90ohm, 35ohm, 100mA AMOTECH CO., LTD.	
7	C6600	Capacitor Ceramic,Chip	ECZH0025920	GRM033R71C102K 1nF 10% 16V X7R - 55TO+125C 0603 R/TP - MURATA MANUFACTURING CO.,LTD.	
7	L1	Inductor Multilayer,Chip	ELCH0003831	LQG15HS1N0S02D 1NH 0.3NH - 300mA - - 0.07OHM 10GHZ 8 SHIELD NONE 1.0X0.5X0.5MM R/TP MURATA MANUFACTURING CO.,LTD.	
7	FL1	Filter,EMI/Power	SFEY0015301	NFM18PC104R1C3 ESD/EMI 0HZ 0.1uF 0H SMD R/TP - MURATA MANUFACTURING CO.,LTD.	
7	L4 L5	Inductor,Wire Wound,Chip	ELCH0003806	LQW18AN82NG00D 82NH 2% - 250mA 0.6OHM 2KHZ 34 NON SHIELD 1.6X0.8X0.8MM - R/TP MURATA MANUFACTURING CO.,LTD.	
7	R3	Resistor,Chip	ERHZ0000401	MCR01MZSJ000 0OHM 5% 1/16W 1005 R/TP - ROHM.	
7	SW1	Connector,RF	EAG63412001	W.FL2-R-SMT-1(61) 0.35MM STRAIGHT SOCKET SMD R/TP AU 50OHM 400mDB HIROSE KOREA CO.,LTD	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
7	C10001 C5206 C6810 C6811 C6812	Capacitor Ceramic,Chip	ECZH0000830	C1005C0G1H330JT000F 33pF 5% 50V NP0 - 55TO+125C 1005 R/TP - TDK KOREA COOPERATION	
7	CN5	Connector,BtoB	EAG63393201	BM10NB(0.8)-10DS-0.4V 10P 0.40MM STRAIGHT FEMALE SMD R/TP 800mM - HIROSE KOREA CO.,LTD	
7	SW1100 SW1102	Connector,RF	ENWY0003901	U.FL-R-SMT(10) 1.90MM STRAIGHT SOCKET SMD T/REEL CU 50OHM 300mDB HIROSE KOREA CO.,LTD	
7	C19	Capacitor Ceramic,Chip	ECCH0000115	MCH155A220JK 22pF 5% 50V NP0 -55TO+125C 1005 R/TP - ROHM Semiconductor KOREA CORPORATION	
7	C20	Capacitor Ceramic,Chip	EAE62685301	CL05A105KA5NQNC 1uF 10% 25V X5R - 55TO+85C 1005 R/TP 0.6T max. Samsung(1.0+-0.1 0.5+-0.1 0.5+-0.1) Murata (1.0+-0.05 0.5+-0.05 0.5+-0.05) SAMSUNG ELECTRO-MECHANICS CO., LTD.	
7	VA7300 VA7301 VA9502 VA9504	Varistor	SEVY0008102	EVLC5S01015 5.5V 0% 15pF 0.6*0.3*0.33 NONE SMD R/TP AMOTECH CO., LTD.	
7	C2379 C6101 C6102 C6106 C6922 C8700 C8701	Capacitor Ceramic,Chip	ECCH0002001	C1005JB0J104KT000F 0.1uF 10% 6.3V X5R - 30TO+85C 1005 R/TP - - TDK CORPORATION	
4	EBR02	PCB Assembly Flexible	EBR78394401	LGVS450PP.AVRZZY 1.0 Flexible	G,17
5	EBR070100	PCB Assembly Flexible,Insert	EBR78409201	LGVS450PP.AVRZZY 1.0 Flexible	
5	EBR070400	PCB Assembly Flexible,SMT	EBR78394201	LGVS450PP.AVRZZY 1.0 Flexible	
6	EBR070300	PCB Assembly Flexible,SMT Top	EBR78355901	LGVS450PP.AVRZZY 1.0 Flexible	
7	EAX010700	PCB,Flexible	EAX65608701	LGD405.AVDSKT 1.0 POLYI Multi 2 0.25 Flexible	

12. EXPLODED VIEW & REPLACEMENT PART LIST

Level	Location No.	Description	Part Number	Spec	Remark
7	LD100 LD101	LED,Array	EAV62094101	CL-425F-C1CC-SD-TS RED/GREEN/BLUE 3.1 30mA 360mcd 625 125mW 3527 R/TP 4P common cathode type CITIZEN ELECTRONICS CO.,LTD.	
6	EBR070200	PCB Assembly Flexible SMT Bottom	EBR78394301	LGVS450PP.AVRZZY 1.0 Flexible	
7	SW100	Switch,Tact	EBF61955001	LS75C2D 1C1P 12VDC 0.02A HORIZONTAL 160GF R/TP - CITIZEN ELECTRONICS CO.,LTD.	
7	CN100	Connector,BtoB	EAG63393301	BM10SB(0.8)-10DP-0.4V 10P 0.40MM STRAIGHT MALE SMD R/TP 800mM - HIROSE KOREA CO.,LTD	
4	EAJ00	LCD Module	EAJ62569501	LM468VN2A QHD 4.7INCH 960X540 450CD COLOR 70% 16/9 1000:1 60Hz Inverter N LED 2D - TOVIS	E,14
4	EAG00	Jack,Phone	EAG63550001	HG05-AB3600 5P 4P ANGLE TR 3.5M BLACK 5P Left Side Contact C-Cut HYUPJIN I&C CO.,LTD.	P,27
4	EAD00	Cable,Assembly	EAD62865601	UFLVWFL2HF04N2TC-A90ALG UFL-LP-066 UFL- LP-066 0.06M 1 BLACK N N HIROSE KOREA CO.,LTD	J,24
4	EAD01	Cable,Assembly	EAD62865501	UFL-2LPVHF-04N1TC-A113LG UFL-LP-066 UFL- LP-066 0.06M 0 WHITE N N HIROSE KOREA CO.,LTD	K,23
4	EAB01	Receiver	EAB63128601	EMR1307SWB5P 50mW 32OHM 110DB 50HZTO7KHZ PIN - EM-TECH	N,26
4	EBD00	Touch Window Assembly	EBD61726101	STWC-L0053A CAPACITIVE TOUCH G/F/F NA(COB Type) 4.7 Inch B to B - SUNTEL CO.,LTD.	C,9
3	EAA030100	PIFA Antenna,Multiple	EAA63125301	BNF13A009 SINGLE -5DB 5:1 FPCB Type - NFC Tape AT&C CO.,LTD	52
2	EAD010000	Cable,Assembly	EAD62150403	DLC-LGE30DCMUA-2 USB USB 1.0M 5 BLACK UL N CRESYN(H.K.)CO.,LTD.	

12. EXPLODED VIEW & REPLACEMENT PART LIST

12.3 Accessory

Note: This Chapter is used for reference, Part order is ordered by SBOM standard on GCSC

Level	Location No.	Description	Part Number	Spec	Remark
2	EAY060000	Adapters	EAY62768913	MCS-01WR_SPRINT 90Vac~264Vac 4.75Vdc~5.25Vdc (At the end of USB Socket) 1.2A 50/60Hz UL WALL 2P USB - SUNLIN ELECTRONICS CO.,LTD	
2	AFN053800	Manual Assembly Operation	AFN76392601	LGLS740.ABMUBL BK:BLACK BLACK -	
3	MBM062600	Card,Quick Reference	MBM64315901	PRINTING LGLS740.ABMUBL ZZ:Without Color Start Guide for LGLS740.BMU	
3	MBM062601	Card,Quick Reference	MBM64316001	PRINTING LGLS740.ABMUBL ZZ:Without Color IIB for LGLS740.BMU	
2	EAC00	Rechargeable Battery Lithium Ion	EAC62238406	BL-64SH_SP_LGC_UP 3.8V 2.92AH 580mAh 65.0*48.5*6.4 68.0*48.5*6.7Max ARCELIK GRAY Top cap Bar type - LG CHEM LTD.	Y,67
2	MFL053800	Manual,Operation	MFL68220501	PRINTING LGLS740.ABMUBL BK:Black United States ENGLISH+ SPANISH WEB UG for LGLS740.BMU	
2	EBX000000	Accessory	EBX61849501	SIMGLT207R SIMGLT207R REMOVABLE 3FF USIM Gemalto, Inc.	