


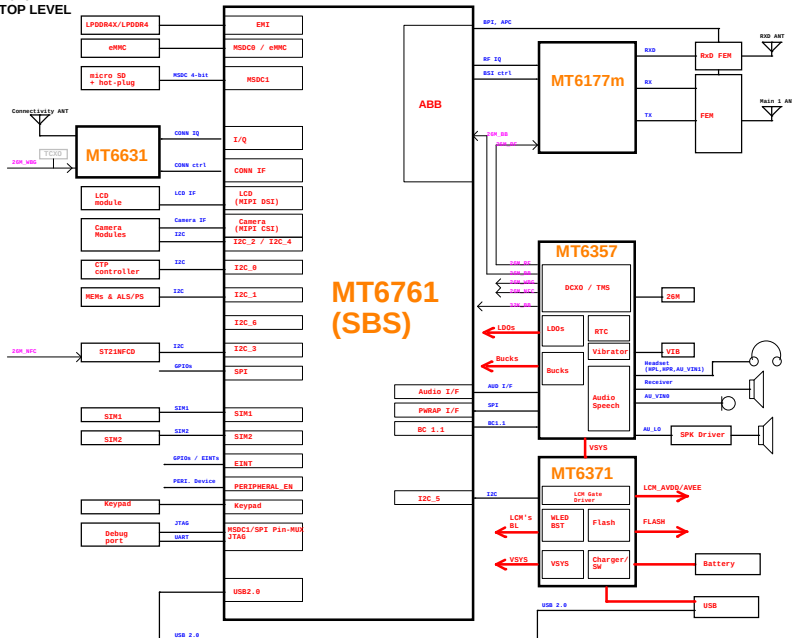

修改记录

修改记录
PO基础上

1. 闪光灯驱动IC由原来的OCP-OC98131AVAD 换成又为的AM6341EDMR
2. 大脚电感L210、电容C240
3. 将电容C201由原来的0201-2.2UF换成0402-10uF
4. 增加电容C202-0201-1uF, 增加电阻R211、R201[100K-0201], 增加电阻R208 (6603-0.5R-1%)
5. 将电阻R202由原来的90.9K换成49.9K, 将电阻R203由原来的13K换成0.5R
6. 删除电阻R611、R612 - - - - -20220324

PO-2 基础

- 1、由于ID调整，OVP后端两个0欧姆电阻删除R1611、R1612(0603封装)

PO.1 修改

- 1、21页，QVGA IIC预留level shift，IIC通路增加R2194/R2193 OR电阻

2. 删除C21


- P1 修改内容 20220509
1. 21页, 删除电平转换芯片LQ110及其周边电路, 删除R2195~R2199、C2189、C2187。
 2. 21页删除器件IC4及其电路, 去掉电阻R2193、R2194

2. 增加列试点

4. 更换60-PIN连接器J2601, 换成M355上的

1. 8279. 8411


2. 耳机参考地串接1.0K电阻R720

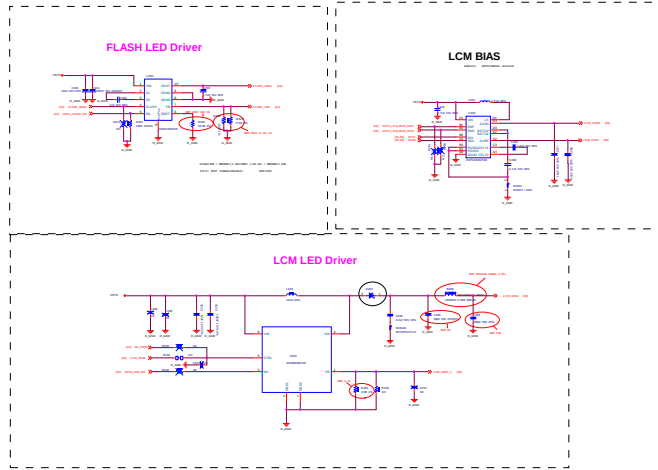


ETA6953:address: D6H BQ25601:address: 6BH

[illegible]

03 Power Charger	
Size	MTK Confidential
c	
Date:	Friday, September 08, 2023
Sheet:	3 of 37

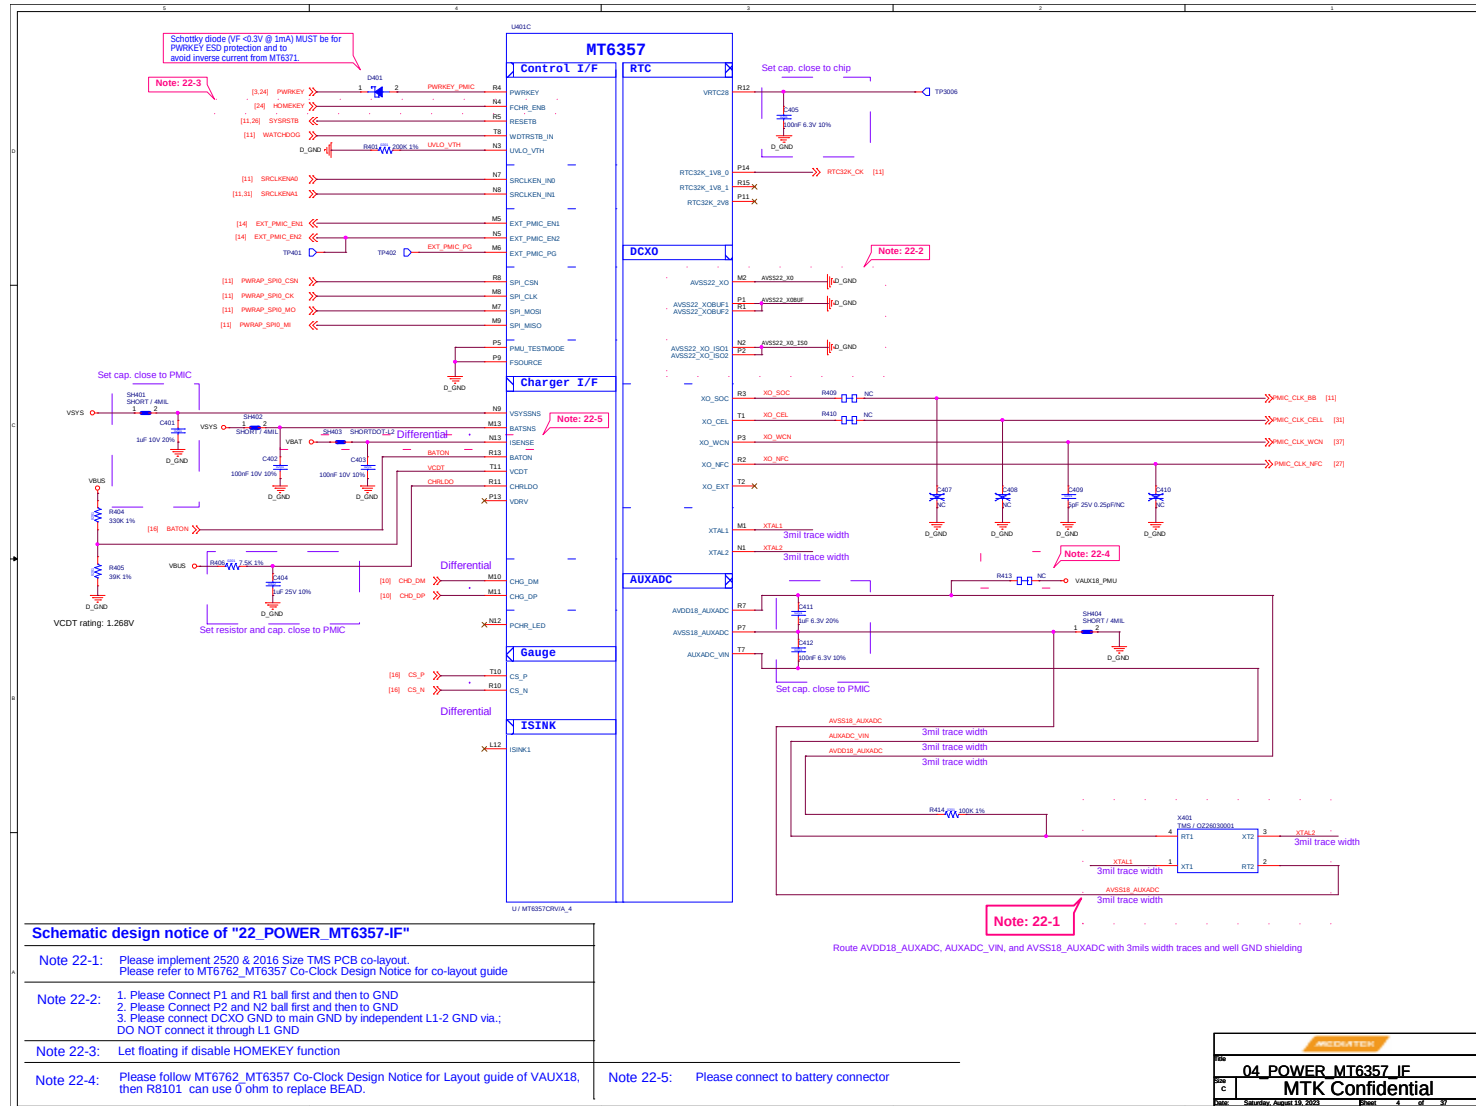

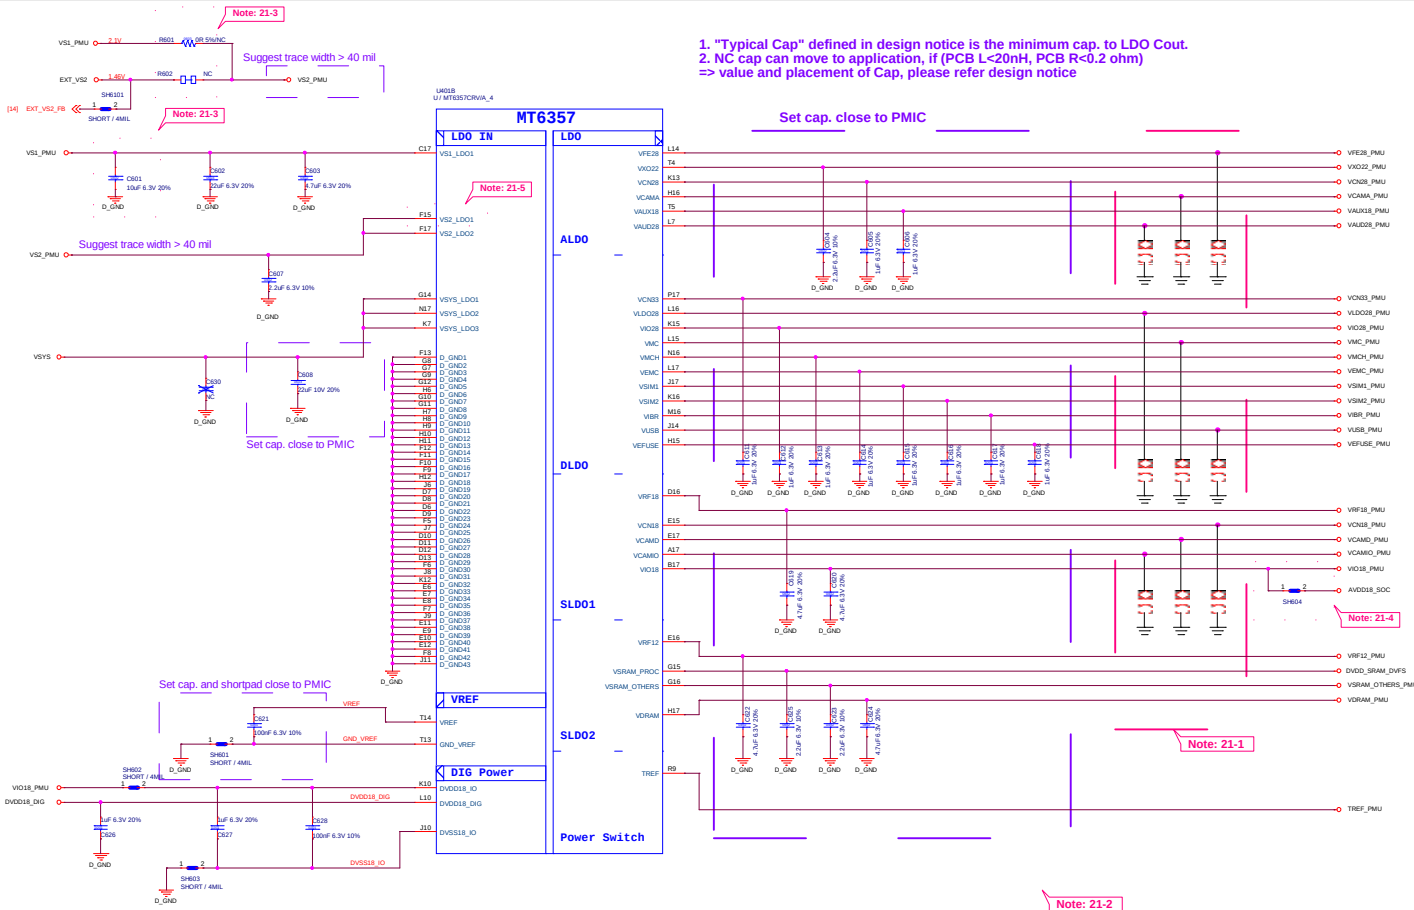

Schematic design notice of "21_POWER_MT6357_LDO"

Note 21-1: If these power trace can meet LDO layout constraint, these CAP can be NC or removed. Please refer to MT6357 design notice.

Note 21-2: Output cap range please follow MT6357CRV LDO design notice


Note 21-3: Ext Buck BOM option

	Ext. buck option
C801	w/ EXT VS2 Buck
C802	10uF(0402)
R601	0-ohm_0603
R602	NC
	N-EXT VS2 Buck
	22uF(0603)
	NC
	0-ohm_0603




Note 21-4: Please set SH2101 close to C2141, making star connection between VIO18_PMU and AVDD18_SOC near to LDO cap. C2141 Please also refer to MT6357 design notice for further detail design information

Note 21-5: Please connect VS2_LDO1(F15) to VS1_PMU if voltage applied to VCAMD(E17) > 1.3 V

06_POWER_MT6357_LDO	
MTK Confidential	
Ver	Version: October 24, 2019
Rev	Rev: 6 of 31

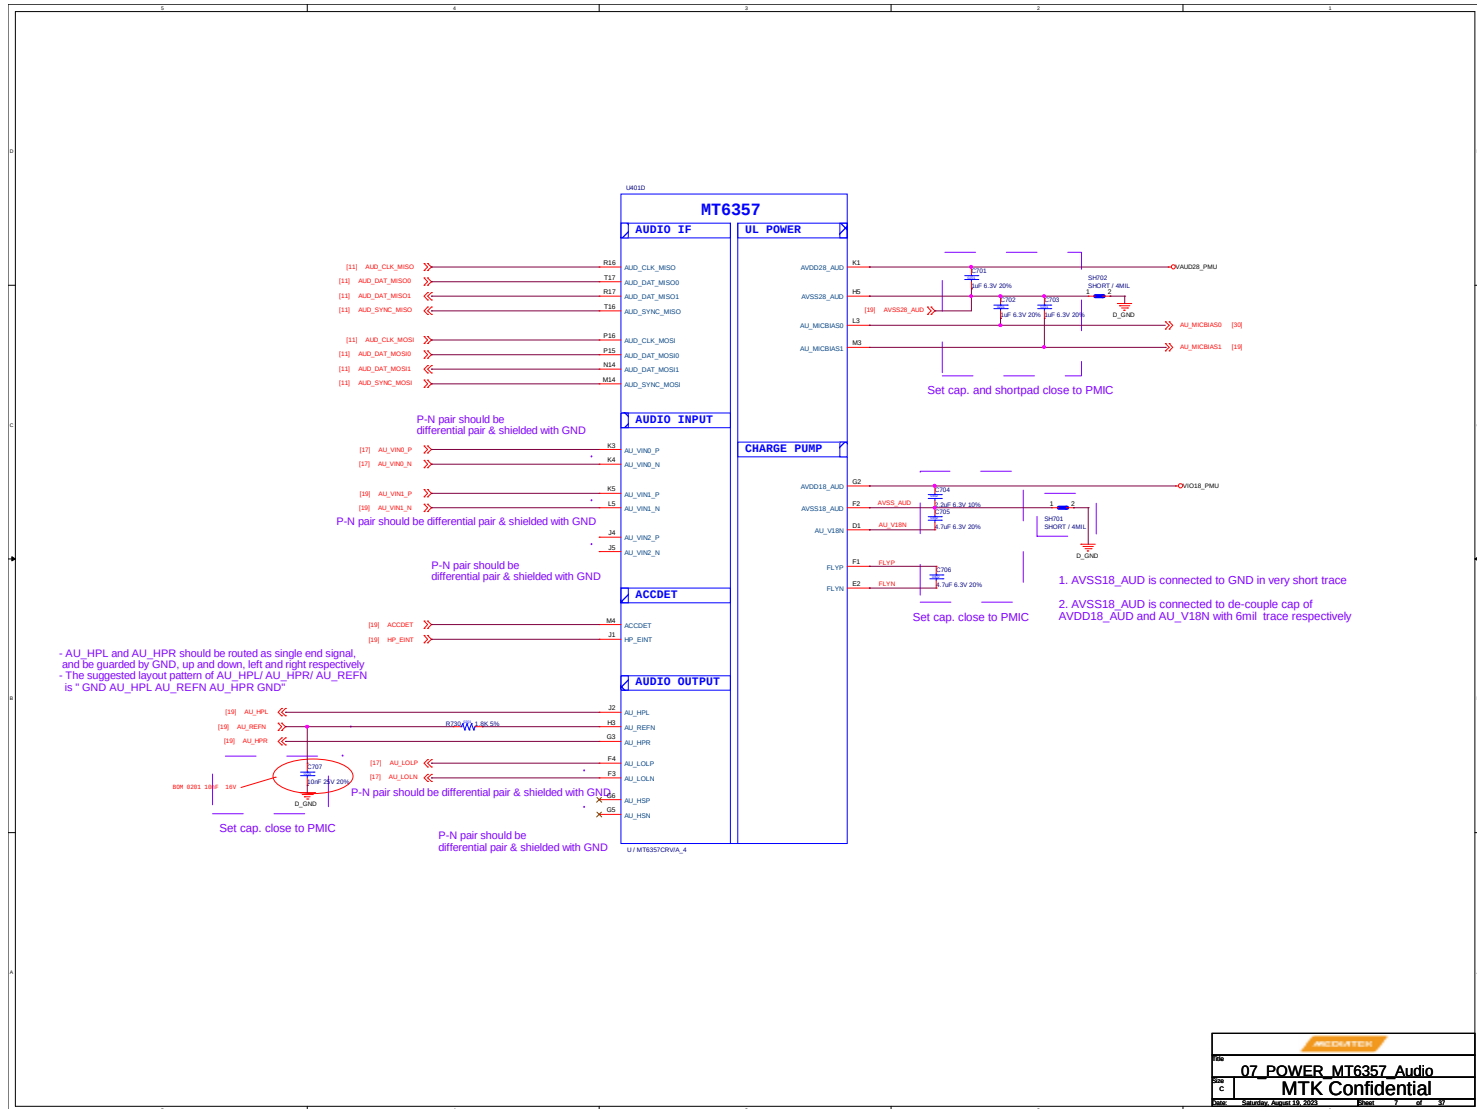

REVISION	
File	07_POWER_MT6357_Audio
Doc	MTK Confidential
Date	Saturday, August 13, 2010
Page	7 of 31

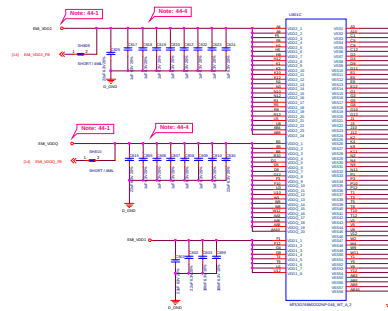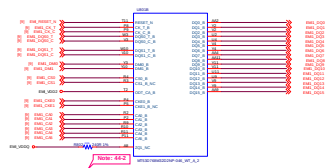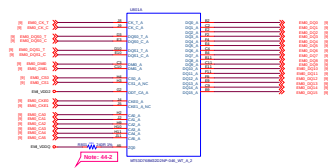

Schematic design notice of "44_Memory_eMMC_LPDDR4X_LPDDR4"

Note 44-1: Please refer to power supply related page select output voltage properly for LP4VLP4

Note 44-2: DRAM ZQx resistor = 240ohm (1%) that must be connected to VDDQ.


Note 44-3: Please refer to eMCP vendor's datasheet or MTK common design notice to get the recommendation bypass cap. value for VCC/VCCQ/VDDI power domains of eMMC.

Note 44-4: VDDQ VDDQ decoupling cap. closed to DRAM ball.
For other cap for PMIC >10uF, at PMIC page, please also refer to MMD and layout guide for placement.

Note 44-5:

DRAM type	LPDDR4	LPDDR4X
RS10, RS11	Mount	NC
U4000	LPDDR4+eMCP	LPDDR4X+eMCP
U4210	Mount	NC
U2802/PL2802	NC	Mount
U2811/C2812		

Note 44-6: R4437/R4438 could be replaced with 0-ohm / 0402 * 3 for LP4 DRAM

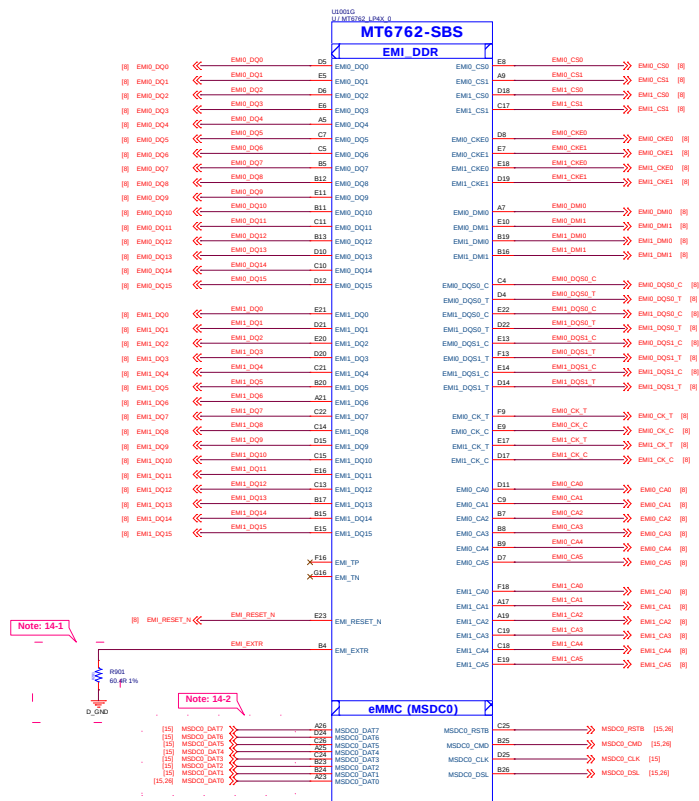

Schematic design notice of "14_BB_3" page.





Note 14-1: R4001 please select 60.4 ohm (1%) resistor

Note 14-2: Please check eMCP LP3 and eMCP LP4X/LP4 pin mux

NOTIFICATION	
File	09_MT6761_BB_EBI
Sub	MTK Confidential
Date	Saturday, August 13, 2021 12:00 PM



Note 12-5: Please set unused IQ pins in NC

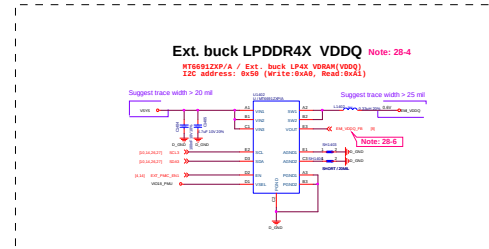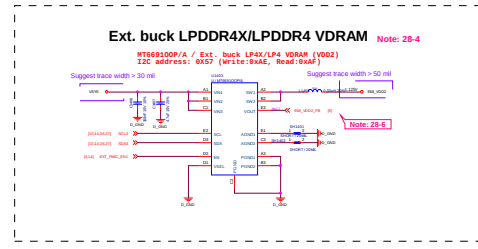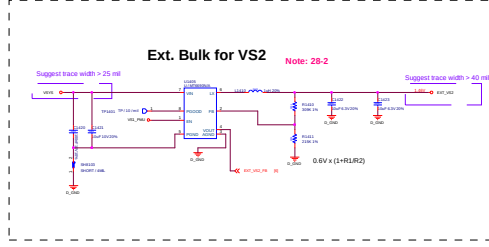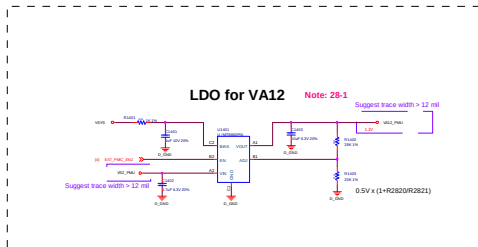

Schematic design notice of "28_POWER_ThirdParty-Power"

Note 28-1: VA12 Layout placement please close to AP


Note 28-2: VS2 Buck Layout placement please close to PMIC MT6357

Note 28-3: VDD1 LDO Layout placement please close to MT6631


Note 28-4: 1.MT6631/OPPIA Buck Layout Placement please close to LP4X/LP4
2.MT6631/OPPIA Buck Layout Placement please close to LP4X
3.If DRAM Application is LPDDR4, MT6631/OPPIA IC

Note 28-5: U2810 LDO Layout Placement Please close to LPDDR4X/LPDDR4 VDD1 power ball


Note 28-6: For EMI_VDD2_FB and EMI_VDDQ_FB, please follow MMD rule

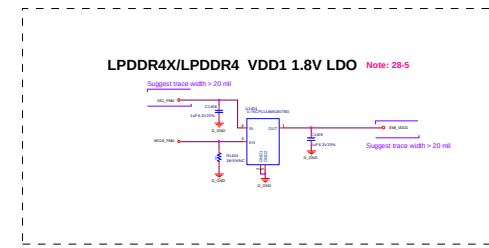


Battery Connector


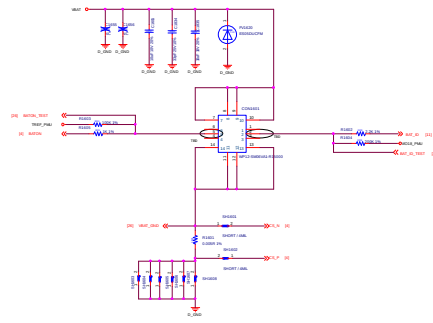


OVP




PD IC



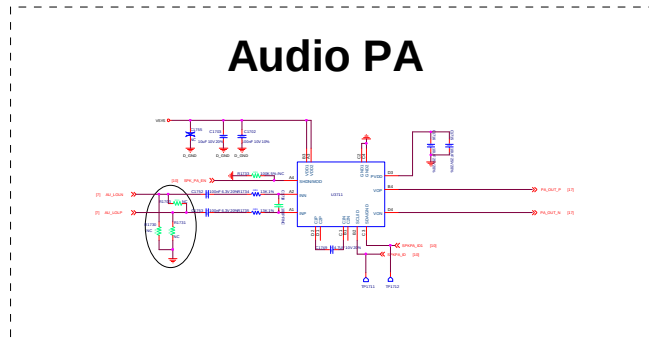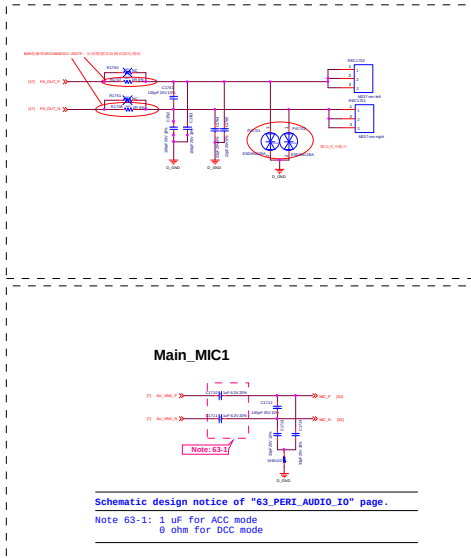


Earphone Audio

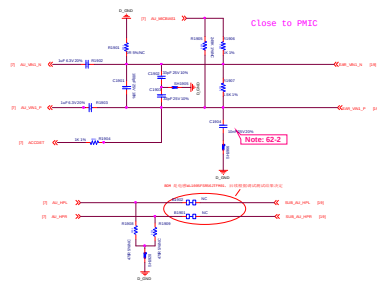

Note 62-2: Reserved Cap for CS/RS test, please double check multi-key function when used

3.5mm Headphone Jack

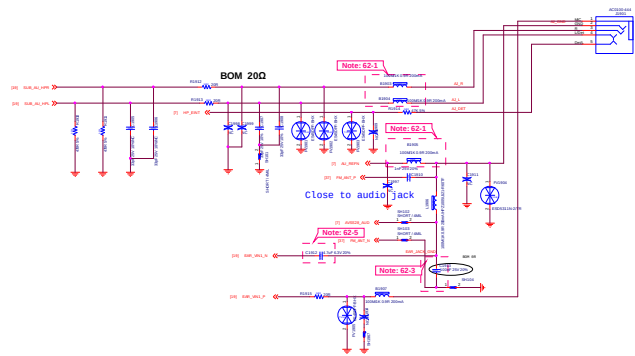

Schematic design notice of "62_PERI_AUDIO_IO" page.

Note 62-1: Part # of BEAD6202, BEAD6203, BEAD6204 and BEAD6205 needs changed to "BLK18801025N1" for high THD performance (-90dB) but this BOM change will results in FM RSSI 100B degraded.

Note 62-2: Reserved Cap for CS/RS test, please double check multi-key function when used

Note 62-3:

Component	Value	Component	Value
C6231	100nF	C6232	100nF

Note 62-4: 1. Please Select ACC Mode for Operator Project to Pass Electrical MOS Test;
More Information refer to Audio/Speech Design Notice;

2. Need do SW configuration for ACC or OCC mode


3. Analog input impedance is at below, please customer check the detail requirement with mic vendor if the mic used has special requirement on the input impedance of analog input

Parameter	Value	Unit	Min	Max	Typ
Z _{in}	400	Ω	-	-	400
Z _{in}	800	Ω	-	-	800

Note 62-5: Please select C6231 with 0402 size


Part Name	Value	Unit
C6231	100nF	Ω
C6232	100nF	Ω
C6233	100nF	Ω
C6234	100nF	Ω
C6235	100nF	Ω
C6236	100nF	Ω
C6237	100nF	Ω
C6238	100nF	Ω
C6239	100nF	Ω
C6240	100nF	Ω

Main LCM

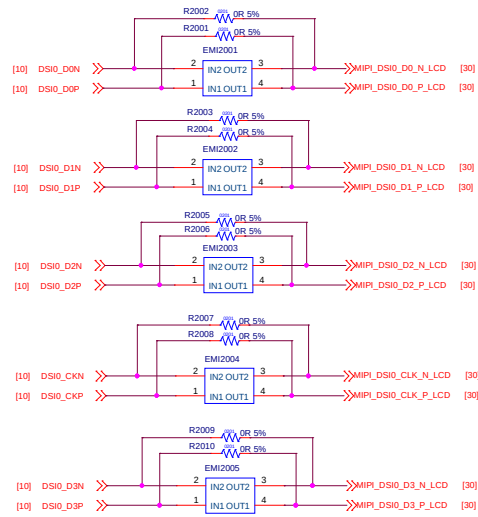


MEDITEK	
Title	20_LCD IF
Size	MTK Confidential
Date:	Friday, October 27, 2023
Sheet	20 of 37


Main Camera

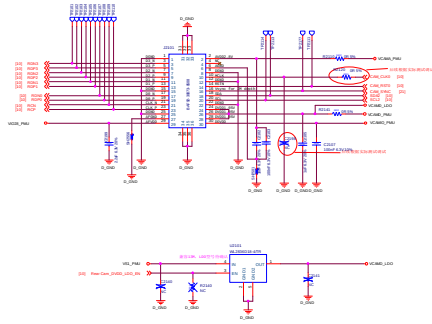


Front Camera

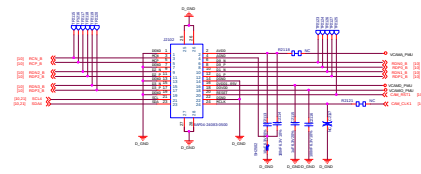


Macro Camera 2M

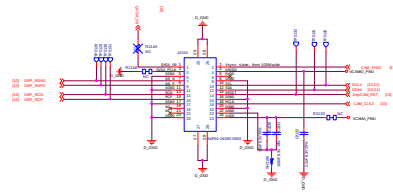


Main Flash LED

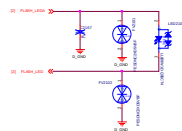


M SENSOR




G-Sensor

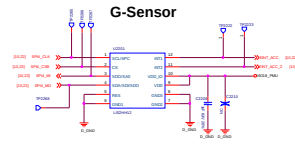

G-sensor

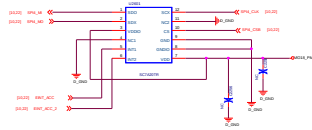

FP-Sensor

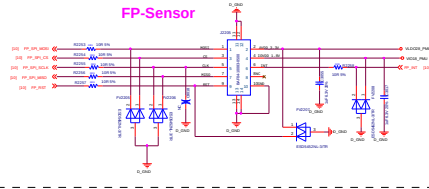

Schematic design notice of "77_PERI_SENSORS_MEMS_ALSIPS" page.

Note 77-1: [M sensor] Keep a minimum distance of 15mm from power ICs / PCB traces of more than 100mA / magnet component. Check HW design notice for more detail

Note 77-2: [A+G] For optimized GPS performance, please check HW design notice for Sensor selection guide

Note 77-3: [A+G] MUST use SPI for optimized sensor hub performance **DO NOT USE I2C**


Note 77-4: [A+G] Suggest choose sensor support **FIFO watermark interrupt** otherwise we cannot support H8-sensor, daydream VR. And Sensor-location accuracy will become worse.

Note 77-5: [Baro] Reserve Baro sensor for LPPE feature (Must for North America Operator / NA SKU)


Note 77-6: **DO NOT share Sensor hub I2C to other non-SCP device**

Note 77-7: Interrupt pin of MEMS sensor must be assign to ball EINT[12:0]


SD CARD

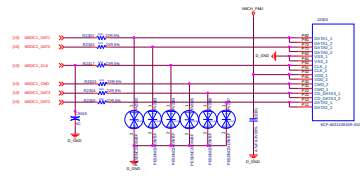


SIM1 PCB靠板边



Detect




SIM2 PCB靠板内



Power Key / Key Pad

DO NOT put pull-up resistor on PWRKEY

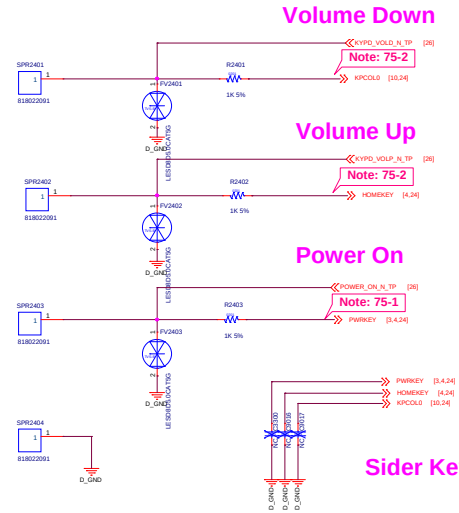

Schematic design notice of "65_PERI_Dual_SIM_ICUSB_KEYPAD" page.


Note 75-1: DO NOT put pull-up resistor on PWRKEY

Note 75-2: Volume Up : HOME Key / GND
Volume Down / FORCED_USB_BOOT : KPCOL0/ GND


Note 75-3: For better ESD performance, please select suitable components for system protection.

DECLARATION	
File	24_Sidekey
Doc	MTK Confidential
Date	Saturday, August 13, 2010 12:00 PM 24 of 31

Battery Test pin



KYPD_VOLD_N_TP Factory test point




VBUS Test pin



Reserved for fast META mode detection



Debug test point



RAMDUMP debug key




eMMC



IIC





HW_ID

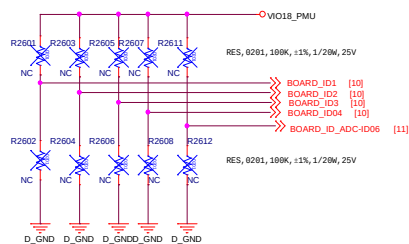

MEDITEK	
Title	26_Test Point Board ID
Size	MTK Confidential
Date	Saturday, August 19, 2023
Sheet	26 of 37

Shielding frame

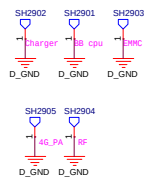

Marks point

[illegible]