




iREPAIR

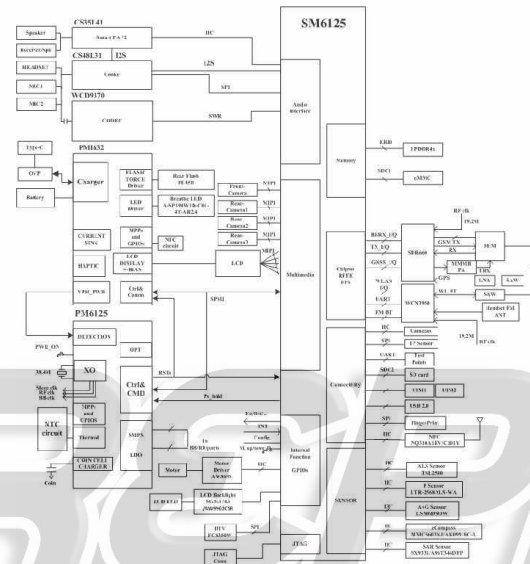

Company Header		
Block Title I2C Configuration Table		
Project	Taller	Rev 1.0
Date	Monday, June 24, 2019	8:00am 8 of 46


Sheet	Content	Sheet	Content
01.	Block Diagram	24.	AUDIO_MIC_RCV_SPK
02.	I2C Configuration Table	25.	AUDIO_HEADSET
03.	Table of Content	26.	SENSORS_MOTOR
04.	GPIO MAP	27.	LCD_TP
05.	SM6125 Control/UFS/SDC1/SDC2	28.	REAR_CAM/FLASH
06.	SM6125 LPDDR4	29.	FRONT_CAM/CAM_POWER
07.	SM6125 CSI/DSI	30.	SIM_SD_KEY_LINK_BATT
08.	SM6125 GPIO (Internal Codec)	31.	DTV
09.	SM6125 Power (Core)	32.	NFC
10.	SM6125 Power (Other, LP4X)	33.	PRIMARY_ANTENNA
11.	SM6125 Ground	34.	PA & PA_THERMAL
12.	PM6125 CLKs/Control_GND	35.	TRX_LB
13.	PM6125 Buck Converter1	36.	TRX_MHB
14.	PM6125 Buck Converter2	37.	DIVERSITY_ANT
15.	PM6125 LDO	38.	DRX_MB_HB
16.	PM8008 and Bob	39.	DRX_LB
17.	SIM_SD	40.	SDR660_MSS
18.	PMI632 Control/Display/GPIO	41.	SDR660_PWR
19.	PM660L Display	42.	SDR660_DA/PRX/DRX/FBRX
20.	eMCP	43.	QFE410I
21.	30W CHARGE	44.	WIFI_2.4G_5G & BT
22.	AOV	45.	GPS
23.	Test Points	46.	WCN3980



SM6125 GPIO Configuration


GPIO_1	DSP_CLK	GPIO_8	WLED_CABC_PM
GPIO_2	NC	GPIO_9	BOOST_BYP_MODE_CTL
GPIO_3	CPU_THERM		
GPIO_4	BOOST_BYP_MODE_CTL_R		
GPIO_5	KEY_VOL_UP		
GPIO_6	NC		
GPIO_7	NC		

GPIO_1	NC	GPIO_8	NC
GPIO_2	BL_ISET_CONTR		
GPIO_3	PMI632_THERM		
GPIO_4	MOTOR_RSTN		
GPIO_5	NC		
GPIO_6	LCD_BL_EN		
GPIO_7	NC		

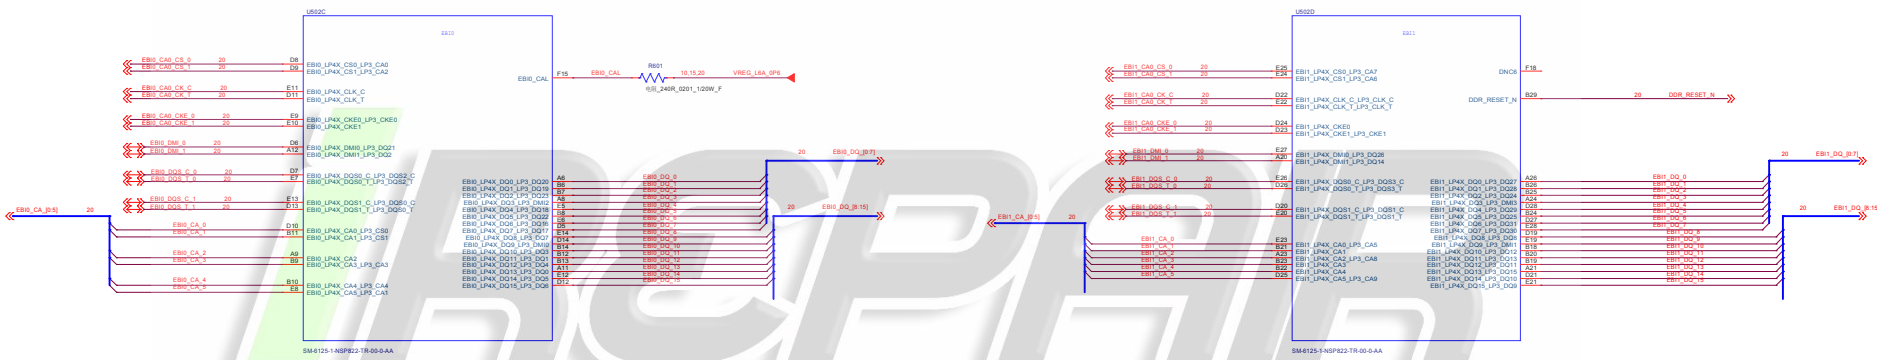

Company Hsien		
Stock Title SM6125 LPDDR4		
Project	Taller	Rev 1.0
Date: Monday, June 24, 2019 10:06 AM		




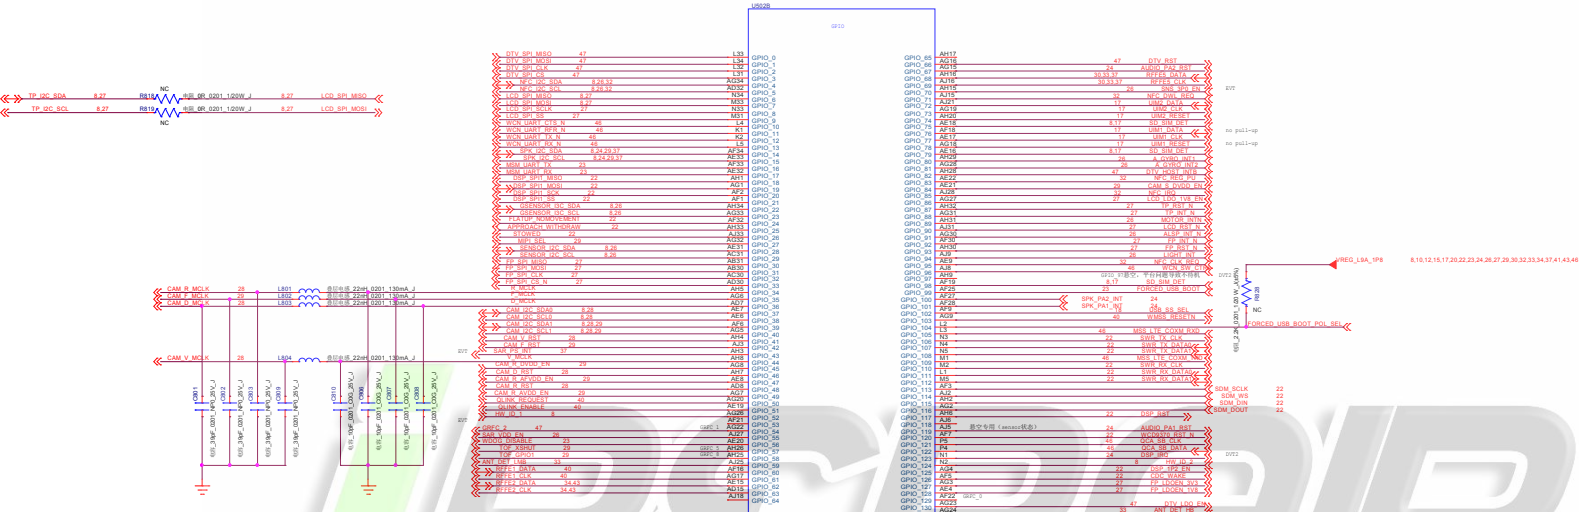


GPIO_58	BOOT_CONFIG(0)	WD0G_DISABLE
GPIO_87	BOOT_CONFIG(1)	FASTBOOT_SEL(0)
GPIO_32	BOOT_CONFIG(2)	FASTBOOT_SEL(1)
GPIO_118	BOOT_CONFIG(3)	FASTBOOT_SEL(2)
GPIO_99	FORCED_USB_D00T	
GPIO_104	FORCED_USB_BOOT_POL_SEL	


BOOT OPTIONS		ROOT CONFIG BITS		
0: Default(eMMC->SD->USB(EDL))		0	0	0
1: SD->eMMC->USB(EDL)		0	0	1
2: SD->USB(EDL)		0	1	0
3: USB(EDL)		0	1	1
4: UFS->SD->USB(EDL)		1	0	0
5: SD->UFS->IR(RFBI)		1	0	1
6: UFS->USB(EDL)		1	1	0
7: UFS, FWM MODE->USB(EDL)		1	1	1

I2C pull up


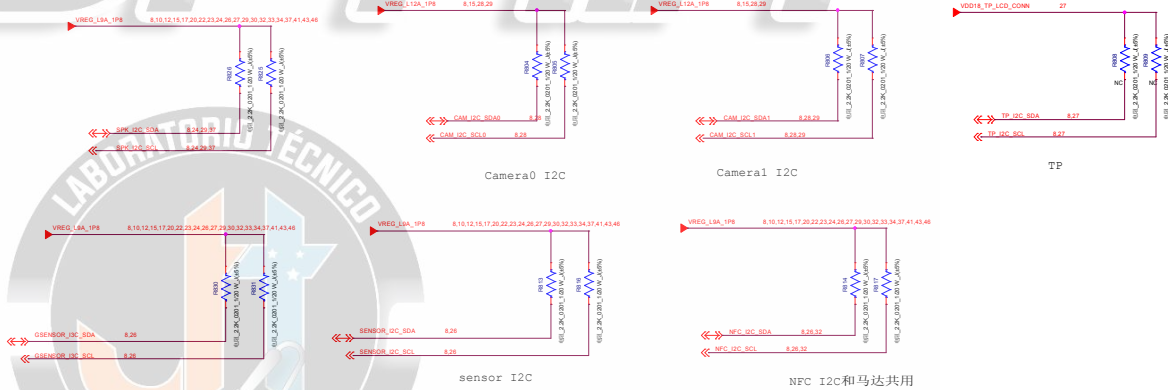



Hardware ID


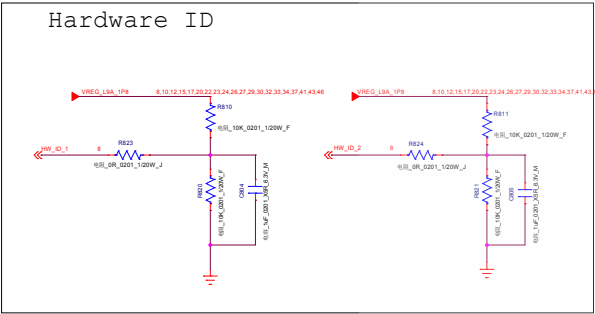


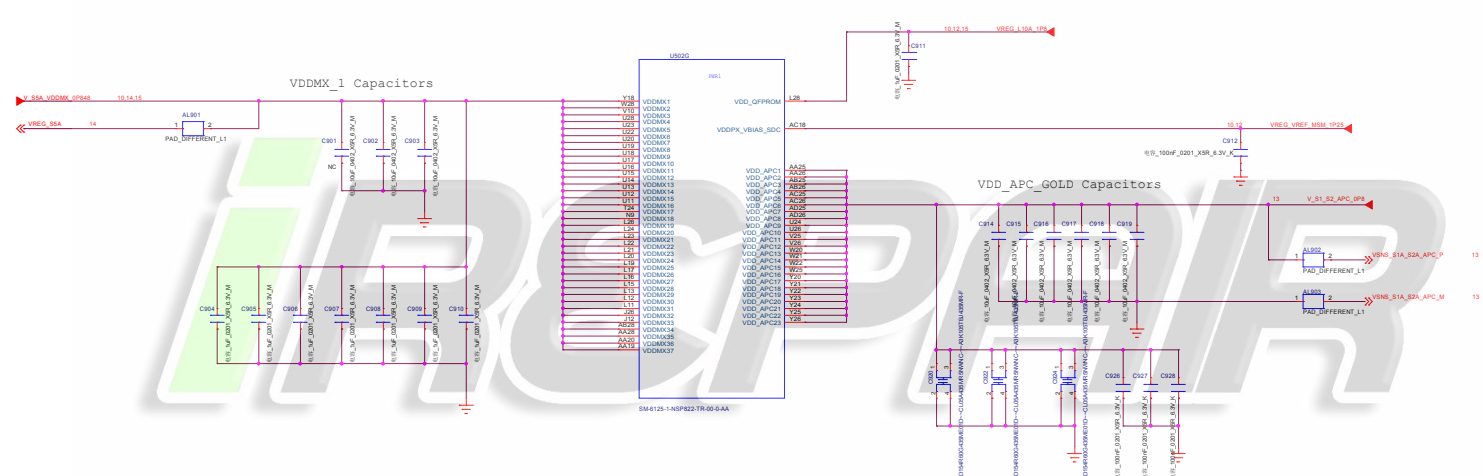

Company: Hualin		
Block Title: SDME30 Power (Core)		
Project	Teller	Rev: 1.0
Date:	Tuesday, June 23, 2019	Sheet: 9 of 46

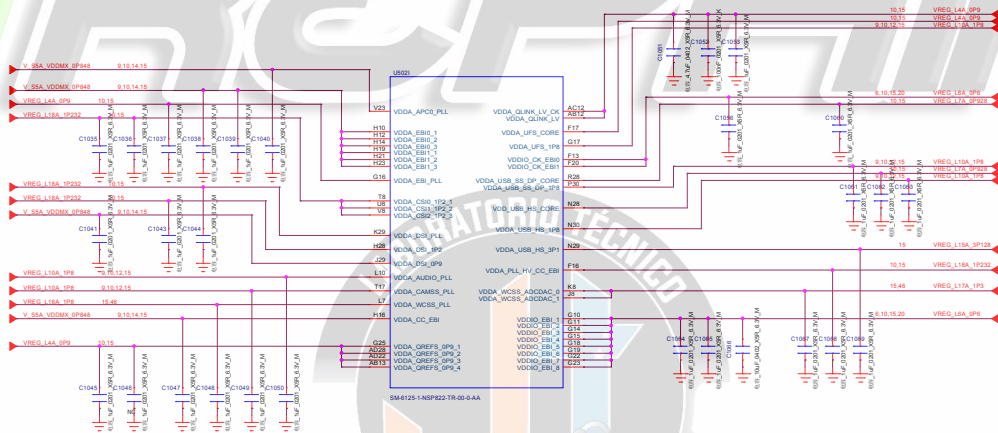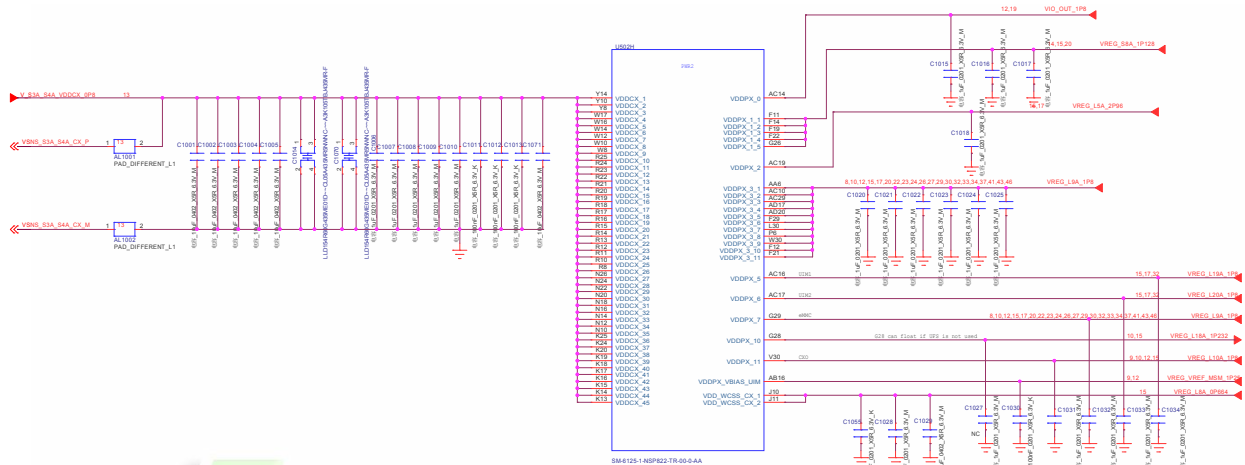

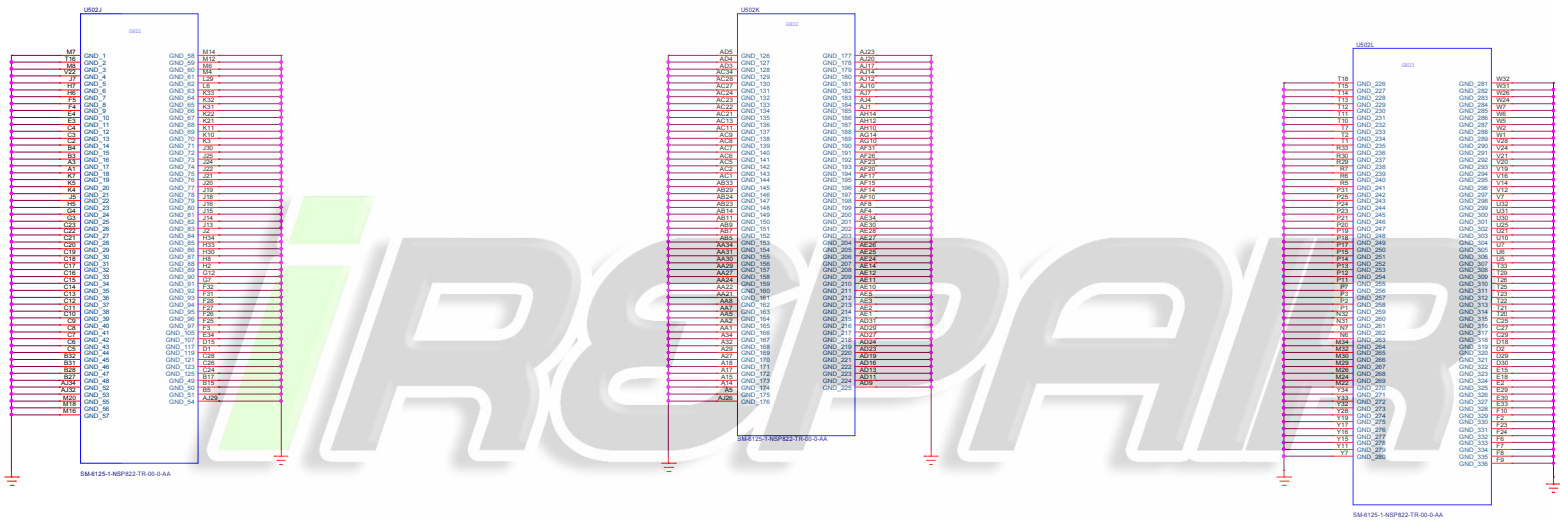

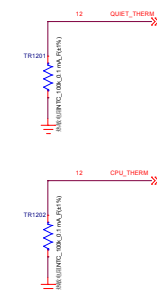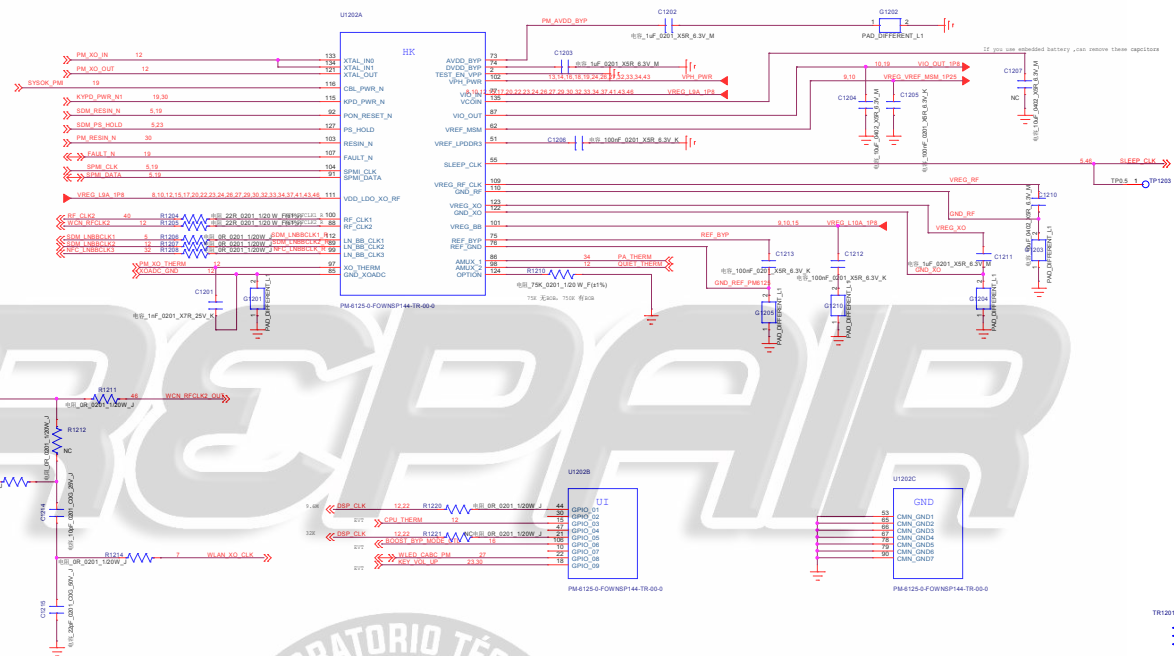


Option Pin Resistor Value	Configuration
5.6k	No External Boost Bypass, SD Card Boot, LPDDR3
22k	No External Boost Bypass, SD Card Boot, LPDDR4x
47k	No External Boost Bypass, No SD Card Boot, LPDDR3
75k	No External Boost Bypass, No SD Card Boot, LPDDR4x
130k	External Boost Bypass, SD Card Boot, LPDDR3
240k	External Boost Bypass, SD Card Boot, LPDDR4x
330k	External Boost Bypass, No SD Card Boot, LPDDR3
750k	External Boost Bypass, No SD Card Boot, LPDDR4x


Note: SD Card Boot implies the voltages for SD card will be enabled during Power On sequence.
No SD Card Boot implies the voltages for SD card will be disabled during Power On sequence.

Chosen Pin Resistor Value	Configuration
5.6K	No External Boost Bypass: No SD Card Boot, LPDDR3
22K	No External Boost Bypass: No SD Card Boot, LPDDR4x
47K	External Boost Bypass: No SD Card Boot, LPDDR4x
75K	No External Boost Bypass: No SD Card Boot, LPDDR4x
139K	External Boost Bypass: No SD Card Boot, LPDDR4x
241K	External Boost Bypass: SD Card Boot, LPDDR3
475K	External Boost Bypass: SD Card Boot, LPDDR4x
330K	External Boost Bypass: No SD Card Boot, LPDDR3
750K	External Boost Bypass: No SD Card Boot, LPDDR4x

Note: SD Card Boot implies the voltages for SD card will be enabled during Power On sequence
No SD Card Boot implies the voltages for SD card will be disabled during Power On sequence

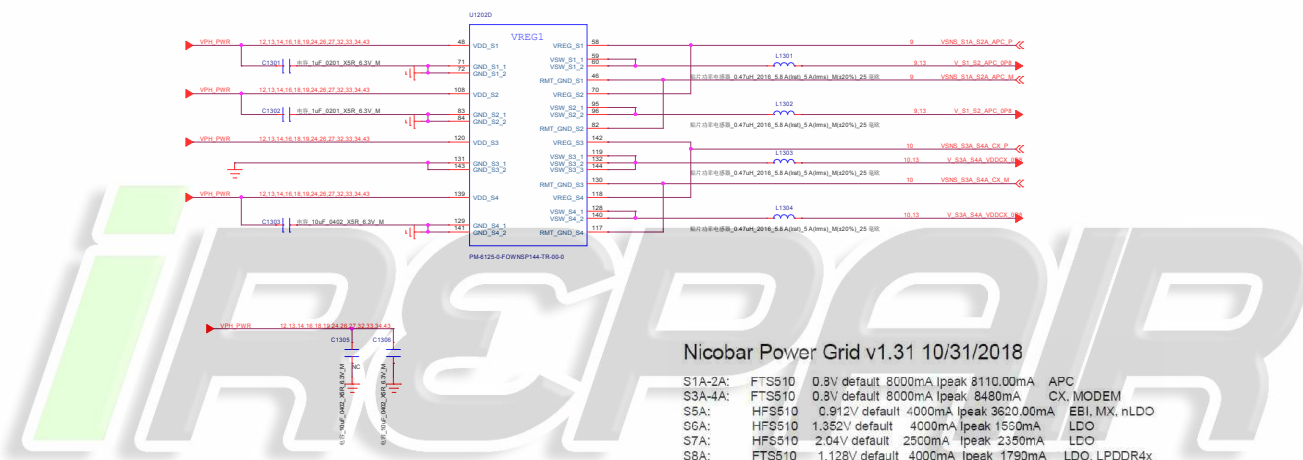


Company Name			
Stock Title			
Project			
Date			

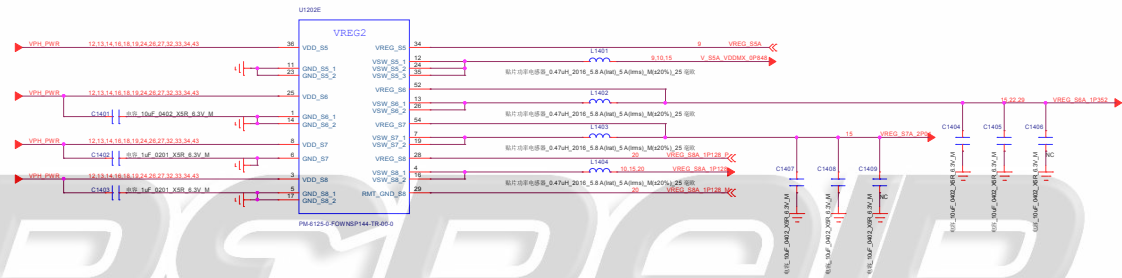

iREPAIR



Company Hsien		
Block Title PM6125 LDO Circuits		
Project	Taller	Rev 1.0
Date	Monday, June 26, 2018	Sheet 13 of 48

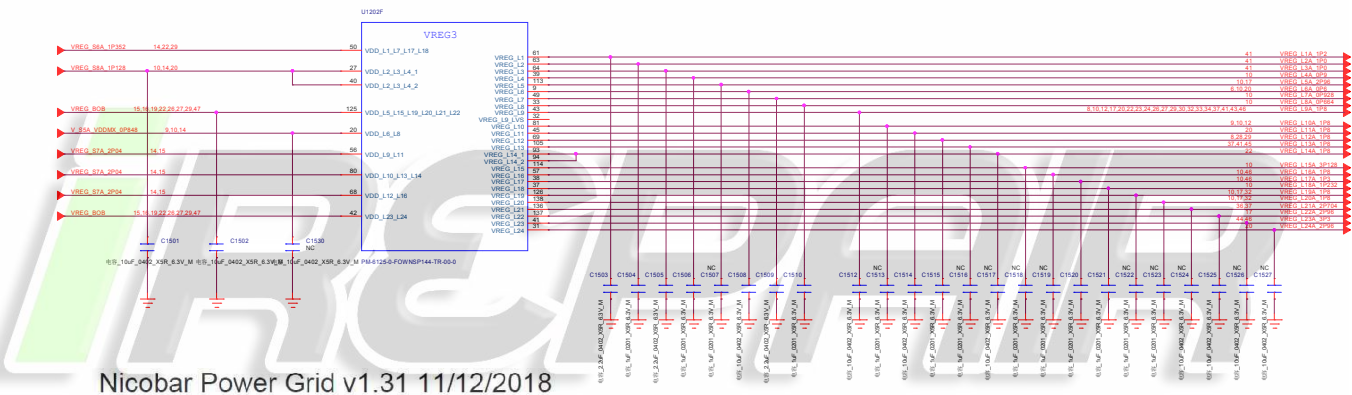

Nicobar Power Grid v1.31 11/12/2018

- LDO Type Source V_default (est) Target Pin#
- L1 N600 S6A 1.2V (625) QLN_SDR 1.2 61
 - L2 N300 S8A 1V (320) SDR_VDD 1.0V 63
 - L3 N600 S8A 1V (370) SDR_VDD 1.0V 64
 - L4 N300 S8A 0.923V (126) QLINK_EBI, MIPI 30
 - L5 MVP50 VPH 2.06V (22) PX 113
 - L6 N120C S5A 0.324V (1040) VDDQ, CDI 9
 - L7 N600 S6A 0.323V (54.2) USB 49
 - L8 N300 S5A 0.564V (81) CX 33
 - L9 LVP600 STA 1.8V (754) Sensors, WCD, TMD, PMI_MSM, OET 43
 - L10 LVP150 STA 1.8V (100) QFPROM, USE_UFS, PX 81
 - L11 LVP600 STA 1.8V (625) EMMC_VDDQ 45
 - L12 LVP300 STA 1.8V (121) OV_USB_REDRIIVER 89
 - L13 VPI300 STA 1.8V (204) OPM 1.8V_RRRX GPS 105
 - L14 LVP600 STA 1.8V (650) WCD Buck 94,93
 - L15 MVP150 VPH 3.128V (5.28) USB 3.1V, DP PHY 114
 - L16 LVP150 STA 1.0V (62.5) WCSS, WCN_XO 50
 - L17 N30C S6A 1.304V (240) WCN_WCSS_AD_X DAC 38
 - L18 N30C S6A 1.232V (133) MIPI_VDDPX 37
 - L19 MVP150 VPH_BB 1.8V (60.2) Memory, SN100, PX 126
 - L20 MVP150 VPH_BB 1.8V (60.2) Memory, SN100, PX 138
 - L21 MVP300 VPH_BB 2.704V (0.88) QAT, DFE, RTC, QSW 133
 - L22 MVP300 VPH_BB 2.06V (800) MMC 137
 - L23 MVP300 VPH_BB 3.304V (591) WCN 3.3V 41
 - L24 MVP300 VPH_BB 2.96V (1170) EMMC 31

LDO L5/L9/L10/L11/L12/L13/L14/L15/L16/L19/L20/L21/L22/L23/L24 is the Pseudo-capless LDO, so can dri CAP in BOM

INCLUCDO CAPLESS LDOs


P-type are pseudo-capless, cap can be at load

For CAPLESS LDOs, if decoups on the load side do not add up to LDO spec, then install the cap close to the PMIC




Company Hsien		
Stock Title	PM660 Charger_FG	
Project	Taller	Rev 1.0
Date	Monday, June 26, 2018	Sheet 15 of 48





Company: Huijin		
Block Title PMSOL Control and Bob_Flash		
Project	Teller	Rev 1.0
Date: Tuesday, June 25, 2019	Sheet 16 of 46	

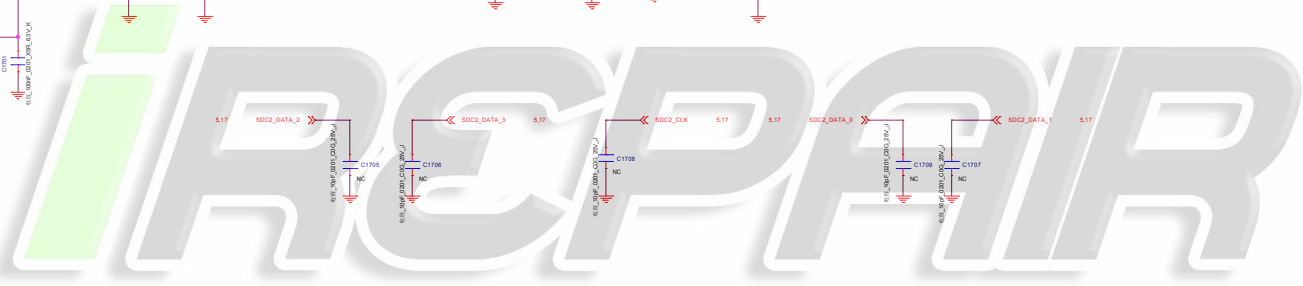


Company: Hsueh		
Block Title: PMSOL Buck and LDO		
Project	Teller	Rev: 1.0
Date:	Tuesday, June 25, 2019	Sheet 17 of 48

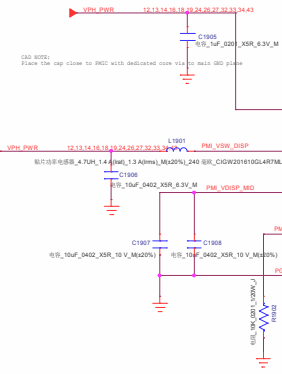

OPTIO	BIOS Configuration	IO Resistor
1	SPMC, uGDR	1K
2	12C, uGDR	22K
3	12C, TypeC	510K
	SPMC, TypeC	1K

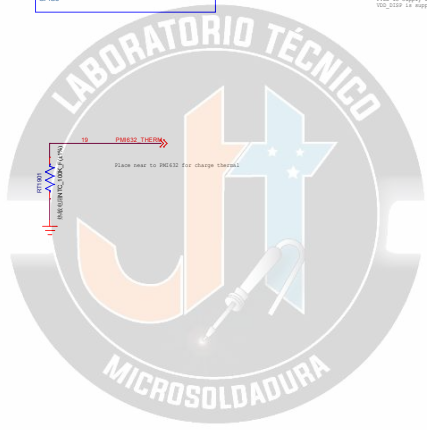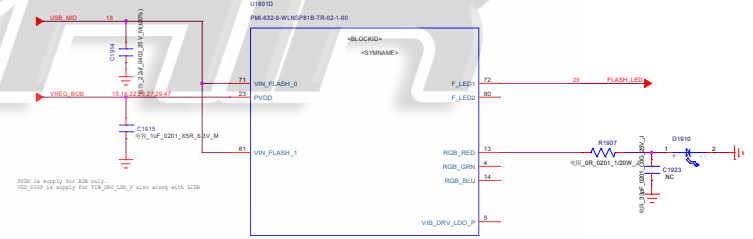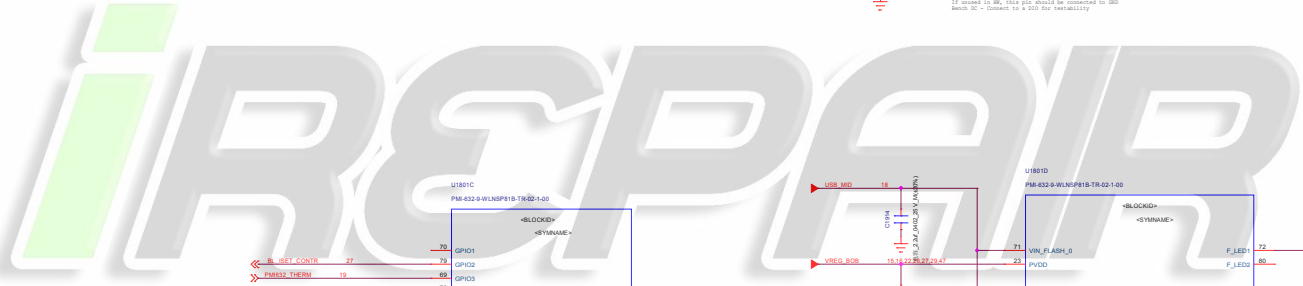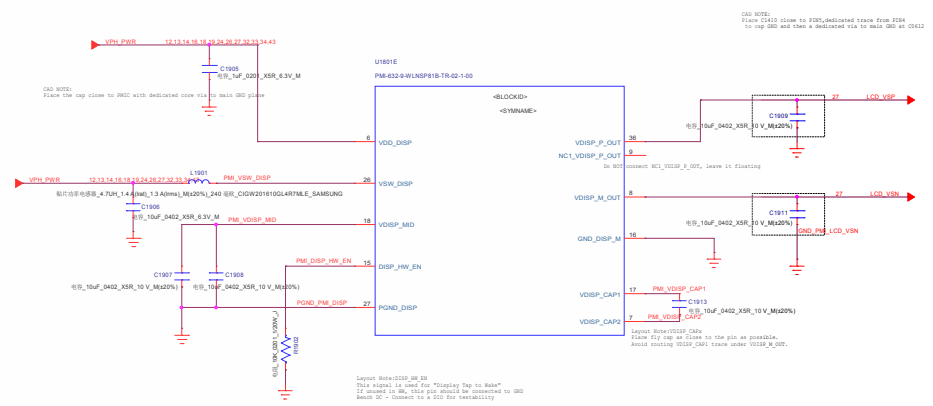


Company: Hualin		
Block Title PM650L Display		
Project	Teller	Rev 1.0
Date:	Tuesday, June 23, 2019	Sheet 19 of 46

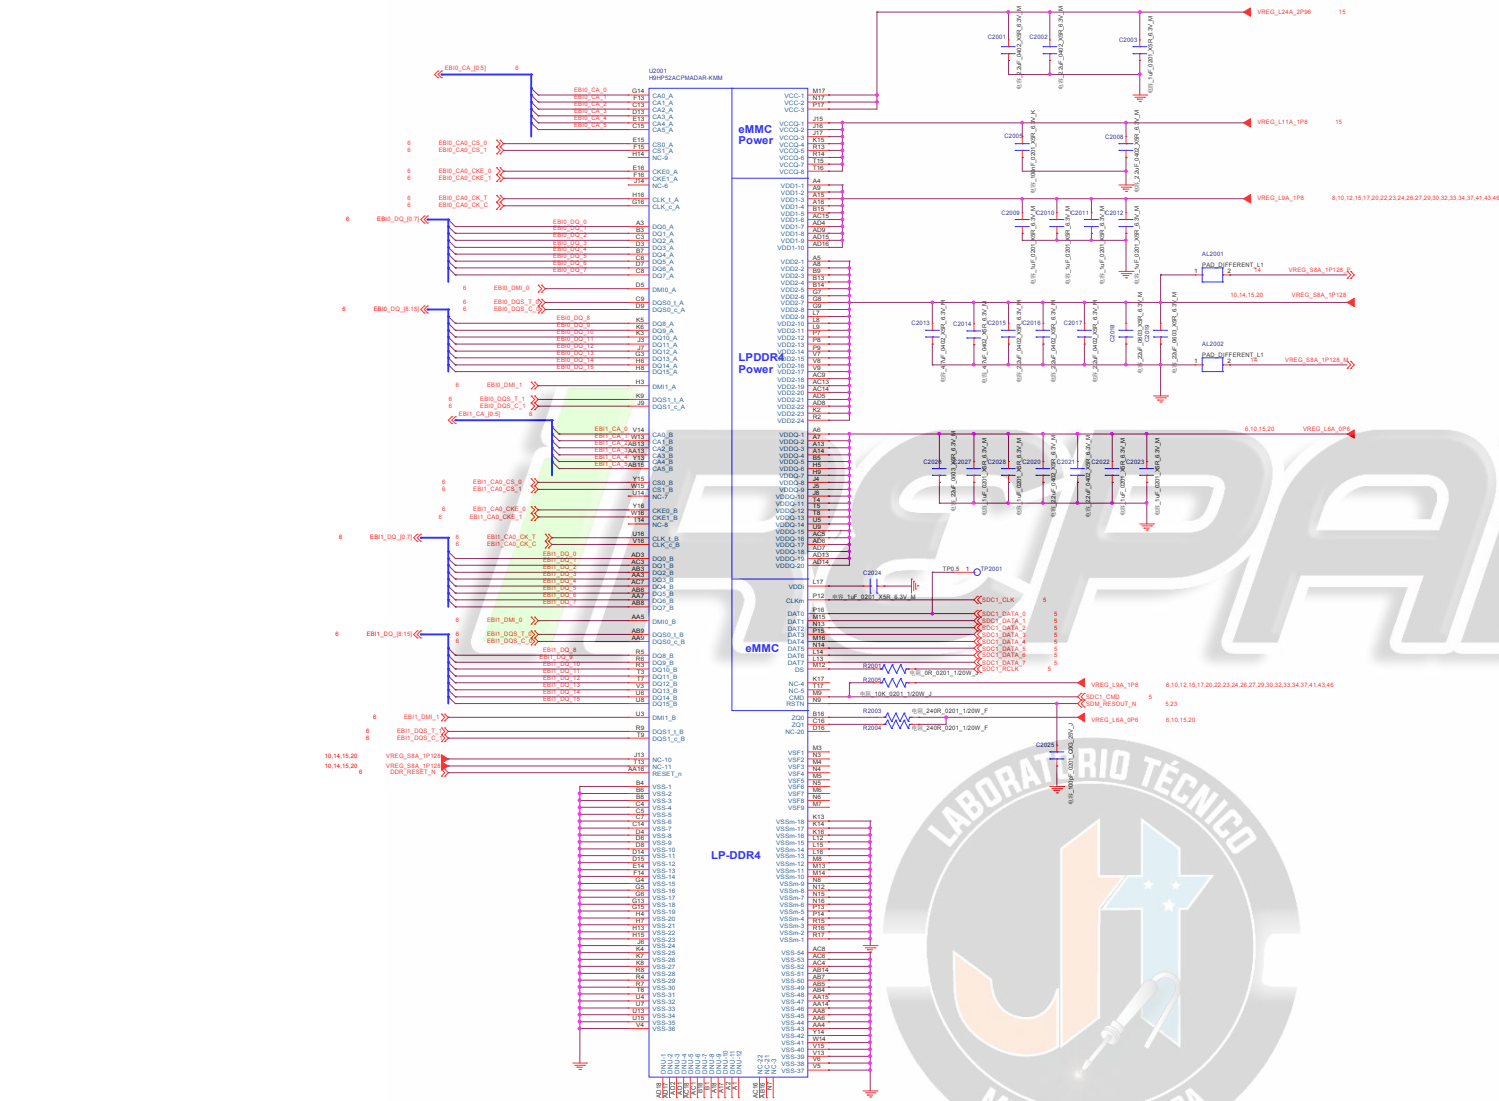

iREPAIR







Company Header			
Block Title		24W CHARGE	
Project	Taller	Rev	1.0
Date	Monday, June 24, 2019	Sheet	21 of 46



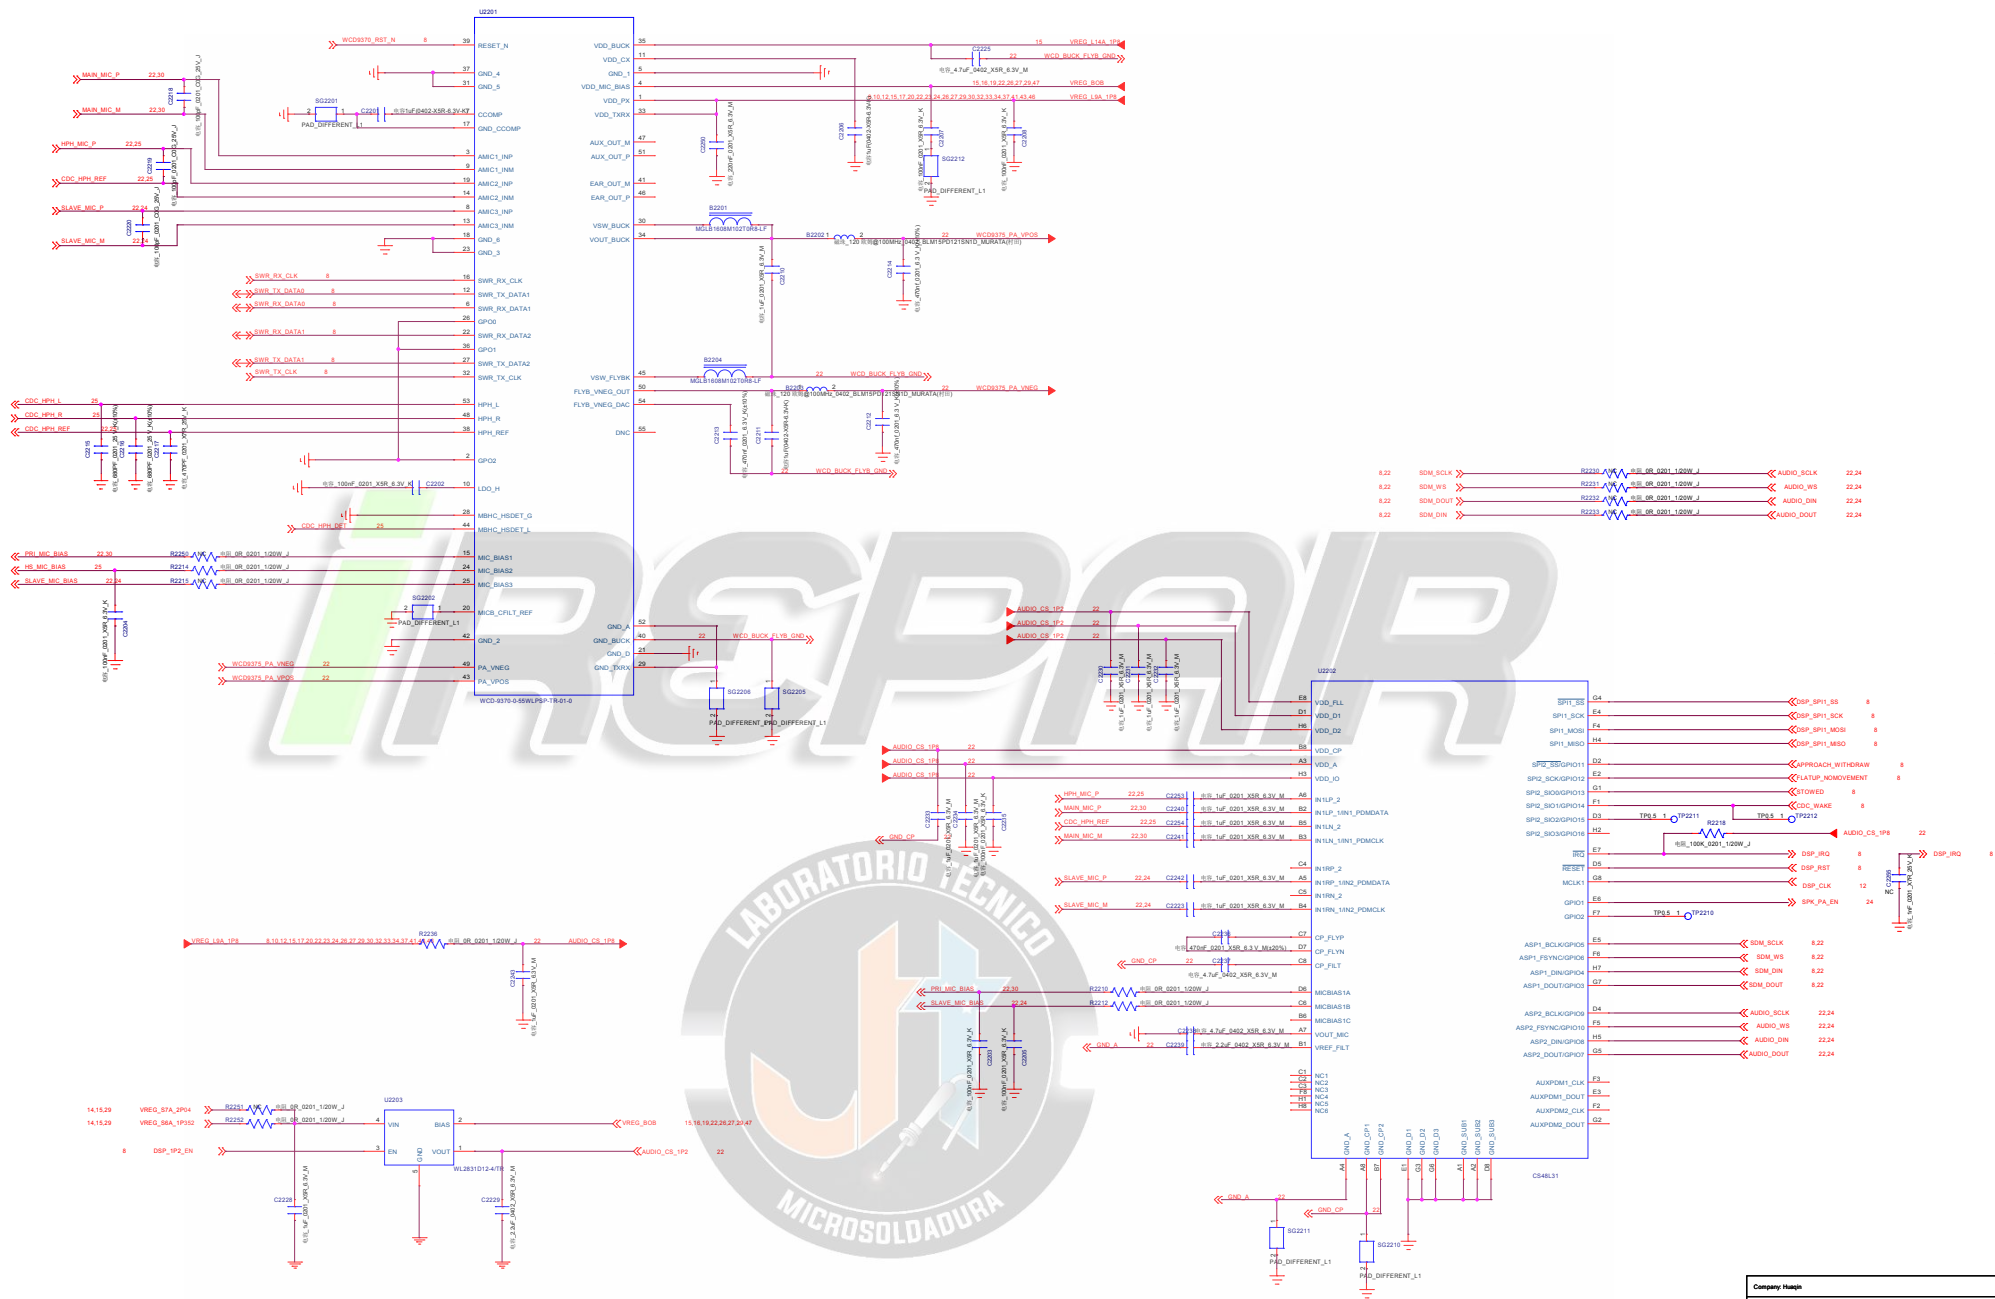


Company: Husqin	
Block Title	Wipower
Project	Teller
Rev	1.0
Date:	Wednesday, June 28, 2018
Sheet	22 of 48

PCBA AUTOMATIC TEST point

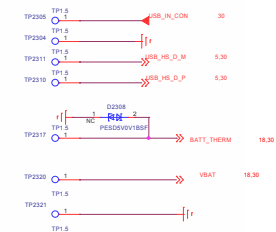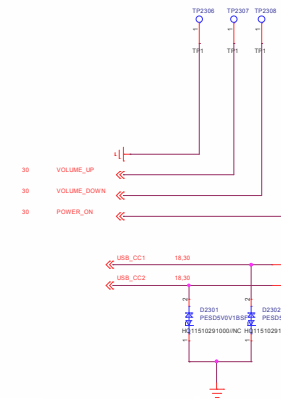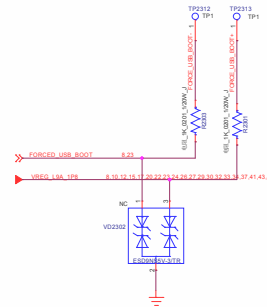
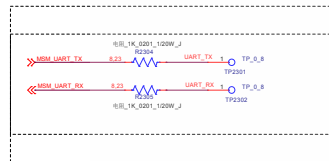


JTAG CONNECTOR

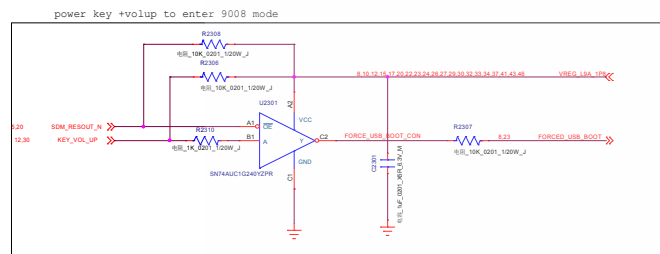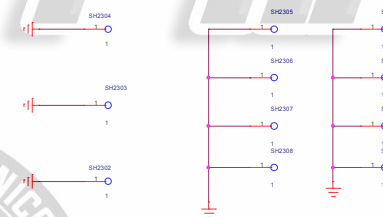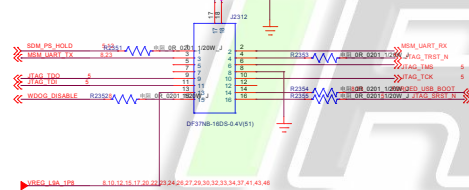


TP/GND/Shielding

Company: Haskin		
Block Title		Test Points
Project	Teller	Rev 1.0
Date:	Wednesday, June 28, 2017	Sheet 23 of 48

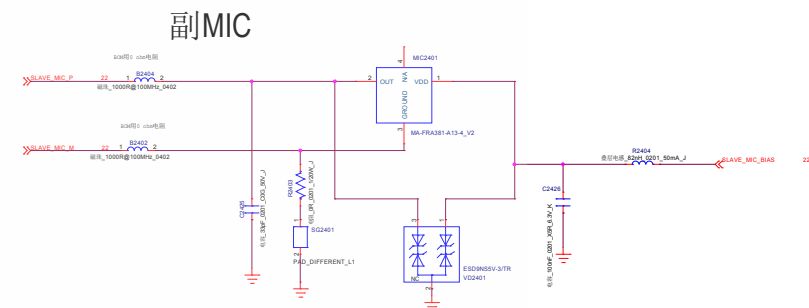
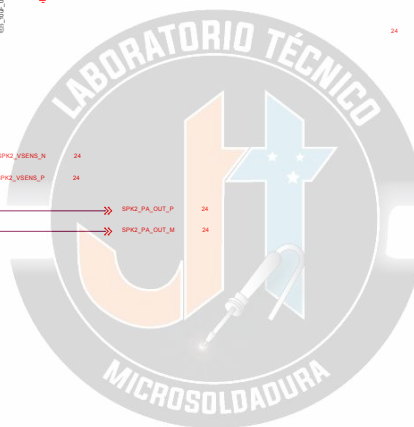
[illegible]

Company: Hsuejin	
Block Title: AUDIO_MIC_RCV_SPK	
Project: Teller	Rev: 1.0
Date: Tuesday, June 25, 2019	Sheet: 24 of 46


AUDIO JACK

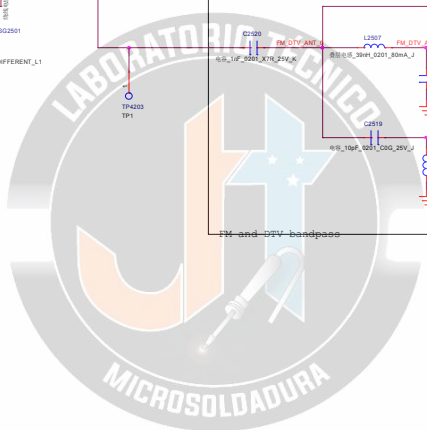


Company: Haejin	
Block Title AUDIO_HEADSET	
Project Teller	Rev 1.0
Date: Tuesday, June 25, 2019	Sheet 25 of 46

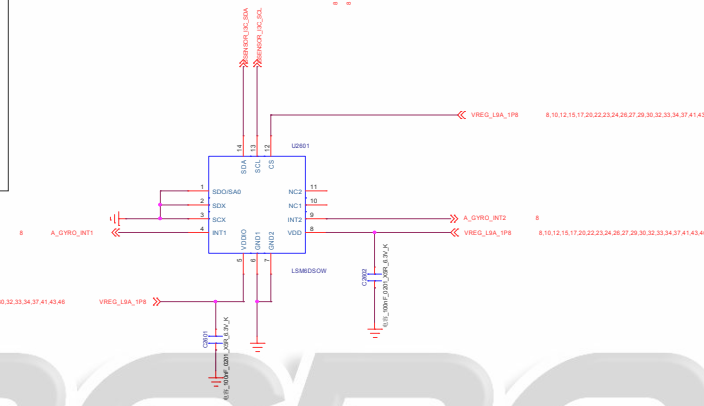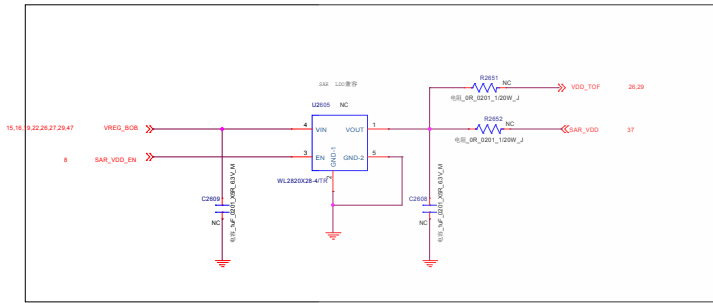



Magnetic Sensor

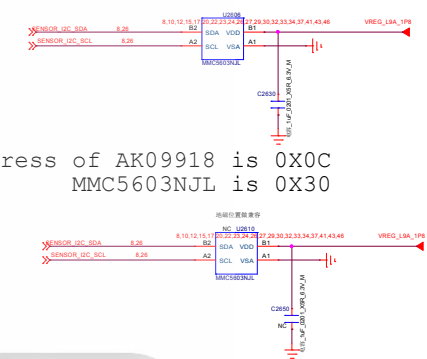

address of AK09918 is 0X0C
MMC5603NJL is 0X30


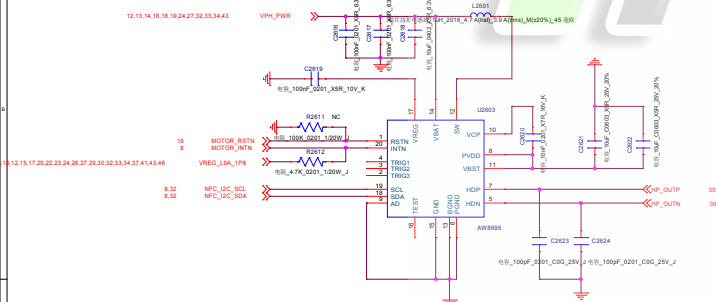


address of AW8695 is
AD:L 0X5A H 0X5B

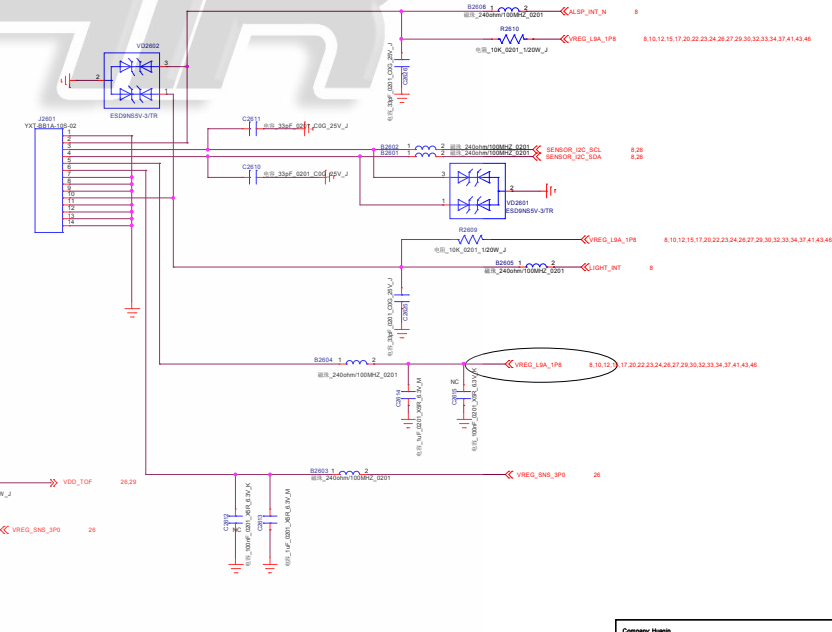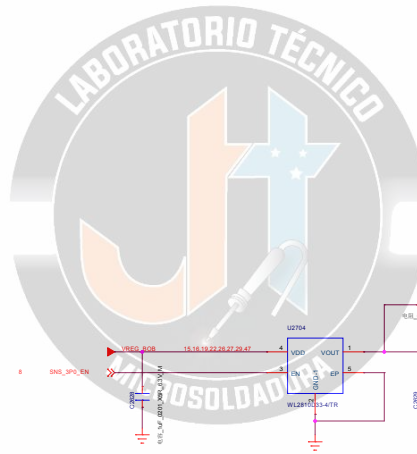

Company Hsien			
Block Title	SENSOR_MOTOR		
Project	Taller	Rev	1.0
Date	Monday, June 24, 2019	Sheet	20 of 48

LCD/TP-Connector

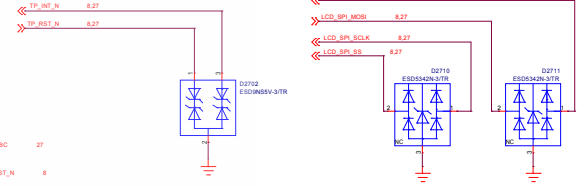


Company: Huzhin		
Block Title		LCD_TP
Project	Teller	Rev 1.0
Date:	Tuesday, June 24, 2019	Sheet 27 of 46



S5KGM1SP03-FGX9-Rear Main CAM I2C Adress: (Write:0x20 Read:0x21)

Rear Cam Inteface

Rear Cam FLASH LED-Dual CCT

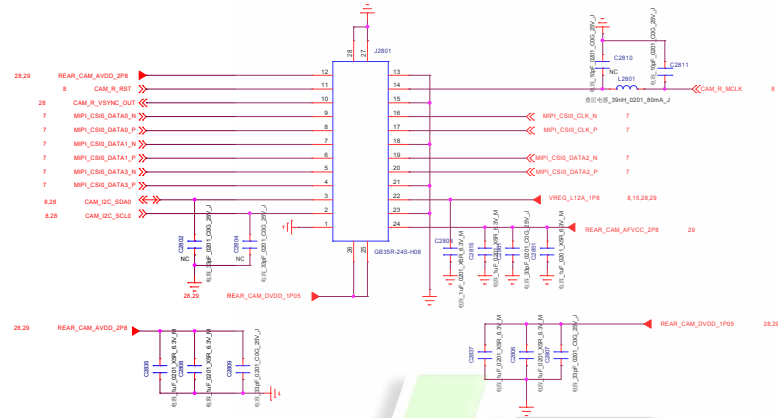

当前配置48M+5M: DVDD是1.2V, U2902用WL2831D105-4/TR
India配置12M+2M: DVDD是1.2V, U2902用WL2831D12-4/TR

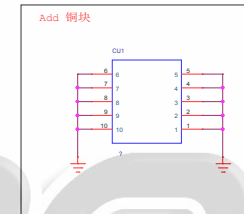
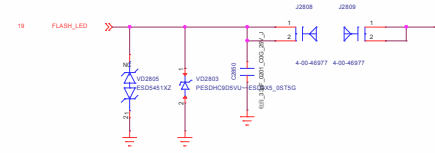


Video CAMERA



OV16885-GA5A-4C-Rear Video Cam I2C Adress: (Write:0x6C Read:0x6D)

SLAVE CAMERA


S5K5E9YX04-FGX9-Rear Slave Cam I2C Adress: (Write:0x5A Read:0x5B)

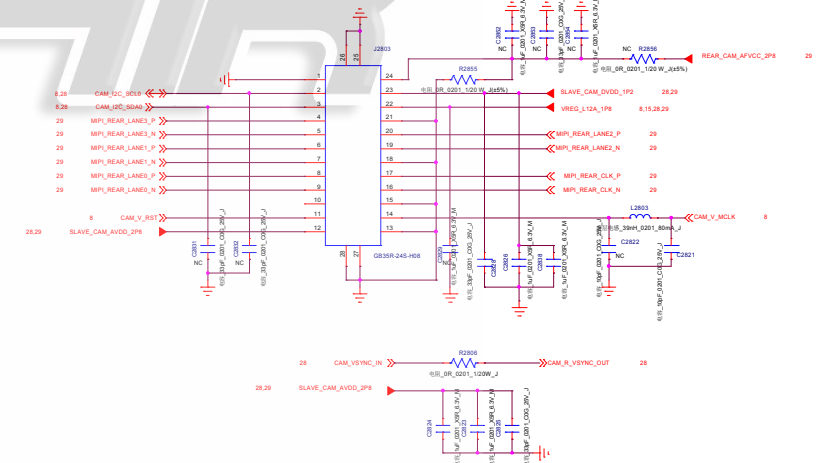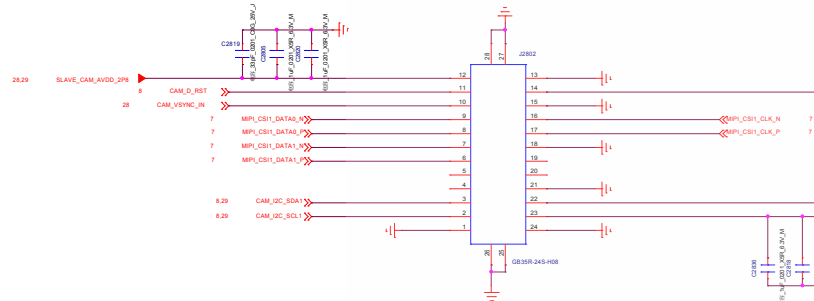


FRONT CAMERA

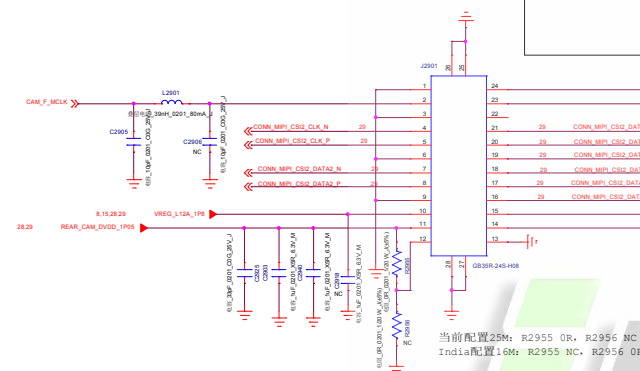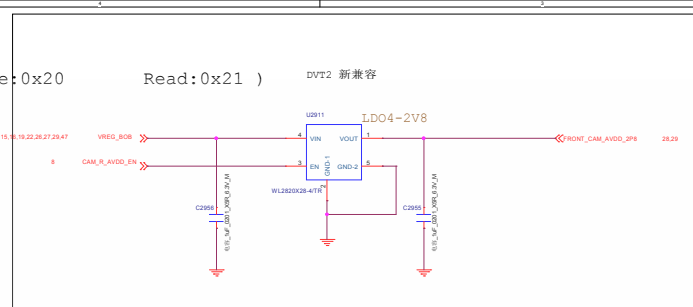


当前配置25M: R2955 0R, R2956 NC
India配置16M: R2955 NC, R2956 0R

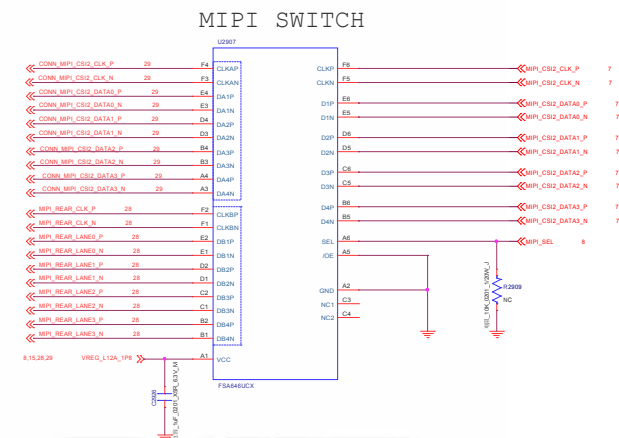



Rear-Main DVDD 1.05V HQ11150937000 or HQ11151047000 /1.2V HQ11150938000兼容，物料替换

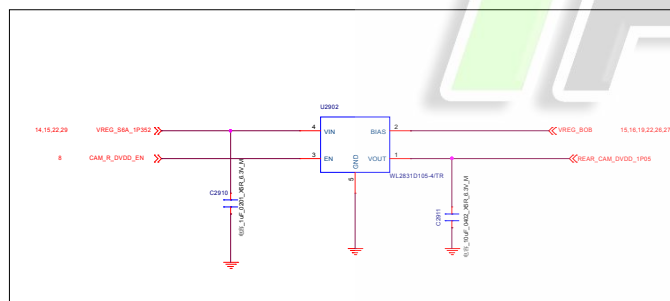

Rear-Main AFVCC 2.8V

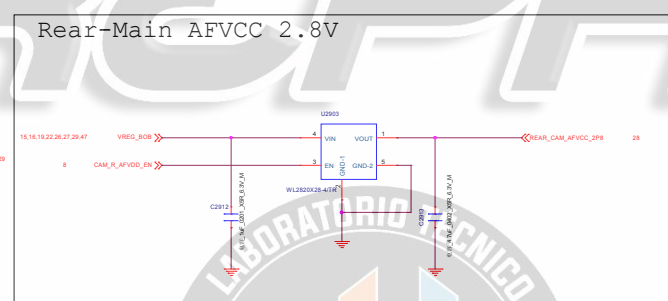


Rear-Main AVDD 2.8V (also Front AVDD)

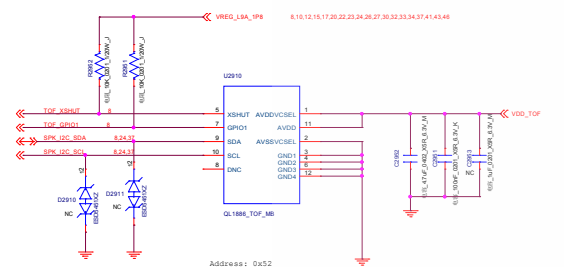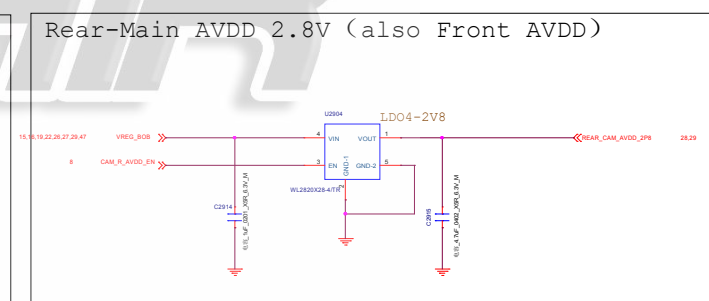



Address: 0x52

Rear-Slave AVDD 2.8V

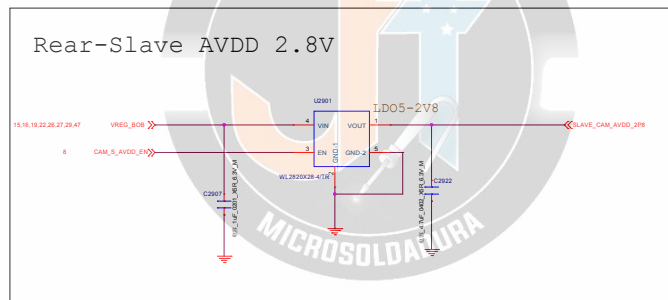



Rear-Slave DVDD 1.2V (Also 8M Front DVDD)

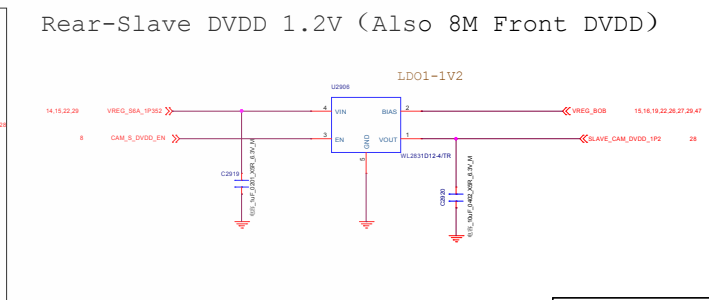

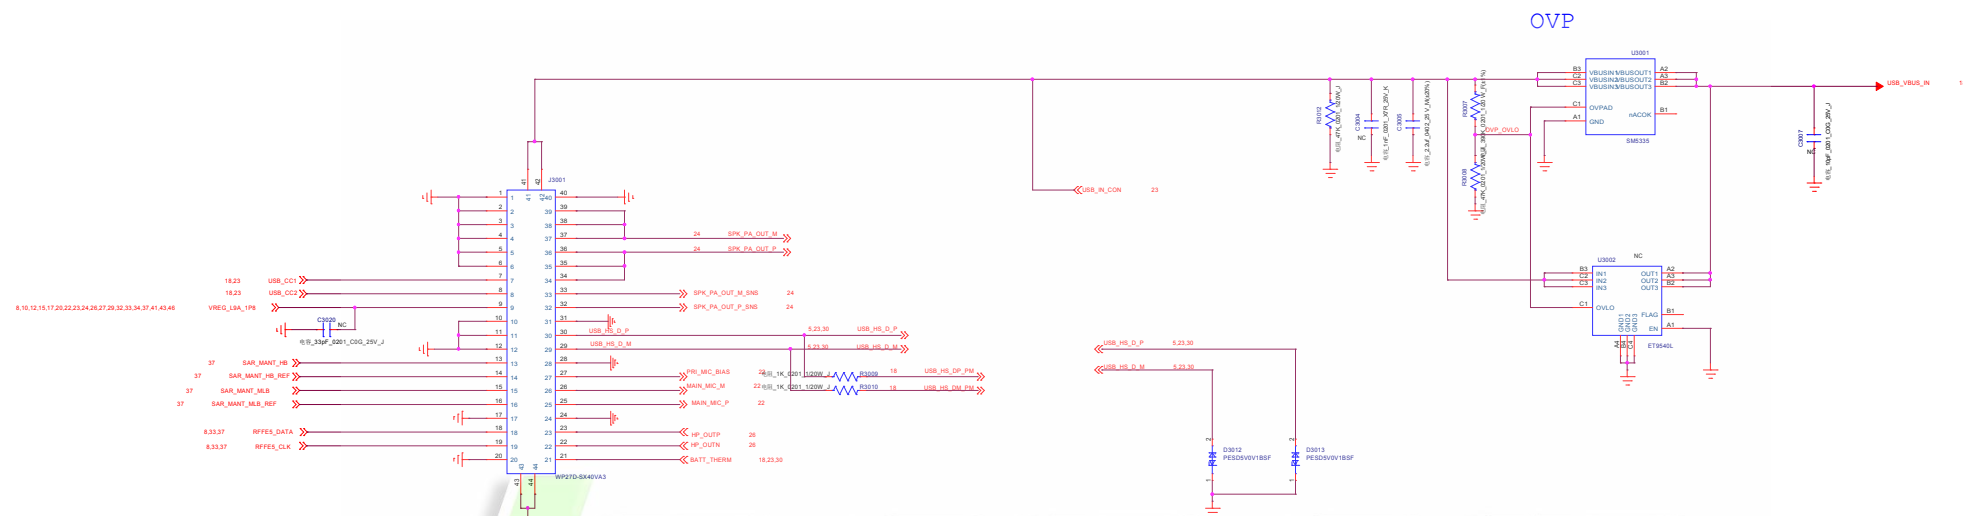

音量键&开关机键

Battery Connector

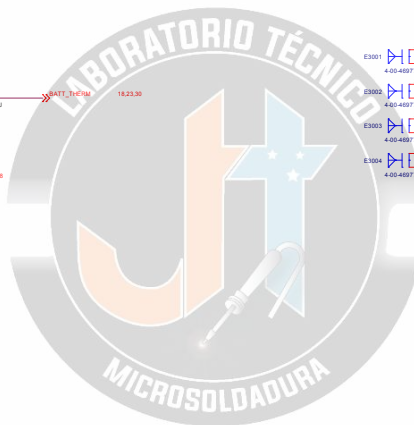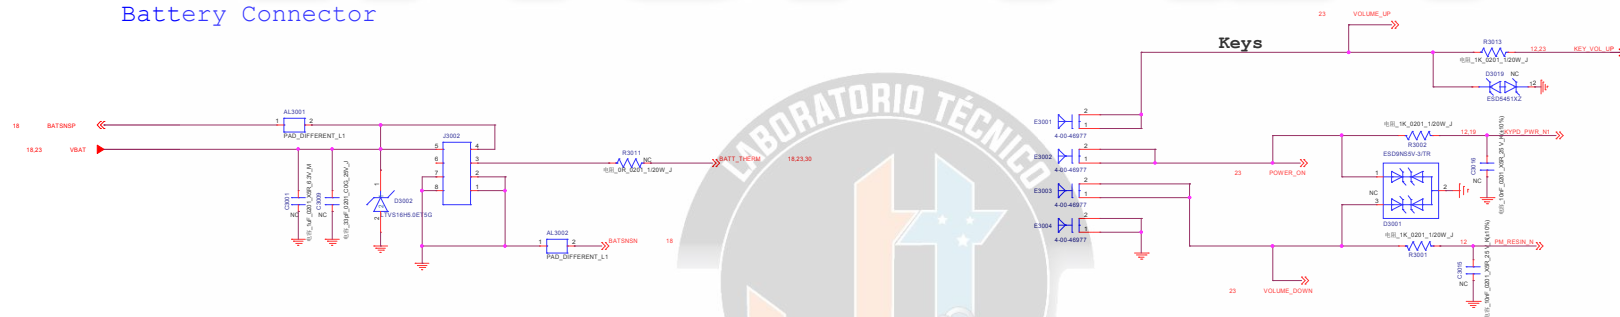


Company: Hsueh		
Block Title: SIM_SD_KEY_LINK_BATT		
Project:	Teller:	Rev: 1.0
Date:	Created: June 25, 2012	Sheet: 50 of 46


iREPAIR




Company Header				
Block Title DTV				
Project	Taller	Rev	1.0	
Date	Monday, June 26, 2018	Sheet	51	of 66






27.12MHz Crystal Need NC

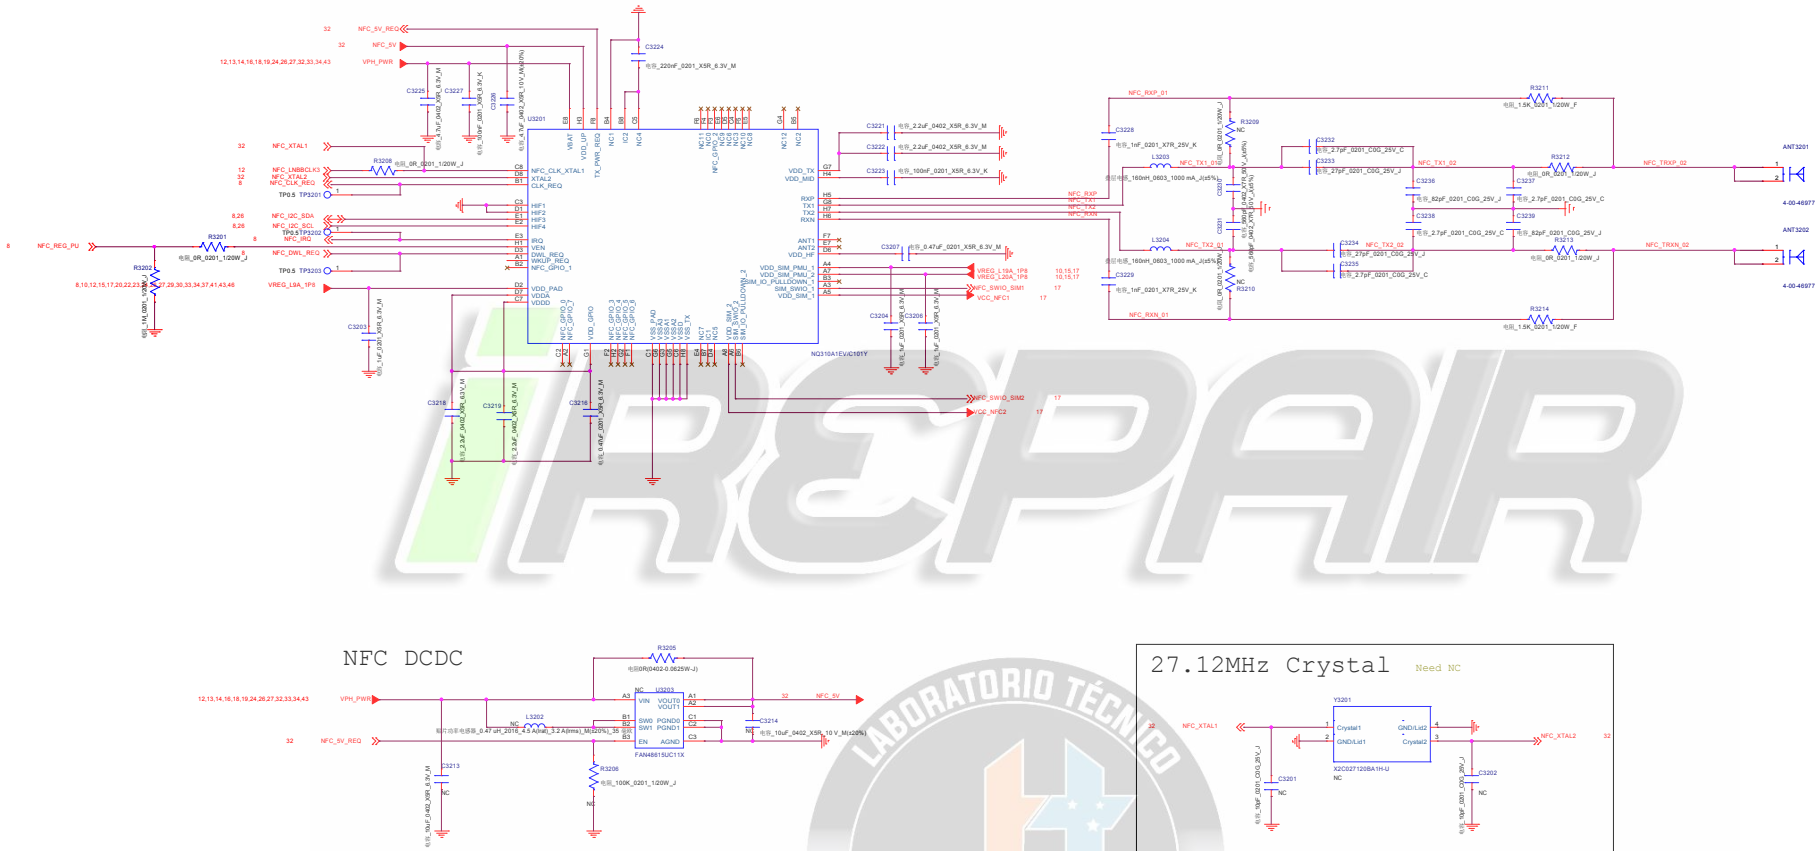

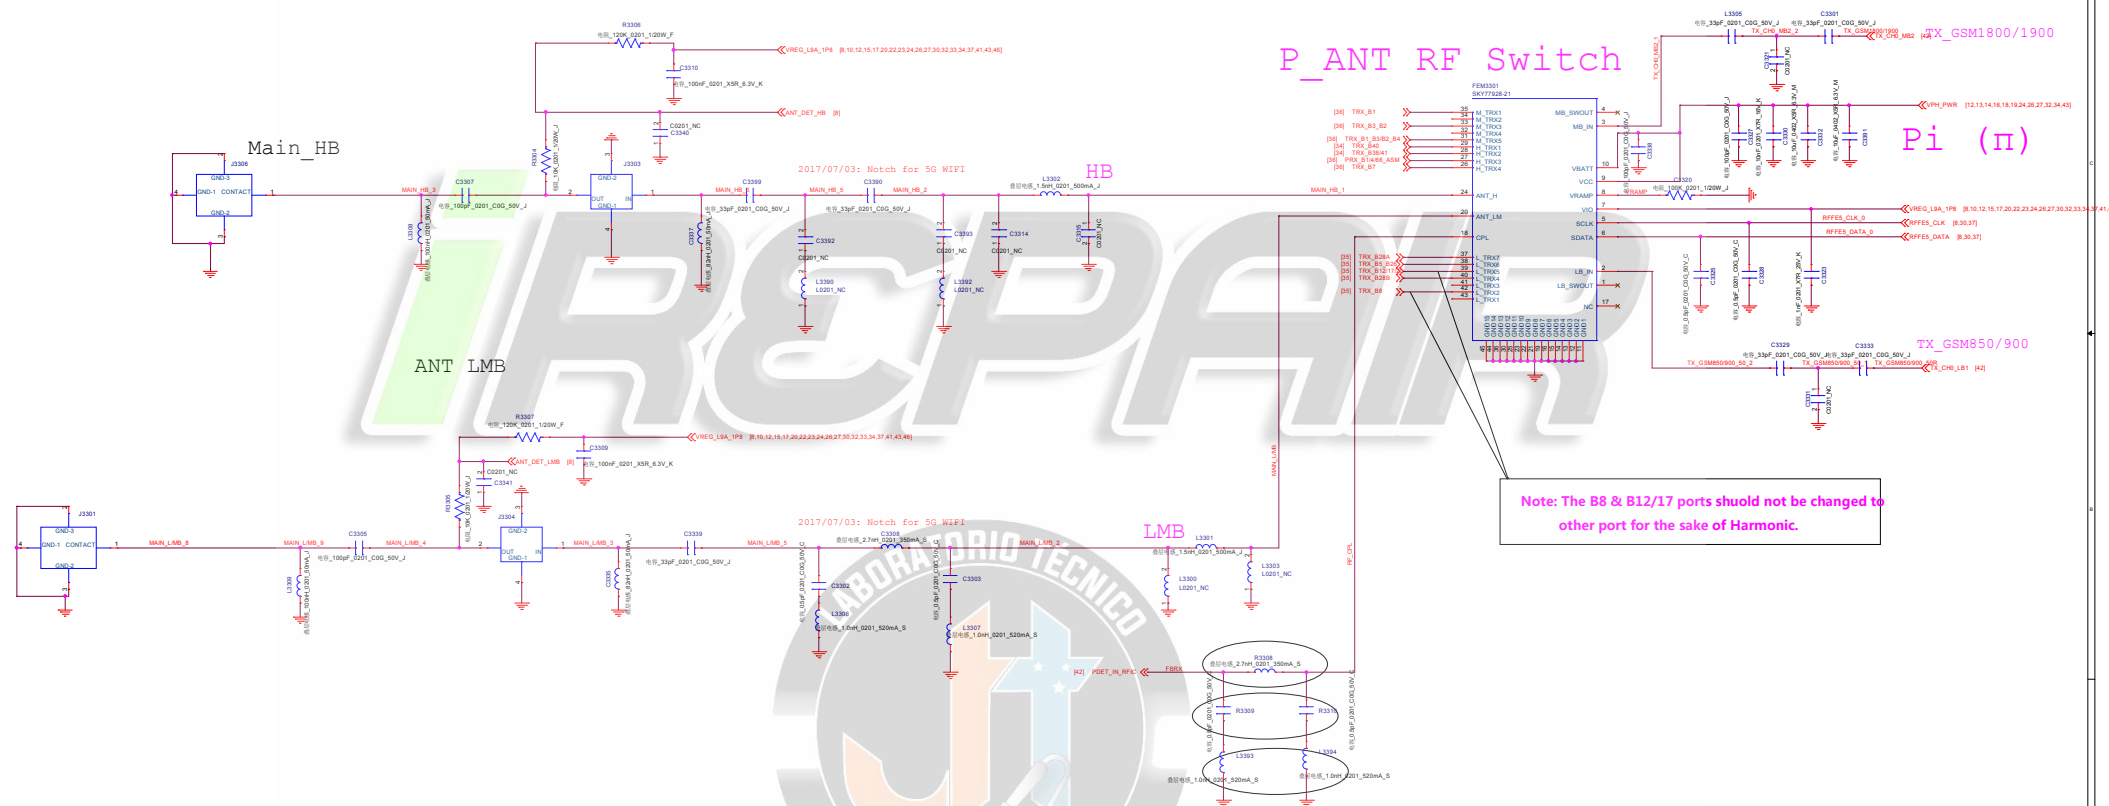


Company: Haskin		
Block Title: PRIMARY_ANTENNA		
Project	Teller	Rev: 1.0
Date:	Tuesday, June 25, 2019	Sheet 33 of 32

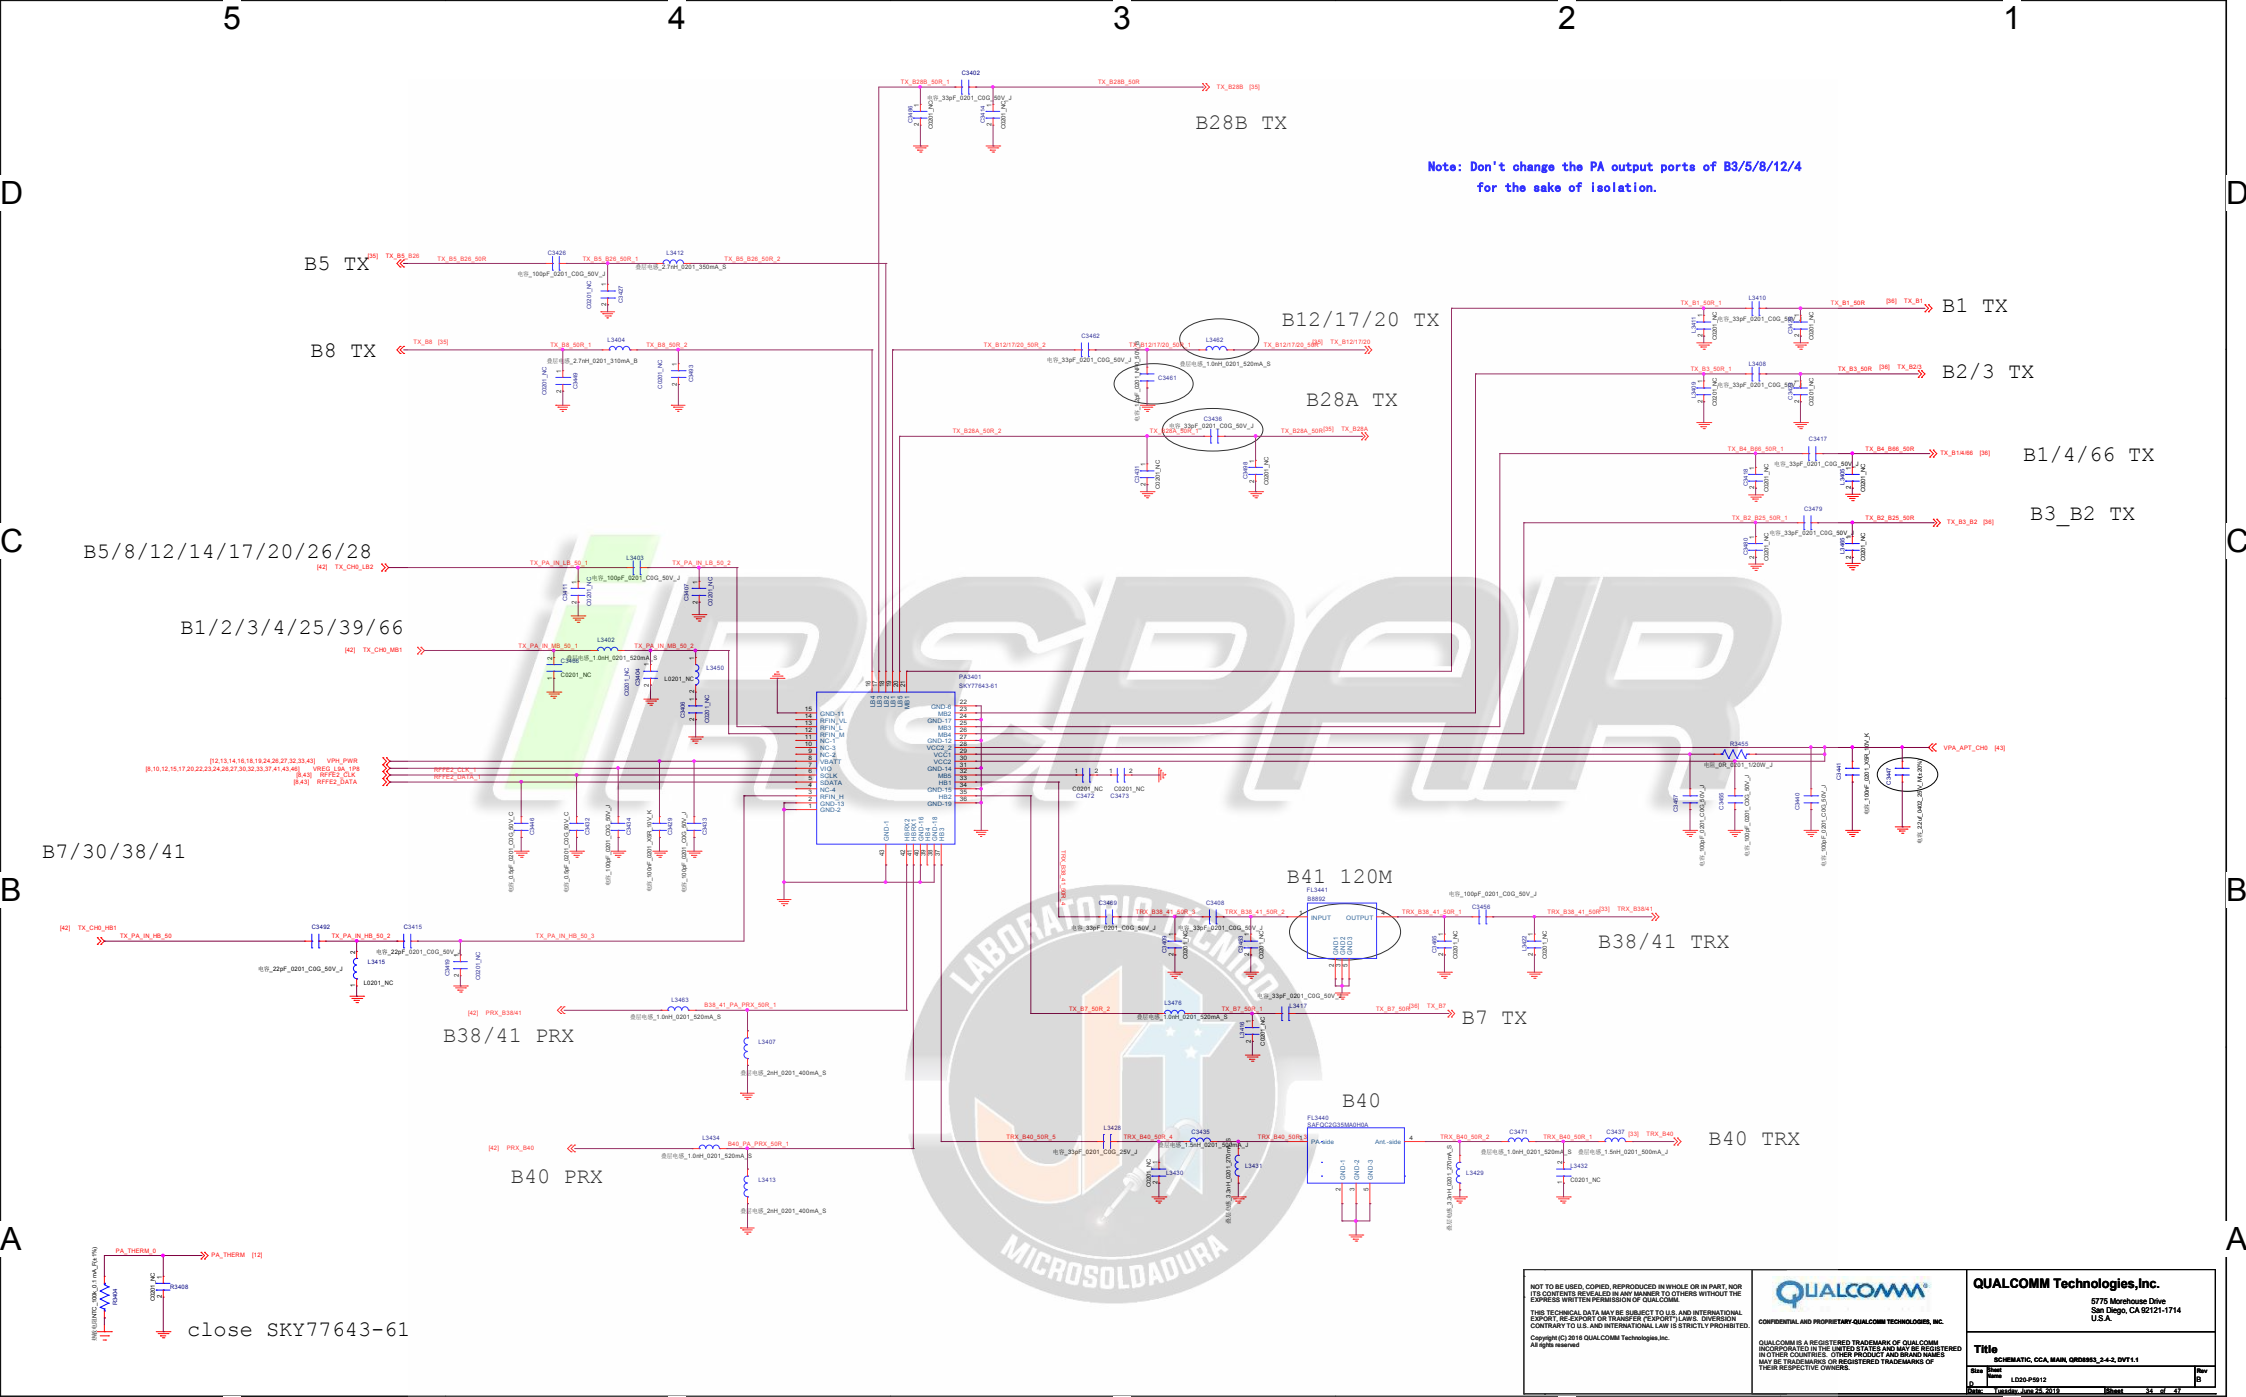

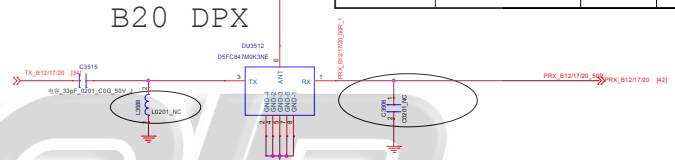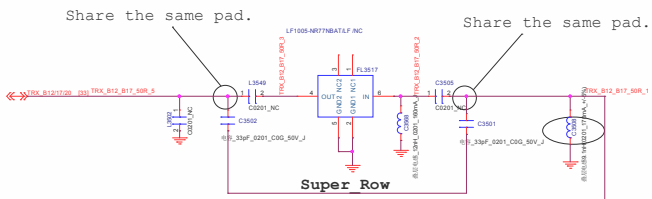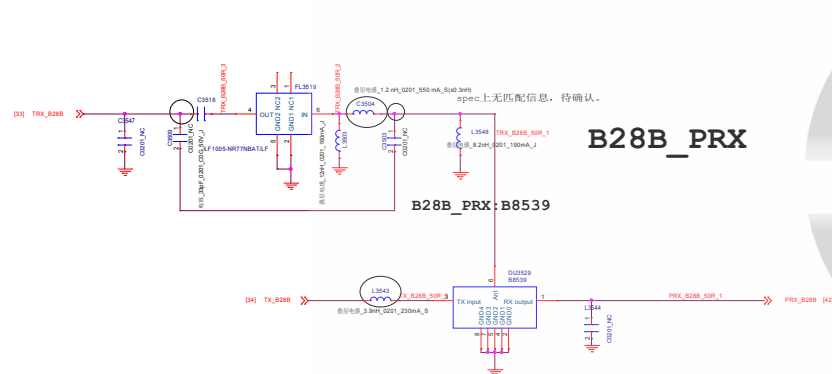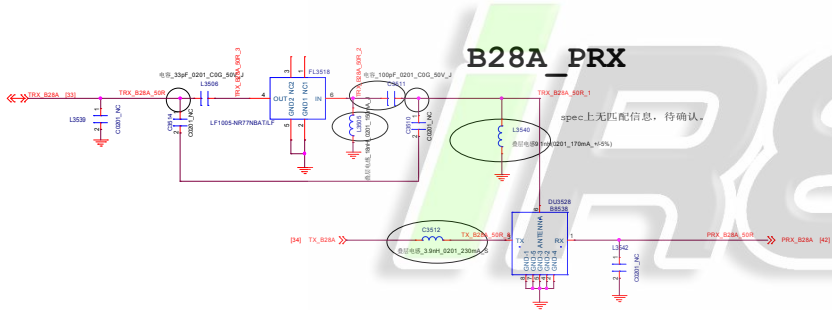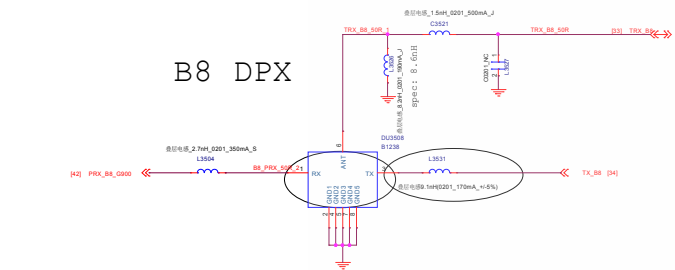


Description	Code	Vendor	SKU
B12/17 DPX	SAYEY707MBA0F0A	MURATA	Brazil & Latam
B20 DPX	D5FC847MOK3NE	TAIYO	Super Row

Description	Code	Vendor	SKU
B5 DPX	SFX836EYJ02	Will	Brazil & Latam
B26 DPX	SAYEY831MBA0B0A	MURATA	Super Row

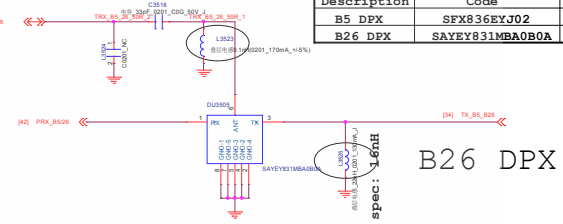

DU3603



Description	Code	Vendor	SKU
B2 Duplexer	SAYEY1G88BC0B0A	MURATA	Super Row
B3 Duplexer	SAYEY1G74BC0B0A	MURATA	Brazil & Latam

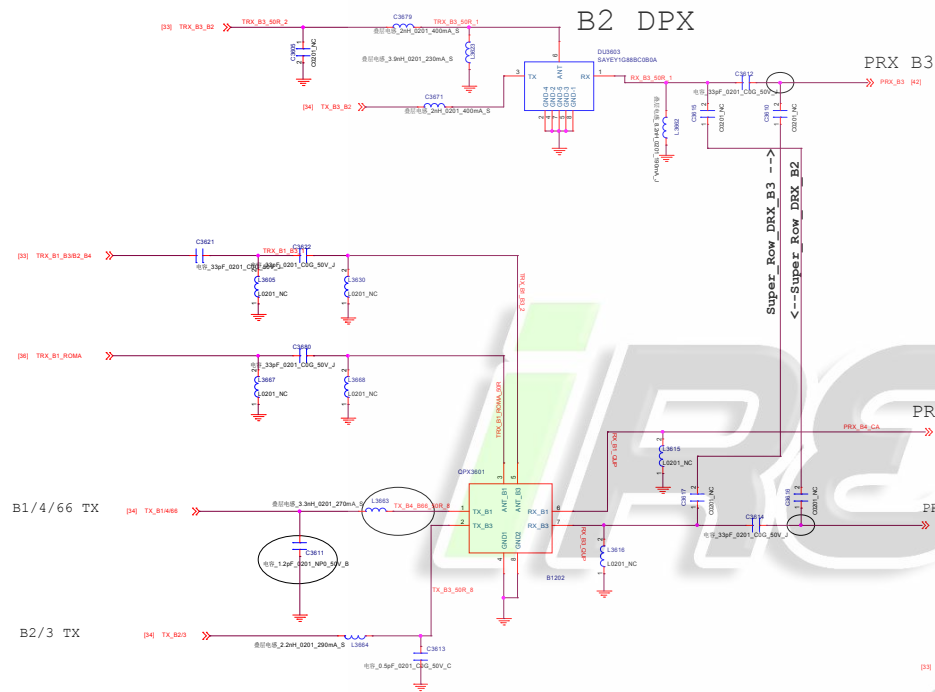


B1/B3 or B2/4 QPX

QPX3601

Description	Code	Vendor	SKU
B1/3 Duplexer	SAHRX1G74BA0B0A	MURATA	Super Row
B2/66 Duplexer	M5000	RF360	Brazil & Latam

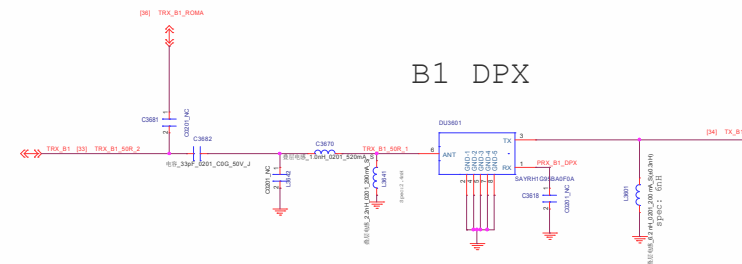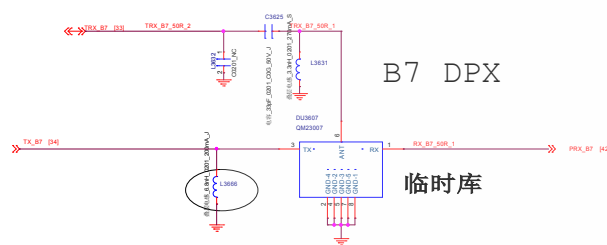


PRX_B1/4/66

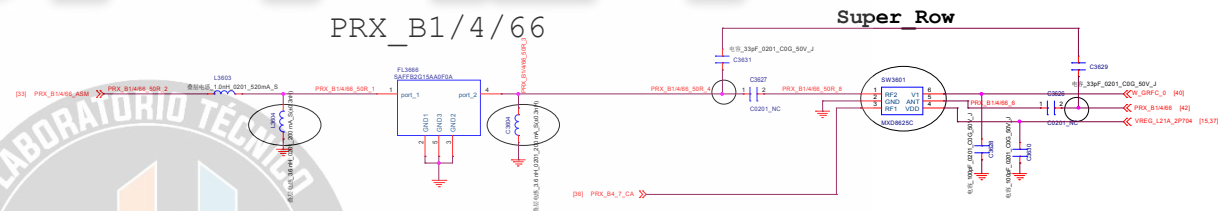

临时库


DIVERSIT_ANT

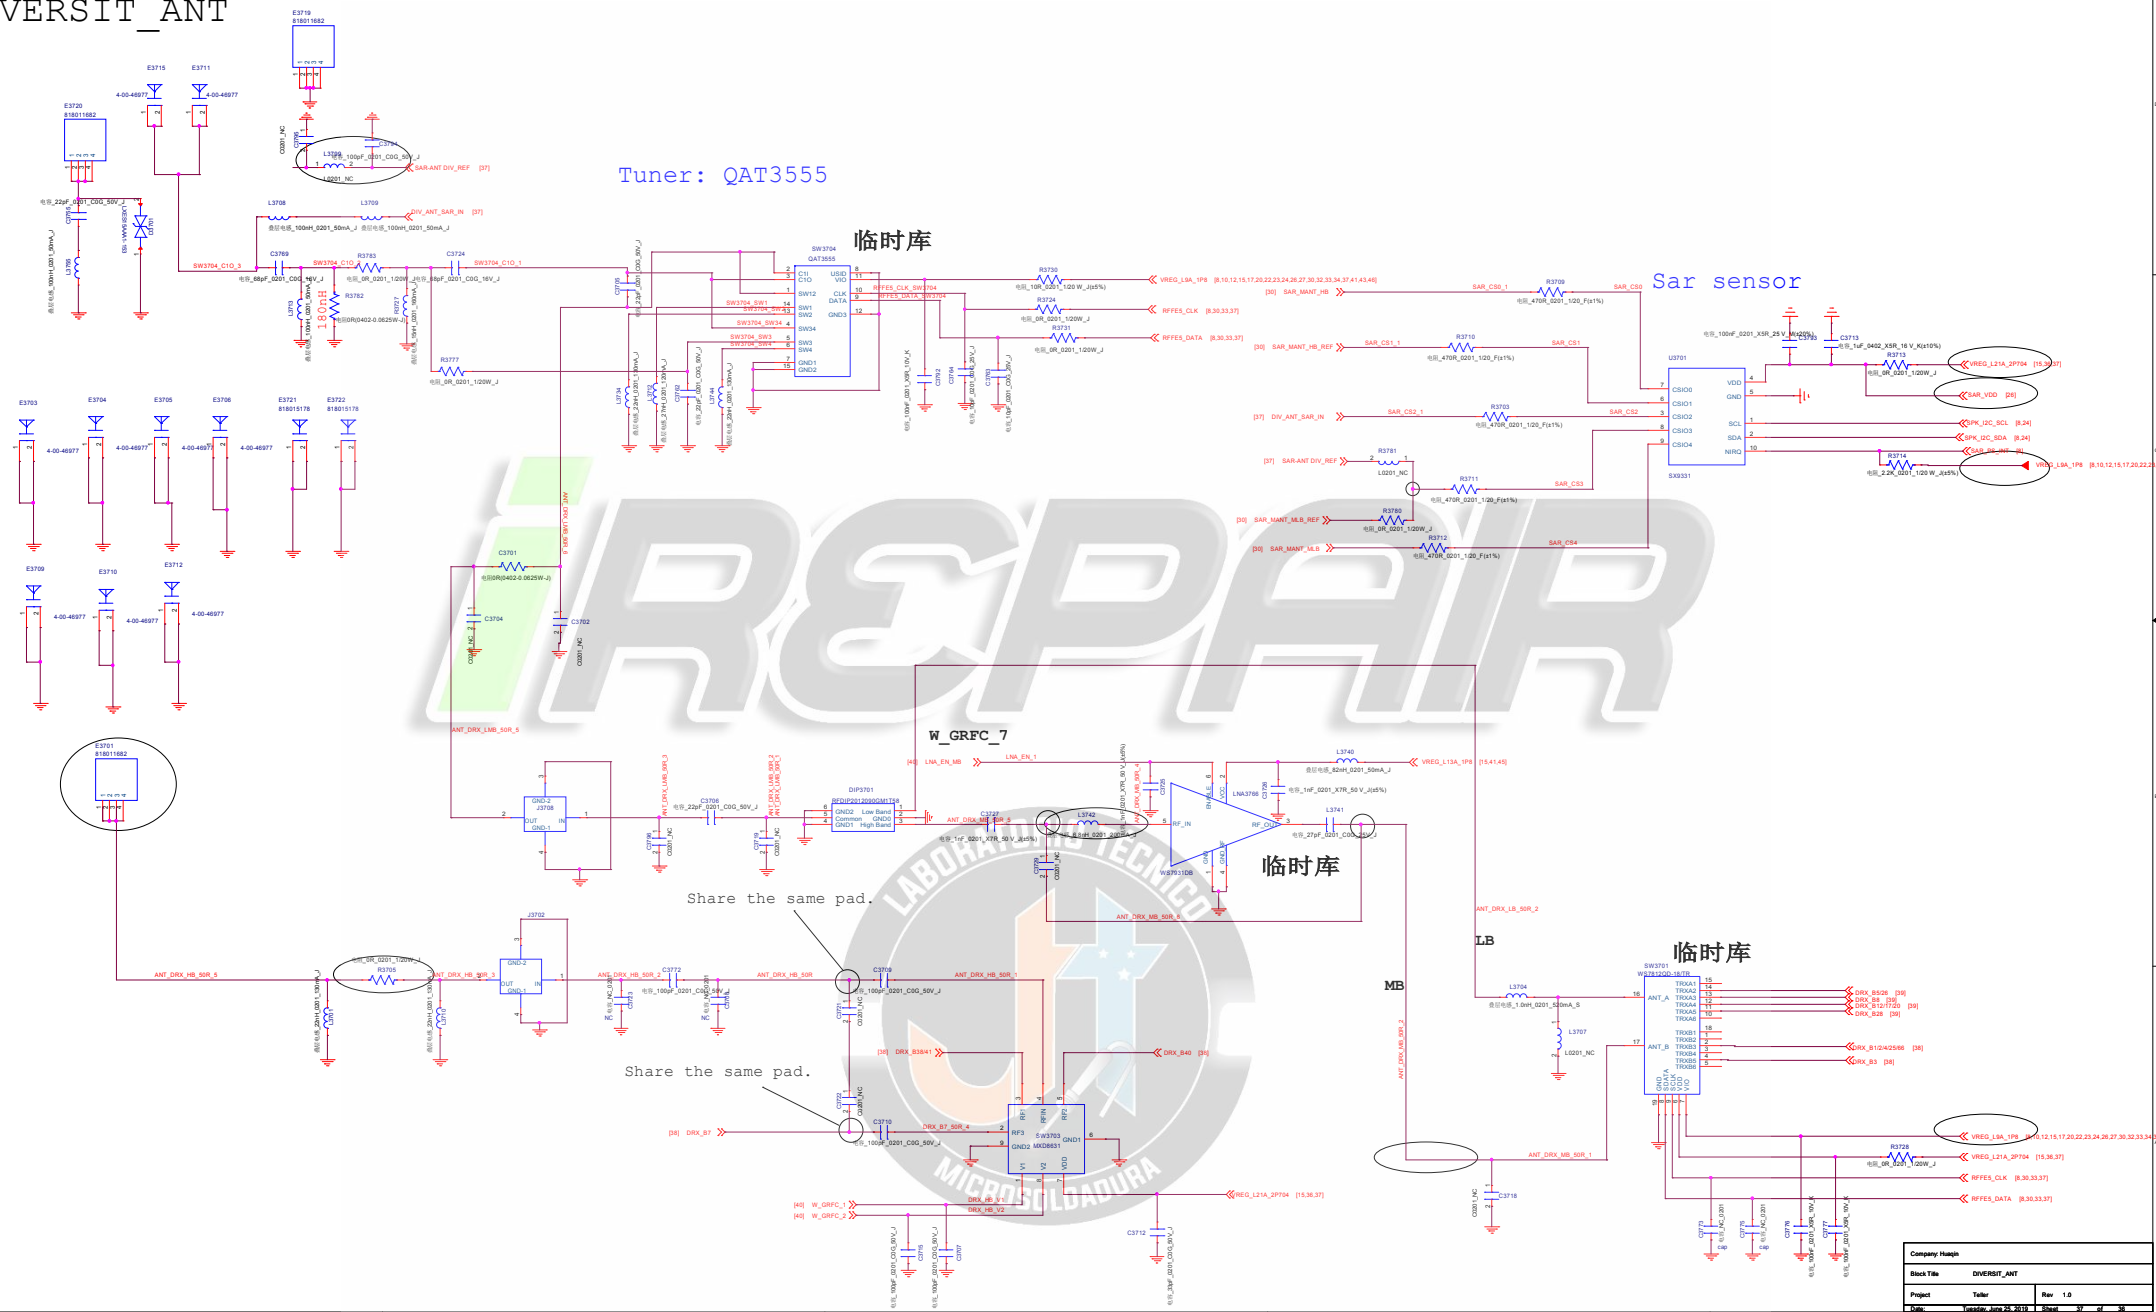





Company Name			
Stock Title			
Project			
Author			
Rev			
Date			

DRX MB HB

Description	Code	Vendor	SKU
B1+3 SAW	SAWFD1G84AA0F0A	MURATA	Super Row
B25+66 SAW	SAWFD1G96AC2F0A	MURATA	Brazil & Latam

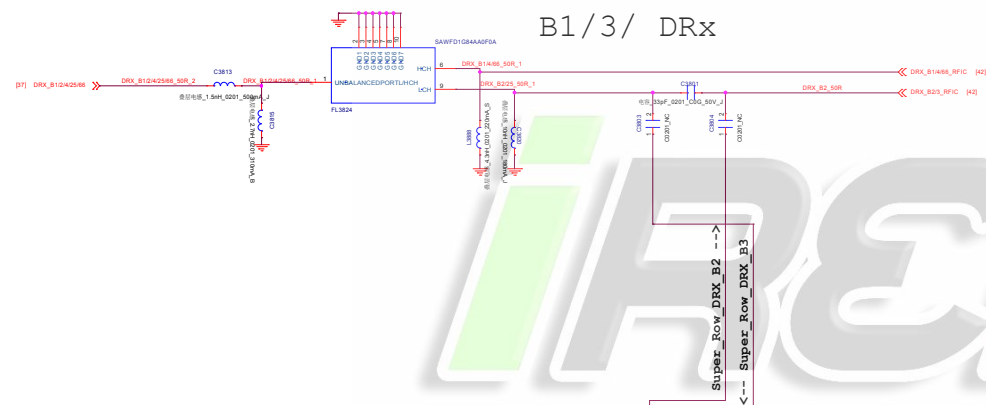


Description	Code	Vendor	SKU
B2 SAW	SFHG60AA002	Wisol	Super Row
B3 SAW	SFHG42AA002	Wisol	Brazil & Latam

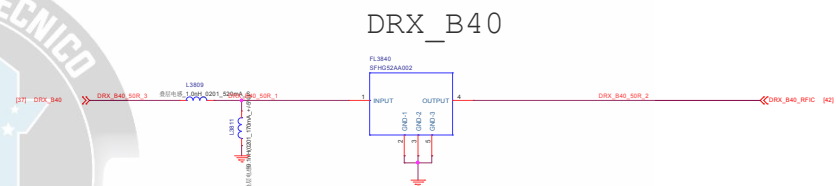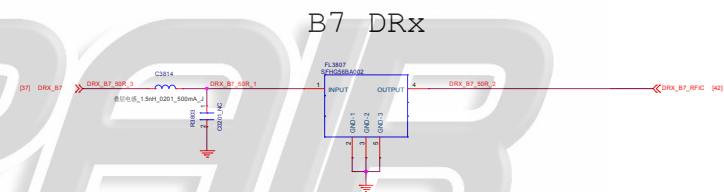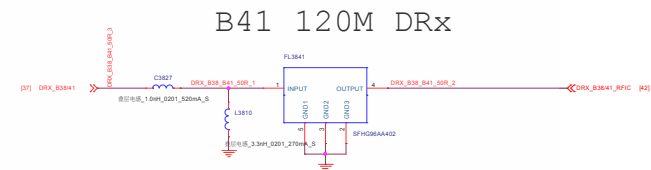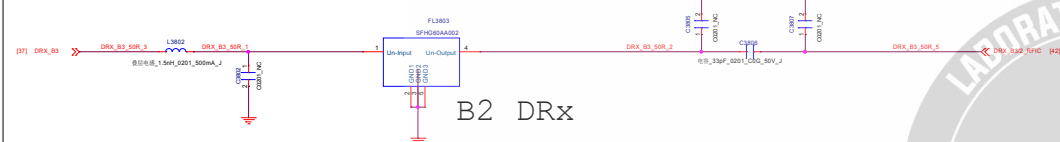


DRX_LB

B5/26 DRX


Description	Code	Vendor	SKU
B5 SAW	SFH881AA002	Wisol	Brazil & Latam
B26 SAW	SAFFB876MAA0F0A	MURATA	Super_Row




B8 DRX



B28 DRX

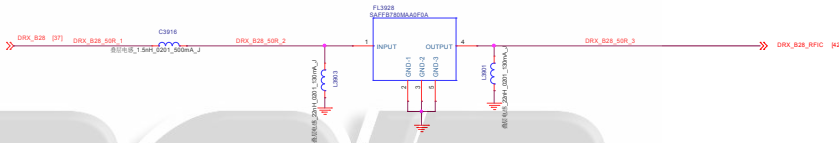


B20 DRX

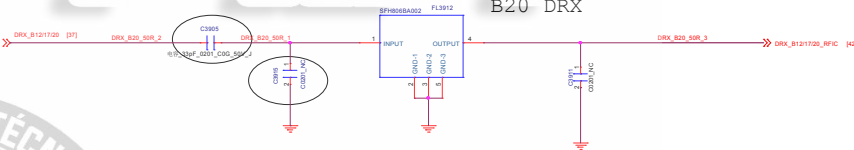


B12/17/20 DRX

Description	Code	Vendor	SKU
B12/17 DPX	SAFFB737MAA0F0A	MURATA	Brazil & Latam
B20 DPX	SFH806BA002	Wisol	Super_Row




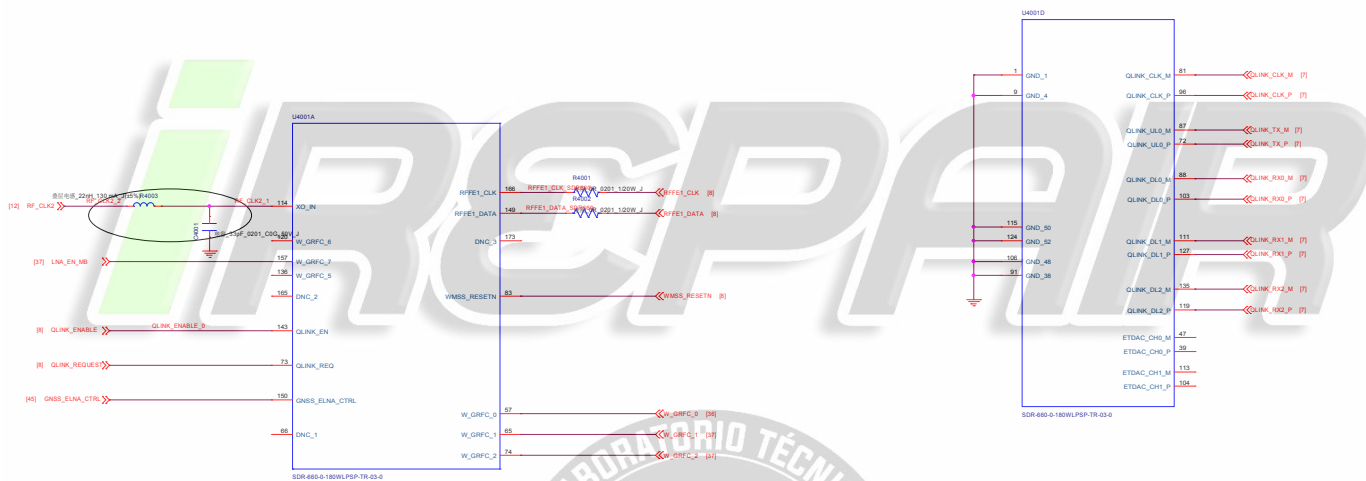

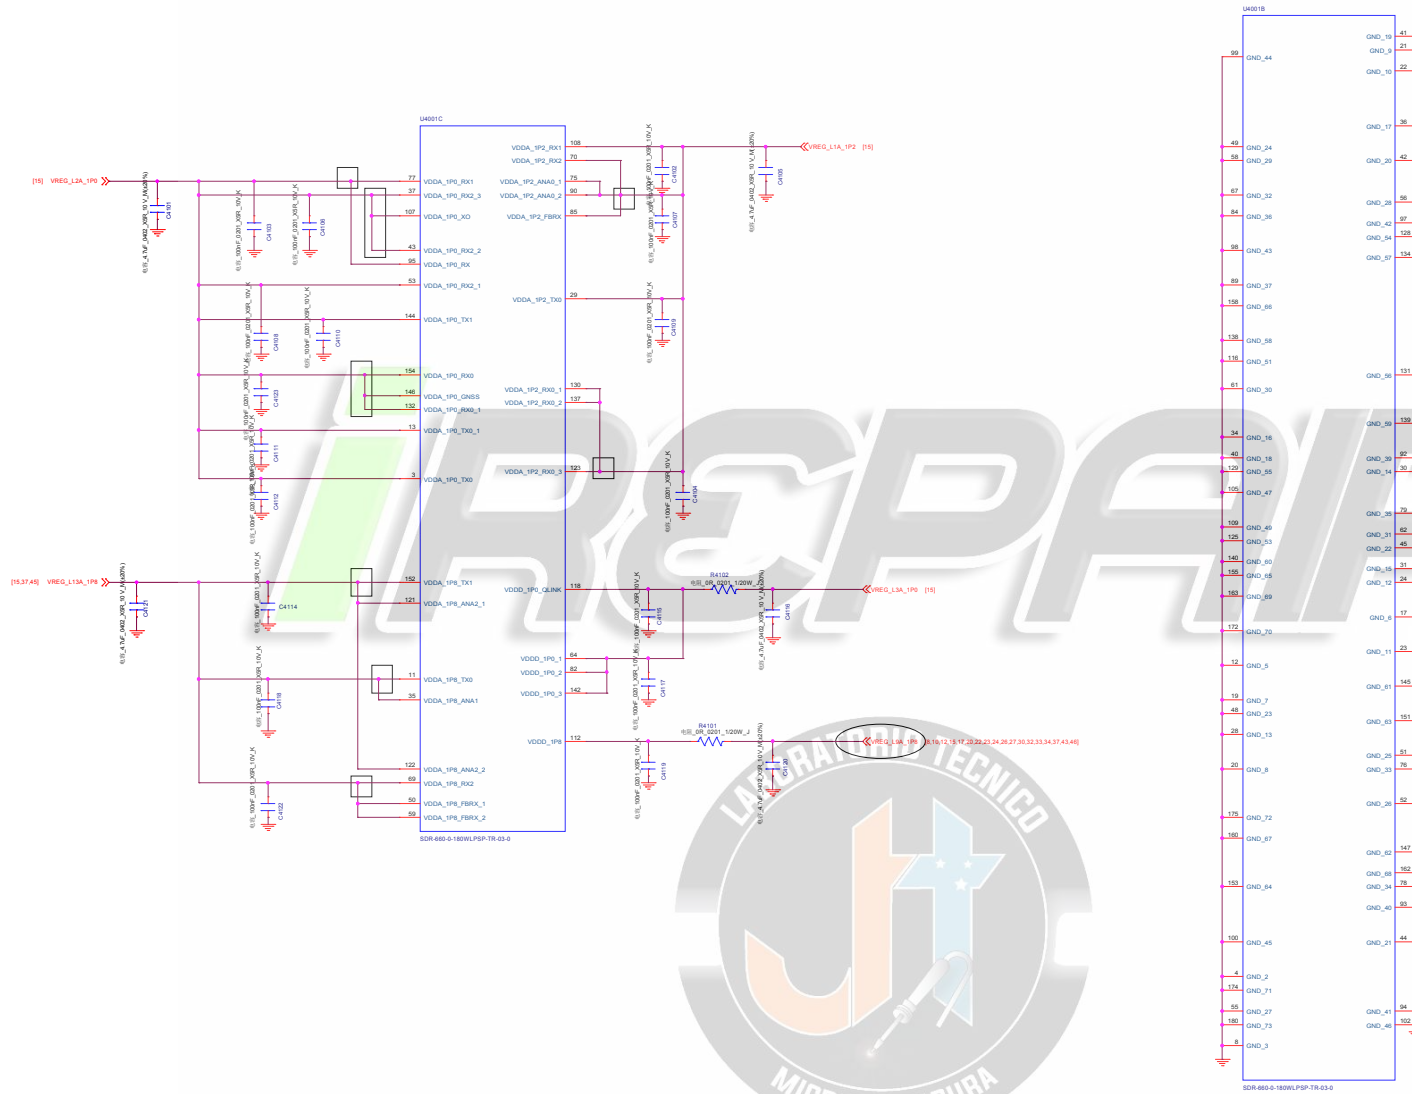


Company: Huzhou		
Block Title: SDR660_PWR		
Project	Teller	Rev: 1.0
Date:	Tuesday, June 24, 2014	Sheet: 41 of 46

SDR660_DA/PRX/DRX/FBRX

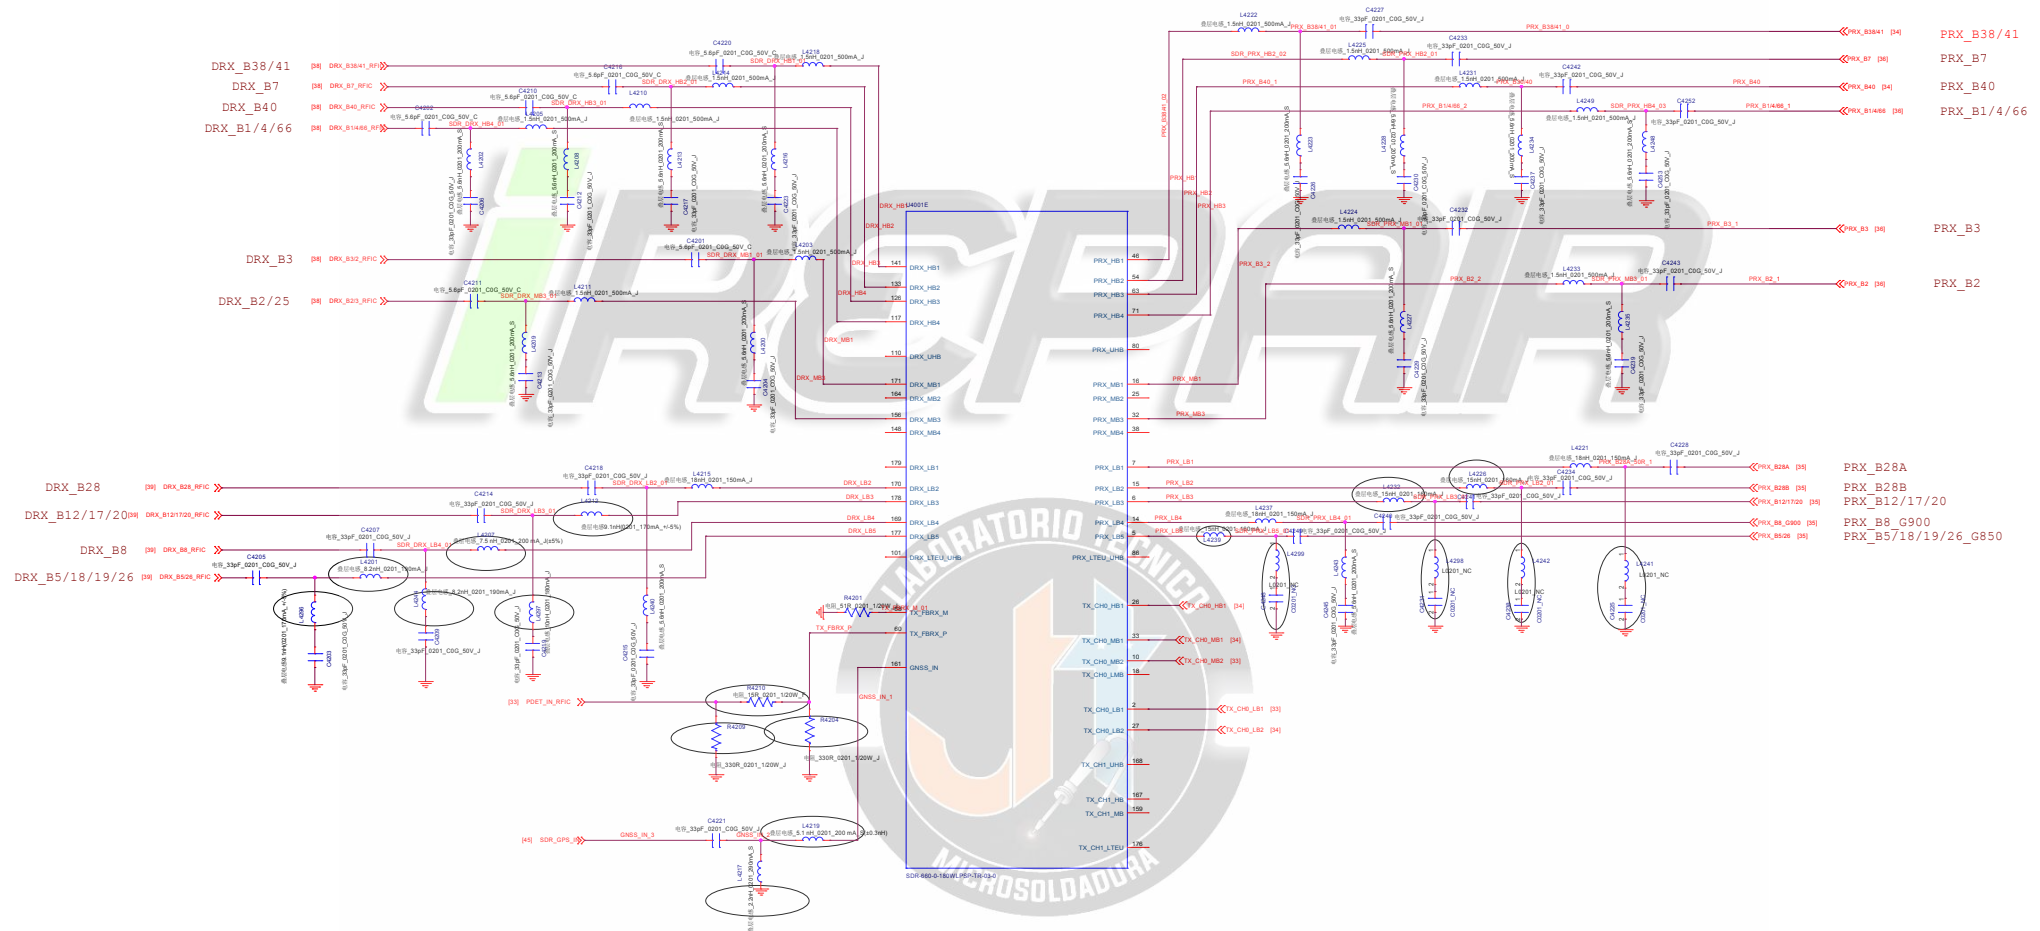

Company: Hualin		
Block Title SDR660_DAIPRXDRXFBRX		
Project	Teller	Rev 1.0
Date:	Tuesday, June 25, 2019	Sheet 42 of 46


QET4101

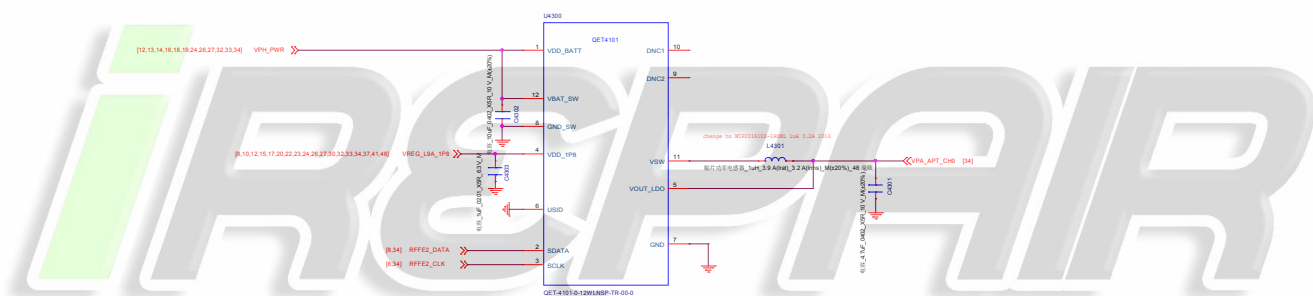

Company Huesen			
Stock Title QET4101			
Project	Taller	Rev	1.0
Date	Monday, June 24, 2019	Sheet	43 of 48

WIFI 2.4G/BT


FL4401 to be changed to HQ11430849000 SAFQA2G45MB0G0A MURATA

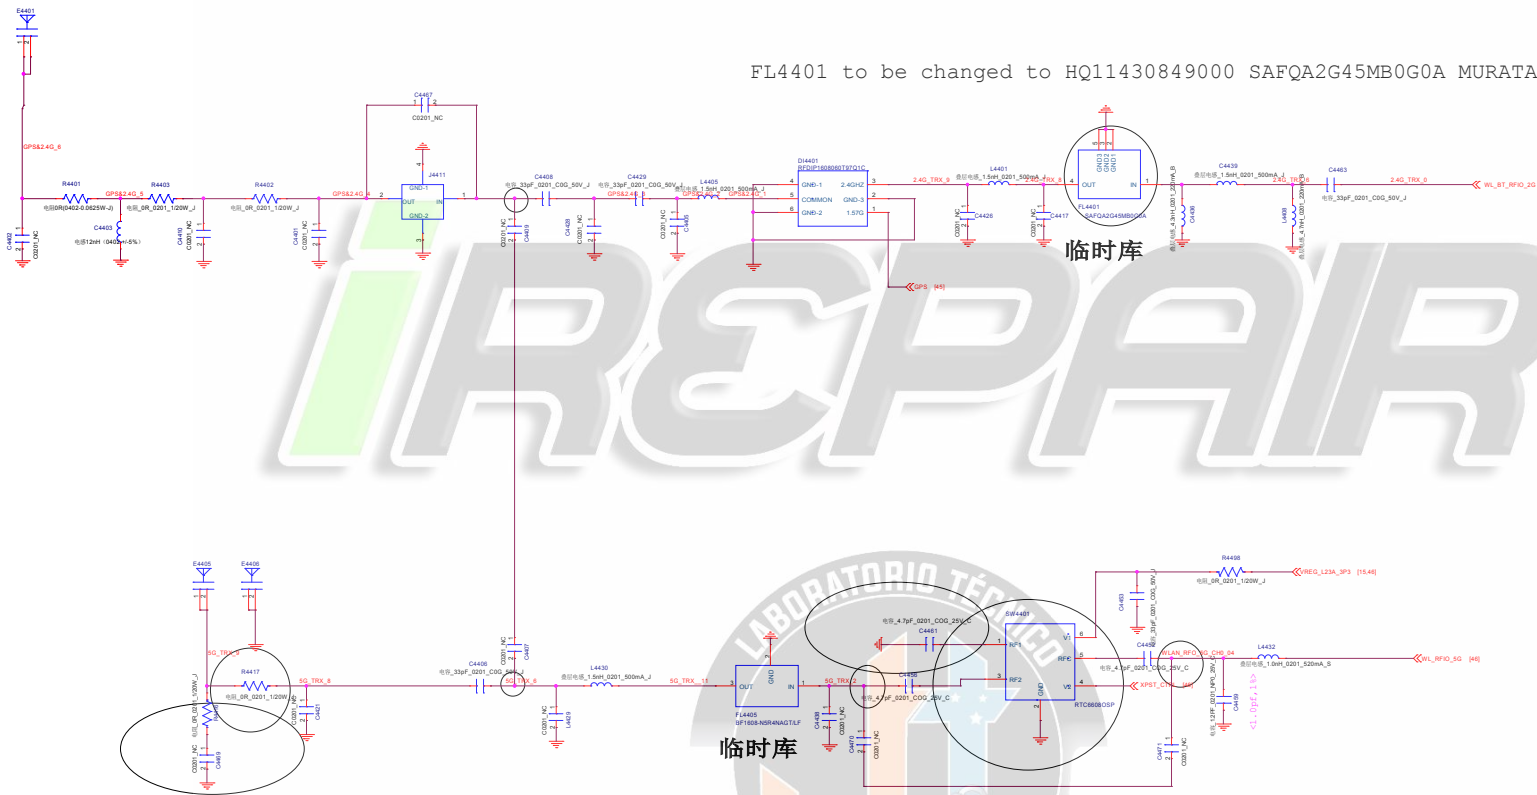

临时库

遗留 HQ11420232000

Company Huan		
Stock Title	WIFI 2.4G/BT	
Project	Taller	Rev 1.0
Date	Monday, June 24, 2019	Sheet 43 of 48

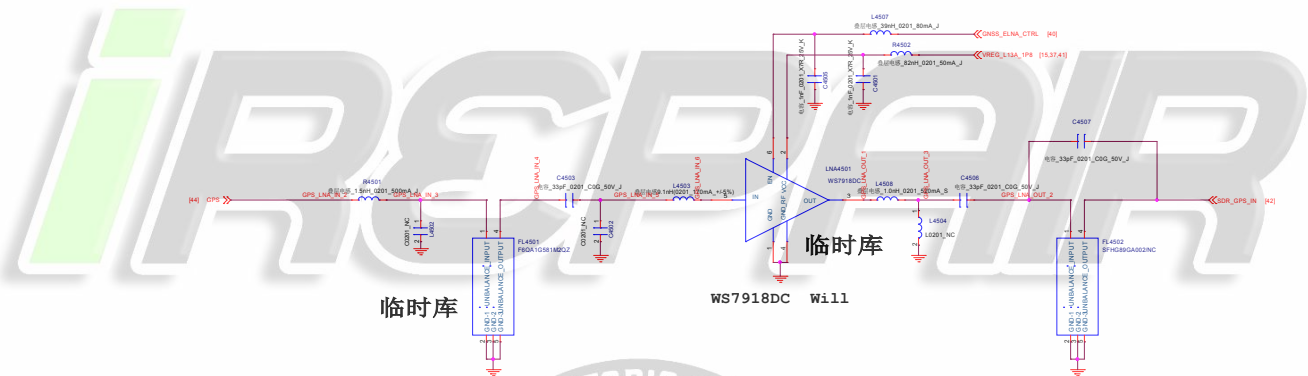

Company Hsien			
Block Title		GPS	
Project	Taller	Rev	1.0
Date	Monday, June 24, 2019	Sheet	05 of 06



I和Q走线需要60dB的隔离，阻抗70-100欧姆控制。

WL_CMD_CLK/DATA layout需要重点保护


3.3V Peak current (mA)		All 585
VDD33_WL_PA	1000	
VDD33_WL_5GPA_DRV_CH0	70	
VDD33_WL_BT_2G_DRV_PM_LD0	65	

1.3V Peak current (mA)


VDD13_BT_BB_WL	120
VDD13_WL_SYNTH_CH0	40
VDD13_BT_SYNTH	15
VDD11d_PM	20
VDD13_FM	15
VDD13_BT_FM_BBPLL	10
VDD13_BT_PM	20

1.8V Peak current (mA)

VDD18_IO	15	ALL75
VDD18_XTAL	60	

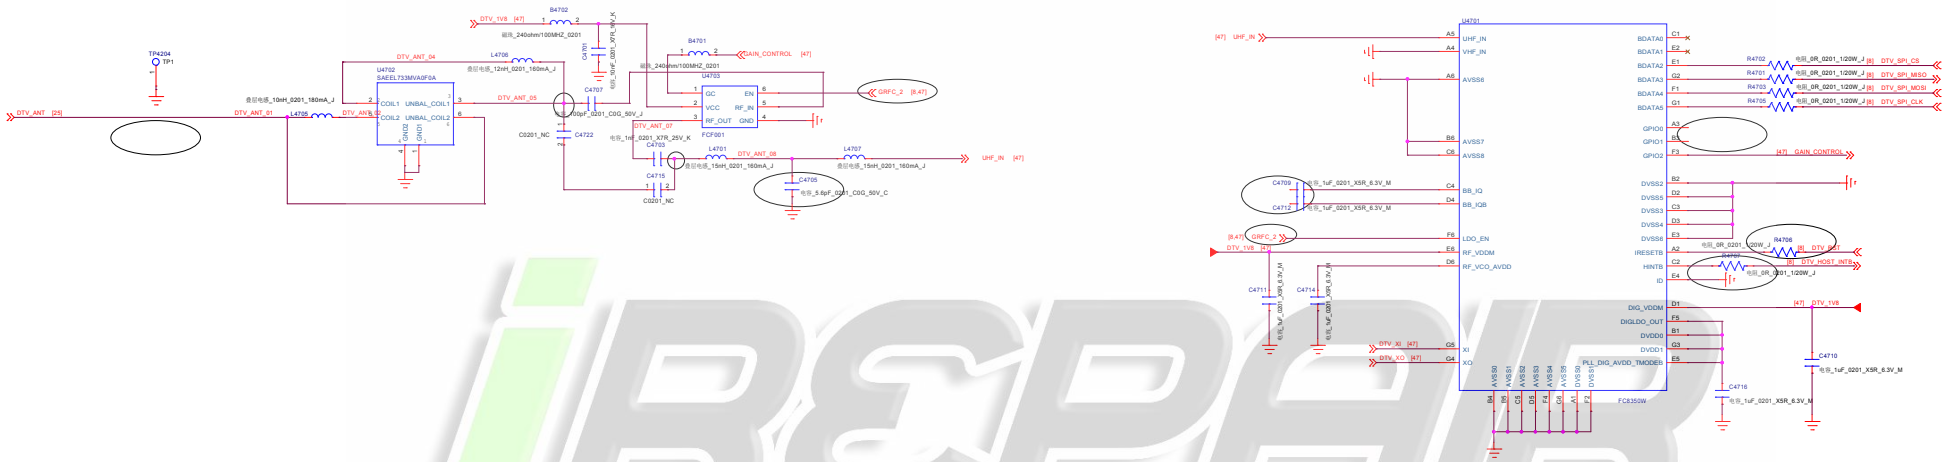

26MHz crystal

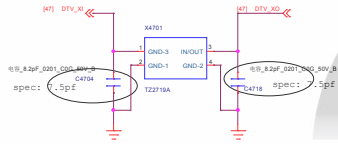

DTV LDO 1.8V

