

Company: Huzijn	
Block Title	Block Diagram
Project	Rev. 1.0

I2C Configuration Table

I2C	GPIO	Function	Material	I2C Slave Address(7-bit mode)
SPK_I2C_SDA/CLK	GPIO 4/GPIO 5	Smart PA	FS1862(1st)	0x34
			TAS2558(2nd)	0x4C
		Sar sensor	98T346HW (1st)	0x20
			SX9325 (2nd)	0x26
GSENSOR_I2C_SDA/SCL	GPIO 22/GPIO 23	TOF	VL53L1CBV0FY/1	0x52
		A+G	LSM6DSOX (1st)	0x6A
SENSOR_I2C_SDA/SC	GPIO 28/GPIO 29	M sensor	ICM-42605 (2nd)	0x10
			AK0991B(1st)	0x0C
		PS	MMCS603NJ(2nd)	0x30
			LTR-256SALS-WA(1st)	0x23
		ALS	TBD(2nd)	TBD
			TSL2540(1st)	0x39
			MS29005(2st)	0x49

SPI Configuration Table

SPI	Function
QUD1, SE3	LCD interface
QUD1, SE1	FPS interface

I2S Configuration Table

I2S	Function
I2S	AUDIO PA interface

Sheet	Content	Sheet	Content
01.	Block Diagram	24.	AUDIO_MIC_RCV_SPK
02.	I2C Configuration Table	25.	AUDIO_HEADSET
03.	Table of Content	26.	SENSORS_MOTOR
04.	GPIO MAP	27.	LCD_TP
05.	SM6125 Control/UFS/SDC1/SDC2	28.	REAR_CAM/FLASH
06.	SM6125 LPDDR4	29.	FRONT_CAM/CAM_POWER
07.	SM6125 CSI/DSI	30.	SIM_SD_KEY_LINK_BATT
08.	SM6125 GPIO (Internal Codec)	31.	DTV
09.	SM6125 Power (Core)	32.	NFC
10.	SM6125 Power (Other, LP4X)	33.	PRIMARY_ANTENNA
11.	SM6125 Ground	34.	PA & PA THERMAL
12.	PM6125 CLKS/Control_GND	35.	TRX_LB
13.	PM6125 Buck Converter1	36.	TRX_MHB
14.	PM6125 Buck Converter2	37.	DIVERSITY_ANT
15.	PM6125 LDO	38.	DRX_MB_HB
16.	PM8008 and Bob	39.	DRX_LB
17.	SIM_SD	40.	SDR660_MSS
18.	PMI632 Control/Display/GPIO	41.	SDR660_PWR
19.	PM660L Display	42.	SDR660_DA/PRX/DRX/FBRX
20.	eMCP	43.	QFE410I
21.	30W CHARGE	44.	WIFI_2.4G_5G & BT
22.	AOV	45.	GPS
23.	Test Points	46.	WCN3980



GPIO MAP

SDM630 GPIO Configuration

GPIO_0	BLSP_SPI_MOSI_1	GPIO_42	NC	GPIO_84	UIM2_CLK
GPIO_1	BLSP_SPI_MISO_1	GPIO_43	NC	GPIO_85	UIM2_RESET
GPIO_2	BLSP_SPI_CSI_N_1	GPIO_44	NC	GPIO_86	UIM2_PRESENT
GPIO_3	BLSP_SPI_CLK_1	GPIO_45	NC	GPIO_87	UIM1_DATA
GPIO_4	BLSP_UART_TX_2	GPIO_46	CAM0_RST_N	GPIO_88	UIM1_CLK
GPIO_5	BLSP_UART_RX_2	GPIO_47	CAM1_RST_N	GPIO_89	UIM1_RESET
GPIO_6	BLSP_I2C_SDA_2	GPIO_48	CAM2_RST_N	GPIO_90	UIM1_PRESENT
GPIO_7	BLSP_I2C_SCL_2	GPIO_49	NC	GPIO_91	UIM_BATT_ALARM
GPIO_8	BLSP_SPI_MOSI_3	GPIO_50	CAM_AF_VDD_EN	GPIO_92	NC
GPIO_9	BLSP_SPI_MISO_3	GPIO_51	CAM_AVDD_EN	GPIO_93	NC
GPIO_10	BLSP_SPI_CS_N_3	GPIO_52	NC	GPIO_94	NC
GPIO_11	BLSP_SPI_CLK_3	GPIO_53	LCD0_RESET_N	GPIO_95	NC
GPIO_12	NC	GPIO_54	SD_CARD_DET_N	GPIO_96	WDOG_DISABLE
GPIO_13	KEYPAD_LED_PWM	GPIO_55	DP_EN_N	GPIO_97	NC
GPIO_14	BLSP_I2C_SDA_4	GPIO_56	USBC_ORIENTATION	GPIO_98	NC
GPIO_15	BLSP_I2C_SCL_4	GPIO_57	FORCED_USB_BOOT	GPIO_99	QLINK_REQUEST
GPIO_16	BLSP_UART_TX_5	GPIO_58	USB_PHY_PS	GPIO_100	QLINK_ENABLE
GPIO_17	BLSP_UART_RX_5	GPIO_59	MDP_VSYNC_P	GPIO_101	RFFE1_DATA - SDR660 debug
GPIO_18	BLSP_UART_CTS_N_5	GPIO_60	NC	GPIO_102	RFFE1_CLK - SDR660 debug
GPIO_19	BLSP_UART_RFR_N_5	GPIO_61	NC	GPIO_103	RFFE2_DATA - (41)QAT3533
GPIO_20	FP_SUB_RESET	GPIO_62	NC	GPIO_104	RFFE2_CLK - (41)QAT3533
GPIO_21	SMB_STAT	GPIO_63	NC	GPIO_105	NC
GPIO_22	BLSP_I2C_SDA_6	GPIO_64	NC	GPIO_106	NC
GPIO_23	BLSP_I2C_SCL_6	GPIO_65	NC	GPIO_107	RFFE4_DATA-(45)QSW8574,(48)RF1656SR
GPIO_24	CDC_SWR_CLK	GPIO_66	TS_RESET_N	GPIO_108	RFFE4_CLK -(45)QSW8574,(48)RF1656SR
GPIO_25	CDC_SWR_DATA	GPIO_67	TS_INT_N	GPIO_109	RFFE5_DATA-(52)QAT3514,(52)QAT3550,(47)QAT3522
GPIO_26	WSA_SPKR_SD_N_1	GPIO_68	ACC_GYRO_DATA_AVA_INT_N	GPIO_110	RFFE5_CLK-(52)QAT3514,(52)QAT3550,(47)QAT3522
GPIO_27	NC	GPIO_69	ACC_GYRO_MOT_INT_N	GPIO_111	RFFE6_DATA - (46)QET4101 ch0,(41)QPA4361
GPIO_28	NFC_IRQ	GPIO_70	MAG_INT_N	GPIO_112	RFFE6_CLK - (46)QET4101 ch0,(41)QPA4361
GPIO_29	NFC_EN	GPIO_71	ALSP_INT_N	GPIO_113	NC
GPIO_30	NFC_DWL_REQ	GPIO_72	FP_INT_N_1	LPI_GPIO_0	LPI_SPI_1_CSI_N
GPIO_31	NFC_ESF_PWR_REQ	GPIO_73	NC	LPI_GPIO_1	LPI_PWR_EN
GPIO_32	CAM_MCLK0	GPIO_74	NC	LPI_GPIO_2	LPI_I2C_3_SDA
GPIO_33	CAM_MCLK1	GPIO_75	NC	LPI_GPIO_3	LPI_I2C_3_SCL
GPIO_34	CAM_MCLK2	GPIO_76	NC	LPI_GPIO_4	LPI_SPI_2_CS_N
GPIO_35	NC	GPIO_77	AUDIO_USBC_EN2_N	LPI_GPIO_5	LPI_SPI_2_CLK
GPIO_36	CCI_I2C_SDA0	GPIO_78	WMSS_RESETN	LPI_GPIO_6	LPI_SPI_2_MOSI
GPIO_37	CCI_I2C_SCL0	GPIO_79	PWM_CNTRL	LPI_GPIO_7	LPI_SPI_2_MISO
GPIO_38	CCI_I2C_SDA1	GPIO_80	AUDIO_USBC_EN1	LPI_GPIO_8	LPI_SPI_1_CS_N
GPIO_39	CCI_I2C_SCL1	GPIO_81	MSS_LTE_COXM_TXD	LPI_GPIO_9	LPI_SPI_1_CLK
GPIO_40	NC	GPIO_82	MSS_LTE_COXM_RXD	LPI_GPIO_10	LPI_SPI_1_MOSI
GPIO_41	FL_STROBE_TRIG	GPIO_83	UIM2_DATA	LPI_GPIO_11	LPI_SPI_1_MISO


LPI_GPIO_12	LPI_UART_1_TX
LPI_GPIO_13	LPI_UART_1_RX
LPI_GPIO_14	NC
LPI_GPIO_15	NC
LPI_GPIO_16	NC
LPI_GPIO_17	NC
LPI_GPIO_18	CDC_PDM_CLK
LPI_GPIO_19	CDC_PDM_SYNC
LPI_GPIO_20	CDC_PDM_TX
LPI_GPIO_21	CDC_PDM_RX0
LPI_GPIO_22	CDC_PDM_RX0_COMP
LPI_GPIO_23	CDC_PDM_RX1
LPI_GPIO_24	CDC_PDM_RX1_COMP
LPI_GPIO_25	CDC_PDM_RX2
LPI_GPIO_26	CDC_DMIC_CLK1
LPI_GPIO_27	CDC_DMIC_DATA1
LPI_GPIO_28	CDC_DMIC_CLK2
LPI_GPIO_29	CDC_DMIC_DATA2
LPI_GPIO_30	LPI_QCA_SB_CLK
LPI_GPIO_31	LPI_QCA_SB_DATA0

PM660 GPIO Configuration			
GPIO_1	OPTION1	GPIO_8	SLB
GPIO_2	DIV_CLK2	GPIO_9	WUSB_TYPEC
GPIO_3	NC	GPIO_10	WCSS_VCTRL
GPIO_4	NFC_CLK_REQ	GPIO_11	HOMEKEY_FP_PM_INT
GPIO_5	WLAN_SW_CTRL	GPIO_12	WIPWR_MODE
GPIO_6	SLP_CLK	GPIO_13	PM_A_GPIO_13
GPIO_7	UIM_BATT_ALARM		



PM660A GPIO Configuration			
GPIO_1	OPTION2	GPIO_8	SD_CARD_DET_N
GPIO_2	LPI_PWR_EN	GPIO_9	WCSS_VCTRL
GPIO_3	FRONT_CAM_DVDD_EN	GPIO_10	SLB
GPIO_4	REAR_CAM_DVDD_EN	GPIO_11	LP4x_CTRL
GPIO_5	NC	GPIO_12	LP4x_MODE
GPIO_6	FP_VDD_EN		
GPIO_7	KEY_VOL_UP_N		

Company Header			
Doc No	GPIO MAP		
Project	Table	Rev	1.0
Date	2025-07-23	Page	4 of 4


Company: Huxign			
Block Title: SOM330 Control/IFS/SOC1/SOC2			
Project: Teller		Rev: 1.0	
Date: Saturday, July 27, 2019	Sheet: 5	of 48	

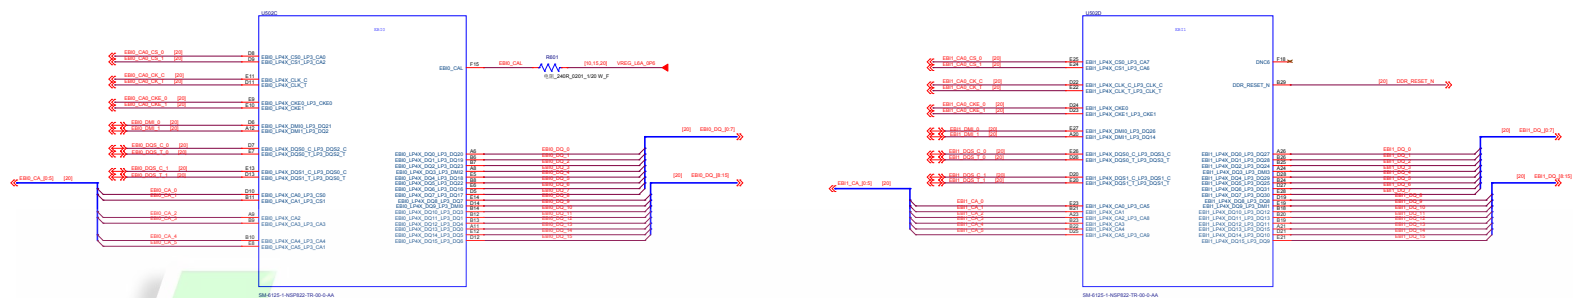The logo for iR&P AIR is displayed in a large, stylized font. The 'i' is green with a white outline, while the 'R&P AIR' is grey with a white outline. The letters have a 3D effect with shadows.

Company: Huesgen		
Block Title: SOM630 LPCOR4		
Project: Teller	Rev: 1.0	
Date: Saturday, July 27, 2013	Sheet: 6 of 46	

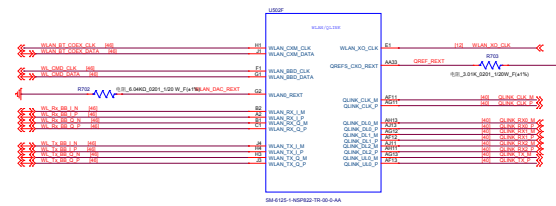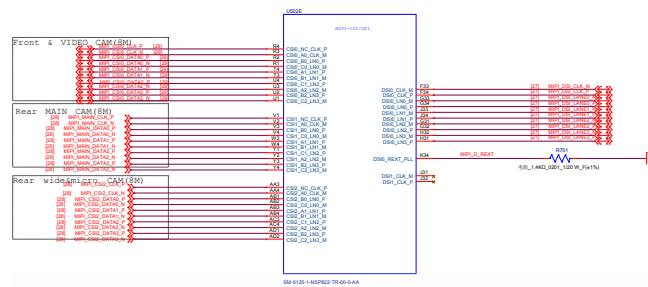The logo for iREPAIR is located at the bottom of the page. It features the word "iREPAIR" in a stylized, italicized font. The letter "i" is green, while "REPAIR" is grey. The letters have a white outline and a slight 3D effect.

Company Name		
Block Title		
SOME30 CSWGS		
Project	Teller	Rev 1.0
Date:	Saturday, July 27, 2019	Sheet 7 of 46

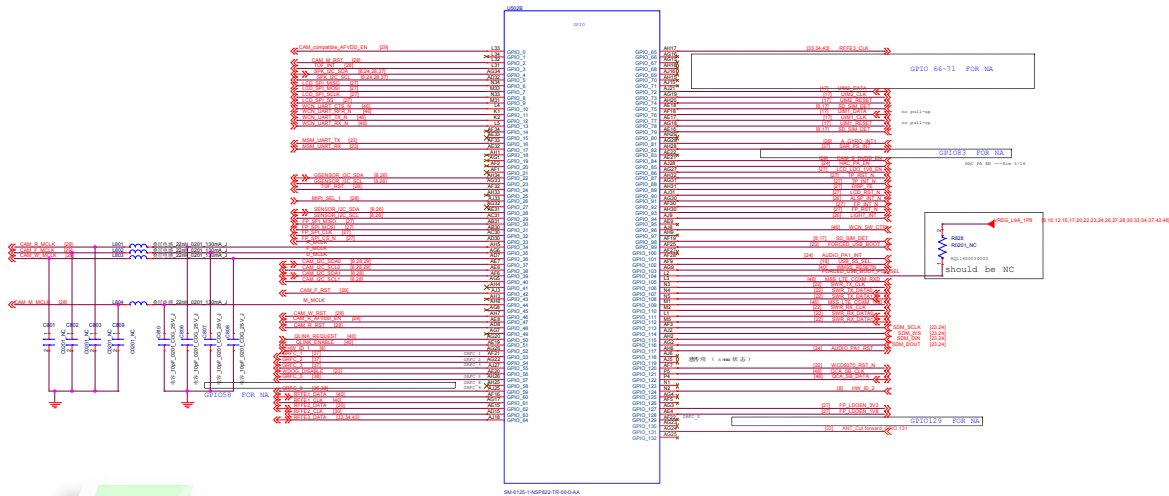

GPIO_56	BOOT_CONFIG0	WDOG_DISABLE
GPIO_87	BOOT_CONFIG1	FASTBOOT_SEL0
GPIO_32	BOOT_CONFIG2	FASTBOOT_SEL1
GPIO_118	BOOT_CONFIG3	FASTBOOT_SEL2
GPIO_66	FORCED_USB_BOOT	
GPIO_104	FORCED_USB_BOOT_POL_SEL	



BOOT OPTIONS	BOOT CONFIG BITS
0: Default (MMC-SD+USB)	0 0 0
1: SD+MMC+USB	0 0 1
2: SD+USB	0 1 0
3: USB	0 1 1
4: USB+SD+MMC	1 0 0
5: SD+USB+MMC	1 0 1
6: USB+MMC	1 1 0
7: USB+MMC+SD	1 1 1

Hardware ID




I2C pull up



Company Name	
Rev	1.0
Date	2023-07-10
Rev	1.0

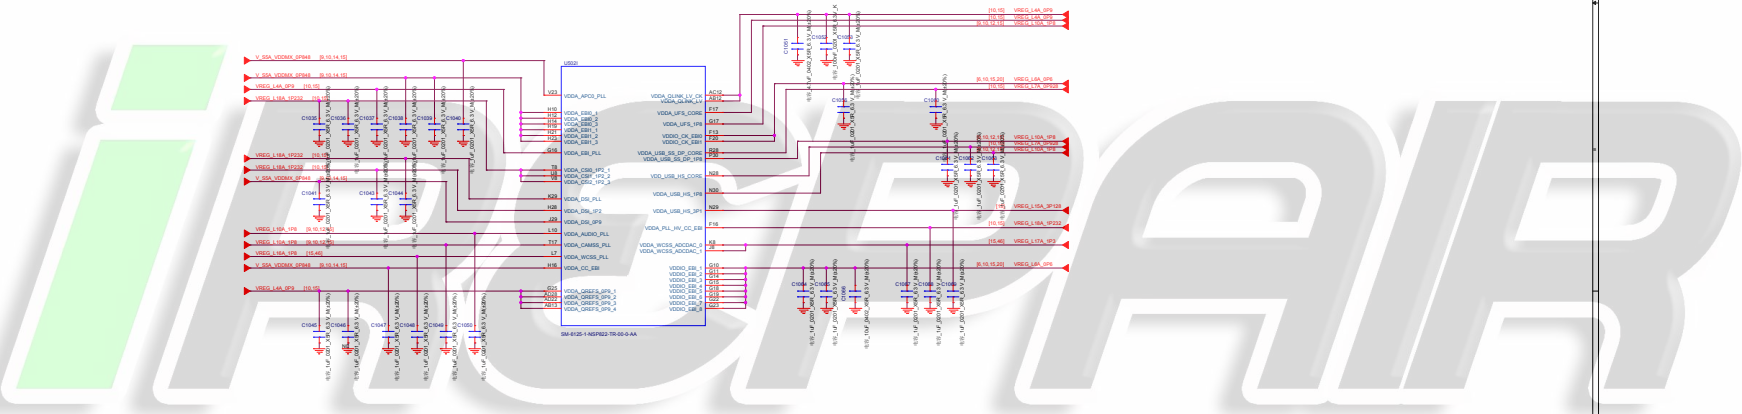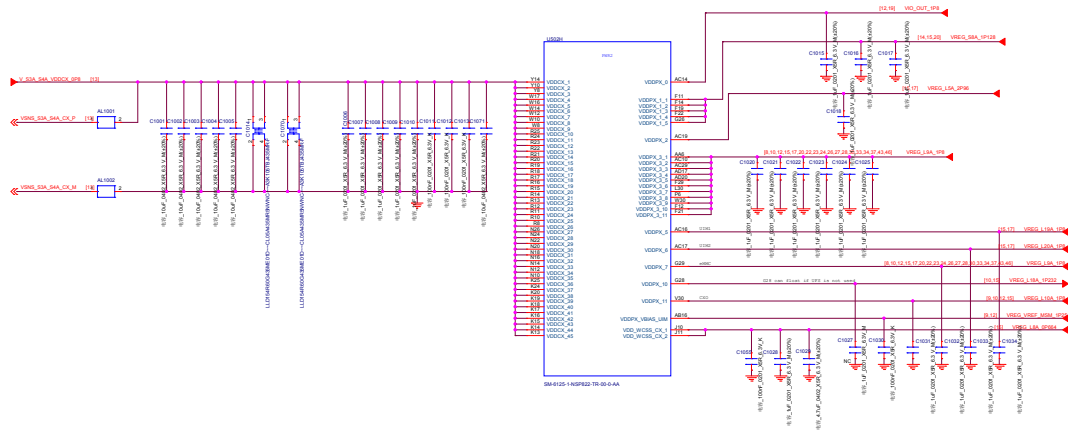


Company: Shenzhen		
Rev: 1.0	Rev: 1.0	Rev: 1.0
Project: SM6125 Power (Other, LP4X)	Rev: 1.0	Rev: 1.0
Date: 2023-07-12	Rev: 1.0	Rev: 1.0

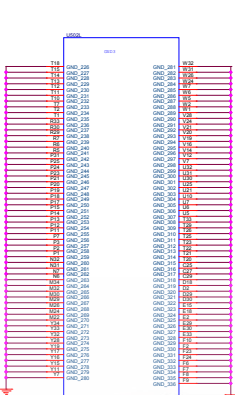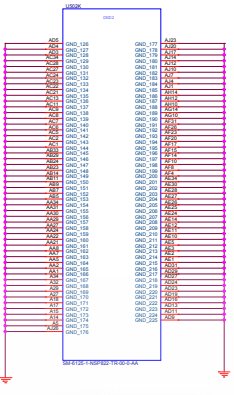
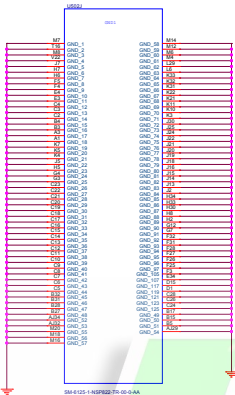


REPAIR

Company / Brand			
Rev. 1.0			
Date: 2024-01-10			
Page: 1 of 1			

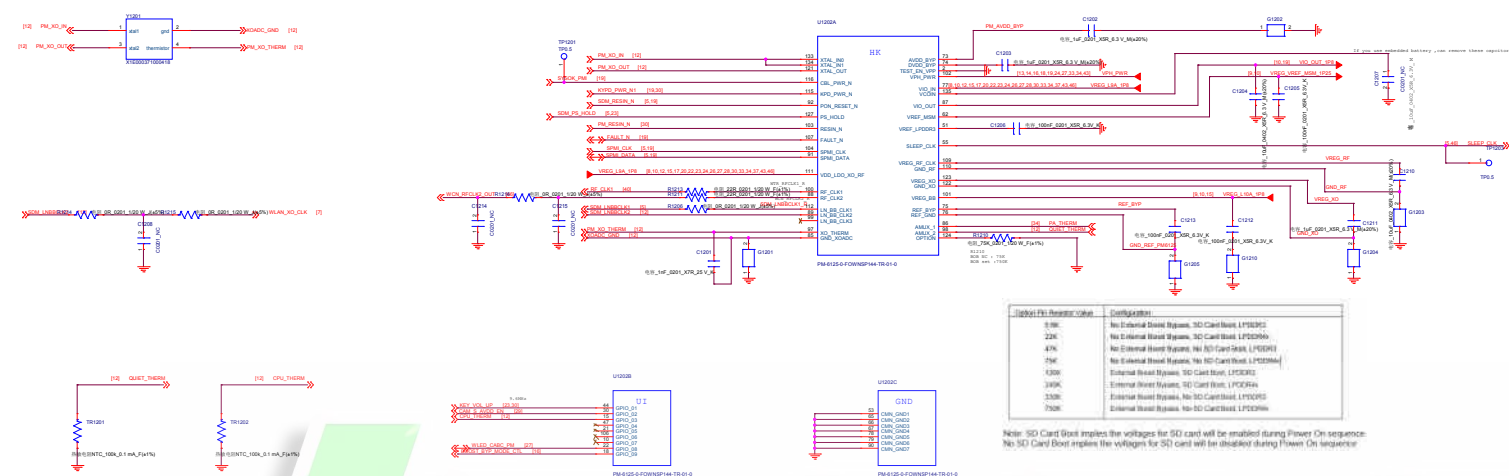

Company: Harsco	
Block Title: PM550 CL/Ka/Control_GND	
Project: Teller	Rev: 1.0
Date: 2/20/2003	By: [signature]

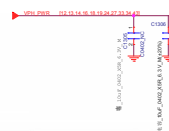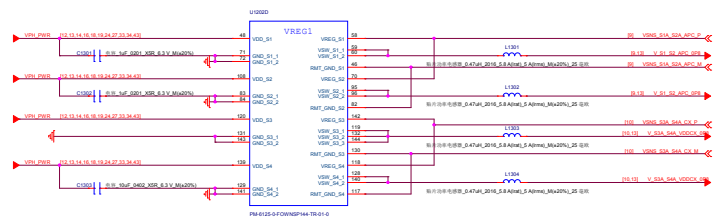

Nicobar Power Grid v1.31 10/31/2018


53A-2A:	FT5510	0.8V default	8000mA peak	8110.00mA	APC
53A-4A:	FT5510	0.8V default	8000mA peak	8480mA	CX, MCOEM
55A:	HF5510	0.912V default	4000mA peak	3620.00mA	EBI, MX, LDO
56A:	HF5510	1.352V default	4000mA peak	1560mA	LDO
57A:	HF5510	2.04V default	2500mA peak	2350mA	LDO
58A:	FT5510	1.126V default	4000mA peak	1790.00mA	LDO, LPDDR4

The logo for iRCPAIR is displayed in a large, stylized font. The 'i' is green with a white outline, while the 'RCPAIR' part is grey with a white outline. The font is bold and italicized, giving it a dynamic feel.


 1-800-285-5748
 www.ti.com

S3A-4A:	FT5510	0.8V default	800mA Ipeak	5480mA	CX, MODEM
S5A:	HF5510	0.912V default	4000mA Ipeak	3620.00mA	EBI, MX, RLDO
S6A:	HF5510	1.352V default	4000mA Ipeak	1550mA	LDO
S7A:	HF5510	2.04V default	2500mA Ipeak	2350mA	LDO
S8A:	FT5510	1.125V default	4000mA Ipeak	1750mA	LDO, LPCDR4x

Company Name			
Block Title			
Project		Teller	
Date		Rev 1.0	
Schedule July 27, 2019		Sheet 31 of 46	

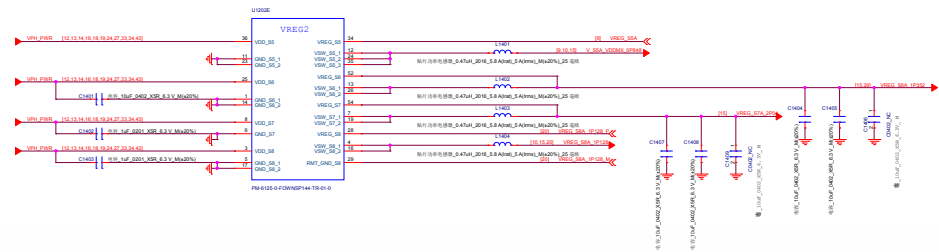


iRCPAIR

Company Name		
Rev. No.	PM6125 LDO Circuit	
Project	Table	Rev. 1.0
Date	2023/05/12 14:03	2023/05/12 14:03







LDO1(L596),LDO2(L13),LDO3(L14),LDO4(L15),LDO5(L20),LDO6(L21),LDO7(L23),LDO8(L24) is the Pseudo-capless LDO, so can the CAP is BOM
 PSEUDO-CAPLESS LDOs
 For a real non-capless-capless, CAP is not the best load
 For CAPLESS LDOs, if output on the load 500 (20-100)
 within 100.00 ohm, load control the load drops to the 100T

Company Name			
Block Title PM990 Charge_FG			
Project Teller		Rev 1.0	
Date:	Monday, July 26, 2010	Sheet	15 of 46

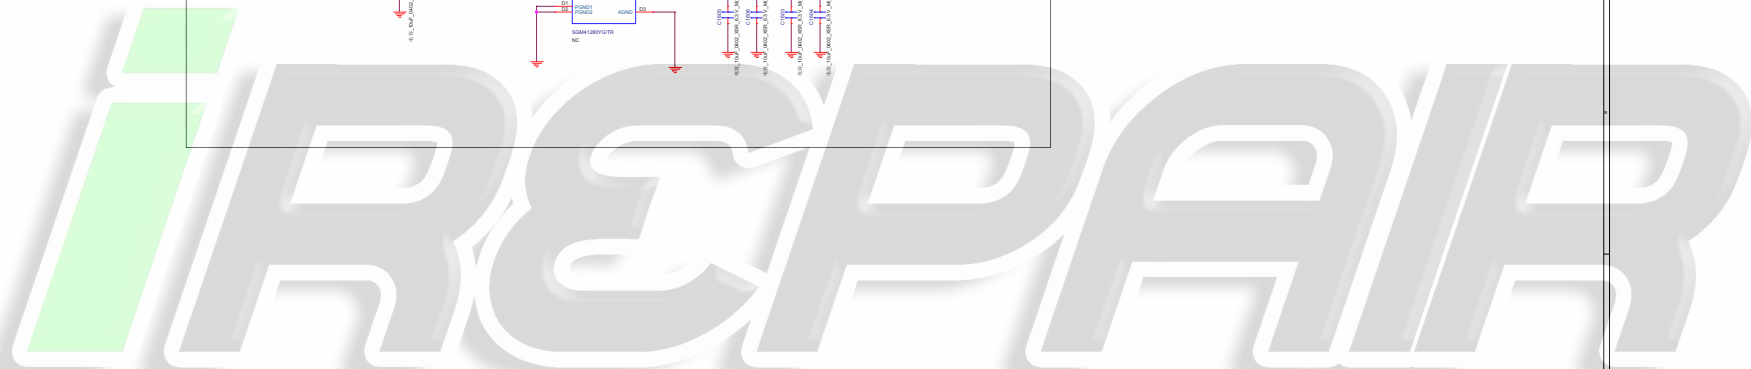


Company: Huesgen	
Block Title: PMBXXL Control and Bob_Flash	
Project: Teller	Rev: 1.0
Date: Saturday, July 27, 2019	Sheet: 16 of 46

Company: Huggins	
Block Title: PMSBL Buck and LDO	
Project: Teller	Rev: 1.0
Editor: Schmitz, J.A. 3/1/2015	Good: 17 of 20

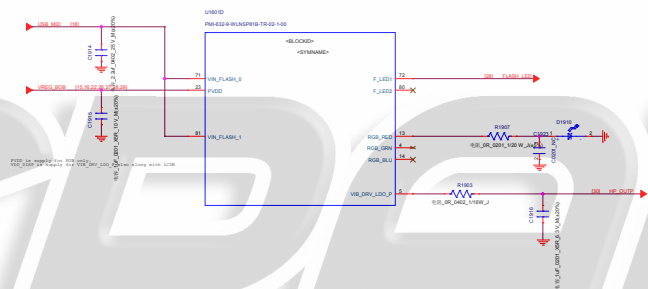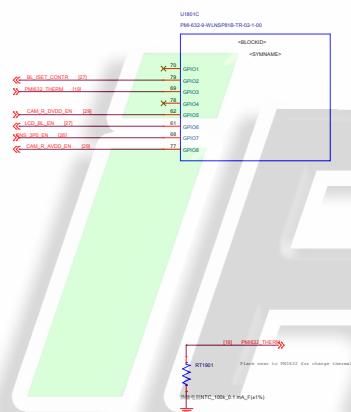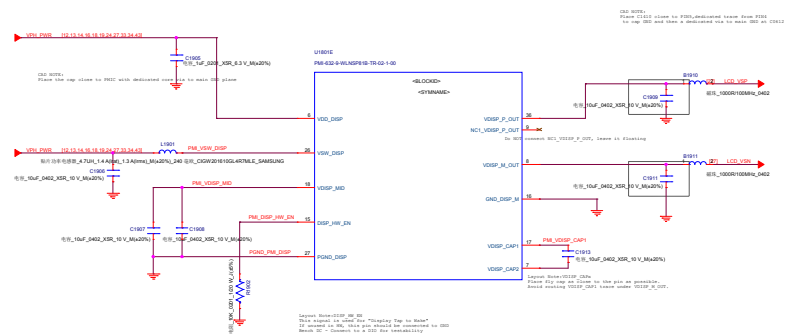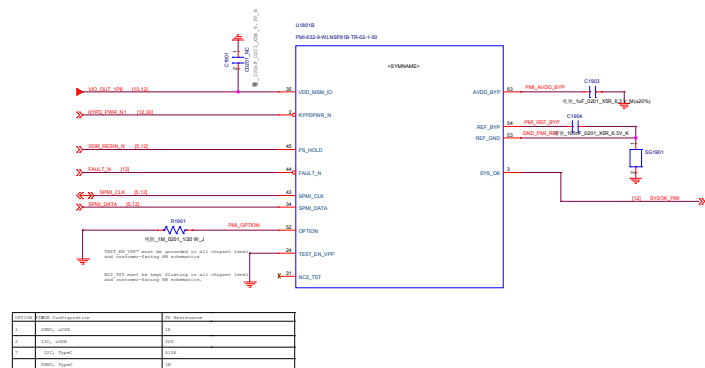


Company Name	
Block Title PMBOL Display	
Project	Rev 1.0
Date	Sheet 10 of 45

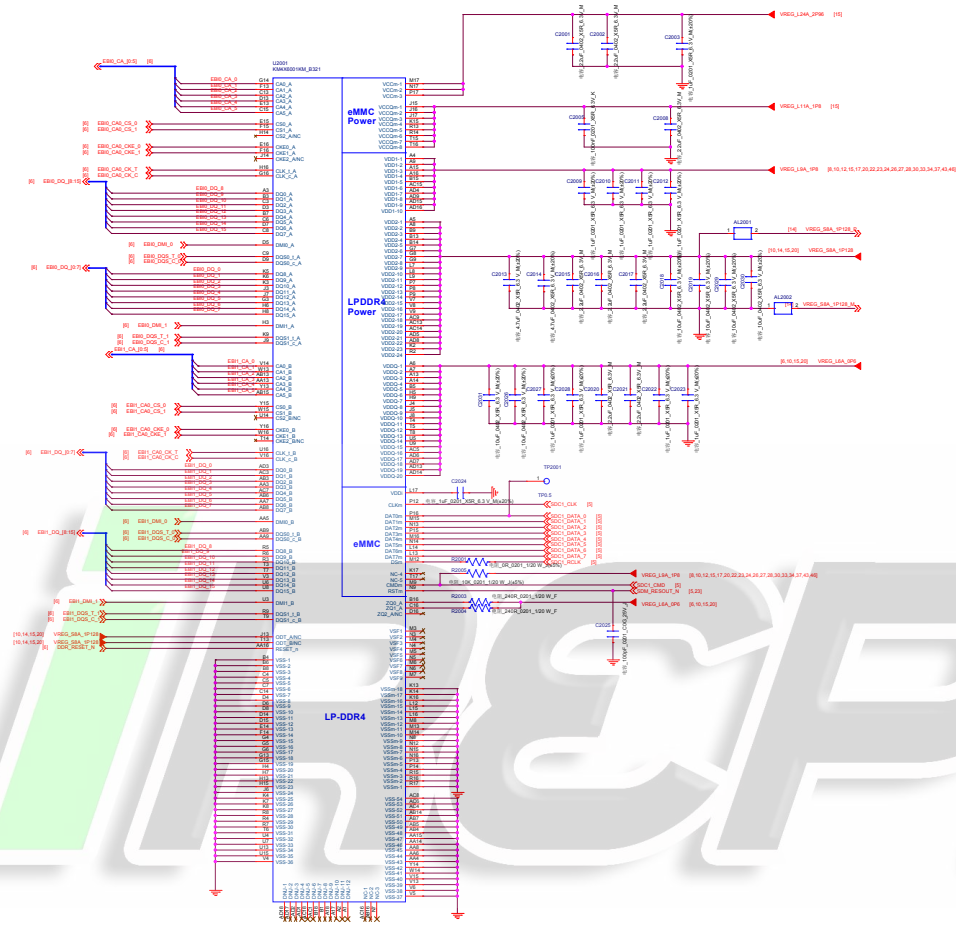

Company: Huesgen	
Block Title: eMCP	
Project: Teller	Rev: 1.0
Date: Saturday, July 27, 2019	Sheet: 20 of 48



Company Number		
Stock No	NEW CHARGE	
Project	Task	Rev: 1.0
Date	2025-07-24 10:03	Page 1 of 1

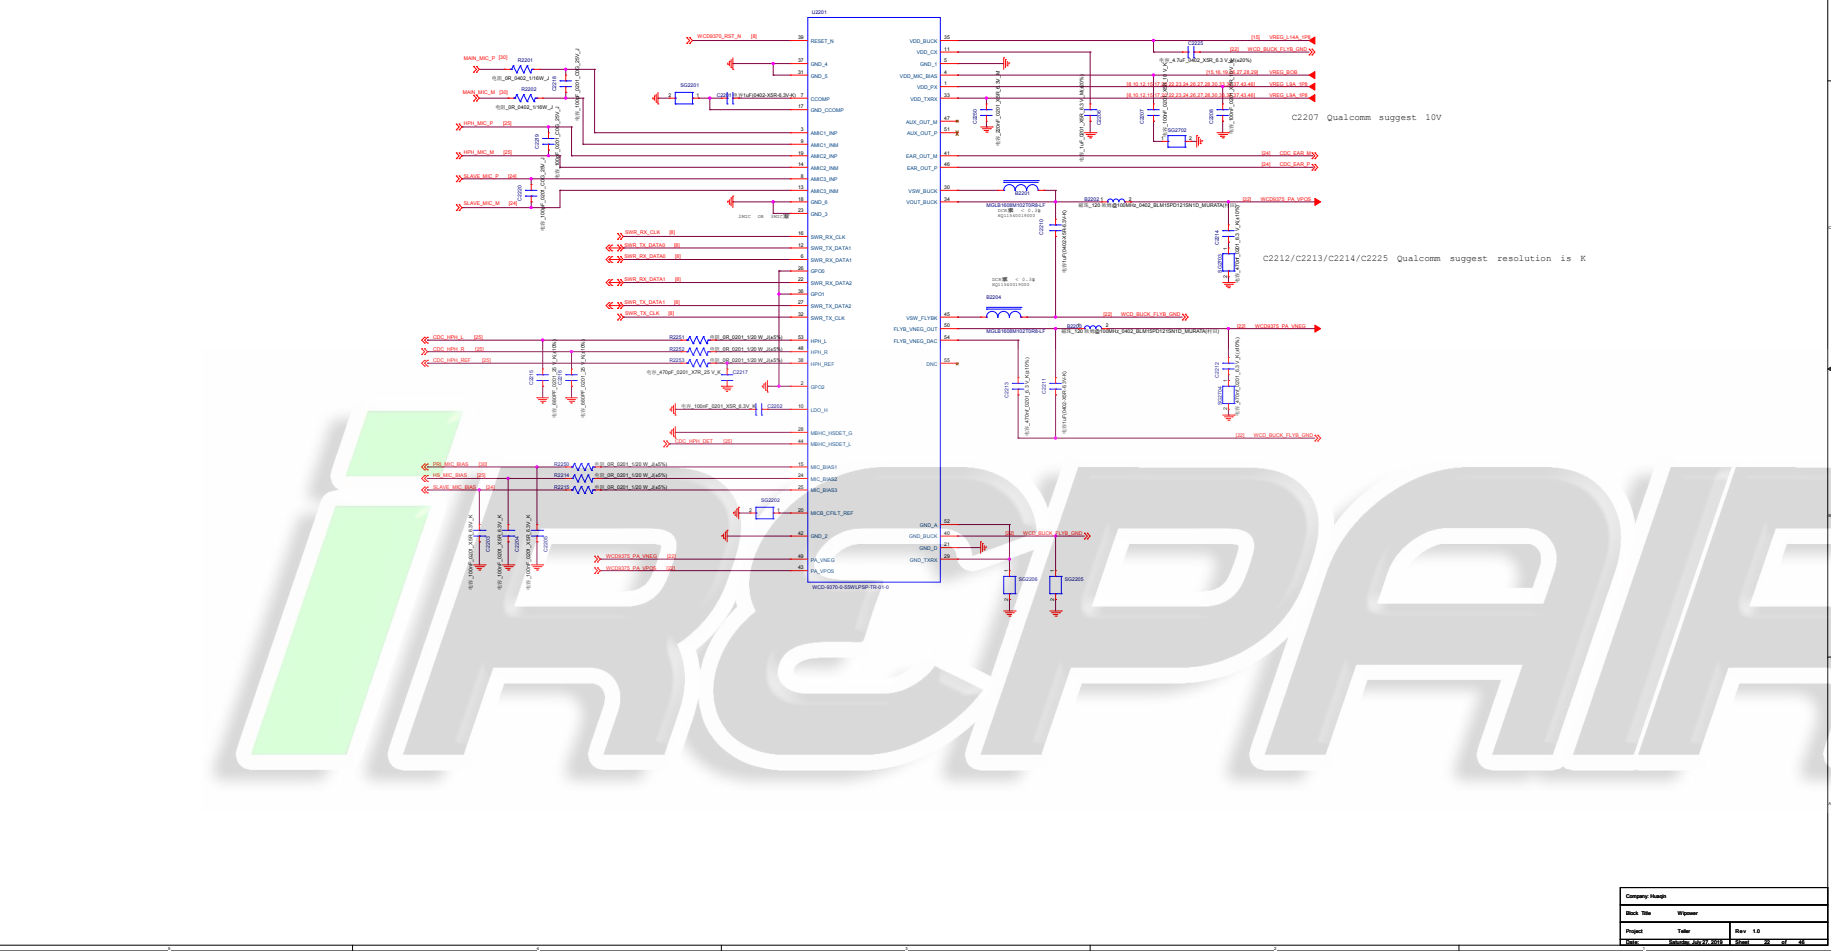


Company Name	
Ref No	2201-2299
Project	Table
Date	2023-07-10


I2S test point




UART




Side key

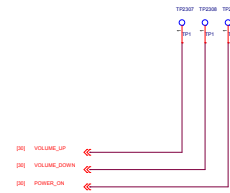

VBUS

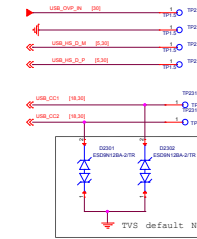


JTAG DEBUG CONNECTOR

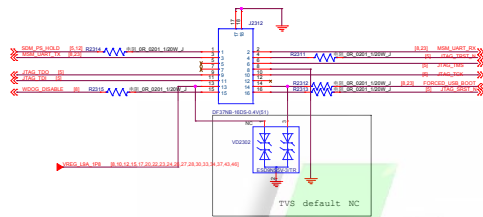


FORCE_BOOT



VBAT



power key +volup to enter 9008 mode

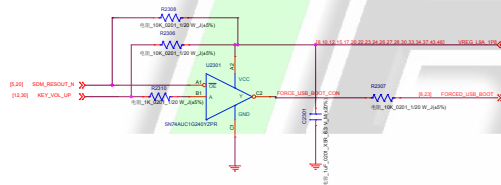

Shielding



MARK





TP/GND/Shielding

Company Name	
Block Name	Test Points
Project	File
Date	Rev: 1.0
Drawn	Checked


Speaker SMART PA

IIC Address
1nd TAS2558 0x4C
2ST FS1862 0x34


slave MIC

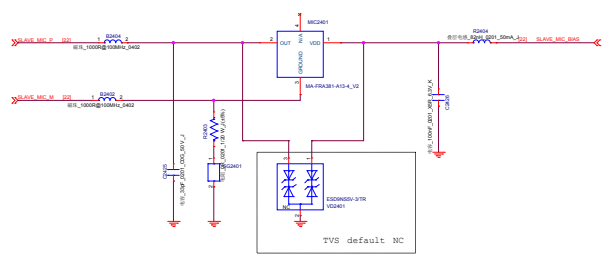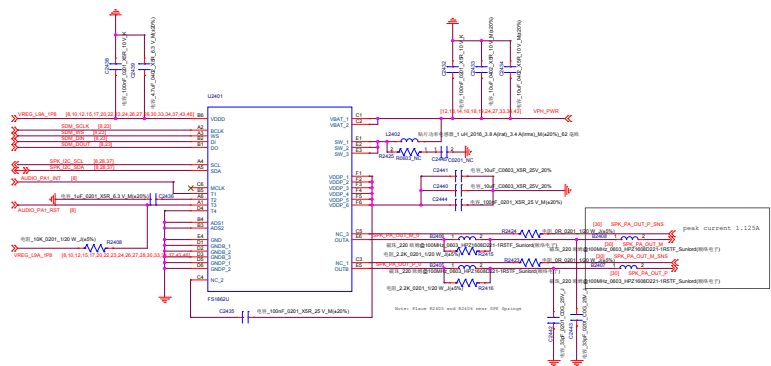

Receiver & HAC

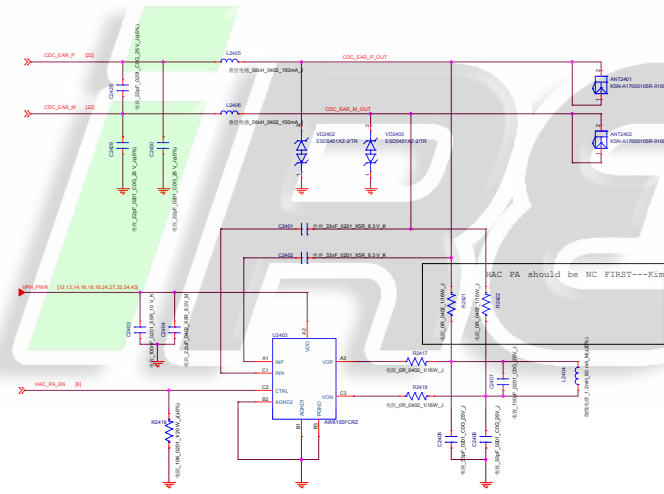


HAC BOM list			
	HAC NC	HAC	
		PA NC	PA
C2401	NC	Y	Y
C2402	NC	Y	Y
C2403	NC	NC	Y
C2404	NC	NC	Y
C2405	NC	NC	Y
C2406	NC	Y	Y
C2407	NC	Y	Y
R2417	NC	NC	Y
R2418	NC	NC	Y
R2419	NC	NC	Y
R2421	NC	Y	NC
R2422	NC	Y	NC
L2404	NC	Y	Y
U2403	NC	N	Y

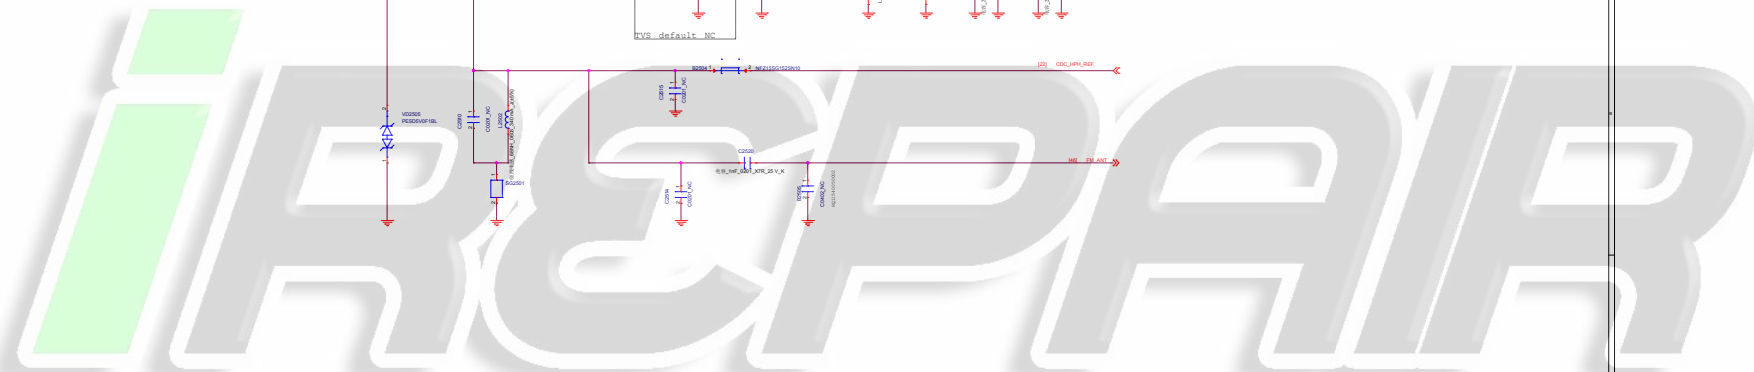

Company: Huesh	
Block Title: AUDIO_HEADSET	
Project: Teller	Rev: 1.0


Magnetic Sensor

- 1st AK09918
- 2nd MMC5603NJL (Outline bigger)

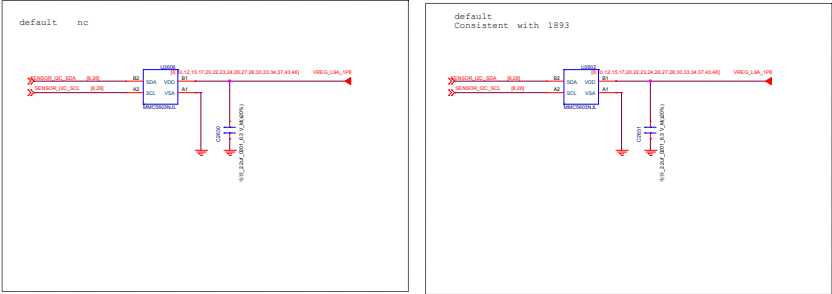



GROY Sensor

- 1st ST LSM6DSOW
- 2nd InvenSense ICM-42605

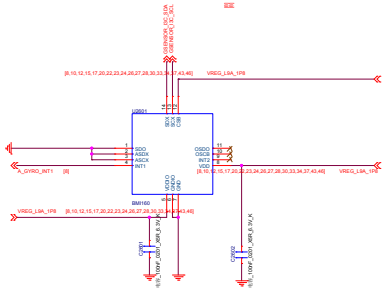

PS&ALS Sensor


- Psensor:
- 1st LTR-2568ALS-WA
- A L S :
- 1st TSL2540
 - 2nd MN29005

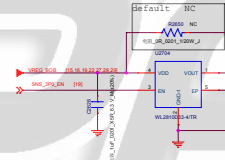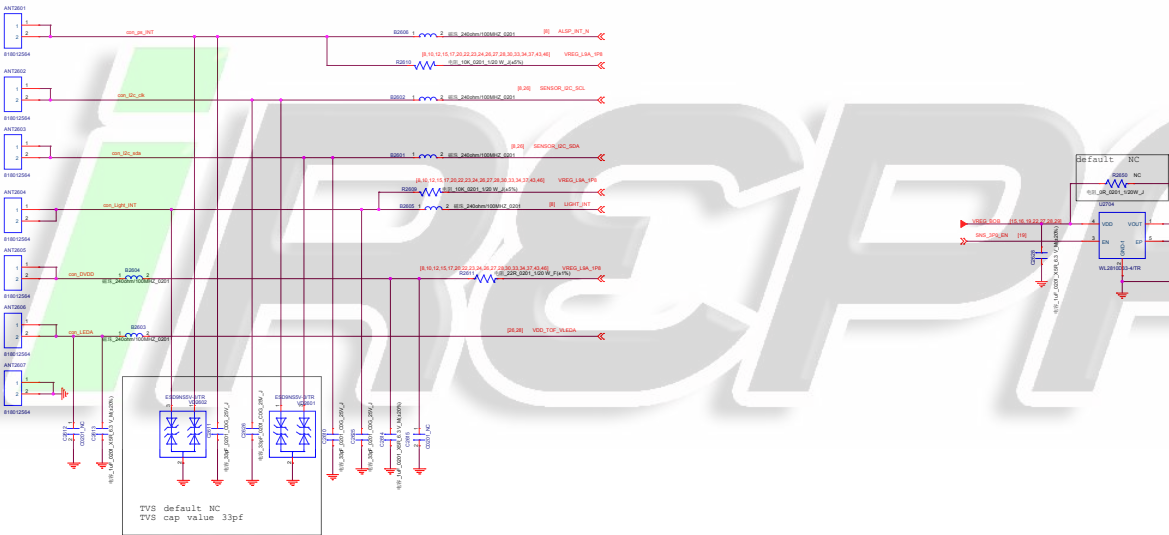


Company Name	
Rev No	REV001_000001
Project	Task
Date	2024-07-10

LCD MIPI Common Mode Filter

default EMIFilter

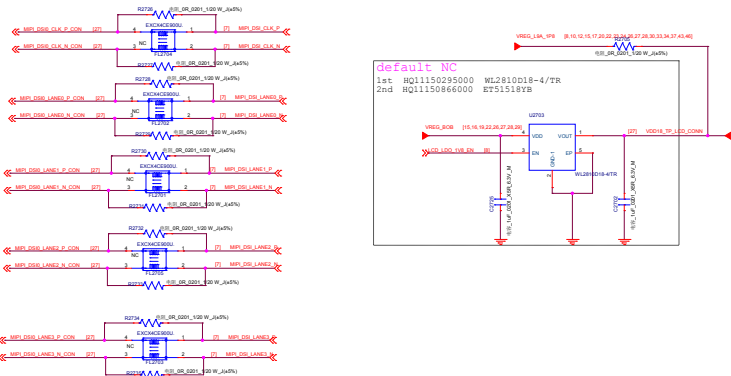


LCD/TP-Connector

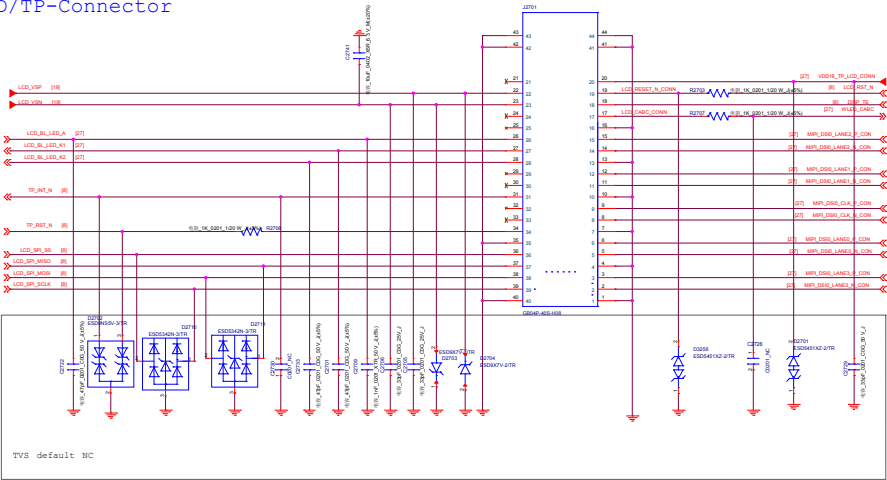


LCD BL driver






1st AW9963CSR HQ11151049000
2nd SGM3743YG/TR HQ11150166000

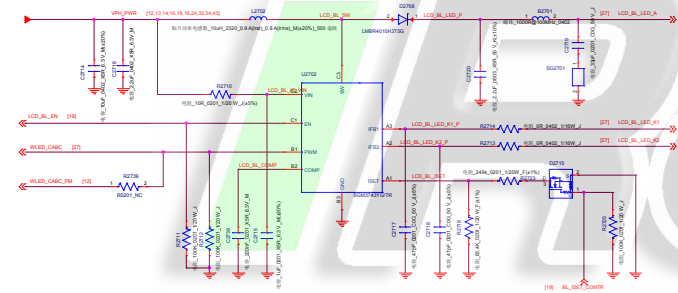


FPS-Connector

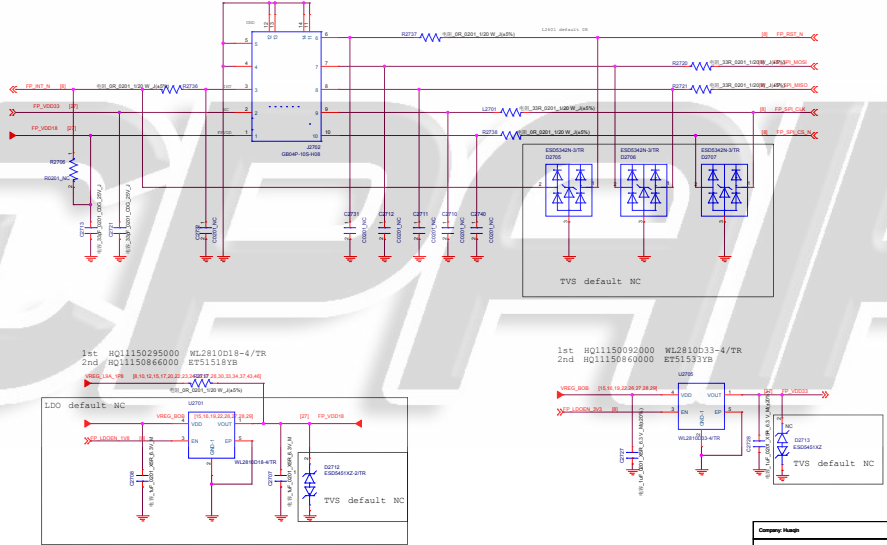

Company Header		
Rev	Rev	Rev
1.0	1.0	1.0
1.0	1.0	1.0

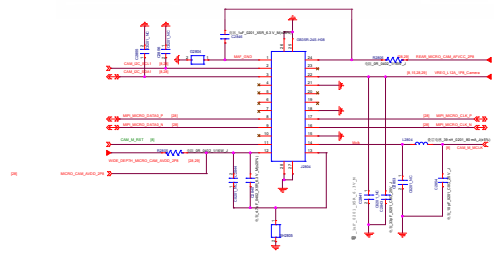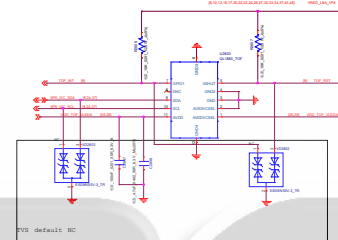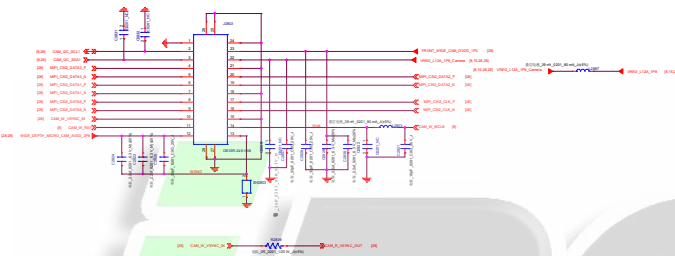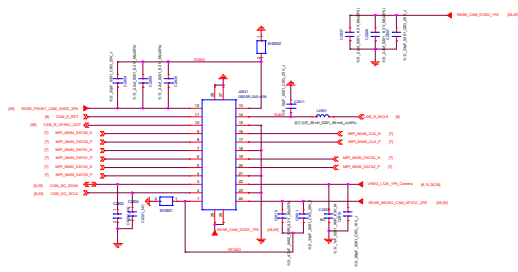

1st: 8Q1110405000 8Q544602516/TS
2nd: 8Q11170414000 8Q4448025

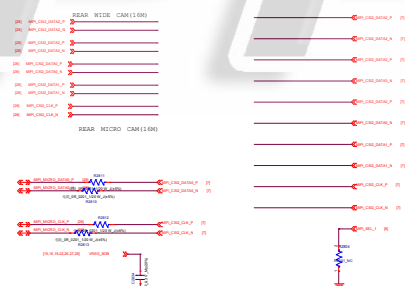

MIPI SWITCH		
	WIDE CAMERA (16M)	MICRO CAMERA (2M)
SEL:	0	1


CSI line mapping when a 4-lane interface is configured as 2-lane
pin 1-lane interface

* DCLK == DCLK_A
* D0 == D0_A
* D1 == D1_A
* D2 == D2_A
* D3 == D3_A

CSI line mapping when a 4-lane interface is configured as 1-lane
pin 1-lane interface


* DCLK == DCLK_A
* D0 == D0_A
* D1 == D1_A
* D2 == D2_A
* D3 == D3_A

FRONT CAMERA

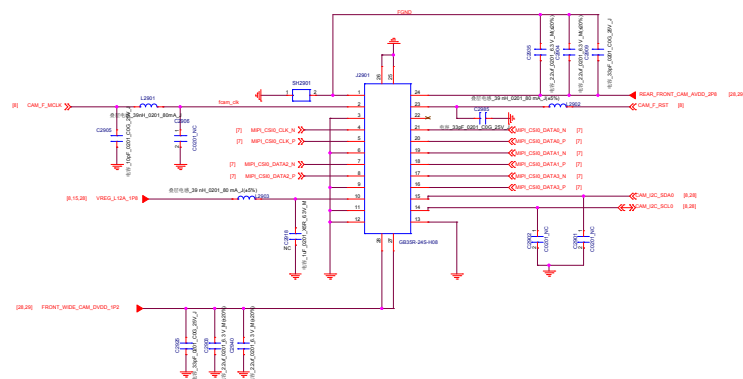


Rear	DVDD	1.2V
------	------	------

1st	HQ11150936000	WL2831D12-4/TR
2nd	HQ11151048000	SGM2038-1.2XUDY4G/TR

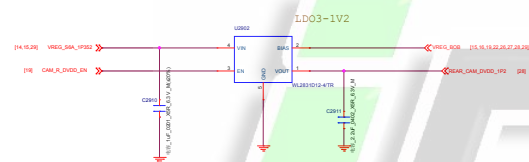


Rear&MICRO AFVCC 2.8V

1st	HQ11150859000	ET51528YB
2nd	HQ11150979000	WL2820X28-4/TR

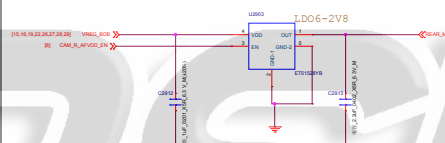


Rear & Front AVDD 2.8V

1st HQ11150859000 ET51528YB
2nd HQ11150979000 WL2820X28-4/TR

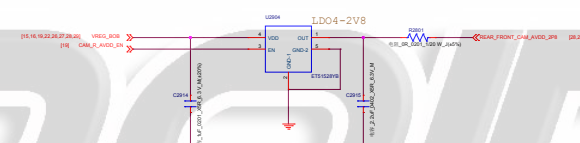


MICRO_CAM_AVDD_2P8

1st	HQ11150859000	ET51528YB
2nd	HQ11150979000	WL2820X28-4/TR

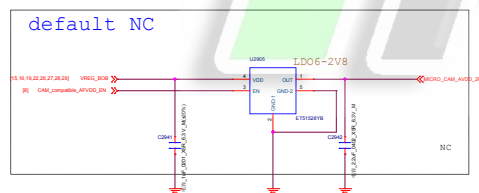


WIDE & DEPTH & MICRO AVDD 2.8V

1st	HQ11150859000	ET51528YB
2nd	HQ11150979000	WL2820X28-4/TR

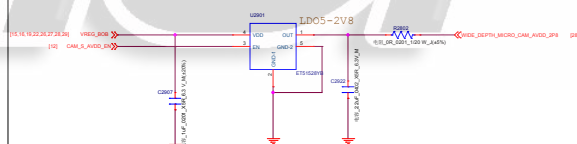


Front & Wide & Video DVDD 1.2V

1st	HQ11150936000	WL2831D12-4/TR
2nd	HQ11151048000	SGM2038-1.2XUDY4G/TR

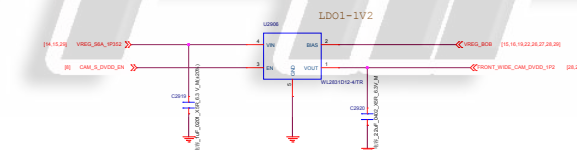


Company: Huesijn		
Block Title: FRONT_CAMCAMS_POWER		
Project	Taller	Rev: 1.0


KEY_LINK_BATT

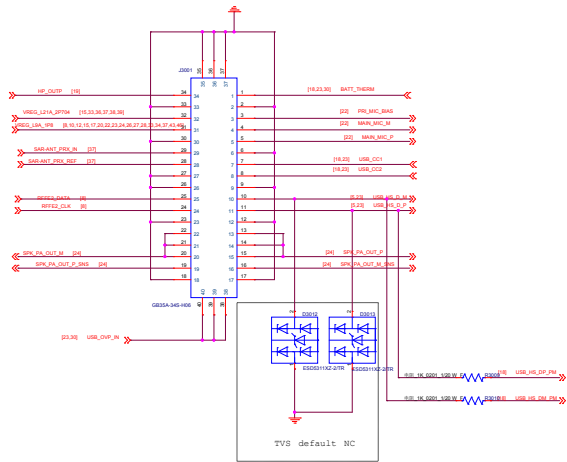


OVP

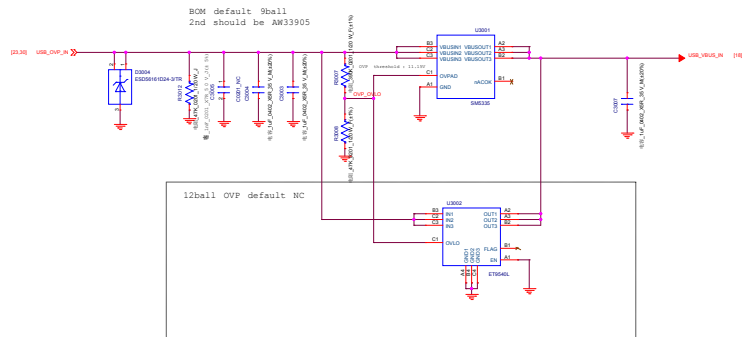

Battery Connector

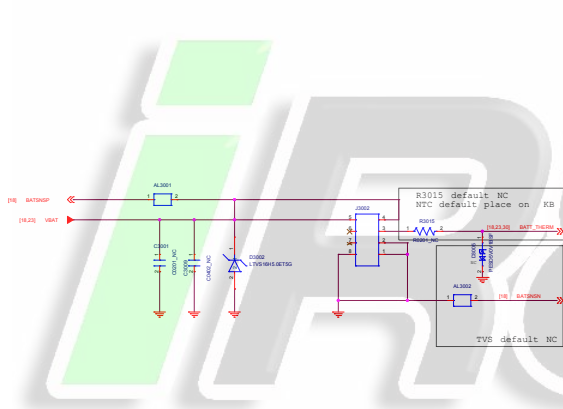

Side KEY

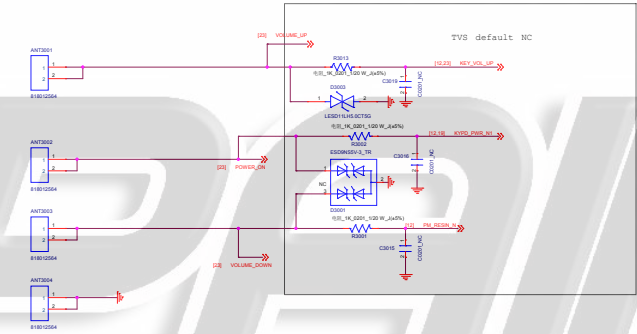

Company Header			
Rev	Rev	Rev	Rev
Rev	Rev	Rev	Rev
Rev	Rev	Rev	Rev



*i*REPAIR

Company Number			
Book No.		DTV	
Project		Title	
Date		Rev.	1.0
Scale		Sheet	31 of 31



PN553 I2C Adress:0x28 (Write:0x50 Read:0x51)



Company Header		
Blank Title NFC		
Project	Title	Rev: 1.0
Date:	2025-07-14 10:00	Page: 1/1

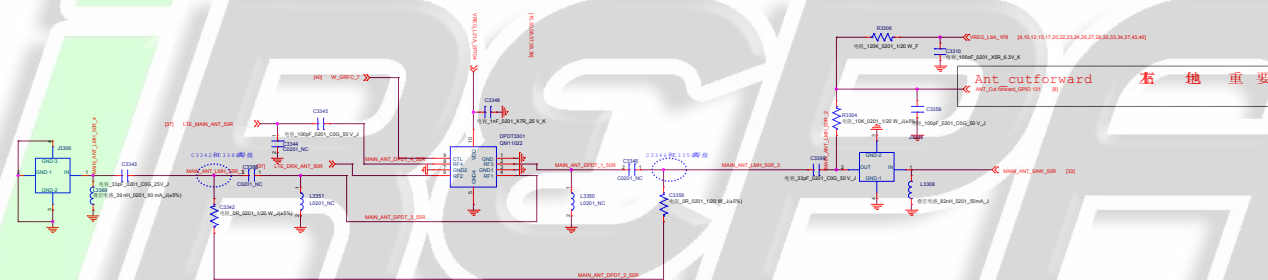
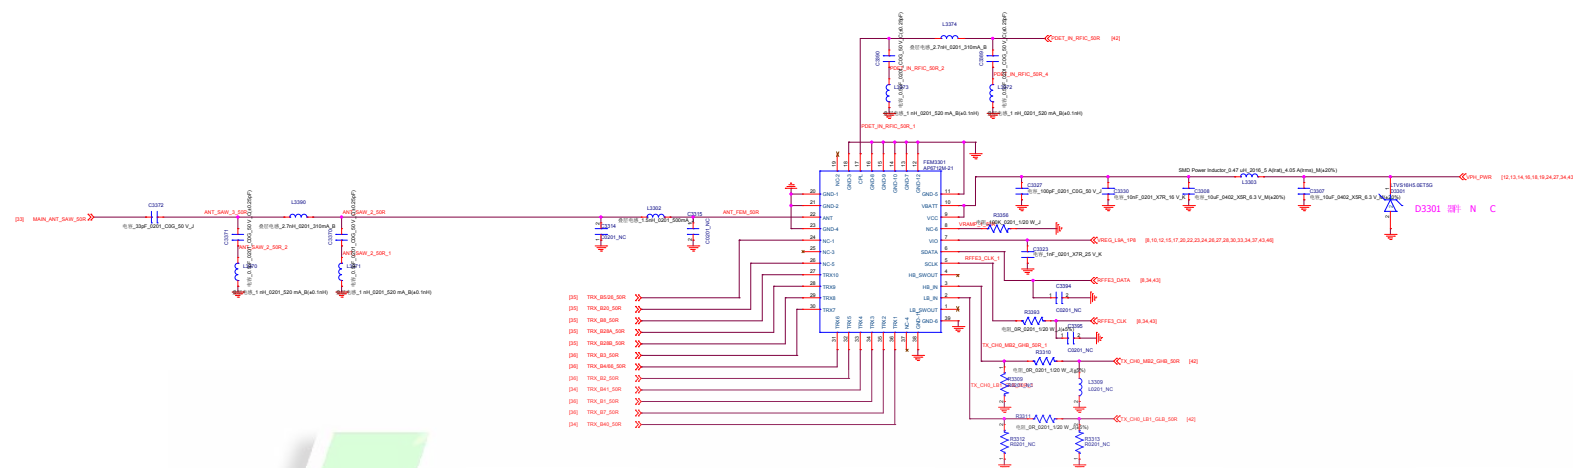


Company: Huelga	
Block Title: PRIMARY_ANTENNA	
Project: Teller	Rev: 1.0







Description	Code	Vendor	SKU
B12/17 DFX	SAYEY707MBA0F0A	MURATA	Brazil & Late
B20 DFX	D5FC847M0K3NE	TAIYO	Super_Row


库要更新




Description	Code	Vendor	SKU
B5 DFX	SFX836EYJ02	Will	Brazil & Lat
B26 DFX	SAYEY831MBA0B0A	MURATA	Super Row

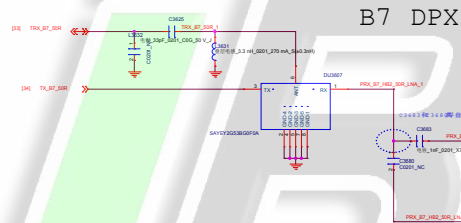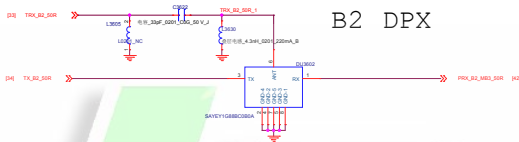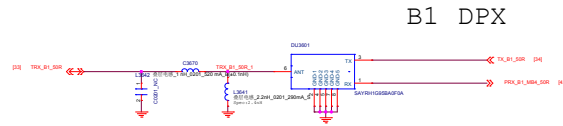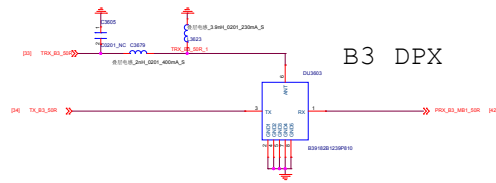


Description	Code	Vendor	SKU
B4 Duplexer	D6DA2G132K2D9(30dBm)	DAIYO	Super Row
B66 Duplexer	D6DA2G155K2T2(29dBm)	DAIYO	Brazil & Latin America

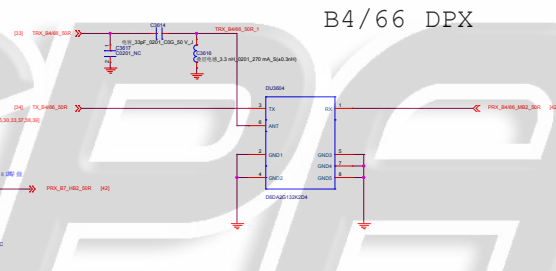

Company Name		
Block Title TRX_MIB		
Project	Teller	Rev 1.0
Date	September 20, 2019	Sheet 36 of 36




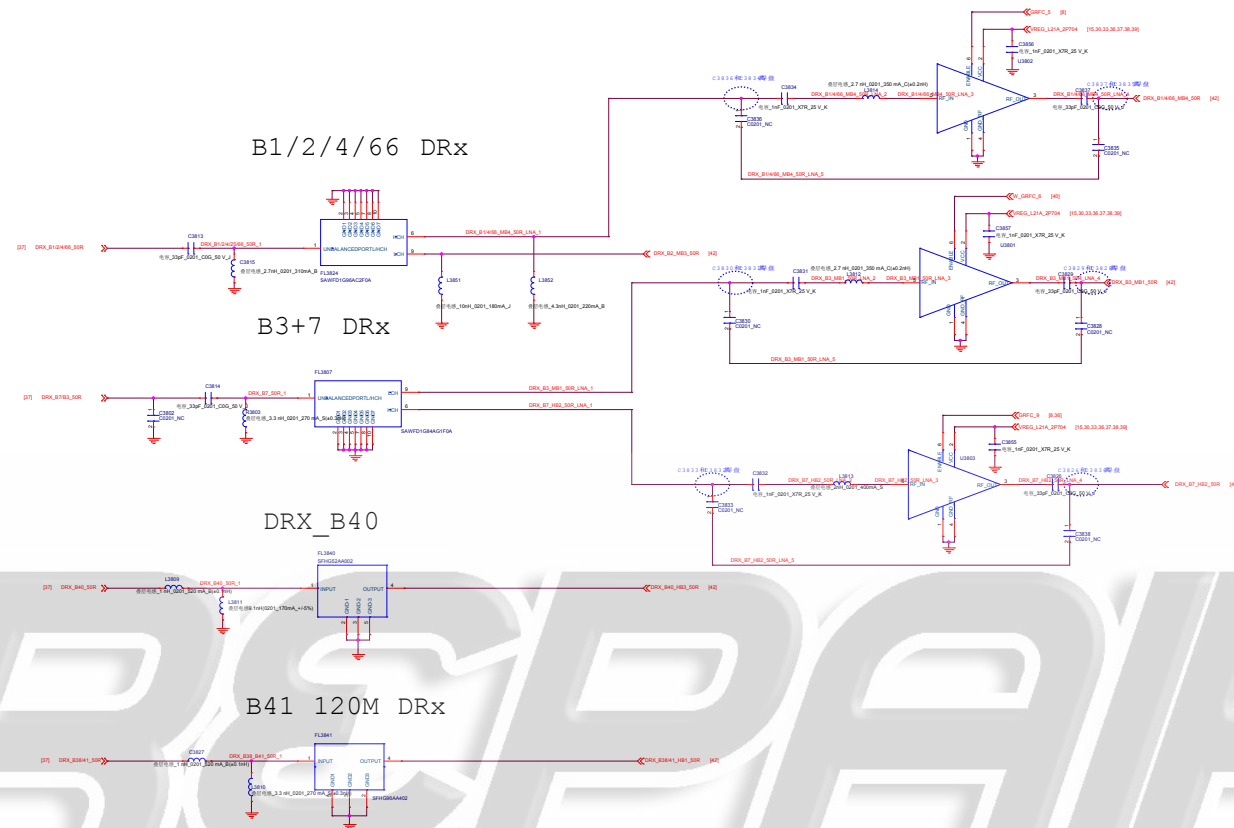

Company Number	
Rev	DRX_MB_HB
Project	Table
Date	2015/05/27 14:03


B5/26 DRX

Description	Code	Vendor	SKU
B5 SAW	SF8881AA002	WISOL	Brazil & Latam
B26 SAW	SAFFB876MAA0F0A	MURATA	Super Row




B12/17/20 DRX


Description	Code	Vendor	SKU
B12/17 DFX	SAFFB737MAA0F0A	MURATA	Brazil & Latam
B20 DFX	SF8806BA002	WISOL	Super_Row

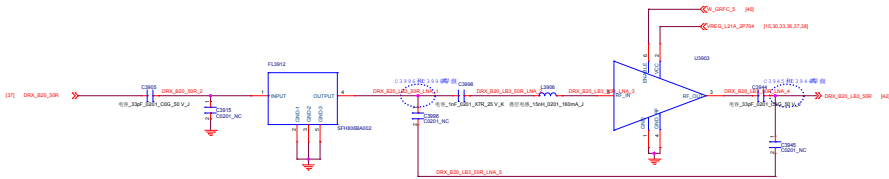



B28 DRX




B8 DRX



Company Header	
Rev	DRX_LB
Project	Table
Date	2023-07-12 10:00

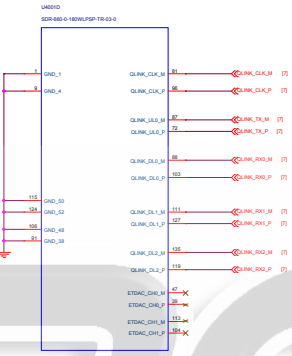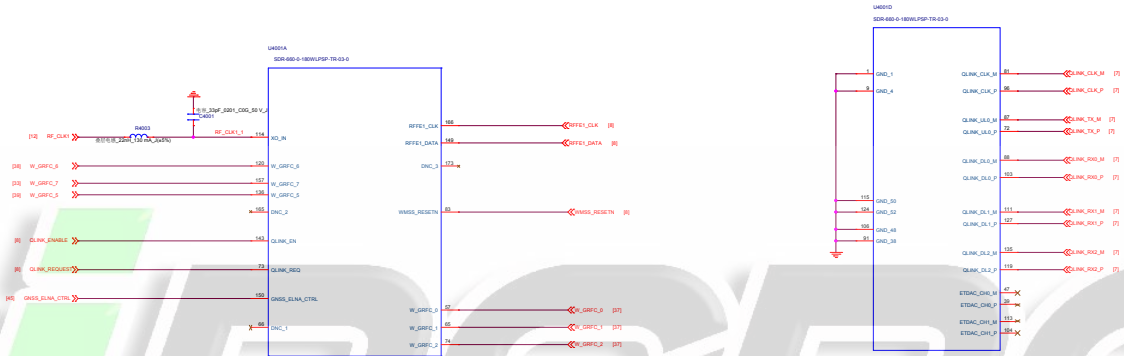


Company Header			
Doc No	SDR660_MSS		
Project	Table	Rev	1.0
Date	2023-07-12 10:00	By	W. J. J.

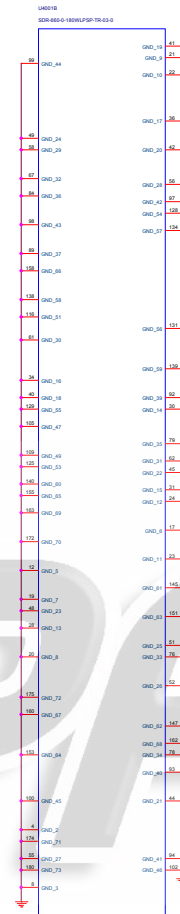


Company Name			
Block Title SC8880_PWR			
Project Teller		Rev 1.0	
Date: Monday, July 26, 2010	Sheet	41	of 48

SDR660 DA/PRX/DRX/FBRX



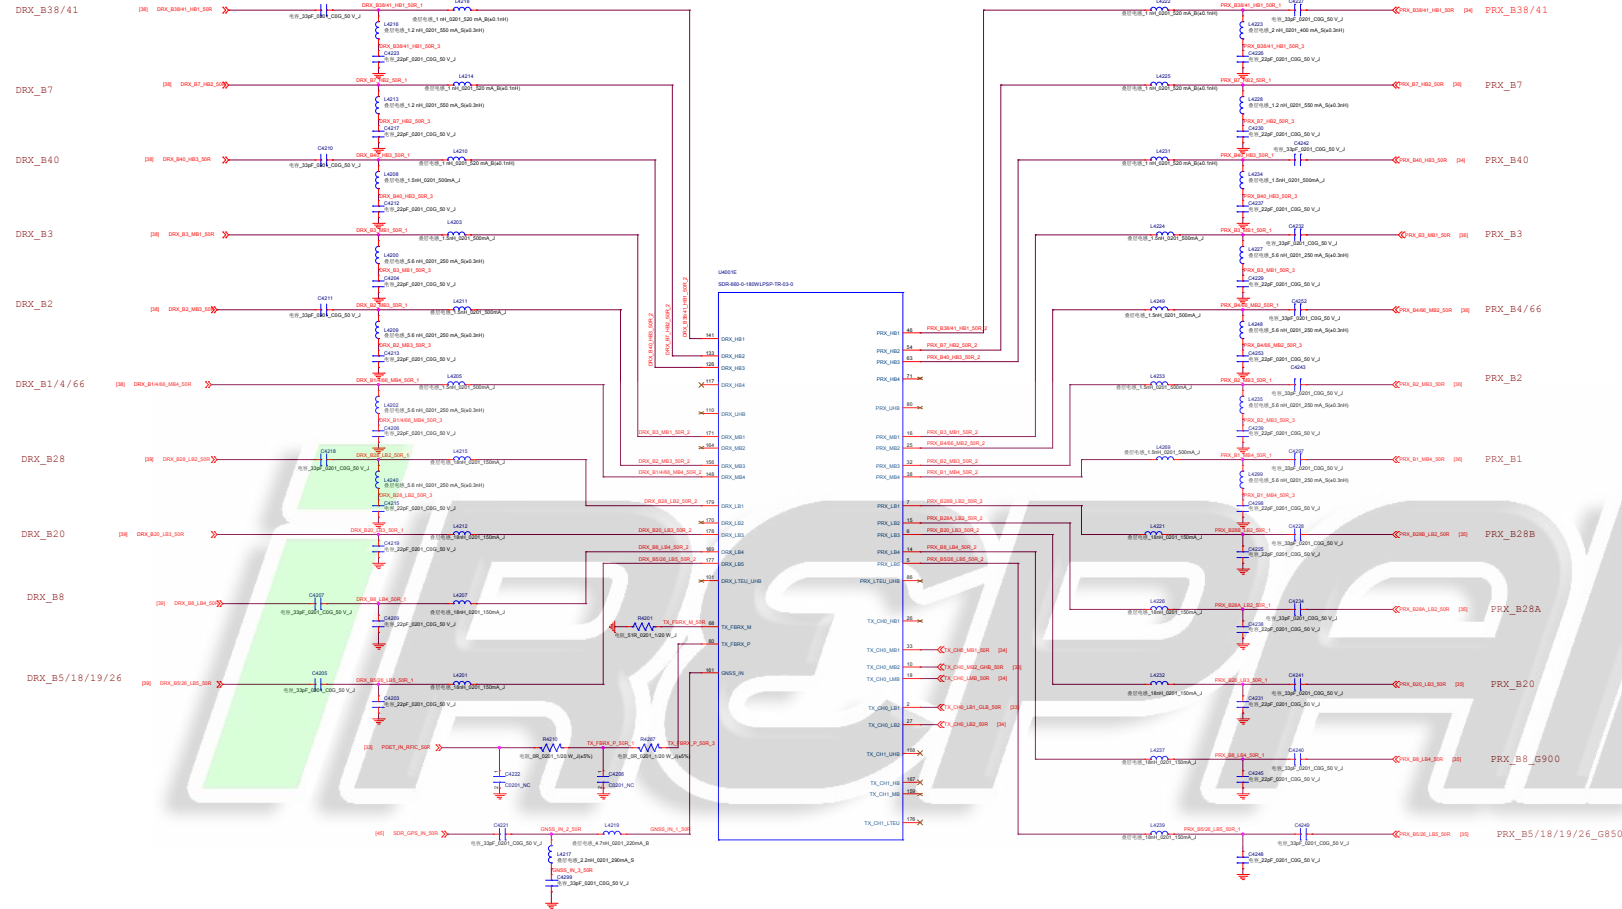


Company Name	
Block Title	
SCRM63_DAFPROCRUFBRX	
Project	Rev 1.0
Teller	
Date: September 27, 2019	Sheet 42 of 44

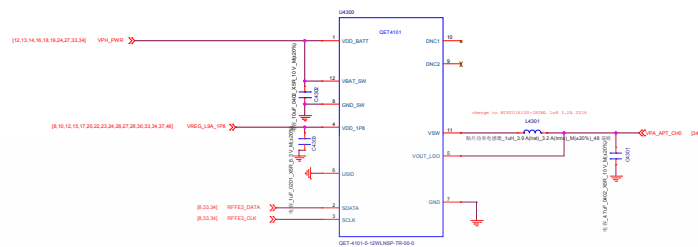
The logo for iRCPAIR is displayed in a large, stylized font. The letter 'i' is green with a white outline, while the letters 'RCPAIR' are grey with a white outline. The font is bold and italicized, giving it a dynamic appearance.

Company: Hargis	
Block Title: OCT4101	
Project: Teller	Rev: 1.0
Notes: Estimated 12-31-2023	Amount: \$5,000.00


WIFI 2.4G/BT

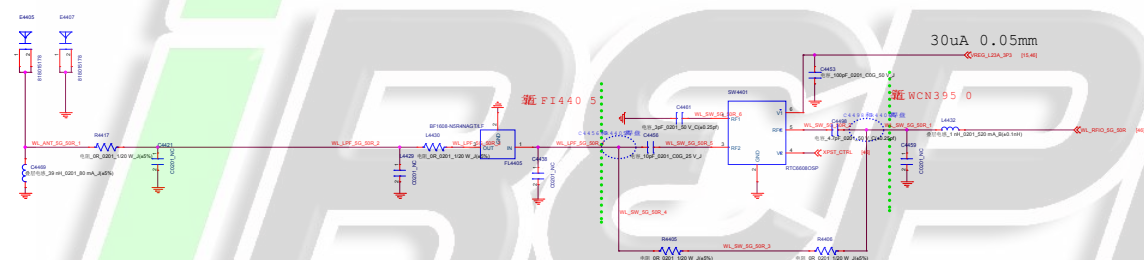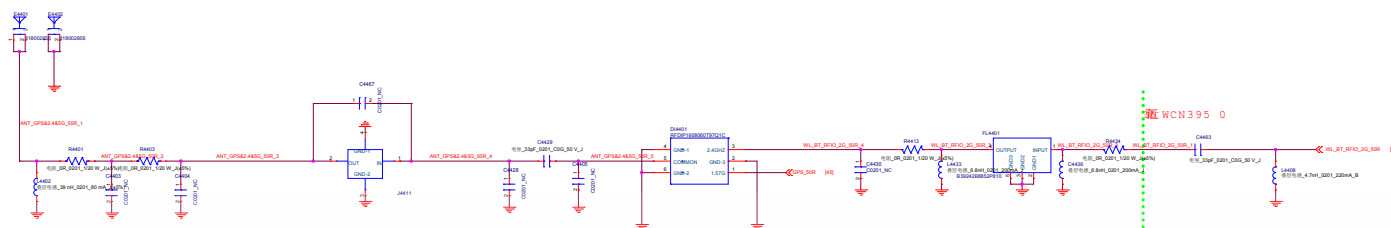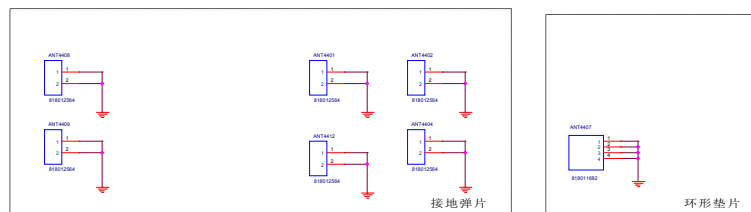

Company Name		
Block Title WFI 2.4G/GSET		
Project	Teller	Rev 1.0
Teller	Revision 1.0 11/11/2024	Rev 1.0 11/11/2024

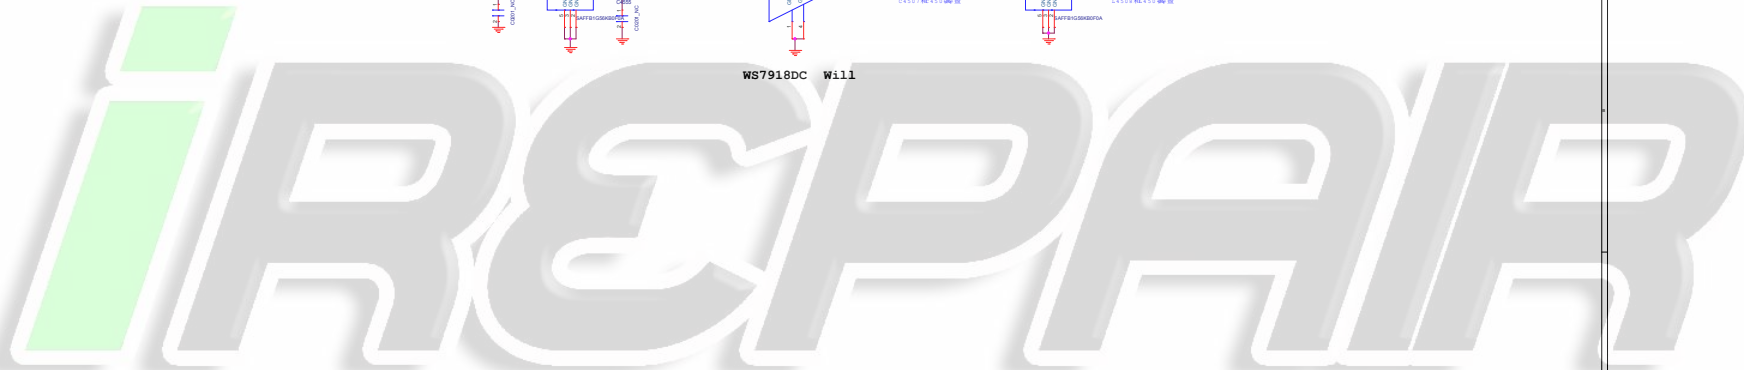The logo for iRCPAIR is displayed in a large, stylized font. The letter 'i' is green with a white outline, while the letters 'RCPAIR' are grey with a white outline. The font is bold and blocky, with a slight 3D effect. Above the logo, there are several small, partially visible diagrams showing electrical connections and components, including labels like 'COM', 'GND', 'VCC', and 'GND'.

Company: Hough	
Block Title: GPS	
Project: Teller	Rev: 1.0
Date: September 27, 2019	Sheet: 45 of 45

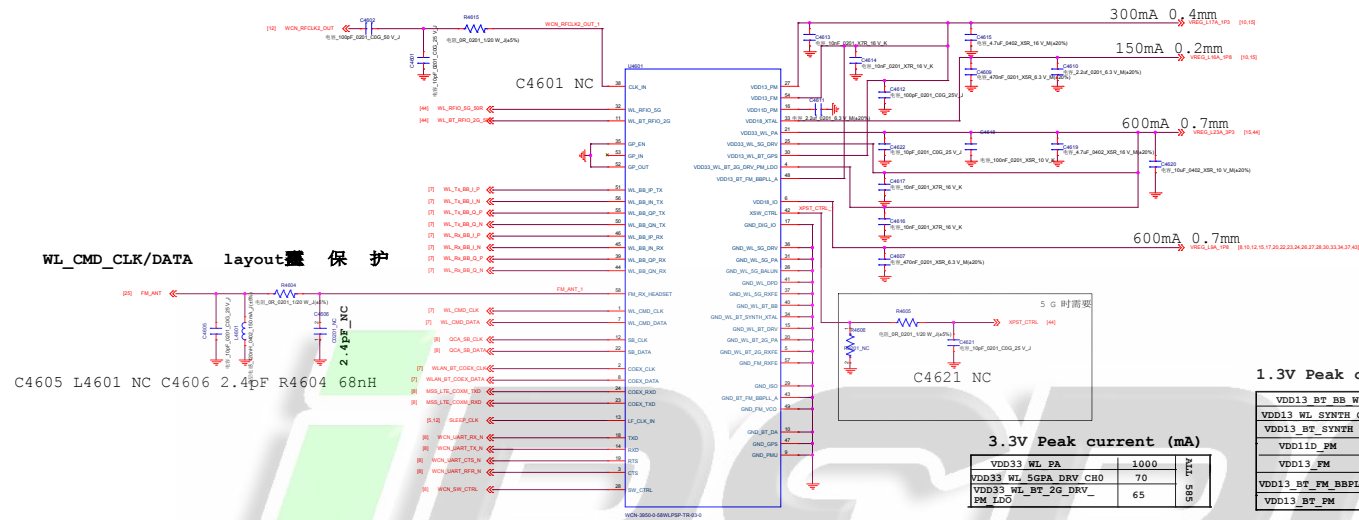

*i*REPAIR

Company Number			
Book Title		DTV	
Project		Title	
Date		Rev	1.0
Date		Rev	1.0