

Redmi not ESA back light
is not on

Fault performance: display without light

Maintenance process: after observing and measuring, it is found that the Capacitor in the upper left corner of the display seat is Short circuit



Display base
bitmap

I Gong Tun
Kong Xi Fei

To

No

VBAT8

Bar
R-còl,

Mounta

Knock

I stone

111

101


return

Find the original civet through the And Capacitor
line


Thousand breakdown state, replace these two more, the fault is solved!



Layout map of lamp control
part

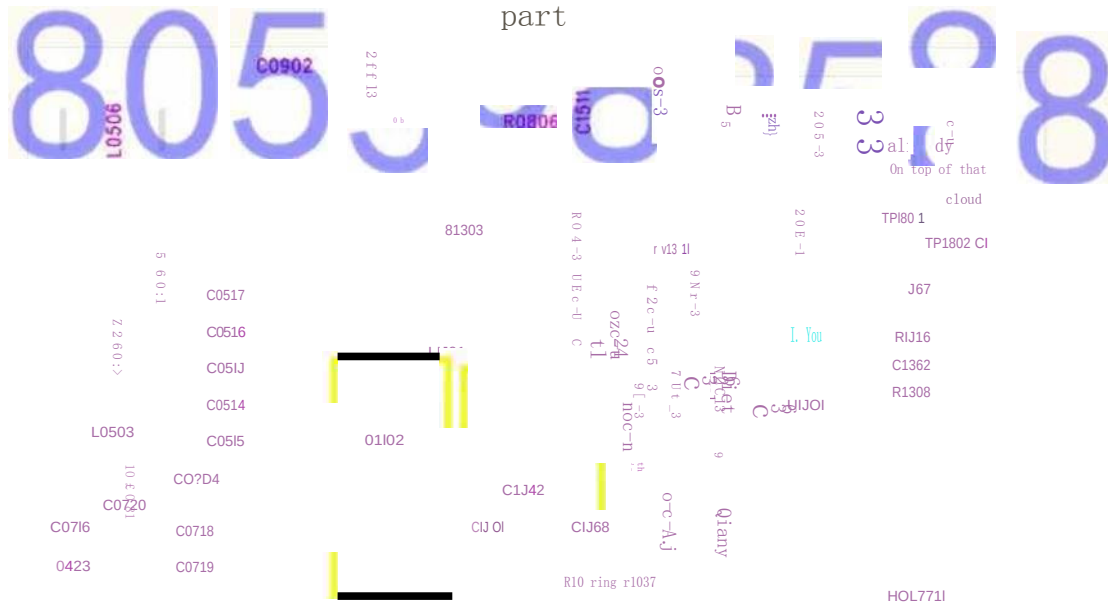

Lamp control part schematic

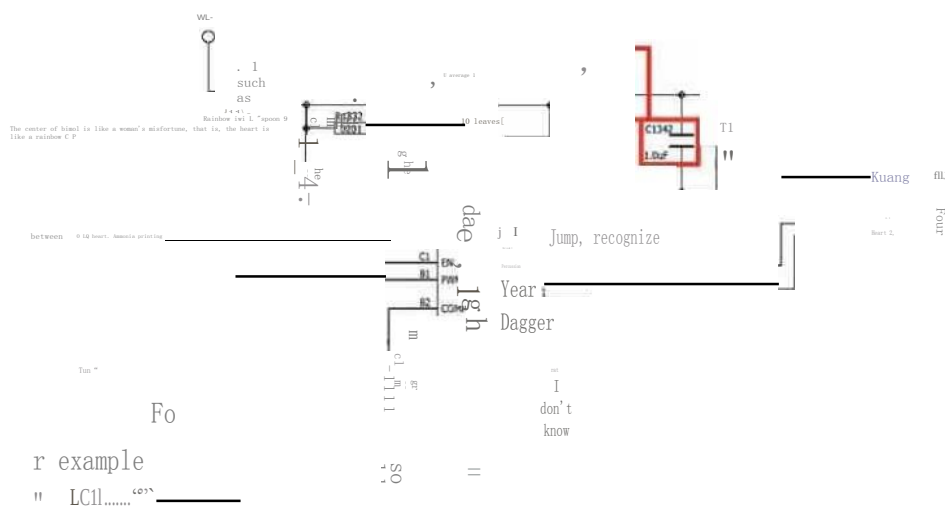

Principle analysis: lamp control circuit VCC more than 20 ∇ If something goes wrong,

Diode and boost Capacitor are the most vulnerable to damage, this Capacitor must be added, otherwise it will affect the brightness adjustment