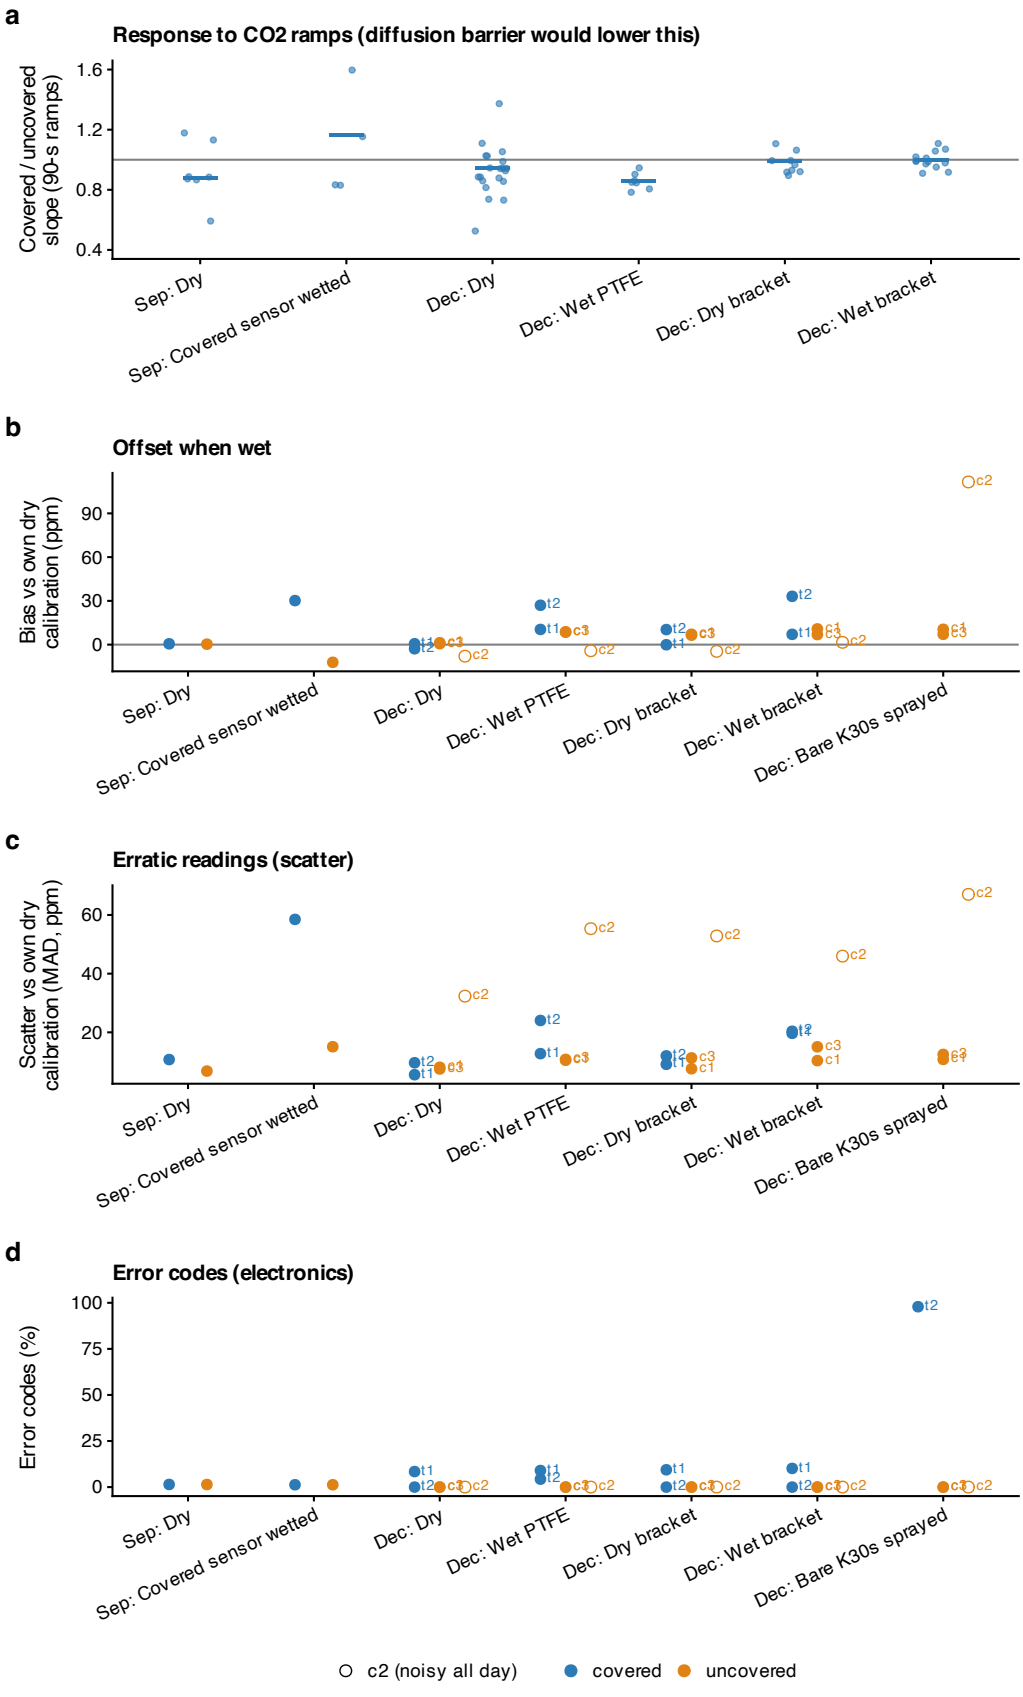
a
Response to CO2 ramps (diffusion barrier would lower this)
Covered / uncovered slope (90-s ramps)
1.6
1.2
0.8
0.4
Sep: Dry
Sep: Covered sensor wetted
Dec: Dry
Dec: Wet PTFE
Dec: Dry bracket
Dec: Wet bracket
b
Offset when wet
Bias vs own dry calibration (ppm)
90
60
30
0
Sep: Dry
Sep: Covered sensor wetted
Dec: Dry
Dec: Wet PTFE
Dec: Dry bracket
Dec: Wet bracket
Dec: Bare K30s sprayed
c
Erratic readings (scatter)
Scatter vs own dry calibration (MAD, ppm)
60
40
20
Sep: Dry
Sep: Covered sensor wetted
Dec: Dry
Dec: Wet PTFE
Dec: Dry bracket
Dec: Wet bracket
Dec: Bare K30s sprayed
d
Error codes (electronics)
Error codes (%)
100
75
50
25
0
Sep: Dry
Sep: Covered sensor wetted
Dec: Dry
Dec: Wet PTFE
Dec: Dry bracket
Dec: Wet bracket
Dec: Bare K30s sprayed
c2 (noisy all day)
covered
uncovered