1. Description


1.1. Project

Project Name	mech_ctrl_proto
Board Name	NUCLEO-L432KC
Generated with:	STM32CubeMX 5.0.1
Date	01/20/2019

1.2. MCU

MCU Series	STM32L4
MCU Line	STM32L4x2
MCU name	STM32L432KCUx
MCU Package	UFQFPN32
MCU Pin number	32

2. Pinout Configuration

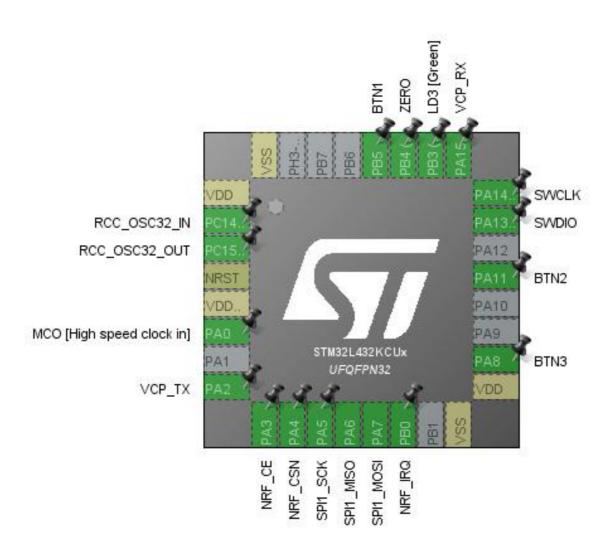


3. Pins Configuration

Pin Number UFQFPN32	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VDD	Power		
2	PC14-OSC32_IN (PC14)	I/O	RCC_OSC32_IN	
3	PC15-OSC32_OUT (PC15)	I/O	RCC_OSC32_OUT	
4	NRST	Reset		
5	VDDA/VREF+	Power		
6	PA0	I/O	RCC_CK_IN	MCO [High speed clock in]
8	PA2	I/O	USART2_TX	VCP_TX
9	PA3 *	I/O	GPIO_Output	NRF_CE
10	PA4 *	I/O	GPIO_Output	NRF_CSN
11	PA5	I/O	SPI1_SCK	
12	PA6	I/O	SPI1_MISO	
13	PA7	I/O	SPI1_MOSI	
14	PB0	I/O	GPIO_EXTI0	NRF_IRQ
16	VSS	Power		
17	VDD	Power		
18	PA8 *	I/O	GPIO_Input	BTN3
21	PA11 *	I/O	GPIO_Input	BTN2
23	PA13 (JTMS-SWDIO)	I/O	SYS_JTMS-SWDIO	SWDIO
24	PA14 (JTCK-SWCLK)	I/O	SYS_JTCK-SWCLK	SWCLK
25	PA15 (JTDI)	I/O	USART2_RX	VCP_RX
26	PB3 (JTDO-TRACESWO) *	I/O	GPIO_Output	LD3 [Green]
27	PB4 (NJTRST) *	I/O	GPIO_Output	ZERO
28	PB5 *	I/O	GPIO_Input	BTN1
32	VSS	Power		

^{*} The pin is affected with an I/O function

4. Clock Tree Configuration

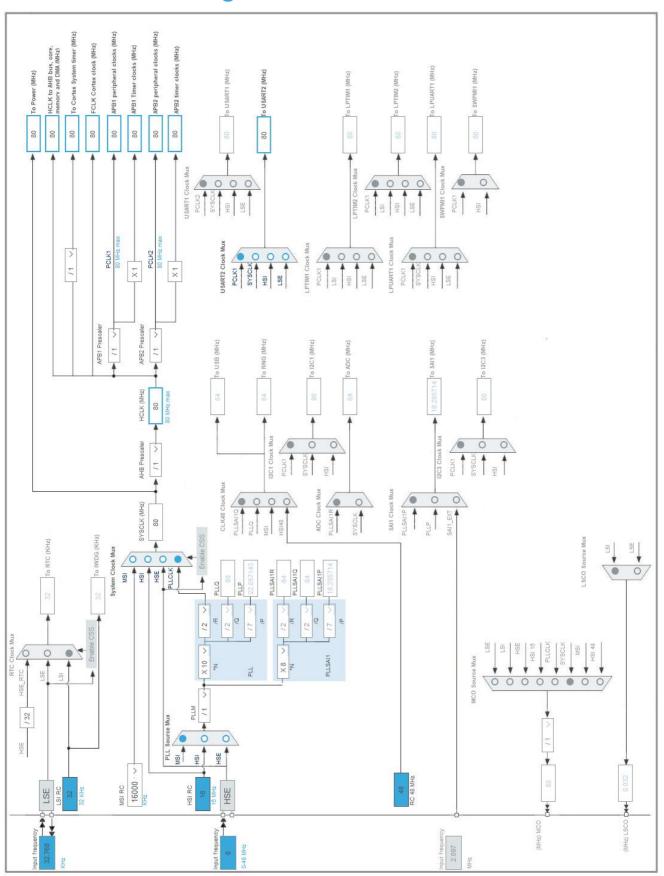

Page 4

5. Software Project

5.1. Project Settings

Name	Value	
Project Name	mech_ctrl_proto	
Project Folder	D:\projects\windsensor\mech_ctrl_proto	
Toolchain / IDE	SW4STM32	
Firmware Package Name and Version	STM32Cube FW_L4 V1.13.0	

5.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy only the necessary library files
Generate peripheral initialization as a pair of '.c/.h' files	No
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power	No
consumption)	

6. Power Consumption Calculator report

6.1. Microcontroller Selection

Series	STM32L4
Line	STM32L4x2
мси	STM32L432KCUx
Datasheet	028798_Rev2

6.2. Parameter Selection

Temperature	25
Vdd	null

7. IPs and Middleware Configuration 7.1. RCC

mode: High Speed Clock (HSE)

Low Speed Clock (LSE): Crystal/Ceramic Resonator

7.1.1. Parameter Settings:

System Parameters:

VDD voltage (V) 3.3
Instruction Cache Enabled
Prefetch Buffer Disabled
Data Cache Enabled

Flash Latency(WS) 4 WS (5 CPU cycle)

RCC Parameters:

HSI Calibration Value 16

MSI Calibration Value 0

MSI Auto Calibration Enabled

HSE Startup Timout Value (ms) 100

LSE Startup Timout Value (ms) 5000

LSE Drive Capability

LSE oscillator low drive capability

Power Parameters:

Power Regulator Voltage Scale Power Regulator Voltage Scale 1

7.2. SPI1

Mode: Full-Duplex Master 7.2.1. Parameter Settings:

Basic Parameters:

Frame Format Motorola

Data Size 8 Bits *

First Bit MSB First

Clock Parameters:

Prescaler (for Baud Rate) 16 *

Baud Rate 5.0 MBits/s *

Clock Polarity (CPOL) Low
Clock Phase (CPHA) 1 Edge

Advanced Parameters:

CRC Calculation Disabled

NSSP Mode **Disabled ***NSS Signal Type Software

7.3. SYS

Debug: Serial Wire

Timebase Source: SysTick

7.4. USART2

Mode: Asynchronous

7.4.1. Parameter Settings:

Basic Parameters:

Baud Rate 115200

Word Length 8 Bits (including Parity)

Parity None Stop Bits 1

Advanced Parameters:

Data Direction Receive and Transmit

Over Sampling 16 Samples
Single Sample Disable

Advanced Features:

Auto Baudrate Disable TX Pin Active Level Inversion Disable **RX Pin Active Level Inversion** Disable Data Inversion Disable TX and RX Pins Swapping Disable Enable Overrun DMA on RX Error Enable MSB First Disable

^{*} User modified value

8. System Configuration

8.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
RCC	PC14- OSC32_IN (PC14)	RCC_OSC32_IN	n/a	n/a	n/a	
	PC15- OSC32_OU T (PC15)	RCC_OSC32_O UT	n/a	n/a	n/a	
	PA0	RCC_CK_IN	n/a	n/a	n/a	MCO [High speed clock in]
SPI1	PA5	SPI1_SCK	Alternate Function Push Pull	No pull-up and no pull-down	Very High	
	PA6	SPI1_MISO	Alternate Function Push Pull	No pull-up and no pull-down	Very High	
	PA7	SPI1_MOSI	Alternate Function Push Pull	No pull-up and no pull-down	Very High	
SYS	PA13 (JTMS- SWDIO)	SYS_JTMS- SWDIO	n/a	n/a	n/a	SWDIO
	PA14 (JTCK- SWCLK)	SYS_JTCK- SWCLK	n/a	n/a	n/a	SWCLK
USART2	PA2	USART2_TX	Alternate Function Push Pull	No pull-up and no pull-down	Very High	VCP_TX
	PA15 (JTDI)	USART2_RX	Alternate Function Push Pull	No pull-up and no pull-down	Very High	VCP_RX
GPIO	PA3	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Very High	NRF_CE
	PA4	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Very High	NRF_CSN
	PB0	GPIO_EXTI0	External Interrupt Mode with Falling edge trigger detection	Pull-up *	n/a	NRF_IRQ
	PA8	GPIO_Input	Input mode	Pull-up *	n/a	BTN3
	PA11	GPIO_Input	Input mode	Pull-up *	n/a	BTN2
	PB3 (JTDO- TRACESWO	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD3 [Green]
	PB4 (NJTRST)	GPIO_Output	Output Push Pull	Pull-down *	Low	ZERO

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
	PB5	GPIO_Input	Input mode	Pull-up *	n/a	BTN1

8.2. DMA configuration

nothing configured in DMA service

8.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority		
Non maskable interrupt	true	0	0		
Hard fault interrupt	true	0	0		
Memory management fault	true	0	0		
Prefetch fault, memory access fault	true	0	0		
Undefined instruction or illegal state	true	0	0		
System service call via SWI instruction	true	0	0		
Debug monitor	true	0	0		
Pendable request for system service	true	0	0		
System tick timer	true	0	0		
EXTI line0 interrupt	true	0	0		
PVD/PVM1/PVM2/PVM3/PVM4 interrupts through EXTI lines 16/35/36/37/38	unused				
Flash global interrupt	unused				
RCC global interrupt	unused				
SPI1 global interrupt	unused				
USART2 global interrupt	unused				
FPU global interrupt	unused				

^{*} User modified value

9. Software Pack Report