

MAIN ROTOR BLADE TRIM TAB INSTALLATION INSTRUCTIONS: DRILL 0.129 TO 0.132 IN. (3.28 TO 3.35 mm) DIAMETER USING NO. 30 DRILL 15 PLACES (7 ON TOP, 8 ON BOTTOM). DEBURR ALL HOLES

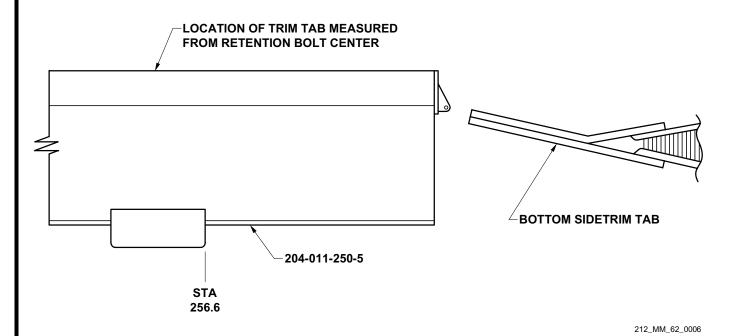


Figure 62-8. Trim Tab Replacement