انفيرومسيف
EnvironmSafe for Engineering
Trading, and services

Inspection & Testing Services

FINAL REPORT

DEMO-PC0001 – Demo boiler shutdown inspection

Client

DEMO – Sample Process Plant (not a real client)

Demo Utilities Area

Document control	
Document number	ES/DEMO-FR-2026-01
Revision	Rev. 00
Date	10 Oct 2026
Status	Issued
Prepared by	Demo Inspector
Reviewed by	Demo Office Lead
Approved by	General Manager

This document is confidential and is intended only for DEMO – Sample Process Plant (not a real client). It shall not be reproduced except in full without the written approval of EnvironmSafe.

EnvironmSafe for Engineering, Trading & Services Ltd.
www.environmsafe.com | support@environmsafe.com
+967 78 340 2932 | Al Buraiqah, Aden, Yemen

1. DOCUMENT CONTROL

Rev.	Date	Description	Prepared	Reviewed	Approved
00	10 Oct 2026	First issue	Demo Inspector	Demo Office Lead	General Manager

CONTENTS

1. DOCUMENT CONTROL 2
2. EXECUTIVE SUMMARY 2
3. SCOPE 2
4. EQUIPMENT INSPECTED 2
5. INSPECTION RESULTS 3
6. FINDINGS AND PRIORITIES 3
7. DAILY PROGRESS SUMMARY 3
8. HOLDS AND OBSERVATIONS 3
9. CERTIFICATES ISSUED 4
10. LIMITATIONS 4
11. SIGN-OFF 4
12. ANNEX – PHOTOGRAPHS 5

2. EXECUTIVE SUMMARY

We carried out 3 inspections on 2 items under DEMO-PC0001. 4 findings remain open (2 at priority P1) and 1 was closed. 2 certificate(s) were issued.

3. SCOPE

The scope of work covered the inspection of the equipment listed in this report in accordance with the referenced codes and the client's requirements.

Internal and external inspection of B-101, PSV overhaul and UT survey of V-201 / V-202 and P-301.

4. EQUIPMENT INSPECTED

Tag	Description	Service	Location	Status
V-201	Air receiver / pressure vessel	Compressed air	Compressor house	In service
PSV-101A	Steam drum safety valve A	Steam	Compressor house	In service

EnvironmSafe for Engineering, Trading & Services Ltd.
www.environmsafe.com | support@environmsafe.com
+967 78 340 2932 | Al Buraiqah, Aden, Yemen

5. INSPECTION RESULTS

Tag	Inspection	Date	Report no.	Conclusion	Next due
V-201	External visual inspection	10 Oct 2026	ES/DEMO-EXT-2026-001	Fit for continued service with conditions	10 Oct 2027
PSV-101A	PSV set pressure test and overhaul	09 Oct 2026	—	Fit for continued service	09 Oct 2027
V-201	Hydrostatic / pressure test	09 Oct 2026	—	Fit for continued service	—

V-201 – External visual inspection (10 Oct 2026)

We carried out an external visual inspection and an ultrasonic thickness survey of the air receiver. External corrosion at the bottom head has progressed since the previous inspection. The drain valve has been replaced. The origin of the pitting at the north support leg could not be established from the as-found condition.

Point	Location	Nominal (mm)	t-min (mm)	Previous (mm)	Measured (mm)	ST rate (mm/y)	LT rate (mm/y)	Rem. life (y)
CML-01	Top head	12	8.2	11.6 (2025)	11.5	0.100	0.060	33.0
CML-04	Bottom head	12	8.2	10.6 (2025)	10.1	0.500	0.219	3.8
CML-05	Drain nozzle	7.1	4	6 (2025)	5.8	0.200	0.139	9.0

6. FINDINGS AND PRIORITIES

Asset	Ref.	Finding	Pri.	Raised	Status	Latest note	Due
V-201	F-001	External corrosion at bottom head	P1	10 Oct 2025	Open – deteriorated	10 Oct 2026: Pitting deeper; coating breakdown now approx. 45 % of the head.	—
V-201	F-002	Drain valve passing	P2	10 Oct 2025	Closed	10 Oct 2026: Valve replaced by client in March 2026.	—
V-201	F-003	Nameplate partly illegible	P3	10 Oct 2025	Open – unchanged	10 Oct 2026: No change.	—
V-201	F-004	Pitting at north support leg	P1	10 Oct 2026	Open		10 Apr 2027
V-201	F-005	Earthing strap loose	P3	10 Oct 2026	Open		—

P1: Action within 6 months. P2: Action at the next shutdown and not later than the set due date. P3: Continuous or routine attention.

7. DAILY PROGRESS SUMMARY

Report	Date	Staff	Hours	Actual %	Main activities
ES/DEMO-PC0001-DPR-003	09 Oct 2026	4	20	45	As-found tests of PSV-101A, 21-PSV-003-2, PSV 18 111-1; UT survey of V-201 completed (5 CMLs)

8. HOLDS AND OBSERVATIONS

Ref.	Type	Description	Raised	Closed
H-01	Hold	Boiler internal access	08 Oct 2026	Open
O-01	Observation	Scaffold tag missing at drum level	08 Oct 2026	09 Oct 2026

EnvironmSafe for Engineering, Trading & Services Ltd.
www.environmsafe.com | support@environmsafe.com
+967 78 340 2932 | Al Buraiqah, Aden, Yemen

9. CERTIFICATES ISSUED

Certificate	Tag	Type	Issued	Issued by
ES-R-12-001	PSV-101A	PSV	10 Oct 2026	Demo Office Lead
ES-H-2026-001	V-201	HYDRO	10 Oct 2026	Demo Office Lead

10. LIMITATIONS

This report records the condition of the equipment as found on the date of inspection, within the scope and access available. Areas that were insulated, buried, inaccessible or not prepared were not examined unless stated. Where the origin of a condition cannot be established from the as-found condition, this is stated.

11. SIGN-OFF

Prepared by	Reviewed by	Approved by
Demo Inspector Date: 10 Oct 2026	**Demo Office Lead** Date:	**General Manager** Date:

EnvironmSafe for Engineering, Trading & Services Ltd.
www.environmsafe.com | support@environmsafe.com
+967 78 340 2932 | Al Buraiqah, Aden, Yemen

12. ANNEX – PHOTOGRAPHS

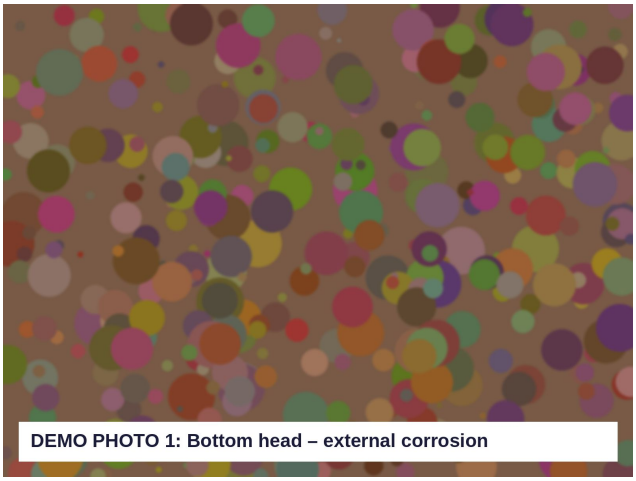


Figure 1 – Bottom head – external corrosion (F-001)

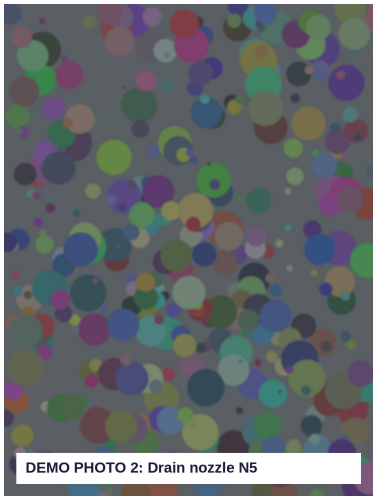


Figure 2 – Drain nozzle N5 with new valve (F-002)