क्षेत्रीय रेल प्रशिक्षण संस्थान, भूली

ZONAL RAILWAY TRAINING INSTITUTE, BHULI

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

Dhananjay Kumar Singh
Transportation Instructor
ZRTI/Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

When line clear for a train can't be obtained from adjacent station by any of the means of communication available at the station, such a situation is termed as total failure of communication

D.K.SINGH/Instructor/ZRTI,Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

➢ MEANS OF COMMUNICATION

1) Block Instrument, Track Circuit & Axle Counter
2) Block Telephone
3) Control Phone
4) VHF Set
5) Station to Station fixed telephone or BSNL Phone

D.K.SINGH/Instructor/ZRTI, Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

- The SM will stop the trains to go towards the affected block section
- The Guard & Driver of the train will be informed about the fact by the SM
- If the Driver is not convergent with the rules for working of trains under such situation the SM shall explain it in presence of Guard

D.K.SINGH/Instructor/ZRTI,Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

The SM will issue form T/C 602 to the driver and obtain the signature of Guard & Driver on the form.

The form T/C 602 includes the following items:

a) **Authority to proceed without Line Clear**

b) **Authority to pass signals at 'ON'**

c) **Caution Order: The Speed of the train will be restricted to:**

i) 25kmph – during day and when visibility is clear

ii) 10kmph – during night and when visibility is not clear

iii) walking pace – during thick foggy weather & dust storm

D.K.SINGH/Instructor/ZRTI,Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

Dispatching of Trains:

a) **Route shall be set correctly and all facing point shall be locked properly.**

b) **Fixed Signal, except LSS shall be taken 'OFF' (if possible).**

c) **2nd & subsequent trains will be dispatched after 30 minutes of interval along with the same forms & with same speed restriction as already mentioned above till normal working is resumed.**

D.K.SINGH/Instructor/ZRTI,Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

Reception of Train:

a) The train will stop at the foot of FSS, there from it will be received by taking 'OFF' signal/signals or otherwise.

b) On arrival of the train at the station, the Driver will handover the form T/C 602 to the SM on duty.


c) The SM will keep this form in his safe custody for inspection by TI(M) who will prepare a report on the working of trains and shall forward the same to DRM, within 7 days of resumption of normal working.

d) The SM will record all particulars in the TSR

- The train must continue to work on this system until anyone of the means of communication is restored and T/I 602 is filled.

D.K.SINGH/Instructor/ZRTI, Bhuli

TOTAL FAILURE OF COMMUNICATION ON DOUBLE LINE ABSOLUTE BLOCK SYSTEM

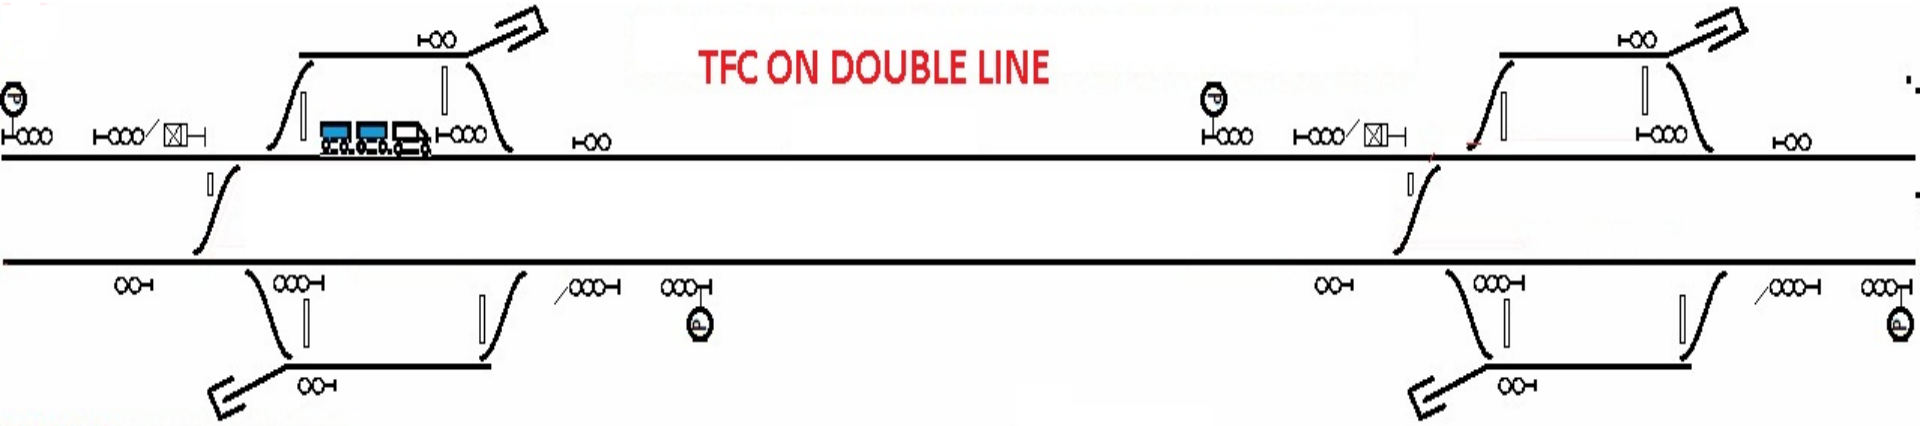

DEPARTURE

FOLLOWING AUTHORITIES WILL BE ISSUED--

T/C 602

1. AUTHORITY TO PROCEED WITHOUT LINE CLEAR
2. AUTHORITY TO PASS SIGNAL / SIGNALS AT "ON"
3. CAUTION ORDER

SPEED- 25/10/ WP KMPH

RECEPTION

THE TRAIN WILL BE RECEIVED BY TAKING "OFF" APPROACH STOP SIGNAL/ SIGNALS, OR BY ANY OTHER RULE.



Dhananjay kumar singh

Transportation Instructor

ZPTI/Bhadli