

North ground-brace alignment correction

Both X-braces between W4 and N1 / U-W were offset 4 inches north of the column axes. All four brace endpoints now coincide with those axes. The analytical offset links at those four connections are eliminated. Attachment heights remain at 6 inches and 115 inches above datum.

W4 is at north-coordinate 253 inches; N1 is at 252.5 inches. The braces follow the plane between those columns, including that half-inch difference. The TN truss above remains in its existing plane at north-coordinate 249 inches. Its short connections to the posts are separate from this ground-brace correction.



The corrected over-door mini-truss and every other physical member are unchanged. Both construction stages and the final second-order analysis were rerun. The whole-frame network contains each column and brace once.

These are structural centerlines. Gussets, brace crossing clearance, bolts, welds and foundations remain to be detailed; this is not a fabrication drawing.

Export replay verified 70 combinations. Maximum partial second-order screen: 0.935. The screen excludes the 125 psf storage sensitivity; it is not complete design approval.


TN Corrected wall elevation

Flat upper chord axis: 18 ft 8 1/4 in
Lower chord axis: 9 ft 7 in
Overall chord run: 23 ft 5 1/2 in

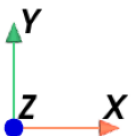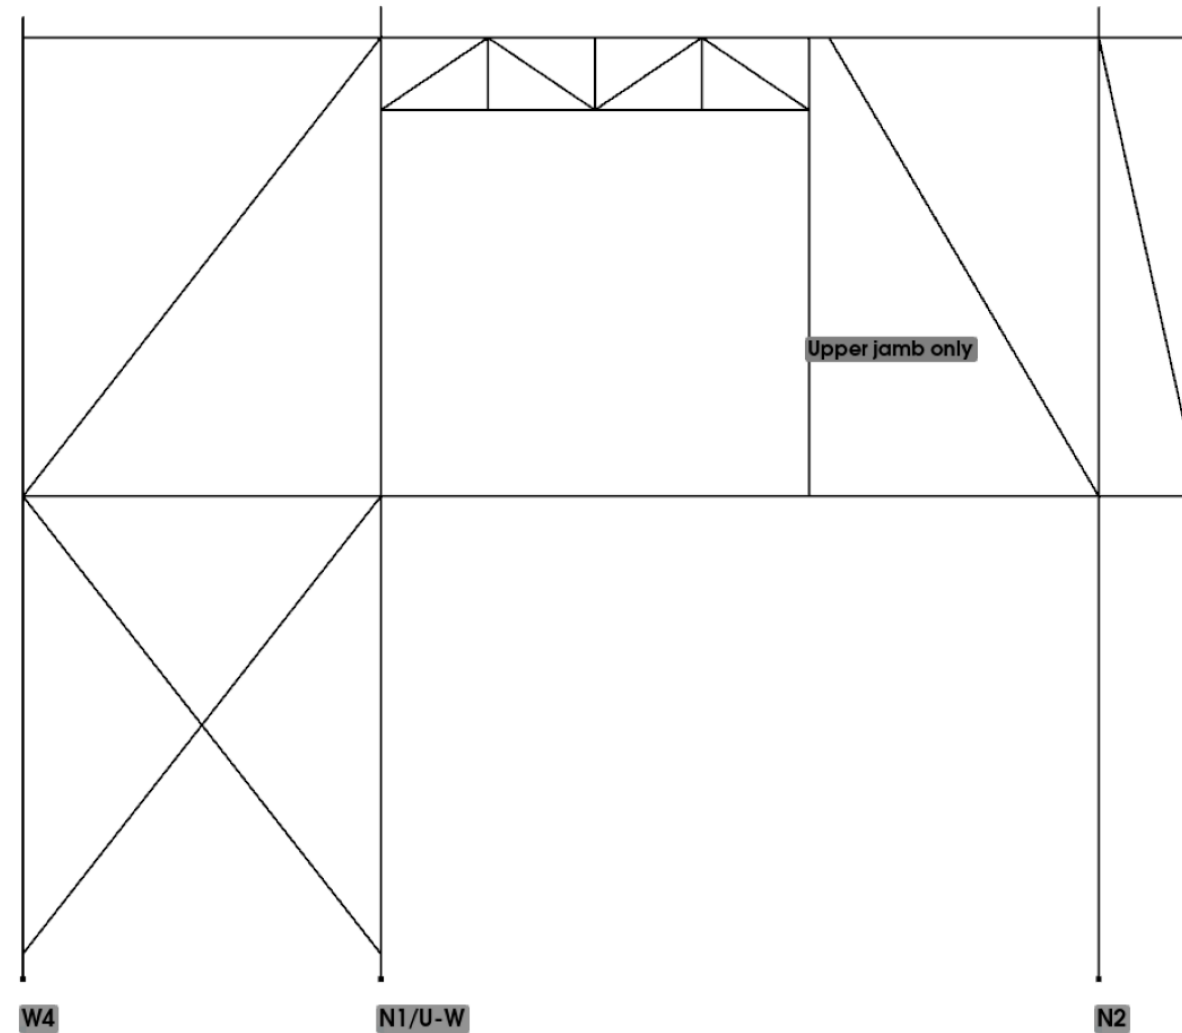


Shared columns replace duplicate truss uprights. Ground-level X bracing retained.
Preliminary fixed-base model; connection and foundation design remains.

NORTH Support path

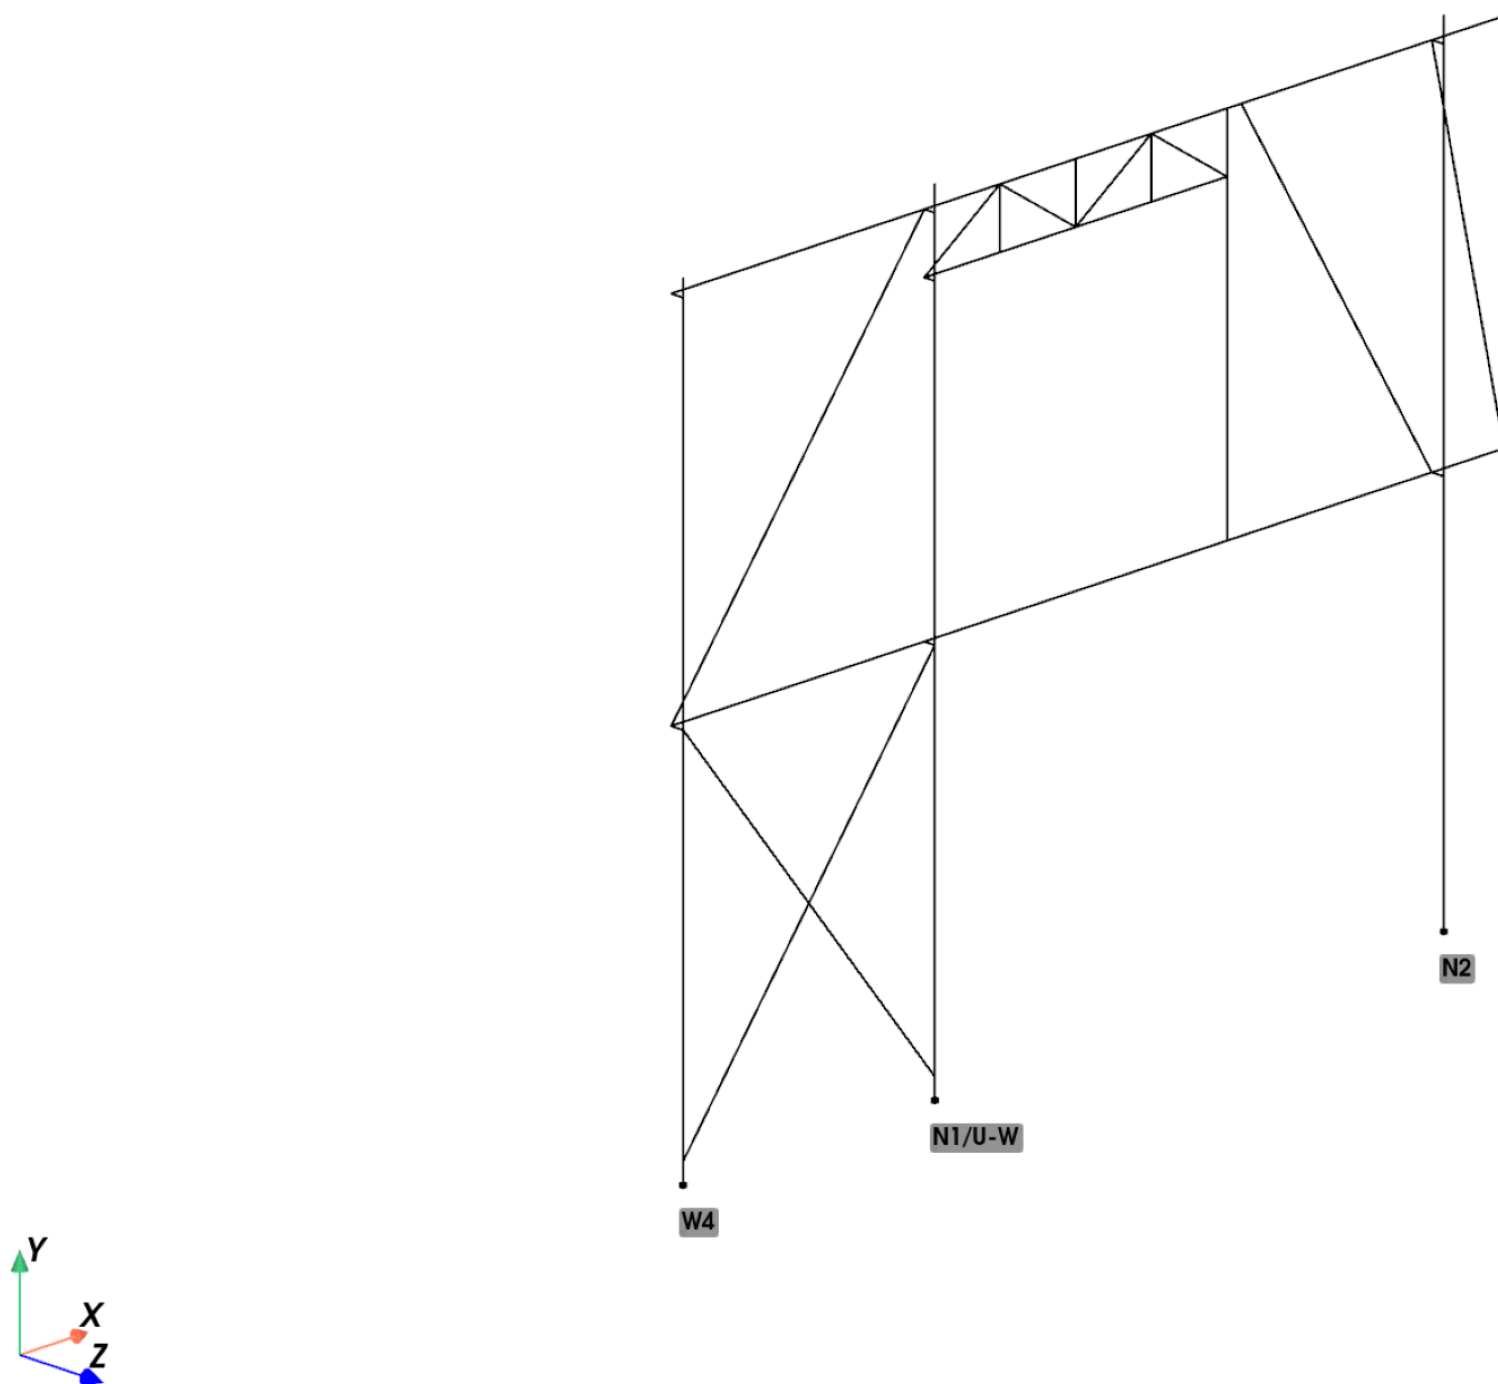


Shared columns replace duplicate truss uprights. Ground-level X bracing retained.
Preliminary fixed-base model; connection and foundation design remains.

TN Corrected over-door mini-truss

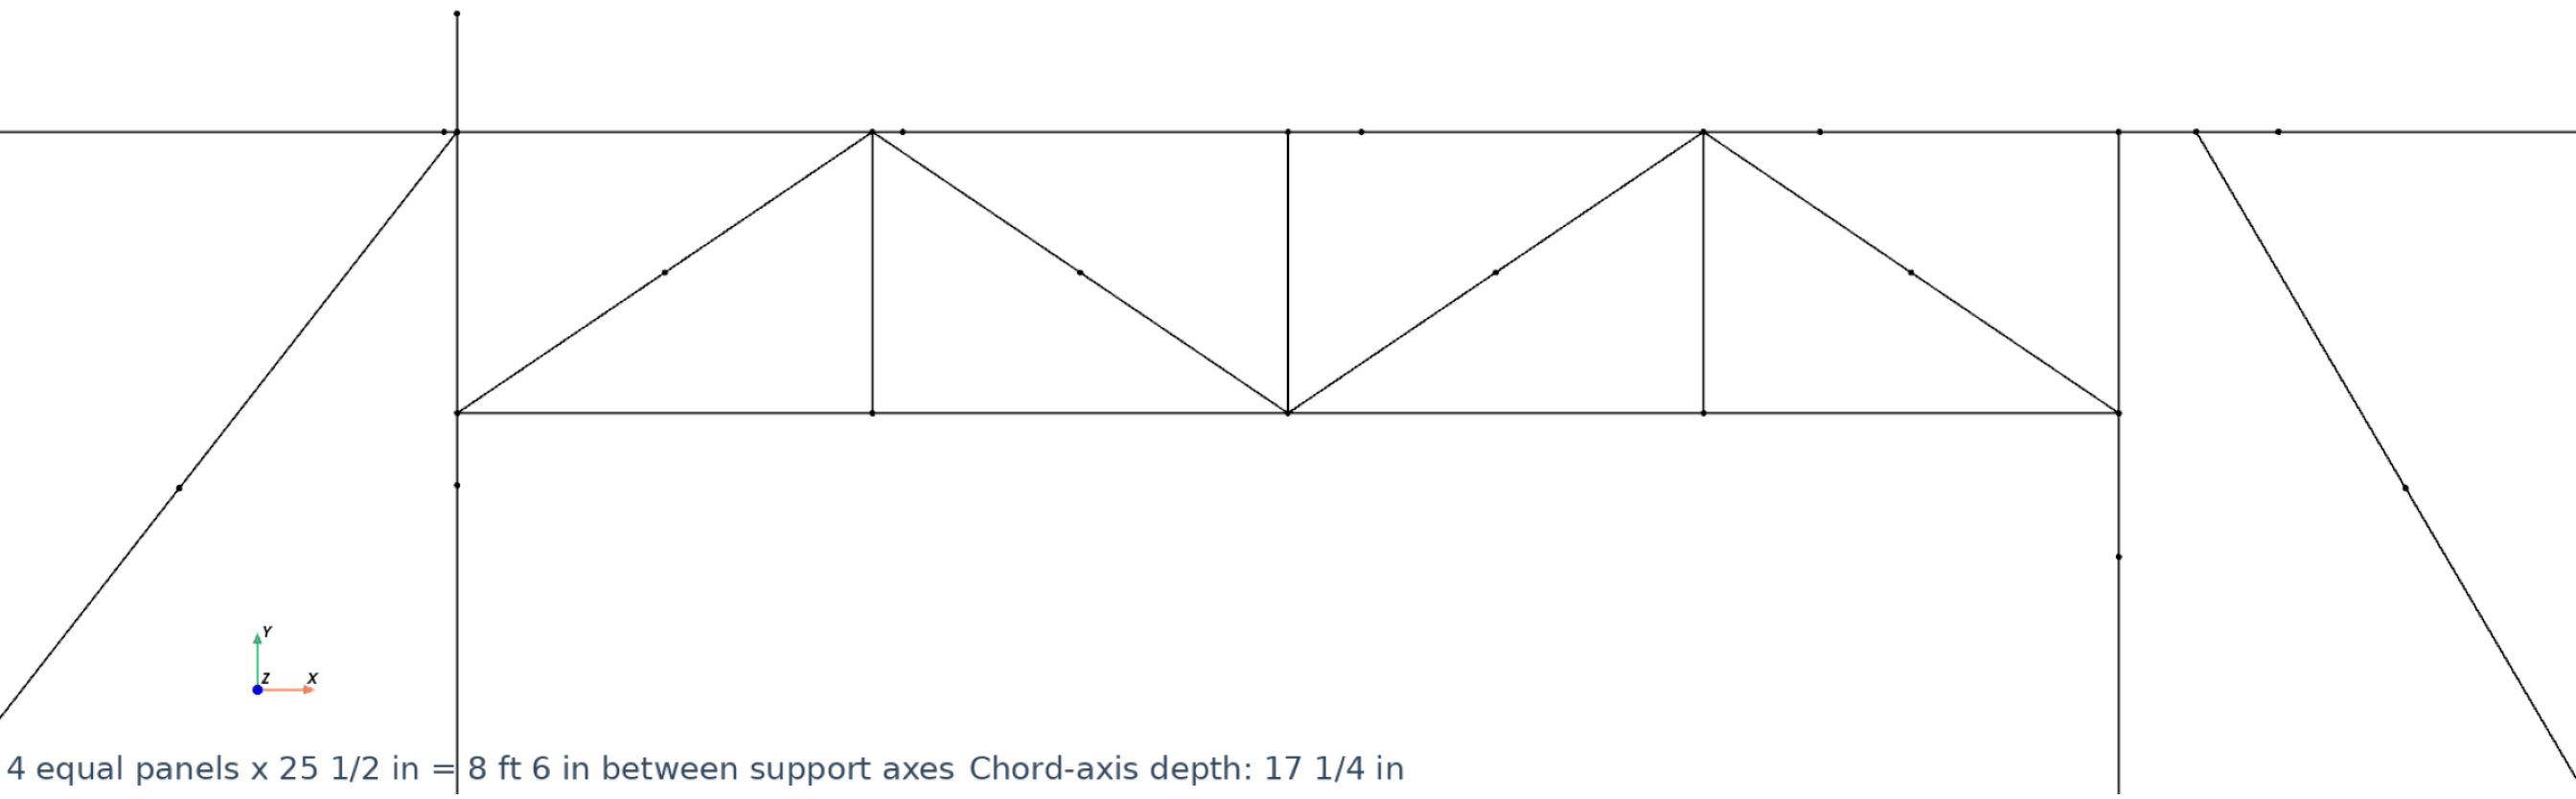

ALL Support path

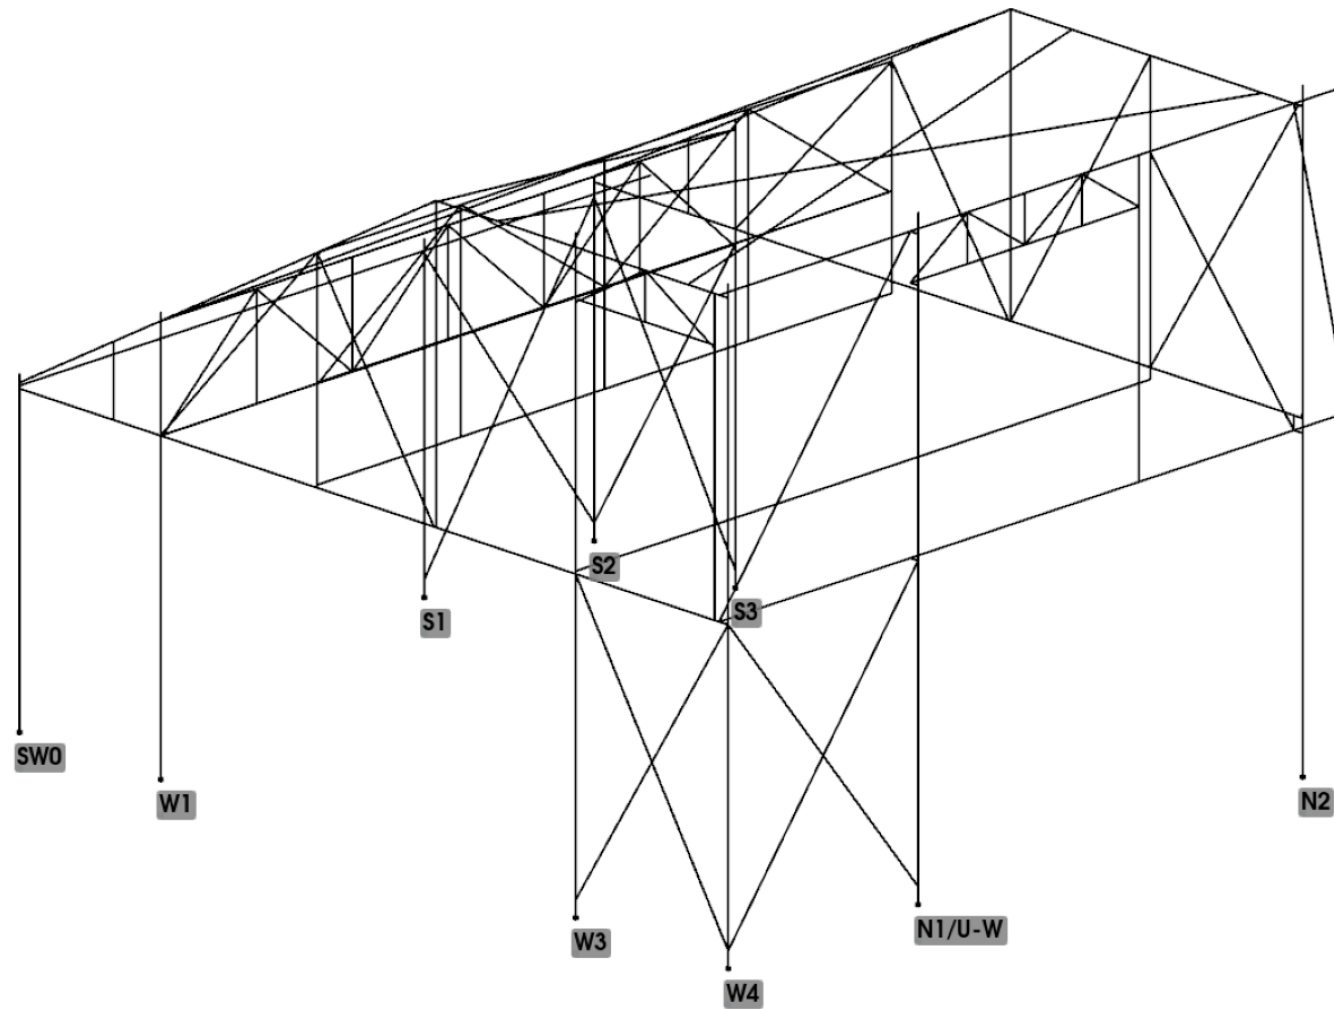

Shared columns replace duplicate truss uprights. Ground-level X bracing retained.
Preliminary fixed-base model; connection and foundation design remains.