


LAMINATED PANEL - FLAT BLANK / PRESS BRAKE


MATERIAL: 16 GA (0.0598)   UNITS: INCHES   SCALE: NTS   PLASMA PROGRAM: laminated\_panel.gm

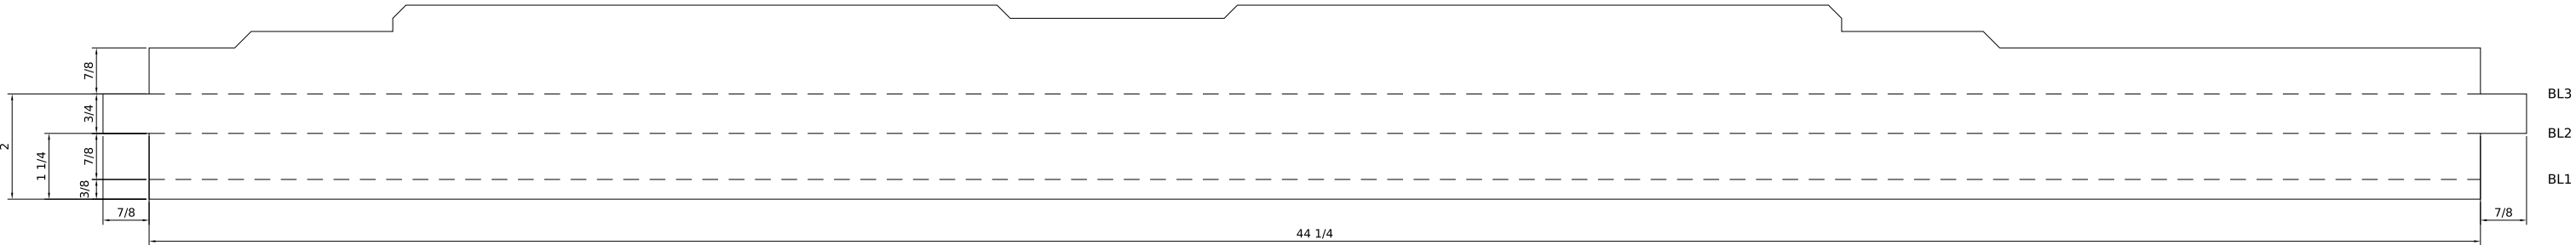

BEND TABLE (dims from bottom edge of blank)

| BEND | FROM BOTTOM | LENGTH | ANGLE | DIRECTION |
|------|-------------|--------|-------|-----------|
| BL1  | 3/8         | 44 1/4 | ---   | UP / DOWN |
| BL2  | 1 1/4       | 44 1/4 | ---   | UP / DOWN |
| BL3  | 2           | 44 1/4 | ---   | UP / DOWN |

1. Bend lines are at the sketch dimensions on the flat blank.
2. Confirm whether sketch dims are flat or formed; bend deduction not applied.
3. Angle and direction not on sketch: fill in before forming.
4. End tabs (7/8 x 3/4) sit between BL2 and BL3; check tab/flange clearance.

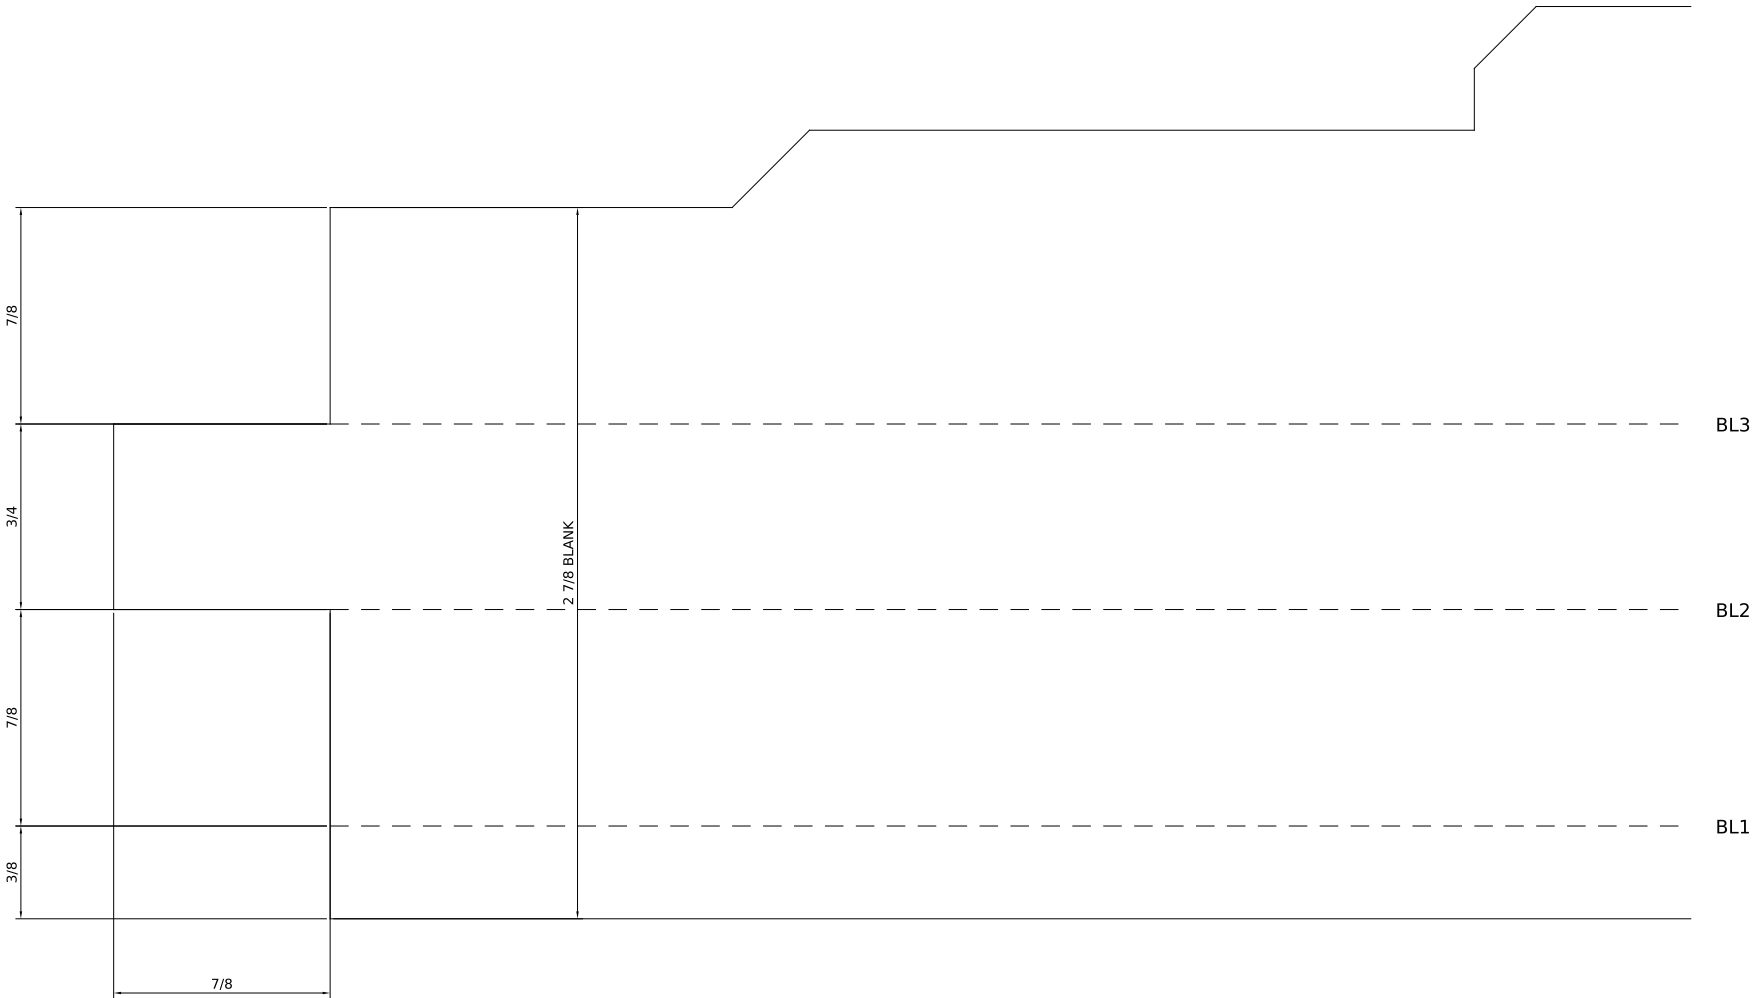

DETAIL - LEFT END (SCALE 4:1) right end is the same