## SERVICE BULLETIN

AMATEUR RADIO

SUBJECT
TS-930S RF FEEDBACK INTO MIC CKT

DATE 8-16-83

Some users may report RF feedback to the MIC at low frequencies, for example: 3.5 Mhz.


Make the following changes to SW unit (J) (X41-1410-00):


MIC 10 CF.01 MCG G

OLD

MCL

Foil side view

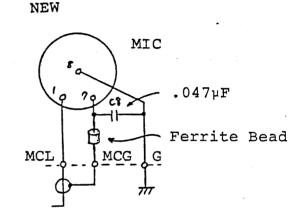

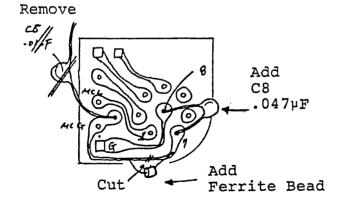

Note: This change is applicable to units before S/N 308XXXX.

TK/cm