

SERVICE BULLETIN

from: TRIO-KENWOOD COMMUNICATIONS, INC.

TS-120S

#816

SUBJECT: TS-120S Band Pass Filter Change


DATE 2/7/80

For complaints of out-of-band interference, especially BCI, the BPF (bandpass filter) terminating resistors may be changed for an improvement of approximately 10dB.

On the RF unit X44-1260-01, change R3,5,7,9,11 from 1.5KOHm to 470 $^{\rm Ohm}$ No adjustments are required.

▼ RF UNIT (X44-1260-01)

PC BOARD VIEWS

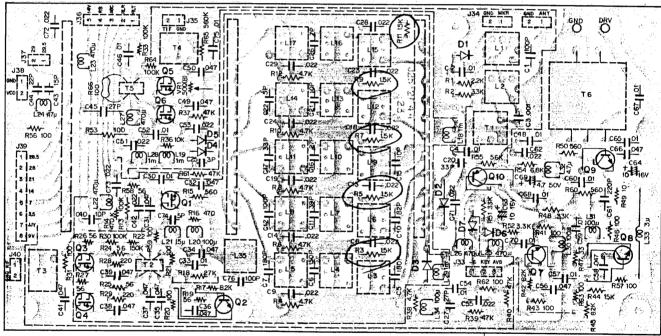

Q1,3~6:35K74(L), Q2,7,8:25C1815(Y), Q9:25C2086, Q10:25A1015(Y) D1,3,5:151587, D2,4:152588, D6,7:151555

JEB/yn