

YIS100 series Data sheet

3D AHRS/VRU/IMU module

Document YSD1310001E-R02, 15 October 2019



Yesense Technologies Co., Ltd.



027-87003846



contact@yesense.com



www.yesense.com



CONTENT

1.	General information	3
1.1	1 Description	3
1.2	2 Features	3
1.3	3 Applications	3
1.4	4 Frames of reference used in YIS100	3
2.	YIS100 series configuration	5
2.1	1 YIS100-U (IMU)	5
2.2		
2.3	3 YIS100-A (AHRS)	5
3.	3D Orientation and performance specifications	6
3.1	1 3D Orientation specifications	6
3.2	2 Sensors specifications	6
3.3	3 System specifications	7
4.	Sensor calibration	8
5.	YFusion® sensor fusion algorithm	8
6.	Pin configuration	9
7.	Interfaces	10
7.1	1 Serial port (UART)	10
7.2	2 I2C	10
7.3	3 Synchronization	12
8.	Message structure	13
8.1	1 Serial port (UART)	13
8.2	2 I2C	15
8.3	3 Value and conversion	15
9.	Package and handing	18
9.1	1 Package drawing	19
9.2	2 Mounting considerations	20
9.3	3 Soldering	20
10	Davidiana	22



1. General information

1.1 Description

The YIS100 series is a module outputting 3D orientation, 3D angular rates, 3D accelerations and 3D magnetic field. It is available as an Inertial Measurement Unit (IMU), Vertical Reference Unit (VRU) or Attitude and Heading Reference System (AHRS).

The Robust and accurate orientation algorithm (YFusion®) is embedded in the YIS100, including robust and accurate orientation estimation, online error estimation and active orientation stabilization, providing stable and real time attitude and heading information. YIS100 is compatible with JEDEC PLCC20 IC-sockets. With a roll/pitch accuracy of 0.5° RMS and yaw accuracy of 1° RMS under dynamic conditions, the output is excellent for

control and stabilization of any object and navigation of e.g. unmanned vehicles.

1.2 Features

Roll/pitch accuracy: 0.5°

• Yaw accuracy: 1°

Low power and low noise

· Real time dynamic sensing

• YFusion® orientation algorithm

PLCC20 compatible

Size: 9.5mm × 9.5mm × 2.6mm

1.3 Applications

- Unmanned aerial vehicle control and navigation
- Robotics, pedestrian dead-reckoning
- VR/AR. HMD's and handheld devices
- Sports science analysis, assistant training

1.4 Frames of reference used in YIS100

The YIS100 series module uses a right-handed coordinate system as the basis of the sensor of frame. The following data is the output in corresponding reference coordinate systems:

Data	Symbol	Reference coordinate system
Acceleration	a_x , a_y , a_z	Sensor-fixed
Angular rate	ω_x , ω_y , ω_z	Sensor-fixed
Magnetic field	m _x , m _y , m _z	Sensor-fixed



Orientation Pitch, roll and yaw Local geographic coordinate system (ENU)

The sensor fixed coordinate system is shown in Figure 1:

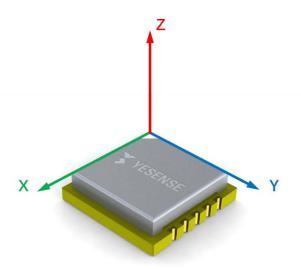


Figure 1. The sensor fixed coordinate system of YIS100

The default local geographic coordinate system is East-North-Up (ENU), and the outputs of YIS100 are default outputted with ENU reference coordinate system.



2. YIS100 series configuration

The YIS100 series is a fully-tested self-contained module that can output 3D orientation data (Euler angles (roll, pitch, yaw) and quaternions), orientation and velocity increments (Δq and Δv) and sensors data (acceleration, rate of turn, magnetic field). The YIS100 series module is available as an Inertial Measurement Unit (IMU), Vertical Reference Unit (VRU) and Attitude and Heading Reference System (AHRS).

2.1 YIS100-U (IMU)

The YIS100-U module is an Inertial Measurement Unit (IMU) that outputs 3D rate of turn, 3D acceleration and 3D magnetic field. The YIS100 also outputs coning and sculling compensated orientation increments and velocity increments (Δq and Δv). Moreover, the testing and calibration over temperature performed by Yesense result in a robust and reliable sensor module.

2.2 YIS100-V (VRU)

The YIS100-V is a 3D vertical reference unit (VRU). Its orientation algorithm (YFusionTM) outputs 3D orientation data with respect to a gravity referenced frame: drift-free roll, pitch and unreferenced yaw. In addition, it outputs calibrated sensor data: 3D acceleration, 3D rate of turn and 3D magnetic field data. The YIS100-V is also capable of outputting data of orientation and velocity increments Δq and Δv . The 3D acceleration is also available as so-called free acceleration which has gravity subtracted.

2.3 YIS100-A (AHRS)

The YIS100-A supports all features of the YIS100-U and YIS100-V. It outputs drift-free roll, pitch and true/magnetic North referenced yaw and sensors data: 3D acceleration, 3D rate of turn, as well as 3D orientation and velocity increments (Δq and Δv), and 3D earth-magnetic field data. Free acceleration is also available.

Output data	YIS100-U IMU	YIS100-V VRU	YIS100-A AHRS
Calibrated sensor data	•	•	•
Roll/pitch		•	•
Unreferenced yaw		•	•
North referenced yaw			•



3. 3D Orientation and performance specifications

3.1 3D Orientation specifications

Table 1. Orientation specifications

Paran	neters	Тур	Unit	Comments
Roll/pitch	Static	0.25	o	1σ RMS
Koli/pitci1	Dynamic	0.5	o	1σ RMS
	VRU	1	0	1σ RMS¹
Yaw (heading)	AHRS	1	o	1σ RMS in a homogenous magnetic field
Output data rate		100	Hz	

3.2 Sensors specifications²

Table 2. Gyroscope specifications

Parameters	Тур	Unit	Comments
Full range	±2000	°/s	
Non-linearity	±0.1	% FS	
Noise density	0.004	°/s/√Hz	@10Hz
Bias variation vs. temperature	±0.01	°/s/°C	
Sensitivity variation vs. temperature	±2	%	

Table 3. Accelerometers specifications

Parameters	Тур	Unit	Comments
Full range	±16	g	
Non-linearity	±0.3	% FS	
Noise density	100	ug/√Hz	@10Hz
Bias variation vs.	±0.5	ma/°C	X,Y axes
temperature	±1	mg/°C	Z axis
Sensitivity variation vs. temperature	±1.5	%	

¹ With active orientation stabilization in YFusion[®], the yaw error will be less than 1 degree after 60 min in static case, and less than 1 degree per min in moderate dynamics case at room temperature.

² These specifications may change as the update of the sensors on the module.



Table 4. Magnetometer specifications

Parameters	Тур	Unit	Comments
Full range	±49	Gauss	
RMS Noise	3	mG	RMS
Sensitivity variation vs. temperature	±0.03	%/°C	

3.3 System specifications

Table 5. System specifications

Parameters	Тур	Unit	Comments
Size	9.5 × 9.5 × 2.6	mm	PLCC20 compatible
Weight	0.5	g	
Input voltage	2.5~3.6	V	
Specified performance operating temperature	0~60	°C	
Operating temperature	-40 ~ +85	°C	
Power consumption	75	mW	@3.3V
Timing accuracy	10	ppm	



4. Sensor calibration

Each YIS is individually calibrated and tested. The (simplified) sensor model of the gyroscopes, accelerometers and magnetometers can be represented as following:

$$\mathbf{u} = \mathbf{H} \cdot \mathbf{y} + \mathbf{b}$$

 \mathbf{u} = sensor data of the gyroscopes, accelerometers and magnetometers in °/s, m/s² or mGauss, respectively

y = sensor value before calibration

H = gain and misalignment matrix

 \mathbf{b} = bias


Yesense' calibration procedure calibrates for many parameters, including bias (offset), alignment of the sensors with respect to the module PCB and each other and gain (scale factor). The calibration values are stored in non-volatile memory in the YIS.

5. YFusion® sensor fusion algorithm

The YFusion™ sensor fusion algorithm is based on Kalman Filter, merging the data from 3-axis gyroscope, 3-axis accelerometer and 3-axis magnetometer. YFusion includes robust and accurate orientation estimation, online error estimation and active orientation stabilization.



6. Pin configuration

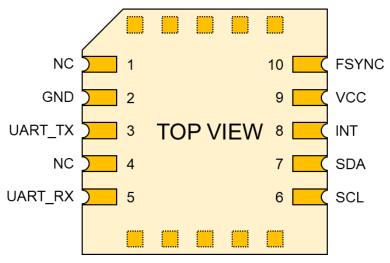

the pins are for mechanical fixing purposes and should be soldered to an unconnected pad Figure 2. Pin configuration of the YIS100 (top view)

Table 6. Pin map

Pin ID	Pin Name	Description
1	NC	Not Electrically Connected
2	GND	Ground
3	UART_TX	Transmitter data output
4	NC	Not Electrically Connected
5	UART_RX	Receiver data input
6	SCL	I2C serial clock
7	SDA	I2C serial data
8	INT	Data Ready Signal (DRDY)
9	VCC	Power supply voltage, 2.7-3.6VDC
10	FSYNC	Synchronization signal



7. Interfaces

7.1 Serial port (UART)

Serial port (UART) in YIS100 supports the following standard baudrates:

- 9600 bps
- 19200 bps
- 38400 bps
- 57600 bps
- 115200 bps
- 230400 bps
- 460800 bps(default)
- 921600 bps

For completeness, the UART specifications are listed below:

Table 7. UART specifications

Item	Value
Data bit	8
Stop bit	1
Parity	None

7.2 I2C

The I2C is a bus slave. The I2C interface is implemented with fast mod(400 KHz) I2C standards as well as with the standard mode.

The slave address associated to the YIS100 is 0110101b. The slave address is completed with Read/Write bit. For example, if master read data from slave, the first address byte is 0x6B.

Table 8. Transfer when master is receiving(reading) multiple bytes of data from slave

Master	ST	SAD+W		SUB		SR	SAD+R			MAK		NMAK	SP
Slave			SAK		SAK			SAK	DATA		DATA		

Note

SAD: Slave Address MAK: Master Acknowledge
ST: START Condition NMAK: No Master Acknowledge

SR: repeated START SAK: Salve Acknowledge



SP: STOP Condition SUB: 8-bit sub-address, always is register address

W: write operationR: read operation

The I2C timing diagram is described in Figure 3.

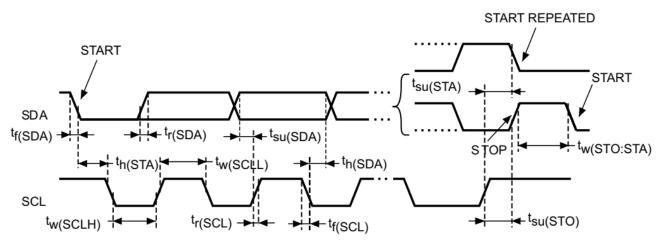


Figure 3. I2C timing diagram

The I2C characteristics are described in Table 9.

Table 9. I2C characteristics

Symbol	Parameter	Standard mode I2C Parameter				Unit	
,		Min	Max	Min	Max		
$t_{w(SCLL)}$	SCL clock low time	4.7	-	1.3	-	0	
$t_{w(SCLH)}$	SCL clock high time	4.0	-	0.6	-	μs	
t _{su(SDA)}	SDA setup time	250	-	100	-		
t _{h(SDA)}	SDA data hold time	0	3450	0	900 ³		
$t_{r(SDA)} \ t_{r(SCL)}$	SDA and SCL rise time	-	1000	-	300	ns	
$t_{f(SDA)} \ tf_{(SCL)}$	SDA and SCL fall time	-	300	-	300		
t _{h(STA)}	Start condition hold time	4.0	-	0.6	-		
t _{su(STA)}	Repeated Start condition setup time	4.7	-	0.6	-	μs	
t _{su(STO)}	Stop condition setup time	4.0	-	0.6	-	μs	
t _{w(STO:STA)}	Stop to Start condition time (bus free)	4.7	-	1.3	-	μs	
t _{SP}	Pulse width of the spikes that are suppressed by the analog filter for standard fast mode	0	50(5)	0	50(5)	ns	
C_{b}	Capacitive load for each bus line	-	400	-	400	pF	

³ The maximum data hold time has only to be met if the interface does not stretch the low period of SCL signal.

-



7.3 Synchronization

7.3.1 Synchronization input

The FSYNC pin is an input channel for external synchronization input. The FSYNC accepts a trigger with rising edge which send out the latest available data message.

The external synchronization signal must be matched that the maximum trigger frequency is 100Hz. Normally, suggestion for trigger frequency is 1Hz.

7.3.2 Synchronization output

The INT pin is an output channel for external synchronization output. The INT pin is used for indicating the new data has updated. The INT pin generates a pulse with rising edge, and the high level will be hold in 1ms.



8. Message structure

8.1 Serial port (UART)

An YIS message contains the following fields:

YS Header	TID	LEN	DATA	CK1	CK2
Dec 89 83 Hex 59 53	2 Bytes Message TID	Length of Message (1 Byte) excluding YS Header, TID	Data size depend on Len filed		oytes ksum

Table 10. UART message structure

Туре	LEN(Bytes)	Description
YS Header	2	Indicators of start of YIS message, 0x59, 0x53
TID	2	Message identifier,Maximum value is 60000(0xEA60)
LEN	1	Length of YIS message,Maximum value is 255(0xFF)
DATA	0-255	Data
CK1	1	CK1 of checksum
CK2	1	CK2 of checksum

Table 11. DATA structure

Packet 1				Packet	N
DATA ID	LEN	DATA(LEN Bytes)	 DATA ID	LEN	DATA(LEN Bytes)

DATA is a list of several packets. Each packet consists of a unique DATA ID, values and the length of values.

Table 12. Packet structure

DATA NAME	DATA ID	LEN	DATA
Acceleration	0x10	12	DATA1 – DATA12
Angular velocity	0x20	12	DATA1 – DATA12
Normalized Magnetic field	0x30	12	DATA1 – DATA12
Magnetic field	0x31	12	DATA1 – DATA12
Euler angles	0x40	12	DATA1 – DATA12
Quaternion	0x41	16	DATA1 – DATA16
Sampling timestamp*	0x51	4	DATA1 – DATA4



Sync timestamp*	0x52	4	DATA1 – DATA4
IMU temperature*	0x01	2	DATA1 – DATA2
Free acceleration*	0x11	12	DATA1 – DATA12
Delta-v*	0x12	12	DATA1 – DATA12
Delta-q*	0x42	16	DATA1 – DATA16

^{*}Data can be sent out by programming. Please refer to YESENSE communication protocol reference manual.

The checksum is calculated over the Message, starting and including the TID field, up until, but excluding, the Checksum Field:

YS Header	TID	LEN	MESSAGE	CK1	CK2
	← Range ove	r which the ch	ecksum is to be calculated		

The checksum algorithm used is the 8-Bit Fletcher Algorithm, which is used in the TCP standard. This algorithm works as follows:

Buffer[N] contains the data over which the checksum is to be calculated.

The two CK_ values are 8-Bit unsigned integers, only! If implementing with larger-sized integer values, make sure to mask both CK_1 and CK_2 with 0xFF after both operations in the loop.

```
CK1 = 0; CK2 = 0;
For(i=0;i<N;i++)
{
    CK1 = CK1 + buffer[i];
    CK2 = CK2 + CK1;
}</pre>
```

Note:

Please carefully configure the baud rate. The baud rate setting needs to consider the amount of data and the output frequency. If the set baud rate is too low, the data transmission will be incomplete after configuration. In general, the minimum baud rate can be estimated as follows:

- 1. Estimate the serial data transmission time t = 1/f * 1000 5 (ms).
 - f: the expected frequency of output data.
- 2. Estimate the baud rate. the required baud rate = n * 10 * 1000 / t.



n: the required output data length in bytes.

After the baud rate configuration is completed. Please communicate to YIS100 with the new baud rate.

8.2 I2C

The register name and register address of the I2C communication are listed below.

Table 13. Register table

REGISTER NAME	REGISTER ADDRESS	DATA LENGTH(BYTE)
Acceleration	0x10	12
Angular velocity	0x20	12
Normalized Magnetic field	0x30	12
Magnetic field	0x31	12
Euler angles	0x40	12
Quaternion	0x41	16
Sampling timestamp	0x51	4
Sync timestamp	0x52	4
IMU temperature	0x01	2
Free acceleration	0x11	12
Delta-v	0x12	12
Delta-q	0x42	16

Note:

Recommended amount of reading data under different I2C clocks are listed as follows.

I2C mode	Standard mode(100K)	Fast mode(400K)
Max length for reading data	100B	400B

8.3 Value and conversion

The data structure of UART and IIC communication is listed below.

Table 14. Value and conversion

Туре	Value	Conversion	Unit
Acceleration	DATA1(DATA[7:0])	$ax = DATA \times 0.000001$	m/s²
Acceleration	DATA2(DATA[15:8])	ax - Daia x 0.000001	111/5



	DATA3(DATA[23:16])		
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
	DATA6(DATA[15:8])	DATA 0. 000001	
	DATA7(DATA[23:16])	ay = DATA × 0.000001	
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])	DATA 0. 000001	
	DATA11(DATA[23:16])	az = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	DATA 0.000001	
	DATA3(DATA[23:16])	wx = DATA × 0.000001	
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
Amaulan valaaitu	DATA6(DATA[15:8])	DATA 0. 000001	dog/o
Angular velocity	DATA7(DATA[23:16])	wy = DATA × 0.000001	deg/s
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])	DATA 0. 000001	
	DATA11(DATA[23:16])	wz = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	my DATA 0 000001	
	DATA3(DATA[23:16])	mx = DATA × 0.000001	
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
Normalized	DATA6(DATA[15:8])	my - DATA va 000001	
Magnetic field	DATA7(DATA[23:16])	my = DATA ×0.000001	
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])	mz = DATA ×0.000001	
	DATA11(DATA[23:16])	Z = DATA ×0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	mx = DATA × 0.001	
	DATA3(DATA[23:16])	IIIX = DATA X 0.001	
	DATA4(DATA[31:24])		
Magnetic field	DATA5(DATA[7:0])		mGauss
	DATA6(DATA[15:8])	mv - DATA v Q QQ1	
	DATA7(DATA[23:16])	my = DATA × 0.001	
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])	mz = DATA × 0.001	
			1



	DATA10(DATA[15:8])	:	
	DATA11(DATA[23:16])		
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	mital DATA 0.000001	
	DATA3(DATA[23:16])		
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
Fulan analas	DATA6(DATA[15:8])		al a a:/ 0 \
Euler angles	DATA7(DATA[23:16])	roll = DATA × 0.000001	deg(°)
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])		
	DATA11(DATA[23:16])	yaw = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])		
	DATA3(DATA[23:16])	q0 = DATA × 0.000001	
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
	DATA6(DATA[15:8])		
	DATA7(DATA[23:16])	q1 = DATA × 0.000001	
	DATA8(DATA[31:24])		
Quaternion	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])		
	DATA11(DATA[23:16])	q2 = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA13(DATA[7:0])		
	DATA14(DATA[15:8])		
	DATA15(DATA[23:16])	q3 = DATA × 0.000001	
	DATA16(DATA[31:24])		
	DATA1(DATA[7:0])		
Sampling	DATA2(DATA[15:8])	sampling_timestamp =	
timestamp	DATA3(DATA[23:16])	DATA	us
umodamp	DATA4(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	-	
Sync timestamp	DATA3(DATA[23:16])	sync timestamp = DATA	us
	DATA4(DATA[31:24])	\dashv	
	DATA1(DATA[7:0])	+	_
IMU temperature	DATA2(DATA[15:8])	temp_imu = DATA \times 0.01	°C
	DATA1(DATA[7:0])	+	
Free acceleration	DATA1(DATA[7.0]) DATA2(DATA[15:8])		m/s²
	DATAZ(DATA[13.0])		



	DATA3(DATA[23:16])		
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
	DATA6(DATA[15:8])	, DATA 0.000000	
	DATA7(DATA[23:16])		
	DATA8(DATA[31:24])		
	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])	f DATA 0 000001	
	DATA11(DATA[23:16])	- faz = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])	d DATA 0.000001	
	DATA3(DATA[23:16])		
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
Delta-v	DATA6(DATA[15:8])	dvy = DATA × 0.000001	
	DATA7(DATA[23:16])		
	DATA8(DATA[31:24])		,
	DATA9(DATA[7:0])		m/s
	DATA10(DATA[15:8])	dvz = DATA × 0.000001	
	DATA11(DATA[23:16])	UV2 = DATA × 0.000001	
	DATA12(DATA[31:24])		
	DATA1(DATA[7:0])		
	DATA2(DATA[15:8])		
	DATA3(DATA[23:16])	$dq0 = DATA \times 0.000001$	
	DATA4(DATA[31:24])		
	DATA5(DATA[7:0])		
	DATA6(DATA[15:8])	$dq1 = DATA \times 0.000001$	
	DATA7(DATA[23:16])		
Delta-q	DATA8(DATA[31:24])		
Delia-q	DATA9(DATA[7:0])		
	DATA10(DATA[15:8])	$dq2 = DATA \times 0.000001$	
	DATA11(DATA[23:16])		
	DATA12(DATA[31:24])		
	DATA13(DATA[7:0])		
	DATA14(DATA[15:8])	dq3 = DATA × 0.000001	
	DATA15(DATA[23:16])		
	DATA16(DATA[31:24])		

9. Package and handing

Note that this is a mechanical shock (g) sensitive device. Proper handling is required to



prevent damage to the part.

Note that this is an ESD-sensitive device. Proper handling is required to prevent damage to the part.

Make sure not to apply force on the components of the YIS100 series module, especially when placing the YIS100 series module in an IC-socket.

9.1 Package drawing

The YIS100 series module is compatible with JEDEC PLCC20 IC-sockets.

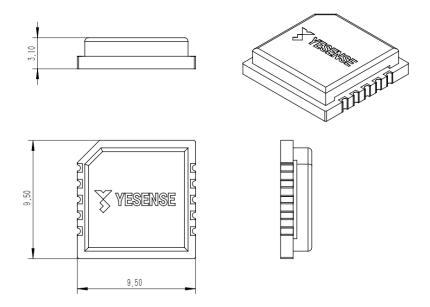


Figure 4. Package drawing (general tolerances are +/- 0.1 mm)



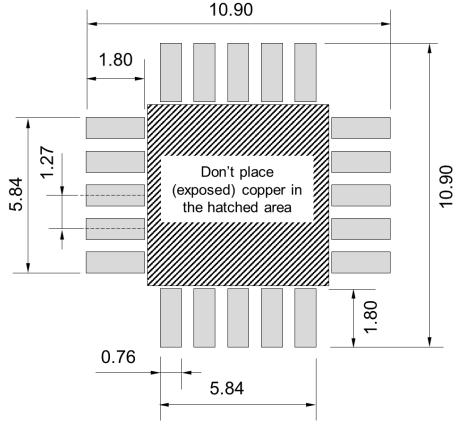


Figure 5. Recommended YIS100 series module footprint

9.2 Mounting considerations

The module contains a MEMS (Micro Electro Mechanical System) chip and is therefore sensitive for stress applied on the PCB. To minimize stress apply the following design rules for the PCB and housing.

Avoid stress on the PCB by screwing/mounting it in a housing, applying unequal or excessive forces to the mounting positions. Ideally the PCB should be mounted using mechanical dampeners.

- Avoid force applied on the PCB by push buttons, connectors etc. close to the YIS100 series module.
- Avoid heat sources close to the YIS100 series
- Avoid vibrations caused by speaker, buzzer etc.

9.3 Soldering

9.3.1 Soldering paste

Use of "No Clean" and "Lead-free" soldering paste is strongly recommended, as it does not require cleaning after the soldering process has taken place.



9.3.2 Reflow soldering

A convection type soldering oven is highly recommended over the infrared type radiation oven.

Convection heated ovens allow precise control of the temperature and all parts will be heated up evenly, regardless of material properties, thickness of components and surface color.

9.3.3 Preheat

Initial heating of component leads and balls. Residual humidity will be dried out. Note that this preheat phase will not replace prior baking procedures.

- Temperature rise rate: max 3° C/s. If the temperature rise is too rapid in the preheat phase it may cause excessive slumping.
- Time: 60 120 s. If the preheat is insufficient, rather large solder balls tend to be generated. Conversely, if performed excessively, fine balls and large balls will be generated in clusters.
- End Temperature: 150 200° C, 180° C is recommended. If the temperature is too low, non-melting tends to be caused in areas containing large heat capacity.

9.3.4 Heating/Reflow

The temperature rises above the liquidus temperature of 217° C. Avoid a sudden rise in temperature as the slump of the paste could become worse.

- Temperature rise/fall rate: max 2 ° C/s.
- Limit time above 217° C liquidus temperature: 40 60 s.
- Peak reflow temperature: 250° C.

9.3.5 Cooling

A controlled cooling avoids negative metallurgical effects (solder becomes more brittle) of the solder and possible mechanical tensions in the products. Controlled cooling helps to achieve bright solder fillets with a good shape and low contact angle.

• Temperature fall rate: max 4° C/s.

9.3.6 Optical inspection

After soldering the YIS100 modules, consider an optical inspection step to check whether:

- The module is properly aligned and centered over the pads.
- All pads are properly soldered.



 No excess solder has created contacts to neighboring pads, or possibly to pad stacks and vias nearby.

9.3.7 Cleaning

In general, cleaning the populated modules is strongly discouraged. Residues underneath the modules cannot be easily removed with a washing process.

The best approach is to use a "no clean" soldering paste and eliminate the cleaning step after the soldering. Note that ultrasonic cleaning will permanently damage the module, in particular the oscillators and MEMS chips.

9.3.8 Repeated reflow soldering

Only single reflow soldering processes are recommended. YIS100 modules should not be submitted to two reflow cycles on a board populated with components on both sides in order to avoid upside down orientation during the second reflow cycle. In this case, the module should always be placed on that side of the board, which is submitted into the last reflow cycle. The reason for this (besides others) is the risk of the module falling off due to the significantly higher weight in relation to other components.

9.3.9 Hand soldering

Hand soldering is allowed. Use a soldering iron temperature-setting equivalent to 350° C. Place the module precisely on the pads. Start with a diagonal fixture soldering (e.g. pins 1 and 11), and then continue in clockwise.

9.3.10 Rework

The YIS100 modules can be unsoldered from the baseboard using a hot air gun. When using a hot air gun for unsoldering the module, a maximum of one reflow cycle is allowed. In general, we do not recommend using a hot air gun because this is an uncontrolled process and might damage the module.

After the module is removed, clean the pads before placing and hand soldering a new module.

In addition to the two reflow cycles, manual rework on particular pins by using a soldering iron is allowed. Manual rework steps on the module can be done several times.



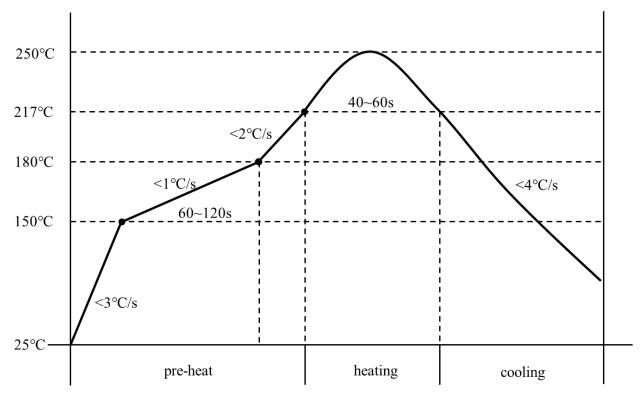


Figure 6 Recommended soldering profile

10. Revisions

Revision	Date	Ву	Changes
R01	2018-12-18	Z. L.	Initial release
R02	2019-10-15	Z. L.	Update communication information

Copyright © 2018 Yesense Technologies Co., Ltd. All rights reserved. Information in this document is subject to change without notice. All other trademarks are the property of their respective owners.