Forward commons arrival a traceable horizontal route

Use the surviving upper-deck ribbons and commons door before placing new core bays. This study covers one port-forward stack on D13-D17; v2 affiliations remain unchanged.

BOW toward Z -541 | PORT at top | dimensions in metres

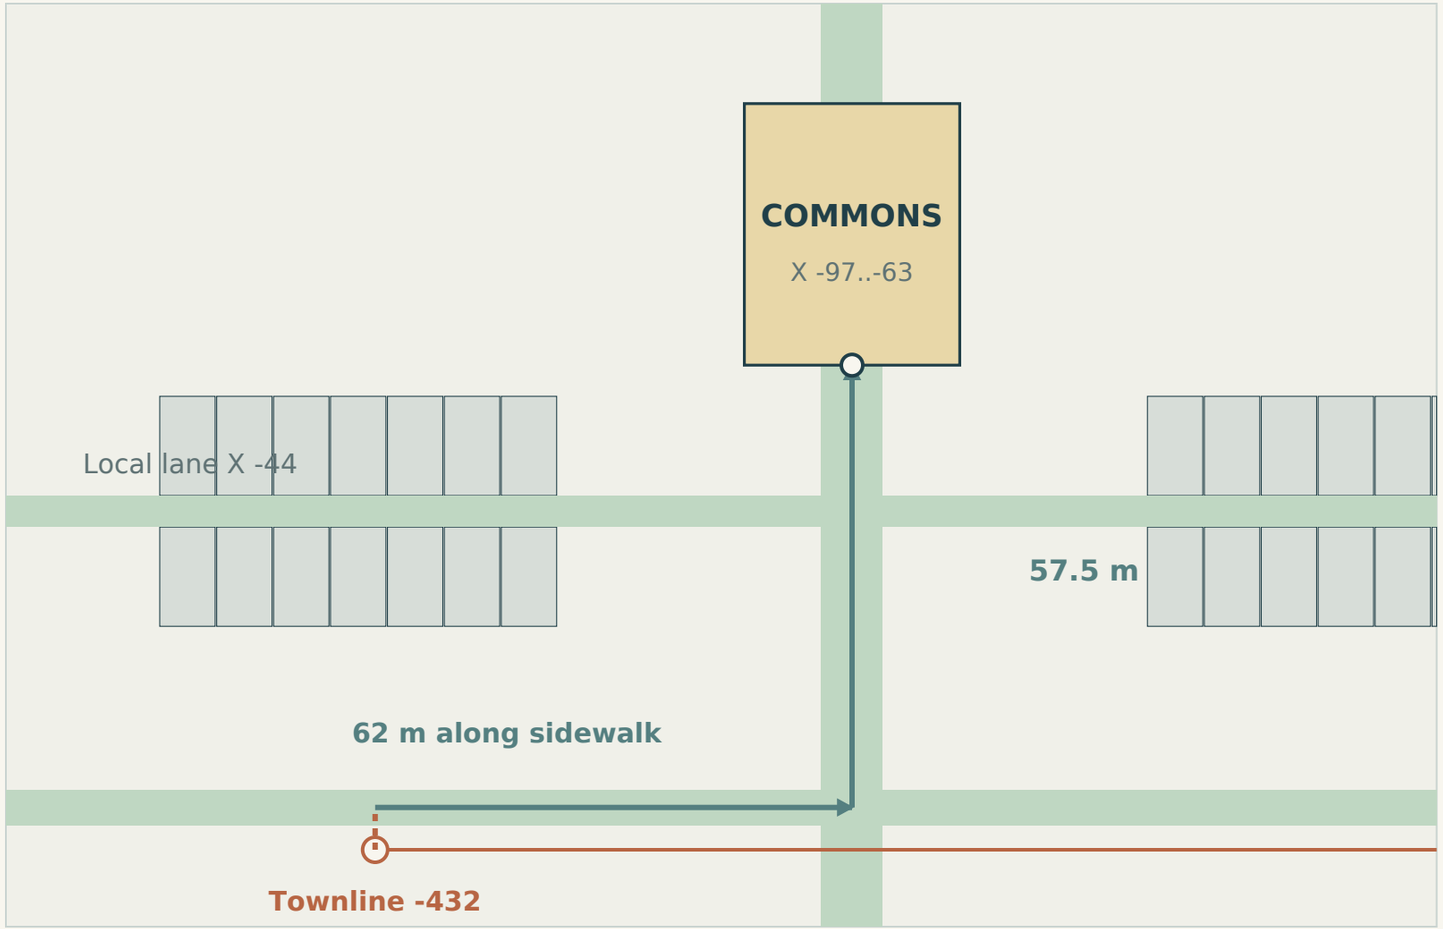

D13 representative; the same route ribbons and commons datum recur on D14-D17.

Historical evidence

Townline stop

Plotted center: X 0, Z -432. The logical boarding vestibule and its actual exit geometry are missing.

Public sidewalk

X -5.5 centerline; 4.6 m drawn width. Existing upper branch starts at Z -370.

Commons threshold

Door marker at X -63, Z -370. Preserve the whole 8 m transverse ribbon and the existing door interface.

Residential branch

Local lane at X -44; 4 m drawn width. Guest rectangles and their assigned IDs remain separate evidence.

119.5 m of route is traceable along historical ribbons. The 5.5 m stop-to-sidewalk offset is only a proposed connection line. Neither distance certifies a traversable route or boarding fit.

Evidence: atlas pp. 15-19 vector paths and door marker; atlas p. 2 limits. No new room affiliation or unit capacity is assigned.

Preferred test two upper core bays beside the shared route

New reservation coordinates are test inputs. The bays start at D12 and serve the D13-D17 commons stack in principle; mechanism, structural and headroom fit remain open.

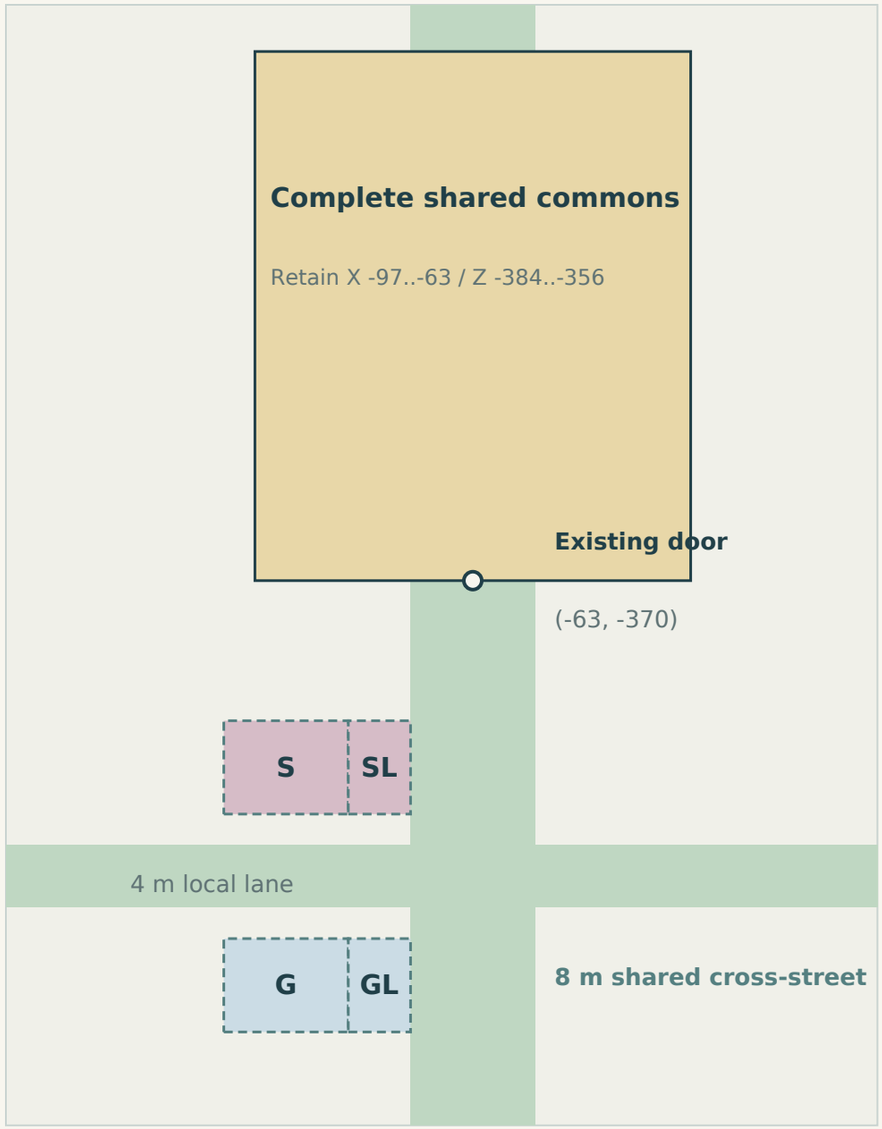

Located proposal

G Guest core reservation

X -40..-34 / Z -386..-378
6 x 8 m plan test; no lift count or passenger capacity inferred.

GL Guest landing

X -40..-34 / Z -378..-374
6 x 4 m, facing the retained cross-street. Aperture and moving-leaf pocket are unknown.

S Service core reservation

X -54..-48 / Z -386..-378
6 x 8 m test; separate vertical staff use. Cart turn, doors and equipment are unsized.

SL Service landing

X -54..-48 / Z -378..-374
6 x 4 m. Upper staff delivery still joins the shared public cross-street.

Keep the route hierarchy legible

The X -44 lane remains between the bays with 2 m to each reservation. Both landings meet the full Z -374..-366 cross-street without reducing its drawn width. The commons door and allocation remain unchanged.

Dashed bays and landings are new proposals. Zero upper room-rectangle or ribbon intersections in the 2D screen; host feasibility is unproven.

Why the first full-height placements fail

Room rectangles alone miss circulation conflicts. Two rejected reservations explain why the preferred test moves inboard and begins above D11.

R1 At the commons edge

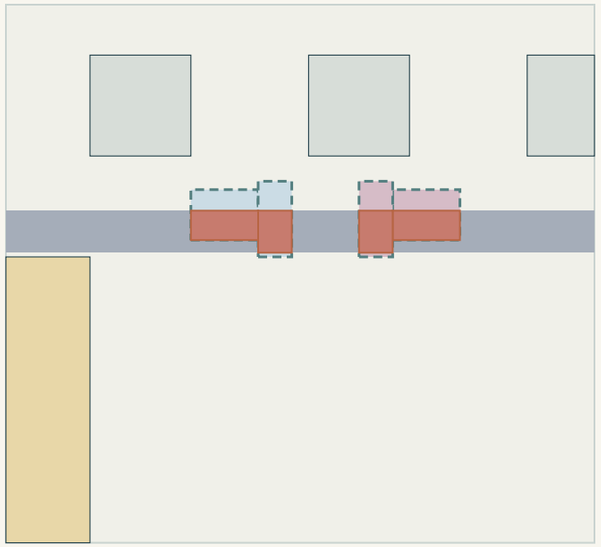

Protected ribbon
X -59.5..-54.5
5 m drawn width
D09-D12

Each core overlaps 28 m2; each landing overlaps 20 m2 of the ribbon on every screened lower deck.

D09 representative service/staff ribbon

R2 Straight inboard stack

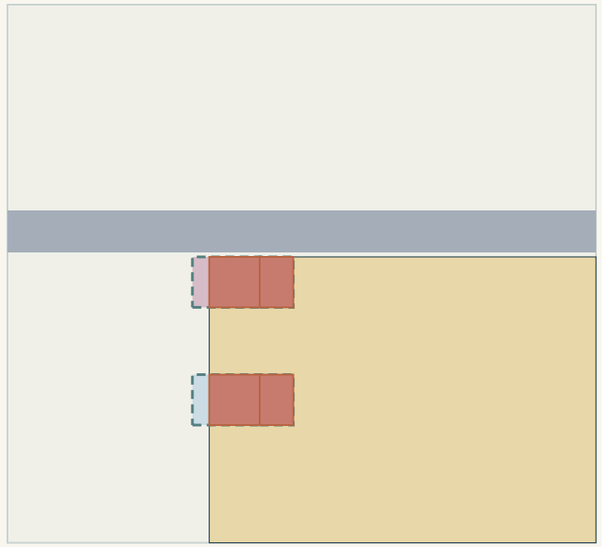

Music room
X -54..-8
Z -384..-316
D11_music

The twin cores and their landings would overlap 120 m2 of its historical allocation in total.

D11 Music room remains protected

Gray matches the service/staff legend; service-route meaning is inferred. Drawn width is not certified clear width.

Disposition

Reject R1: keep the service/staff ribbon continuous. Reject R2 as a D09-D17 stack: retain the Music room and its public access. R3 uses the same inboard twin-bay plan only from D12 upward, with separately proposed lower-level approach links.

No hidden permission to occupy the gap

A clear 2D overlay is only a candidate. Unshown structure, service equipment, final room walls, fire/egress needs, lift pits and ceiling zones may still occupy or constrain it. No floor openings or host edits are made.

D12 transfer level and upper section strategy

Start the proposed local cores at D12 to retain the D11 Music allocation. Express and Townline remain the documented travel interfaces while these interfaces are unresolved.

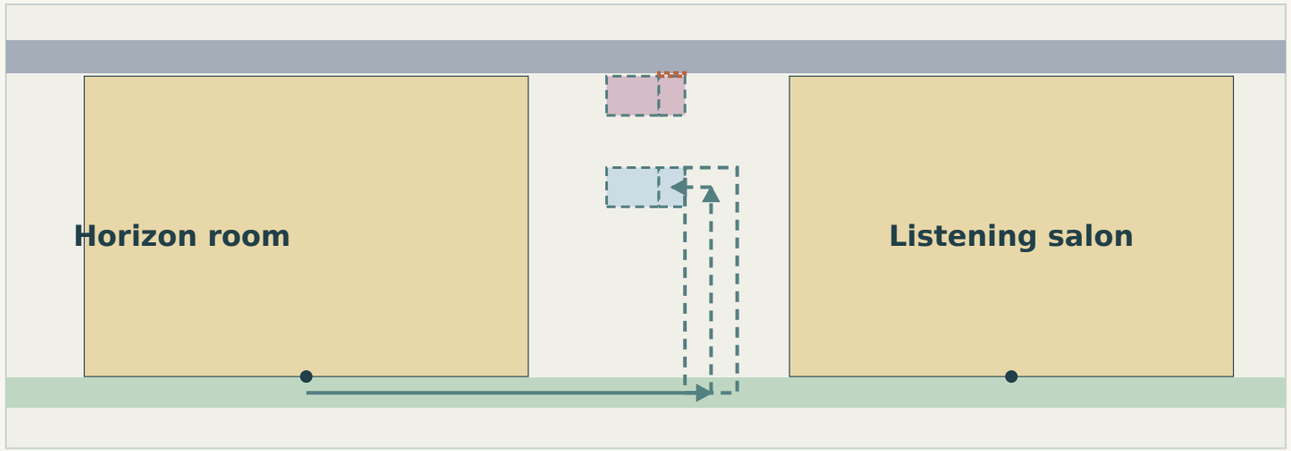

D12 approach proposals

Guest: new 8 m spur at Z -374..-366, X -40..-5.5, linking the known port sidewalk to the guest landing. The historical D12 transverse ribbons are elsewhere; this spur is not recovered geometry.

Staff: a 0.5 m long x 4 m wide threshold link from the service ribbon edge X -54.5 to the service landing at X -54. The ribbon stays open. Exact wall, door, cart turning and support conditions need recovery.

Historical public entries stay on the port sidewalk; both destinations retain their full footprints.

Proposed vertical travel range exact floor datums

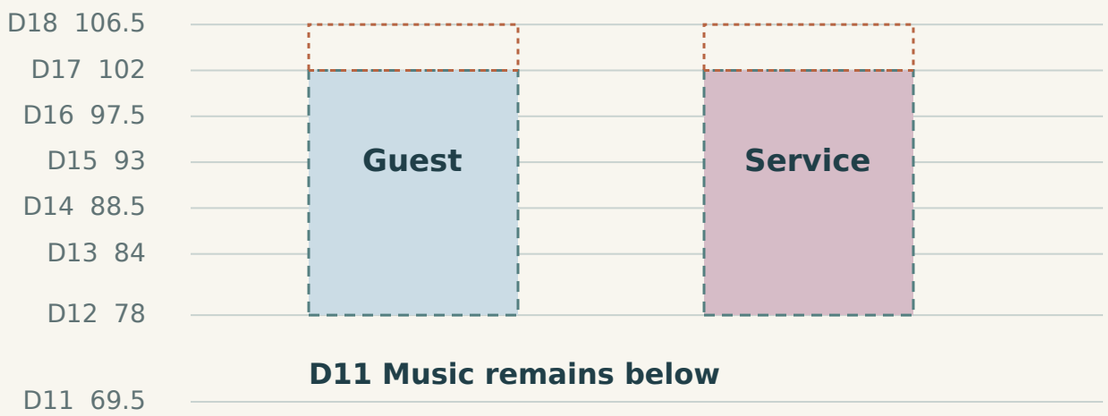

Headroom and D18 interface unknown

D13-D17 commons levels remain complete

No lift speed, cabin count or capacity assigned

D12 base Y78: pit and slab/support fit unresolved

Section shows intended connection range, not built shafts or slab openings. Upper hull, roof clearance, machinery and fire/egress provisions are unverified.

Protected footprints and the next interface decisions

R3 is a preferred coordinate-based test for one stack. It preserves the named programs and historical route strips in the available plan evidence, while keeping all missing host geometry explicit.

Protected program beside the study

D09	**Orchard market**	X -54..-8 / Z -466..-398 D09_market0
D10	**The shared table / 240 places**	X -54..-8 / Z -466..-398 D10_dining0
D11	**The music room**	X -54..-8 / Z -384..-316 D11_music
D12	**Horizon room**	X -54..-8 / Z -466..-398 D12_observation0
D12	**Listening salon**	X -54..-8 / Z -358..-290 D12_listening2
D13-D17	**Complete port forward commons**	X -97..-63 / Z -384..-356 Geometry-to-ID mapping unresolved

Door markers on the port public side remain X -8: market / dining / Horizon at Z -432; Music at -350; Listening at -324.

Before and after

R1: conflicts with the lower service/staff ribbon. Rejected.
R2: clears that ribbon but intersects D11 Music. Rejected as a continuous lower-to-upper core.
R3: starts at D12, with new guest and staff approach stubs. Bays avoid protected plan footprints; the guest spur deliberately joins the sidewalk.

Hard evidence gates

Recover wall, floor/support and lift-pit geometry at Y78; no assumption that stopping above Music avoids an underfloor conflict.

Verify moving door clear span, clear head, leaf travel and cassette on each landing; no dimensions borrowed from salon fixtures.

Check actual cart/body turns and supported routes. Upper delivery shares the public cross-street; segregated back-of-house access is not established.

Recover upper hull and machinery/headroom; reconcile 1,000 units and 81 luxury units by ID and real room geometry.

Planning to asset handoff

Next useful kit: a paired guest landing return and service threshold/stow edge, parametric to the 6 x 4 m study landings. Preserve the 8 m cross-street and 4 m residential lane. Test a calm commons-facing guest identity beside a clearly serviceable cart-side interface before authoring shafts or moving mechanisms.

D09 shops and upper guest rectangles are also screened and unchanged. No new room IDs, capacities, allocations, runtime geometry or floor cuts are produced.