


set card

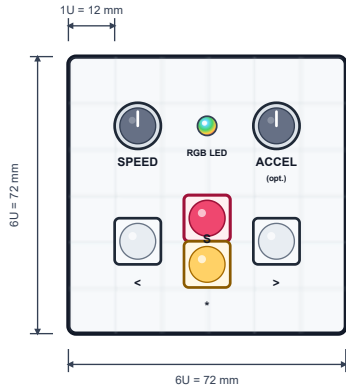

Panel

Silk: S SET · < MOVE_L · > MOVE_R · * OPTION. ACCEL pot is optional (B4S_USE_ACCEL_P0T).
Unlock at boot: press OPTION (rainbow LED).

Move

ACTION	KEY	DESCRIPTION
(MOVE_L / MOVE_R) tap $\leq \frac{1}{5}s$	< / > tap	Locked cruise toward that soft end at SPEED
(MOVE_L / MOVE_R) hold $> \frac{1}{5}s$	< / > hold	Hold-to-run; soft-stop on release
Same MOVE tip while locked	< or > tip	Soft-stop cruise
Opposite MOVE	< or >	Reverse / retarget other soft end
OPTION + (MOVE_L / MOVE_R)	* + < / >	Same as MOVE at panel max speed
OPTION hold while moving	* hold	Boost to max speed; release → SPEED pot
SET while moving	S	Soft-stop
MOVE_L + MOVE_R	< >	Halt; driver off until any key
MOVE_L + MOVE_R hold $\geq 1s$	< > hold $\geq 1s$	Swap left/right
All four (L+R+OPTION+SET)	< > * S	Halt + reset like power-up

Tap vs hold: B4S_MOVE_TAP_MS (333 ms). OPTION before MOVE launches at max speed + max accel; OPTION after start boosts speed only.

Soft limits (A / B window)

ACTION	KEY	DESCRIPTION
SET + MOVE_L tap	S < tap	Set soft_limit_L here
SET + MOVE_R tap	S > tap	Set soft_limit_R here
SET + MOVE_L hold $\geq 1s$	S < hold $\geq 1s$	Reset L $\rightarrow$ slider min
SET + MOVE_R hold $\geq 1s$	S > hold $\geq 1s$	Reset R $\rightarrow$ slider max
SET + L + R hold $\geq 1s$	S < > hold $\geq 1s$	Reset both ends

Travel only inside the working window. MOVE cruise targets those ends (A / B).

SET / OPTION

ACTION	KEY	DESCRIPTION
SET tap (idle)	S tap	Nothing
SET hold ≥1s (idle)	S hold ≥1s	Accel preset L — no ACCEL pot
SET hold ≥3s (idle)	S hold ≥3s	Accel preset H — no ACCEL pot
SET hold ≥5s (idle)	S hold ≥5s	Accel learn from SPEED pot — no ACCEL pot
OPTION + SET tap	* S tap	Disable driver
OPTION + SET hold ≥1s	* S hold ≥1s	Toggle loop armed
Any key while disabled	—	Re-enable driver

Loop arm does not start motion; next MOVE cruise ping-pongs until SET / same tip / halt.

Pots


CONTROL	DESCRIPTION
SPEED	Left → slower floor; right → faster (finer at low end)
ACCEL	If B4S_USE_ACCEL_POT=1: left gentler / right snappier. SET accel holds off.

Workflows

- **Normal moving**
 - Unlock with OPTION if LED is rainbow
 - Dial SPEED (and ACCEL pot, or SET 1s/3s presets if no pot)
 - Tap MOVE to cruise to a soft end; hold MOVE to jog
 - Same tip stops; opposite reverses; SET stops; L+R halt
- **Frame A / B**
 - Jog to first pose; $S < \text{tap} \rightarrow \text{soft_limit_L}$
 - Jog to second pose; $S > \text{tap} \rightarrow \text{soft_limit_R}$
 - Rehearse: MOVE tap cruises to that end
 - Optional loop: idle * S hold $\geq 1s$, then MOVE tap

Status LED

COLOUR	MEANING
 Rainbow	Power-on / unlock
 Dim white	Idle, ready
 White ↔ blue	Loop armed (idle)
 Yellow	Accel / decel
 Green	Steady speed
 +30% / 100% blue	Near / at soft end
 +10% blue	Loop running
 Dim orange	Driver off
 Red fast blink	Hard limit
 Red blink	Homing
 Red	DRV_ERROR / E-stop
 White blip	Soft limit set / reset
 White flash /s	SET hold second counter
 Violet ×1 / ×2 / ×3	Accel preset L / H / learn
 Red flash	Halt / all-four reset

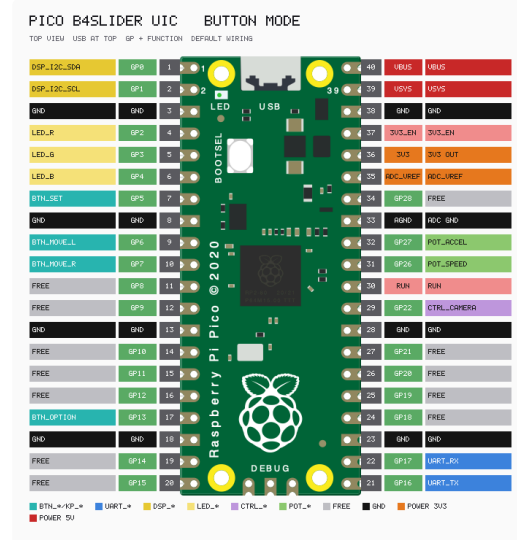

UART to SliderMC @ 1Mbaud (GP16/17 crossed). Handshake: UIC \n → MC welcome # ... banner.