

849 NW STATE ROAD 45

NEWBERRY, FL 32669 USA

PH: 888.472.2424 OR 352.472.5500

FAX: 352.472.2030

EMAIL: linfo@timcoengr.com
HTTP://WWW.TIMCOENGR.COM

FCC PART 74 LOW POWER LICENSED TRANSMITTER TEST REPORT

APPLICANT	PROFORA INTERNATIONAL CORPORATION			
	719 LAMBS CREEK ROAD			
	P.O. BOX 99			
	MANSFIELD, PA USA 16933			
FCC ID	2AAQCPM-HHP1			
PRODUCT DESCRIPTION	HANDHELD WIRELESS MICROPHONE			
DATE SAMPLE RECEIVED	9/18/2012			
DATE TESTED	10/8/2012			
TESTED BY	Sushant Kadimdivan			
APPROVED BY	Mario de Aranzeta			
TIMCO REPORT NO.	1350UT13TestReport.doc			
TEST RESULTS	⊠ PASS ☐ FAIL			

THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.





TABLE OF CONTENTS

GENERAL REMARKS	3
GENERAL INFORMATION	4
TEST PROCEDURES	6
RF POWER OUTPUT	7
MODULATION CHARACTERISTICS	8
VOICE MODULATED COMMUNICATION EQUIPMENT	9
AUDIO INPUT VERSUS MODULATION	10
OCCUPIED BANDWIDTH	11
SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED)	13
FIELD STRENGTH OF SPURIOUS EMISSIONS	14
FREQUENCY STABILITY	16
EMC EQUIPMENT LIST	17

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID:

2AAQCPM-HHP1 V:\P\PROFORA\1350UT13\1350UT13TESTREPORT.DOC REPORT:



GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

The test results relate only to the items tested.

Summary

The device under test does:

fulfill the general approval requirements as identified in this test report not fulfill the general approval requirements as identified in this test report

Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.

Certificate # 0955-01

I attest that the necessary measurements were made, under my supervision, at:

Timco Engineering Inc. 849 NW State Road 45 Newberry, Fl 32669



Authorized Signatory Name:

Mario de Aranzeta C.E.T. Compliance Engineer/ Lab. Supervisor

Date: October/8/2012

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



GENERAL INFORMATION

RULES PART 2.1033

DUT TECHNICAL DESCRIPTION

DUT Description	HANDHELD WIRELESS MICROPHONE		
FCC ID	2AAQCPM-HHP1		
Modulation	FM		
	140KOF3E		
	Bn = 2M + 2DK		
Type of Emission	M = 15000		
Type of Emission	D = 55 kHz (Peak Deviation)		
	K = 1		
	Bn = 2(15k) + 2(55k)(1) = 140k		
Frequency Range	668-692 MHz		
Test Frequencies	668 MHz, 680 MHz, 692 MHz		
Maximum Output Power	0.002 Watts		
	☐ 110-120Vac/50- 60Hz		
DUT Power Source	☐ DC Power		
	☐ Battery Operated Exclusively		
	☐ Prototype		
Test Item	☐ Pre-Production		
	□ Production		
	Fixed		
Type of Equipment	Mobile		
	□ Portable □		

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



GENERAL INFORMATION

Test Facility	Timco Engineering, Inc. 849 NW State Road 45, Newberry, FL 32669			
Test Condition	The temperature was 26°C Relative humidity of 50%.			
Modifications	None			
Test Exercise (e.g software description, test signal, etc.)	n, operation			
Applicable Standards	ANSI/TIA 603-C:2004, FCC CFR 47 Parts 2 and 74			

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID:

2AAQCPM-HHP1 V:\P\PROFORA\1350UT13\1350UT13TESTREPORT.DOC REPORT:



TEST PROCEDURES

Power Line Conducted Interference: The procedure used was ANSI/TIA 603-C: 2004 using a 50uH LISN. Both lines were observed with the UUT transmitting. The bandwidth of the spectrum analyzer was 10 kHz with an appropriate sweep speed.

Bandwidth 20 dB: The measurements were made with the spectrum analyzer's resolution bandwidth (RBW) = 1 MHz and the video bandwidth (VBW) = 3 MHz and the span set as shown on plot.

Power Output: For a device with a fixed antenna, RF power is measured as ERP as the antenna is permanently attached. The substitution method was used as described in ANSI/TIA-603-C: 2004.

Antenna Conducted Emissions: The RBW = 100 kHz, VBW = 300 kHz and the span set to 10.0 MHz and the spectrum was scanned from 30 MHz to the 10^{th} Harmonic of the fundamental. Above 1 GHz the resolution bandwidth was 1 MHz and the VBW = 3 MHz and the span to 50 MHz.

Radiation Interference: The test procedure used was ANSI/TIA 603-C: 2004 using an Agilent spectrum receiver with preselector. The bandwidth (RBW) of the spectrum receiver was 100 kHz up to 1 GHz and 1 MHz above 1 GHz with an appropriate sweep speed. The VBW above 1 GHz was 3 MHz. The analyzer was calibrated in dB above a microvolt at the output of the antenna.

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



RF POWER OUTPUT


Rule Part No.: Part 2.1046(a), Part 74

Method of Measurement:

For Conducted measurements the device was connected to a power meter with appropriate attenuators. The reading was corrected for the total cable and attenuator loss.

For a device has a fixed antenna, RF power is measured as ERP as the antenna is permanently attached. The substitution method was used. With the transmitter properly adjusted the RF output measures:

Test Setup Diagram:

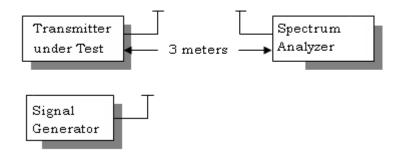

Test Data:

OUTPUT POWER: .002 Watts

Part 2.1033 (C)(8) DC Input into the final amplifier

INPUT POWER: (3.0V)(0.12A) = 0.36 Watts

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



MODULATION CHARACTERISTICS


Rule Part No.: Part 2.1047(a)(b),

Method of Measurement:

Audio frequency response

The audio frequency response was measured in accordance with ANSI/TIA 603-C: 2004 with no exception. A curve or equivalent data showing the frequency response of the audio modulating circuit over a range of 100 – 5000Hz shall be submitted. The audio frequency response curve is shown below.

AUDIO FREQUENCY RESPONSE PLOT

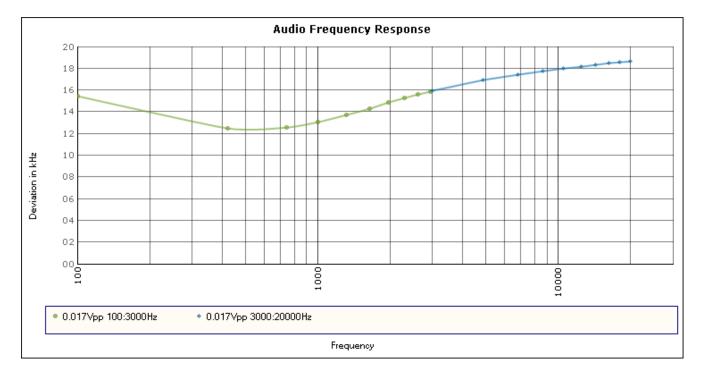

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



VOICE MODULATED COMMUNICATION EQUIPMENT

Part 2.1047(a) Voice modulated communication equipment: For equipment required to have an audio low-pass filter, a curve showing the frequency response of the filter, or of all the circuitry installed between the modulation limiter and the modulated stage shall be submitted.

Audio low pass filter is not required in this unit.

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1




AUDIO INPUT VERSUS MODULATION

Rule Part No.: Part 2.1047(b) & 74

Test Requirements:

Method of Measurement: Modulation cannot exceed 100%, the audio input level needed for a particular percentage of modulation was measured in accordance with ANSI/TIA 603-C: 2004. The audio input curves versus modulation are shown below. Curves are provided for audio input frequencies of 300, 1000, and 3000 Hz.

Test data:

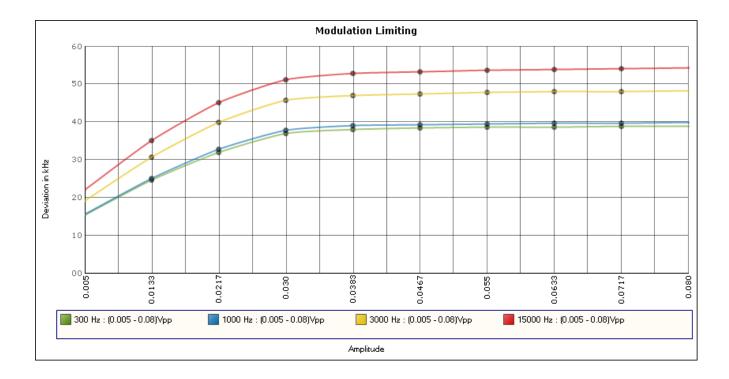


Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



OCCUPIED BANDWIDTH

Data in the plots show that all sidebands between 50 & 100% for the authorized bandwidth are attenuated by at least 25 dB. From 100 to 250% of the authorized bandwidth they are attenuated by at least 35 dB and beyond 250% 43+10log(Po) dB. The plot shows the transmitter modulated with 15000 Hz (the highest modulation frequency), adjusted for 50% modulation plus 16 dB. The spectrum analyzer was set with the unmodulated carrier at the top of the screen. The test procedure diagram and occupied bandwidth plot follows.

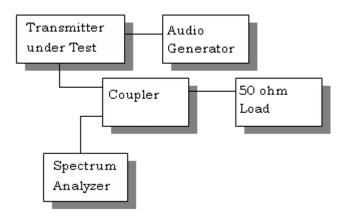

OCCUPIED BANDWIDTH MEASUREMENT


Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



OCCUPIED BANDWIDTH PLOT

NOTES: Profora International Corp. - FCC ID: 2AAQCPM-HHP1 Occupied Bandwidth Plot

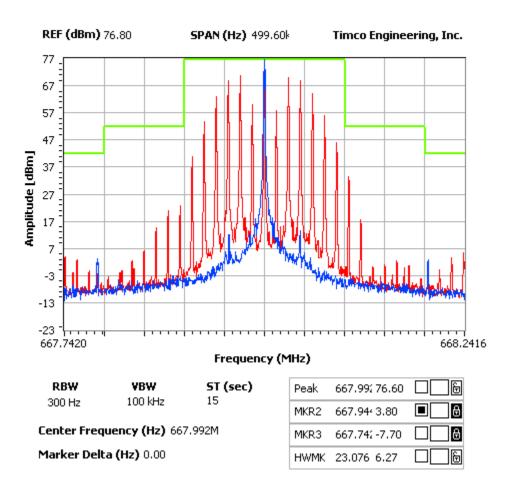

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED)

REQUIREMENTS: Emissions must be 43 +10log(Po) dB below the mean power output of the transmitter.

surpur of the transmitter.

$$43 + 10 \log (0.010) = 23.0 \text{ dB}$$

TEST DATA:

The microphone does not have an external antenna connector.

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



FIELD STRENGTH OF SPURIOUS EMISSIONS

Rule Parts. No.: Part 2.1053


Requirements: Emissions must be 43 +10log(Po) dB below the mean power output of

the transmitter.

 $43 + 10 \log(0.010) = 23.0 \text{ dB}$

METHOD OF MEASUREMENTS: The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. This test was conducted per ANSI/TIA 603-C: 2004 using the substitution method. Measurements were made at the test site of Timco Engineering, Inc. located at 849 NW State Road 45, Newberry, FL 32669.

Test Setup Diagram:

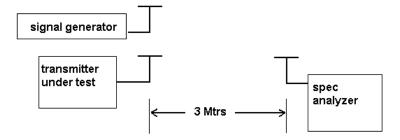

Test Data:

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
668.00	V	0
1336.00	V	43.8
2004.00	V	33.0
2672.00	V	39.2
3340.00	V	39.6
4008.00	V	45.4
4676.00	V	50.9
5344.00	V	50.4
6012.00	V	50.2
6680.00	V	50.0

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
680.00	0	0
1360.00	V	45.9
2040.00	V	28.3
2720.00	V	43.2
3400.00	V	38.4
4080.00	V	46.2
4760.00	V	44.7
5440.00	V	50.5
6120.00	V	49.1
6800.00	V	48.4

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
692.00	0	0
1384.00	V	47.3
2076.00	V	24.3
2768.00	V	49.2
3460.00	V	38.5
4152.00	V	43.2
4844.00	V	46.7
5536.00	V	49.9
6228.00	V	53.1
6920.00	V	48.2

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID:

2AAQCPM-HHP1 V:\P\PROFORA\1350UT13\1350UT13TESTREPORT.DOC REPORT:



FREQUENCY STABILITY

Rule Parts. No.: Part 2.1055, Part 74.861, RSS-123 Issue 1, Rev. 2

Requirements: Temperature and voltage tests were performed to verify that the frequency remains within the .0050%,(50 ppm)

Method of Measurements: ANSI/TIA 603-C: 2004.

The test was conducted as follows: The transmitter was placed in the temperature chamber at 25 °C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15-second intervals. The worse case number used in the table below. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -30 °C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15-second intervals. The worst-case number was again used in the table below. This procedure was repeated in 10-degree increments up to +50 degrees C.

Test Data:

Assigned Frequency (Ref. Frequency) (MHz)		
Temperature (°C)	Frequency (MHz)	Frequency Stability (PPM)
-30	679.991910	0.23
-20	679.993489	2.55
-10	679.994599	4.18
0	679.994490	4.02
+10	679.993436	2.47
+20	679.991750	-0.01
+30	679.989998	-2.58
+40	679.988930	-4.15
+50	679.988453	-4.85

Assigned Frequence	cy (Ref. Frequency) (MHz)	
Battery Frequency (MHz)		Frequency Stability (PPM)
-15%	679.991820	0.10
0	679.991754	0
+15%	679.991706	-0.07

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID: 2AAQCPM-HHP1



EMC EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3/10-Meter OATS	TEI	N/A	N/A	12/31/11	12/31/13
3-Meter OATS	TEI	N/A	N/A	12/31/11	12/31/13
AC Voltmeter	HP	400FL	2213A14499	06/12/11	06/12/13
Frequency Counter	HP	5385A	2730A03025	08/17/11	08/17/13
Antenna: Log- Periodic	Electro- Metrics	LPA-25	1122	05/04/11	05/04/13
Measuring Tape-7.5M	Kraftixx	7.5M PROFI		06/13/11	06/13/13
Digital Multimeter	Fluke	FLUKE-77-3	79510405	06/13/11	06/13/13
Analyzer Open-Frame Tower Preamplifier	НР	8449B	3008A01075	07/22/09	09/15/13
Analyzer Tan Tower Preamplifier	НР	8449B-H02	3008A00372	11/21/09	10/28/13
Analyzer Tan Tower Quasi- Peak Adapter	НР	85650A	3303A01690	11/22/09	10/28/13
Analyzer Tan Tower RF Preselector	НР	85685A	3221A01400	11/21/09	10/28/13
Analyzer Tan Tower Spectrum Analyzer	НР	8566B Opt 462	3138A07786 3144A20661	11/24/09	10/28/13
Temperature Chamber	Tenney Engineering	TTRC	11717-7	07/03/12	07/03/14
3-Meter Semi- Anechoic Chamber	Panashield	N/A	N/A	12/31/11	12/31/13

Applicant: PROFORA INTERNATIONAL CORPORATION

FCC ID:

2AAQCPM-HHP1 $V:\P\PROFORA\1350UT13\1350UT13TESTREPORT.DOC$ REPORT: