


Picture D.3 Tilt position of the wireless device on the left side of SAM

D.2 Body-worn device

A typical example of a body-worn device is a mobile phone, wireless enabled PDA or other battery operated wireless device with the ability to transmit while mounted on a person's body using a carry accessory approved by the wireless device manufacturer.

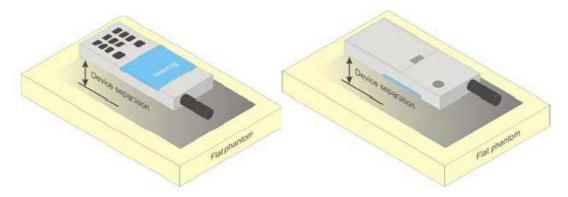


Picture D.4 Test positions for body-worn devices

D.3 Desktop device

A typical example of a desktop device is a wireless enabled desktop computer placed on a table or desk when used.

The DUT shall be positioned at the distance and in the orientation to the phantom that corresponds to the intended use as specified by the manufacturer in the user instructions. For devices that employ an external antenna with variable positions, tests shall be performed for all antenna positions specified. Picture 8.5 show positions for desktop device SAR tests. If the intended use is not specified, the device shall be tested directly against the flat phantom.



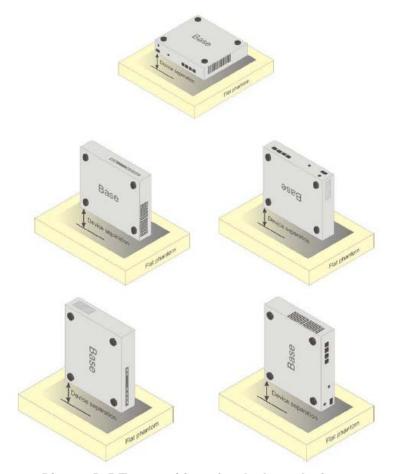

Picture D.5 Test positions for desktop devices

D.4 DUT Setup Photos



Picture D.6



ANNEX E Equivalent Media Recipes

The liquid used for the frequency range of 800-3000 MHz consisted of water, sugar, salt, preventol, glycol monobutyl and Cellulose. The liquid has been previously proven to be suited for worst-case. The Table E.1 shows the detail solution. It's satisfying the latest tissue dielectric parameters requirements proposed by the IEEE 1528 and IEC 62209.

TableE.1: Composition of the Tissue Equivalent Matter

		•			•			
Frequency	835Head	025Dady	1900	1900	2450	2450	5800	5800
(MHz)	озопеац	835Body	Head	Body	Head	Body	Head	Body
Ingredients (% by	/ weight)							
Water	41.45	52.5	55.242	69.91	58.79	72.60	65.53	65.53
Sugar	56.0	45.0	\	\	\	\	\	\
Salt	1.45	1.4	0.306	0.13	0.06	0.18	\	\
Preventol	0.1	0.1	\	\	\	\	\	\
Cellulose	1.0	1.0	\	\	\	\	\	\
Glycol	,	\	44.450	20.06	44.4E	07.00	\	\
Monobutyl	\	\	44.452	29.96	41.15	27.22	\	\
Diethylenglycol	,	\	\	\	\	\	17.24	17.24
monohexylether	\	\	\	\	\	\	17.24	17.24
Triton X-100	\	\	\	\	\	\	17.24	17.24
Dielectric	ε=41.5	ε=55.2	ε=40.0	ε=53.3	ε=39.2	ε=52.7	ε=35.3	ε=48.2
Parameters								
Target Value	σ=0.90	σ=0.97	σ=1.40	σ=1.52	σ=1.80	σ=1.95	σ=5.27	σ=6.00



ANNEX F System Validation

The SAR system must be validated against its performance specifications before it is deployed. When SAR probes, system components or software are changed, upgraded or recalibrated, these must be validated with the SAR system(s) that operates with such components.

Table F.1: System Validation for 3617

Probe St. Liquid name Validation date Prequency point Status (N. Kri Not)	Droha CN		Validation data	1	Ctatus (OK as Nat)
3617 Head 850MHz Sep. 5, 2015 850 MHz OK 3617 Head 1450MHz Sep. 6, 2015 900 MHz OK 3617 Head 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Head 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Head 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Head 1900MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2450MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5300MHz Sep. 12, 2015 3500 MHz OK	Probe SN.	Liquid name	Validation date	Frequency point	Status (OK or Not)
3617 Head 900MHz Sep. 6, 2015 900 MHz OK 3617 Head 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Head 1640MHz Sep. 7, 2015 1450 MHz OK 3617 Head 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Head 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1900MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1900MHz Sep. 8, 2015 2000 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2450MHz Sep. 11, 2015 2450 MHz OK 3617 Head 2500MHz Sep. 11, 2015 2500 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5500MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5500MHz Sep. 14, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 1750MHz Sep. 5, 2015 850 MHz OK 3617 Body 1750MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1750MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1810 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2000MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2000MHz			• '		
3617 Head 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Head 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Head 1750MHz Sep. 8, 2015 1750 MHz OK 3617 Head 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1800MHz Sep. 8, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 8, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2100MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2500MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5200 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5600MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Body 750MHz Sep. 14, 2015 5800 MHz OK 3617 Body 850MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 750 MHz OK 3617 Body 1450MHz Sep. 5, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1750 MHz OK 3617 Body 1450MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1450MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1450MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1450MHz Sep. 8, 2015 1810 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 10, 2015 2300 MHz OK 3617 Body 24000MHz Sep. 10, 2015 2300 MHz OK 3617 Body 24000MHz Sep. 10, 2015 2300 MHz OK 3617 Body 24			•		
3617 Head 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Head 1750MHz Sep. 8, 2015 1750 MHz OK 3617 Head 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 8, 2015 2000 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2450MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5000MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5000MHz Sep. 13, 2015 5200 MHz OK 3617 Head 5000MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5000MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5000MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5000MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5000MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5000MHz Sep. 14, 2015 5600 MHz OK 3617 Body 750MHz Sep. 14, 2015 5800 MHz OK 3617 Body 850MHz Sep. 5, 2015 750 MHz OK 3617 Body 900MHz Sep. 5, 2015 900 MHz OK 3617 Body 1450MHz Sep. 5, 2015 900 MHz OK 3617 Body 1450MHz Sep. 5, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1810 MHz OK 3617 Body 2000MHz Sep. 8, 2015 1810 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2450MHz Sep. 9, 2015 2200 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2300 MHz OK			• .		
3617 Head 1750MHz Sep. 7, 2015 1750 MHz OK			•		
3617 Head 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Head 1900MHz Sep. 9, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 11, 2015 3500 MHz OK 3617 Head 5200MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5300MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1450MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1450MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1450 MHz OK 3617 Body 1450MHz Sep. 8, 2015 1450 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1450 MHz OK 3617 Body 1200MHz Sep. 8, 2015 1450 MHz OK 3617 Body 1200MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 24000MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2450MHz Sep. 11, 2015 2600 MHz OK 3617 Body 25000MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3600 MHz OK 3617 Body 35			•		
3617 Head 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 3500MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5600MHz Sep. 13, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5600 MHz OK 3617 Bedy 580MHz Sep. 5, 2015 750 MHz	3617	Head 1750MHz	Sep. 7, 2015	1750 MHz	
3617 Head 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Head 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3500MHz Sep. 12, 2015 3700 MHz OK 3617 Head 3700MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5300 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5500MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 5, 2015 750 MHz	3617	Head 1810MHz	Sep. 8, 2015	1810 MHz	OK
3617 Head 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 5, 2015 750 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz	3617	Head 1900MHz	Sep. 8, 2015	1900 MHz	OK
3617 Head 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 5, 2015 750 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 6, 2015 850 MHz <t< td=""><td>3617</td><td>Head 2000MHz</td><td>Sep. 9, 2015</td><td>2000 MHz</td><td>OK</td></t<>	3617	Head 2000MHz	Sep. 9, 2015	2000 MHz	OK
3617 Head 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 9400MHz Sep. 6, 2015 1450 MHz	3617	Head 2100MHz	Sep. 9, 2015	2100 MHz	OK
3617 Head 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 7, 2015 1640 MHz	3617	Head 2300MHz	Sep. 10, 2015	2300 MHz	OK
3617 Head 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Bedy 580MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK <td>3617</td> <td>Head 2450MHz</td> <td>Sep. 10, 2015</td> <td>2450 MHz</td> <td>OK</td>	3617	Head 2450MHz	Sep. 10, 2015	2450 MHz	OK
3617 Head 3700MHz Sep. 12, 2015 3700 MHz OK 3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Head 5800MHz Sep. 5, 2015 750 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 350 MHz OK 3617 Body 900MHz Sep. 6, 2015 390 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 8, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1900 MHz OK <td>3617</td> <td>Head 2600MHz</td> <td>Sep. 11, 2015</td> <td>2600 MHz</td> <td>OK</td>	3617	Head 2600MHz	Sep. 11, 2015	2600 MHz	OK
3617 Head 5200MHz Sep. 12, 2015 5200 MHz OK 3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 360 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK	3617	Head 3500MHz	Sep. 11, 2015	3500 MHz	OK
3617 Head 5300MHz Sep. 13, 2015 5300 MHz OK 3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK	3617	Head 3700MHz	Sep. 12, 2015	3700 MHz	OK
3617 Head 5500MHz Sep. 13, 2015 5500 MHz OK 3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1640 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK <td>3617</td> <td>Head 5200MHz</td> <td>Sep. 12, 2015</td> <td>5200 MHz</td> <td>OK</td>	3617	Head 5200MHz	Sep. 12, 2015	5200 MHz	OK
3617 Head 5600MHz Sep. 14, 2015 5600 MHz OK 3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2300 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK <td>3617</td> <td>Head 5300MHz</td> <td>Sep. 13, 2015</td> <td>5300 MHz</td> <td>OK</td>	3617	Head 5300MHz	Sep. 13, 2015	5300 MHz	OK
3617 Head 5800MHz Sep. 14, 2015 5800 MHz OK 3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK <td>3617</td> <td>Head 5500MHz</td> <td>Sep. 13, 2015</td> <td>5500 MHz</td> <td>OK</td>	3617	Head 5500MHz	Sep. 13, 2015	5500 MHz	OK
3617 Body 750MHz Sep. 5, 2015 750 MHz OK 3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK <td>3617</td> <td>Head 5600MHz</td> <td>Sep. 14, 2015</td> <td>5600 MHz</td> <td>OK</td>	3617	Head 5600MHz	Sep. 14, 2015	5600 MHz	OK
3617 Body 850MHz Sep. 5, 2015 850 MHz OK 3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK<	3617	Head 5800MHz	Sep. 14, 2015	5800 MHz	OK
3617 Body 900MHz Sep. 6, 2015 900 MHz OK 3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 750MHz	Sep. 5, 2015	750 MHz	OK
3617 Body 1450MHz Sep. 6, 2015 1450 MHz OK 3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 850MHz	Sep. 5, 2015	850 MHz	OK
3617 Body 1640MHz Sep. 7, 2015 1640 MHz OK 3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 900MHz	Sep. 6, 2015	900 MHz	OK
3617 Body 1750MHz Sep. 7, 2015 1750 MHz OK 3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 1450MHz	Sep. 6, 2015	1450 MHz	OK
3617 Body 1810MHz Sep. 8, 2015 1810 MHz OK 3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 1640MHz	Sep. 7, 2015	1640 MHz	OK
3617 Body 1900MHz Sep. 8, 2015 1900 MHz OK 3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 1750MHz	Sep. 7, 2015	1750 MHz	OK
3617 Body 2000MHz Sep. 9, 2015 2000 MHz OK 3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 1810MHz	Sep. 8, 2015	1810 MHz	OK
3617 Body 2100MHz Sep. 9, 2015 2100 MHz OK 3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 1900MHz	Sep. 8, 2015	1900 MHz	OK
3617 Body 2300MHz Sep. 10, 2015 2300 MHz OK 3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 2000MHz	Sep. 9, 2015	2000 MHz	OK
3617 Body 2450MHz Sep. 10, 2015 2450 MHz OK 3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 2100MHz	Sep. 9, 2015	2100 MHz	OK
3617 Body 2600MHz Sep. 11, 2015 2600 MHz OK 3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 2300MHz	Sep. 10, 2015	2300 MHz	OK
3617 Body 3500MHz Sep. 11, 2015 3500 MHz OK 3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 2450MHz	Sep. 10, 2015	2450 MHz	OK
3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 2600MHz	Sep. 11, 2015	2600 MHz	OK
3617 Body 3700MHz Sep. 12, 2015 3700 MHz OK	3617	Body 3500MHz	Sep. 11, 2015	3500 MHz	OK
	3617	Body 3700MHz	Sep. 12, 2015		OK
	3617	Body 5200MHz	•	5200 MHz	OK



ANNEX G Probe Calibration Certificate

Probe 3617 Calibration Certificate

Calibration Laboratory of Schmid & Partner Engineering AG Zeughausstrasse 43, 8004 Zurich, Switzerland





Schweizerischer Kalibrierdienst Service suisse d'étalonnage C Servizio svizzero di taratura Swiss Calibration Service

Accreditation No.: SCS 0108

Accredited by the Swiss Accreditation Service (SAS) The Swiss Accreditation Service is one of the signatories to the EA Multilateral Agreement for the recognition of calibration certificates

Client

CTTL (Auden)

Certificate No: EX3-3617_Aug15

CALIBRATION CERTIFICATE Object EX3DV4 - SN:3617 Calibration procedure(s) QA CAL-01.v9, QA CAL-14.v4, QA CAL-23.v5, QA CAL-25.v6 Calibration procedure for dosimetric E-field probes Calibration date: August 26, 2015 This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI). The measurements and the uncertainties with confidence probability are given on the following pages and are part of the certificate. All calibrations have been conducted in the closed laboratory facility: environment temperature (22 ± 3)°C and humidity < 70%. Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID	Cal Date (Certificate No.)	Scheduled Calibration
Power meter E4419B	GB41293874	01-Apr-15 (No. 217-02128)	Mar-16
Power sensor E4412A	MY41498087	01-Apr-15 (No. 217-02128)	Mar-16
Reference 3 dB Attenuator	SN: S5054 (3c)	01-Apr-15 (No. 217-02129)	Mar-16
Reference 20 dB Attenuator	SN: S5277 (20x)	01-Apr-15 (No. 217-02132)	Mar-16
Reference 30 dB Attenuator	SN: S5129 (30b)	01-Apr-15 (No. 217-02133)	Mar-16
Reference Probe ES3DV2	SN: 3013	30-Dec-14 (No. ES3-3013_Dec14)	Dec-15
DAE4	SN: 660	14-Jan-15 (No. DAE4-660_Jan15)	Jan-16
Secondary Standards	ID	Check Date (in house)	Scheduled Check
RF generator HP 8648C	US3642U01700	4-Aug-99 (in house check Apr-13)	In house check: Apr-16
Network Analyzer HP 8753E	US37390585	18-Oct-01 (in house check Oct-14)	In house check: Oct-15

	Name	Function	Signature
Calibrated by:	Claudio Leubler	Laboratory Technician	QD.
Approved by:	Katja Pokovic	Technical Manager	ASUL.
			Issued: August 27, 2015

Page 1 of 11



Calibration Laboratory of Schmid & Partner Engineering AG Zeughausstrasse 43, 8004 Zurich, Switzerland





S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
Servizio svizzero di taratura
Swiss Calibration Service

Accreditation No.: SCS 0108

Accredited by the Swiss Accreditation Service (SAS)

The Swiss Accreditation Service is one of the signatories to the EA Multilateral Agreement for the recognition of calibration certificates

Glossary:

TSL tissue simulating liquid
NORMx,y,z sensitivity in free space
ConvF sensitivity in TSL / NORMx,y,z
DCP diode compression point

CF crest factor (1/duty_cycle) of the RF signal modulation dependent linearization parameters

Polarization φ rotation around probe axis

Polarization 9 9 rotation around an axis that is in the plane normal to probe axis (at measurement center),

i.e., 9 = 0 is normal to probe axis

Connector Angle information used in DASY system to align probe sensor X to the robot coordinate system

Calibration is Performed According to the Following Standards:

- IEEE Std 1528-2013, "IEEE Recommended Practice for Determining the Peak Spatial-Averaged Specific Absorption Rate (SAR) in the Human Head from Wireless Communications Devices: Measurement Techniques", June 2013
- IEC 62209-1, "Procedure to measure the Specific Absorption Rate (SAR) for hand-held devices used in close proximity to the ear (frequency range of 300 MHz to 3 GHz)", February 2005
- IEC 62209-2, "Procedure to determine the Specific Absorption Rate (SAR) for wireless communication devices used in close proximity to the human body (frequency range of 30 MHz to 6 GHz)", March 2010
- d) KDB 865664, "SAR Measurement Requirements for 100 MHz to 6 GHz"

Methods Applied and Interpretation of Parameters:

- NORMx,y,z: Assessed for E-field polarization 9 = 0 (f ≤ 900 MHz in TEM-cell; f > 1800 MHz: R22 waveguide).
 NORMx,y,z are only intermediate values, i.e., the uncertainties of NORMx,y,z does not affect the E²-field uncertainty inside TSL (see below ConvF).
- NORM(f)x,y,z = NORMx,y,z * frequency_response (see Frequency Response Chart). This linearization is
 implemented in DASY4 software versions later than 4.2. The uncertainty of the frequency response is included
 in the stated uncertainty of ConvF.
- DCPx,y,z: DCP are numerical linearization parameters assessed based on the data of power sweep with CW signal (no uncertainty required). DCP does not depend on frequency nor media.
- PAR: PAR is the Peak to Average Ratio that is not calibrated but determined based on the signal characteristics
- Ax,y,z; Bx,y,z; Cx,y,z; Dx,y,z; VRx,y,z: A, B, C, D are numerical linearization parameters assessed based on the data of power sweep for specific modulation signal. The parameters do not depend on frequency nor media. VR is the maximum calibration range expressed in RMS voltage across the diode.
- ConvF and Boundary Effect Parameters: Assessed in flat phantom using E-field (or Temperature Transfer Standard for f ≤ 800 MHz) and inside waveguide using analytical field distributions based on power measurements for f > 800 MHz. The same setups are used for assessment of the parameters applied for boundary compensation (alpha, depth) of which typical uncertainty values are given. These parameters are used in DASY4 software to improve probe accuracy close to the boundary. The sensitivity in TSL corresponds to NORMx,y,z * ConvF whereby the uncertainty corresponds to that given for ConvF. A frequency dependent ConvF is used in DASY version 4.4 and higher which allows extending the validity from ± 50 MHz to ± 100 MHz.
- Spherical isotropy (3D deviation from isotropy): in a field of low gradients realized using a flat phantom exposed by a patch antenna.
- Sensor Offset: The sensor offset corresponds to the offset of virtual measurement center from the probe tip (on probe axis). No tolerance required.
- Connector Angle: The angle is assessed using the information gained by determining the NORMx (no uncertainty required).

Certificate No: EX3-3617_Aug15 Page 2 of 11



August 26, 2015

Probe EX3DV4

SN:3617

Manufactured: Calibrated:

May 3, 2007 August 26, 2015

Calibrated for DASY/EASY Systems (Note: non-compatible with DASY2 system!)

Certificate No: EX3-3617_Aug15 Page 3 of 11



August 26, 2015

DASY/EASY - Parameters of Probe: EX3DV4 - SN:3617

Basic Calibration Parameters

	Sensor X	Sensor Y	Sensor Z	Unc (k=2)
Norm $(\mu V/(V/m)^2)^A$	0.35	0.22	0.32	± 10.1 %
DCP (mV) ^B	103.7	99.6	98.7	

Modulation Calibration Parameters

UID	Communication System Name		A dB	B dB√μV	С	D dB	VR mV	Unc ^E (k≃2)
0	CW	X	0.0	0.0	1.0	0.00	181.1	±2.5 %
		Y	0.0	0.0	1.0		172.2	11.0
		Z	0.0	0.0	1.0		179.1	

The reported uncertainty of measurement is stated as the standard uncertainty of measurement multiplied by the coverage factor k=2, which for a normal distribution corresponds to a coverage probability of approximately 95%.

A The uncertainties of Nom X,Y,Z do not affect the E²-field uncertainty inside TSL (see Pages 5 and 6).

Numerical linearization parameter: uncertainty not required.

Uncertainty is determined using the max. deviation from linear response applying rectangular distribution and is expressed for the square of the field value.



August 26, 2015

DASY/EASY - Parameters of Probe: EX3DV4 - SN:3617

Calibration Parameter Determined in Head Tissue Simulating Media

f (MHz) ^C	Relative Permittivity ^F	Conductivity (S/m) F	ConvF X	ConvF Y	ConvF Z	Alpha ^G	Depth ^G (mm)	Unc (k=2)
750	41.9	0.89	9.98	9.98	9.98	0.41	0.88	± 12.0 %
835	41.5	0.90	9.56	9.56	9.56	0.50	0.80	± 12.0 %
900	41.5	0.97	9.41	9.41	9.41	0.45	0.85	± 12.0 %
1450	40.5	1.20	8.76	8.76	8.76	0.27	1.02	± 12.0 %
1640	40.3	1.29	8.62	8.62	8.62	0.30	0.80	± 12.0 %
1750	40.1	1.37	8.34	8.34	8.34	0.26	0.94	± 12.0 %
1810	40.0	1.40	8.13	8.13	8.13	0.28	0.89	± 12.0 %
1900	40.0	1.40	8.07	8.07	8.07	0.34	0.80	± 12.0 %
2000	40.0	1.40	8.04	8.04	8.04	0.32	0.89	± 12.0 %
2100	39.8	1.49	8.11	8.11	8.11	0.31	0.89	± 12.0 %
2300	39.5	1.67	7.74	7.74	7.74	0.27	0.97	± 12.0 %
2450	39.2	1.80	7.24	7.24	7.24	0.28	0.96	± 12.0 %
2600	39.0	1.96	7.21	7.21	7.21	0.43	0.80	± 12.0 %
3500	37.9	2.91	7.28	7.28	7.28	0.30	1.20	± 13.1 %
3700	37.7	3.12	6.79	6.79	6.79	0.28	1.20	± 13.1 %
5200	36.0	4.66	5.46	5.46	5.46	0.35	1.80	± 13.1 %
5300	35.9	4.76	5.28	5.28	5.28	0.35	1.80	± 13.1 %
5500	35.6	4.96	5.05	5.05	5.05	0.35	1.80	± 13.1 %
5600	35.5	5.07	4.75	4.75	4.75	0.40	1.80	± 13.1 %
5800	35.3	5.27	4.85	4.85	4.85	0.40	1.80	± 13.1 %

^c Frequency validity above 300 MHz of ± 100 MHz only applies for DASY v4.4 and higher (see Page 2), else it is restricted to ± 50 MHz. The uncertainty is the RSS of the ConvF uncertainty at calibration frequency and the uncertainty for the indicated frequency band. Frequency validity below 300 MHz is ± 10, 25, 40, 50 and 70 MHz for ConvF assessments at 30, 64, 128, 150 and 220 MHz respectively. Above 5 GHz frequency validity can be extended to ± 110 MHz.

Fat frequencies below 3 GHz, the validity of tissue parameters (ɛ and ơ) can be relaxed to ± 10% if liquid compensation formula is applied to measured SAR values. At frequencies above 3 GHz, the validity of tissue parameters (ɛ and ơ) is restricted to ± 5%. The uncertainty is the RSS of the ConvF uncertainty for indicated target tissue parameters.

Alpha/Depth are determined during calibration. SPEAG warrants that the remaining deviation due to the boundary effect after compensation is always less than ± 1% for frequencies below 3 GHz and below ± 2% for frequencies between 3-6 GHz at any distance larger than half the probe tip diameter from the boundary.



August 26, 2015

DASY/EASY - Parameters of Probe: EX3DV4 - SN:3617

Calibration Parameter Determined in Body Tissue Simulating Media

f (MHz) ^C	Relative Permittivity ^F	Conductivity (S/m) F	ConvF X	ConvF Y	ConvF Z	Alpha ^G	Depth ^G (mm)	Unc (k=2)
750	55.5	0.96	9.76	9.76	9.76	0.58	0.79	± 12.0 %
835	55.2	0.97	9.71	9.71	9.71	0.50	0.80	± 12.0 %
900	55.0	1.05	9.47	9.47	9.47	0.50	0.80	± 12.0 9
1450	54.0	1.30	8.27	8.27	8.27	0.21	1.33	± 12.0 9
1640	53.8	1.40	8.31	8.31	8.31	0.39	0.91	± 12.0 9
1750	53.4	1.49	7.96	7.96	7.96	0.43	0.80	± 12.0 9
1810	53.3	1.52	7.88	7.88	7.88	0.44	0.80	± 12.0 9
1900	53.3	1.52	7.74	7.74	7.74	0.37	0.83	± 12.0 9
2000	53.3	1.52	7.97	7.97	7.97	0.24	1.05	± 12.0 9
2100	53.2	1.62	8.08	8.08	8.08	0.27	1.00	± 12.0 °
2300	52.9	1.81	7.68	7.68	7.68	0.32	0.94	± 12.0
2450	52.7	1.95	7.35	7.35	7.35	0.32	0.80	± 12.0 9
2600	52.5	2.16	7.20	7.20	7.20	0.25	0.80	± 12.0 °
3500	51.3	3.31	6.60	6.60	6.60	0.30	1.20	± 13.1 9
3700	51.0	3.55	6.72	6.72	6.72	0.32	1.25	± 13.1 °
5200	49.0	5.30	4.88	4.88	4.88	0.40	1.90	± 13.1 9
5300	48.9	5.42	4.69	4.69	4.69	0.40	1.90	± 13.1 9
5500	48.6_	5.65	4.41	4.41	4.41	0.40	1.90	± 13.1 9
5600	48.5	5.77	4.27	4.27	4.27	0.45	1.90	± 13.1 9
5800	48.2	6.00	4.41	4.41	4.41	0.45	1.90	± 13.1 9

^C Frequency validity above 300 MHz of ± 100 MHz only applies for DASY v4.4 and higher (see Page 2), else it is restricted to ± 50 MHz. The uncertainty is the RSS of the ConvF uncertainty at calibration frequency and the uncertainty for the indicated frequency band. Frequency validity below 300 MHz is ± 10, 25, 40, 50 and 70 MHz for ConvF assessments at 30, 64, 128, 150 and 220 MHz respectively. Above 5 GHz frequency validity can be extended to ± 110 MHz.


F At frequencies below 3 GHz, the validity of tissue parameters (and of) can be relaxed to ± 10% if liquid compensation formula is applied to measured SAR values. At frequencies above 3 GHz, the validity of tissue parameters (and of) is restricted to ± 5%. The uncertainty is the RSS of the ConvF uncertainty for indicated target tissue parameters.

Alpha/Depth are determined during calibration. SPEAG warrants that the remaining deviation due to the boundary effect after compensation is always less than ± 1% for frequencies below 3 GHz and below ± 2% for frequencies between 3-6 GHz at any distance larger than half the probe tip diameter from the boundary.



August 26, 2015

Frequency Response of E-Field (TEM-Cell:ifi110 EXX, Waveguide: R22)

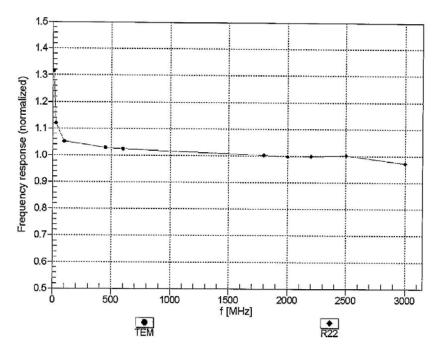



Uncertainty of Frequency Response of E-field: ± 6.3% (k=2)



August 26, 2015

Receiving Pattern (ϕ), $\vartheta = 0^{\circ}$

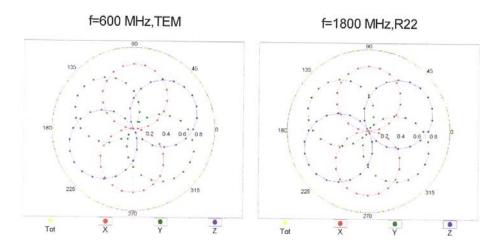


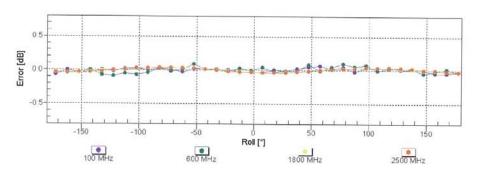


Uncertainty of Axial Isotropy Assessment: ± 0.5% (k=2)



August 26, 2015

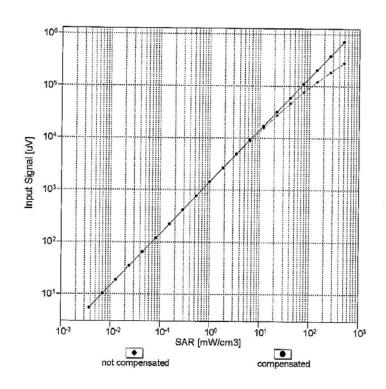

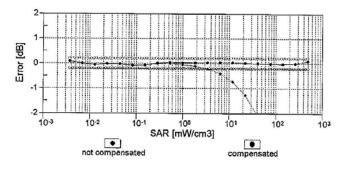


Uncertainty of Linearity Assessment: ± 0.6% (k=2)




EX3DV4- SN:3617 August 26, 2015

Conversion Factor Assessment

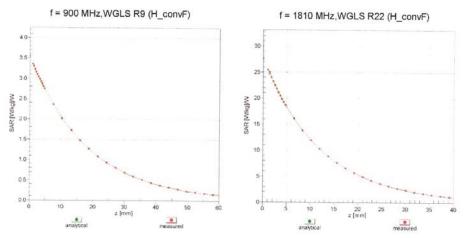

Deviation from Isotropy in Liquid Error (φ, θ), f = 900 MHz

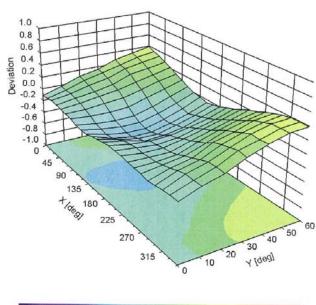

-1.0 -0.8 -0.6 -0.4 -0.2 0.0 0.2 0.4 0.6 0.8 1.
Uncertainty of Spherical Isotropy Assessment: ± 2.6% (k=2)

Certificate No: EX3-3617_Aug15 Page 10 of 11



August 26, 2015

DASY/EASY - Parameters of Probe: EX3DV4 - SN:3617

Other Probe Parameters

Sensor Arrangement	Triangular
Connector Angle (°)	67.5
Mechanical Surface Detection Mode	enabled
Optical Surface Detection Mode	disabled
Probe Overall Length	337 mm
Probe Body Diameter	10 mm
Tip Length	9 mm
Tip Diameter	2.5 mm
Probe Tip to Sensor X Calibration Point	1 mm
Probe Tip to Sensor Y Calibration Point	1 mm
Probe Tip to Sensor Z Calibration Point	1 mm
Recommended Measurement Distance from Surface	1.4 mm



Dipole Calibration Certificate ANNEX H

835 MHz Dipole Calibration Certificate

Calibration Laboratory of Schmid & Partner Engineering AG Zeughausstrasse 43, 8004 Zurich, Switzerland





C

Schweizerischer Kalibrierdienst Service suisse d'étalonnage Servizio svizzero di taratura **Swiss Calibration Service**

Accreditation No.: SCS 0108

Accredited by the Swiss Accreditation Service (SAS) The Swiss Accreditation Service is one of the signatories to the EA Multilateral Agreement for the recognition of calibration certificates

CALIBRATION C	ERTIFICATE		: D835V2-4d069_Jul15
Object	D835V2 - SN: 4d	069	
Calibration procedure(s)	QA CAL-05.v9 Calibration proce	dure for dipole validation kits abo	ove 700 MHz
Calibration date:	July 23, 2015		
The measurements and the unce	ertainties with confidence proceed in the closed laborator	onal standards, which realize the physical un robability are given on the following pages an γ facility: environment temperature (22 \pm 3)°C	d are part of the certificate.
Primary Standards	ID #	Cal Date (Certificate No.)	Scheduled Calibration
Power meter EPM-442A	GB37480704	07-Oct-14 (No. 217-02020)	Oct-15
Power sensor HP 8481A	US37292783	07-Oct-14 (No. 217-02020)	Oct-15
Power sensor HP 8481A	MY41092317	07-Oct-14 (No. 217-02021)	Oct-15
	(001)		
Reference 20 dB Attenuator	SN: 5058 (20k)	01-Apr-15 (No. 217-02131)	Mar-16
	SN: 5058 (20k) SN: 5047.2 / 06327	01-Apr-15 (No. 217-02131) 01-Apr-15 (No. 217-02134)	Mar-16 Mar-16
Type-N mismatch combination	The second secon		
Type-N mismatch combination Reference Probe ES3DV3	SN: 5047.2 / 06327	01-Apr-15 (No. 217-02134)	Mar-16
Type-N mismatch combination Reference Probe ES3DV3 DAE4	SN: 5047.2 / 06327 SN: 3205	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14)	Mar-16 Dec-15
Type-N mismatch combination Reference Probe ES3DV3 DAE4 Secondary Standards	SN: 5047.2 / 06327 SN: 3205 SN: 601	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14) 18-Aug-14 (No. DAE4-601_Aug14)	Mar-16 Dec-15 Aug-15
Reference 20 dB Attenuator Type-N mismatch combination Reference Probe ES3DV3 DAE4 Secondary Standards RF generator R&S SMT-06 Network Analyzer HP 8753E	SN: 5047.2 / 06327 SN: 3205 SN: 601	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14) 18-Aug-14 (No. DAE4-601_Aug14) Check Date (in house)	Mar-16 Dec-15 Aug-15 Scheduled Check
Type-N mismatch combination Reference Probe ES3DV3 DAE4 Secondary Standards RF generator R&S SMT-06	SN: 5047.2 / 06327 SN: 3205 SN: 601	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14) 18-Aug-14 (No. DAE4-601_Aug14) Check Date (in house) 04-Aug-99 (in house check Oct-13)	Mar-16 Dec-15 Aug-15 Scheduled Check In house check: Oct-16
Type-N mismatch combination Reference Probe ES3DV3 DAE4 Secondary Standards RF generator R&S SMT-06	SN: 5047.2 / 06327 SN: 3205 SN: 601 ID # 100005 US37390585 S4206	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14) 18-Aug-14 (No. DAE4-601_Aug14) Check Date (in house) 04-Aug-99 (in house check Oct-13) 18-Oct-01 (in house check Oct-14)	Mar-16 Dec-15 Aug-15 Scheduled Check In house check: Oct-16 In house check: Oct-15
Type-N mismatch combination Reference Probe ES3DV3 DAE4 Secondary Standards RF generator R&S SMT-06 Network Analyzer HP 8753E	SN: 5047.2 / 06327 SN: 3205 SN: 601 ID # 100005 US37390585 S4206	01-Apr-15 (No. 217-02134) 30-Dec-14 (No. ES3-3205_Dec14) 18-Aug-14 (No. DAE4-601_Aug14) Check Date (in house) 04-Aug-99 (in house check Oct-13) 18-Oct-01 (in house check Oct-14)	Mar-16 Dec-15 Aug-15 Scheduled Check In house check: Oct-16 In house check: Oct-15

Certificate No: D835V2-4d069_Jul15

Page 1 of 8