FCC RF Test Report

APPLICANT : TCL Communication Ltd.

EQUIPMENT: Tablet PC

BRAND NAME : alcatel MODEL NAME : 9015B

MARKETING NAME : Alcatel POP™ 7 LTE

FCC ID : 2ACCJB066

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Jul. 05, 2016 and testing was completed on Aug. 01, 2016. We, SPORTON INTERNATIONAL (SHENZHEN) INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL (SHENZHEN) INC., the test report shall not be reproduced except in full.

Prepared by: Ken Chen / Manager

lon Cher

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL (SHENZHEN) INC.

1F & 2F, Building A, Morning Business Center, No. 4003 ShiGu Rd., Xili Town, Nanshan District, Shenzhen, Guangdong, P. R. China.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 1 of 69

Testing Laboratory 2353

Report No.: FR670507A

Report Issued Date : Aug. 16, 2016 Report Version : Rev. 01

TABLE OF CONTENTS

| RE | VISIO | N HISTORY | 3 |
|----|-------|---|----|
| SU | MMAF | RY OF TEST RESULT | 4 |
| 1 | GENI | ERAL DESCRIPTION | 5 |
| | 1.1 | Applicant | 5 |
| | 1.2 | Manufacturer | 5 |
| | 1.3 | Product Feature of Equipment Under Test | 5 |
| | 1.4 | Product Specification of Equipment Under Test | 6 |
| | 1.5 | Specification of Accessory | 6 |
| | 1.6 | Modification of EUT | 7 |
| | 1.7 | Testing Location | 7 |
| | 1.8 | Applicable Standards | 8 |
| 2. | TEST | CONFIGURATION OF EQUIPMENT UNDER TEST | 9 |
| | 2.1 | Descriptions of Test Mode | 9 |
| | 2.2 | Test Mode | _ |
| | 2.3 | Connection Diagram of Test System | 11 |
| | 2.4 | Support Unit used in test configuration and system | |
| | 2.5 | EUT Operation Test Setup | 12 |
| | 2.6 | Measurement Results Explanation Example | 12 |
| 3. | TEST | RESULT | 13 |
| | 3.1 | Number of Channel Measurement | 13 |
| | 3.2 | Hopping Channel Separation Measurement | |
| | 3.3 | Dwell Time Measurement | |
| | 3.4 | 20dB and 99% Bandwidth Measurement | |
| | 3.5 | Peak Output Power Measurement | |
| | 3.6 | Conducted Band Edges Measurement | |
| | 3.7 | Conducted Spurious Emission Measurement | |
| | 3.8 | Radiated Band Edges and Spurious Emission Measurement | |
| | 3.9 | AC Conducted Emission Measurement | |
| | 3.10 | Antenna Requirements | 67 |
| 4. | LIST | OF MEASURING EQUIPMENT | 68 |
| 5. | UNC | ERTAINTY OF EVALUATION | 69 |
| ΑP | PEND | IX A. RADIATED TEST RESULTS | |
| ΑP | PEND | IX B. SETUP PHOTOGRAPHS | |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 2 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

REVISION HISTORY

| REPORT NO. | VERSION | DESCRIPTION | ISSUED DATE |
|------------|---------|-------------------------|---------------|
| FR670507A | Rev. 01 | Initial issue of report | Aug. 16, 2016 |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 3 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

SUMMARY OF TEST RESULT

| Report Section | FCC Rule | IC Rule | Description | Limit | Result | Remark |
|-------------------|-----------------------|-------------------|--|-------------------------------|--------|---|
| 3.1 | 15.247(a)(1) | RSS-247 5.1(4) | Number of Channels | ≥ 15Chs | Pass | - |
| 3.2 | 15.247(a)(1) | RSS-247 5.1(2) | Hopping Channel Separation | ≥ 2/3 of 20dB BW | Pass | - |
| 3.3 | 15.247(a)(1) | RSS-247 5.1(4) | Dwell Time of Each Channel | ≤ 0.4sec in 31.6sec period | Pass | - |
| 3.4 | 15.247(a)(1) | RSS-247 5.1(1) | 20dB Bandwidth | NA | Pass | - |
| 3.4 | - | RSS-Gen 6.6 | 99% Bandwidth | - | Pass | - |
| 3.5 | 15.247(b)(1) | RSS-247 5.4(2) | Peak Output Power | ≤ 125 mW | Pass | - |
| 3.6 | 15.247(d) | RSS-247 5.5 | Conducted Band Edges | ≤ 20dBc | Pass | - |
| 3.7 | 15.247(d) | RSS-247 5.5 | Conducted Spurious Emission | ≤ 20dBc | Pass | - |
| 3.8 | 15.247(d) | RSS-247 5.5 | Radiated Band Edges and Radiated Spurious Emission | 15.209(a) & 15.247(d) | Pass | Under limit 5.96 dB at 42.610 MHz |
| 3.9 | 15.207 | RSS-Gen 8.8 | AC Conducted Emission | 15.207(a) | Pass | Under limit 11.77 dB at 0.160 MHz |
| 3.10 | 15.203 & 15.247(b) | N/A | Antenna Requirement | N/A | Pass | - |

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 4 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

1 General Description

1.1 Applicant

TCL Communication Ltd.

5F, C-Tower, No. 232, Liang Jing Road, ZhangJiang High-Tech Park, Pudong Area, Shanghai, 201203, P. R. China

1.2 Manufacturer

TCL Communication Ltd.

5F, C-Tower, No. 232, Liang Jing Road, ZhangJiang High-Tech Park, Pudong Area, Shanghai, 201203, P. R. China

1.3 Product Feature of Equipment Under Test

| Product Feature | | | | |
|---------------------------------|--|--|--|--|
| Equipment | Tablet PC | | | |
| Brand Name | alcatel | | | |
| Model Name | 9015B | | | |
| Marketing Name | Alcatel POP™ 7 LTE | | | |
| FCC ID | 2ACCJB066 | | | |
| | GPRS/EDGE/WCDMA/HSPA/DC-HSDPA/ | | | |
| | HSPA+(16QAM uplink is not supported)/LTE | | | |
| EUT supports Radios application | WLAN 2.4GHz 802.11b/g/n HT20 | | | |
| | WLAN 5GHz 802.11a/n HT20/HT40 | | | |
| | Bluetooth v3.0 + EDR/Bluetooth v4.1 LE | | | |
| | Conducted: 014732000100067 | | | |
| IMEI Code | Radiation: 014732000100026 | | | |
| | Conduction: 014732000100075 | | | |
| HW Version | Pixi4-7 4G TMO_MAIN_V03 | | | |
| SW Version | 5RA2 | | | |
| EUT Stage | Production Unit | | | |

Remark: The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 5 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

1.4 Product Specification of Equipment Under Test

| Standards-related Product Specification | | | | |
|---|--|--|--|--|
| Tx/Rx Frequency Range | 2402 MHz ~ 2480 MHz | | | |
| Number of Channels | 79 | | | |
| Carrier Frequency of Each Channel | 2402+n*1 MHz; n=0~78 | | | |
| Maximum Output Power to Antenna | Bluetooth BR(1Mbps) : 10.38 dBm (0.0109 W) Bluetooth EDR (2Mbps) : 10.37 dBm (0.0109 W) Bluetooth EDR (3Mbps) : 10.73 dBm (0.0118 W) | | | |
| 99% Occupied Bandwidth | Bluetooth BR(1Mbps) : 0.876MHz Bluetooth EDR (2Mbps) : 1.168MHz Bluetooth EDR (3Mbps) : 1.152MHz | | | |
| Antenna Type/Gain | PIFA Antenna with gain -3 dBi | | | |
| Type of Modulation | Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) : π /4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK | | | |

1.5 Specification of Accessory

| | Specification of Accessory | | | | | |
|------------|----------------------------|----------------------------|---|----------|--|--|
| | Brand Name | ALCATEL onetouch | Model Name | UC13US | | |
| AC Adapter | Power Rating | I/P: 100-240Vac, 400m | I/P: 100-240Vac, 400mA, O/P: 5.0Vdc, 2A | | | |
| | P/N | CBA0059AG0C2 | | | | |
| Battery | Brand Name | ALCATEL onetouch | Model Name | TLp032B2 | | |
| | Power Rating | 3.7Vdc, 3240mAh | , | | | |
| | Brand Name | N/A | Model Name | N/A | | |
| USB Cable | Signal Line Type | 0.8m shielded without core | | | | |
| | P/N | N/A | | | | |

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 6 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

1.6 Modification of EUT

No modifications are made to the EUT during all test items.

1.7 Testing Location

| Test Site | SPORTON INTERNATIONAL (SHENZHEN) INC. | | | |
|--------------------|--|------------|--|--|
| | 1F & 2F, Building A, Morning Business Center, No. 4003 ShiGu Rd., Xili | | | |
| Test Site Location | Town, Nanshan District, Shenzhen, Guangdong, P. R. China | | | |
| rest Site Location | TEL: +86-755-8637-9589 | | | |
| | FAX: +86-755-8637-9595 | | | |
| Took Cita No | Sportor | n Site No. | | |
| Test Site No. | TH01-SZ | CO01-SZ | | |

| Test Site | SPORTON INTERNATIONAL (SHENZHEN) INC. | | | |
|--------------------|--|--|--|--|
| Test Site Location | No. 3 Building, the third floor of south, Shahe River west, Fengzeyuan warehouse, Nanshan District, Shenzhen, Guangdong, P. R. China | | | |
| | TEL: +86-755- 3320-2398 | | | |
| Tool Cita No | Sporton Site No. FCC/IC Registration No. | | | |
| Test Site No. | 03CH03-SZ 565805/4086F | | | |

Note: The test site complies with ANSI C63.4 2014 requirement.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 7 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013
- IC RSS-247 Issue 1
- IC RSS-Gen Issue 4

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 8 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

2. Test Configuration of Equipment Under Test

2.1 Descriptions of Test Mode

Preliminary tests were performed in different data rates and recorded the RF output power in the following table:

| | | В | luetooth RF Output Pow | er |
|----------|-----------|-----------|------------------------|------------------------|
| Channel | Eroguepay | | Data Rate / Modulation | |
| Chamilei | Frequency | GFSK | π/4-DQPSK | 8-DPSK |
| | | 1Mbps | 2Mbps | 3Mbps |
| Ch00 | 2402MHz | 10.38 dBm | 10.37 dBm | 10.73 <mark>dBm</mark> |
| Ch39 | 2441MHz | 10.04 dBm | 10.04 dBm | 10.40 dBm |
| Ch78 | 2480MHz | 9.48 dBm | 9.56 dBm | 9.79 dBm |

Remark:

- 1. All the test data for each data rate were verified, but only the worst case was reported.
- 2. The data rate was set in 3Mbps for all the test items due to the highest RF output power.
- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction (150 kHz to 30 MHz), radiation (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). Pre-scanned tests, X, Y, Z in three orthogonal panels, and different data rates were conducted to determine the final configuration (Y plane as worst plane) from all possible combinations, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 9 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

2.2 **Test Mode**

The following summary table is showing all test modes to demonstrate in compliance with the standard.

| | Summary table of Test Cases | | | | | | |
|------------------------|-----------------------------|---|-----------------------|--|--|--|--|
| | Data Rate / Modulation | | | | | | |
| Test Item | Bluetooth BR 1Mbps | Bluetooth EDR 2Mbps | Bluetooth EDR 3Mbps | | | | |
| | GFSK | π /4-DQPSK | 8-DPSK | | | | |
| Conducted | Mode 1: CH00_2402 MHz | Mode 4: CH00_2402 MHz | Mode 7: CH00_2402 MHz | | | | |
| | Mode 2: CH39_2441 MHz | Mode 5: CH39_2441 MHz | Mode 8: CH39_2441 MHz | | | | |
| Test Cases | Mode 3: CH78_2480 MHz | Mode 6: CH78_2480 MHz | Mode 9: CH78_2480 MHz | | | | |
| | Bluetooth EDR 3Mbps 8-DPSK | | | | | | |
| | В | luetooth EDR 3Mbps 8-DPS | K | | | | |
| Radiated | В | Iuetooth EDR 3Mbps 8-DPS Mode 1: CH00_2402 MHz | K | | | | |
| Radiated Test Cases | В | | K | | | | |
| | В | Mode 1: CH00_2402 MHz | K | | | | |
| | | Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz | | | | | |
| Test Cases | | Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz luetooth Link + WLAN(2.4G) | | | | | |

Remark:

- 1. For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performance with Adapter, Battery, Earphone, and USB Cable.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066

: 10 of 69 Page Number Report Issued Date: Aug. 16, 2016 Report Version : Rev. 01


Report No.: FR670507A

2.3 Connection Diagram of Test System

<Bluetooth Tx Mode>

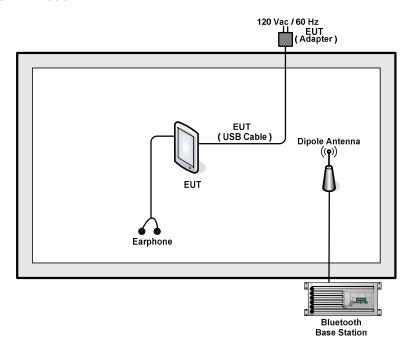

<AC Conducted Emission Mode>

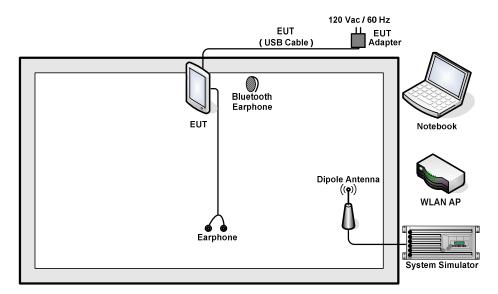

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 11 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

2.4 Support Unit used in test configuration and system

| Item | Equipment | Trade Name | Model Name | FCC ID | Data Cable | Power Cord |
|------|-----------------------|------------|------------|-------------|-----------------|--|
| 1. | System Simulator | Anritsu | MT8820C | N/A | N/A | Unshielded, 1.8 m |
| 2. | WLAN AP | Dlink | DIR-820L | KA2IR820LA1 | N/A | Unshielded, 1.8 m |
| 3. | SD Card | SanDisk | 4G Class 4 | FCC DoC | N/A | N/A |
| 4. | Bluetooth Earphone | Nokia | BH-108 | PYAHS-107W | N/A | N/A |
| 5. | iPod Earphone | Apple | MC690ZP/A | FCC DoC | Unshielded,1.6m | N/A |
| 6. | Notebook | Acer | ZG8 | HLZUNDP-1Q | N/A | AC I/P: Unshielded, 1.8 m DC O/P: Shielded, 1.8 m |

2.5 EUT Operation Test Setup

For Bluetooth test items, an engineering test program was provided and enabled to make EUT contact with Bluetooth base station for continuous transmitting and receiving signals.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 5 dB and 10dB attenuator.

 $Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$

= 5 + 10 = 15 (dB)

3. Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings: Span = the frequency band of operation;
 RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 13 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01


Report No.: FR670507A

3.1.5 Test Result of Number of Hopping Frequency


| Test Mode : | 3Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Number of Hopping (Channel) | Adaptive Frequency Hopping (Channel) | Limits (Channel) | Pass/Fail |
|--------------------------------|--------------------------------------|---------------------|-----------|
| 79 | 20 | > 15 | Pass |

Number of Hopping Channel Plot on Channel 00 - 78

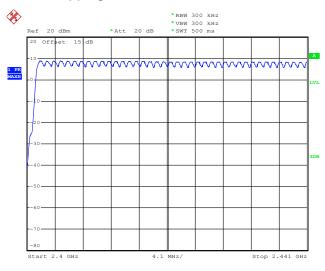

Date: 18.JUL.2016 18:40:56

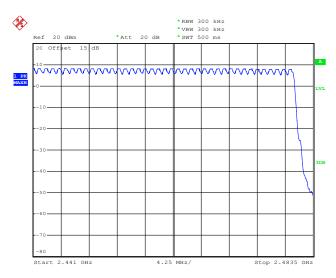

Date: 18.JUL.2016 18:50:25

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 14 of 69
Report Issued Date : Aug. 16, 2016

Report No.: FR670507A

Report Version : Rev. 01

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 - Span = wide enough to capture the peaks of two adjacent channels;
 - RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup




TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 15 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

3.2.5 Test Result of Hopping Channel Separation

| Test Mode : | 1Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | Frequency Separation (MHz) | (2/3 of 20dB BW) Limits (MHz) | Pass/Fail |
|---------|--------------------|----------------------------|----------------------------------|-----------|
| 00 | 2402 | 1.020 | 0.6053 | Pass |
| 39 | 2441 | 1.020 | 0.6053 | Pass |
| 78 | 2480 | 1.014 | 0.6053 | Pass |


Channel Separation Plot on Channel 00 - 01

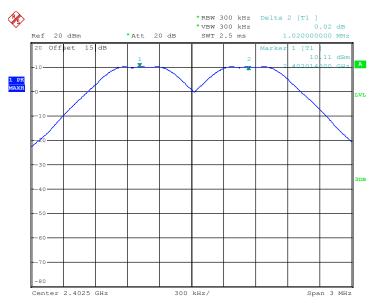

Date: 18.JUL.2016 16:14:46


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 16 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

Channel Separation Plot on Channel 39 - 40

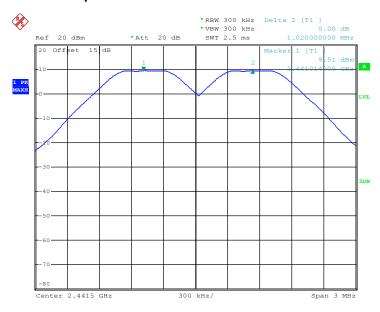

Date: 18.JUL.2016 16:15:44

Channel Separation Plot on Channel 77 - 78

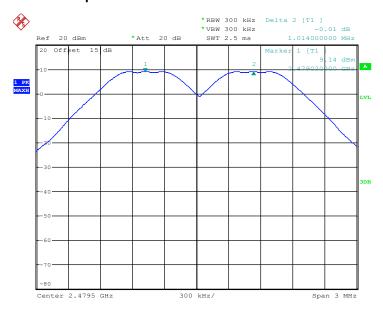

Date: 18.JUL.2016 16:16:40

SPORTON INTERNATIONAL (SHENZHEN) INC.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 17 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 2Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | Frequency Separation (MHz) | (2/3 of 20dB BW) Limits (MHz) | Pass/Fail |
|---------|--------------------|----------------------------|----------------------------------|-----------|
| 00 | 2402 | 1.008 | 0.8480 | Pass |
| 39 | 2441 | 1.008 | 0.8480 | Pass |
| 78 | 2480 | 1.002 | 0.8480 | Pass |

Channel Separation Plot on Channel 00 - 01

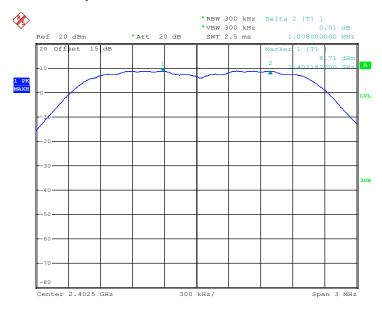


Date: 18.JUL.2016 17:59:14

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 18 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01


Report No.: FR670507A

Channel Separation Plot on Channel 39 - 40

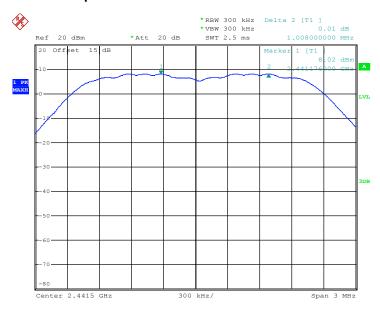

Date: 18.JUL.2016 16:20:09

Channel Separation Plot on Channel 77 - 78

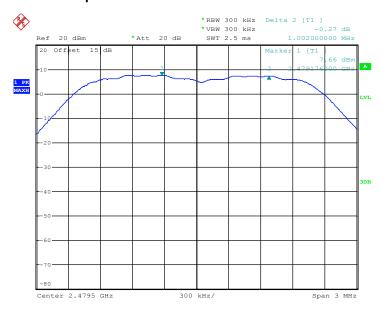

Date: 18.JUL.2016 16:21:04

SPORTON INTERNATIONAL (SHENZHEN) INC.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 19 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | Frequency Separation (MHz) | (2/3 of 20dB BW) Limits (MHz) | Pass/Fail |
|---------|--------------------|----------------------------|----------------------------------|-----------|
| 00 | 2402 | 1.002 | 0.8240 | Pass |
| 39 | 2441 | 1.302 | 0.8240 | Pass |
| 78 | 2480 | 1.002 | 0.8240 | Pass |

Channel Separation Plot on Channel 00 - 01

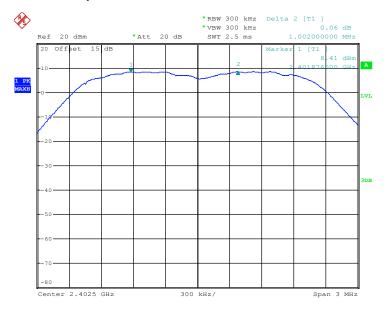


Date: 18.JUL.2016 16:21:57

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066

: 20 of 69 Page Number Report Issued Date: Aug. 16, 2016 Report Version : Rev. 01


Report No.: FR670507A

Channel Separation Plot on Channel 39 - 40

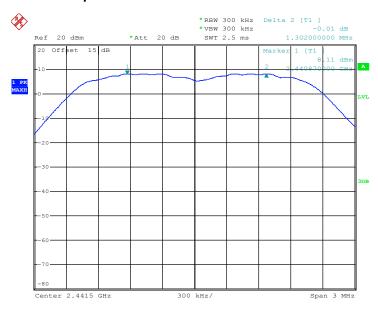

Date: 18.JUL.2016 18:10:58

Channel Separation Plot on Channel 77 - 78

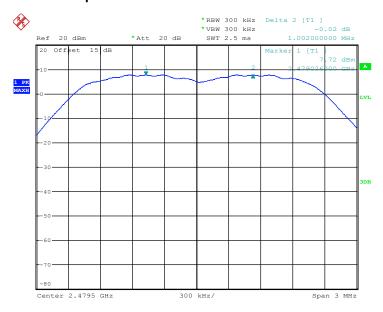

Date: 18.JUL.2016 18:12:45

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 21 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 22 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.3.5 Test Result of Dwell Time

| Test Mode : | 3DH5 | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Mode | Channel | Hops Over Occupancy Time(hops) | IIMA | Dwell Time (sec) | Limits (sec) | Pass/Fail |
|--------|---------|--------------------------------------|--------|---------------------|-----------------|-----------|
| Normal | 79 | 106.67 | 2.8855 | 0.31 | 0.4 | Pass |
| AFH | 20 | 53.33 | 2.8855 | 0.15 | 0.4 | Pass |


Remark:

- In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels.
 With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4 x 79) (s),
 Hops Over Occupancy Time comes to (1600 / 6 / 79) x (0.4 x 79) = 106.67 hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4×20) (s), Hops Over Occupancy Time comes to $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$ hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 23 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

Package Transfer Time Plot

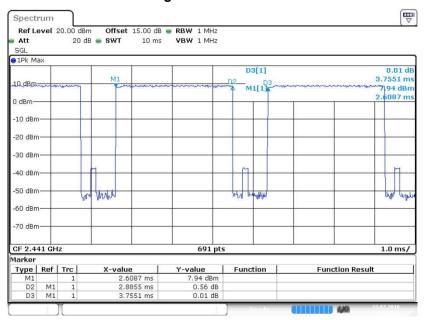

Date: 13.JUL.2016 14:55:22

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 24 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
 RBW ≥ 1% of the 20 dB bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;
 - Trace = max hold.
- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
 RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;
 Trace = max hold.
- 6. Measure and record the results in the test report.

3.4.4 Test Setup



SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 25 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01


Report No.: FR670507A

3.4.5 Test Result of 20dB Bandwidth

| Test Mode : | 1Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | 20dB Bandwidth (MHz) |
|---------|-----------------|----------------------|
| 00 | 2402 | 0.908 |
| 39 | 2441 | 0.908 |
| 78 | 2480 | 0.908 |


20 dB Bandwidth Plot on Channel 00

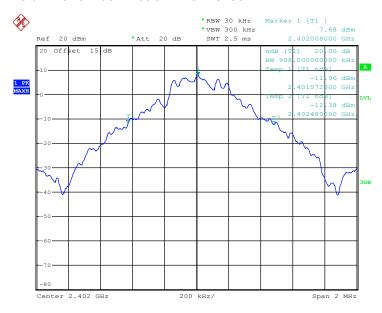

Date: 18.JUL.2016 17:54:13


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 26 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

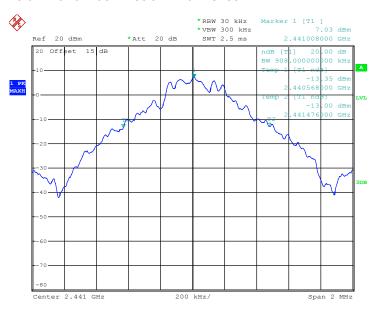

Date: 18.JUL.2016 16:27:44

20 dB Bandwidth Plot on Channel 78

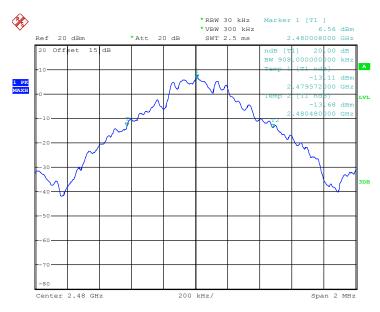

Date: 18.JUL.2016 16:28:01


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 27 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 2Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |


| Channel | Frequency (MHz) | 20dB Bandwidth (MHz) |
|---------|-----------------|----------------------|
| 00 | 2402 | 1.272 |
| 39 | 2441 | 1.272 |
| 78 | 2480 | 1.272 |

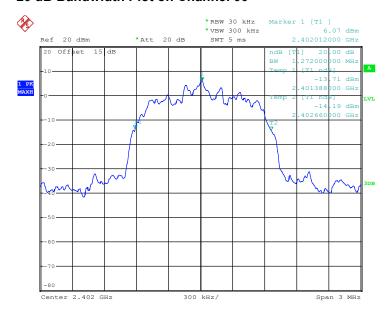

Date: 18.JUL.2016 16:29:24


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 28 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

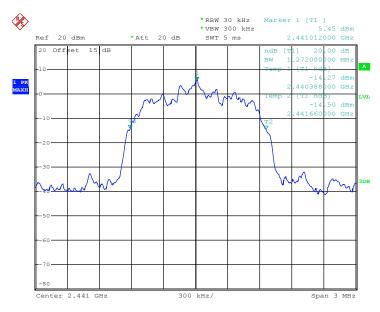

Date: 18.JUL.2016 16:29:56

20 dB Bandwidth Plot on Channel 78

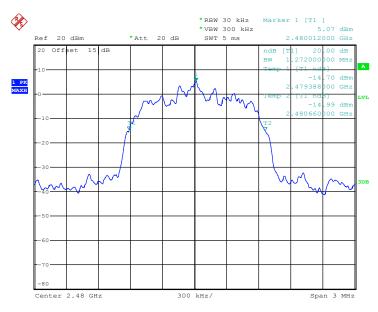

Date: 18.JUL.2016 16:31:47


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 29 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |


| Channel | Frequency (MHz) | 20dB Bandwidth (MHz) |
|---------|-----------------|----------------------|
| 00 | 2402 | 1.236 |
| 39 | 2441 | 1.236 |
| 78 | 2480 | 1.236 |

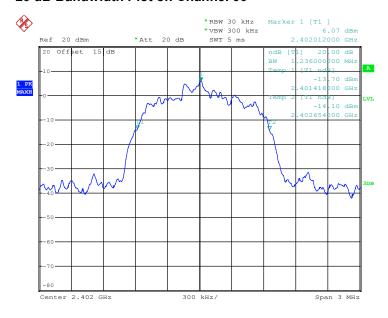

Date: 18.JUL.2016 16:32:33


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 30 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

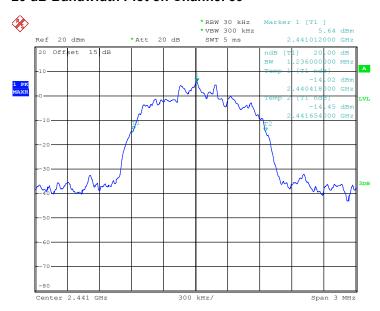

Date: 18.JUL.2016 18:02:55

20 dB Bandwidth Plot on Channel 78

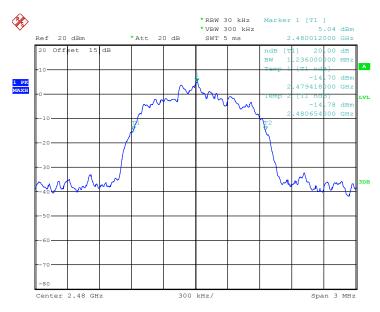

Date: 18.JUL.2016 16:33:49

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 31 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01


Report No.: FR670507A

3.4.6 Test Result of 99% Occupied Bandwidth

| Test Mode : | 1Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | 99% Occupied Bandwidth (MHz) |
|---------|-----------------|------------------------------|
| 00 | 2402 | 0.856 |
| 39 | 2441 | 0.876 |
| 78 | 2480 | 0.876 |


99% Occupied Bandwidth Plot on Channel 00

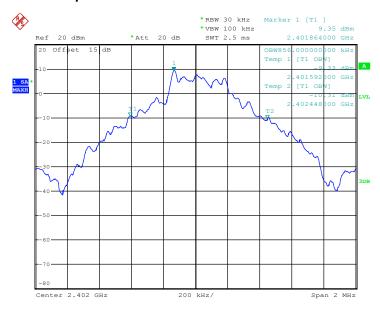

Date: 18.JUL.2016 16:34:28


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 32 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

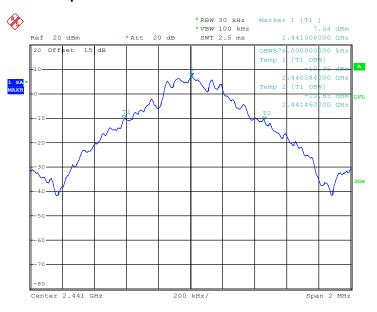

Date: 18.JUL.2016 16:35:04

99% Occupied Bandwidth Plot on Channel 78

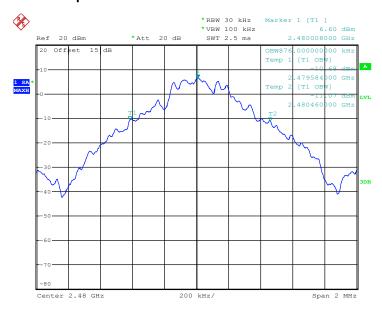

Date: 18.JUL.2016 16:35:40


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 33 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 2Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |


| Channel | Frequency (MHz) | 99% Occupied Bandwidth (MHz) |
|---------|-----------------|------------------------------|
| 00 | 2402 | 1.168 |
| 39 | 2441 | 1.168 |
| 78 | 2480 | 1.168 |

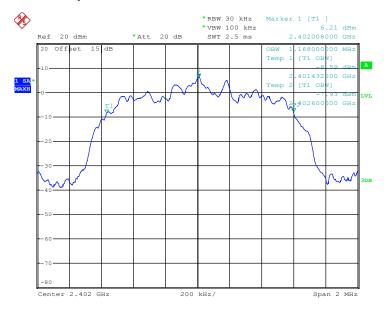

Date: 18.JUL.2016 16:36:17

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 34 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

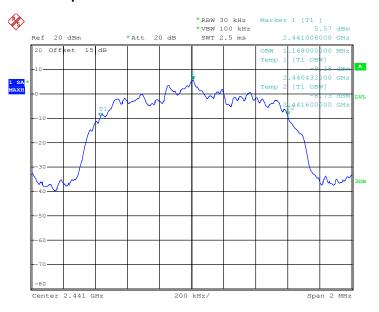

Date: 18.JUL.2016 16:36:53

99% Occupied Bandwidth Plot on Channel 78



Date: 18.JUL.2016 16:37:29

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 35 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| Channel | Frequency (MHz) | 99% Occupied Bandwidth (MHz) |
|---------|-----------------|------------------------------|
| 00 | 2402 | 1.148 |
| 39 | 2441 | 1.152 |
| 78 | 2480 | 1.152 |



Date: 18.JUL.2016 18:28:59


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 36 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

99% Occupied Bandwidth Plot on Channel 39



Date: 18.JUL.2016 16:38:42

99% Occupied Bandwidth Plot on Channel 78

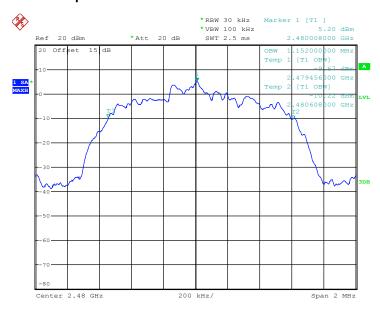

Date: 18.JUL.2016 16:39:18

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 37 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.

3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 38 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.5.5 Test Result of Peak Output Power

| Test Mode : | 1Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| | | R | F Power (dBm) | |
|---------|-----------|--------|---------------|-----------|
| Channel | Frequency | GFSK | Max. Limits | Dogg/Egil |
| | (MHz) | 1 Mbps | (dBm) | Pass/Fail |
| 00 | 2402 | 10.38 | 20.97 | Pass |
| 39 | 2441 | 10.04 | 20.97 | Pass |
| 78 | 2480 | 9.48 | 20.97 | Pass |

| Test Mode : | 2Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| | | RF Power (dBm) | | |
|---------|-------|----------------|-------------|-----------|
| Channel | | | Max. Limits | Pass/Fail |
| | (MHz) | 2 Mbps | (dBm) | Pass/Faii |
| 00 | 2402 | 10.37 | 20.97 | Pass |
| 39 | 2441 | 10.04 | 20.97 | Pass |
| 78 | 2480 | 9.56 | 20.97 | Pass |

| Test Mode : | 3Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

| | Evaguanav | R | F Power (dBm) | |
|---------|--------------------------------|--------|---------------|-----------|
| Channel | Channel Frequency 8-DPSK (MHz) | | Max. Limits | Pass/Fail |
| | (IVITIZ) | 3 Mbps | (dBm) | Pass/Faii |
| 00 | 2402 | 10.73 | 20.97 | Pass |
| 39 | 2441 | 10.40 | 20.97 | Pass |
| 78 | 2480 | 9.79 | 20.97 | Pass |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 39 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

Report No.: FR670507A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup




TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 40 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

Report No.: FR670507A

3.6.5 Test Result of Conducted Band Edges


| Test Mode : | 1Mbps | Temperature : | 24~26 ℃ |
|----------------|-----------|---------------------|----------------|
| Test Channel : | 00 and 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

Low Band Edge Plot on Channel 00

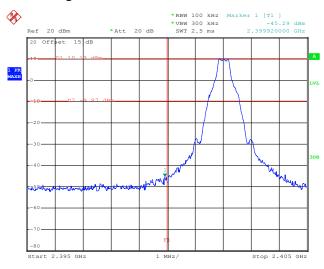

Date: 18.JUL.2016 16:40:01

High Band Edge Plot on Channel 78

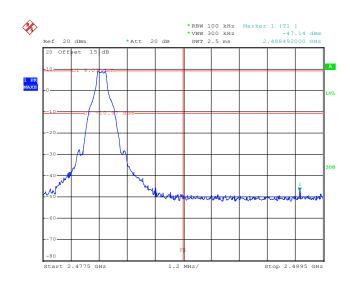

Date: 18.JUL.2016 16:47:02


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 41 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 2Mbps | Temperature : | 24~26 ℃ |
|----------------|-----------|---------------------|----------------|
| Test Channel : | 00 and 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

Low Band Edge Plot on Channel 00

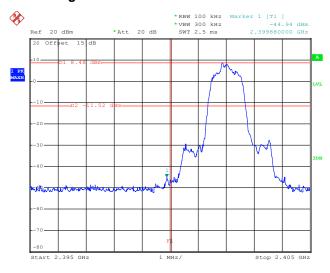

Date: 18.JUL.2016 16:53:24

High Band Edge Plot on Channel 78

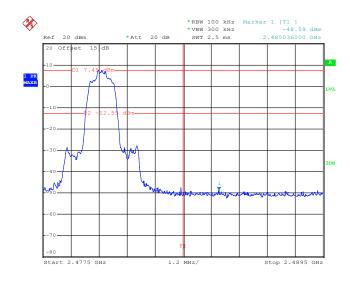

Date: 18.JUL.2016 17:10:16


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 42 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 3Mbps | Temperature : | 24~26 ℃ |
|----------------|-----------|---------------------|----------------|
| Test Channel : | 00 and 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

Low Band Edge Plot on Channel 00

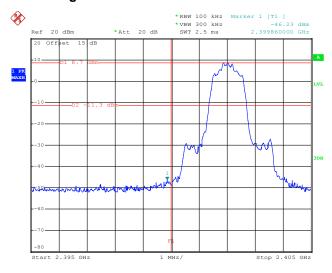

Date: 18.JUL.2016 17:28:09

High Band Edge Plot on Channel 78

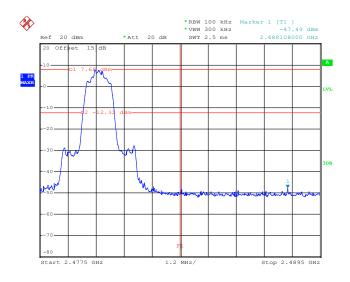

Date: 18.JUL.2016 17:43:59

SPORTON INTERNATIONAL (SHENZHEN) INC.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 43 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.6.7 Test Result of Conducted Hopping Mode Band Edges


| Test Mode : | 1Mbps | Temperature : | 24~26℃ |
|-----------------|-----------|---------------------|--------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

1Mbps Hopping Mode Low Band Edge Plot

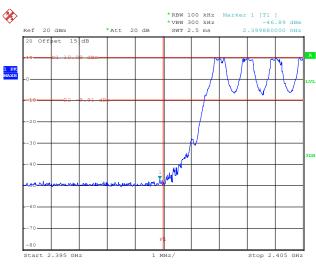

Date: 18.JUL.2016 18:19:11

1Mbps Hopping Mode High Band Edge Plot

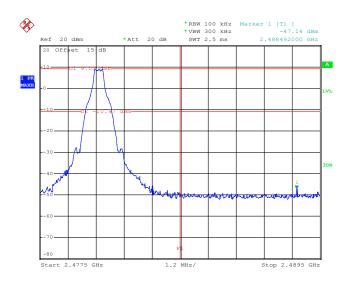

Date: 18.JUL.2016 16:47:02


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 44 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 2Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |

2Mbps Hopping Mode Low Band Edge Plot

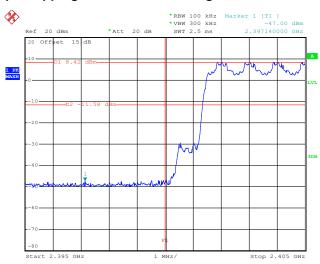

Date: 18.JUL.2016 17:09:50

2Mbps Hopping Mode High Band Edge Plot

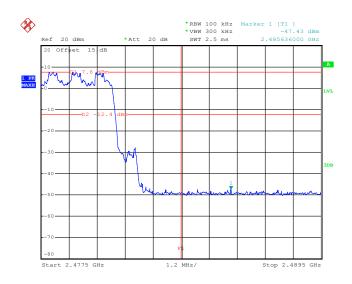

Date: 18.JUL.2016 17:22:04


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 45 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

| Test Mode : | 3Mbps | Temperature : | 24~26 ℃ |
|-----------------|-----------|---------------------|----------------|
| Test Engineer : | Sam Zheng | Relative Humidity : | 50~53% |


3Mbps Hopping Mode Low Band Edge Plot

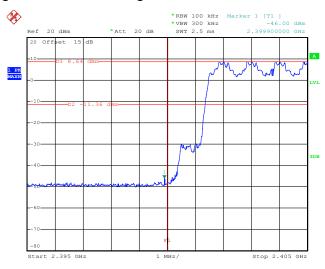

Report No.: FR670507A

Date: 18.JUL.2016 17:40:59

3Mbps Hopping Mode High Band Edge Plot

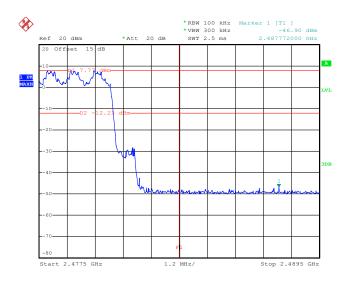

Date: 18.JUL.2016 17:52:43

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 46 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

3.7 **Conducted Spurious Emission Measurement**

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066


: 47 of 69 Page Number Report Issued Date: Aug. 16, 2016 Report Version : Rev. 01

Report No.: FR670507A

3.7.5 Test Result of Conducted Spurious Emission


| Test Mode : | 1Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 00 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

1Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

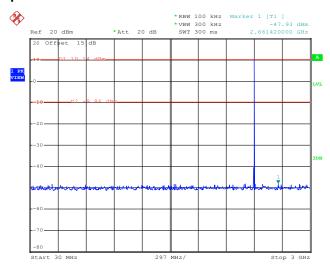

Date: 18.JUL.2016 16:40:42

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

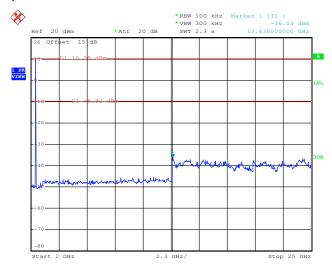

Date: 18.JUL.2016 16:41:03


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 48 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 1Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 39 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

1Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

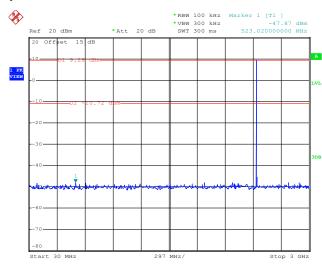

Date: 18.JUL.2016 17:55:12

1Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

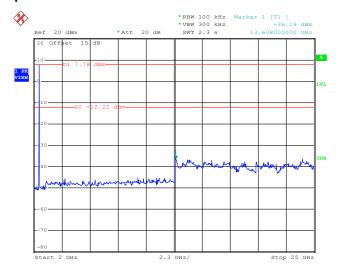

Date: 18.JUL.2016 17:55:33


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 49 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 1Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

1Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

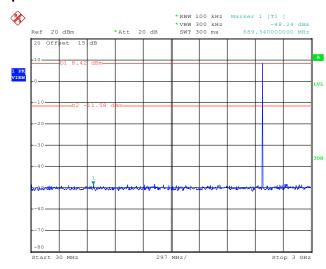

Date: 18.JUL.2016 16:52:36

1Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

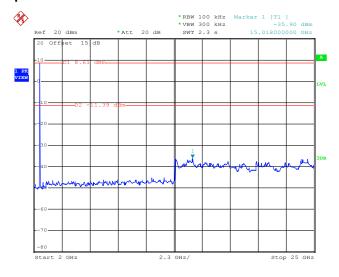

Date: 18.JUL.2016 16:52:57


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 50 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 2Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 00 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

2Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

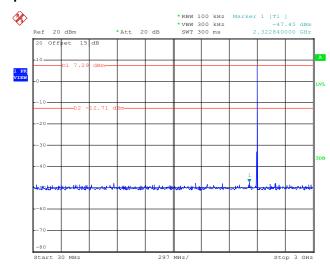

Date: 18.JUL.2016 16:54:07

2Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

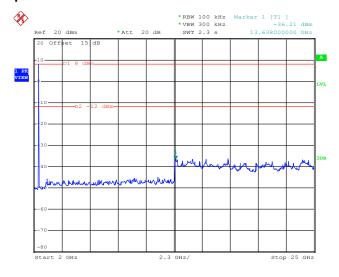

Date: 18.JUL.2016 16:54:29


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 51 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 2Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 39 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

2Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

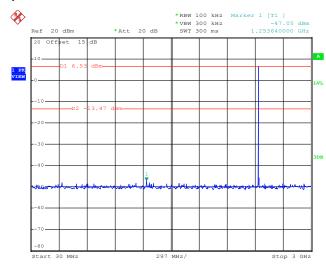

Date: 18.JUL.2016 18:01:19

2Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

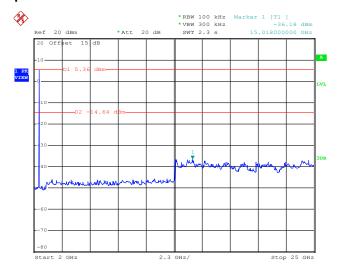

Date: 18.JUL.2016 18:01:40


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 52 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 2Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

2Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

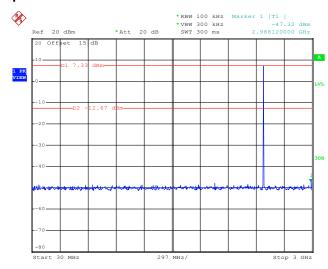

Date: 18.JUL.2016 17:24:32

2Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

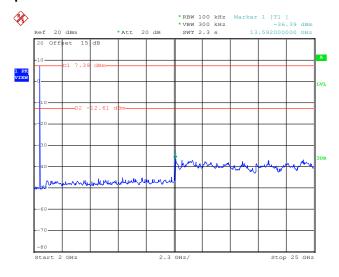

Date: 18.JUL.2016 17:24:54


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 53 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 00 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

3Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

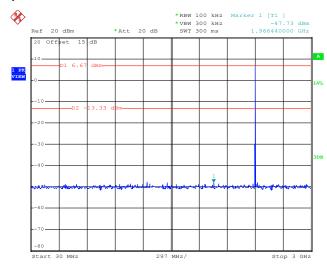

Date: 18.JUL.2016 17:28:36

3Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

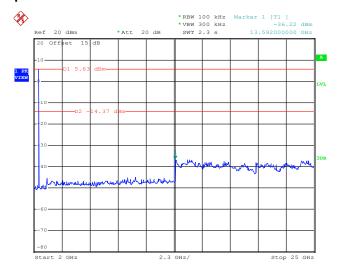

Date: 18.JUL.2016 17:28:58


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 54 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 39 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

3Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

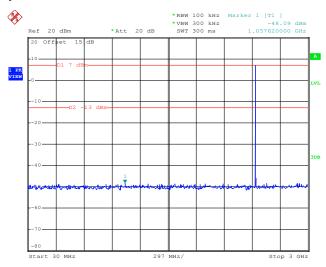

Date: 18.JUL.2016 17:42:02

3Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

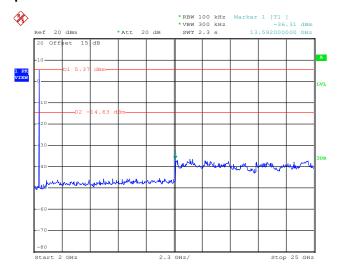

Date: 18.JUL.2016 17:42:24


SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 55 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


| Test Mode : | 3Mbps | Temperature : | 24~26℃ |
|----------------|-------|---------------------|-----------|
| Test Channel : | 78 | Relative Humidity : | 50~53% |
| | | Test Engineer : | Sam Zheng |

3Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

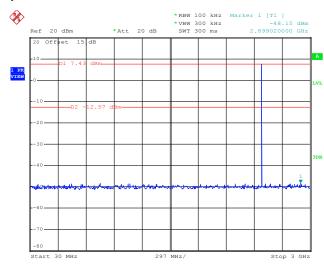

Date: 18.JUL.2016 17:45:17

3Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

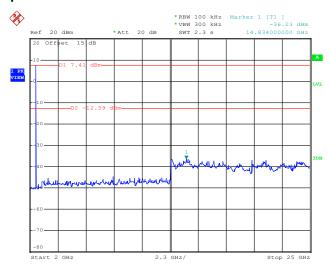

Date: 18.JUL.2016 17:45:39

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 56 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the FCC section 15.209 limits as below.

| Frequency | Field Strength | Measurement Distance |
|---------------|--------------------|----------------------|
| (MHz) | (microvolts/meter) | (meters) |
| 0.009 - 0.490 | 2400/F(kHz) | 300 |
| 0.490 – 1.705 | 24000/F(kHz) | 30 |
| 1.705 – 30.0 | 30 | 30 |
| 30 – 88 | 100 | 3 |
| 88 – 216 | 150 | 3 |
| 216 - 960 | 200 | 3 |
| Above 960 | 500 | 3 |

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 57 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.8.3 Test Procedures

- The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c). Duty cycle = On time/100 milliseconds

 On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

 Average Emission Level = Peak Emission Level + 20*log(Duty cycle)
- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.85dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 58 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.8.4 Test Setup

For radiated emissions below 30MHz




For radiated emissions from 30MHz to 1GHz



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 59 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

For radiated emissions above 1GHz

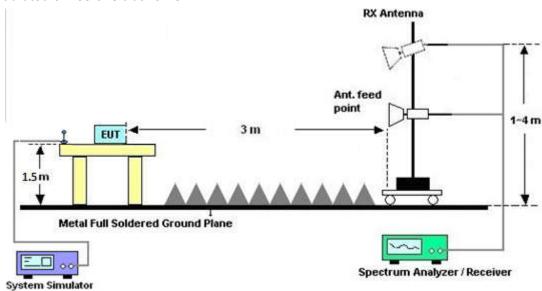

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)


The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 60 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1


Report No.: FR670507A

3.8.6 Duty cycle correction factor for average measurement

3DH5 on time (One Pulse) Plot on Channel 39

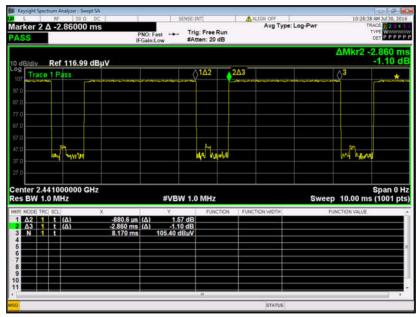

3DH5 on time (Count Pulses) Plot on Channel 39

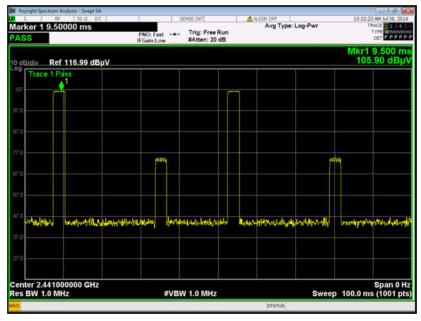

Note:

- 2. Worst case Duty cycle = on time/100 milliseconds = 2 * 2.86 / 100 = 5.72 %
- 3. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.85 dB
- 4. 3DH5 has the highest duty cycle worst case and is reported.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 61 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

 $2.86 \text{ ms } \times 20 \text{ channels} = 57.2 \text{ ms}$

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

2.86 ms x 2 = 5.72 ms

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.72 \text{ ms/}100\text{ms}) = -24.85 \text{ dB}$

3.8.7 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix A.

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix A.

Page Number : 62 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

| Eroquanay of amission (MUz) | Conducted limit (dBµV) | |
|-----------------------------|------------------------|-----------|
| Frequency of emission (MHz) | Quasi-peak | Average |
| 0.15-0.5 | 66 to 56* | 56 to 46* |
| 0.5-5 | 56 | 46 |
| 5-30 | 60 | 50 |

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.


3.9.3 Test Procedures

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 63 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A


3.9.4 Test Setup

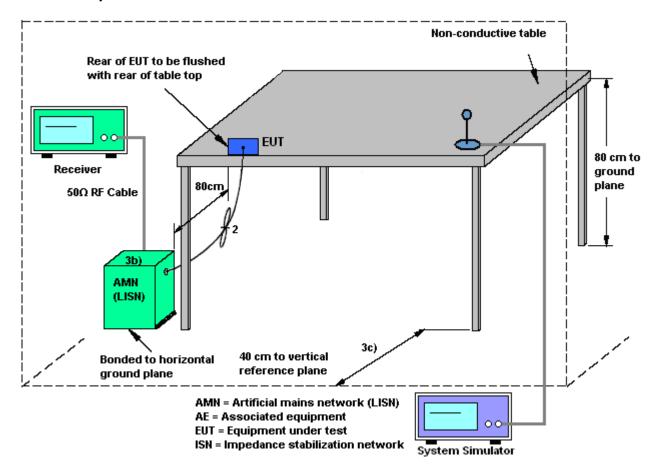

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 64 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

Report No.: FR670507A

3.9.5 Test Result of AC Conducted Emission

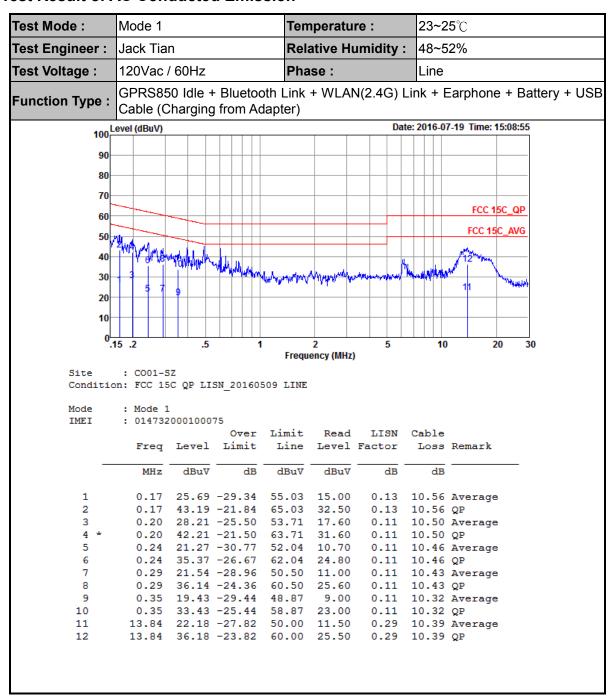


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 65 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A



| Test Mode : | Mode 1 | Temperature : | 23~25 ℃ |
|-----------------|---------------|---------------------|----------------|
| Test Engineer : | Jack Tian | Relative Humidity : | 48~52% |
| Test Voltage : | 120Vac / 60Hz | Phase : | Neutral |
| | | | |

Function Type : GPRS850 Idle + Bluetooth Link + WLAN(2.4G) Link + Earphone + Battery + USB Cable (Charging from Adapter)

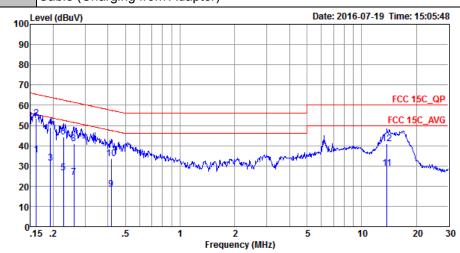

Site : CO01-SZ

Condition: FCC 15C_QP LISN_20160509 NEUTRAL

Mode : Mode 1

IMEI : 014732000100075

| | | | Over | Limit | Read | LISN | Cable | |
|----|-----|-----------|----------|-------|-------|--------|-------|---------|
| | F | req Level | Limit | Line | Level | Factor | Loss | Remark |
| | | MHz dBu\ | dB | dBu∀ | dBu∀ | dB | dB | |
| 1 | 0 | .16 35.61 | -19.77 | 55.38 | 24.91 | 0.13 | 10.57 | Average |
| 2 | * 0 | .16 53.61 | -11.77 | 65.38 | 42.91 | 0.13 | 10.57 | QP |
| 3 | 0 | .19 31.22 | 2 -22.67 | 53.89 | 20.60 | 0.11 | 10.51 | Average |
| 4 | 0 | .19 49.02 | 2 -14.87 | 63.89 | 38.40 | 0.11 | 10.51 | QP |
| 5 | 0 | .23 26.38 | 3 -26.14 | 52.52 | 15.80 | 0.11 | 10.47 | Average |
| 6 | 0 | .23 44.28 | -18.24 | 62.52 | 33.70 | 0.11 | 10.47 | QP |
| 7 | 0 | .26 24.26 | -27.16 | 51.42 | 13.70 | 0.11 | 10.45 | Average |
| 8 | 0 | .26 41.06 | -20.36 | 61.42 | 30.50 | 0.11 | 10.45 | QP |
| 9 | 0 | .42 18.55 | -28.96 | 47.51 | 8.20 | 0.11 | 10.24 | Average |
| 10 | 0 | .42 33.75 | -23.76 | 57.51 | 23.40 | 0.11 | 10.24 | QP |
| 11 | 13 | .77 28.78 | 3 -21.22 | 50.00 | 18.10 | 0.29 | 10.39 | Average |
| 12 | 13 | .77 40.98 | -19.02 | 60.00 | 30.30 | 0.29 | 10.39 | QP |

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 66 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the FCC rule.

3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 67 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01

Report No.: FR670507A

4. List of Measuring Equipment

| Instrument | Manufacturer | Model No. | Serial No. | Characteristics | Calibration Date | Test Date | Due Date | Remark |
|---|--|----------------------------------|------------------|--------------------|---------------------|---------------------------------|-------------------------|--------------------------|
| Spectrum Analyzer | R&S | FSV40 | 101078 | 9kHz~40GHz | May 07, 2016 | Jul. 13, 2016~ Jul. 20, 2016 | May 06, 2017 | Conducted (TH01-SZ) |
| Spectrum Analyzer | R&S | FSP30 | 101400 | 9kHz~40GHz | Jan. 12, 2016 | Jul. 13, 2016~ Jul. 20, 2016 | Jan. 11, 2017 | Conducted (TH01-SZ) |
| Pulse Power Senor | Anritsu | MA2411B | 1207253 | 30MHz~40GHz | Jan. 12, 2016 | Jul. 13, 2016~ Jul. 20, 2016 | Jan. 11, 2017 | Conducted (TH01-SZ) |
| Power Meter | Anritsu | ML2495A | 1218010 | 50MHz Bandwidth | Jan. 12, 2016 | Jul. 13, 2016~ Jul. 20, 2016 | Jan. 11, 2017 | Conducted (TH01-SZ) |
| EMI Test Receiver&SA | KEYSIGHT | N9038A | MY544500 83 | 20Hz~8.4GHz | May 07, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | May 06, 2017 | Radiation (03CH03-SZ) |
| EXA Spectrum Anaiyzer | KEYSIGHT | N9010A | MY551502 46 | 10Hz~44GHz | May 07, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | May 06, 2017 | Radiation (03CH03-SZ) |
| Loop Antenna | R&S | HFH2-Z2 | 100354 | 9kHz~30MHz | May 07, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | May 06, 2017 | Radiation (03CH03-SZ) |
| Bilog Antenna | TeseQ | CBL6112D | 35408 | 30MHz~2GHz | May 21, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | May 20, 2017 | Radiation (03CH03-SZ) |
| HF Amplifier | MITEQ | TTA1840-35- HG | 1871923 | 18GHz~40GHz | Jul. 16, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | Jul. 15, 2017 | Radiation (03CH03-SZ) |
| SHF-EHF Horn | com-power | AH-840 | 101071 | 18Ghz-40GHz | Aug.19, 2015 | Jul. 25, 2016~ Aug. 01, 2016 | Aug. 18, 2016 | Radiation (03CH03-SZ) |
| Amplifier | Burgeon | BPA-530 | 102210 | 0.01Hz ~3000MHz | Oct. 20, 2015 | Jul. 25, 2016~ Aug. 01, 2016 | Oct. 19, 2016 | Radiation (03CH03-SZ) |
| HF Amplifier | MITEQ | AMF-7D-0010 1800-30-10P- R | 1943528 | 1GHz~18GHz | Oct. 20, 2015 | Jul. 25, 2016~ Aug. 01, 2016 | Oct. 19, 2016 | Radiation (03CH03-SZ) |
| Amplifier | Agilent Technologies | 83017A | MY395013 02 | 500MHz~26.5G Hz | Jan. 12, 2016 | Jul. 25, 2016~ Aug. 01, 2016 | Jan. 11, 2017 | Radiation (03CH03-SZ) |
| AC Power Source | Chroma | 61601 | 616010001 985 | N/A | NCR | Jul. 25, 2016~ Aug. 01, 2016 | NCR | Radiation (03CH03-SZ) |
| Turn Table | EM | EM1000 | N/A | 0~360 degree | NCR | Jul. 25, 2016~ Aug. 01, 2016 | NCR | Radiation (03CH03-SZ) |
| Antenna Mast | EM | EM1000 | N/A | 1 m~4 m | NCR | Jul. 25, 2016~ Aug. 01, 2016 | NCR | Radiation (03CH03-SZ) |
| EMI Receiver | R&S | ESCI7 | 100724 | 9kHz~3GHz; | Nov. 23, 2015 | Jul. 19, 2016 | Nov. 22, 2016 | Conduction (CO01-SZ) |
| AC LISN | EMCO | 3816/2SH | 00103892 | 9kHz~30MHz | Jan. 12, 2016 | Jul. 19, 2016 | Jan. 11, 2017 | Conduction (CO01-SZ) |
| AC LISN (for auxiliary equipment) | uxiliary MessTec 3816/2SH 00103912 9kH | | 9kHz~30MHz | Jan. 12, 2016 | Jul. 19, 2016 | Jan. 11, 2017 | Conduction (CO01-SZ) | |
| AC Power Source | Chroma | 61602 | 616020000 891 | 100Vac~250Vac | Jul. 16, 2016 | Jul. 19, 2016 | Jul. 15, 2017 | Conduction (CO01-SZ) |
| Pulse Limiter | COM-POWER | LIT-153 Transient Limiter | 53139 | 150kHz~30MHz | Oct. 20, 2015 | Jul. 19, 2016 | Oct. 19, 2016 | Conduction (CO01-SZ) |

NCR: No Calibration Required

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 68 of 69
Report Issued Date : Aug. 16, 2016

Report No.: FR670507A

Report Version : Rev. 01

5. Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

| Measuring Uncertainty for a Level of | 2.5dB |
|--------------------------------------|-------|
| Confidence of 95% (U = 2Uc(y)) | 2.50В |

<u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

| Measuring Uncertainty for a Level of | 5.0dB |
|--------------------------------------|-------|
| Confidence of 95% (U = 2Uc(y)) | 5.0UB |

<u>Uncertainty of Radiated Emission Measurement (1GHz ~ 18GHz)</u>

| | - |
|--------------------------------------|-------|
| Measuring Uncertainty for a Level of | 40.10 |
| Confidence of 95% (U = 2Uc(y)) | 4.8dB |
| | |

<u>Uncertainty of Radiated Emission Measurement (18GHz ~ 40GHz)</u>

| Measuring Uncertainty for a Level of | 5.0dB |
|--------------------------------------|-------|
| Confidence of 95% (U = 2Uc(y)) | 5.VUB |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : 69 of 69
Report Issued Date : Aug. 16, 2016
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 1.1

Report No.: FR670507A

Appendix A. Radiated Spurious Emission

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

| ВТ | Note | Frequency | Level | Over | Limit | Read | Antenna | Cable | Preamp | Ant | Table | Peak | Pol. |
|------------------|------|-----------|------------|--------|------------|--------|----------|--------|--------|--------|-------|-------|-------|
| | | | | Limit | Line | Level | Factor | Loss | Factor | Pos | Pos | Avg. | |
| | | (MHz) | (dBµV/m) | (dB) | (dBµV/m) | (dBµV) | (dB/m) | (dB) | (dB) | (cm) | (deg) | (P/A) | (H/V) |
| | | 2343.54 | 39.9 | -34.1 | 74 | 42.94 | 27.19 | 4.82 | 35.05 | 172 | 204 | Р | Н |
| | | 2343.54 | 15.05 | -38.95 | 54 | - | - | - | - | 172 | 204 | Α | Н |
| DT | * | 2402 | 104.55 | - | - | 107.4 | 27.29 | 4.86 | 35 | 172 | 204 | Р | Н |
| BT CH00 | * | 2402 | 79.7 | - | - | - | - | - | - | 172 | 204 | Α | Н |
| 2402MHz | | 2372.66 | 40.88 | -33.12 | 74 | 43.78 | 27.26 | 4.86 | 35.02 | 150 | 69 | Р | V |
| 2402111112 | | 2372.66 | 16.03 | -37.97 | 54 | - | - | - | - | 150 | 69 | Α | V |
| | * | 2402 | 102.56 | - | - | 105.41 | 27.29 | 4.86 | 35 | 150 | 69 | Р | V |
| | * | 2402 | 77.71 | - | - | - | - | - | - | 150 | 69 | Α | ٧ |
| | | 2313.23 | 42.26 | -31.74 | 74 | 45.45 | 27.12 | 4.79 | 35.1 | 150 | 334 | Р | Н |
| | | 2313.23 | 17.41 | -36.59 | 54 | - | - | - | - | 150 | 334 | Α | Н |
| | * | 2441 | 102.83 | - | - | 105.5 | 27.4 | 4.88 | 34.95 | 150 | 334 | Р | Н |
| | * | 2441 | 77.98 | - | - | - | - | - | - | 150 | 334 | Α | Н |
| | | 2486.89 | 40.2 | -33.8 | 74 | 42.75 | 27.47 | 4.9 | 34.92 | 150 | 334 | Р | Н |
| BT | | 2486.89 | 15.35 | -38.65 | 54 | - | - | - | - | 150 | 334 | Α | Н |
| CH 39 2441MHz | | 2312.66 | 39.72 | -34.28 | 74 | 42.91 | 27.12 | 4.79 | 35.1 | 165 | 254 | Р | V |
| 244 WIF1Z | | 2312.66 | 14.87 | -39.13 | 54 | - | - | - | - | 165 | 254 | Α | ٧ |
| | * | 2441 | 102.28 | - | - | 104.95 | 27.4 | 4.88 | 34.95 | 165 | 254 | Р | V |
| | * | 2441 | 77.43 | - | - | - | - | - | - | 165 | 254 | Α | V |
| | | 2488.03 | 39.72 | -34.28 | 74 | 42.24 | 27.5 | 4.9 | 34.92 | 165 | 254 | Р | ٧ |
| | | 2488.03 | 14.87 | -39.13 | 54 | - | - | - | - | 165 | 254 | Α | ٧ |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A1 of A6
Report Issued Date : Aug. 16, 2016
Report Version : Rev 01

Report No.: FR670507A



| | * | 2480 | 103.44 | - | - | 105.99 | 27.47 | 4.9 | 34.92 | 223 | 203 | Р | Н |
|------------------|---|------------------|--------|----------|-------------|-----------|-------|-----|-------|-----|-----|---|---|
| | * | 2480 | 78.59 | - | - | - | - | - | - | 223 | 203 | Α | Н |
| | | 2483.5 | 52.1 | -21.9 | 74 | 54.65 | 27.47 | 4.9 | 34.92 | 223 | 203 | Р | Н |
| BT | | 2483.5 | 27.25 | -26.75 | 54 | - | - | - | - | 223 | 203 | Α | Н |
| CH 78 2480MHz | * | 2480 | 100.71 | - | - | 103.26 | 27.47 | 4.9 | 34.92 | 205 | 62 | Р | V |
| 240UWITZ | * | 2480 | 75.86 | - | - | - | - | - | - | 205 | 62 | Α | V |
| | | 2483.69 | 49.27 | -24.73 | 74 | 51.82 | 27.47 | 4.9 | 34.92 | 205 | 62 | Р | V |
| | | 2483.69 | 24.42 | -29.58 | 54 | - | - | - | - | 205 | 62 | Α | V |
| Remark | | o other spurious | | ⊃eak and | Average lir | mit line. | | | | | | , | |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A2 of A6
Report Issued Date : Aug. 16, 2016
Report Version : Rev 01

Report No.: FR670507A

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

| ВТ | Note | Frequency | Level | Over | Limit | Read | Antenna | Cable | Preamp | Ant | Table | Peak | Pol |
|------------------------|------|-----------|------------|--------|------------|---------------------|----------|--------|--------|--------|-------|-------|------|
| | | | | Limit | Line | Level | Factor | Loss | Factor | Pos | Pos | Avg. | |
| | | (MHz) | (dBµV/m) | (dB) | (dBµV/m) | (dB _µ V) | (dB/m) | (dB) | (dB) | (cm) | (deg) | (P/A) | (H/V |
| DT | | 4804 | 40.79 | -33.21 | 74 | 59.61 | 32.52 | 6.96 | 58.3 | 250 | 0 | Р | Н |
| BT CH 00 2402MHz | | 4804 | 15.94 | -38.06 | 54 | - | - | - | - | 250 | 0 | Α | Н |
| | | 4804 | 40.32 | -33.68 | 74 | 59.14 | 32.52 | 6.96 | 58.3 | 250 | 0 | Р | V |
| 2402111112 | | 4804 | 15.47 | -38.53 | 54 | - | - | - | - | 250 | 0 | Α | V |
| | | 4882 | 39.15 | -34.85 | 74 | 58.16 | 32.66 | 6.99 | 58.66 | 250 | 0 | Р | Н |
| | | 4882 | 14.3 | -39.7 | 54 | - | - | - | - | 250 | 0 | Α | Н |
| | | 7323 | 48 | -26 | 74 | 60 | 37.67 | 8.93 | 58.6 | 150 | 0 | Р | Н |
| BT | | 7323 | 23.15 | -30.85 | 54 | - | - | - | - | 150 | 0 | Α | Н |
| CH 39 2441MHz | | 4882 | 40.06 | -33.94 | 74 | 59.07 | 32.66 | 6.99 | 58.66 | 250 | 0 | Р | V |
| 244 I IVI 112 | | 4882 | 15.21 | -38.79 | 54 | - | - | - | - | 250 | 0 | Α | V |
| | | 7323 | 47.27 | -26.73 | 74 | 59.27 | 37.67 | 8.93 | 58.6 | 150 | 0 | Р | V |
| | | 7323 | 22.42 | -31.58 | 54 | - | - | - | - | 150 | 0 | Α | V |
| | | 4960 | 41.26 | -32.74 | 74 | 59.66 | 32.83 | 7.07 | 58.3 | 250 | 0 | Р | Н |
| | | 4960 | 16.41 | -37.59 | 54 | - | - | - | - | 250 | 0 | Α | Н |
| | | 7440 | 47.92 | -26.08 | 74 | 59.53 | 37.69 | 9.15 | 58.45 | 150 | 0 | Р | Н |
| BT | | 7440 | 23.07 | -30.93 | 54 | - | - | - | - | 150 | 0 | Α | Н |
| CH 78 | | 4960 | 41.65 | -32.35 | 74 | 60.05 | 32.83 | 7.07 | 58.3 | 250 | 0 | Р | V |
| 2480MHz | | 4960 | 16.8 | -37.2 | 54 | - | - | - | - | 250 | 0 | Α | V |
| | | 7440 | 48.08 | -25.92 | 74 | 59.69 | 37.69 | 9.15 | 58.45 | 150 | 0 | Р | V |
| | | 7440 | 23.23 | -30.77 | 54 | - | - | - | - | 150 | 0 | Α | V |

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A3 of A6
Report Issued Date : Aug. 16, 2016

Report No.: FR670507A

Report Version : Rev 01
Report Template No.: BU5-FR15CBT Version 1.1

Emission below 1GHz

2.4GHz BT (LF)

| ВТ | Note | Frequency | Level | Over | Limit | Read | Antenna | Cable | Preamp | Ant | Table | Peak | Pol. |
|--------------|--------|-----------------|--------------|--------------|------------|--------|----------|--------|--------|--------|---------|-------|-------|
| | | | | Limit | Line | Level | Factor | Loss | Factor | Pos | Pos | Avg. | |
| | | (MHz) | (dBµV/m) | (dB) | (dBµV/m) | (dBµV) | (dB/m) | (dB) | (dB) | (cm) | (deg) | (P/A) | (H/V) |
| | | 42.61 | 32.27 | -7.73 | 40 | 42.58 | 20.82 | 0.62 | 31.75 | 100 | 300 | Р | Н |
| | | 120.21 | 33.53 | -9.97 | 43.5 | 45.65 | 18.4 | 0.99 | 31.51 | - | - | Р | Н |
| | | 244.37 | 34.1 | -11.9 | 46 | 46.27 | 17.72 | 1.4 | 31.29 | - | - | Р | Н |
| | | 411.21 | 26.75 | -19.25 | 46 | 30.34 | 25.75 | 1.89 | 31.23 | - | - | Р | Н |
| 0.4011- | | 572.23 | 27.28 | -18.72 | 46 | 31.2 | 25.04 | 2.25 | 31.21 | - | - | Р | Н |
| 2.4GHz BT | | 737.13 | 29.89 | -16.11 | 46 | 31.2 | 27.4 | 2.52 | 31.23 | - | - | Р | Н |
| LF | | 42.61 | 34.04 | -5.96 | 40 | 44.35 | 20.82 | 0.62 | 31.75 | 100 | 200 | Р | V |
| Li | | 117.3 | 28.14 | -15.36 | 43.5 | 40.22 | 18.45 | 0.99 | 31.52 | - | - | Р | V |
| | | 181.32 | 24.72 | -18.78 | 43.5 | 38.33 | 16.42 | 1.28 | 31.31 | - | - | Р | V |
| | | 238.55 | 30.13 | -15.87 | 46 | 42.56 | 17.45 | 1.4 | 31.28 | - | - | Р | V |
| | | 399.57 | 30.27 | -15.73 | 46 | 33.69 | 26 | 1.82 | 31.24 | - | - | Р | V |
| | | 567.38 | 27.56 | -18.44 | 46 | 31.61 | 25.03 | 2.13 | 31.21 | - | - | Р | V |
| Remark | | other spurious | | imit line | | | | | | | | | |
| | ۷. ۸۱۱ | results are I A | oo agamst ii | iiiii iiiic. | | | | | | | | | |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A4 of A6
Report Issued Date : Aug. 16, 2016
Report Version : Rev 01

Report No.: FR670507A

Note symbol

| * | Fundamental Frequency which can be ignored. However, the level of any unwanted emissions shall not |
|-----|--|
| | exceed the level of the fundamental frequency. |
| ! | Test result is over limit line. |
| P/A | Peak or Average |
| H/V | Horizontal or Vertical |

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A5 of A6
Report Issued Date : Aug. 16, 2016
Report Version : Rev 01

Report No.: FR670507A

A calculation example for radiated spurious emission is shown as below:

| WIFI | Note | Frequency | Level | Over | Limit | Read | Antenna | Cable | Preamp | Ant | Table | Peak | Pol. |
|---------|------|-----------|------------|--------|------------|---------------------|----------|--------|--------|--------|-------|-------|-------|
| Ant. | | - | - | Limit | Line | Level | Factor | Loss | Factor | Pos | Pos | Avg. | |
| 1+2 | | (MHz) | (dBµV/m) | (dB) | (dBµV/m) | (dB _µ V) | (dB/m) | (dB) | (dB) | (cm) | (deg) | (P/A) | (H/V) |
| 802.11b | | 2390 | 55.45 | -18.55 | 74 | 54.51 | 32.22 | 4.58 | 35.86 | 103 | 308 | Р | Н |
| CH 01 | | | | | | | | | | | | | |
| 2412MHz | | 2390 | 43.54 | -10.46 | 54 | 42.6 | 32.22 | 4.58 | 35.86 | 103 | 308 | Α | Н |

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level($dB\mu V/m$)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dB μ V) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL (SHENZHEN) INC.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: 2ACCJB066 Page Number : A6 of A6
Report Issued Date : Aug. 16, 2016
Report Version : Rev 01

Report No.: FR670507A