Occupied Bandwidth

Mode		LTE Band 2 : 99%OBW(MHz)											
BW	1.4MHz		3MHz		5MHz		10MHz		15MHz		20MHz		
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	
Lowest CH	1.091	1.097	2.727	2.727	4.486	4.496	9.071	9.051	13.457	13.457	18.422	18.462	
Middle CH	1.097	1.097	2.721	2.721	4.505	4.496	9.091	9.031	13.427	13.457	18.302	18.262	
Highest CH	1.099	1.097	2.721	2.727	4.505	4.496	9.031	9.051	13.427	13.487	18.342	18.382	

Mode		LTE Band 4 : 99%OBW(MHz)											
BW	1.4MHz		IHz 3MHz		5MHz		10MHz		15MHz		20MHz		
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	
Lowest CH	1.094	1.097	2.727	2.721	4.496	4.486	9.071	9.031	13.487	13.457	18.342	18.422	
Middle CH	1.097	1.097	2.727	2.727	4.496	4.496	9.071	9.051	13.516	13.487	18.422	18.581	
Highest CH	1.097	1.097	2.727	2.733	4.496	4.505	9.051	9.051	13.457	13.457	18.222	18.142	

Mode		LTE Band 5 : 99%OBW(MHz)										
BW	1.4MHz		3MHz		5MHz		10MHz		15MHz		20MHz	
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM
Lowest CH	1.097	1.097	2.727	2.721	4.505	4.496	9.051	9.031	-	-	-	-
Middle CH	1.097	1.097	2.733	2.727	4.505	4.505	9.071	9.051	-	-	-	-
Highest CH	1.094	1.097	2.721	2.727	4.496	4.496	9.071	8.991	-	-	-	-

Mode		LTE Band 7 : 99%OBW(MHz)											
BW	1.4MHz		3MHz		5MHz		10MHz		15MHz		20MHz		
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	
Lowest CH	-	-	-	-	4.496	4.496	9.031	9.031	13.427	13.487	18.342	18.462	
Middle CH	-	-	-	-	4.505	4.486	9.131	9.031	13.487	13.516	18.342	18.342	
Highest CH	-	-	-	-	4.505	4.496	9.111	9.051	13.427	13.487	18.422	18.422	

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A67 of A191
Report Issued Date : Apr. 17, 2015

Report No. : FG511301-03B

Report Version : Rev. 01


Mode		LTE Band 12 : 99%OBW(MHz)											
BW	1.4MHz		3MHz		5MHz		10MHz		15MHz		20MHz		
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	
Lowest CH	1.097	1.097	2.721	2.721	4.505	4.496	9.091	9.031	-	-	-	-	
Middle CH	1.094	1.097	2.721	2.727	4.496	4.496	9.051	9.031	-	-	-	-	
Highest CH	1.094	1.097	2.733	2.721	4.496	4.505	9.031	9.031	-	-	-	-	

Mode		LTE Band 17 : 99%OBW(MHz)											
BW	1.4MHz		3MHz		5MHz		10MHz		15MHz		20MHz		
Mod.	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	QPSK	16QAM	
Lowest CH	-	-	-	-	4.505	4.496	9.071	8.991	-	-	-	-	
Middle CH	-	-	-	-	4.496	4.496	9.031	9.011	-	-	-	-	
Highest CH	-	-	-	-	4.505	4.505	9.091	9.051	-	-	-	-	


Page Number : A68 of A191
Report Issued Date : Apr. 17, 2015

Report No. : FG511301-03B


Report Version : Rev. 01

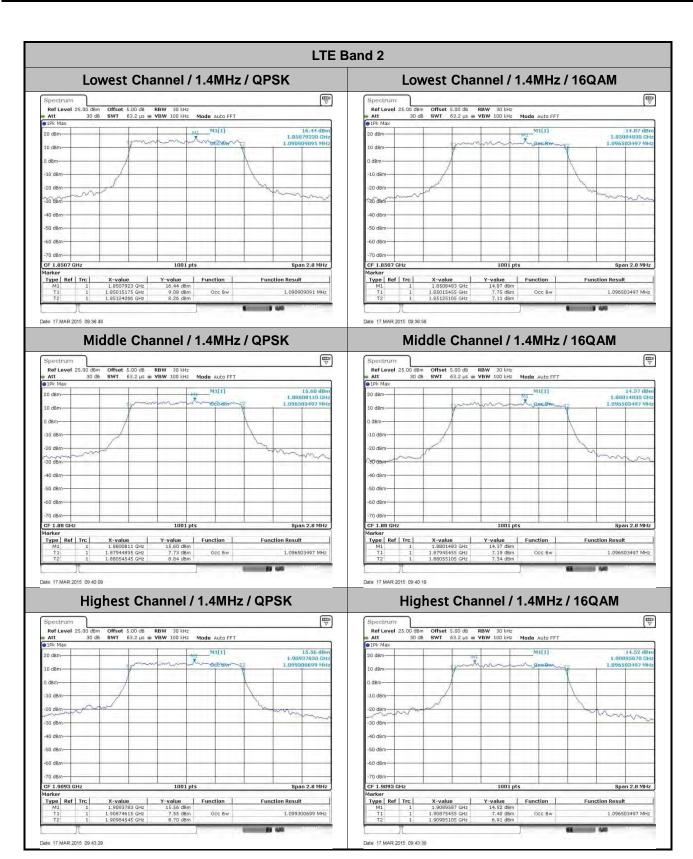


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A69 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

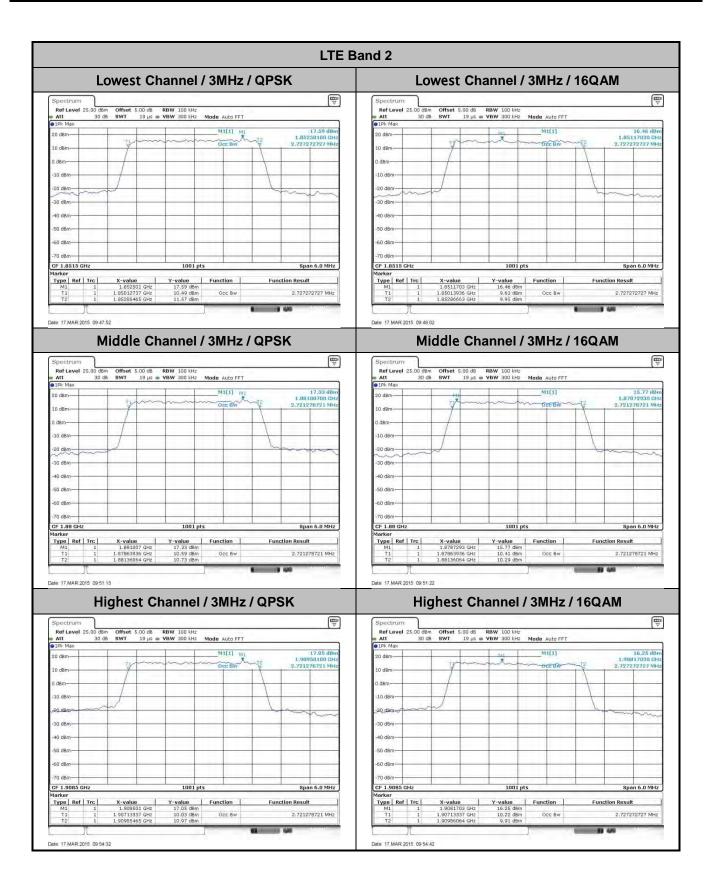


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A70 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

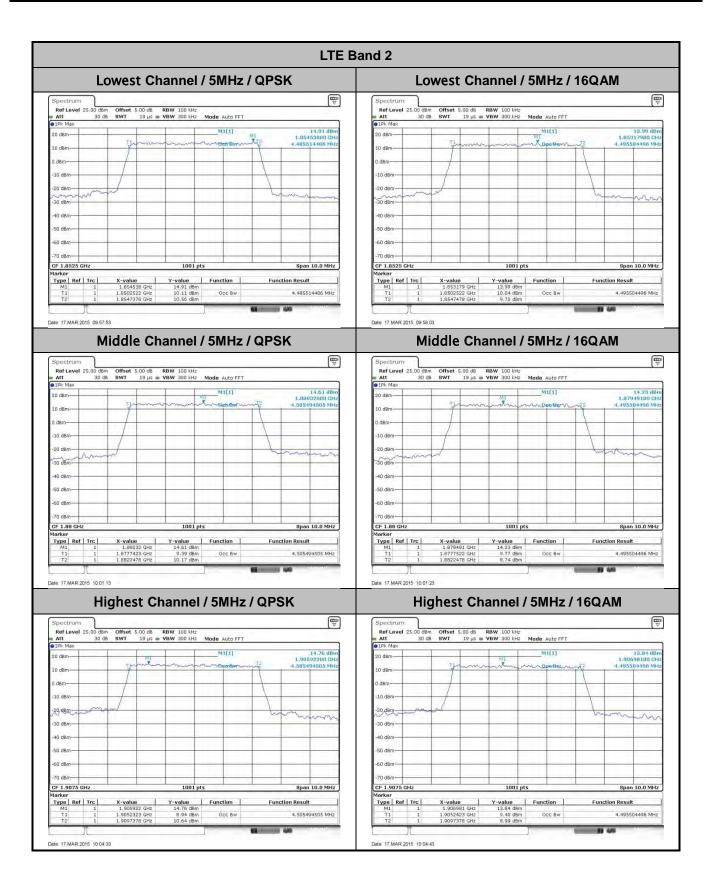


Page Number : A71 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

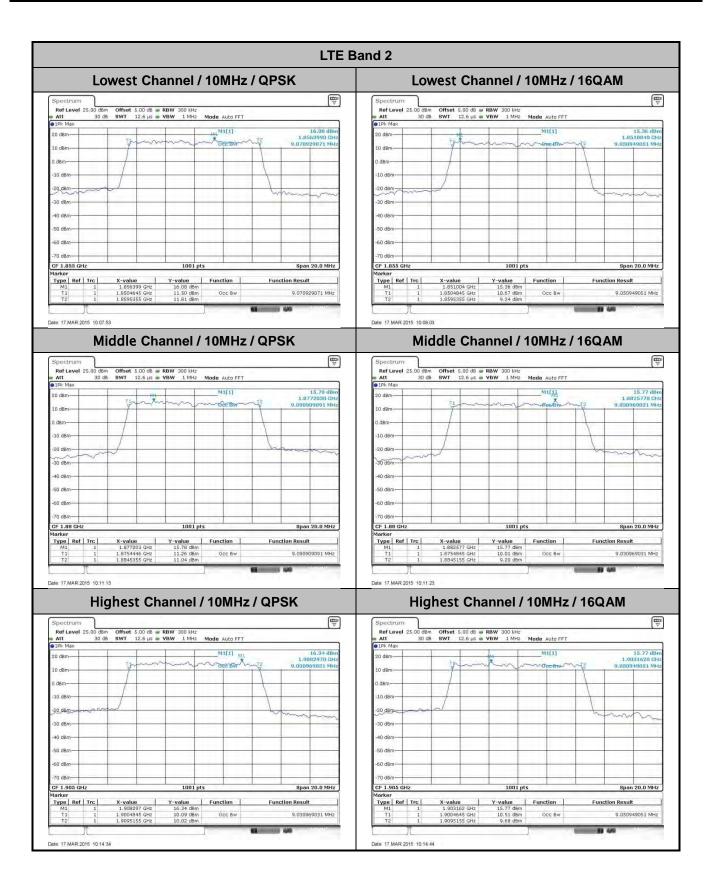


Page Number : A72 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

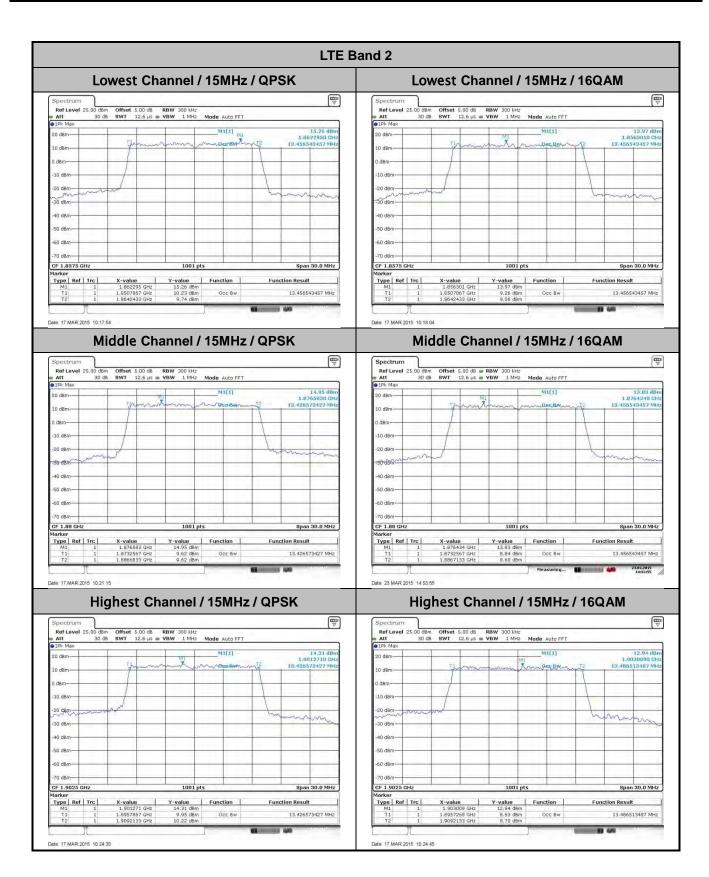


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A73 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

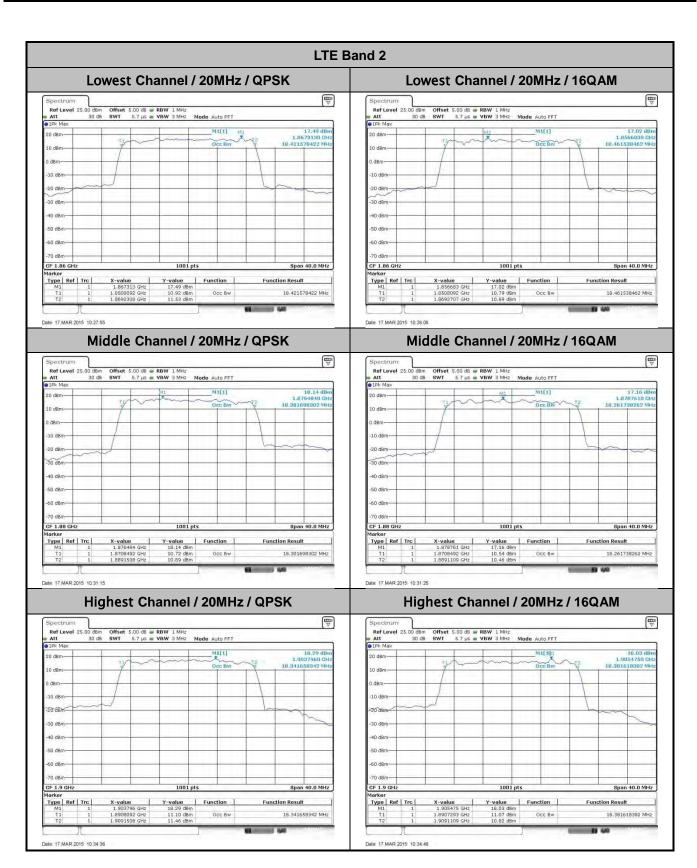


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A74 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

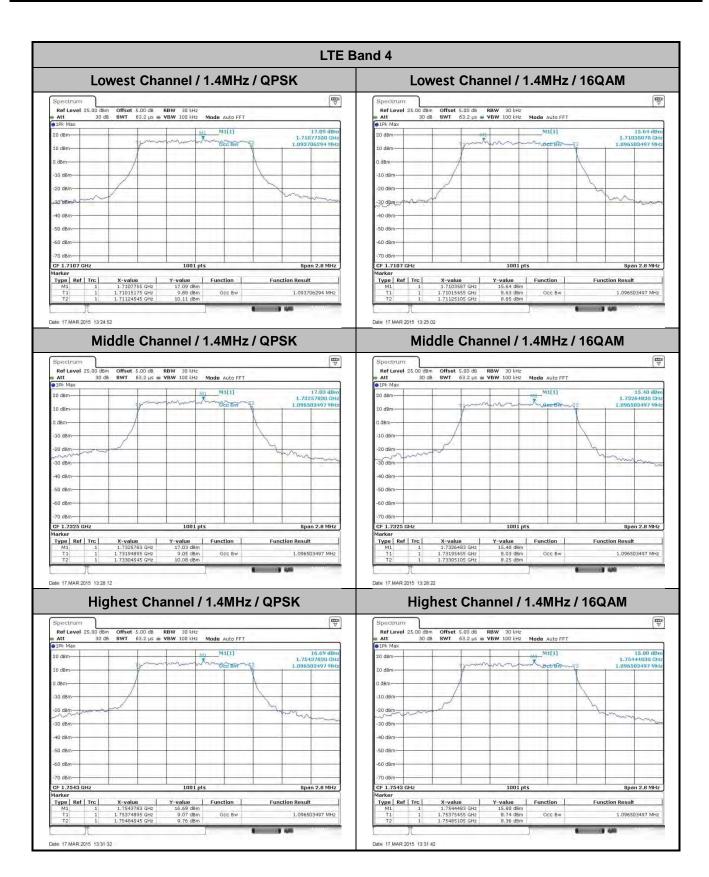


Page Number : A75 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

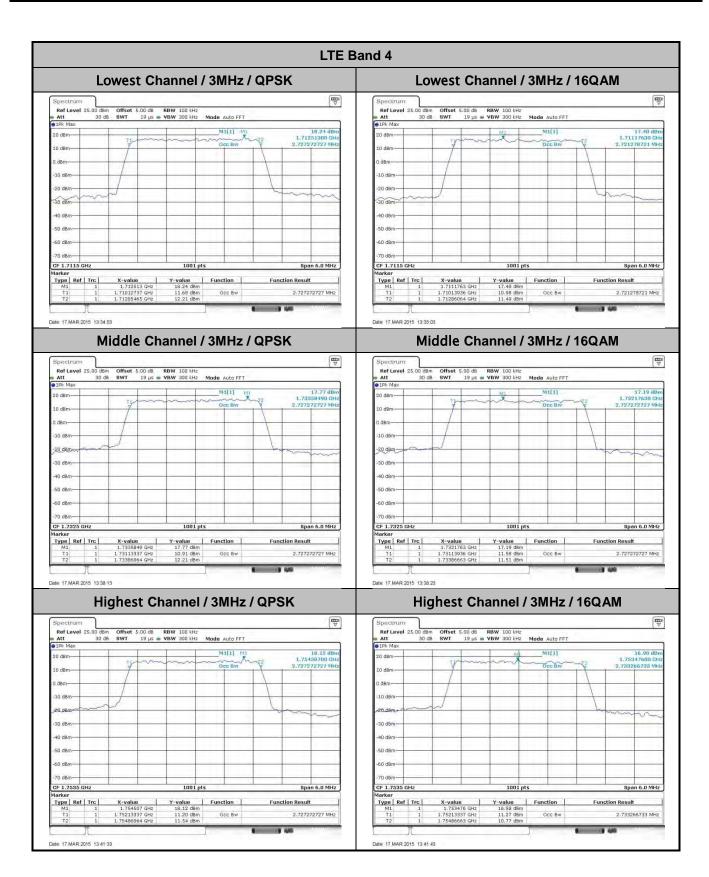


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A76 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

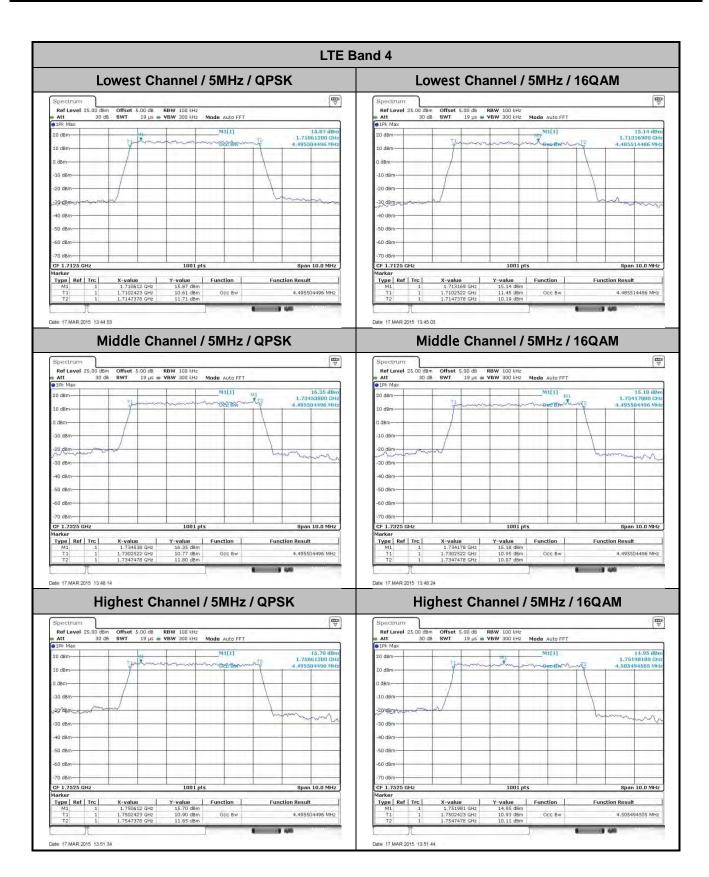

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A77 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

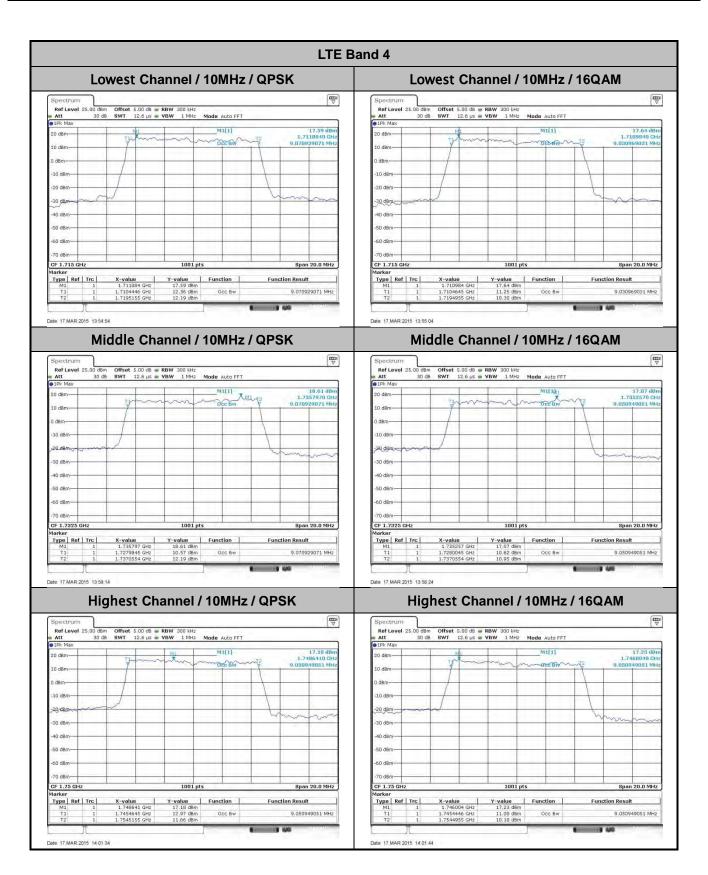

Page Number : A78 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

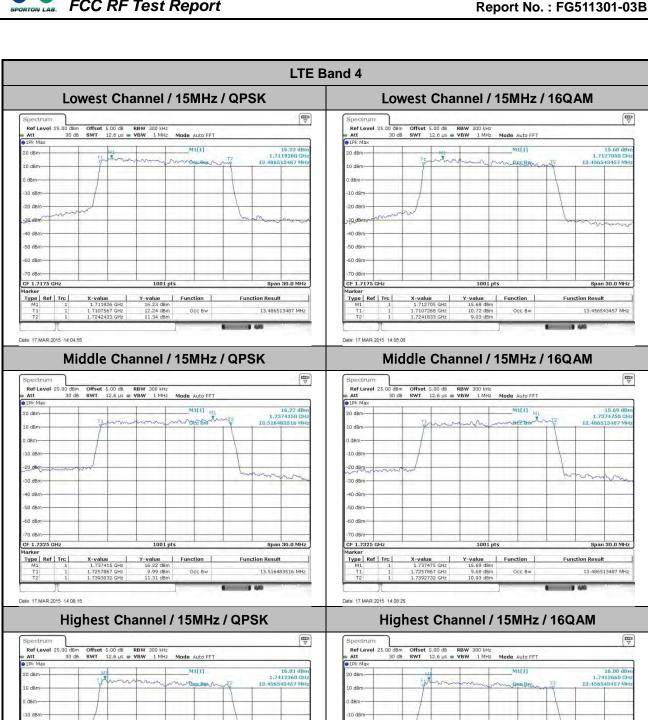

20 dBm-30 dBm -50 dBm

70 dBm

CF 1.7475 GHz

Type | Ref | Trc |

Date: 17 MAR 2015 14:11:45

Span 30.0 MHz

13.456543457 MHz

SPORTON INTERNATIONAL (KUNSHAN) INC.

 X-volue
 Y-value
 Function
 Function Result

 1.741236 GHz
 1.6.81 dBm
 1.7407268 GHz
 1.6.81 dBm

 1.7407256 GHz
 11.42 dBm
 Occ 8w
 13.456843

 1.7541839 GHz
 9.49 dBm
 Occ 8w
 13.456843

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002

50 dBm

CF 1.7475 GHz

Type | Ref | Trc |

Date: 17 MAR 2015 14:11:35


Page Number : A79 of A191 Report Issued Date: Apr. 17, 2015 Report Version : Rev. 01

Span 30.0 MHz

13.456543457 MHz

Function Result


1001 pts

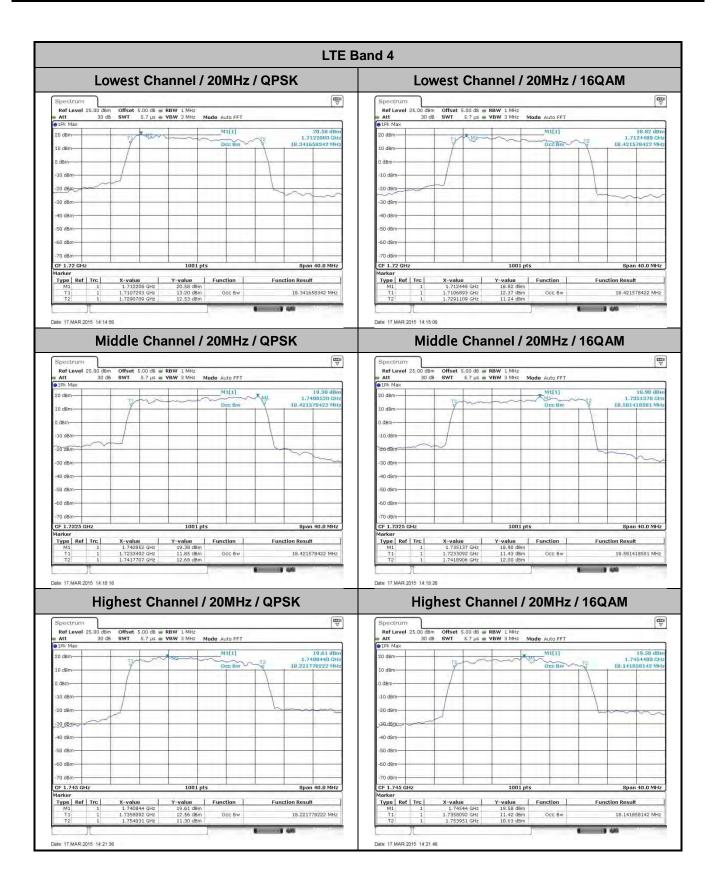


Page Number : A80 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01




TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A81 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

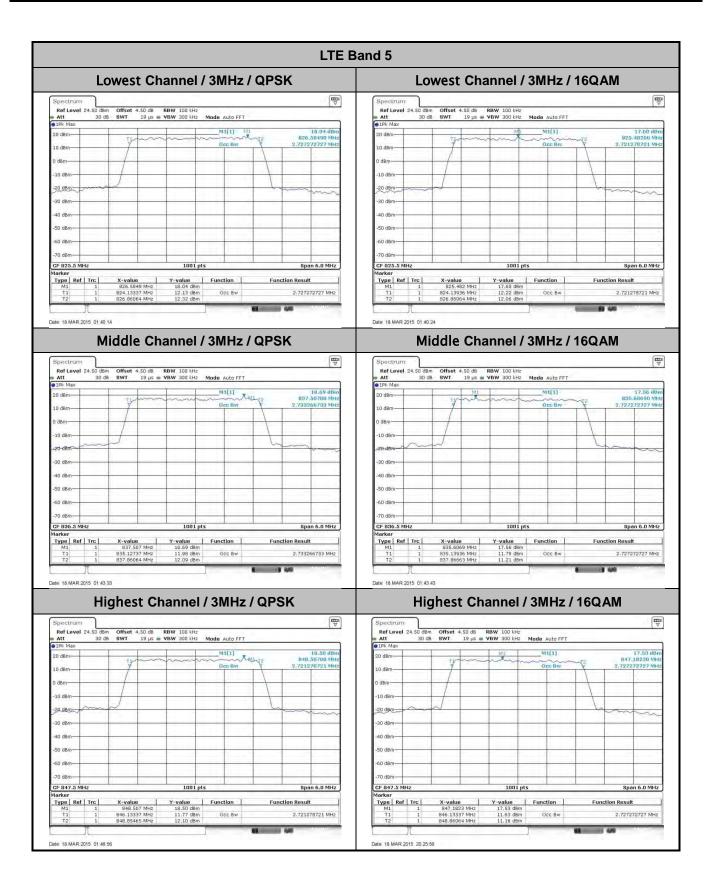


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A82 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

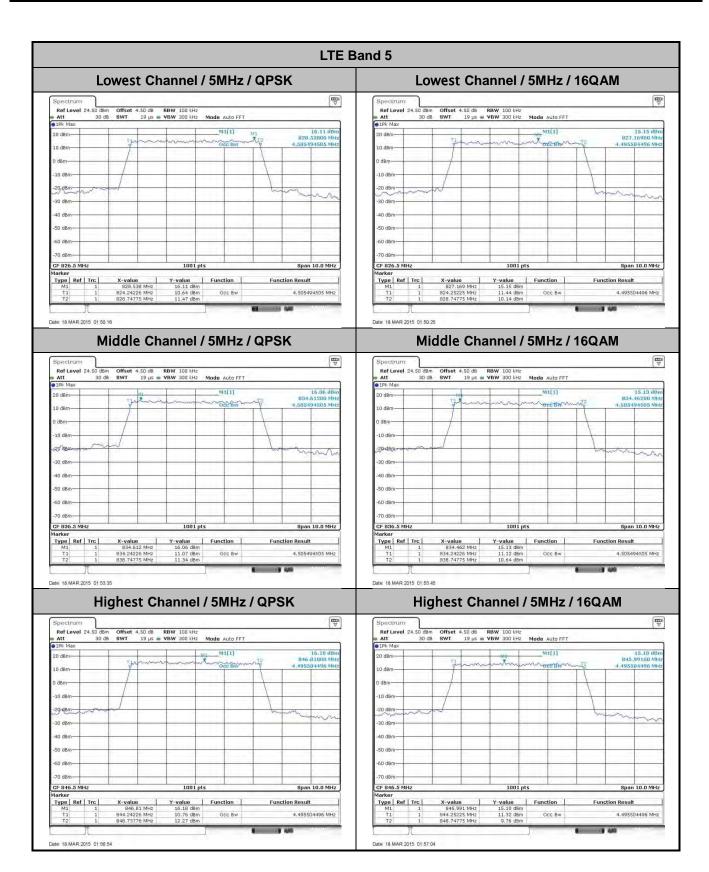


Page Number : A83 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

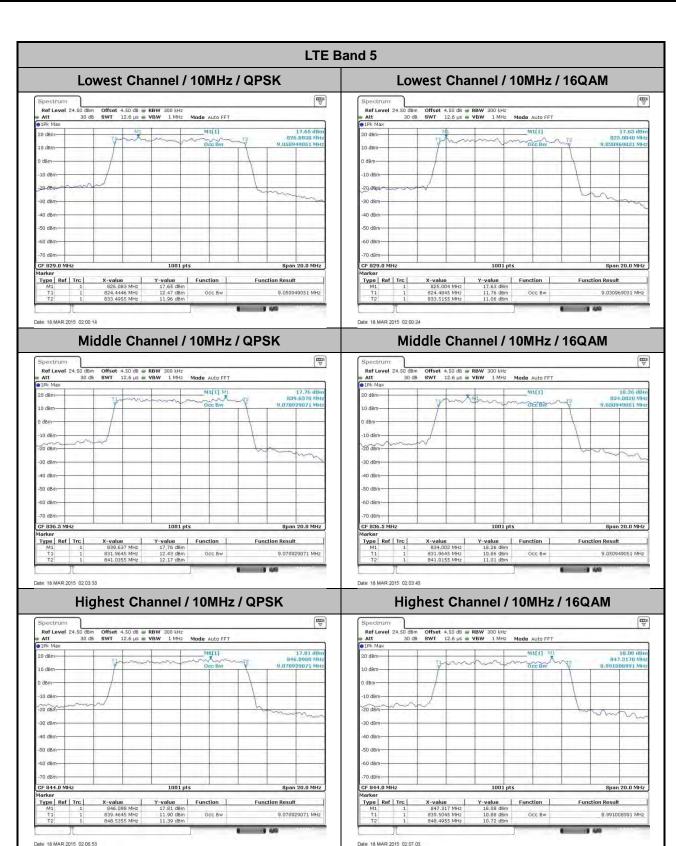


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A84 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

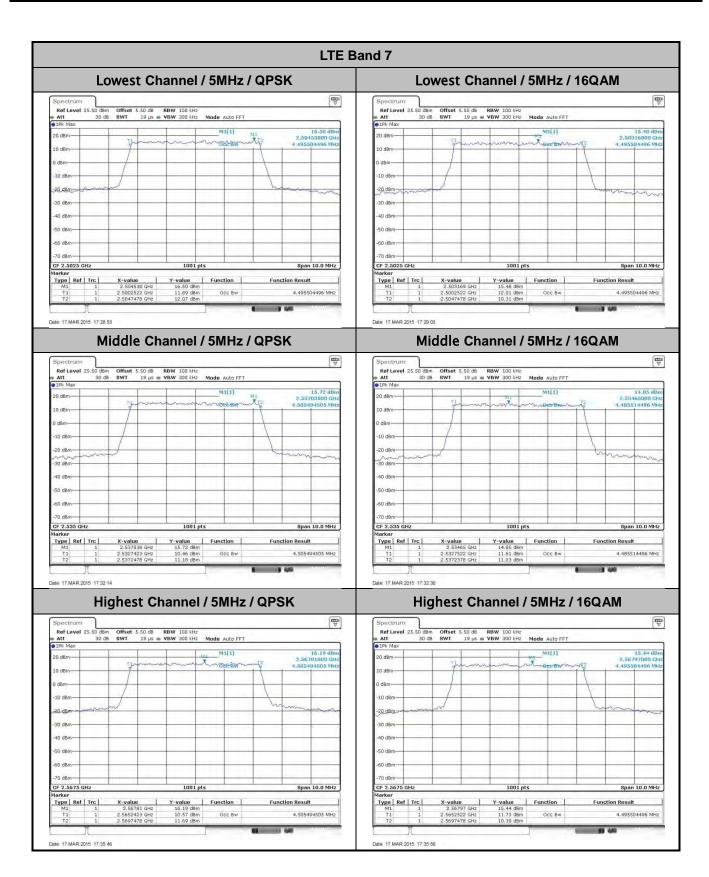

Page Number : A85 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

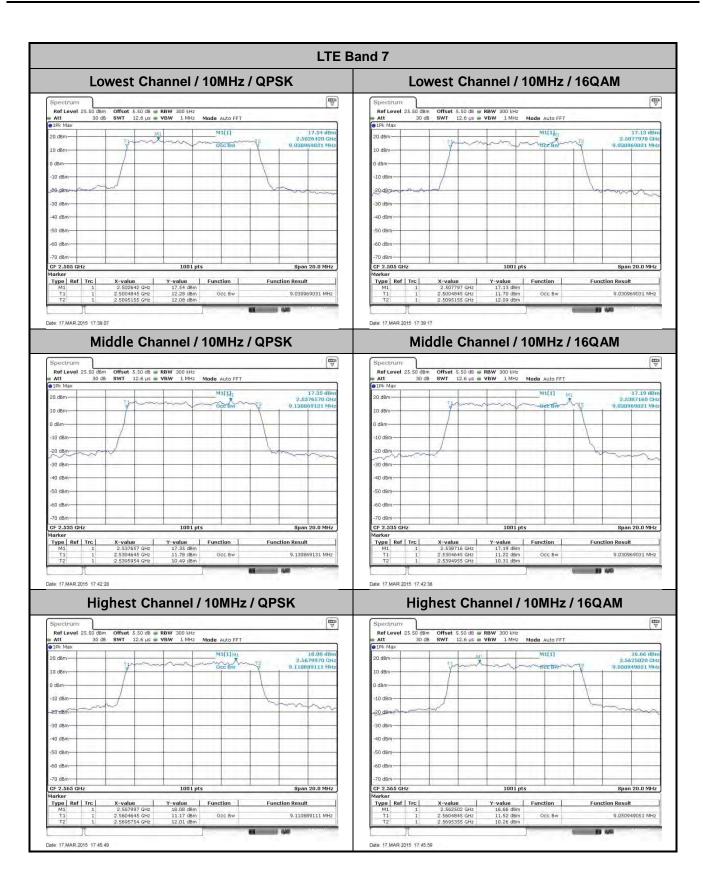

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A86 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

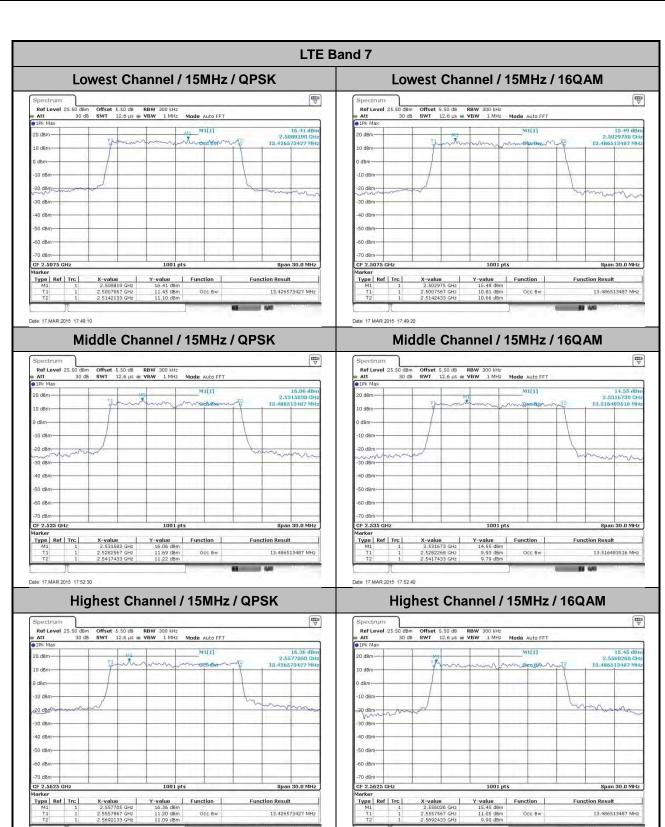


Date: 17.MAR 2015 17:56:01


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002

Date: 17 MAR 2015 17 55 51

Page Number : A87 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

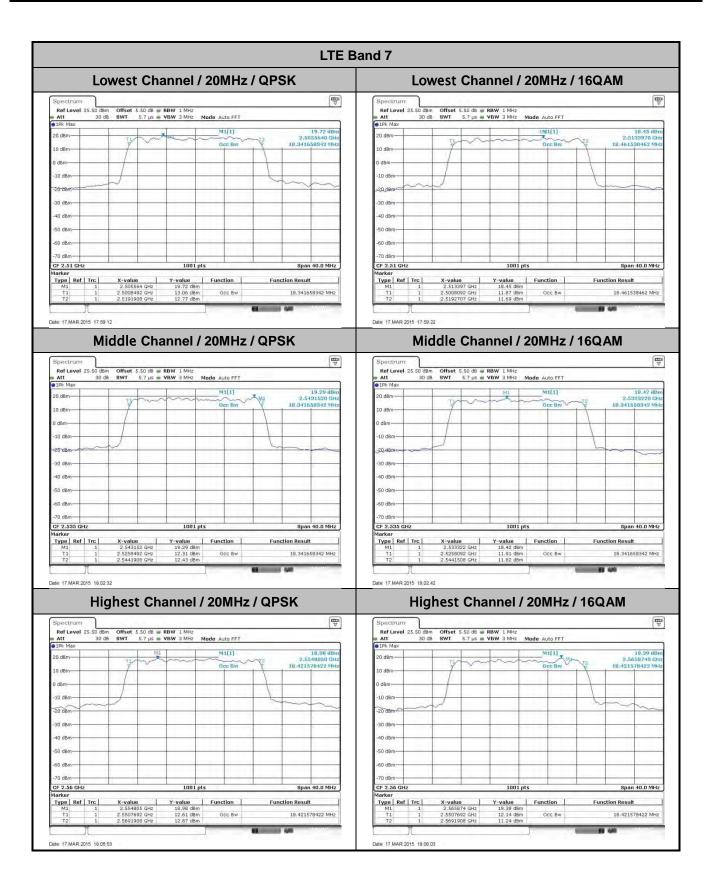

Page Number : A88 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

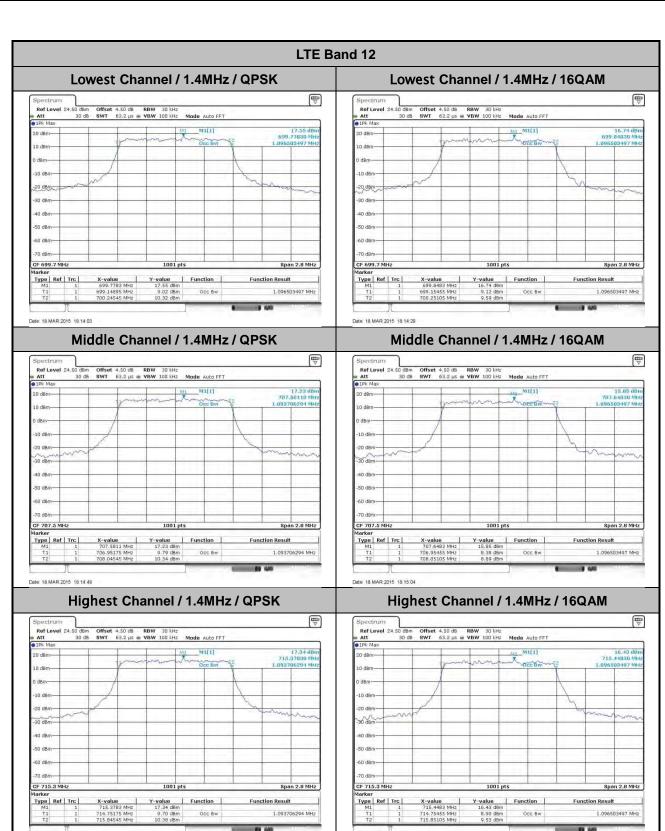


Date: 18 MAR 2015 18 15 47

SPORTON INTERNATIONAL (KUNSHAN) INC.


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002

Date: 18 MAR 2015 18 15 36


Page Number : A89 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

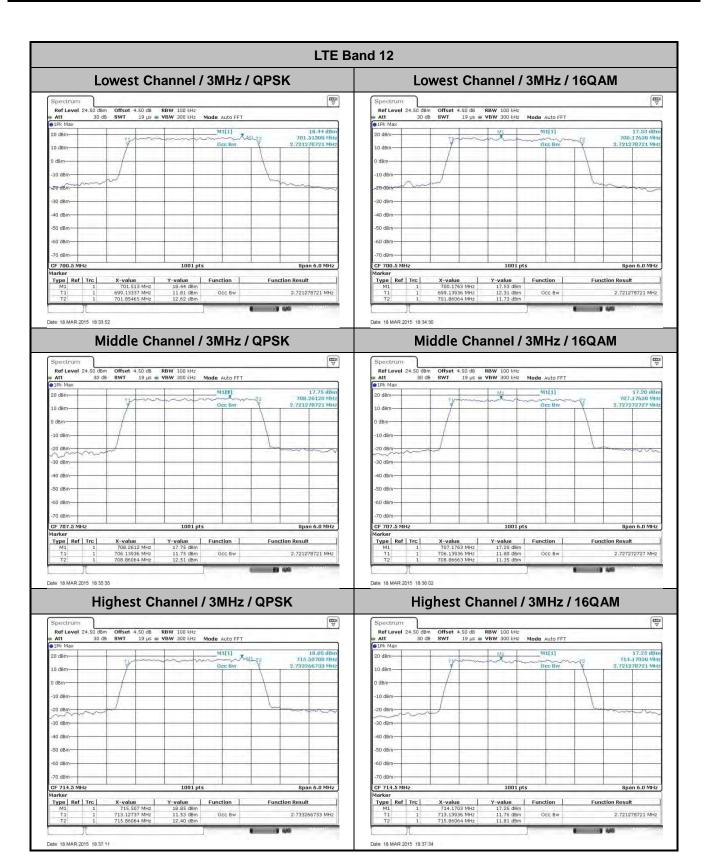


Page Number : A90 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

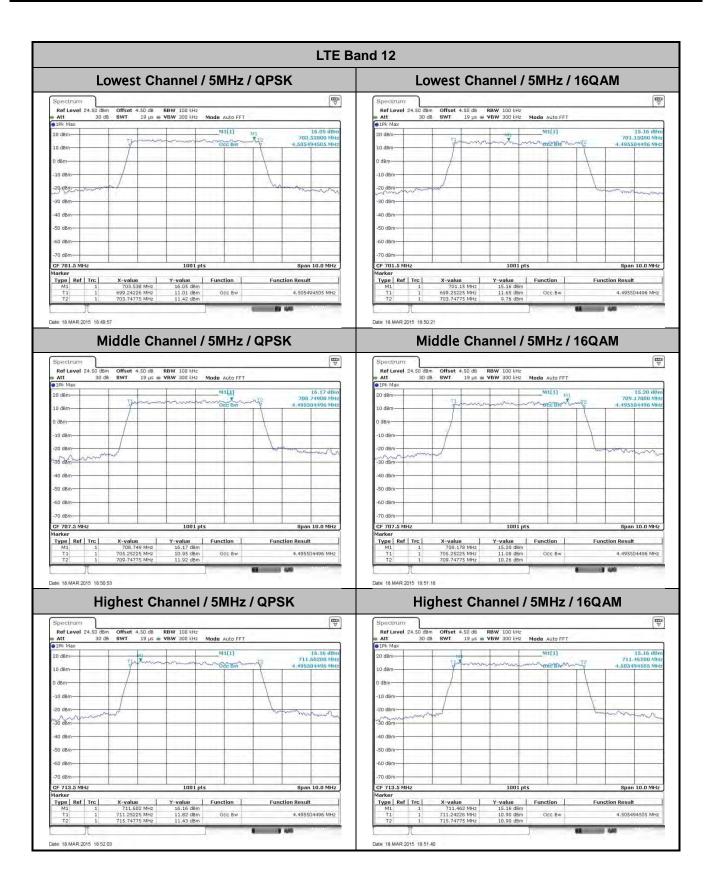


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A91 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

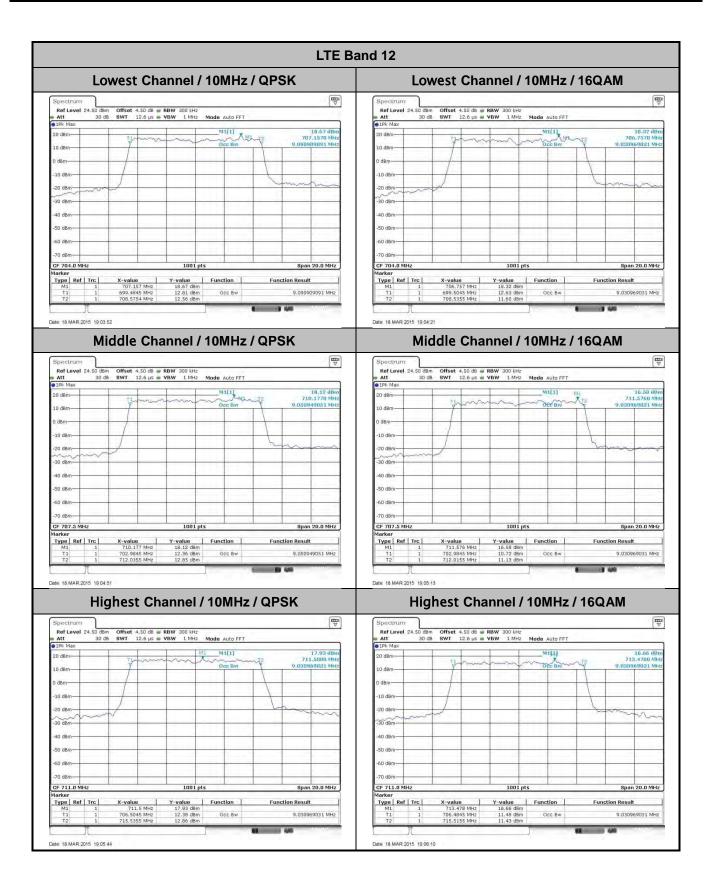

Page Number : A92 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

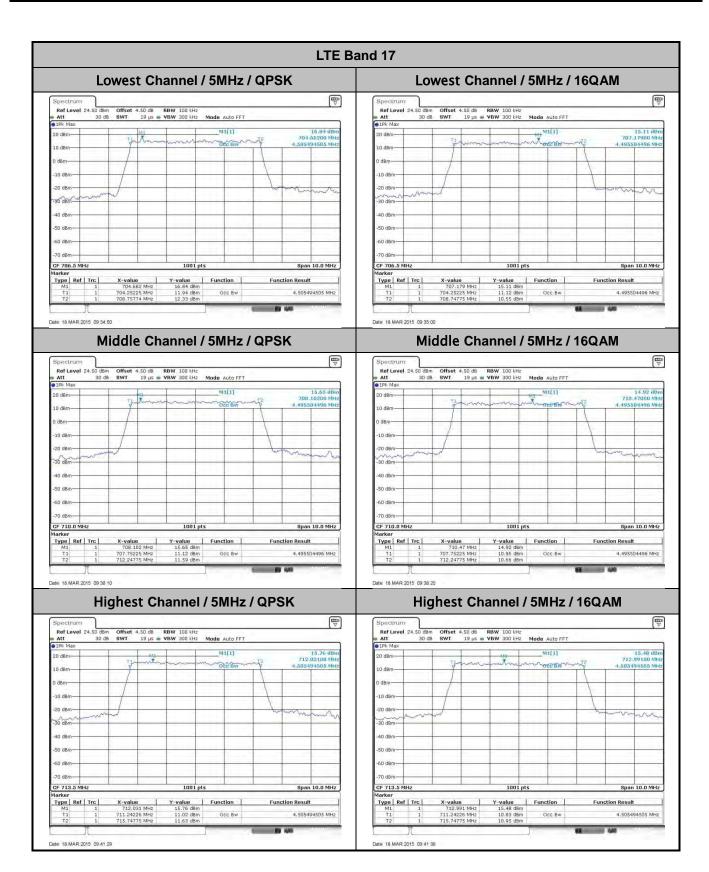

Page Number : A93 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01

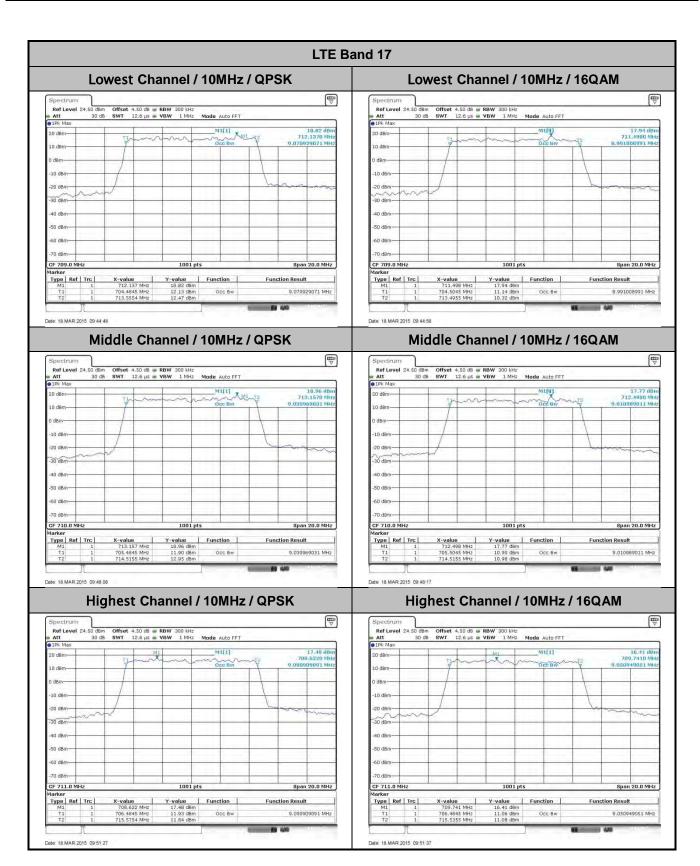

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: 2ACCJN002 Page Number : A94 of A191
Report Issued Date : Apr. 17, 2015
Report Version : Rev. 01