



TEL: +86-512-57900158 FAX: +86-512-57900958 FCCID: 2AFZZ-RMSC3CH Page Number : A255 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

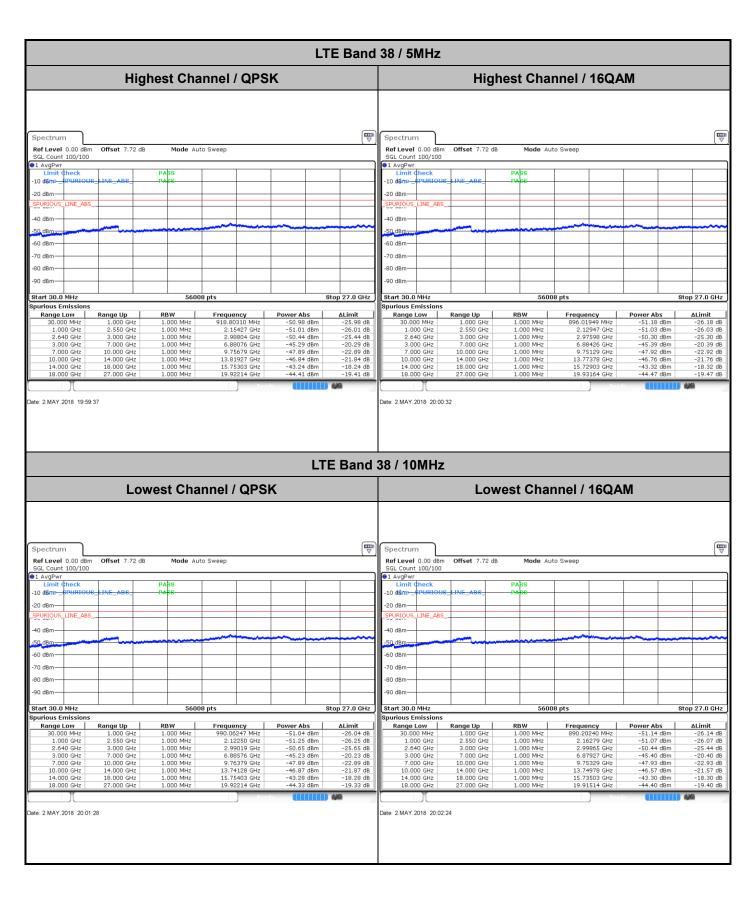


TEL: +86-512-57900158 FAX: +86-512-57900958 FCCID: 2AFZZ-RMSC3CH Page Number : A256 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

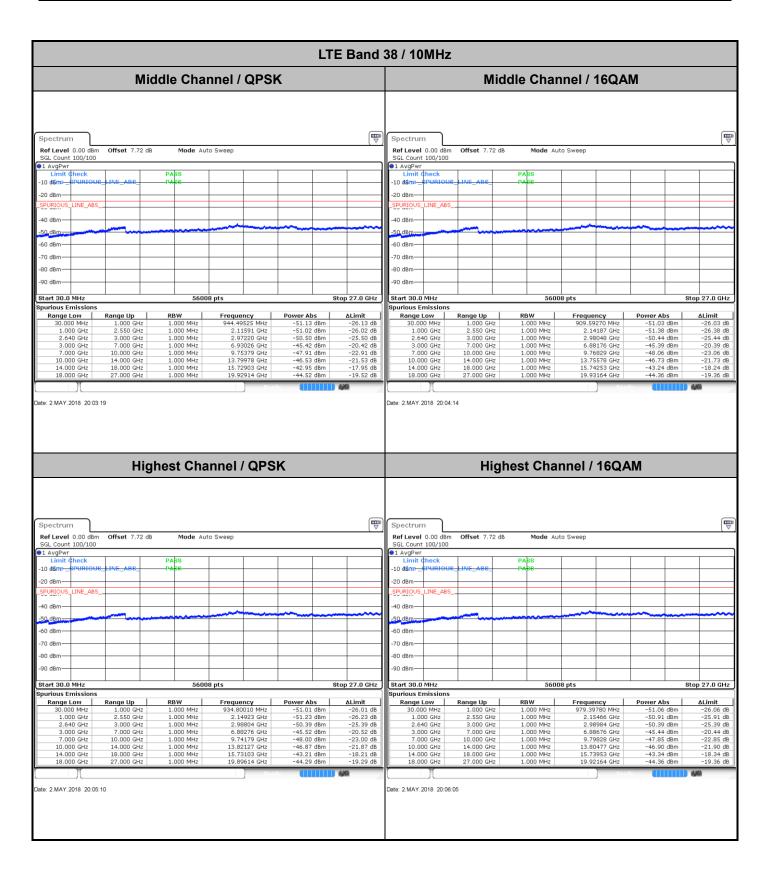


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A257 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

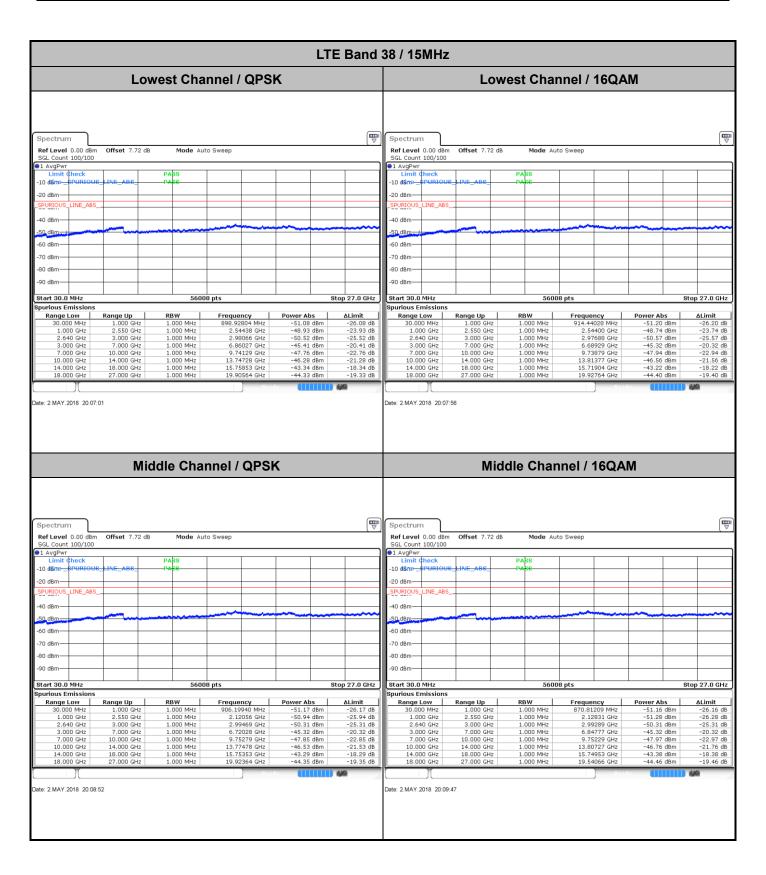

TEL: +86-512-57900158 FAX: +86-512-57900958 FCCID: 2AFZZ-RMSC3CH Page Number : A258 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

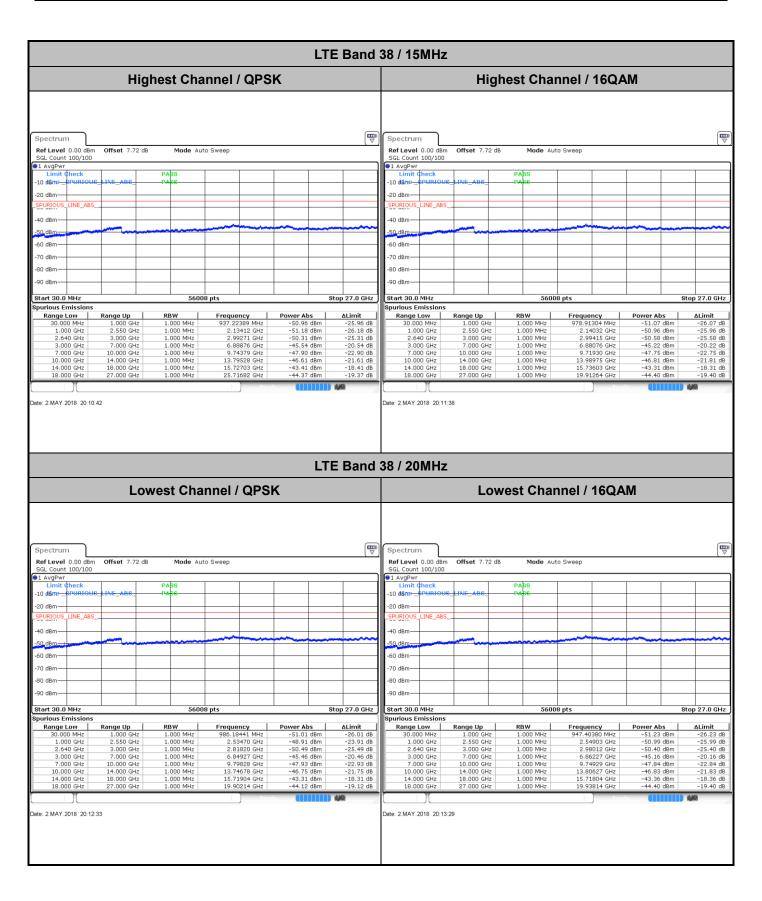


TEL: +86-512-57900158 FAX: +86-512-57900958 FCCID: 2AFZZ-RMSC3CH Page Number : A259 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0




TEL: +86-512-57900158 FAX: +86-512-57900958 FCCID: 2AFZZ-RMSC3CH Page Number : A260 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

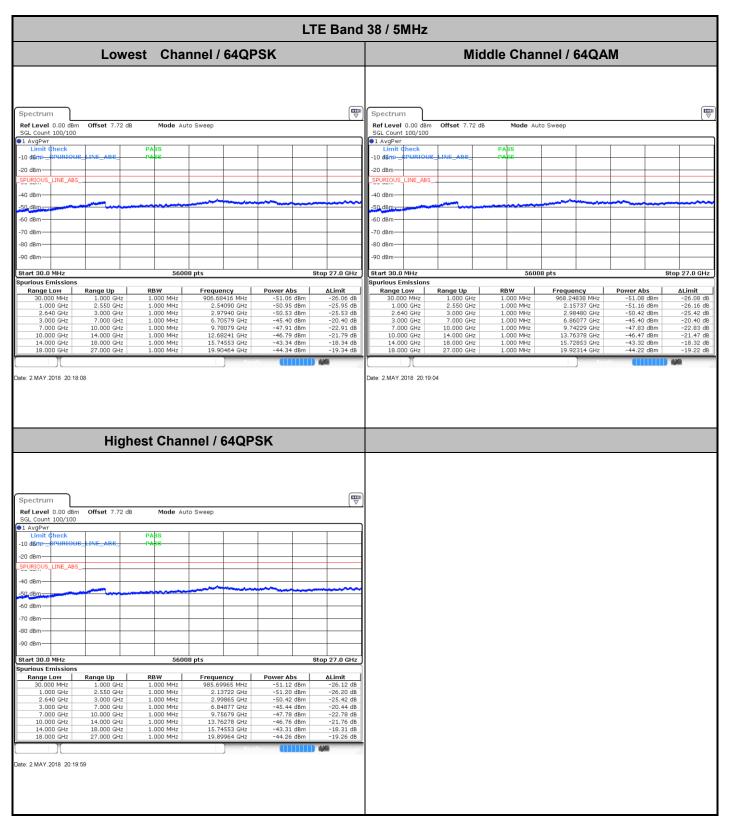


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A261 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

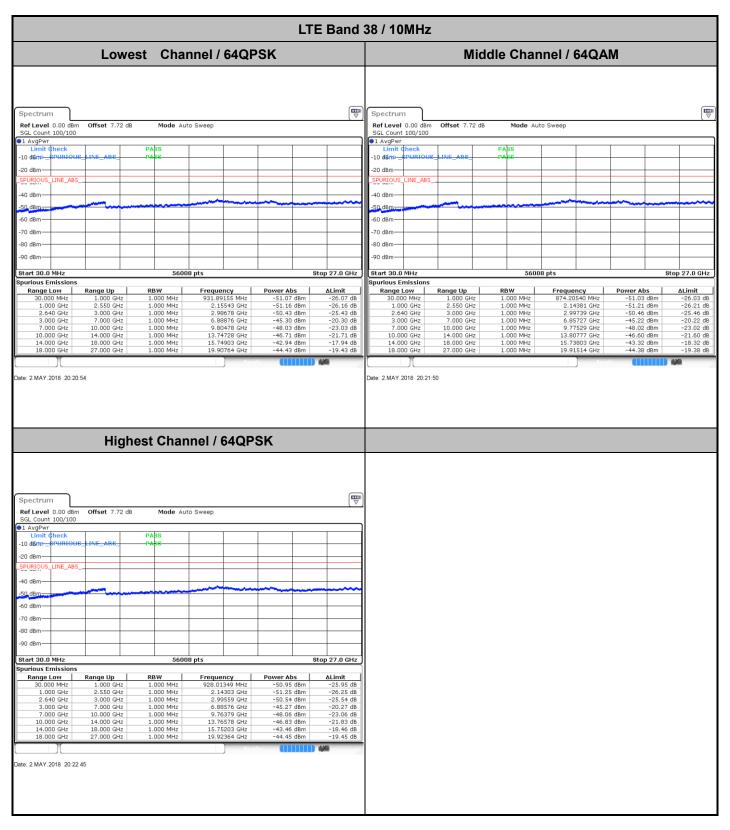

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A262 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01


Report Template No.: BU5-FGLTE Version 2.0

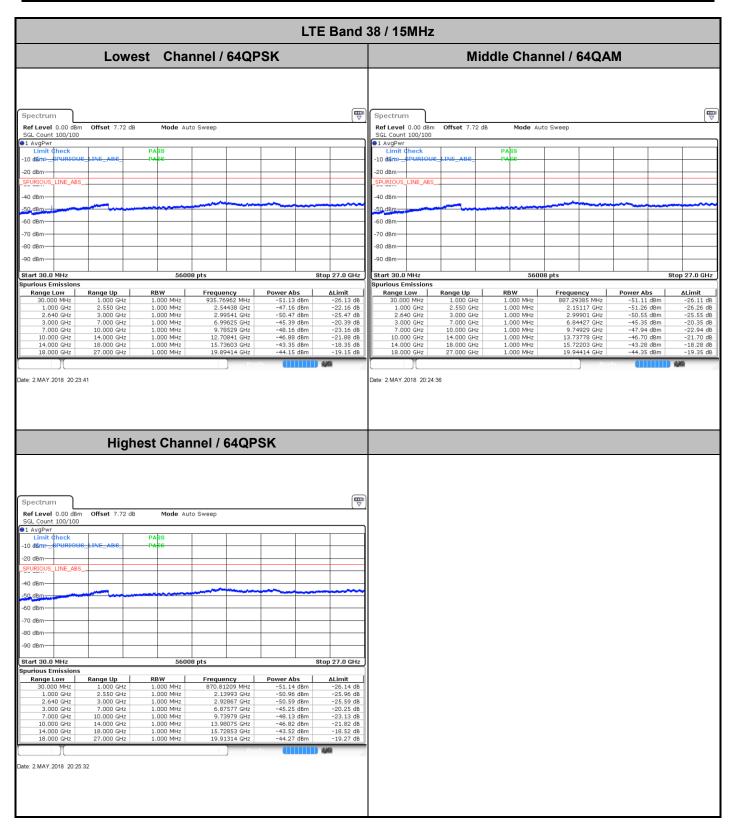

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A263 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report No.: FG841616B

Report Template No.: BU5-FGLTE Version 2.0

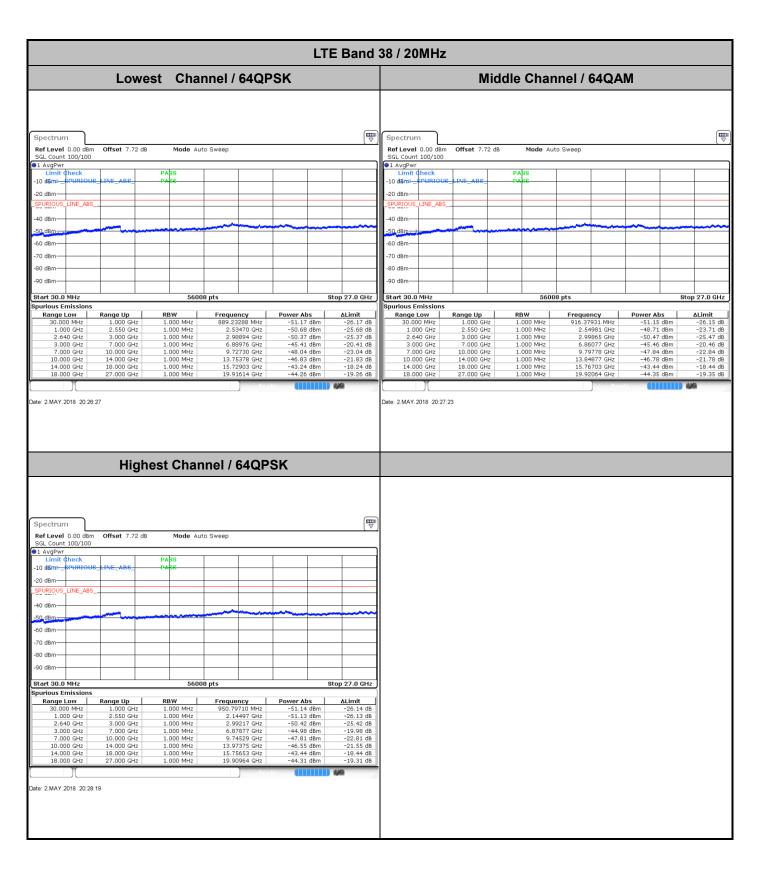

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A264 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Frequency Stability

Test (Conditions	LTE Band 2 (QPSK) / Middle Channel	Limit	
_		BW 10MHz	Note 2.	
Temperature (°C)	Voltage (Volt)	Deviation (ppm)	Result	
50	Normal Voltage	0.0069		
40	Normal Voltage	0.0032		
30	Normal Voltage	0.0096		
20(Ref.)	Normal Voltage	0.0000		
10	Normal Voltage	0.0122		
0	Normal Voltage	0.0149		
-10	Normal Voltage	0.0021	PASS	
-20	Normal Voltage	0.0101		
-30	Normal Voltage	0.0165		
20	Maximum Voltage	0.0048		
20	Normal Voltage	0.0011		
20	Battery End Point	0.0144		

Note:

- 1. Normal Voltage =3.85 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.4 V.
- 2. Note: The frequency fundamental emissions stay within the authorized frequency block.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A265 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Test (Conditions	LTE Band 4 (QPSK) / Middle Channel	Limit
		BW 10MHz	Note 2.
Temperature (°C)	Voltage (Volt)	Deviation (ppm)	Result
50	Normal Voltage	0.0033	
40	Normal Voltage	0.0027	
30	Normal Voltage	0.0014	
20(Ref.)	Normal Voltage	0.0000	
10	Normal Voltage	0.0031	
0	Normal Voltage	0.0025	
-10	Normal Voltage	0.0006	PASS
-20	Normal Voltage	0.0021	
-30	Normal Voltage	0.0009	
20	Maximum Voltage	0.0010	
20	Normal Voltage	0.0028	
20	Battery End Point	0.0005	

Note:

- 1. Normal Voltage =3.85 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.4 V.
- 2. Note: The frequency fundamental emissions stay within the authorized frequency block.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A266 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Test (Conditions	LTE Band 5 (QPSK) / Middle Channel	Limit
_ ,		BW 10MHz	2.5ppm
Temperature (°C)	Voltage (Volt)	Deviation (ppm)	Result
50	Normal Voltage	0.0143	
40	Normal Voltage	0.0084	
30	Normal Voltage	0.0287	
20(Ref.)	Normal Voltage	0.0000	
10	Normal Voltage	0.0406	
0	Normal Voltage	0.0466	
-10	Normal Voltage	0.0060	PASS
-20	Normal Voltage	0.0359	
-30	Normal Voltage	0.0454	
20	Maximum Voltage	0.0060	
20	Normal Voltage	0.0072	
20	Battery End Point	0.0383	

Note: Normal Voltage =3.85 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.4 V.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A267 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Test (Conditions	LTE Band 7 (QPSK) / Middle Channel	Limit
		BW 10MHz	Note 2.
Temperature (°C)	Voltage (Volt)	Deviation (ppm)	Result
50	Normal Voltage	0.0001	
40	Normal Voltage	0.0020	
30	Normal Voltage	0.0016	
20(Ref.)	Normal Voltage	0.0000	
10	Normal Voltage	0.0008	
0	Normal Voltage	0.0024	
-10	Normal Voltage	0.0011	PASS
-20	Normal Voltage	0.0004	
-30	Normal Voltage	0.0021	
20	Maximum Voltage	0.0016	
20	Normal Voltage	0.0011	
20	Battery End Point	0.0014	

Note:

- 1. Normal Voltage =3.85 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.4 V.
- 2. Note: The frequency fundamental emissions stay within the authorized frequency block.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : A268 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Test (Conditions	LTE Band 38 (QPSK) / Middle Channel	Limit
		BW 10MHz	Note 2.
Temperature (°C)	Voltage (Volt)	Deviation (ppm)	Result
50	Normal Voltage	0.0024	
40	Normal Voltage	0.0004	
30	Normal Voltage	0.0023	
20(Ref.)	Normal Voltage	0.0000	
10	Normal Voltage	0.0015	
0	Normal Voltage	0.0022	
-10	Normal Voltage	0.0021	PASS
-20	Normal Voltage	0.0003	
-30	Normal Voltage	0.0002	
20	Maximum Voltage	0.0015	
20	Normal Voltage	0.0005	
20	Battery End Point	0.0024	

Note:

- 1. Normal Voltage =3.85 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.4 V.
- 2. Note: The frequency fundamental emissions stay within the authorized frequency block.

Sporton International (Kunshan) Inc.

FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH

TEL: +86-512-57900158

Page Number : A269 of A269
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

Appendix B. Test Results of Radiated Test

Radiated Spurious Emission

	LTE Band 2 / 1.4MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3758.92	-64.81	-13	-51.81	-78.43	-72.39	5.02	12.60	Н				
	5638.38	-60.95	-13	-47.95	-77.55	-66.75	7.30	13.10	Н				
Middle	7517.84	-62.55	-13	-49.55	-82.53	-66.12	7.73	11.30	Н				
ivildale	3758.92	-62.82	-13	-49.82	-77.15	-70.40	5.02	12.60	V				
	5638.38	-62.95	-13	-49.95	-79.48	-68.75	7.30	13.10	V				
	7517.84	-62.98	-13	-49.98	-82.62	-66.55	7.73	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 2 / 3MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3757.48	-64.77	-13	-51.77	-78.39	-72.35	5.02	12.60	Н				
	5636.22	-60.89	-13	-47.89	-77.49	-66.69	7.30	13.10	Н				
Middle	7514.96	-62.39	-13	-49.39	-82.37	-65.96	7.73	11.30	Н				
Middle	3757.48	-62.82	-13	-49.82	-77.15	-70.40	5.02	12.60	V				
	5636.22	-62.44	-13	-49.44	-78.97	-68.24	7.30	13.10	V				
	7514.96	-62.64	-13	-49.64	-82.28	-66.21	7.73	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 2 / 5MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3755.68	-65.53	-13	-52.53	-79.15	-73.11	5.02	12.60	Н				
	5633.52	-61.47	-13	-48.47	-78.07	-67.27	7.30	13.10	Н				
Middle	7511.36	-62.46	-13	-49.46	-82.44	-66.03	7.73	11.30	Н				
Middle	3755.68	-62.91	-13	-49.91	-77.24	-70.49	5.02	12.60	V				
	5633.52	-63.65	-13	-50.65	-80.18	-69.45	7.30	13.10	V				
	7511.36	-62.25	-13	-49.25	-81.89	-65.82	7.73	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B1 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 2 / 10MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3751.18	-64.60	-13	-51.60	-78.22	-72.18	5.02	12.60	Н				
	5626.77	-61.08	-13	-48.08	-77.68	-66.88	7.30	13.10	Н				
Middle	7502	-62.41	-13	-49.41	-82.39	-65.98	7.73	11.30	Н				
Middle	3751.18	-62.40	-13	-49.40	-76.73	-69.98	5.02	12.60	V				
	5626.77	-61.23	-13	-48.23	-77.76	-67.03	7.30	13.10	V				
	7502	-62.80	-13	-49.80	-82.44	-66.37	7.73	11.30	V				

	LTE Band 2 / 15MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3746.68	-63.57	-13	-50.57	-77.19	-71.15	5.02	12.60	Н				
	5620.02	-59.78	-13	-46.78	-76.38	-65.58	7.30	13.10	Н				
Middle	7493.36	-62.97	-13	-49.97	-82.95	-66.54	7.73	11.30	Н				
Middle	3746.68	-61.12	-13	-48.12	-75.45	-68.70	5.02	12.60	V				
	5620.02	-62.00	-13	-49.00	-78.53	-67.80	7.30	13.10	V				
	7493.36	-63.29	-13	-50.29	-82.93	-66.86	7.73	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 2 / 20MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3742.18	-64.43	-13	-51.43	-78.05	-72.01	5.02	12.60	Н				
	5613.27	-60.40	-13	-47.40	-77.00	-66.20	7.30	13.10	Н				
Middle	7484.36	-64.00	-13	-51.00	-83.98	-67.57	7.73	11.30	Н				
Middle	3742.18	-61.32	-13	-48.32	-75.65	-68.90	5.02	12.60	V				
	5613.27	-63.30	-13	-50.30	-79.83	-69.10	7.30	13.10	V				
	7484.36	-63.98	-13	-50.98	-83.62	-67.55	7.73	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B2 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 4 / 1.4MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3463.74	-52.58	-13	-39.58	-72.19	-60.33	4.85	12.60	Н				
	5195.61	-56.92	-13	-43.92	-80.37	-64.44	5.58	13.10	Н				
Middle	6927.48	-57.57	-13	-44.57	-81.09	-62.31	6.56	11.30	Н				
Middle	3463.74	-50.50	-13	-37.50	-70.89	-58.25	4.85	12.60	V				
	5195.61	-57.52	-13	-44.52	-81.57	-65.04	5.58	13.10	V				
	6927.48	-57.61	-13	-44.61	-81.15	-62.35	6.56	11.30	V				

	LTE Band 4 / 3MHz / QPSK													
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)					
	3462.48	-52.02	-13	-39.02	-71.63	-59.77	4.85	12.60	Н					
	5193.72	-79.86	-13	-66.86	-79.86	-87.38	5.58	13.10	Н					
Middle	6924.96	-57.90	-13	-44.90	-81.42	-62.64	6.56	11.30	Н					
Middle	3462.48	-51.80	-13	-38.80	-72.19	-59.55	4.85	12.60	V					
	5193.72	-57.15	-13	-44.15	-81.2	-64.67	5.58	13.10	V					
	6924.96	-57.86	-13	-44.86	-81.4	-62.60	6.56	11.30	V					

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 4 / 5MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3460.68	-51.30	-13	-38.30	-70.91	-59.05	4.85	12.60	Н				
	5191.02	-55.37	-13	-42.37	-78.82	-62.89	5.58	13.10	Н				
Middle	6921.36	-57.98	-13	-44.98	-81.50	-62.72	6.56	11.30	Н				
Middle	3460.68	-50.44	-13	-37.44	-70.83	-58.19	4.85	12.60	V				
	5191.02	-57.43	-13	-44.43	-81.48	-64.95	5.58	13.10	V				
	6921.36	-58.10	-13	-45.10	-81.64	-62.84	6.56	11.30	V				

 $Remark: Spurious\ emissions\ within\ 30\text{-}1000MHz\ were\ found\ more\ than\ 20dB\ below\ limit\ line.$

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B3 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 4 / 10MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3456.18	-50.14	-13	-37.14	-69.75	-57.89	4.85	12.60	Н				
	5184.27	-56.14	-13	-43.14	-79.59	-63.66	5.58	13.10	Н				
Middle	6912.36	-58.06	-13	-45.06	-81.58	-62.80	6.56	11.30	Н				
Middle	3456.18	-49.12	-13	-36.12	-69.51	-56.87	4.85	12.60	V				
	5184.27	-57.13	-13	-44.13	-81.18	-64.65	5.58	13.10	V				
	6912.36	-57.64	-13	-44.64	-81.18	-62.38	6.56	11.30	V				

	LTE Band 4 / 15MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3451.68	-50.18	-13	-37.18	-69.79	-57.93	4.85	12.60	Н				
	5177.52	-56.51	-13	-43.51	-79.96	-64.03	5.58	13.10	Н				
Middle	6903.36	-58.05	-13	-45.05	-81.57	-62.79	6.56	11.30	Н				
Middle	3451.68	-50.39	-13	-37.39	-70.78	-58.14	4.85	12.60	V				
	5177.52	-57.13	-13	-44.13	-81.18	-64.65	5.58	13.10	V				
	6903.36	-57.63	-13	-44.63	-81.17	-62.37	6.56	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 4 / 20MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	3447.18	-52.26	-13	-39.26	-71.87	-60.01	4.85	12.60	Н				
	5170.77	-55.95	-13	-42.95	-79.40	-63.47	5.58	13.10	Н				
Middle	6894.36	-58.05	-13	-45.05	-81.57	-62.79	6.56	11.30	Н				
Middle	3447.18	-53.39	-13	-40.39	-73.78	-61.14	4.85	12.60	V				
	5170.77	-55.85	-13	-42.85	-79.9	-63.37	5.58	13.10	V				
	6894.36	-57.63	-13	-44.63	-81.17	-62.37	6.56	11.30	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B4 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 5 / 1.4MHz / QPSK												
Channel	Frequency (MHz)	ERP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	1671.74	-67.53	-13	-54.53	-73.09	-71.94	2.84	9.40	Н				
	2507.61	-68.29	-13	-55.29	-78.71	-73.04	3.7	10.60	Н				
Middle	3343.48	-66.72	-13	-53.72	-81.48	-72.80	4.37	12.60	Н				
Middle	1671.74	-69.99	-13	-56.99	-74.70	-74.40	2.84	9.40	V				
	2507.61	-67.57	-13	-54.57	-77.40	-72.32	3.70	10.60	V				
	3343.48	-67.92	-13	-54.92	-81.49	-74.00	4.37	12.60	V				

	LTE Band 5 / 3MHz / QPSK												
Channel	Frequency (MHz)	ERP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	1670.3	-66.46	-13	-53.46	-72.02	-70.87	2.84	9.40	Н				
	2505.45	-67.35	-13	-54.35	-77.77	-72.10	3.7	10.60	Н				
N 4: al all a	3340.6	-66.29	-13	-53.29	-81.05	-72.37	4.37	12.60	Н				
Middle	1670.3	-68.03	-13	-55.03	-72.74	-72.44	2.84	9.40	V				
	2505.45	-66.42	-13	-53.42	-76.25	-71.17	3.70	10.60	V				
	3340.6	-67.73	-13	-54.73	-81.30	-73.81	4.37	12.60	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 5 / 5MHz / QPSK												
Channel	Frequency (MHz)	ERP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	1668.5	-67.06	-13	-54.06	-72.62	-71.47	2.84	9.40	Н				
	2502.75	-68.05	-13	-55.05	-78.47	-72.80	3.7	10.60	Н				
Middle	3337	-66.41	-13	-53.41	-81.17	-72.49	4.37	12.60	Н				
Middle	1668.5	-66.55	-13	-53.55	-71.26	-70.96	2.84	9.40	V				
	2502.75	-65.89	-13	-52.89	-75.72	-70.64	3.70	10.60	V				
	3337	-67.46	-13	-54.46	-81.03	-73.54	4.37	12.60	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B5 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 5 / 10MHz / QPSK												
Channel	Frequency (MHz)	ERP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	1664	-64.77	-13	-51.77	-70.33	-69.18	2.84	9.40	Н				
	2496	-66.89	-13	-53.89	-77.31	-71.64	3.7	10.60	Н				
Middle	3328	-66.24	-13	-53.24	-81.00	-72.32	4.37	12.60	Н				
Middle	1664	-66.08	-13	-53.08	-70.79	-70.49	2.84	9.40	V				
	2496	-66.16	-13	-53.16	-75.99	-70.91	3.70	10.60	V				
	3328	-67.52	-13	-54.52	-81.09	-73.60	4.37	12.60	V				

	LTE Band 7 / 5MHz / QPSK													
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)					
	5066	-59.45	-25	-34.45	-81.84	-67.21	4.94	12.70	Н					
	7599	-47.59	-25	-22.59	-74.49	-52.10	6.79	11.30	Н					
Middle	10131	-54.11	-25	-29.11	-83.29	-58.35	7.86	12.10	Н					
Middle	5066	-59.59	-25	-34.59	-81.37	-67.35	4.94	12.70	V					
	7599	-49.62	-25	-24.62	-76.5	-54.13	6.79	11.30	V					
	10131	-55.69	-25	-30.69	-82.85	-59.93	7.86	12.10	V					

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

	LTE Band 7 / 10MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	5061	-58.48	-25	-33.48	-80.87	-66.24	4.94	12.70	Н				
	7592	-48.52	-25	-23.52	-75.42	-53.03	6.79	11.30	Н				
N 4: -1 -11 -	10122	-53.99	-25	-28.99	-83.17	-58.23	7.86	12.10	Н				
Middle	5061	-59.56	-25	-34.56	-81.34	-67.32	4.94	12.70	V				
	7592	-49.94	-25	-24.94	-76.82	-54.45	6.79	11.30	V				
	10122	-56.15	-25	-31.15	-83.31	-60.39	7.86	12.10	V				

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B6 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

	LTE Band 7 / 15MHz / QPSK												
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)				
	5057	-59.46	-25	-34.46	-81.85	-67.22	4.94	12.70	Н				
	7585	-51.09	-25	-26.09	-77.99	-55.60	6.79	11.30	Н				
Middle	10113	-54.07	-25	-29.07	-83.25	-58.31	7.86	12.10	Н				
Middle	5057	-59.99	-25	-34.99	-81.77	-67.75	4.94	12.70	V				
	7585	-49.69	-25	-24.69	-76.57	-54.20	6.79	11.30	V				
	10113	-55.96	-25	-30.96	-83.12	-60.20	7.86	12.10	V				

	LTE Band 7 / 20MHz / QPSK										
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)		
	5052	-59.00	-25	-34.00	-81.39	-66.76	4.94	12.70	Н		
	7578	-52.17	-25	-27.17	-79.07	-56.68	6.79	11.30	Н		
Middle	10104	-54.15	-25	-29.15	-83.33	-58.39	7.86	12.10	Н		
Middle	5052	-59.52	-25	-34.52	-81.3	-67.28	4.94	12.70	V		
	7578	-52.48	-25	-27.48	-79.36	-56.99	6.79	11.30	V		
	10104	-56.74	-25	-31.74	-83.9	-60.98	7.86	12.10	V		

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

LTE Band 38 / 5MHz / QPSK										
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)	
	5186	-59.64	-25	-34.64	-82.03	-67.40	4.94	12.70	Н	
	7778	-42.86	-25	-17.86	-69.76	-47.37	6.79	11.30	Н	
Middle	10371	-54.28	-25	-29.28	-83.46	-58.52	7.86	12.10	Н	
Middle	5186	-60.33	-25	-35.33	-82.11	-68.09	4.94	12.70	V	
	7778	-52.92	-25	-27.92	-79.8	-57.43	6.79	11.30	V	
	10371	-55.60	-25	-30.60	-82.76	-59.84	7.86	12.10	V	

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B7 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0

LTE Band 38 / 10MHz / QPSK										
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)	
	5181	-59.75	-25	-34.75	-82.14	-67.51	4.94	12.70	Н	
	7772	-44.73	-25	-19.73	-71.63	-49.24	6.79	11.30	Н	
Middle	10362	-54.49	-25	-29.49	-83.67	-58.73	7.86	12.10	Н	
Middle	5181	-60.42	-25	-35.42	-82.2	-68.18	4.94	12.70	V	
	7772	-50.70	-25	-25.70	-77.58	-55.21	6.79	11.30	V	
	10362	-56.26	-25	-31.26	-83.42	-60.50	7.86	12.10	V	

	LTE Band 38 / 15MHz / QPSK										
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)		
	5177	-60.23	-25	-35.23	-82.62	-67.99	4.94	12.70	Н		
	7765	-46.21	-25	-21.21	-73.11	-50.72	6.79	11.30	Н		
Middle	10353	-54.46	-25	-29.46	-83.64	-58.70	7.86	12.10	Н		
ivildale	5177	-60.84	-25	-35.84	-82.62	-68.60	4.94	12.70	V		
	7765	-52.49	-25	-27.49	-79.37	-57.00	6.79	11.30	V		
	10353	-56.31	-25	-31.31	-83.47	-60.55	7.86	12.10	V		

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

LTE Band 38 / 20MHz / QPSK										
Channel	Frequency (MHz)	EIRP (dBm)	Limit (dBm)	Over Limit (dB)	SPA Reading (dBm)	S.G. Power (dBm)	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)	
	5172	-60.11	-25	-35.11	-82.50	-67.87	4.94	12.70	Н	
	7758	-43.22	-25	-18.22	-70.12	-47.73	6.79	11.30	Н	
Middle	10344	-54.44	-25	-29.44	-83.62	-58.68	7.86	12.10	Н	
	5172	-60.88	-25	-35.88	-82.66	-68.64	4.94	12.70	V	
	7758	-53.07	-25	-28.07	-79.95	-57.58	6.79	11.30	V	
	10344	-56.44	-25	-31.44	-83.6	-60.68	7.86	12.10	V	

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AFZZ-RMSC3CH Page Number : B8 of B8
Report Issued Date : Jun. 06, 2018
Report Version : Rev. 01

Report Template No.: BU5-FGLTE Version 2.0