



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A87 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

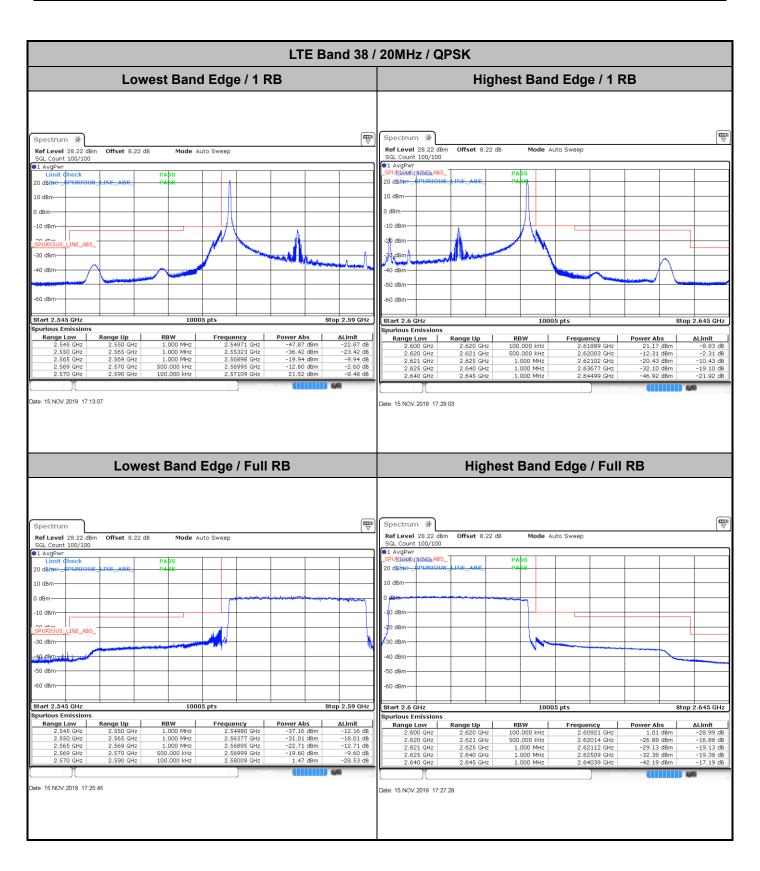


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A88 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

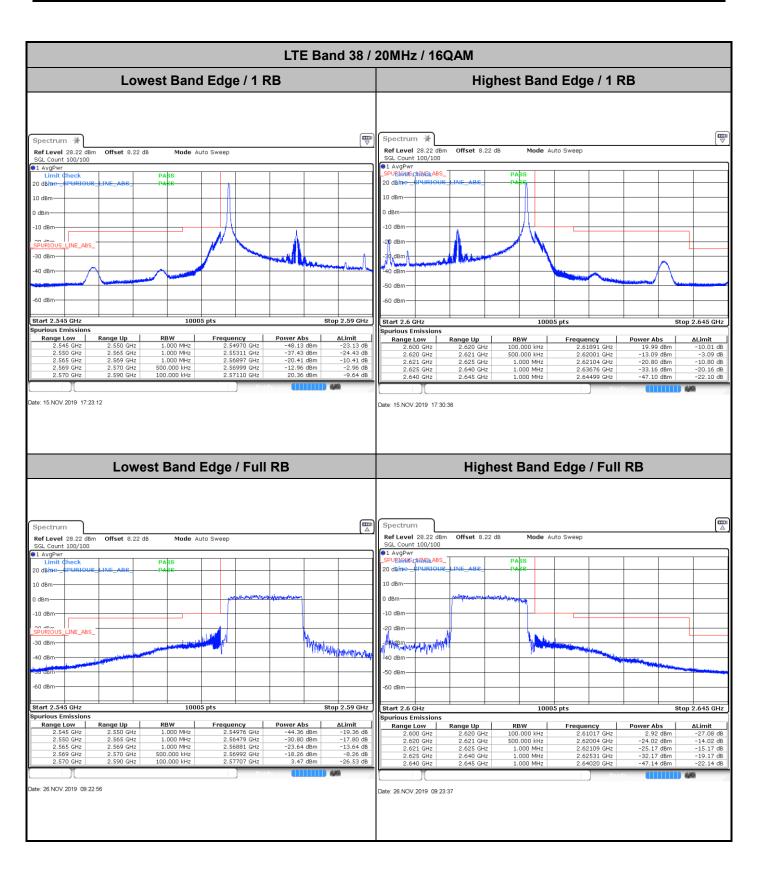


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A89 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

## **Conducted Spurious Emission**

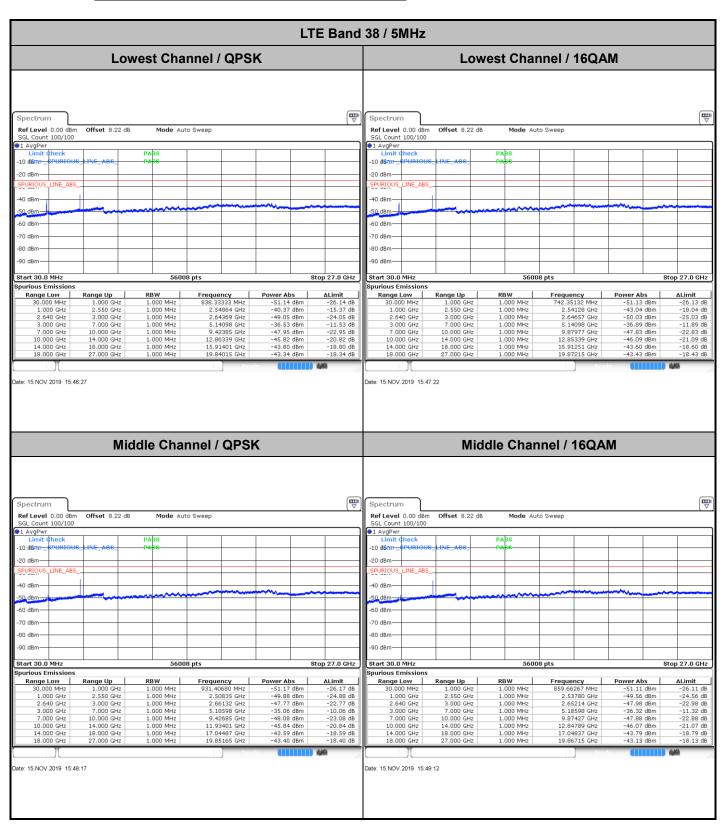


Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A90 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

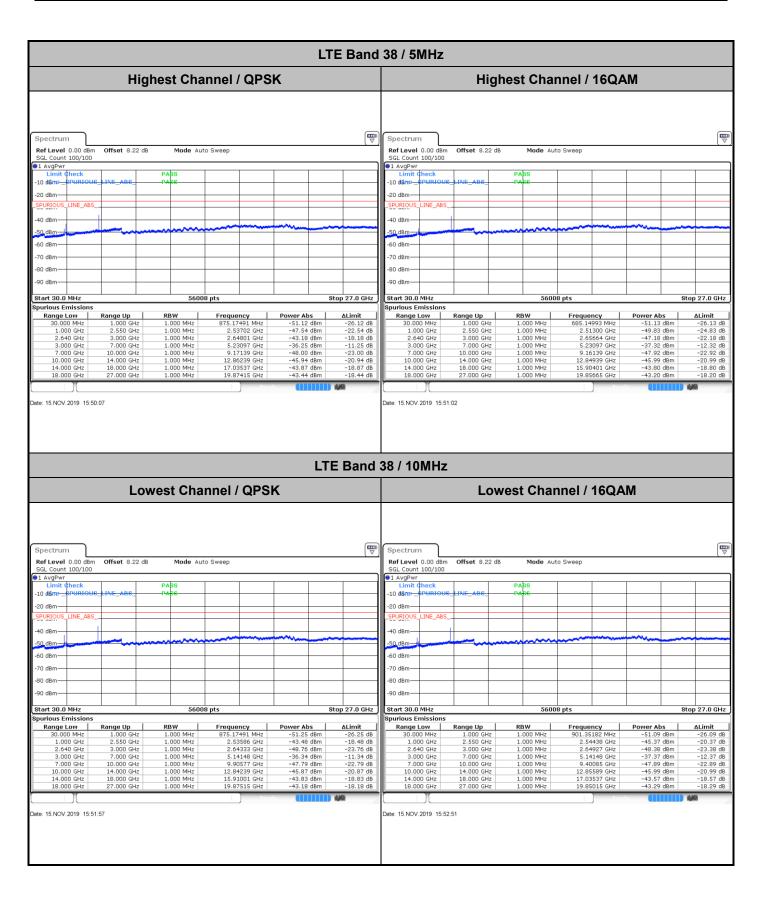


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A91 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

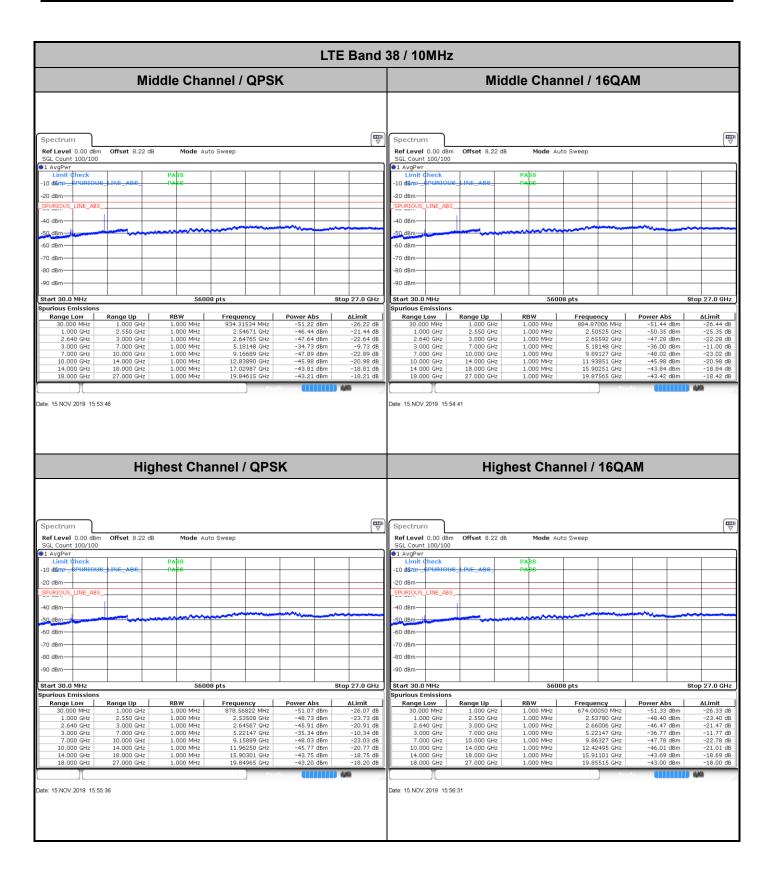


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A92 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

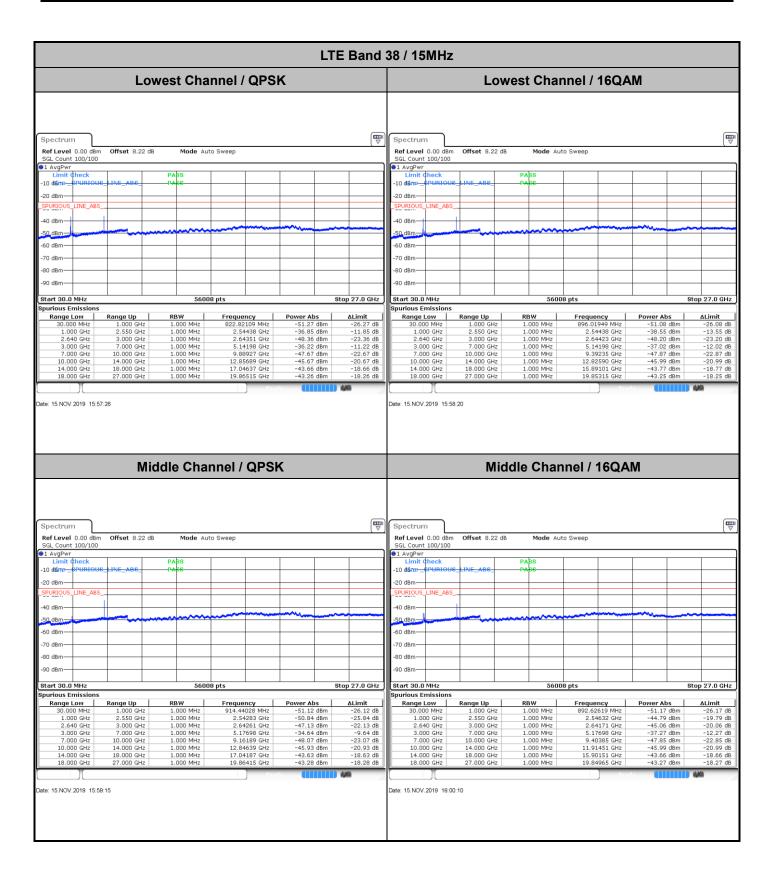

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A93 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

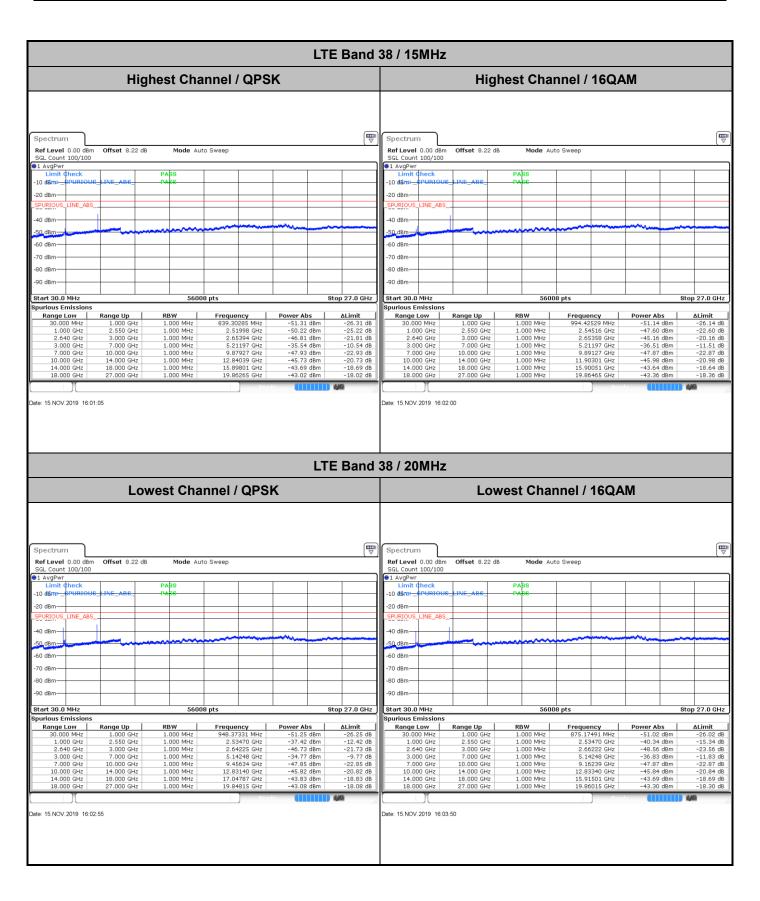

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A94 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

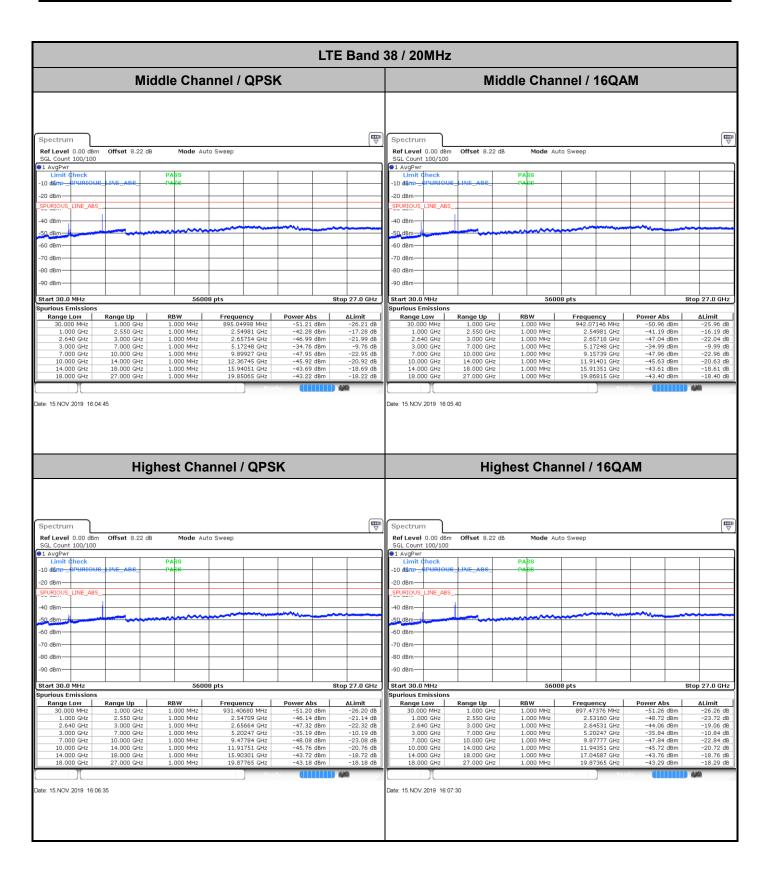

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A95 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

# Frequency Stability

Test Conditions		LTE Band 38 (QPSK) / Middle Channel		
Temperature (°C)		BW 10MHz	Note 2.	
	Voltage (Volt)	Deviation (ppm)	Result	
50	Normal Voltage	0.0032		
40	Normal Voltage	0.0024		
30	Normal Voltage	0.0041		
20(Ref.)	Normal Voltage	0.0000		
10	Normal Voltage	0.0025		
0	Normal Voltage	0.0036		
-10	Normal Voltage	0.0007	PASS	
-20	Normal Voltage	0.0010		
-30	Normal Voltage	0.0026		
20	Maximum Voltage	0.0012		
20	Normal Voltage	0.0030		
20	Battery End Point	0.0033		

#### Note:

- 1. Normal Voltage =3.9 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.2 V.
- **2.** Note: The frequency fundamental emissions stay within the authorized frequency block.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : A96 of A96
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

## **Appendix B. Test Results of Radiated Test**

## **Radiated Spurious Emission**

LTE Band 5 / 10MHz / QPSK								
Channel	Frequency ( MHz )	ERP ( dBm )	Limit ( dBm )	Over Limit ( dB )	S.G. Power ( dBm )	TX Cable loss ( dB )	TX Antenna Gain (dBi)	Polarization (H/V)
Middle	1664	-60.49	-13	-47.49	-67.46	1.58	10.70	Н
	2496	-54.38	-13	-41.38	-62.63	2.102	12.50	Н
	3330	-54.43	-13	-41.43	-63.32	2.856	13.90	Н
	4158	-57.95	-13	-44.95	-66.41	2.689	13.30	Н
	1664	-51.49	-13	-38.49	-58.46	1.58	10.70	V
	2496	-54.33	-13	-41.33	-62.58	2.10	12.50	V
	3330	-58.46	-13	-45.46	-67.35	2.86	13.90	V
	4158	-60.13	-13	-47.13	-68.59	2.69	13.30	V

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

LTE Band 7 / 20MHz / QPSK								
Channel	Frequency (MHz)	EIRP ( dBm )	Limit ( dBm )	Over Limit ( dB )	S.G. Power ( dBm )	TX Cable loss ( dB )	TX Antenna Gain (dBi)	Polarization (H/V)
Middle	5052	-46.96	-25	-21.96	-57.17	3.03	13.24	Н
	7580	-48.76	-25	-23.76	-58.21	3.56	13.01	Н
	10100	-47.94	-25	-22.94	-57.46	3.92	13.44	Н
	12630	-47.02	-25	-22.02	-56.94	4.44	14.36	Н
	5052	-46.22	-25	-21.22	-56.43	3.03	13.24	V
	7580	-45.22	-25	-20.22	-54.67	3.56	13.01	V
	10100	-49.86	-25	-24.86	-59.38	3.92	13.44	V
	12630	-46.06	-25	-21.06	-55.98	4.44	14.36	V

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : B1 of B2
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01

LTE Band 38 / 20MHz / QPSK								
Channel	Frequency (MHz)	EIRP ( dBm )	Limit ( dBm )	Over Limit ( dB )	S.G. Power ( dBm )	TX Cable loss ( dB )	TX Antenna Gain (dBi)	Polarization (H/V)
Middle	5172	-47.42	-25	-22.42	-57.63	3.03	13.24	Н
	7760	-47.38	-25	-22.38	-56.83	3.56	13.01	Η
	10340	-49.95	-25	-24.95	-59.47	3.92	13.44	Н
	12930	-43.84	-25	-18.84	-53.76	4.44	14.36	Н
	5172	-46.96	-25	-21.96	-57.17	3.03	13.24	V
	7760	-43.70	-25	-18.70	-53.15	3.56	13.01	V
	10340	-50.31	-25	-25.31	-59.83	3.92	13.44	V
	12930	-45.23	-25	-20.23	-55.15	4.44	14.36	V

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1155 Page Number : B2 of B2
Report Issued Date : Nov. 29, 2019
Report Version : Rev. 01