FCC RF Test Report

APPLICANT : HMD Global Oy EQUIPMENT : Smart Phone

BRAND NAME : NOKIA
MODEL NAME : TA-1044

FCC ID : 2AJOTTA-1044

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION: (DSS) Spread Spectrum Transmitter

The product was received on Jan. 20, 2017 and testing was completed on Feb. 24, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 1 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

1190

Report No.: FR712016A

TABLE OF CONTENTS

RE	VISION	N HISTORY	3
SUI	MMAR	Y OF TEST RESULT	4
1	GENE	RAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Applicable Standards	6
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	9
	2.4	Support Unit used in test configuration and system	9
	2.5	UT Operation Test Setup	9
	2.6	Measurement Results Explanation Example	10
3	TEST	RESULT	11
	3.1	Number of Channel Measurement	11
	3.2	Hopping Channel Separation Measurement	
	3.3	Dwell Time Measurement	20
	3.4	20dB and 99% Bandwidth Measurement	22
	3.5	Peak Output Power Measurement	35
	3.6	Conducted Band Edges Measurement	37
	3.7	Conducted Spurious Emission Measurement	44
	3.8	Radiated Band Edges and Spurious Emission Measurement	54
	3.9	AC Conducted Emission Measurement	58
	3.10	Antenna Requirements	60
4	LIST	OF MEASURING EQUIPMENT	61
5	UNCE	RTAINTY OF EVALUATION	62
API	PENDI	X A. AC CONDUCTED EMISSION TEST RESULT	
API	PENDI	X B. RADIATED SPURIOUS EMISSION	
API	PENDI	X C. RADIATED SPURIOUS EMISSION PLOTS	
API	PENDI	X D. DUTY CYCLE PLOTS	

APPENDIX E. SETUP PHOTOGRAPHS

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 2 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No. : FR712016A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR712016A	Rev. 01	Initial issue of report	Mar. 24, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 3 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No. : FR712016A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-
3.4	-	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 7.13 dB at 36.750 MHz
3.9	15.207	AC Conducted Emission	15.207(a)	Pass	Under limit 15.90 dB at 13.558 / 17.678 MHz
3.10	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 4 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No. : FR712016A

1 General Description

1.1 Applicant

HMD Global Oy

Karaportti 2, 02610 Espoo, Finland

1.2 Manufacturer

HMD Global Oy

Karaportti 2, 02610 Espoo, Finland

1.3 Product Feature of Equipment Under Test

GSM/WCDMA/LTE, Bluetooth, Wi-Fi 2.4GHz 802.11b/g/n, Wi-Fi 5GHz 802.11a/n, Ant.+, FM Receiver, NFC, and GPS.

WWAN: PIFA Antenna WLAN: PIFA Antenna Bluetooth: PIFA Antenna Ant.+: PIFA Antenna GPS/Glonass/Beidou : Monopole Antenna	Product Specification subjective to this standard				
Antenna Type Bluetooth: PIFA Antenna Ant.+: PIFA Antenna					
Ant.+: PIFA Antenna	Antonno Typo				
GPS/Glonass/Beidou : Monopole Antenna	Antenna Type				
NFC : Loop Antenna		•			

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 5 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW0007 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.			
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Techn	ology Park,		
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.			
rest Site Location	TEL: +886-3-327-3456			
	FAX: +886-3-328-4978			
Toot Site No	Sporton	Site No.		
Test Site No.	TH05-HY	CO05-HY		

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site	SPORTON INTERNATIONAL INC.				
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,				
Took Site Legation	Taoyuan City, Taiwan (R.O.C.)				
Test Site Location	TEL: +886-3-327-0868				
	FAX: +886-3-327-0855				
Test Site No.	Sporton Site No.				
rest site No.	03CH11-HY				

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 6 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 7 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Z plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.


The following sufficiently table is showing all test modes to demonstrate in compliance with the standard.						
	Summary table of Test Cases					
		Data Rate / Modulation				
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps			
	GFSK	π/4-DQPSK	8-DPSK			
Canduated	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz			
Conducted	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz			
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz			
	Bluetooth EDR 3Mbps 8-DPSK					
	B	luetooth EDR 3Mbps 8-DPS	SK			
Radiated	В	Mode 1: CH00_2402 MHz	SK .			
Radiated Test Cases	В		SK .			
	В	Mode 1: CH00_2402 MHz	SK			
		Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz				
Test Cases	Mode 1: GSM 850 Idle +	Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz Bluetooth Link + WLAN (2	2.4GHz) Link + NFC On +			
Test Cases	Mode 1: GSM 850 Idle +	Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz	2.4GHz) Link + NFC On +			

Remark: For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and the conducted spurious emissions and conducted band edge measurement for each data rate are no worse than 3Mbps, and no other significantly frequencies found in conducted spurious emission.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 8 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

2.3 Connection Diagram of Test System

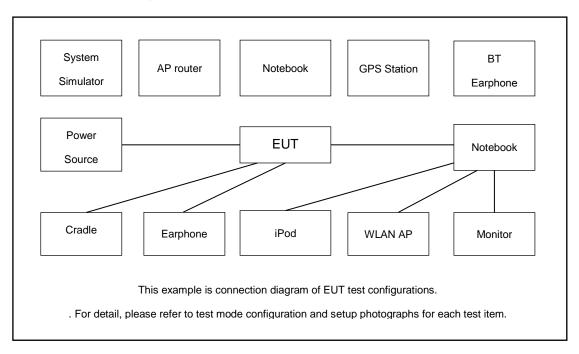

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	System Simulator	Anritsu	MT8820C	N/A	N/A	Unshielded, 1.8 m
2.	Bluetooth Base Station	R&S	CBT32	N/A	N/A	Unshielded, 1.8 m
3.	WLAN AP	ASUS	RT-AC66U	MSQ-RTAC66U	N/A	Unshielded,1.8m
4.	Notebook	DELL	Latitude E6320	FCC DoC/ Contains FCC ID: QDS-BRCM1054	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
5.	Bluetooth Earphone	Sony Ericsson	MW600	PY7DDA-2029	N/A	N/A
6.	SD Card	SanDisk	MicroSD HC	FCC DoC	N/A	N/A

2.5 UT Operation Test Setup

The RF test items utility, "QRCT" was installed in Notebook which was programmed in order to make the EUT get into the engineering modes to contact with base station for continuous transmitting and receiving signals.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 9 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

Offset(dB) = RF cable loss(dB) + attenuator factor(dB).
=
$$4.2 + 10 = 14.2$$
 (dB)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 10 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings: Span = the frequency band of operation;
 RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup



3.1.5 Test Result of Number of Hopping Frequency

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%


Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 11 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Number of Hopping Channel Plot on Channel 00 - 78

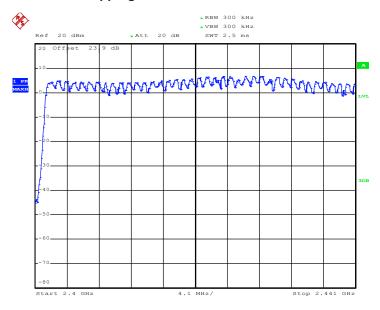

Date: 24.FEB.2017 00:17:59

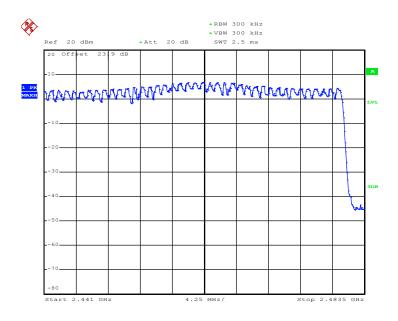

Date: 24.FEB.2017 00:18:40

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 12 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 - Span = wide enough to capture the peaks of two adjacent channels;
 - RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 13 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

3.2.5 Test Result of Hopping Channel Separation

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.014	0.6213	Pass
39	2441	1.002	0.6213	Pass
78	2480	1.002	0.6213	Pass

Channel Separation Plot on Channel 00 - 01

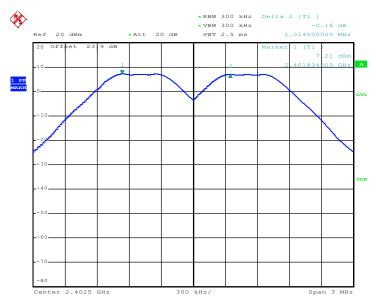


Date: 24.FEB.2017 00:32:15

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 14 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

Channel Separation Plot on Channel 39 - 40

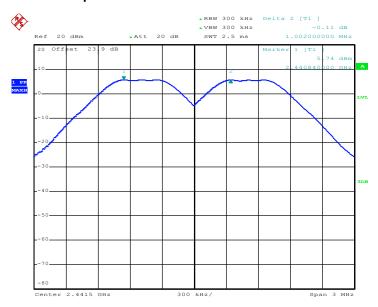

Date: 24.FEB.2017 00:36:43

Channel Separation Plot on Channel 77 - 78

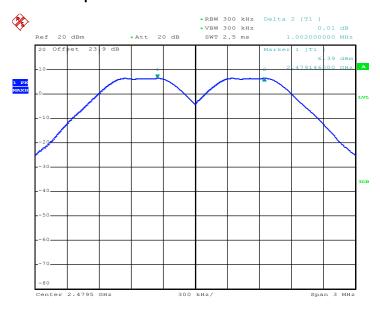

Date: 24.FEB.2017 00:41:33

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 15 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8400	Pass
39	2441	1.008	0.8400	Pass
78	2480	1.002	0.8400	Pass

Channel Separation Plot on Channel 00 - 01

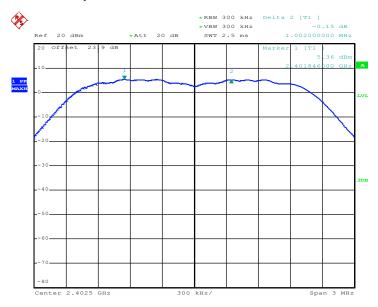


Date: 24.FEB.2017 00:47:18

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 16 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

Channel Separation Plot on Channel 39 - 40

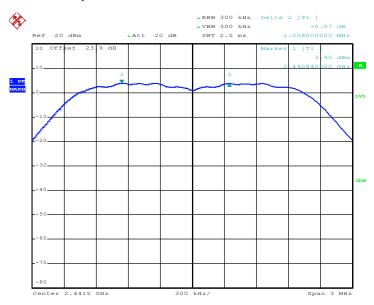

Date: 24.FEB.2017 00:54:52

Channel Separation Plot on Channel 77 - 78

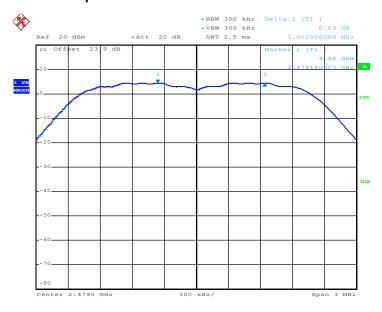

Date: 24.FEB.2017 01:00:41

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 17 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.008	0.8200	Pass
39	2441	1.008	0.8200	Pass
78	2480	1.002	0.8200	Pass

Channel Separation Plot on Channel 00 - 01

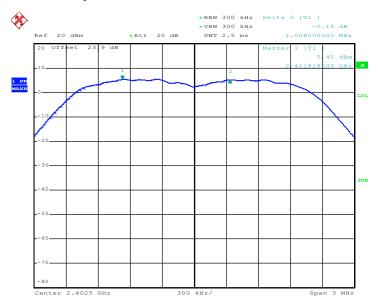


Date: 24.FEB.2017 01:07:53

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 18 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

Channel Separation Plot on Channel 39 - 40

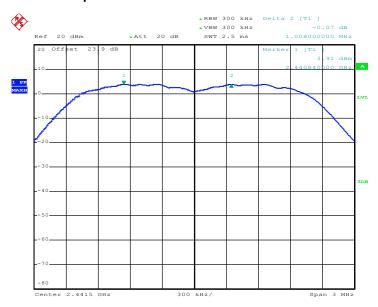

Date: 24.FEB.2017 01:12:42

Channel Separation Plot on Channel 77 - 78

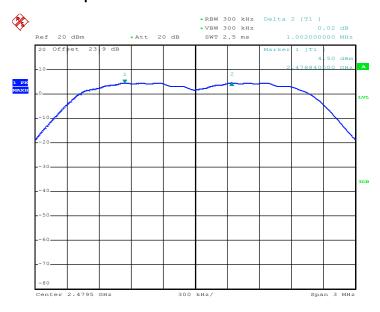

Date: 24.FEB.2017 01:22:09

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 19 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 20 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.3.5 Test Result of Dwell Time


Test Mode :	DH5	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Mode	Channel	Hops Over Occupancy Time(hops)	IIMA	Dwell Time (sec)	Limits (sec)	Pass/Fail
Normal	79	106.67	2.90	0.31	0.4	Pass
AFH	20	53.33	2.90	0.15	0.4	Pass

Remark:

- In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels.
 With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4 x 79) (s),
 Hops Over Occupancy Time comes to (1600 / 6 / 79) x (0.4 x 79) = 106.67 hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
 With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
 Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

Package Transfer Time Plot

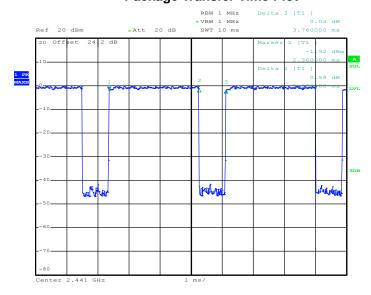

Date: 9.FEB.2017 22:51:30

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 21 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only


3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
 - RBW \geq 1% of the 20 dB bandwidth; VBW \geq RBW; Sweep = auto; Detector function = peak;
 - Trace = \max hold.
- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
 - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;
 - Trace = max hold.
- 6. Measure and record the results in the test report.

3.4.4 Test Setup

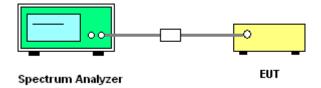

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 22 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

3.4.5 Test Result of 20dB Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	0.932
39	2441	0.932
78	2480	0.932


20 dB Bandwidth Plot on Channel 00

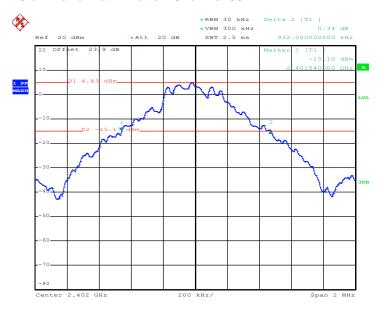

Date: 24.FEB.2017 00:28:02


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 23 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

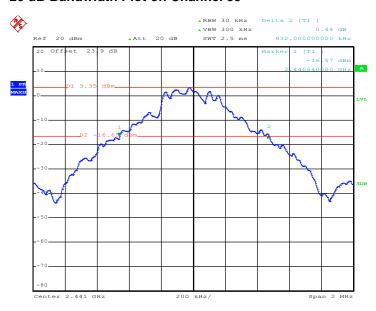

Date: 24.FEB.2017 00:34:02

20 dB Bandwidth Plot on Channel 78

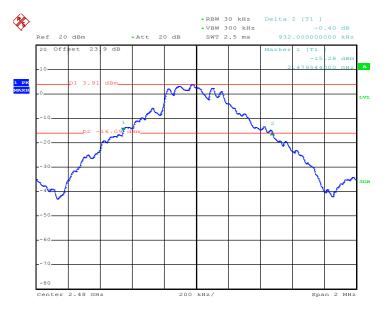

Date: 24.FEB.2017 00:37:48


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 24 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.260
39	2441	1.260
78	2480	1.260

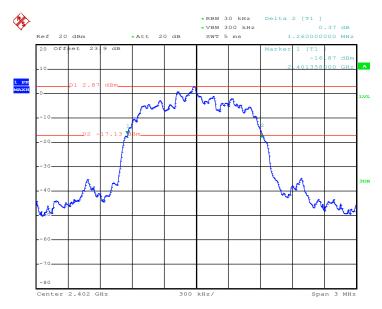

Date: 24.FEB.2017 00:43:04


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 25 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

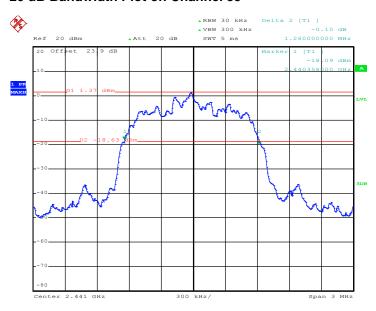

Date: 24.FEB.2017 00:48:25

20 dB Bandwidth Plot on Channel 78

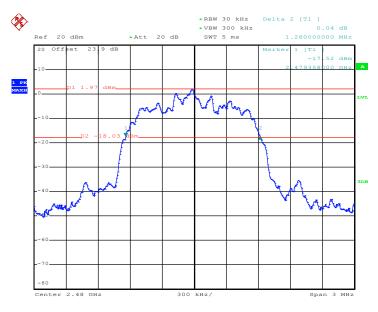

Date: 24.FEB.2017 00:55:52


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 26 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.230
39	2441	1.230
78	2480	1.230

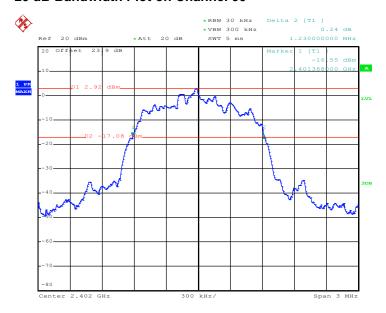

Date: 24.FEB.2017 01:02:44


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 27 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

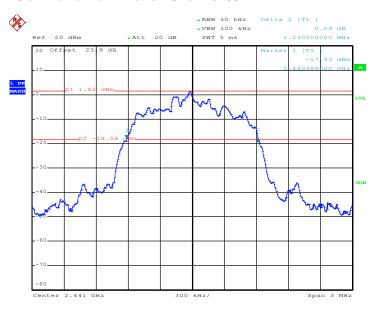

Date: 24.FEB.2017 01:09:47

20 dB Bandwidth Plot on Channel 78

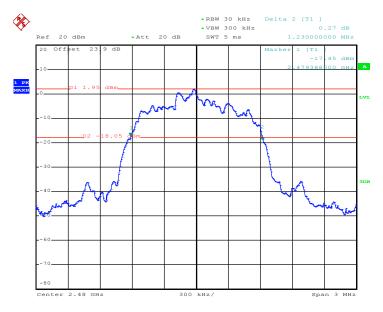

Date: 24.FEB.2017 01:13:59

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 28 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

3.4.6 Test Result of 99% Occupied Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	0.880
39	2441	0.884
78	2480	0.880


99% Occupied Bandwidth Plot on Channel 00

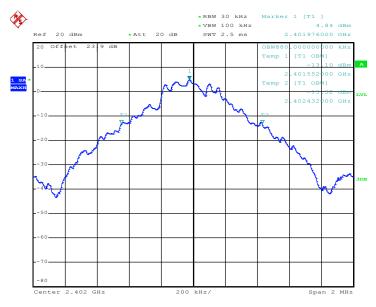

Date: 24.FEB.2017 00:29:40


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 29 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

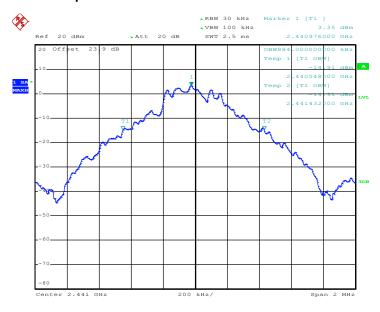

Date: 24.FEB.2017 00:35:07

99% Occupied Bandwidth Plot on Channel 78

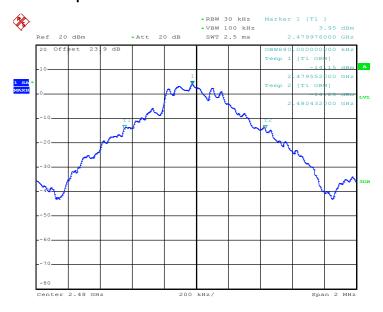

Date: 24.FEB.2017 00:39:42


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 30 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%


Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.168
39	2441	1.168
78	2480	1.168

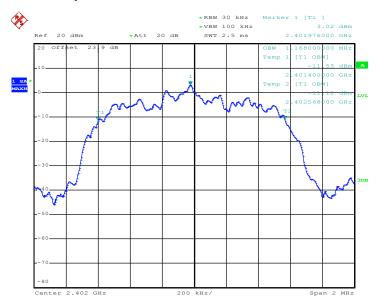

Date: 24.FEB.2017 00:44:43

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 31 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

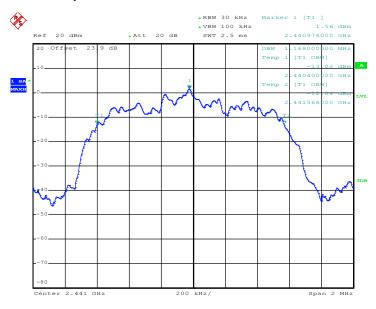

Date: 24.FEB.2017 01:08:42

99% Occupied Bandwidth Plot on Channel 78



Date: 24.FEB.2017 00:57:41


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 32 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%


Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.148
39	2441	1.148
78	2480	1.148

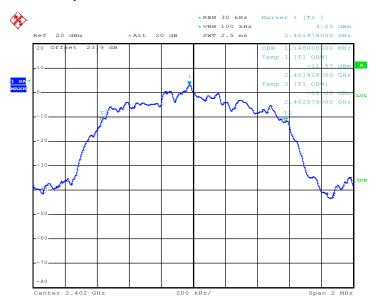

Date: 24.FEB.2017 01:05:13

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 33 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

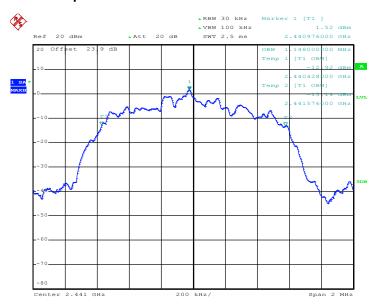

Date: 24.FEB.2017 01:10:43

99% Occupied Bandwidth Plot on Channel 78



Date: 24.FEB.2017 01:16:13

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 34 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.

3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 35 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.5.5 Test Result of Peak Output Power

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

	F	R	F Power (dBm)	
Channel	Frequency	GFSK	Max. Limits	Dece/Feil
	(MHz)	1 Mbps	(dBm)	Pass/Fail
00	2402	7.85	20.97	Pass
39	2441	6.42	20.97	Pass
78	2480	7.14	20.97	Pass

Note: For AFH mode using 20 hopping channels, the maximum output power limit is 20.97dBm.

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

	Fraguenay	RF Power (dBm)			
Channel		π/4-DQPSK	Max. Limits	Dece/Feil	
	(MHz)	2 Mbps	(dBm)	Pass/Fail	
00	2402	7.75	20.97	Pass	
39	2441	6.35	20.97	Pass	
78	2480	7.08	20.97	Pass	

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

Channel	Frequency (MHz)	RF Power (dBm)		
		8-DPSK	Max. Limits	Pass/Fail
		3 Mbps	(dBm)	Pass/Fall
00	2402	8.18	20.97	Pass
39	2441	6.76	20.97	Pass
78	2480	7.46	20.97	Pass

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 36 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No. : FR712016A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 37 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.6.5 Test Result of Conducted Band Edges


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

Low Band Edge Plot on Channel 00

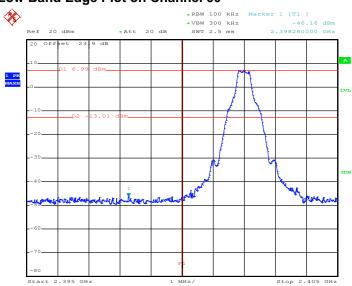

Date: 24.FEB.2017 00:29:07

High Band Edge Plot on Channel 78

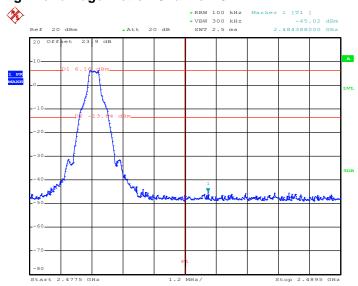

Date: 24.FEB.2017 00:39:07


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 38 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A


Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

Low Band Edge Plot on Channel 00

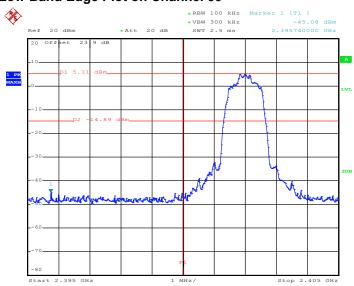

Date: 24.FEB.2017 00:44:08

High Band Edge Plot on Channel 78

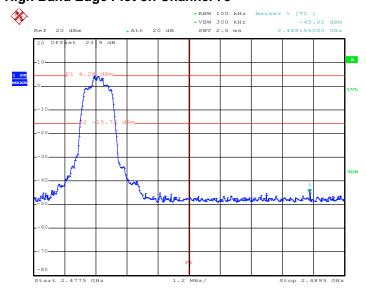

Date: 24.FEB.2017 00:56:54

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 39 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

Low Band Edge Plot on Channel 00

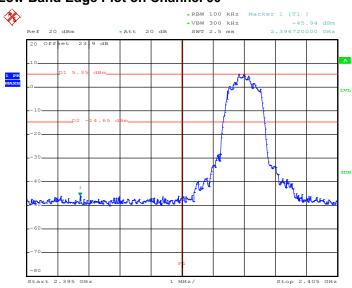

Date: 24.FEB.2017 01:03:46

High Band Edge Plot on Channel 78

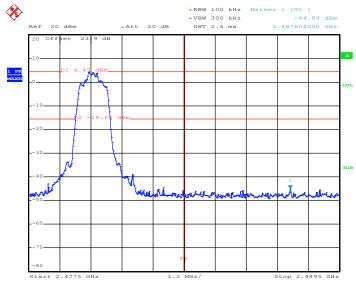

Date: 24.FEB.2017 01:15:31

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 40 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A

3.6.6 Test Result of Conducted Hopping Mode Band Edges


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

1Mbps Hopping Mode Low Band Edge Plot

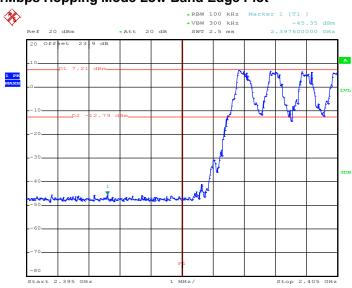

Date: 24.FEB.2017 00:23:29

1Mbps Hopping Mode High Band Edge Plot

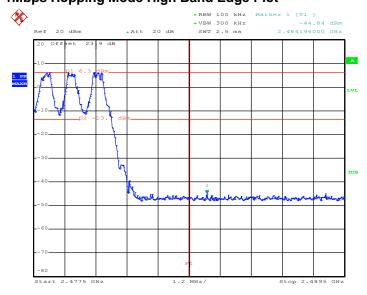

Date: 24.FEB.2017 00:24:44

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 41 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01


Report No.: FR712016A

Test Engineer : Derek Hsu

Test Mode :	2Mbps	Temperature :	24~26 ℃
rest wode :	ZIVIDPS	remperature :	24~20 (


Relative Humidity:

2Mbps Hopping Mode Low Band Edge Plot

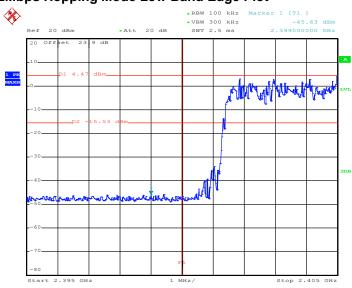

Date: 24.FEB.2017 00:22:09

2Mbps Hopping Mode High Band Edge Plot

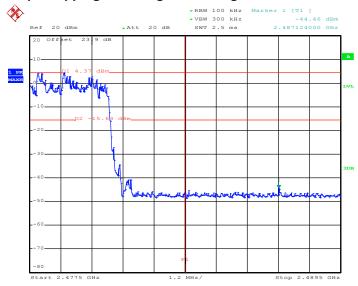

Date: 24.FEB.2017 00:21:19

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 42 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

48~51%


Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Derek Hsu	Relative Humidity :	48~51%

3Mbps Hopping Mode Low Band Edge Plot

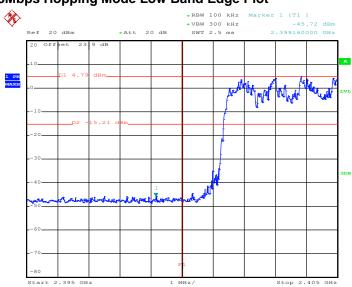

Date: 24.FEB.2017 00:19:30

3Mbps Hopping Mode High Band Edge Plot

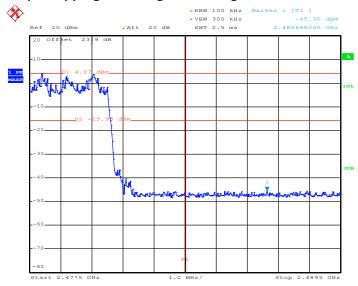

Date: 24.FEB.2017 00:20:30

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 43 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 44 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.7.5 Test Result of Conducted Spurious Emission


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	00	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

1Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

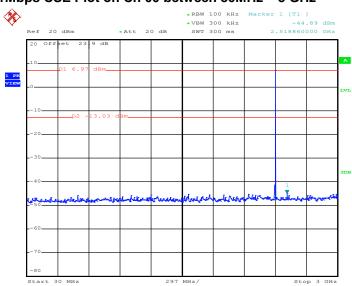

Date: 24.FEB.2017 00:31:00

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

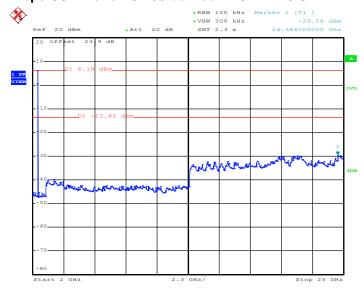

Date: 24.FEB.2017 00:31:22

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 45 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

1Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

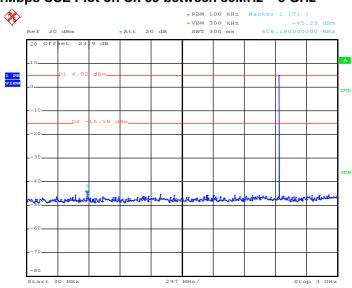

Date: 24.FEB.2017 00:35:32

1Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

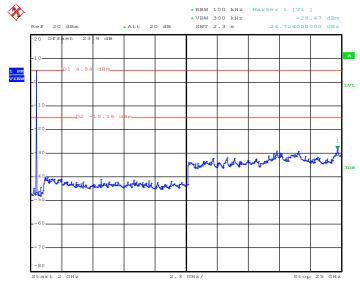

Date: 24.FEB.2017 00:35:54


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 46 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A


Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

1Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

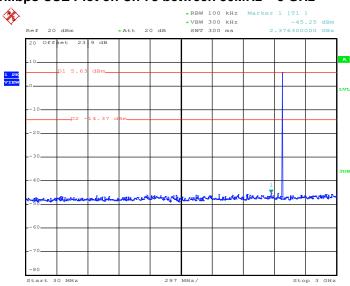

Date: 24.FEB.2017 00:40:19

1Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

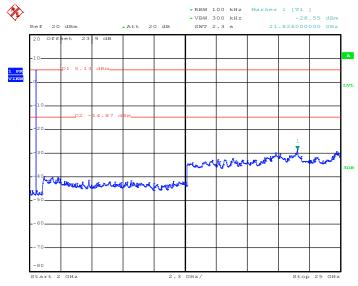

Date: 24.FEB.2017 00:40:41

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 47 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Channel :	00	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

2Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

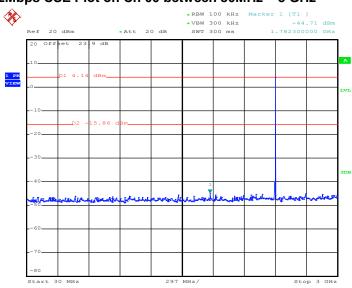

Date: 24.FEB.2017 00:46:01

2Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

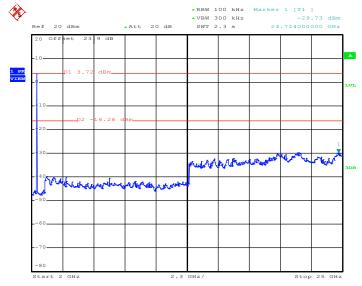

Date: 24.FEB.2017 00:46:23

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 48 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

2Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

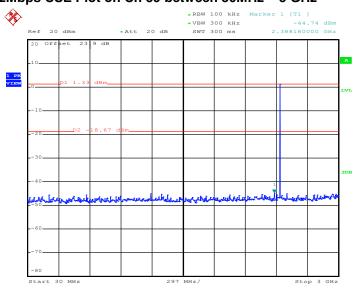

Date: 24.FEB.2017 00:51:58

2Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

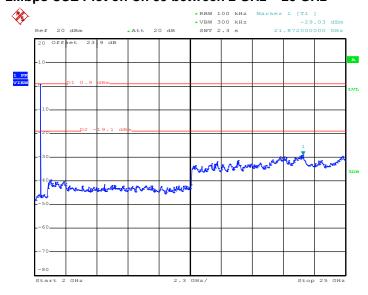

Date: 24.FEB.2017 00:53:21

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 49 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

2Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

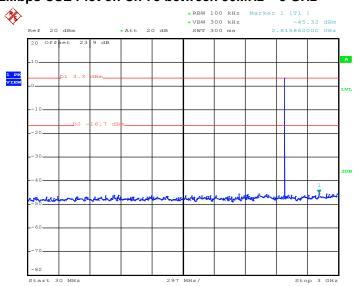

Date: 24.FEB.2017 01:25:15

2Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

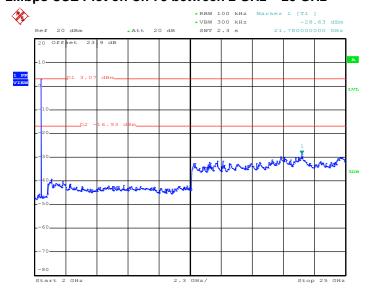


Date: 24.FEB.2017 01:25:36


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 50 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A




3Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

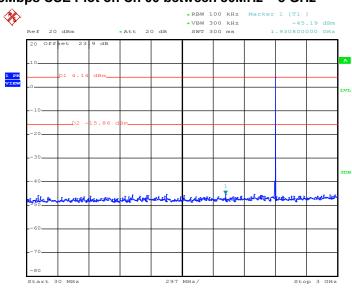

Date: 24.FEB.2017 01:06:35

3Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

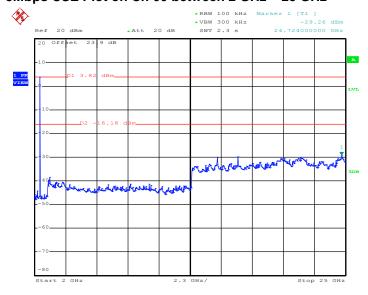

Date: 24.FEB.2017 01:06:56

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 51 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

3Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

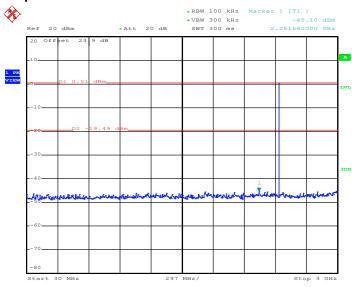

Date: 24.FEB.2017 01:11:29

3Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

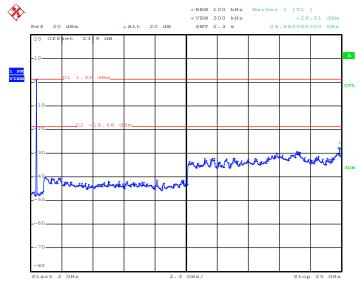

Date: 24.FEB.2017 01:11:51

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 52 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A




Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Derek Hsu

3Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

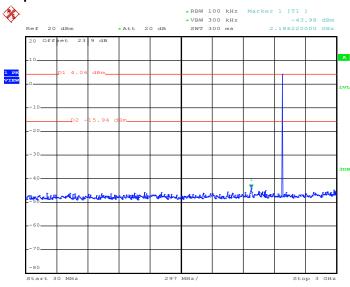

Date: 24.FEB.2017 01:16:38

3Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

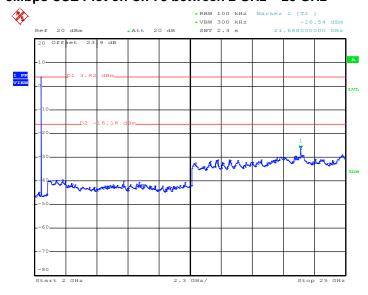

Date: 24.FEB.2017 01:19:59

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 53 of 62 Report Issued Date: Mar. 24, 2017 Report Version : Rev. 01

Report No.: FR712016A

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the FCC section 15.209 limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 54 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c). Duty cycle = On time/100 milliseconds

 On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.
 - Average Emission Level = Peak Emission Level + 20*log(Duty cycle)
- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.76dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Report No.: FR712016A

3.8.4 Test Setup

For radiated emissions below 30MHz



For radiated emissions from 30MHz to 1GHz




SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 56 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

For radiated emissions above 1GHz

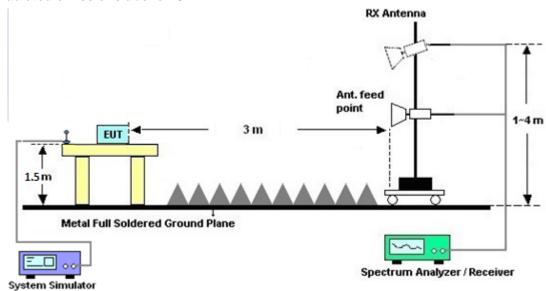

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix B and C.

3.8.7 Duty Cycle

Please refer to Appendix D.

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix B and C.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 57 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Fraguency of emission (MUz)	Conducted limit (dBμV)			
Frequency of emission (MHz)	Quasi-peak	Average		
0.15-0.5	66 to 56*	56 to 46*		
0.5-5	56	46		
5-30	60	50		

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.


3.9.3 Test Procedures

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 58 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.9.4 Test Setup

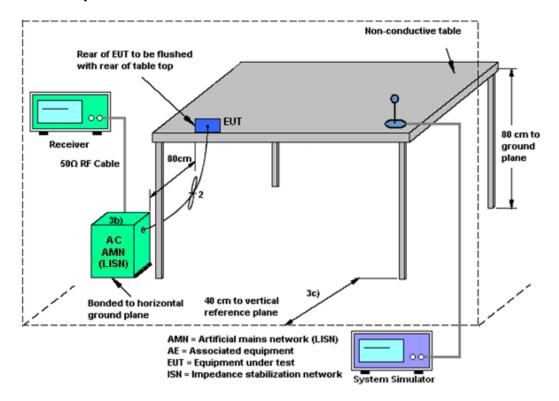

3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix A.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 59 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the FCC rule.

3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 60 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Power Meter	Agilent	E4416A	GB412923 44	300MHz~40GHz	Dec. 26, 2016	Feb. 09, 2017 ~ Feb. 24, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Power Sensor	Agilent	E9327A	US404415 48	300MHz~40GHz	Dec. 26, 2016	Feb. 09, 2017 ~ Feb. 24, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz-40GHz	Jul. 17, 2016	Feb. 09, 2017 ~ Feb. 24, 2017	Jul. 16, 2017	Conducted (TH05-HY)
BT Base Station (Measure)	Rohde & Schwarz	СВТ	101136	BT 3.0	Sep. 21, 2016	Feb. 09, 2017 ~ Feb. 24, 2017	Sep. 20, 2017	Conducted (TH05-HY)
Amplifier	SONOMA	310N	187312	9kHz~1GHz	Nov. 10, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100315	9 kHz~30 MHz	Sep. 02, 2015	Feb. 23, 2017 ~ Feb. 24, 2017	Sep. 01, 2017	Radiation (03CH11-HY)
Bilog Antenna	TESEQ	CBL 6111D	35414	30MHz~1GHz	Oct. 15, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Oct. 14, 2017	Radiation (03CH11-HY)
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-152 2	1GHz ~ 18GHz	Mar. 30, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Mar. 31, 2017	Radiation (03CH11-HY)
Preamplifier	Keysight	83017A	MY532700 80	1GHz~26.5GHz	Nov. 10, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Spectrum Analyzer	Keysight	N9010A	MY523502 76	10Hz ~ 44GHZ	Mar. 21, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Mar. 20, 2017	Radiation (03CH11-HY)
Antenna Mast	EMEC	AM-BS-4500- B	N/A	1~4m	N/A	Feb. 23, 2017 ~ Feb. 24, 2017	N/A	Radiation (03CH11-HY)
Turn Table	EMEC	TT 2000	N/A	0~360 Degree	N/A	Feb. 23, 2017 ~ Feb. 24, 2017	N/A	Radiation (03CH11-HY)
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1815698	1GHz~18GHz	Dec. 01, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Nov. 30, 2017	Radiation (03CH11-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170 584	18GHz- 40GHz	Nov. 08, 2016	Feb. 23, 2017 ~ Feb. 24, 2017	Nov. 07, 2017	Radiation (03CH11-HY)
AC Power Source	ChainTek	APC-1000W	N/A	N/A	N/A	Feb. 09, 2017	N/A	Conduction (CO05-HY)
EMI Test Receiver	Rohde & Schwarz	ESCI 7	100724	9kHz~7GHz	Aug. 30, 2016	Feb. 09, 2017	Aug. 29, 2017	Conduction (CO05-HY)
LISN	Rohde & Schwarz	ENV216	100080	9kHz~30MHz	Nov. 29, 2016	Feb. 09, 2017	Nov. 28, 2017	Conduction (CO05-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 61 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No. : FR712016A

5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of Confidence	2.7
of 95% (U = 2Uc(y))	2.1

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	F 2
of 95% (U = 2Uc(y))	5.2

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.5
of 95% (U = 2Uc(y))	5.5

Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y))	5.2

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: 2AJOTTA-1044 Page Number : 62 of 62
Report Issued Date : Mar. 24, 2017
Report Version : Rev. 01

Report No.: FR712016A

Appendix A. AC Conducted Emission Test Results

Test Engineer :	Arthur Hsieh	Temperature :	21~22°ℂ
		Relative Humidity :	58~60%

Report No. : FR712016A

SPORTON INTERNATIONAL INC. Page Number : A1 of A1

TEL: 886-3-327-3456 FAX: 886-3-328-4978

EUT Information


 Report NO :
 712016

 Test Mode :
 Mode 1

 Test Voltage :
 120Vac/60Hz

Phase: Line

ENV216 Auto Test FCC Power Bar - L

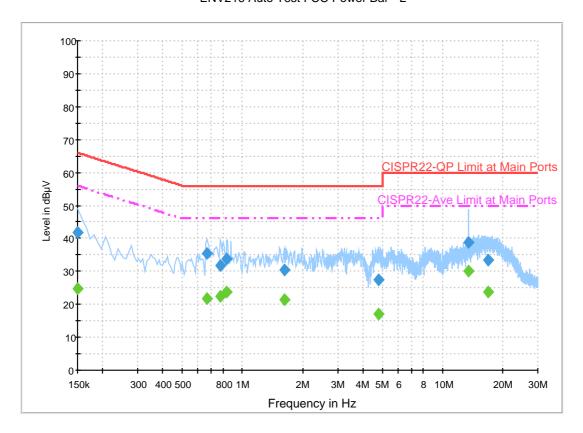

Final Result 1

Frequency	QuasiPeak	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	41.8	Off	L1	19.6	24.2	66.0
0.662000	35.3	Off	L1	19.6	20.7	56.0
0.774000	31.8	Off	L1	19.6	24.2	56.0
0.838000	33.7	Off	L1	19.6	22.3	56.0
1.614000	30.4	Off	L1	19.6	25.6	56.0
4.822000	27.6	Off	L1	19.8	28.4	56.0
13.558000	38.9	Off	L1	20.2	21.1	60.0
16.862000	33.6	Off	L1	20.4	26.4	60.0


Final Result 2

Frequency	Average	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	24.8	Off	L1	19.6	31.2	56.0
0.662000	21.9	Off	L1	19.6	24.1	46.0
0.774000	22.4	Off	L1	19.6	23.6	46.0
0.838000	23.6	Off	L1	19.6	22.4	46.0
1.614000	21.3	Off	L1	19.6	24.7	46.0
4.822000	17.2	Off	L1	19.8	28.8	46.0
13.558000	29.9	Off	L1	20.2	20.1	50.0
16.862000	23.9	Off	L1	20.4	26.1	50.0

EUT Information

Report NO: 712016
Test Mode: Mode 1
Test Voltage: 120Vac/60Hz
Phase: Neutral

ENV216 Auto Test FCC Power Bar - N

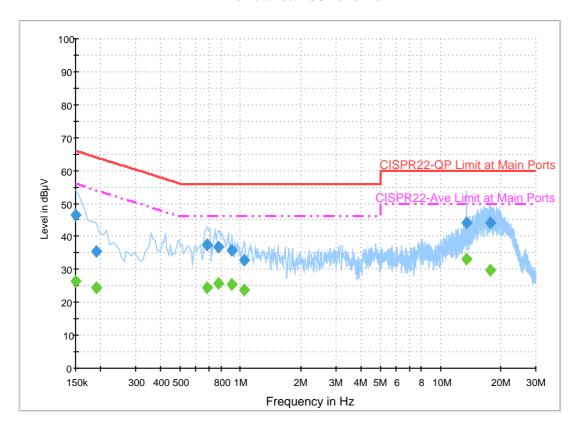

Final Result 1

	Juliu I					
Frequency	QuasiPeak	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	46.6	Off	N	19.5	19.4	66.0
0.190000	35.3	Off	N	19.5	28.7	64.0
0.678000	37.3	Off	N	19.5	18.7	56.0
0.774000	36.6	Off	N	19.5	19.4	56.0
0.910000	35.9	Off	N	19.5	20.1	56.0
1.046000	32.9	Off	N	19.6	23.1	56.0
13.558000	44.1	Off	N	20.3	15.9	60.0
17.678000	44.1	Off	N	20.6	15.9	60.0

Final Result 2

Frequency	Average	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	26.3	Off	N	19.5	29.7	56.0
0.190000	24.3	Off	N	19.5	29.7	54.0
0.678000	24.4	Off	N	19.5	21.6	46.0
0.774000	25.6	Off	N	19.5	20.4	46.0
0.910000	25.3	Off	N	19.5	20.7	46.0
1.046000	23.6	Off	N	19.6	22.4	46.0
13.558000	33.0	Off	N	20.3	17.0	50.0
17.678000	29.7	Off	N	20.6	20.3	50.0

Appendix B. Radiated Spurious Emission

Took Empire on .	LC Lines locky lives and Kan We	Temperature :	20~24°C
Test Engineer :	J.C. Liang, Jacky Hung, and Ken Wu	Relative Humidity :	50~54%

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		, .	,, .	Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	,	(dBµV/m)		(dB/m)	(dB)	(dB)	(cm)	(deg)		
		2378.145	44.27	-29.73	74	41.91	27.14	8.82	33.6	257	17	Р	Н
		2378.145	19.51	-34.49	54	-	-	-	-	-	-	Α	Н
	*	2402	90.03	-	-	87.54	27.19	8.89	33.59	257	17	Р	Н
	*	2402	65.27	-	-	-	-	-	-	-	-	Α	Н
ВТ													Н
CH00													Н
2402MHz		2342.55	44.06	-29.94	74	41.81	27.03	8.82	33.6	259	66	Р	V
		2342.55	19.3	-34.7	54	-	-	ı	-	-	-	Α	V
	*	2402	91.14	-	-	88.65	27.19	8.89	33.59	259	66	Р	٧
	*	2402	66.38	-	-	-	-	ı	-	-	-	Α	V
													V
													V
		2370.34	44.35	-29.65	74	41.99	27.14	8.82	33.6	289	19	Р	Н
		2370.34	19.59	-34.41	54	-	-	ı	-	-	-	Α	Н
	*	2441	90.42	-	-	87.72	27.34	8.94	33.58	289	19	Р	Н
	*	2441	65.66	-	-	-	-	1	-	-	-	Α	Н
рт		2494.75	43.59	-30.41	74	40.68	27.5	8.98	33.57	289	19	Р	Н
BT		2494.75	18.83	-35.17	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		2368.38	43.64	-30.36	74	41.33	27.09	8.82	33.6	274	69	Р	V
277 (IVII IZ		2368.38	18.88	-35.12	54	-	-	-	-	-	-	Α	V
	*	2441	92.3	-	-	89.6	27.34	8.94	33.58	274	69	Р	٧
	*	2441	67.54	-	-	-	-	-	-	-	-	Α	V
		2485.09	43.62	-30.38	74	40.77	27.45	8.98	33.58	274	69	Р	V
		2485.09	18.86	-35.14	54	-	-	1	-	-	-	Α	٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978



	*	2480	93.01	-	-	90.16	27.45	8.98	33.58	314	37	Р	
	*	2480	68.25	-	-	-	-	-	-	-	-	Α	Ī
		2498.28	44.28	-29.72	74	41.37	27.5	8.98	33.57	314	37	Р	
		2498.28	19.52	-34.48	54	-	-	-	-	-	-	Α	Ī
													Ī
BT													Ī
H 78 80MHz	*	2480	94.32	-	-	91.47	27.45	8.98	33.58	307	64	Р	Ī
OUNINZ	*	2480	69.56	-	-	-	-	-	-	-	-	Α	Ī
		2493	44.23	-29.77	74	41.32	27.5	8.98	33.57	307	64	Р	Ī
		2493	19.47	-34.53	54	-	-	-	-	-	-	Α	Ī
													Ī
	1. N	o other spurious	s found.	1		1	1	1	1		1	1	
mark	2. A	II results are PA	SS against	Peak and	Average li	mit line.							

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos		Avg.	
		(MHz)	(dBµV/m)		(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)		(P/A)	1
		4804	36.8	-37.2	74	52.82	31.66	10.65	58.33	100	0	Р	Н
		4804	12.04	-41.96	54	-	-	-	-	-	-	Α	Н
ВТ													Н
CH 00													Н
2402MHz		4804	36.59	-37.41	74	52.61	31.66	10.65	58.33	100	0	Р	V
2402111112		4804	11.83	-42.17	54	-	-	-	-	-	-	Α	V
													V
													V
		4882	37.28	-36.72	74	52.86	31.78	10.88	58.24	100	0	Р	Н
		4882	12.52	-41.48	54	-	-	-	-	-	-	Α	Н
		7323	40.93	-33.07	74	49.95	37.29	12.79	59.1	100	0	Р	Н
BT		7323	16.17	-37.83	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		4882	36.79	-37.21	74	52.37	31.78	10.88	58.24	100	0	Р	V
244 I WI M2		4882	12.03	-41.97	54	-	-	-	-	-	-	Α	V
		7323	40.61	-33.39	74	49.63	37.29	12.79	59.1	100	0	Р	V
		7323	15.85	-38.15	54	-	-	-	-	-	-	Α	V
		4960	37.75	-36.25	74	52.83	31.94	11.12	58.14	100	0	Р	Н
		4960	12.99	-41.01	54	-	-	-	-	-	-	Α	Н
		7440	41.4	-32.6	74	50.25	37.44	12.88	59.17	100	0	Р	Н
BT		7440	16.64	-37.36	54	-	-	-	-	-	-	Α	Н
CH 78 2480MHz		4960	37.25	-36.75	74	52.33	31.94	11.12	58.14	100	0	Р	V
Z40UIVITIZ		4960	12.49	-41.51	54	-	-	-	-	-	-	Α	V
		7440	41.59	-32.41	74	50.44	37.44	12.88	59.17	100	0	Р	V
		7440	16.83	-37.17	54	-	-	_	_	-	-	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B3 of B6

Emission below 1GHz

2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Ро
		(MHz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB/m)	Loss (dB)	Factor (dB)	Pos (cm)	Pos (deg)	Avg.	(H/
		99.39	25.9	-17.6	43.5	40.77	16.1	1.51	32.48	-	-	P	 -
		165	26.84	-16.66	43.5	41.19	16.4	2	32.75	-	-	Р	ŀ
		200.91	28.94	-14.56	43.5	43.7	16.02	2.1	32.88	-	-	Р	ŀ
		601	29.03	-16.97	46	32.11	25.71	3.67	32.46	-	-	Р	ŀ
		860	32.26	-13.74	46	30.78	28.96	4.39	31.87	-	-	Р	ŀ
		952.4	33.72	-12.28	46	29.62	30.59	4.69	31.18	312	144	Р	ŀ
													ŀ
													ı
													ŀ
													I
. 4011-													
2.4GHz BT													ŀ
LF		30.54	32.78	-7.22	40	38.81	25.18	1.29	32.5	-	-	Р	١
		36.75	32.87	-7.13	40	42.09	21.98	1.29	32.49	199	255	Р	,
		197.4	25.92	-17.58	43.5	40.84	15.86	2.1	32.88	-	-	Р	,
		706	29.85	-16.15	46	31.46	26.82	4.02	32.45	-	-	Р	,
		835.5	33.32	-12.68	46	32.21	28.72	4.39	32	-	-	Р	١
		924.4	32.68	-13.32	46	29.6	29.89	4.63	31.44	-	-	Р	,
													١
													١
													١
													١
													١
							_						١

2. All results are PASS against limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B4 of B6

Note symbol

Report No. : FR712016A

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions
	shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

SPORTON INTERNATIONAL INC. Page Number : B5 of B6

TEL: 886-3-327-3456 FAX: 886-3-328-4978

A calculation example for radiated spurious emission is shown as below:

Report No.: FR712016A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : B6 of B6

TEL: 886-3-327-3456 FAX: 886-3-328-4978



Appendix C. Radiated Spurious Emission Plots

Took Empire con .		Temperature :	20~24°C
lest Engineer :	J.C. Liang, Jacky Hung, and Ken Wu	Relative Humidity :	50~54%

Note symbol

-L	Low channel location
-R	High channel location

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	2.4GHz 2400~2483.5N	IHz Band Edge @ 3m						
ANT	BT CH00) 2402MHz						
1	Horizontal	Fundamental						
Peak	105.0 Date 2017-83-23 105.0 ST. 2340. 2340. 2340. 2340. 2440. 2455 STE : 03CHIL-HV Condition : FRAX, SE, 74 Str. HORN 91200-HF HORIZONTAL : BRW1000000000-Hz SWT-Auto Detector : Flexik Project : 712016	Table Tabl						

TEL: 886-3-327-3456 FAX: 886-3-328-4978

ANT

BT CH00 2402MHz

1

Vertical

Fundamental

1

Vertical

Fundamental

1

Fundamental

1

Peak

Peak

Peak

Peak

Peak


Peak

Project

1712016

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Report No. : FR712016A

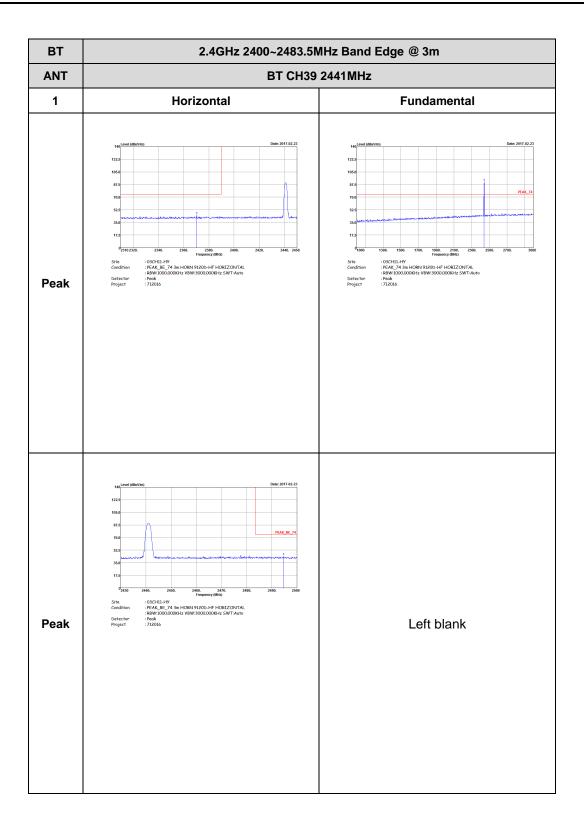

TEL: 886-3-327-3456 FAX: 886-3-328-4978

вт 2.4GHz 2400~2483.5MHz Band Edge @ 3m ANT BT CH39 2441MHz 1 Vertical **Fundamental** : 03CHIII-HY : PEAK_BE_74 3m H/RN 9120D-HF VERTICAL : RBW:1000,000KHz VBW:3000,000KHz SWT:Auto : Peak : 712016 Peak Peak Left blank

TEL: 886-3-327-3456 FAX: 886-3-328-4978

ANT

BT CH78 2480MHz

1 Horizontal

Fundamental

1 Horizontal

Fundamental

State of the Character of the Ch

TEL: 886-3-327-3456 FAX: 886-3-328-4978


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Report No. : FR712016A

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

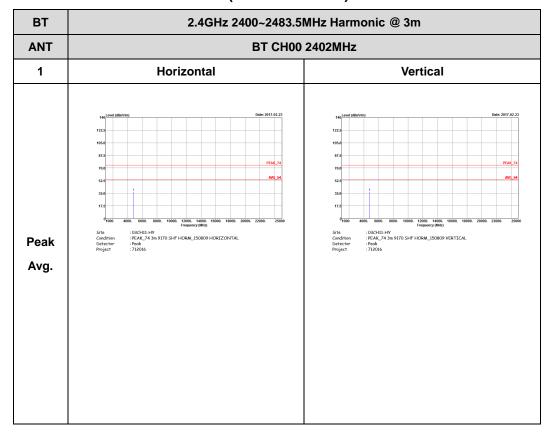

TEL: 886-3-327-3456 FAX: 886-3-328-4978 ANT

BT CH39 2441MHz

1 Horizontal


Vertical

Wertical

Peak

Avg.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

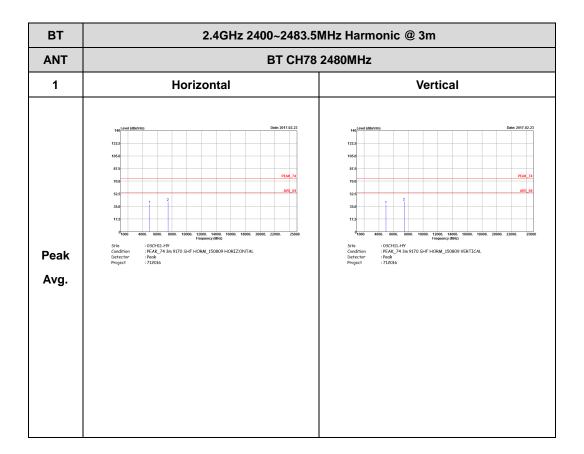


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Report No. : FR712016A

Emission below 1GHz

2.4GHz BT (LF)

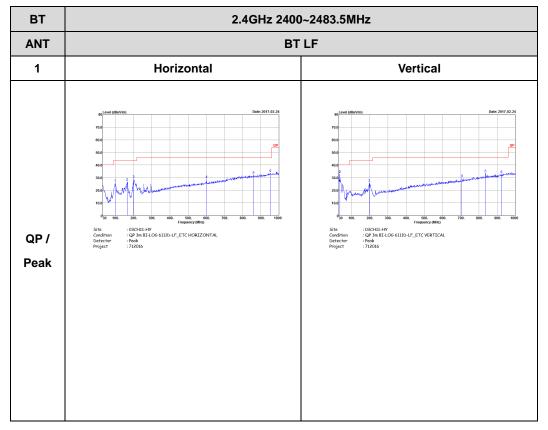


TEL: 886-3-327-3456 FAX: 886-3-328-4978




Report No.: FR712016A

Appendix D. Duty Cycle Plots

3DH5 on time (One Pulse) Plot on Channel 39

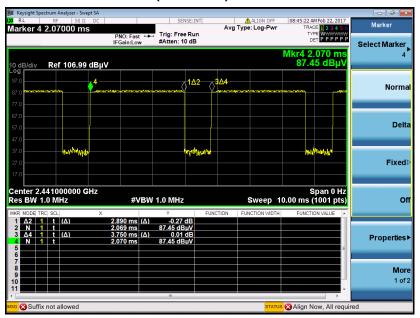

on time (Count Pulses) Plot on Channel 39

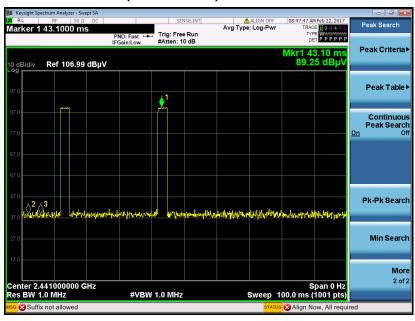

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = $2 \times 2.89 / 100 = 5.78 \%$
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.76 dB
- 3DH5 has the highest duty cycle worst case and is reported.



FCC RF Test Report

Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

 $2.89 \text{ ms } \times 20 \text{ channels} = 57.8 \text{ ms}$

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

2.89 ms x 2 = 5.78 ms

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.78 \text{ ms}/100\text{ms}) = -24.76 \text{ dB}$

TEL: 886-3-327-3456 FAX: 886-3-328-4978