# **FCC RF Test Report**

APPLICANT : HMD Global Oy

**EQUIPMENT**: GSM/WCDMA/LTE Mobile Phone

BRAND NAME : Nokia MODEL NAME : TA-1084

FCC ID : 2AJOTTA-1084

STANDARD : FCC Part 15 Subpart C §15.247

**CLASSIFICATION** : (DSS) Spread Spectrum Transmitter

The product was received on Mar. 21, 2018 and testing was completed on May 15, 2018. We, Sporton International (Kunshan) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International (Kunshan) Inc., the test report shall not be reproduced except in full.



Approved by: James Huang / Manager



## Sporton International (Kunshan) Inc.

No.3-2 Ping-Xiang Rd, Kunshan Development Zone Kunshan City Jiangsu Province 215335 China

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 1 of 63
Report Issued Date : Jun. 12, 2018

Report No.: FR832104A

Report Version : Rev. 01

## **TABLE OF CONTENTS**

RE\	/ISION	I HISTORY	3
SUN	/MAR	Y OF TEST RESULT	4
1	GENE	RAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	6
	1.5	Modification of EUT	6
	1.6	Testing Location	7
	1.7	Applicable Standards	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Carrier Frequency Channel	8
	2.2	Test Mode	9
	2.3	Connection Diagram of Test System	. 10
	2.4	Support Unit used in test configuration and system	. 10
	2.5	EUT Operation Test Setup	11
	2.6	Measurement Results Explanation Example	. 11
3	TEST	RESULT	.12
	3.1	Number of Channel Measurement	. 12
	3.2	Hopping Channel Separation Measurement	. 14
	3.3	Dwell Time Measurement	21
	3.4	20dB and 99% Bandwidth Measurement	. 23
	3.5	Output Power Measurement	. 36
	3.6	Conducted Band Edges Measurement	
	3.7	Conducted Spurious Emission Measurement	. 45
	3.8	Radiated Band Edges and Spurious Emission Measurement	. 55
	3.9	AC Conducted Emission Measurement	. 59
	3.10	Antenna Requirements	.61
4	LIST	OF MEASURING EQUIPMENT	. 62
5	UNCE	RTAINTY OF EVALUATION	. 63
APF	PENDI	X A. AC CONDUCTED EMISSION TEST RESULT	
APF	PENDI	X B. RADIATED SPURIOUS EMISSION	
APF	PENDI	X C. DUTY CYCLE PLOTS	

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 2 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR832104A	Rev. 01	Initial issue of report	Jun. 12, 2018

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 3 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## **SUMMARY OF TEST RESULT**

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-
3.4	-	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d) Conducted Band Edges		≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 14.76 dB at 920.460 MHz
3.9	15.207	AC Conducted Emission	15.207(a)	Pass	Under limit 10.89 dB at 3.399 MHz
3.10	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 4 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 1 General Description

## 1.1 Applicant

**HMD Global Oy** 

Karaportti 2 02610 Espoo FINLAND

## 1.2 Manufacturer

**HMD Global Oy** 

Karaportti 2 02610 Espoo FINLAND

## 1.3 Product Feature of Equipment Under Test

Product Feature				
Equipment	GSM/WCDMA/LTE Mobile Phone			
Brand Name	Nokia			
Model Name	TA-1084			
FCC ID	2AJOTTA-1084			
	GSM/GPRS/EGPRS/WCDMA/HSPA/LTE			
EUT supports Radios application	WLAN 2.4GHz 802.11b/g/n HT20/HT40			
Lor supports readios application	Bluetooth v3.0 + EDR/Bluetooth v4.0 LE/			
	Bluetooth v4.1 LE/Bluetooth v4.2 LE			
	Conducted: 356940090000420/356940090000438			
IMEI Code	Conduction: 356940090001840/356940090001857			
	Radiation: 356940090004802/356940090004810			
HW Version	HW0303			
SW Version	000C_0_146			
EUT Stage	Identical Prototype			

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 5 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 9.83 dBm (0.0096 W) Bluetooth EDR (2Mbps) : 10.67 dBm (0.0117 W) Bluetooth EDR (3Mbps) : 10.88 dBm (0.0122 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps): 0.956MHz Bluetooth EDR (2Mbps): 1.176MHz Bluetooth EDR (3Mbps): 1.148MHz			
Antenna Type / Gain	PIFA Antenna with gain -3.00 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) : π /4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

## 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 6 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 1.6 Testing Location

Sporton International (Kunshan) Inc. is accredited to ISO 17025 by National Voluntary Laboratory Accreditation Program (NVLAP code: 600155-0) and the FCC designation No. is CN5013.

Test Site	Sporton International (Kunshan) Inc.					
Test Site Location	No.3-2 Ping-Xiang Rd, Kunshan Development Zone Kunshan City Jiangsu Province 215335 China  TEL: +86-512-57900158  FAX: +86-512-57900958					
Test Site No.	Sporton Site No.  Registration No TH01-KS 03CH04-KS CO01-KS 630927					

Note: The test site complies with ANSI C63.4 2014 requirement.

## 1.7 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 7 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

### **Test Configuration of Equipment Under Test** 2

## 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084

Page Number : 8 of 63 Report Issued Date : Jun. 12, 2018 Report Version : Rev. 01

Report No.: FR832104A

### 2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Z plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Summary table of Test Cases					
		Data Rate / Modulation			
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps		
	GFSK	π /4-DQPSK	8-DPSK		
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz		
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz		
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz		
	Bluetooth EDR 3Mbps 8-DPSK				
	В	Sluetooth EDR 3Mbps 8-DPS	K		
Radiated	В	Mode 1: CH00_2402 MHz	K		
Radiated Test Cases	В	•	K		
	В	Mode 1: CH00_2402 MHz	K		
		Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz			
Test Cases		Mode 1: CH00_2402 MHz  Mode 2: CH39_2441 MHz  Mode 3: CH78_2480 MHz  Metooth Link + WLAN (2.4G) Li			

#### Remark:

- 1. For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter, Earphone and USB Cable.


Sporton International (Kunshan) Inc. TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 9 of 63
Report Issued Date : Jun. 12, 2018

Report No.: FR832104A

Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

## 2.3 Connection Diagram of Test System

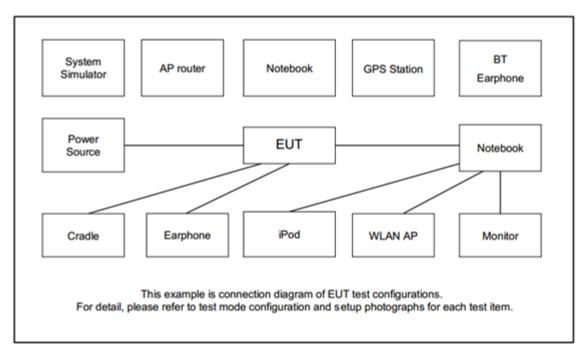

## 2.4 Support Unit used in test configuration and system

ltem	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	System Simulator	Anritsu	MT8820C	N/A	N/A	Unshielded, 1.8 m
2.	BT Base Station	R&S	СВТ	N/A	N/A	Unshielded, 1.8 m
3.	WLAN AP	D-Link	DIR-855	KA2DIR855A2	N/A	Unshielded, 1.8 m
4.	Bluetooth Earphone	Lenovo	LBH308	N/A	N/A	N/A
5.	Notebook	Lenovo	G480	N/A	N/A	AC I/P: Unshielded, 1.8 m DC O/P: Shielded, 1.8 m

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 10 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit/receive.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

## 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss.

Offset = RF cable loss

Following shows an offset computation example with cable loss 5.8 dB.

 $Offset(dB) = RF \ cable \ loss(dB).$ 

= 5.8 (dB)

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 11 of 63
Report Issued Date : Jun. 12, 2018

Report No.: FR832104A

Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

## 3 Test Result

### 3.1 Number of Channel Measurement

## 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

## 3.1.4 Test Setup



### 3.1.5 Test Result of Number of Hopping Frequency

Test Mode:	3Mbps	Temperature :	21~25℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%


Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 12 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## Number of Hopping Channel Plot on Channel 00 - 78

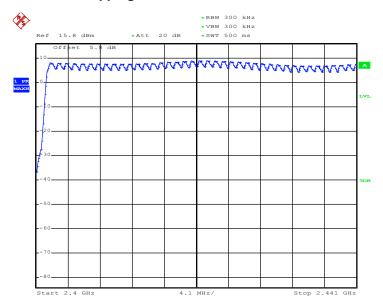

Date: 9.MAY.2018 21:32:20

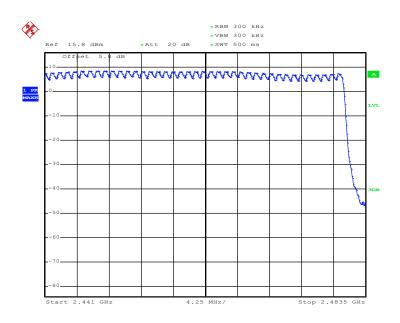

Date: 9.MAY.2018 21:38:25

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 13 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.2 Hopping Channel Separation Measurement

## 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


### 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
  - Span = wide enough to capture the peaks of two adjacent channels;
  - RBW = 300kHz; VBW  $\geq$  RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.2.4 Test Setup



Sporton International (Kunshan) Inc. TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 14 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


## 3.2.5 Test Result of Hopping Channel Separation

Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.008	0.6507	Pass
39	2441	1.008	0.7013	Pass
78	2480	1.002	0.6560	Pass


## Channel Separation Plot on Channel 00 - 01

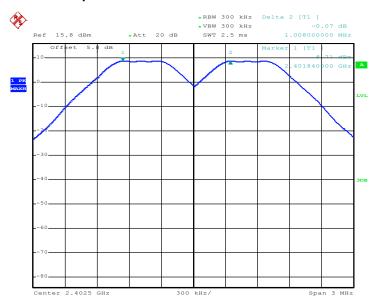

Date: 9.MAY.2018 21:40:12


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 15 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### Channel Separation Plot on Channel 39 - 40

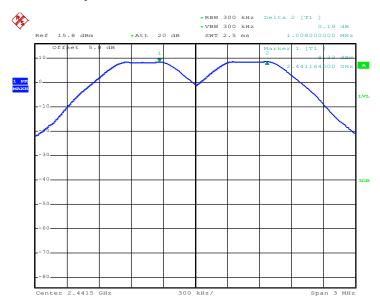

Date: 9.MAY.2018 21:04:00

#### Channel Separation Plot on Channel 77 - 78

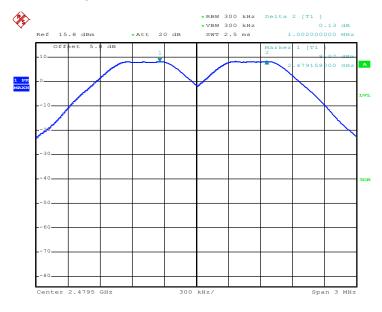

Date: 9.MAY.2018 21:04:40

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 16 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8440	Pass
39	2441	1.008	0.8760	Pass
78	2480	1.002	0.8520	Pass


## Channel Separation Plot on Channel 00 - 01

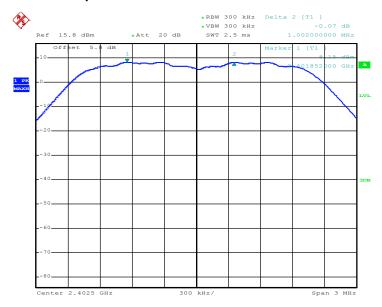

Date: 9.MAY.2018 21:06:35


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 17 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

## Channel Separation Plot on Channel 39 - 40

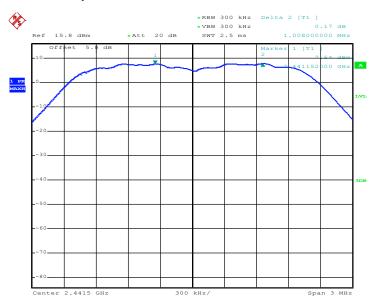

Date: 9.MAY.2018 21:07:14

## Channel Separation Plot on Channel 77 - 78

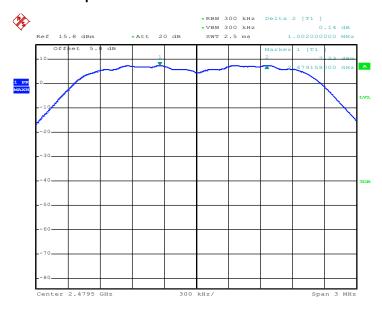

Date: 9.MAY.2018 21:08:34

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 18 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8240	Pass
39	2441	1.002	0.8280	Pass
78	2480	1.002	0.8280	Pass


## Channel Separation Plot on Channel 00 - 01

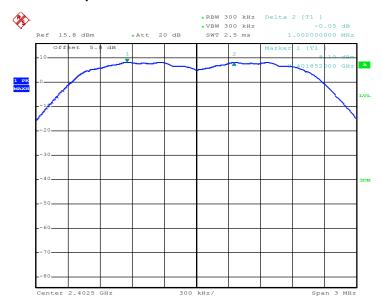

Date: 9.MAY.2018 21:09:13


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 19 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### Channel Separation Plot on Channel 39 - 40

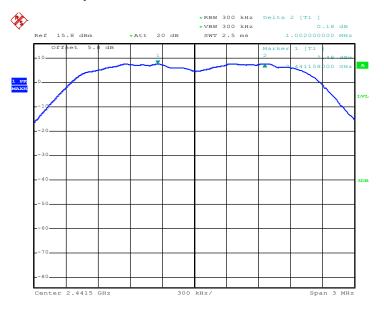

Date: 9.MAY.2018 21:10:30

#### Channel Separation Plot on Channel 77 - 78

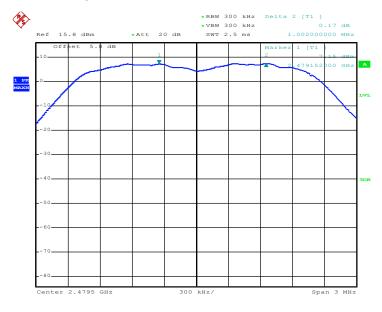

Date: 9.MAY.2018 21:11:51

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 20 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


## 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.3.4 Test Setup



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 21 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

#### 3.3.5 Test Result of Dwell Time

Test Mode :	3DH5	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Mode	Channel	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Normal	79	106.67	2.8957	0.31	0.4	Pass
AFH	20	53.34	2.8957	0.15	0.4	Pass

#### Package Transfer Time Plot

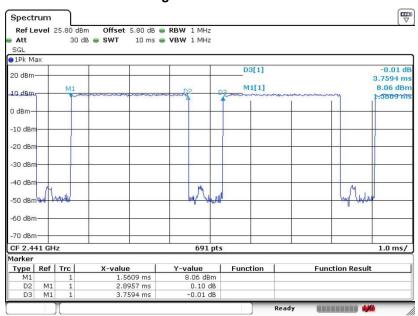

Date: 8.MAY.2018 20:27:21

#### Remark:

- 1. In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels. With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit  $(0.4 \times 79)$  (s), Hops Over Occupancy Time comes to  $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$  hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit  $(0.4 \times 20)$  (s), Hops Over Occupancy Time comes to  $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$  hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 22 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.4 20dB and 99% Bandwidth Measurement

#### 3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only


## 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
  - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
  - $RBW \ge 1\%$  of the 20 dB bandwidth;  $VBW \ge RBW$ ; Sweep = auto; Detector function = peak;
  - Trace = max hold.
- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
  - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
  - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = sample;
  - Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.4.4 Test Setup



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 23 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.4.5 Test Result of 20dB Bandwidth


Test Mode:	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	0.976
39	2441	1.052
78	2480	0.984

## <1Mbps>


#### 20 dB Bandwidth Plot on Channel 00

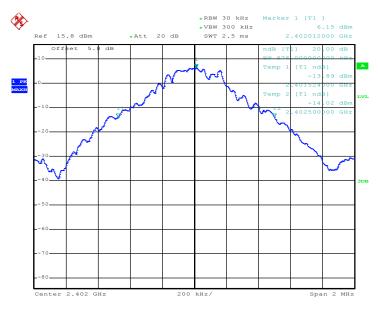

Date: 9.MAY.2018 21:12:27


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 24 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### 20 dB Bandwidth Plot on Channel 39

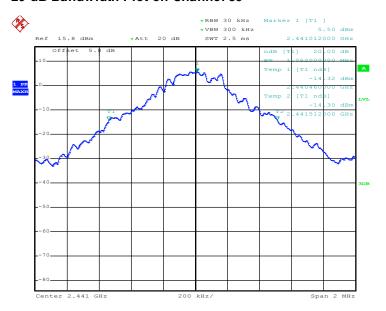

Date: 9.MAY.2018 21:12:56

#### 20 dB Bandwidth Plot on Channel 78

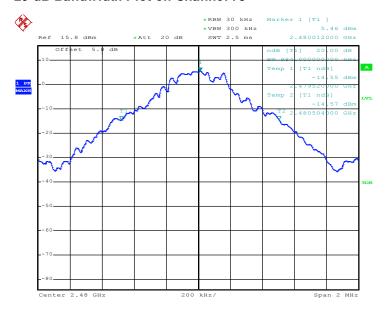

Date: 9.MAY.2018 21:13:25

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 25 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	2Mbps	Temperature :	21~25℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.266
39	2441	1.314
78	2480	1.278

## <2Mbps>


## 20 dB Bandwidth Plot on Channel 00

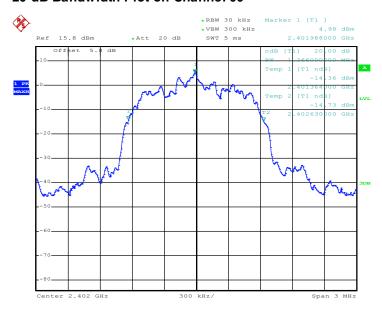

Date: 9.MAY.2018 21:13:43


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 26 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### 20 dB Bandwidth Plot on Channel 39

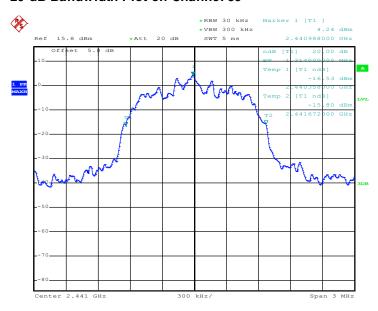

Date: 9.MAY.2018 21:14:05

#### 20 dB Bandwidth Plot on Channel 78

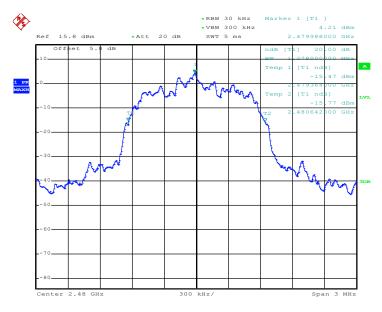

Date: 9.MAY.2018 21:14:14

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 27 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	3Mbps	Temperature :	21~25℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.236
39	2441	1.242
78	2480	1.242

## <3Mbps>


## 20 dB Bandwidth Plot on Channel 00

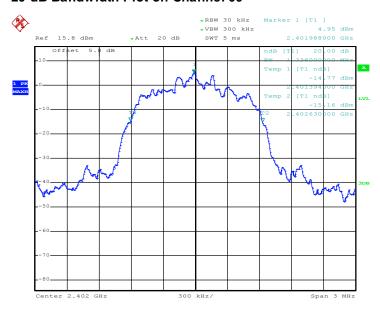

Date: 9.MAY.2018 21:14:29


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 28 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### 20 dB Bandwidth Plot on Channel 39

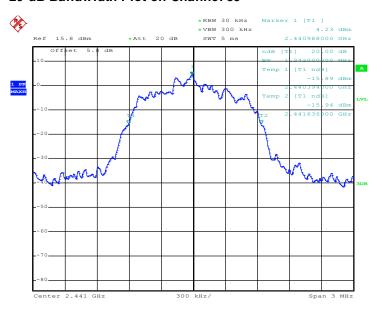

Date: 9.MAY.2018 21:14:47

#### 20 dB Bandwidth Plot on Channel 78

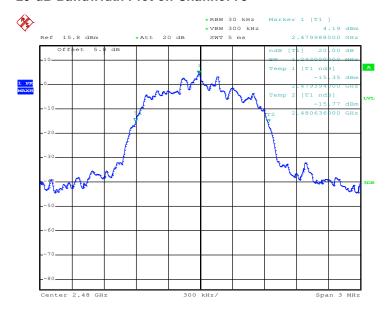

Date: 9.MAY.2018 21:14:57

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 29 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


## 3.4.6 Test Result of 99% Occupied Bandwidth

Test Mode:	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	0.888
39	2441	0.956
78	2480	0.924


## 99% Occupied Bandwidth Plot on Channel 00

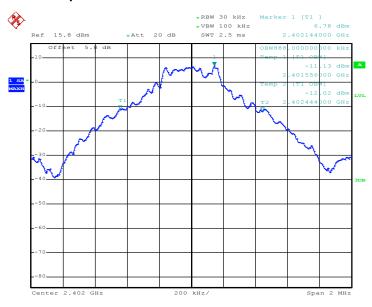

Date: 9.MAY.2018 21:20:46


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 30 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

## 99% Occupied Bandwidth Plot on Channel 39

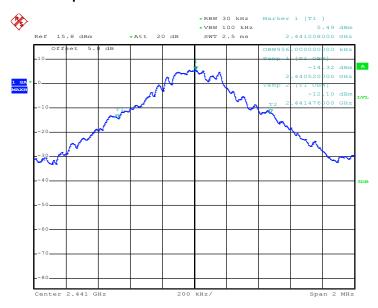

Date: 9.MAY.2018 21:21:22

## 99% Occupied Bandwidth Plot on Channel 78

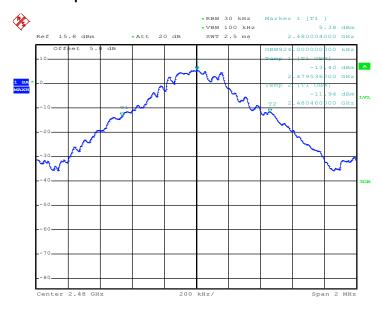

Date: 9.MAY.2018 21:21:58

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 31 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.164
39	2441	1.176
78	2480	1.176


## 99% Occupied Bandwidth Plot on Channel 00

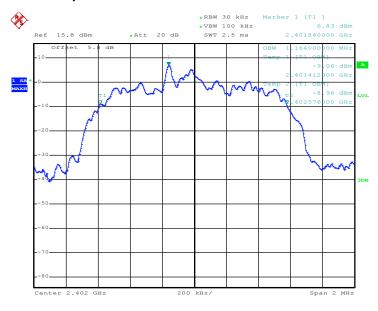

Date: 9.MAY.2018 21:22:34


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 32 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### 99% Occupied Bandwidth Plot on Channel 39

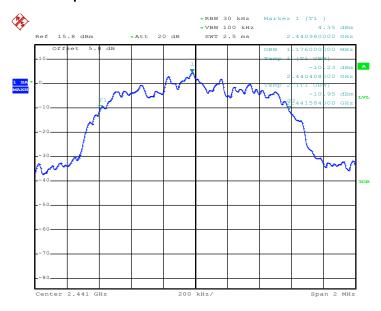

Date: 9.MAY.2018 21:23:10

#### 99% Occupied Bandwidth Plot on Channel 78

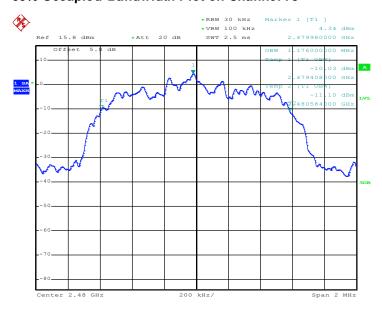

Date: 9.MAY.2018 21:23:46

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 33 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

Test Mode :	3Mbps	Temperature :	21~25℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

Report No.: FR832104A

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.148
39	2441	1.144
78	2480	1.148


## 99% Occupied Bandwidth Plot on Channel 00

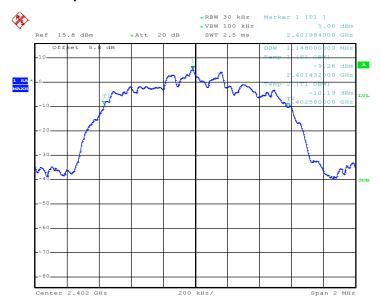

Date: 9.MAY.2018 21:24:22


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 34 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

#### 99% Occupied Bandwidth Plot on Channel 39

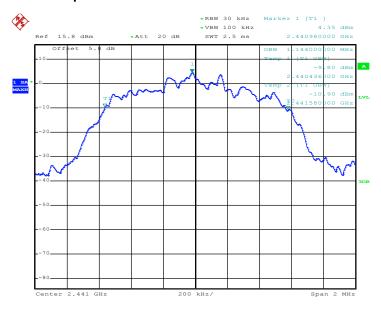

Date: 9.MAY.2018 21:24:58

## 99% Occupied Bandwidth Plot on Channel 78

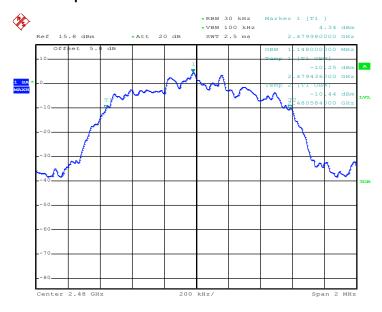

Date: 9.MAY.2018 21:25:34

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 35 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.5 Output Power Measurement

## 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


## 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

#### 3.5.4 Test Setup



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 36 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

# 3.5.5 Test Result of Peak Output Power

Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Silent Hai	Relative Humidity:	51~55%

	Eroguonov	RF Power (dBm)			
Channel	Frequency GFSK		Max. Limits	D/F-:1	
	(MHz)	1 Mbps	(dBm)	Pass/Fail	
00	2402	9.83	20.97	Pass	
39	2441	9.28	20.97	Pass	
78	2480	9.03	20.97	Pass	

Test Mode:	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%

	Eroguanov	R	F Power (dBm)	
Channel	Frequency (MHz)	π /4-DQPSK	Max. Limits	Pass/Fail
	(IVITIZ)	2 Mbps	(dBm)	Pass/Faii
00	2402	10.67	20.97	Pass
39	2441	9.97	20.97	Pass
78	2480	9.81	20.97	Pass

Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%

Fraguanay		RF Power (dBm)			
Channel	Frequency (MHz)	8-DPSK	Max. Limits	Pass/Fail	
	(WITIZ)	3 Mbps	(dBm)	Passyran	
00	2402	10.88	20.97	Pass	
39	2441	10.12	20.97	Pass	
78	2480	9.99	20.97	Pass	

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 37 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR832104A

## 3.6 Conducted Band Edges Measurement

## 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


### 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

#### 3.6.4 Test Setup



Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 38 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.6.5 Test Result of Conducted Band Edges


Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Channel:	00 and 78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

### Low Band Edge Plot on Channel 00

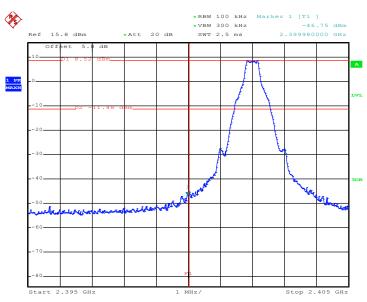

Date: 9.MAY.2018 21:15:50

## High Band Edge Plot on Channel 78

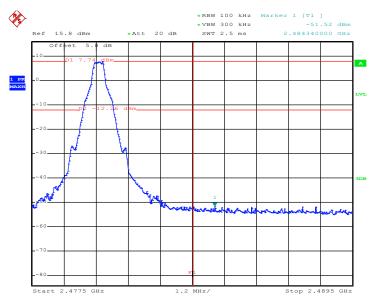

Date: 9.MAY.2018 21:16:42


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 39 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	2Mbps	Temperature :	21~25℃
Test Channel:	00 and 78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

### Low Band Edge Plot on Channel 00

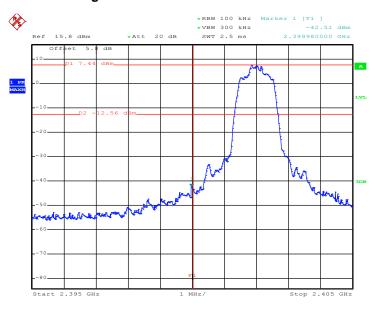

Date: 9.MAY.2018 21:41:20

### High Band Edge Plot on Channel 78

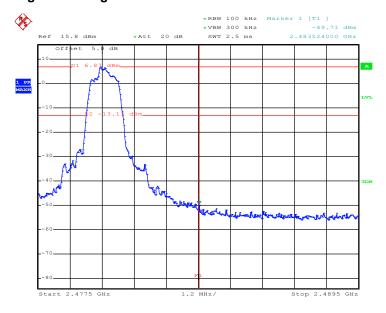


Date: 9.MAY.2018 21:40:39

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 40 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel:	00 and 78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

### Low Band Edge Plot on Channel 00

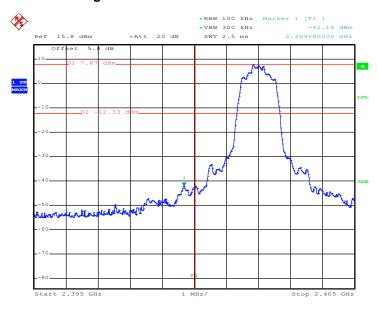

Date: 9.MAY.2018 21:19:17

### High Band Edge Plot on Channel 78

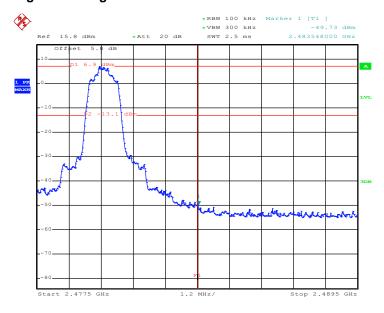


Date: 9.MAY.2018 21:20:08

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 41 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

## 3.6.6 Test Result of Conducted Hopping Mode Band Edges


Test Mode:	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%

#### **Hopping Mode Low Band Edge Plot**

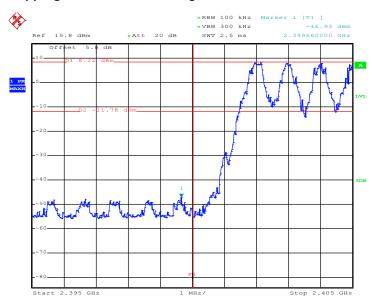

Date: 9.MAY.2018 22:46:34

#### **Hopping Mode High Band Edge Plot**

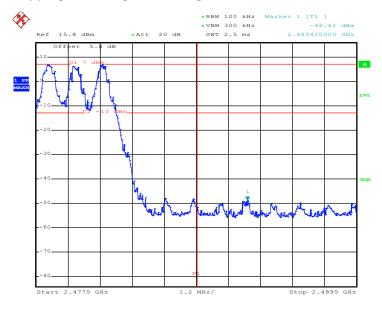

Date: 9.MAY.2018 22:44:15


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 42 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode:	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%

#### **Hopping Mode Low Band Edge Plot**

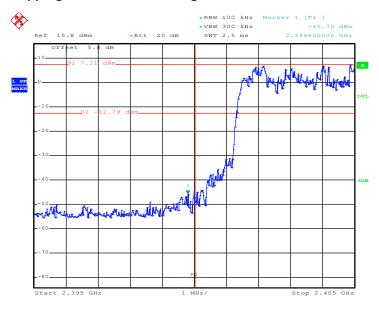

Date: 9.MAY.2018 22:47:29

## Hopping Mode High Band Edge Plot

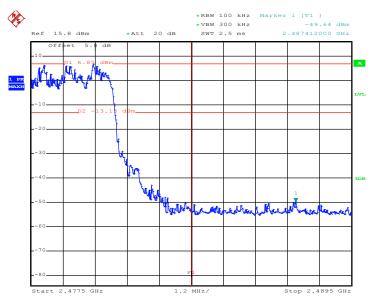


Date: 9.MAY.2018 22:48:28

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 43 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Test Mode:	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer:	Silent Hai	Relative Humidity:	51~55%

### **Hopping Mode Low Band Edge Plot**

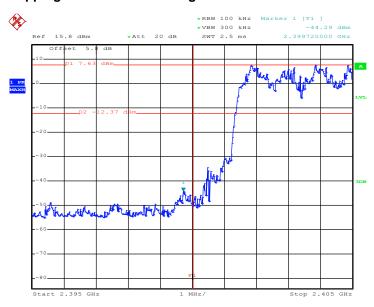

Date: 9.MAY.2018 22:50:39

### Hopping Mode High Band Edge Plot

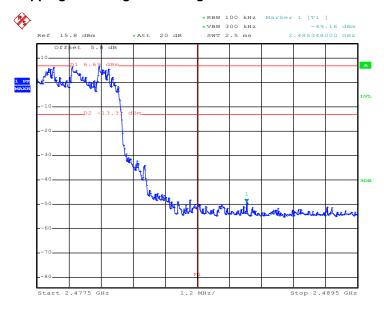

Date: 9.MAY.2018 22:49:35

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 44 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

## 3.7 Conducted Spurious Emission Measurement

### 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


## 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

#### 3.7.4 Test Setup



Sporton International (Kunshan) Inc. TEL: +86-512-57900158


FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 45 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.7.5 Test Result of Conducted Spurious Emission


Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Channel:	00	Relative Humidity:	51~55%
		Test Engineer :	Silent Hai

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

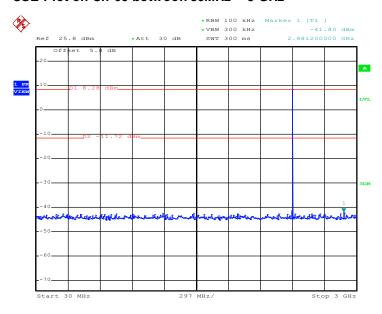

Date: 9.MAY.2018 21:45:57

#### 1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

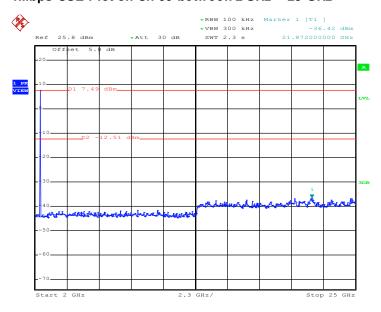

Date: 9.MAY.2018 21:46:19


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 46 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode:	1Mbps	Temperature :	21~25℃
Test Channel:	39	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

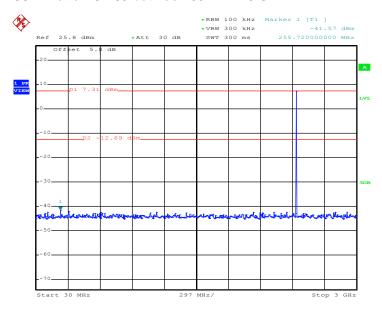

Date: 9.MAY.2018 21:50:12

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

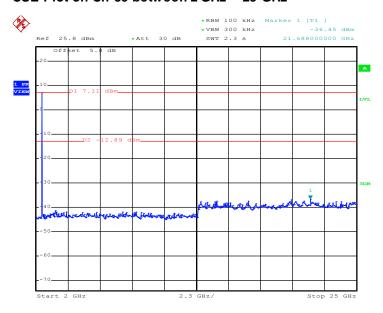


Date: 9.MAY.2018 21:50:33

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 47 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Test Mode:	1Mbps	Temperature :	<b>21~25</b> ℃
Test Channel:	78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

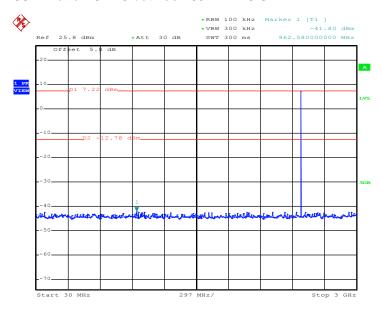

Date: 9.MAY.2018 21:55:50

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

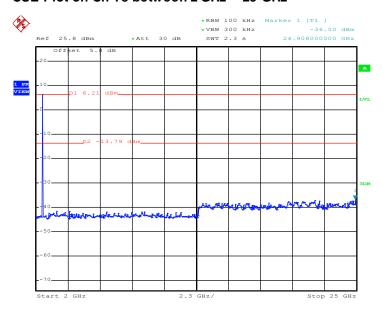

Date: 9.MAY.2018 21:56:12


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 48 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	2Mbps	Temperature :	21~25℃
Test Channel:	00	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

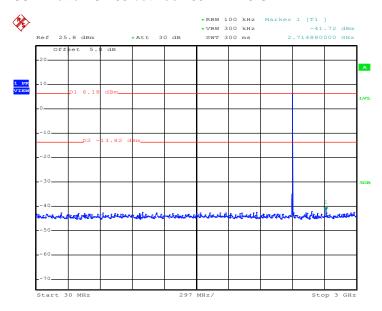

Date: 9.MAY.2018 21:57:49

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

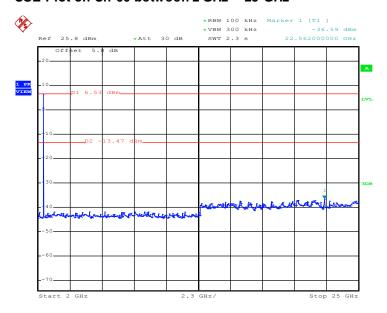


Date: 9.MAY.2018 21:58:11

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 49 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Test Mode :	2Mbps	Temperature :	21~25℃
Test Channel:	39	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

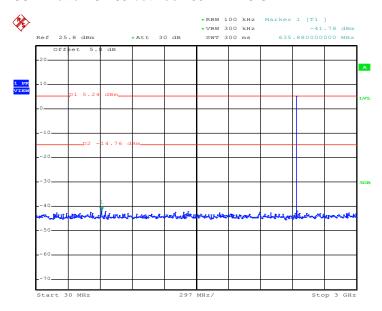

Date: 9.MAY.2018 22:03:56

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

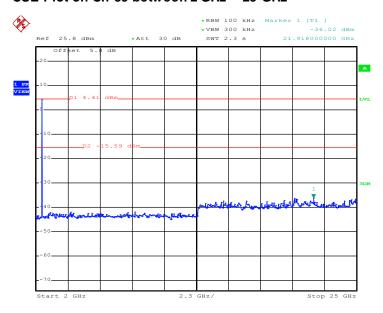

Date: 9.MAY.2018 22:08:54


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 50 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	2Mbps	Temperature :	21~25℃
Test Channel:	78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

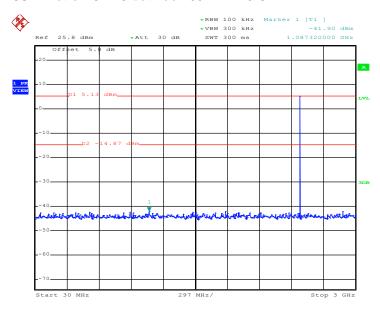

Date: 9.MAY.2018 22:10:30

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

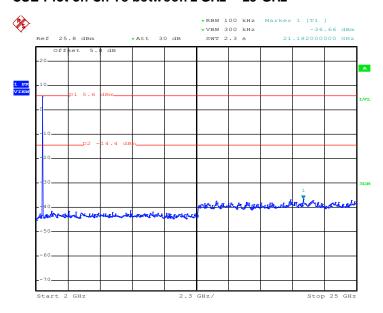

Date: 9.MAY.2018 22:10:52


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 51 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel:	00	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

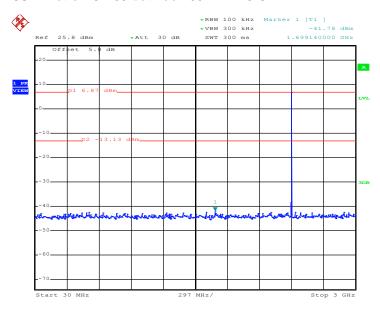

Date: 9.MAY.2018 22:12:43

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

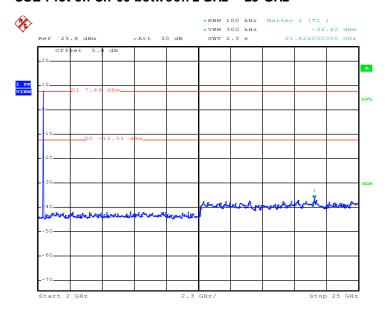


Date: 9.MAY.2018 22:20:25

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 52 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel:	39	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

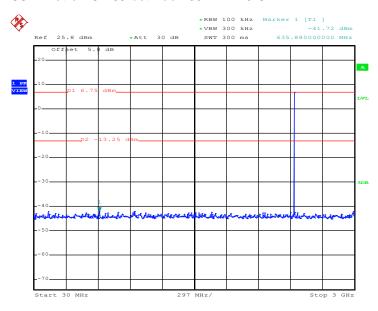

Date: 9.MAY.2018 22:22:21

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

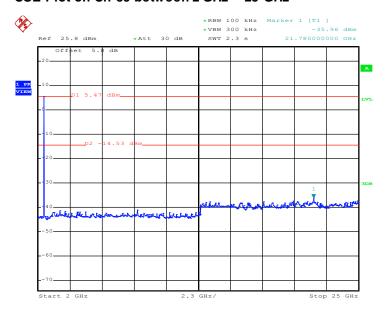

Date: 9.MAY.2018 22:28:02


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 53 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel:	78	Relative Humidity:	51~55%
		Test Engineer:	Silent Hai

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

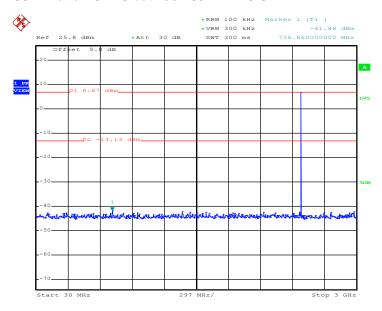

Date: 9.MAY.2018 22:33:02

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

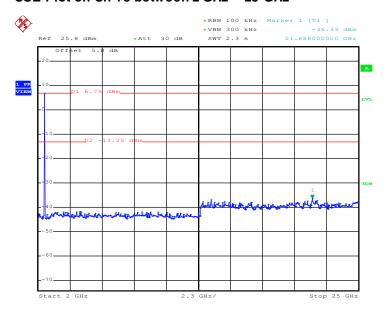

Date: 9.MAY.2018 22:33:24

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 54 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.8 Radiated Band Edges and Spurious Emission Measurement

## 3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

## 3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 55 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

#### 3.8.3 Test Procedures

1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.

Report No.: FR832104A

- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1 GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Page Number

Report Version


: 56 of 63

: Rev. 01

Report Issued Date: Jun. 12, 2018

## 3.8.4 Test Setup


#### For radiated emissions below 30MHz

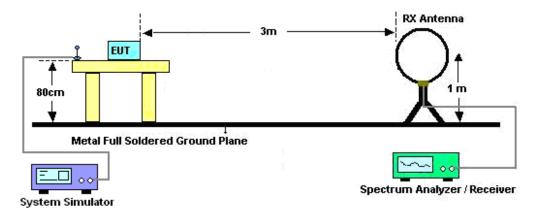

For radiated emissions from 30MHz to 1GHz



#### For radiated emissions above 1GHz

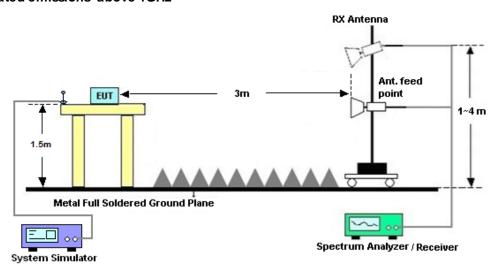

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 57 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

## 3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix B.

## 3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10<sup>th</sup> Harmonic)

Please refer to Appendix B.

## 3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix C.

Sporton International (Kunshan) Inc. TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 58 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

### 3.9 AC Conducted Emission Measurement

### 3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Fraguency of emission (MHz)	Conducted limit (dBµV)			
Frequency of emission (MHz)	Quasi-peak	Average		
0.15-0.5	66 to 56*	56 to 46*		
0.5-5	56	46		
5-30	60	50		

<sup>\*</sup>Decreases with the logarithm of the frequency.

## 3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.9.3 Test Procedures


- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 59 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.9.4 Test Setup

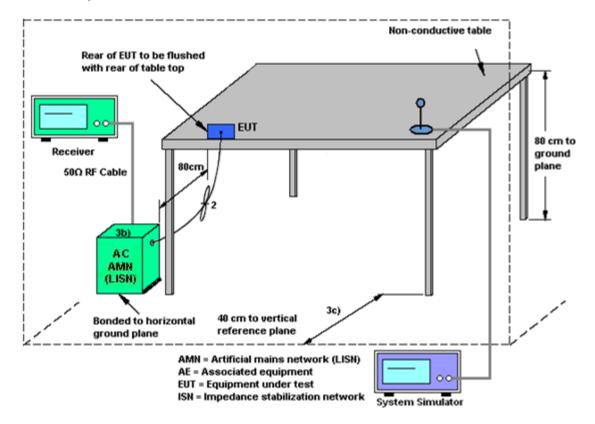

### 3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 60 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 3.10 Antenna Requirements

## 3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

## 3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

#### 3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 61 of 63
Report Issued Date : Jun. 12, 2018

Report No.: FR832104A

Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

# 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101040	10Hz~40GHz	Aug. 08, 2017	May 08, 2018~ May 09, 2018	Aug. 07, 2018	Conducted (TH01-KS)
Spectrum Analyzer	R&S	FSP40	100319	9kHz~40GHz	Oct. 12, 2017	May 08, 2018~ May 09, 2018	Oct. 11, 2018	Conducted (TH01-KS)
Pulse Power Senor	Anritsu	MA2411B	0917070	300MHz~40GH z	Jan. 18, 2018	May 08, 2018~ May 09, 2018	Jan. 17, 2019	Conducted (TH01-KS)
Pow er Meter	Anritsu	ML2495A	1005002	50MHz Bandw idth	Jan. 18, 2018	May 08, 2018~ May 09, 2018	Jan. 17, 2019	Conducted (TH01-KS)
EMI Test Receiver	Keysight	N9038A	MY564000 23	3Hz~8.5GHz;M ax 30dBm	Oct. 19, 2017	May 10, 2018	Oct. 18, 2018	Radiation (03CH04-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY553705 28	10Hz-44GHz	Oct. 10, 2017	May 10, 2018	Oct. 09, 2018	Radiation (03CH04-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 22, 2017	May 10, 2018	Oct. 21, 2018	Radiation (03CH04-KS)
Bilog Antenna	TeseQ	CBL6111D	44483	30MHz-1GHz	Jan. 29, 2018	May 10, 2018	Jan. 28, 2019	Radiation (03CH04-KS)
Horn Antenna	Schw arzbeck	BBHA9120D	1648	1GHz~18GHz	Dec. 16, 2017	May 10, 2018	Dec. 15, 2018	Radiation (03CH04-KS)
SHF-EHF Horn	Schw arzbeck	BBHA 9170	BBHA 1702 49	15GHz~40GHz	Feb. 07, 2018	May 10, 2018	Feb. 06, 2019	Radiation (03CH04-KS)
Amplifier	Burgeon	BPA-530	102219	0.01MHz ~3000MHz	Dec. 16, 2017	May 10, 2018	Dec. 15, 2018	Radiation (03CH04-KS)
Amplifier	MITEQ	TTA 1840-35- HG	2014749	18~40GHz	Feb. 08, 2018	May 10, 2018	Feb. 07, 2019	Radiation (03CH04-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	1Ghz-18Ghz	Apr. 17, 2018	May 10, 2018	Apr. 16, 2019	Radiation (03CH04-KS)
Amplifier	Keysight	83017A	MY532702 03	500MHz~26.5G Hz	Dec. 16, 2017	May 10, 2018	Dec. 15, 2018	Radiation (03CH04-KS)
AC Pow er Source	Chroma	61601	F1040900 04	N/A	NCR	May 10, 2018	NCR	Radiation (03CH04-KS)
Turn Table	ChamPro	EM 1000-T	060762-T	0~360 degree	NCR	May 10, 2018	NCR	Radiation (03CH04-KS)
Antenna Mast	ChamPro	EM 1000-A	060762-A	1 m~4 m	NCR	May 10, 2018	NCR	Radiation (03CH04-KS)
EMI Receiver	R&S	ESCI7	100768	9kHz~7GHz;	Apr. 19, 2018	May 15, 2018	Apr. 18, 2019	Conduction (CO01-KS)
AC LISN	MessTec	AN3016	060103	9kHz~30MHz	Oct. 13, 2017	May 15, 2018	Oct. 12, 2018	Conduction (CO01-KS)
AC LISN (for auxiliary equipment)	MessTec	AN3016	060105	9kHz~30MHz	Oct. 13, 2017	May 15, 2018	Oct. 12, 2018	Conduction (CO01-KS)
AC Pow er Source	Chroma	61602	ABP00000 0811	AC 0V~300V, 45Hz~1000Hz	Oct. 12, 2017	May 15, 2018	Oct. 11, 2018	Conduction (CO01-KS)

NCR: No Calibration Required

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 62 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

# 5 Uncertainty of Evaluation

## Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of Confidence	2.9dB
of 95% (U = 2Uc(y))	2.900

## <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	4.1dB
of 95% $(U = 2Uc(y))$	4. IUB

#### Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	4.1dB
of 95% (U = 2Uc(y))	4. IUB

#### Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)


Measuring Uncertainty for a Level of Confidence	4.6dB
of 95% (U = 2Uc(y))	

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : 63 of 63
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01


Report No.: FR832104A

## **Appendix A. AC Conducted Emission Test Results**

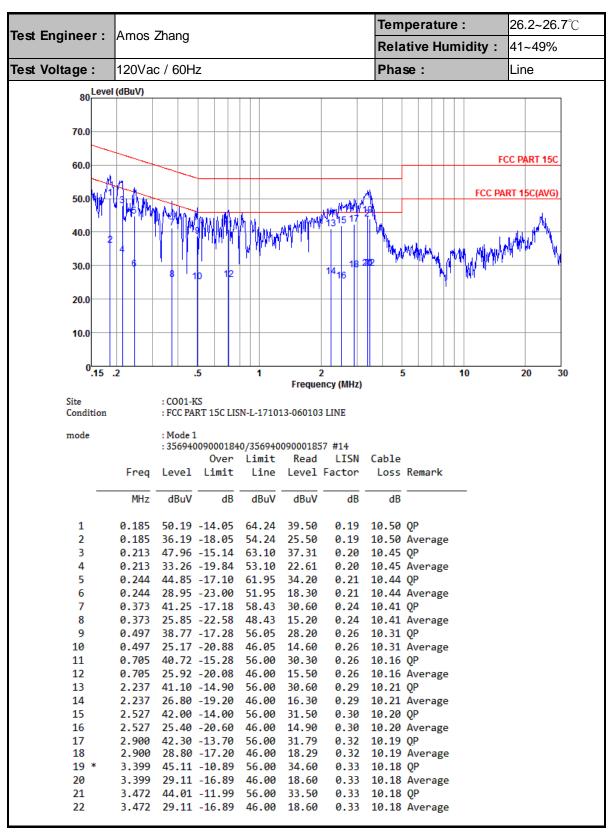

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : A1 of A2
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR832104A

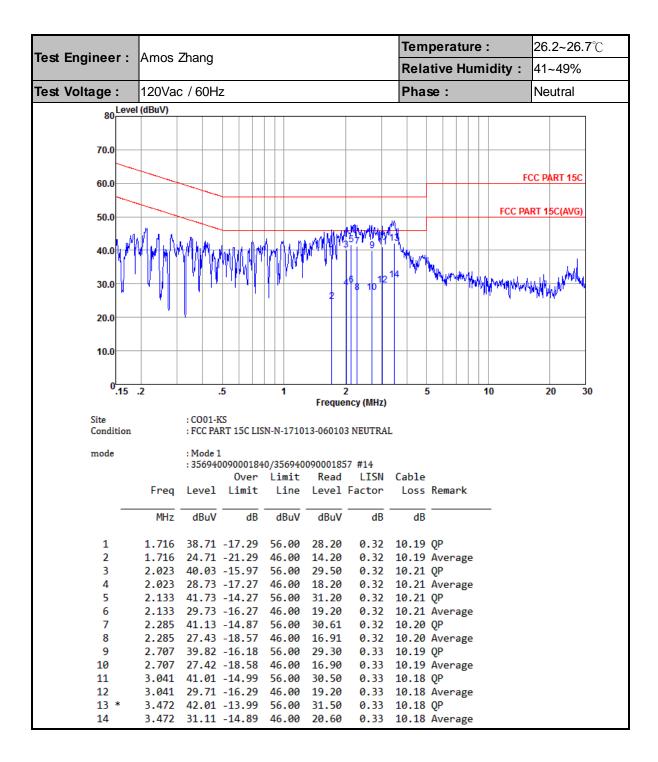

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : A2 of A2
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR832104A

# Appendix B. Radiated Spurious Emission

### 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	( dBµV/m )	(dBµV)	( dB/m )	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2376.17	51.95	-22.05	74	49.19	31.27	5.63	34.14	108	319	Р	Н
	*	2376.17	27.16	-26.84	54	-	-	-	-	-	-	Α	Н
DT		2402	104.97	-	-	102.16	31.3	5.65	34.14	108	319	Р	Н
BT CH00		2402	80.18	-	-	-	-	•	-	-	-	Α	Н
2402MHz		2382.28	51.55	-22.45	74	48.79	31.27	5.63	34.14	119	250	Р	V
2402WII IZ	*	2382.28	26.76	-27.24	54	-	ı	1	-	-	-	Α	٧
		2402	106.65	-	-	103.84	31.3	5.65	34.14	119	250	Р	V
		2402	81.86	-	ı	-	ı	1	-	-	-	Α	٧
		2480	101.86	-	-	98.95	31.44	5.75	34.28	108	319	Р	Н
	*	2480	77.07	-	ı	-	ı	1	-	-	-	Α	Н
D.T.		2483.5	53.88	-20.12	74	50.97	31.44	5.75	34.28	108	319	Р	Н
BT CH 78		2483.5	29.09	-24.91	54	-	ı	1	-	-	-	Α	Н
2480MHz		2480	104.57	-	-	101.66	31.44	5.75	34.28	119	250	Р	٧
2400WINZ	*	2480	79.78	-	-	-	-	ı	-	-	-	Α	V
		2483.55	52.21	-21.79	74	49.3	31.44	5.75	34.28	119	250	Р	V
		2483.55	27.42	-26.58	54	-	-	1	-	-	-	Α	V
Remark		o other spuriou results are PA		Peakand	Average lim	itline.							

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : B1 of B5
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## 2.4GHz 2400~2483.5MHz

## BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
ВТ		4806	50.8	-23.2	74	59.73	35.66	7.84	52.43	150	360	Р	Н
		4806	26.01	-27.99	54	-	-	-	-	-	-	Α	Н
CH 00 2402MHz		4806	55.58	-18.42	74	64.51	35.66	7.84	52.43	150	360	Р	V
2402141712		4806	30.79	-23.21	54	-	•	-	-	-	-	Α	V
		4884	51.3	-22.7	74	60.32	35.61	7.9	52.53	100	360	Р	Η
DT		4884	26.51	-27.49	54	-	-	-	-	-	-	Α	Н
BT CH 39		7320	44	-30	74	52.98	35.9	9.51	54.39	100	360	Р	Н
2441MHz		4884	53.69	-20.31	74	62.71	35.61	7.9	52.53	100	360	Р	V
244111112		4884	28.9	-25.1	54	-	-	-	-	-	-	Α	V
		7320	43.82	-30.18	74	52.8	35.9	9.51	54.39	100	360	Р	V
		4962	55.65	-18.35	74	64.85	35.54	7.97	52.71	100	360	Р	Н
D.T.		4962	30.86	-23.14	54	-	-	-	-	-	-	Α	Н
BT CH 78		7440	44.17	-29.83	74	52.61	35.97	9.57	53.98	100	360	Р	Н
2480MHz		4962	58.8	-15.2	74	68	35.54	7.97	52.71	100	360	Р	V
2400WII IZ		4962	34.01	-19.99	54	-	-	-	-	-	-	Α	V
		7440	43.37	-30.63	74	51.81	35.97	9.57	53.98	100	360	Р	V
Remark		o other spuriou results are PA		Peak and	Average lim	itline.							

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : B2 of B5
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## **Emission below 1GHz**

## 2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	( dBµV/m )	(dBµV)	( dB/m )	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		30	24.53	-15.47	40	29.86	25.2	0.57	31.1	-	-	Р	Н
		74.62	23.54	-16.46	40	41.06	12.96	0.92	31.4	-	-	Р	Н
		418.97	23.1	-22.9	46	30.37	22.02	2.25	31.54	1	-	Р	Н
		583.87	26.13	-19.87	46	29.66	25.3	2.67	31.5	-	-	Р	Н
0.4011		808.91	29.73	-16.27	46	28.99	28.36	3.17	30.79	1	-	Р	Н
2.4GHz BT		920.46	31.24	-14.76	46	29.75	29.22	3.45	31.18	120	100	Р	Н
LF		30	24.43	-15.57	40	29.76	25.2	0.57	31.1	-	-	Р	V
		148.34	20.99	-22.51	43.5	33.58	16.99	1.31	30.89	-	-	Р	V
		375.32	22.33	-23.67	46	30.7	21.02	2.11	31.5	-	-	Р	V
		652.74	27.8	-18.2	46	29.51	26.02	2.89	30.62	1	-	Р	V
		799.21	29.84	-16.16	46	29.11	28.28	3.15	30.7	1	-	Р	V
		906.88	31.01	-14.99	46	29.63	29.07	3.44	31.13	100	75	Р	V
Remark		o other spuriou results are PA		imitline.									

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : B3 of B5
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A

## Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is <b>over limit</b> line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : B4 of B5
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR832104A

#### A calculation example for radiated spurious emission is shown as below:

Report No.: FR832104A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	( dB/m )	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level( $dB\mu V/m$ ) Limit Line( $dB\mu V/m$ )
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

#### For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level( $dB\mu V/m$ ) Limit Line( $dB\mu V/m$ )
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

 Sporton International (Kunshan) Inc.
 Page Number
 : B5 of B5

 TEL: +86-512-57900158
 Report Issued Date
 : Jun. 12, 2018


 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID: 2AJOTTA-1084 Report Template No.: BU5-FR15CBT Version 2.0




# Appendix C. Duty Cycle Plots

## 3DH5 on time (One Pulse) Plot on Channel 39

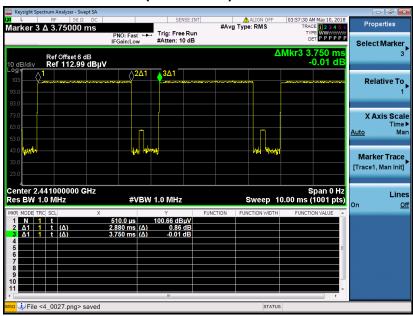

## 3DH5 on time (Count Pulses) Plot on Channel 39

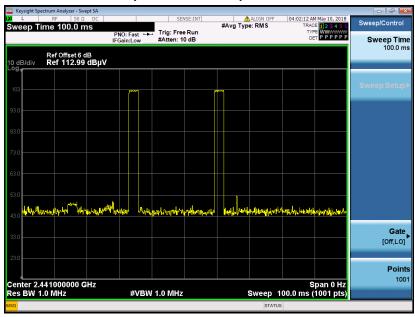

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 \* 2.88 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. 3DH5 has the highest duty cycle worst case and is reported.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1084 Page Number : C1 of C1
Report Issued Date : Jun. 12, 2018
Report Version : Rev. 01

Report No.: FR832104A