


Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

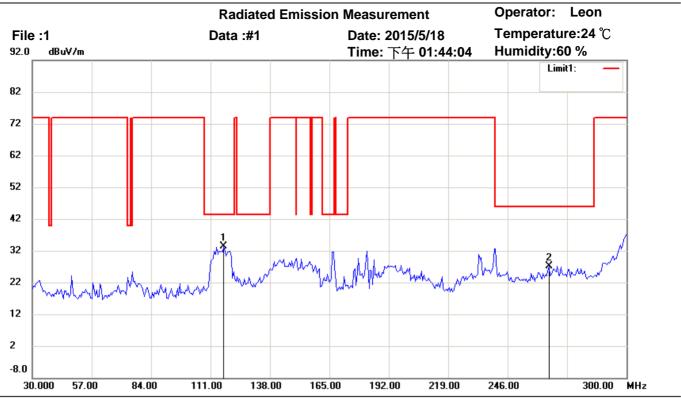

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	117.1142	19.63	peak	13.77	33.40	43.50	100	90	-10.10	
	264.8297	12.27	peak	14.83	27.10	46.00	100	155	-18.90	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

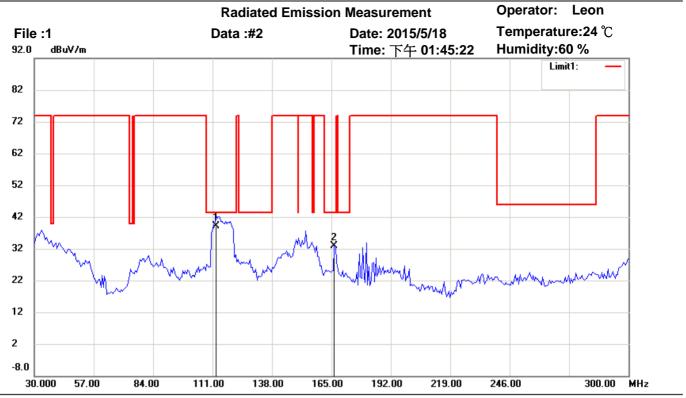

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	112.7856	25.67	QP	13.46	39.13	43.50	100	35	-4.37	
	166.3527	17.62	peak	15.24	32.86	43.50	100	120	-10.64	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

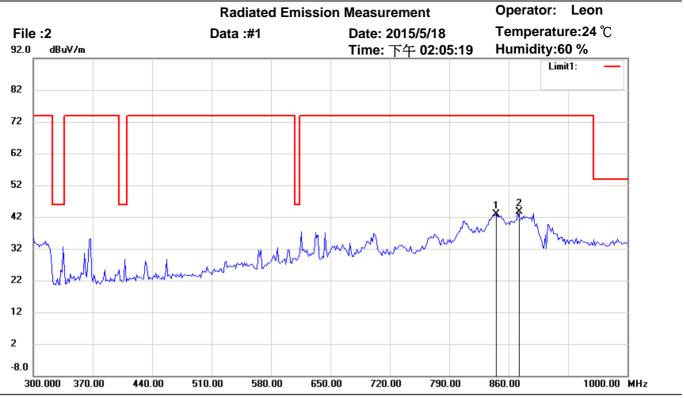

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	845.6914	15.39	peak	27.46	42.85	74.00	100	120	-31.15	
*	870.9420	15.73	peak	27.89	43.62	74.00	100	145	-30.38	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

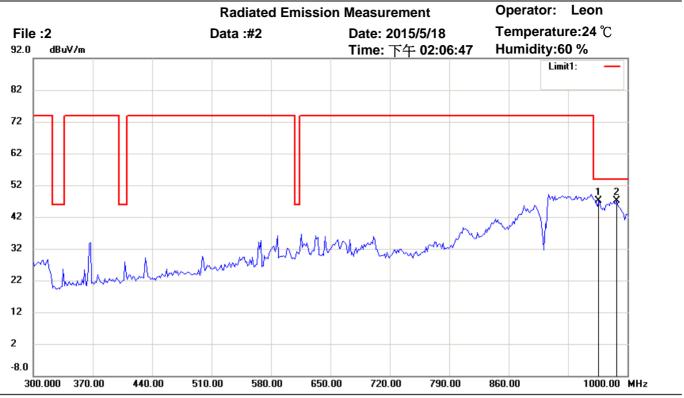

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	966.3327	18.46	peak	28.61	47.07	54.00	100	230	-6.93	
*	987.3747	18.34	peak	28.87	47.21	54.00	100	85	-6.79	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

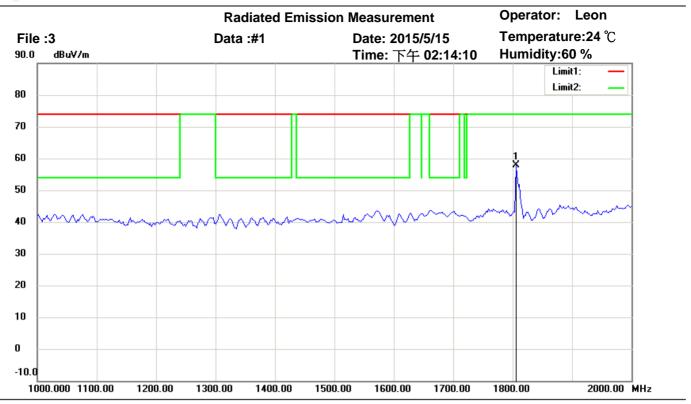

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1805.611	65.02	peak	-7.20	57.82	74.00	100	155	-16.18	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

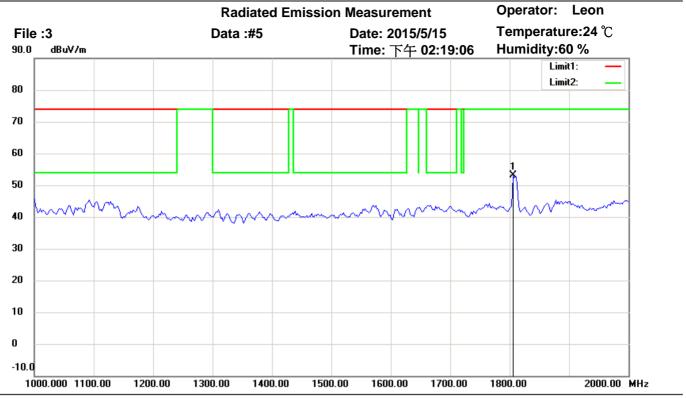

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

	Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
Ī	*	1805.611	60.31	peak	-7.20	53.11	74.00	100	55	-20.89	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

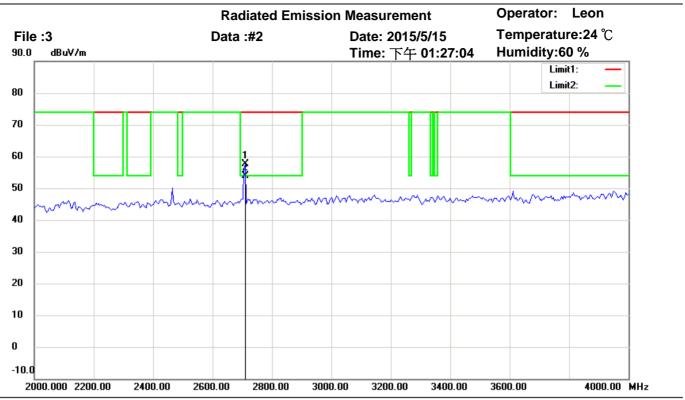

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.377	60.72	peak	-3.08	57.64	74.00	100	35	-16.36	
*	2708.377	56.85	AVG	-3.08	53.77	54.00	100	35	-0.23	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

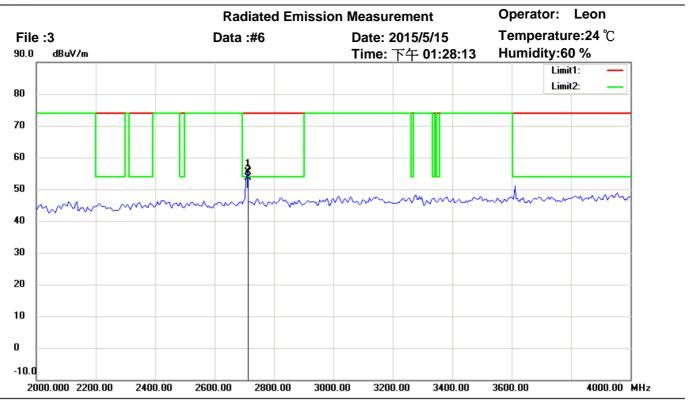

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2709.419	58.46	peak	-3.08	55.38	74.00	100	210	-18.62	
*	2709.419	56.69	AVG	-3.08	53.61	54.00	100	210	-0.39	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

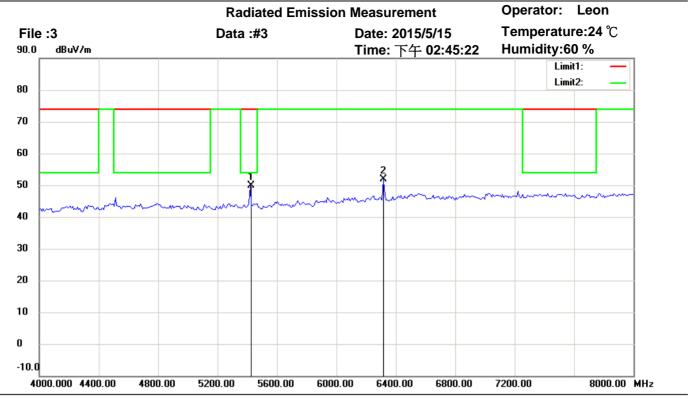

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5418.838	47.56	peak	2.34	49.90	74.00	100	95	-24.10	
*	6316.633	47.20	peak	4.79	51.99	74.00	100	130	-22.01	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

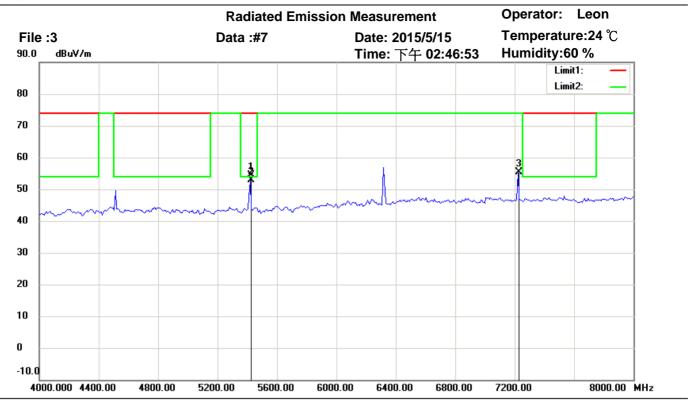

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5418.838	52.11	peak	2.34	54.45	74.00	100	155	-19.55	
*	5418.838	50.49	AVG	2.34	52.83	54.00	100	155	-1.17	
	7222.445	50.74	peak	4.76	55.50	74.00	100	75	-18.50	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

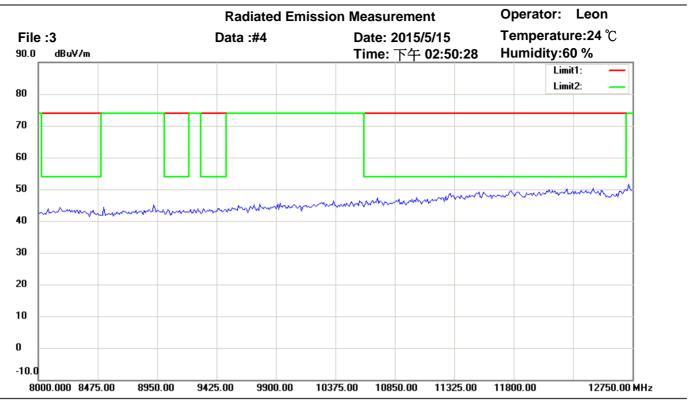

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

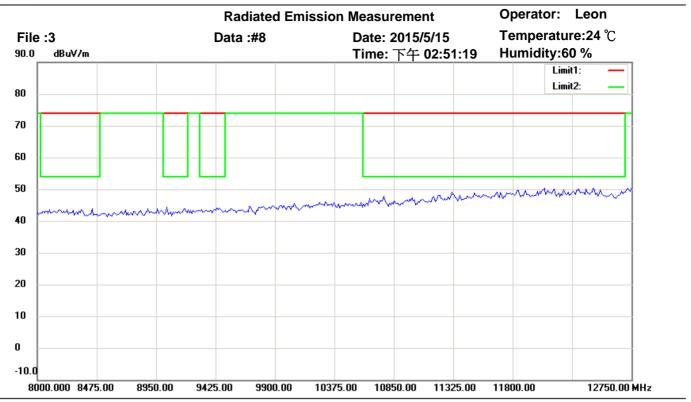

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

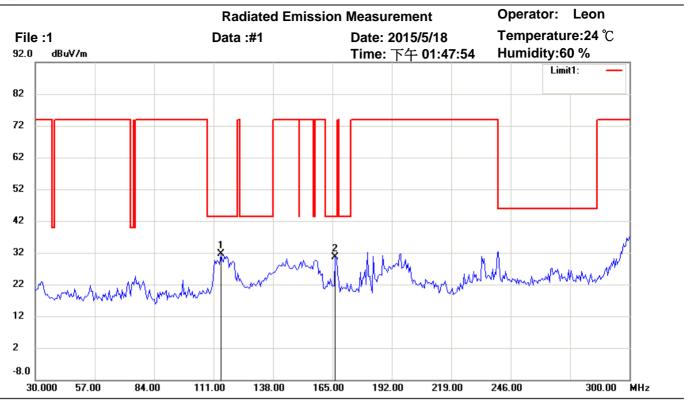

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	114.4088	18.02	peak	13.58	31.60	43.50	100	210	-11.90	
	166.3527	15.48	peak	15.24	30.72	43.50	100	155	-12.78	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

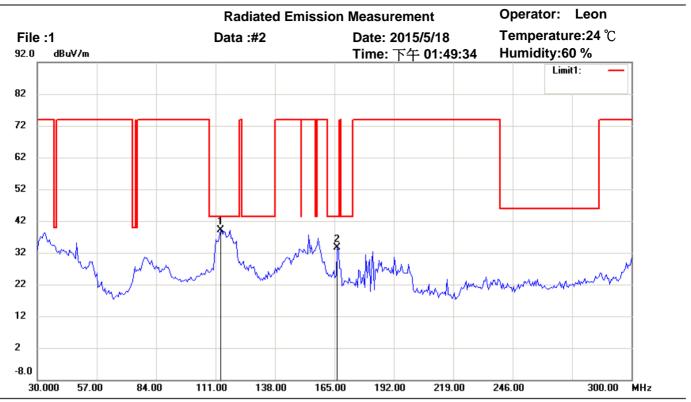

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	113.3267	25.70	peak	13.50	39.20	43.50	100	75	-4.30	
	166.3527	18.45	peak	15.24	33.69	43.50	100	120	-9.81	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

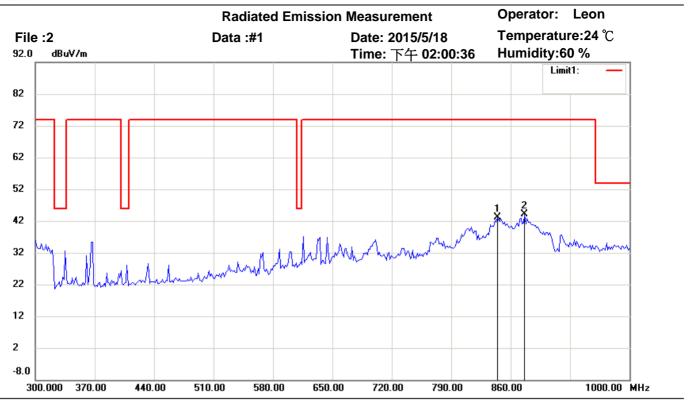

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	844.2886	15.62	peak	27.43	43.05	74.00	100	155	-30.95	
*	876.5531	16.19	peak	27.99	44.18	74.00	100	20	-29.82	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

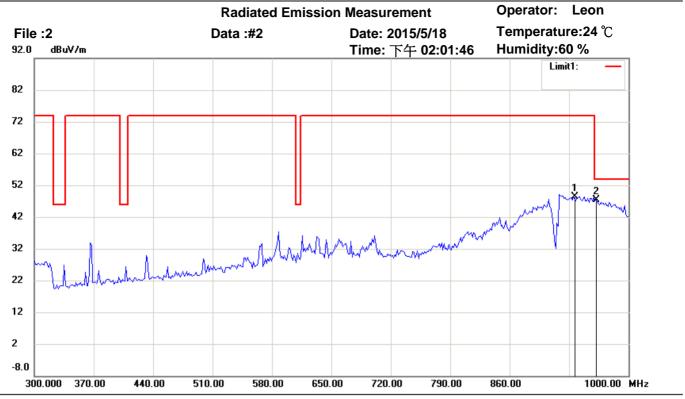

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	935.4710	20.07	peak	28.39	48.46	74.00	100	190	-25.54	
*	962.1242	18.85	peak	28.55	47.40	54.00	100	65	-6.60	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

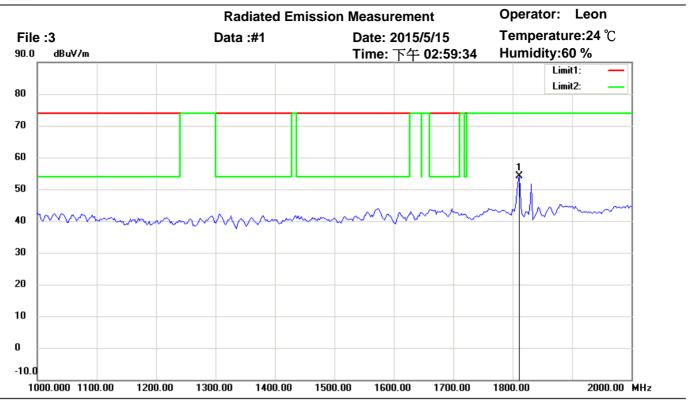

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
Ī	*	1811.623	61.16	peak	-7.12	54.04	74.00	100	175	-19.96	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

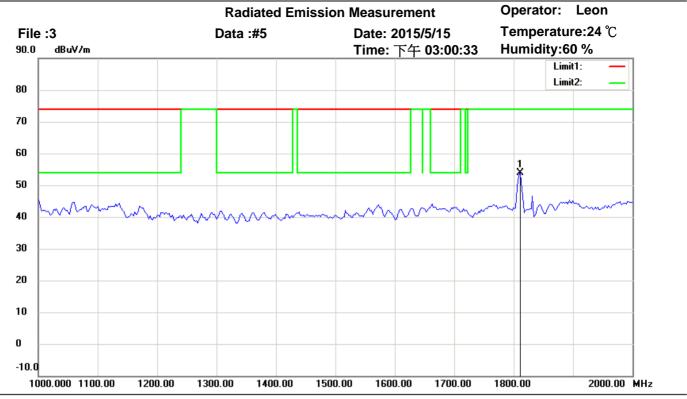

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

	Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
Ī	*	1811.623	60.97	peak	-7.12	53.85	74.00	100	90	-20.15	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

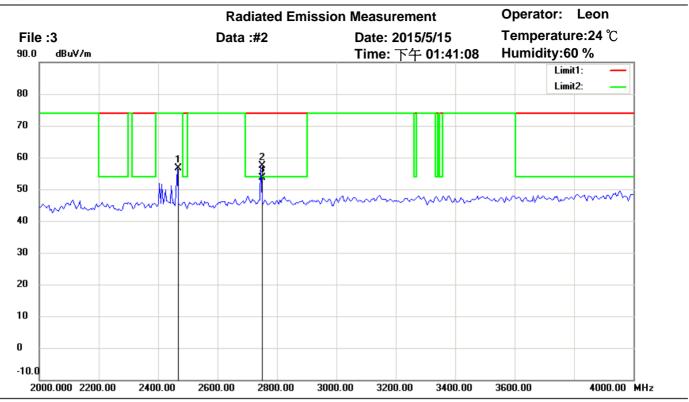

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2464.930	60.68	peak	-3.95	56.73	74.00	100	120	-17.27	
	2745.810	60.35	peak	-2.97	57.38	74.00	100	243	-16.62	
*	2745.810	56.65	AVG	-2.97	53.68	54.00	100	243	-0.32	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

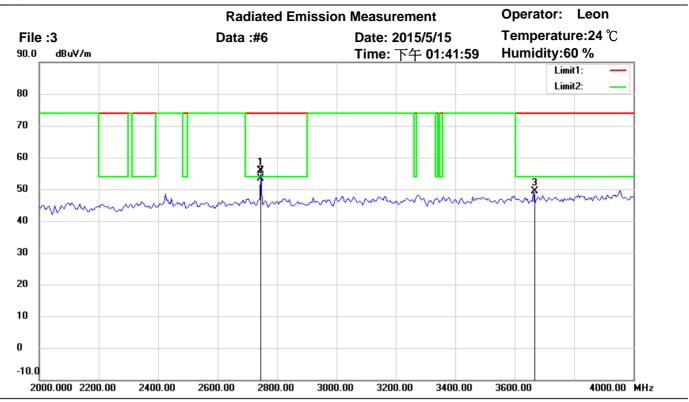

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.491	58.79	peak	-2.97	55.82	74.00	100	95	-18.18	
*	2745.491	56.35	AVG	-2.97	53.38	54.00	100	95	-0.62	
	3663.327	50.42	peak	-1.15	49.27	74.00	100	30	-24.73	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

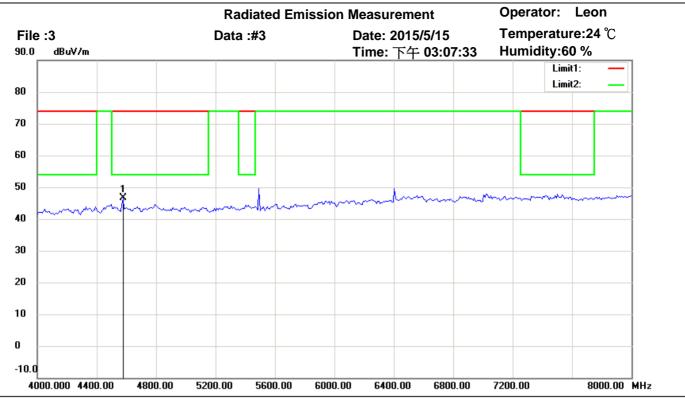

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
Ī	*	4577.154	45.72	peak	0.82	46.54	74.00	100	50	-27.46	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

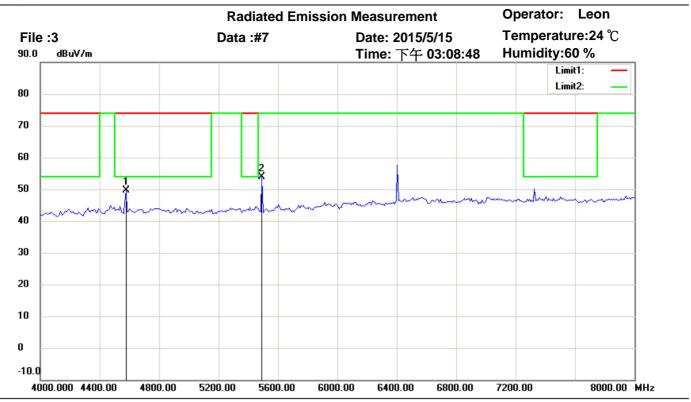

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4577.154	48.81	peak	0.82	49.63	74.00	100	145	-24.37	
*	5490.982	51.47	peak	2.44	53.91	74.00	100	230	-20.09	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

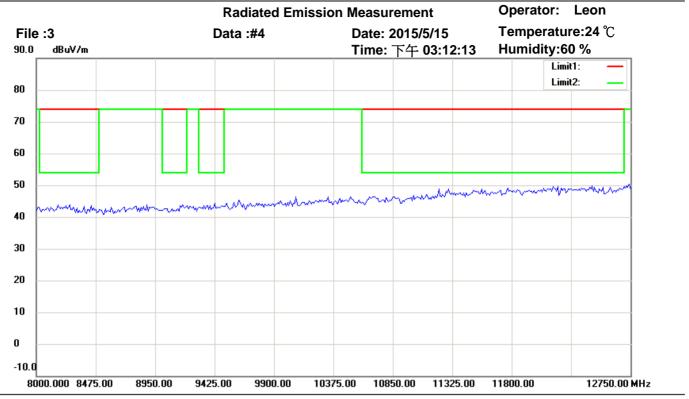

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

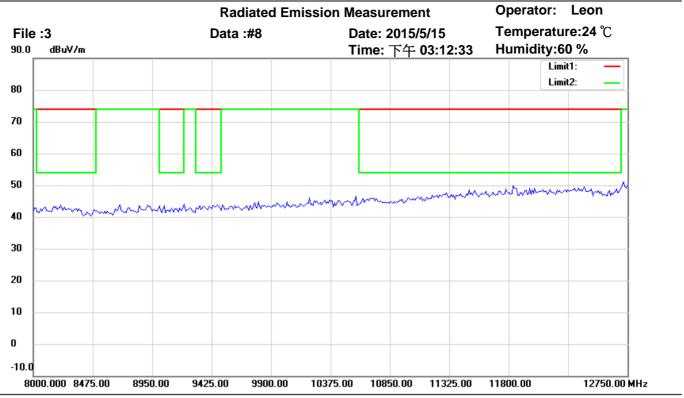

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

NAI-	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

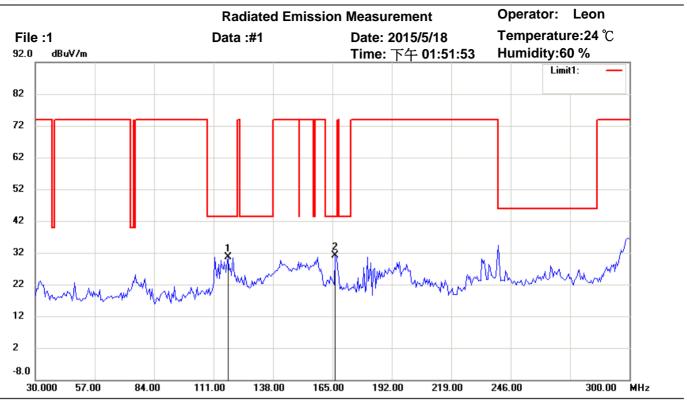

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	117.6553	16.73	peak	13.81	30.54	43.50	100	130	-12.96	
*	166.3527	15.92	peak	15.24	31.16	43.50	100	55	-12.34	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

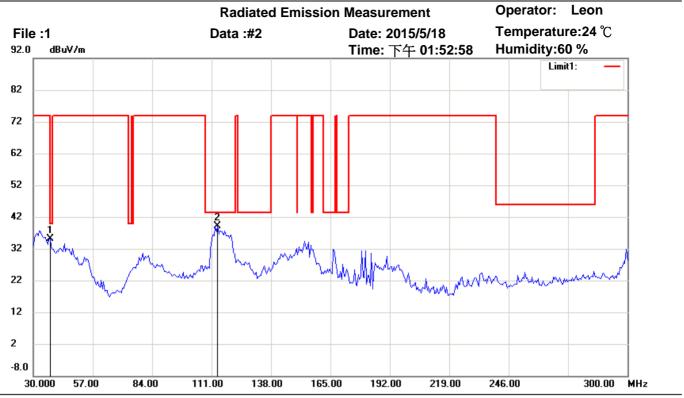

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.5752	20.91	peak	14.31	35.22	40.00	100	175	-4.78	
*	113.8677	25.68	peak	13.54	39.22	43.50	100	310	-4.28	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

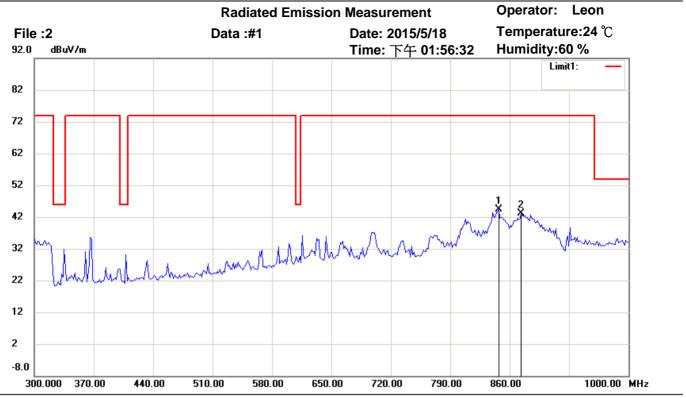

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	847.0942	16.83	peak	27.49	44.32	74.00	100	145	-29.68	
	873.7475	15.15	peak	27.94	43.09	74.00	100	110	-30.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

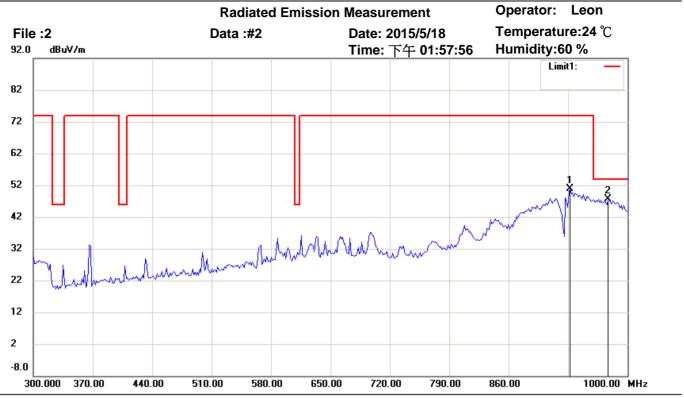

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	932.6653	22.49	peak	28.39	50.88	74.00	100	170	-23.12	
*	977.5551	18.85	peak	28.75	47.60	54.00	100	35	-6.40	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

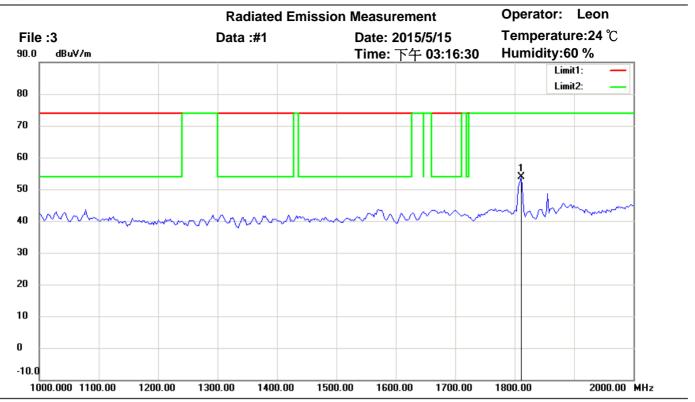

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1811.623	61.10	peak	-7.12	53.98	74.00	100	155	-20.02	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

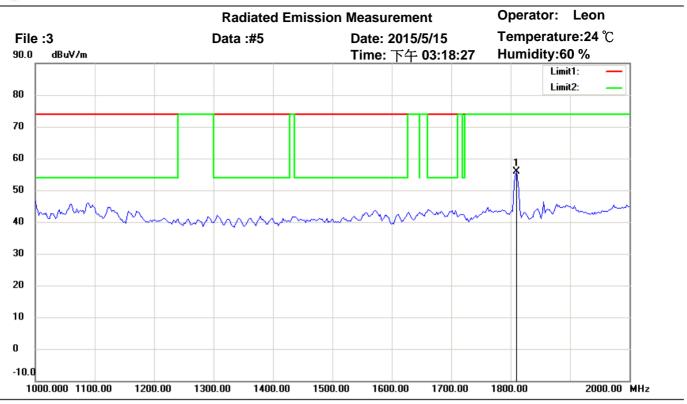

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1809.619	62.98	peak	-7.15	55.83	74.00	100	210	-18.17	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

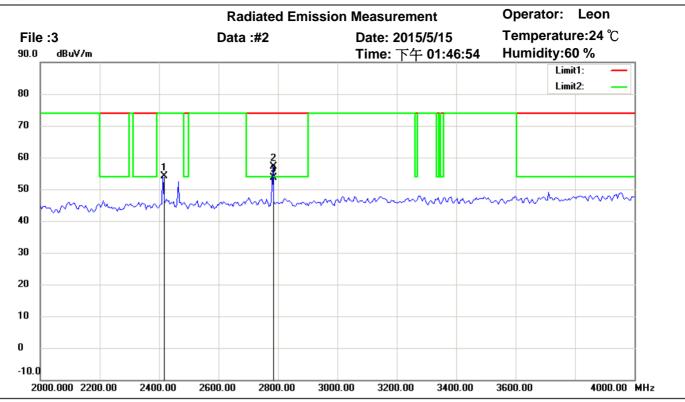

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2412.826	58.14	peak	-4.05	54.09	74.00	100	170	-19.91	
	2781.809	59.98	peak	-2.86	57.12	74.00	100	37	-16.88	
*	2781.809	56.59	AVG	-2.86	53.73	54.00	100	37	-0.27	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

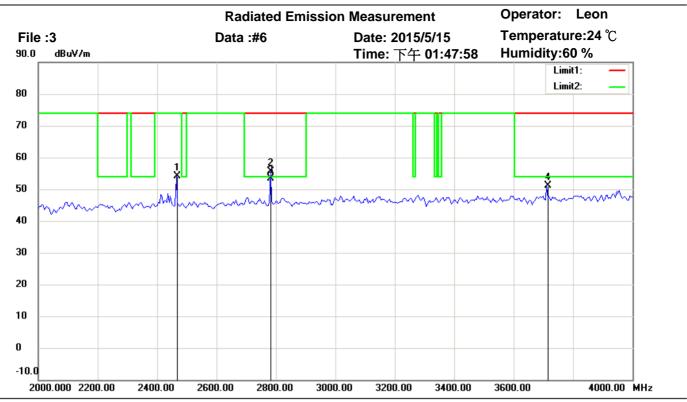

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2464.930	58.09	peak	-3.95	54.14	74.00	100	85	-19.86	
	2781.563	58.54	peak	-2.86	55.68	74.00	100	135	-18.32	
*	2781.563	56.31	AVG	-2.86	53.45	54.00	100	135	-0.55	
	3711.423	52.22	peak	-1.13	51.09	74.00	100	90	-22.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

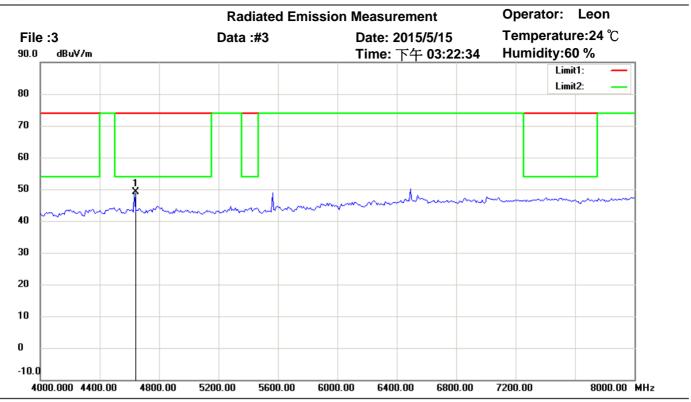

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	4633.267	48.62	peak	0.61	49.23	74.00	100	215	-24.77	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

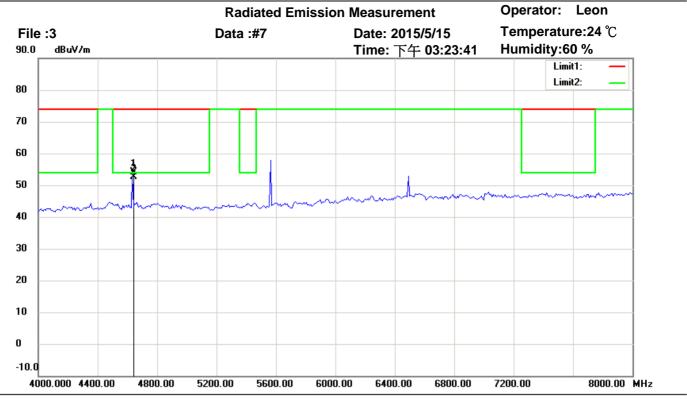

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4633.267	53.46	peak	0.61	54.07	74.00	100	115	-19.93	
*	4633.267	51.96	AVG	0.61	52.57	54.00	100	155	-1.43	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

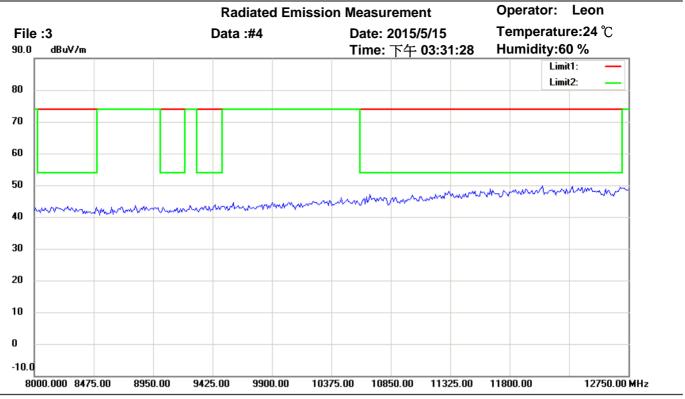

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

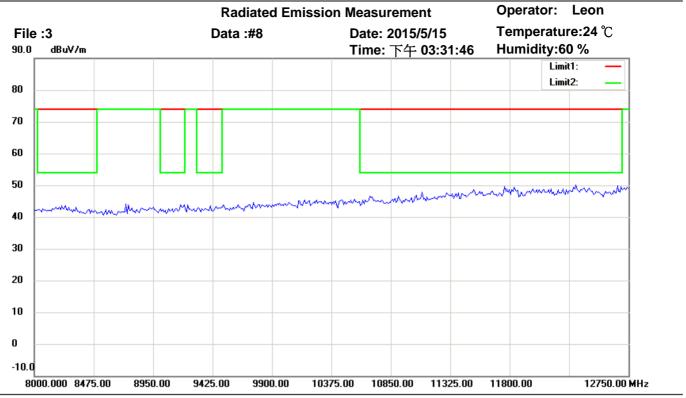

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

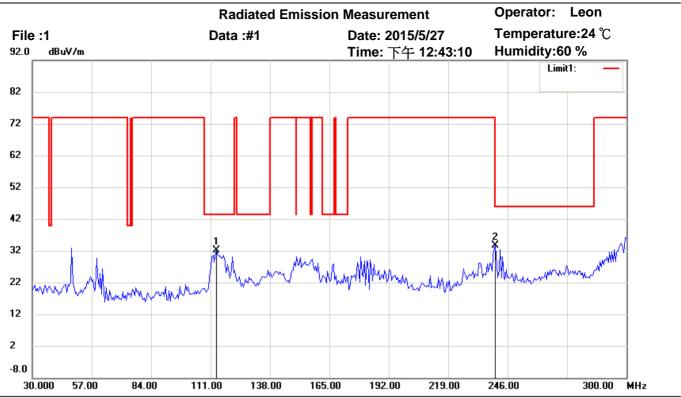

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	113.8677	18.54	peak	13.54	32.08	43.50	100	155	-11.42	
	240.4810	19.39	peak	14.21	33.60	46.00	100	90	-12.40	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

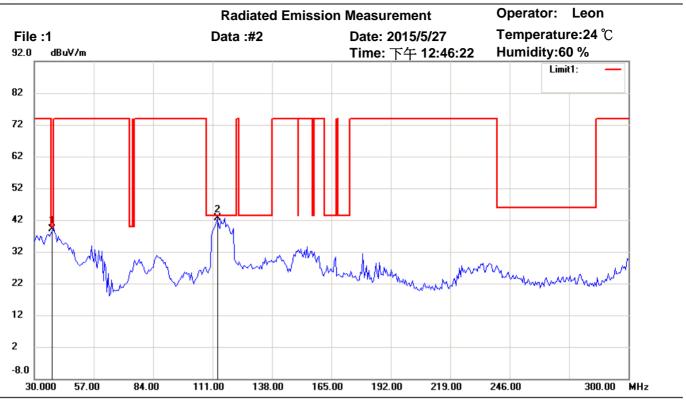

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	38.1162	24.69	QP	14.37	39.06	40.00	100	155	-0.94	
*	113.3267	29.09	QP	13.50	42.59	43.50	100	210	-0.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

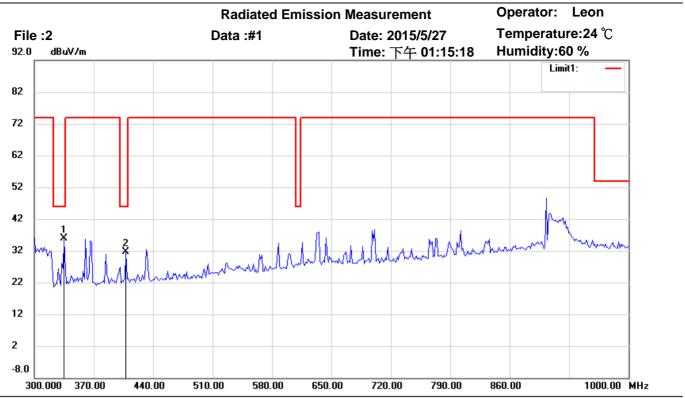

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	19.00	peak	16.99	35.99	46.00	100	135	-10.01	
	408.0160	12.59	peak	19.00	31.59	46.00	100	60	-14.41	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

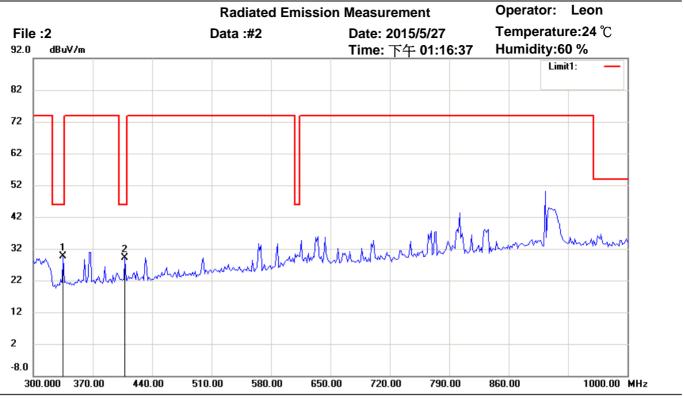

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	12.57	peak	16.99	29.56	46.00	100	20	-16.44	
	408.0160	10.03	peak	19.00	29.03	46.00	100	185	-16.97	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

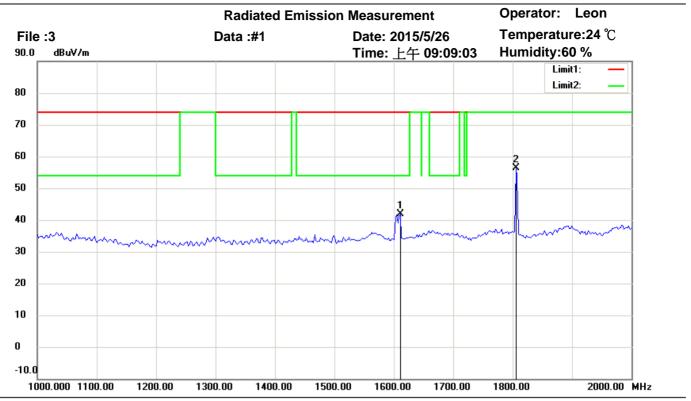

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1611.222	49.57	peak	-7.71	41.86	74.00	100	155	-32.14	
*	1805.611	63.55	peak	-7.20	56.35	74.00	100	90	-17.65	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

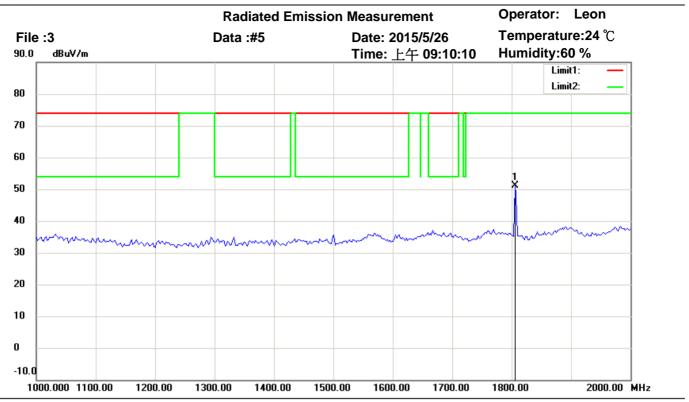

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1805.611	58.25	peak	-7.20	51.05	74.00	100	35	-22.95	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

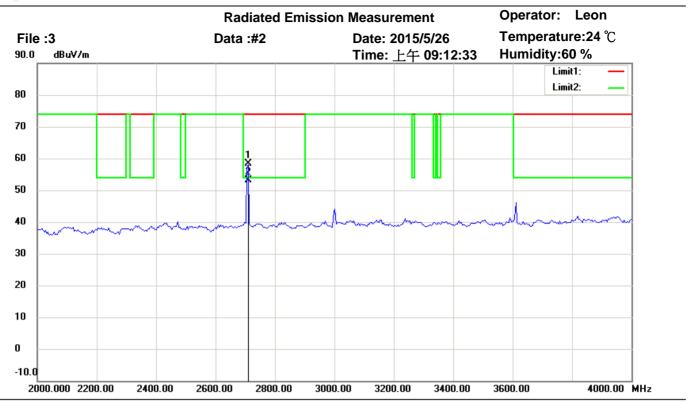

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.495	61.40	peak	-3.08	58.32	74.00	100	308	-15.68	
*	2708.495	56.17	AVG	-3.08	53.09	54.00	100	308	-0.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

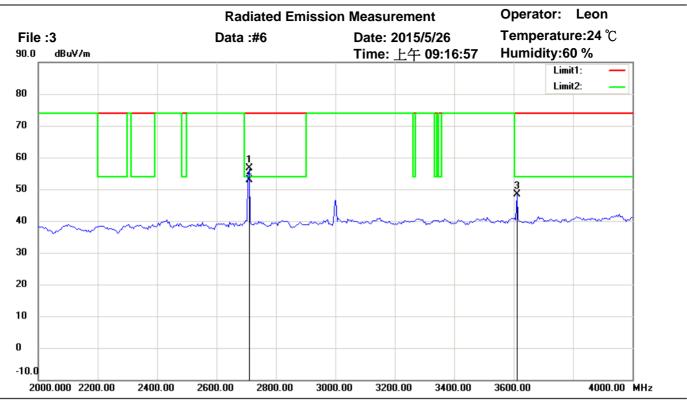

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.272	59.59	peak	-3.08	56.51	74.00	100	168	-17.49	
*	2708.272	56.08	AVG	-3.08	53.00	54.00	100	168	-1.00	
	3611.222	49.64	peak	-1.18	48.46	74.00	100	125	-25.54	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

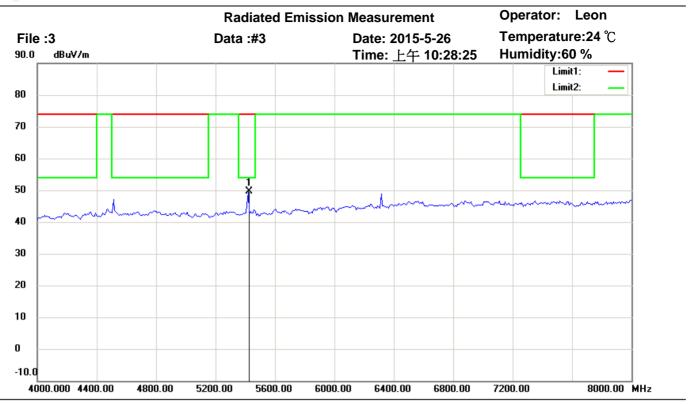

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	5418.838	47.40	peak	2.34	49.74	74.00	100	55	-24.26	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

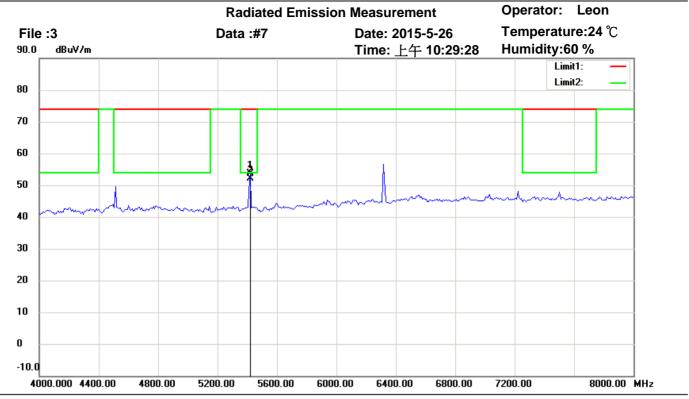

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5416.652	51.26	peak	2.33	53.59	74.00	100	220	-20.41	
*	5416.652	49.85	AVG	2.33	52.18	54.00	100	220	-1.82	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

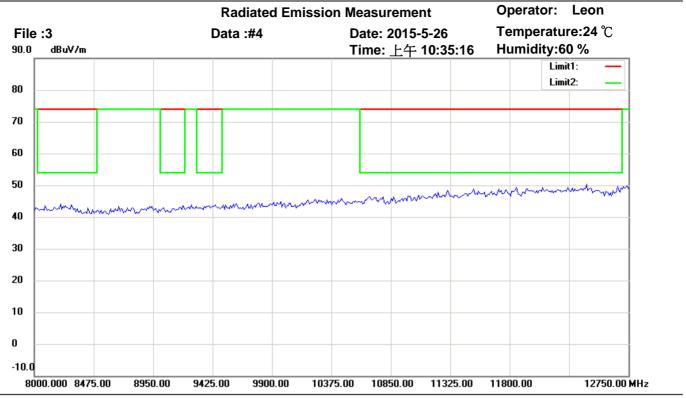

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

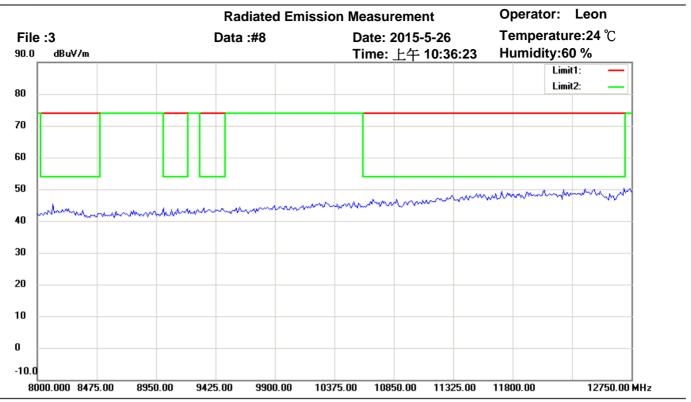

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

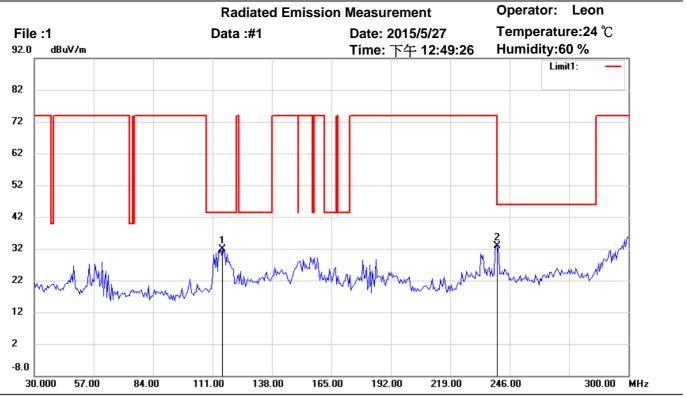

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	114.9500	18.24	peak	13.62	31.86	43.50	100	75	-11.64	
	240.4810	18.65	peak	14.21	32.86	46.00	100	120	-13.14	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

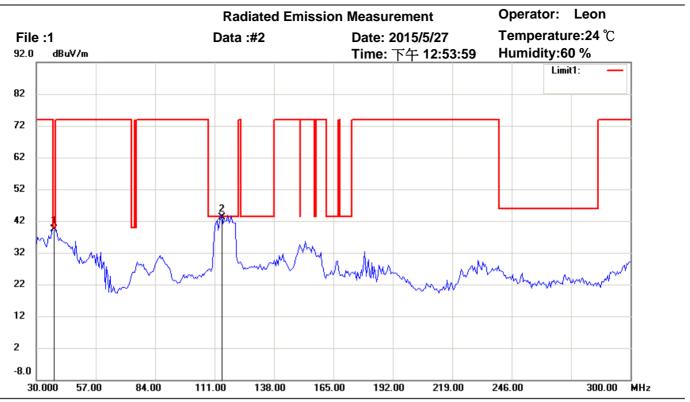

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	38.1162	24.95	QP	14.37	39.32	40.00	100	55	-0.68	
*	114.4088	29.63	QP	13.58	43.21	43.50	100	35	-0.29	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

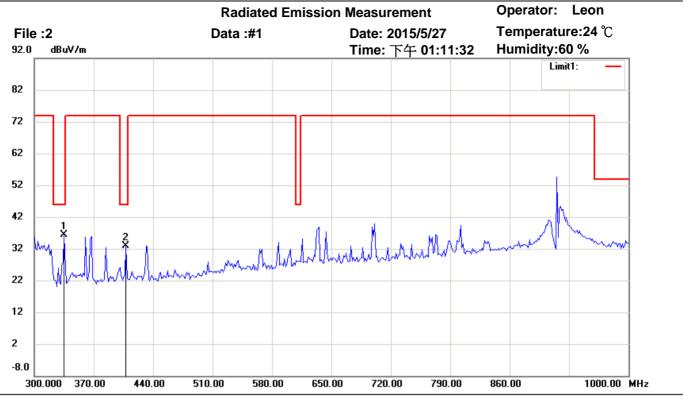

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	19.42	peak	16.99	36.41	46.00	100	25	-9.59	
	408.0160	13.88	peak	19.00	32.88	46.00	100	80	-13.12	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

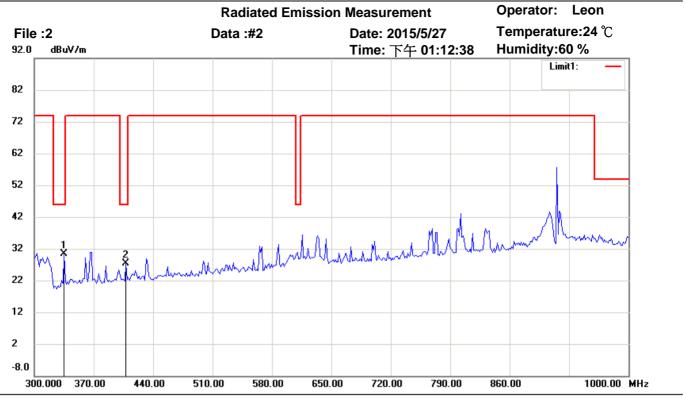

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	13.35	peak	16.99	30.34	46.00	100	50	-15.66	
	408.0160	8.42	peak	19.00	27.42	46.00	100	75	-18.58	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

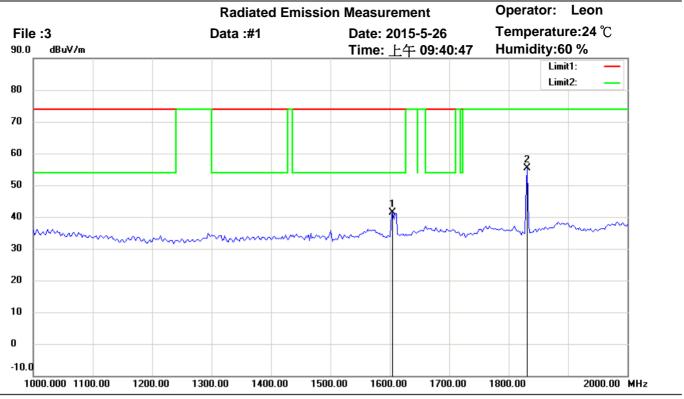

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1605.210	49.22	peak	-7.74	41.48	74.00	100	95	-32.52	
*	1831.663	62.27	peak	-6.86	55.41	74.00	100	160	-18.59	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

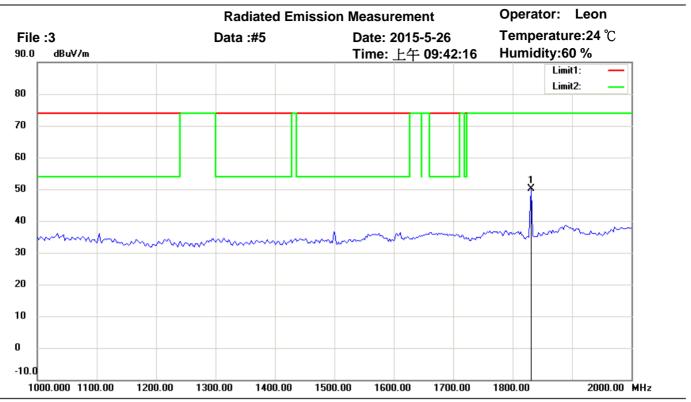

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

	Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
Ī	*	1831.663	57.00	peak	-6.86	50.14	74.00	100	130	-23.86	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

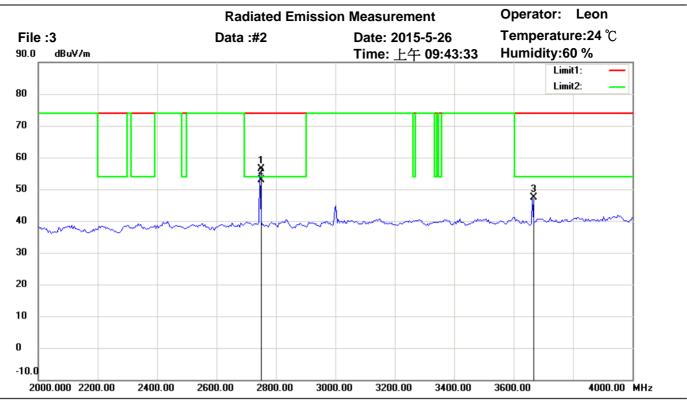

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.958	59.32	peak	-2.97	56.35	74.00	100	310	-17.65	
*	2745.958	55.82	AVG	-2.97	52.85	54.00	100	310	-1.15	
	3663.327	48.53	peak	-1.15	47.38	74.00	100	75	-26.62	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

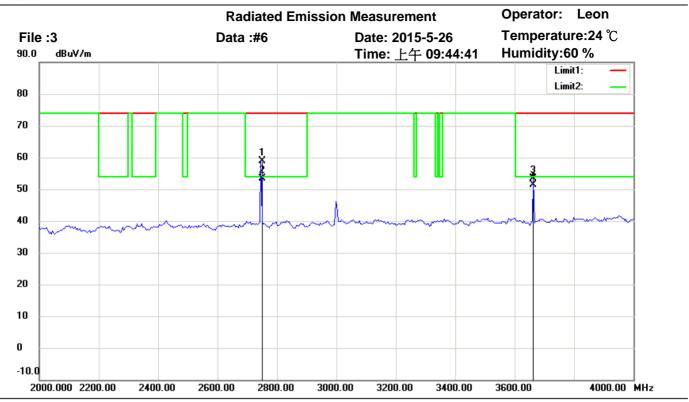

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.881	61.91	peak	-2.97	58.94	74.00	100	178	-15.06	
*	2745.881	56.43	AVG	-2.97	53.46	54.00	100	178	-0.54	
	3661.089	54.45	peak	-1.16	53.29	74.00	100	160	-20.71	
	3661.089	52.64	AVG	-1.16	51.48	54.00	100	160	-2.52	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

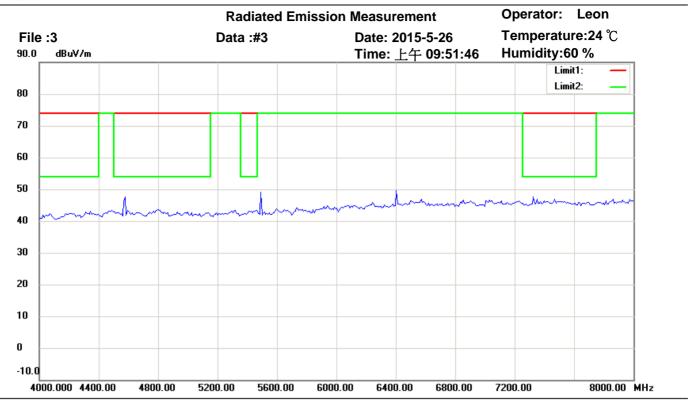

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

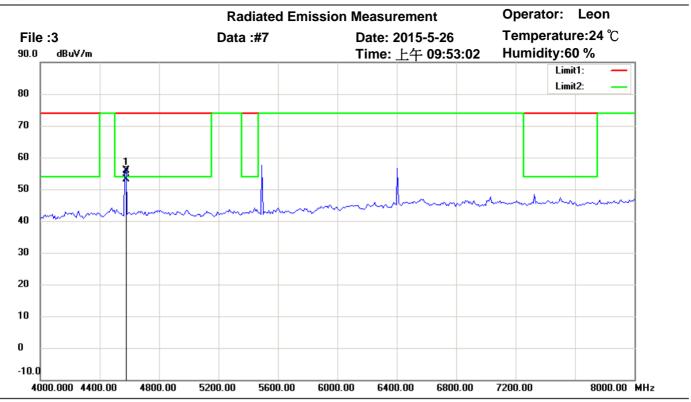

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4576.394	55.11	peak	0.82	55.93	74.00	100	178	-18.07	
*	4576.394	52.43	AVG	0.82	53.25	54.00	100	178	-0.75	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

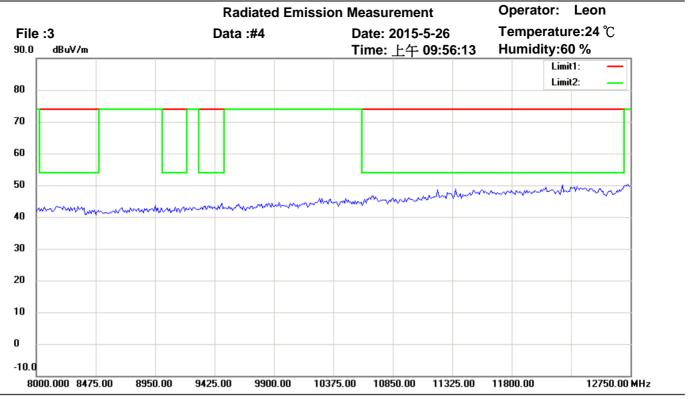

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

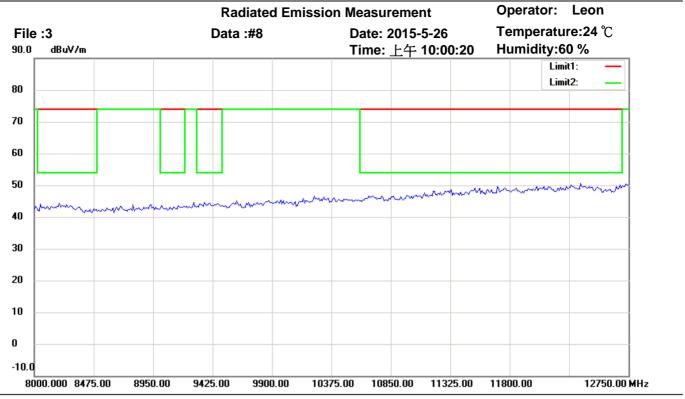

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

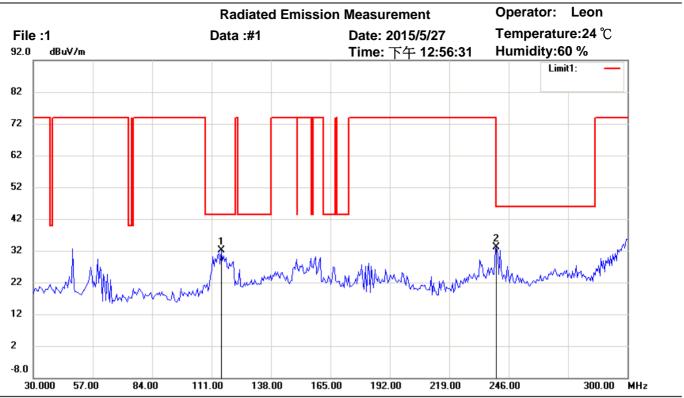

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	115.4910	18.54	peak	13.66	32.20	43.50	100	75	-11.30	
	240.4810	18.92	peak	14.21	33.13	46.00	100	60	-12.87	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

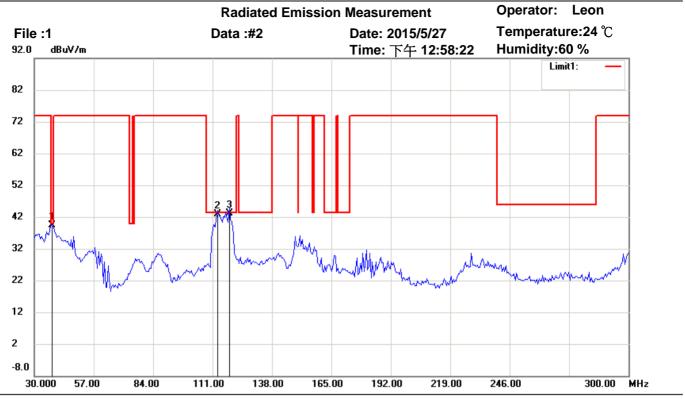

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	38.1162	25.10	QP	14.37	39.47	40.00	100	10	-0.53	
	113.3267	29.42	QP	13.50	42.92	43.50	100	95	-0.58	
*	118.7375	29.31	QP	13.89	43.20	43.50	100	35	-0.30	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

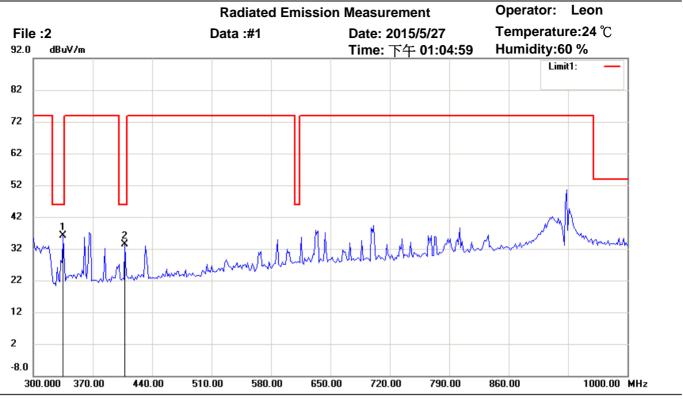

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	19.13	peak	16.99	36.12	46.00	100	155	-9.88	
	408.0160	14.30	peak	19.00	33.30	46.00	100	90	-12.70	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

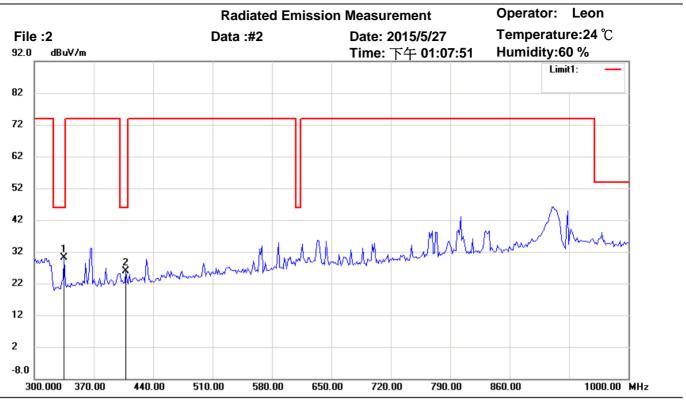

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	335.0701	13.06	peak	16.99	30.05	46.00	100	175	-15.95	
	408.0160	6.87	peak	19.00	25.87	46.00	100	135	-20.13	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

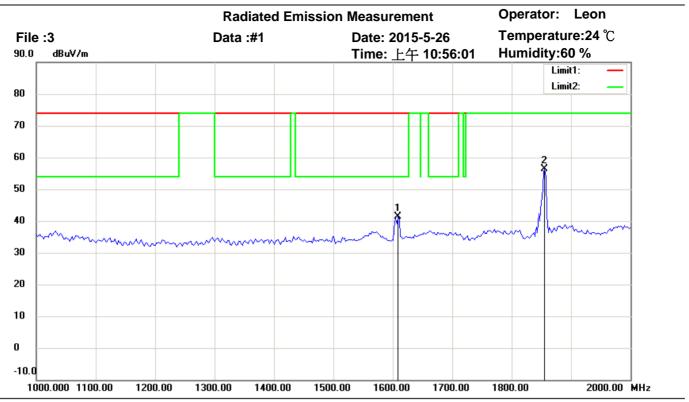

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1609.218	48.98	peak	-7.72	41.26	74.00	100	155	-32.74	
*	1855.711	62.98	peak	-6.56	56.42	74.00	100	90	-17.58	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

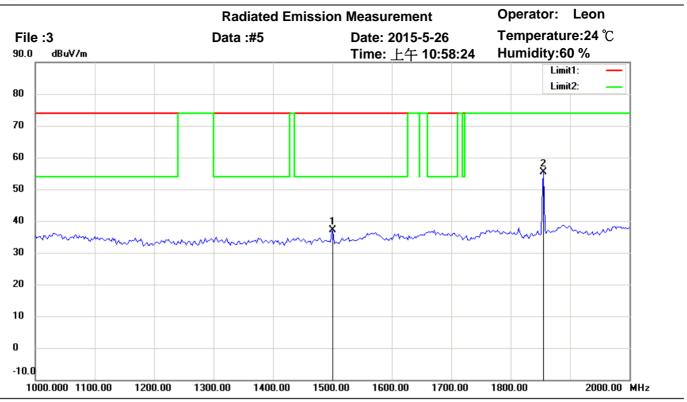

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1501.002	45.94	peak	-8.92	37.02	74.00	100	145	-36.98	
*	1855.711	61.96	peak	-6.56	55.40	74.00	100	110	-18.60	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

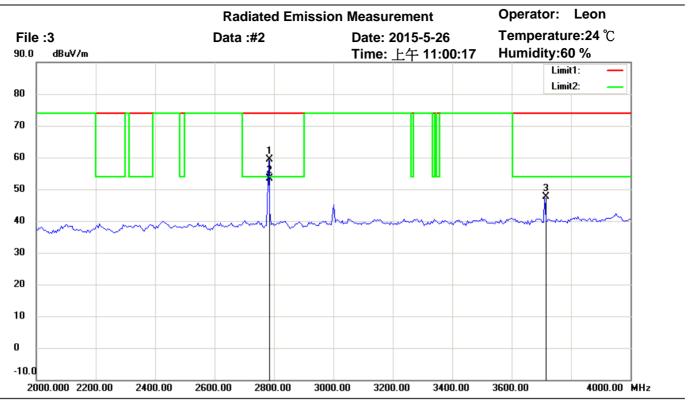

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.848	62.14	peak	-2.86	59.28	74.00	100	322	-14.72	
*	2781.848	56.31	AVG	-2.86	53.45	54.00	100	322	-0.55	
	3711.423	48.86	peak	-1.13	47.73	74.00	100	90	-26.27	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

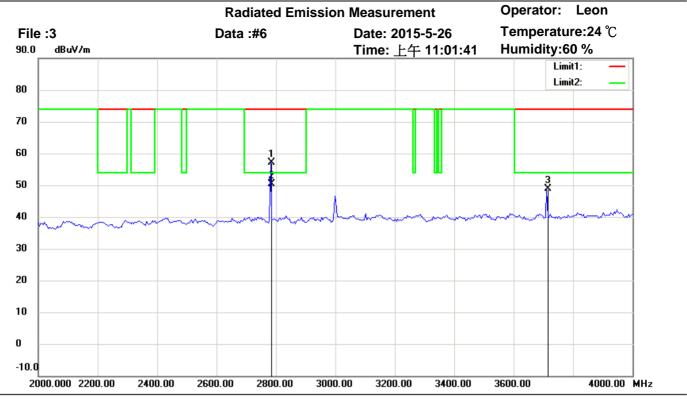

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.805	60.01	peak	-2.86	57.15	74.00	100	315	-16.85	
*	2781.805	53.18	AVG	-2.86	50.32	54.00	100	315	-3.68	
	3711.423	50.03	peak	-1.13	48.90	74.00	100	175	-25.10	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

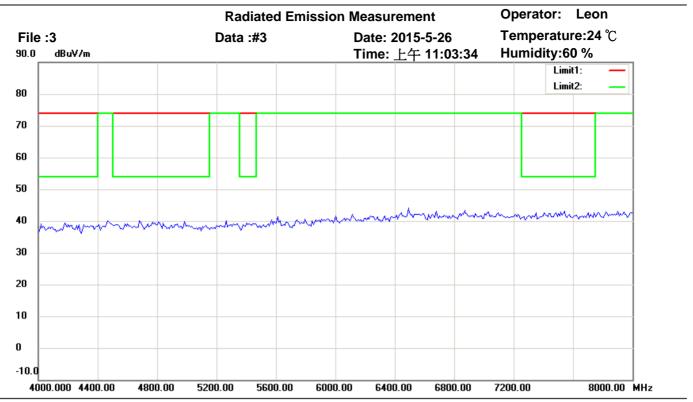

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

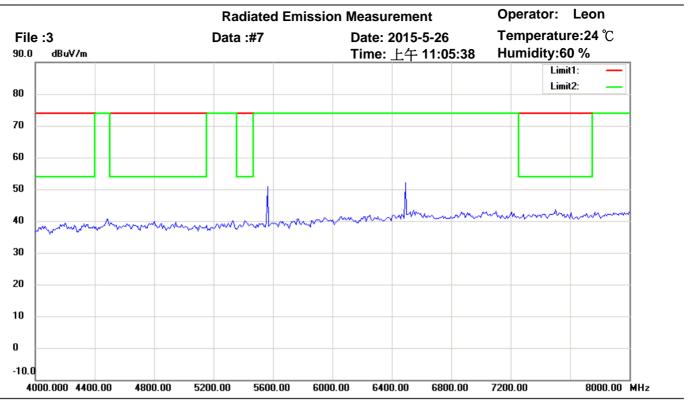

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

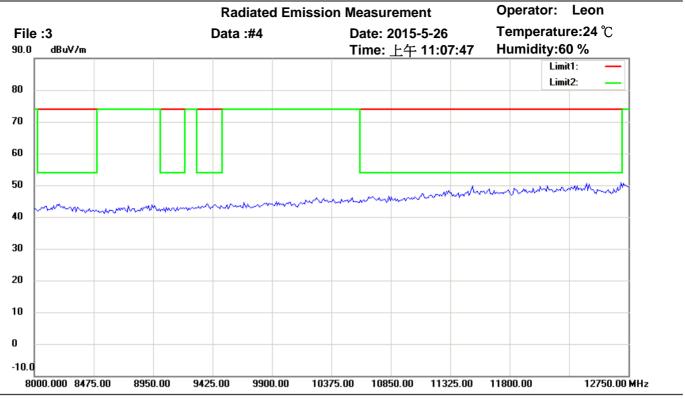

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

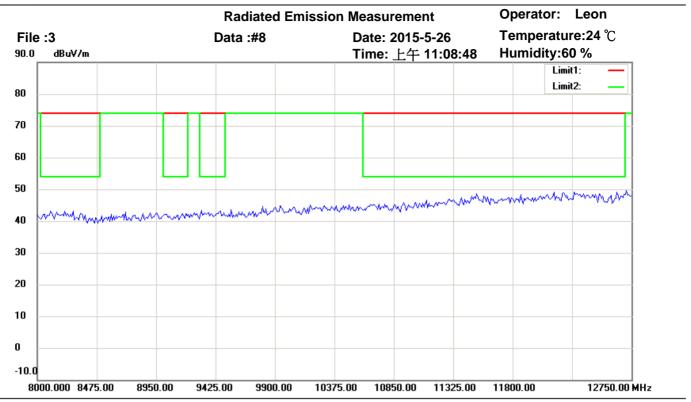

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz


	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

TX_Antenna model: EBD-101



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei

Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

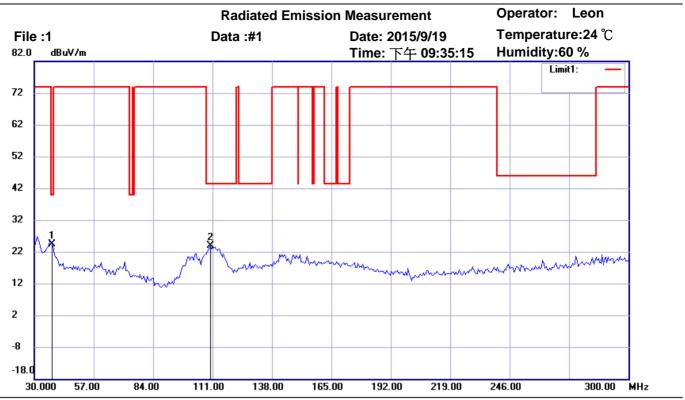

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	38.1162	10.03	peak	14.37	24.40	40.00	100	15	-15.60	
	110.0802	10.49	peak	13.27	23.76	43.50	100	60	-19.74	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

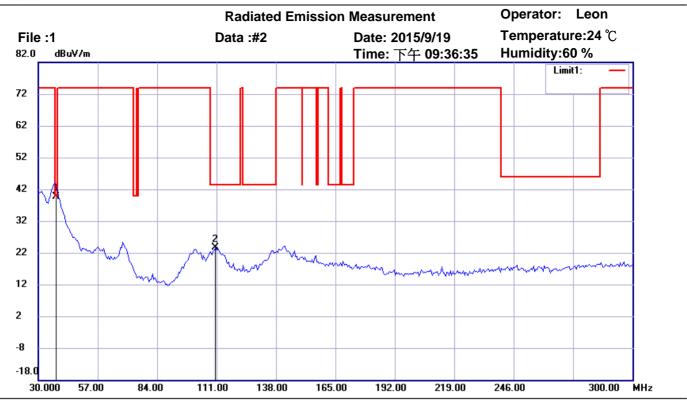

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7524	25.35	QP	14.33	39.68	40.00	100	160	-0.32	
	110.6212	10.31	peak	13.30	23.61	43.50	100	90	-19.89	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

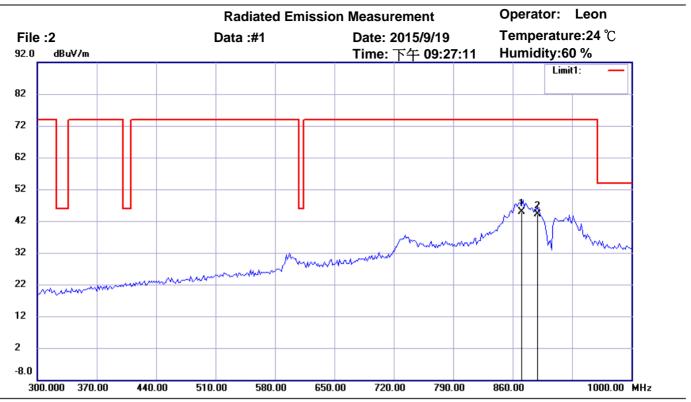

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	870.5211	17.06	QP	27.88	44.94	74.00	100	360	-29.06	
	888.9680	15.98	QP	28.19	44.17	74.00	100	0	-29.83	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

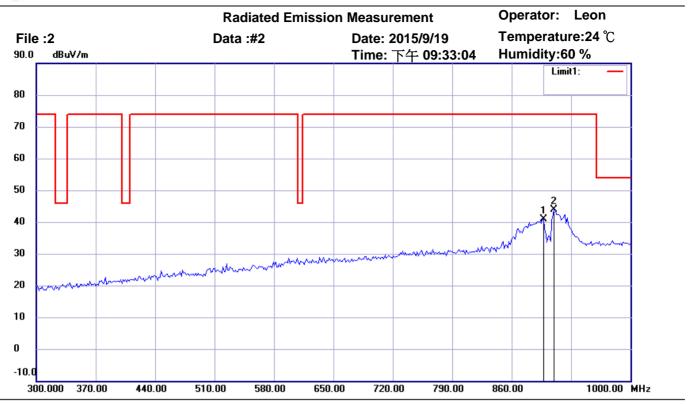

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	897.5952	12.56	peak	28.34	40.90	74.00	100	155	-33.10	
*	910.2204	15.49	peak	28.38	43.87	74.00	100	30	-30.13	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

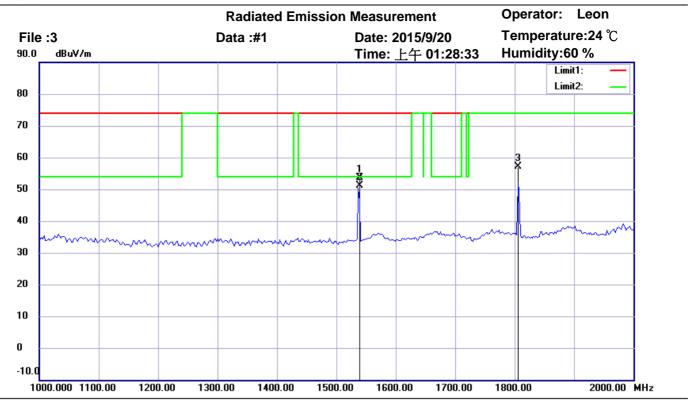

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.918	62.22	peak	-8.49	53.73	74.00	120	265	-20.27	
*	1537.918	59.62	AVG	-8.49	51.13	54.00	120	265	-2.87	
	1805.611	64.37	peak	-7.20	57.17	74.00	120	175	-16.83	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

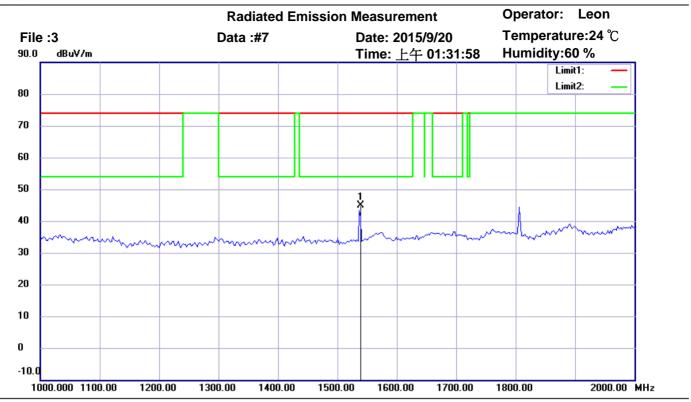

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

ľ	۷k.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	*	1537.874	53.31	peak	-8.49	44.82	74.00	130	269	-29.18	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

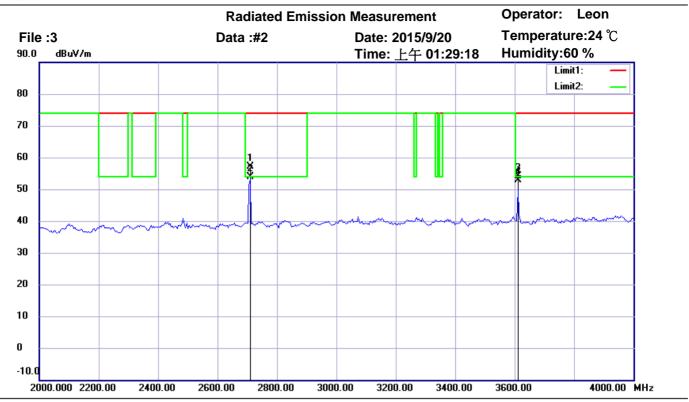

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.355	60.15	peak	-3.08	57.07	74.00	165	185	-16.93	
*	2708.355	56.89	AVG	-3.08	53.81	54.00	165	185	-0.19	
	3611.136	55.24	peak	-1.17	54.07	74.00	135	40	-19.93	
	3611.136	53.97	AVG	-1.17	52.80	54.00	135	40	-1.20	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

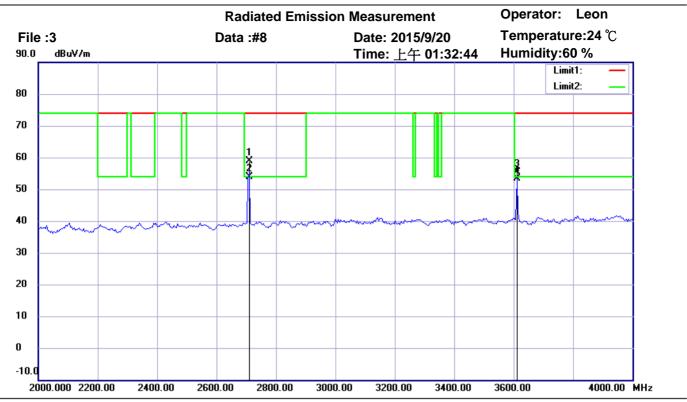

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.355	61.92	peak	-3.08	58.84	74.00	215	199	-15.16	
*	2708.355	57.00	AVG	-3.08	53.92	54.00	215	199	-0.08	
	3611.222	56.67	peak	-1.18	55.49	74.00	100	155	-18.51	
	3611.222	54.55	AVG	-1.18	53.37	54.00	100	155	-0.63	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

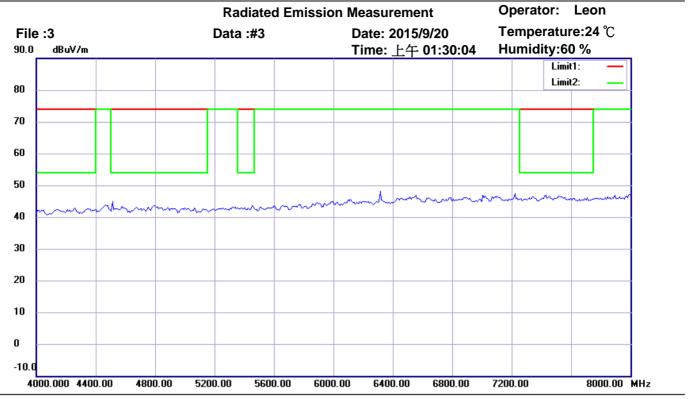

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

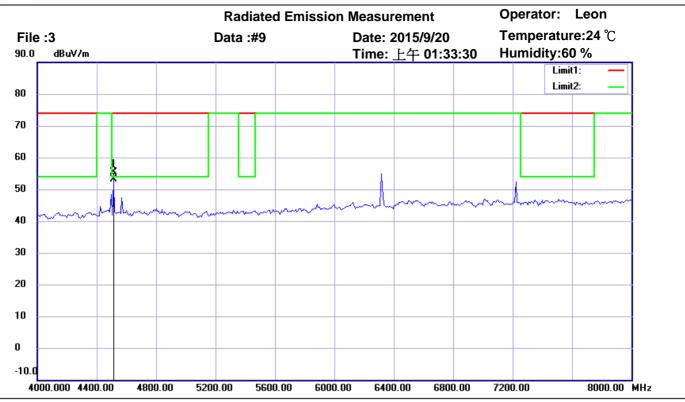

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4513.026	54.33	peak	1.11	55.44	74.00	125	130	-18.56	
*	4513.026	51.96	AVG	1.11	53.07	54.00	125	130	-0.93	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

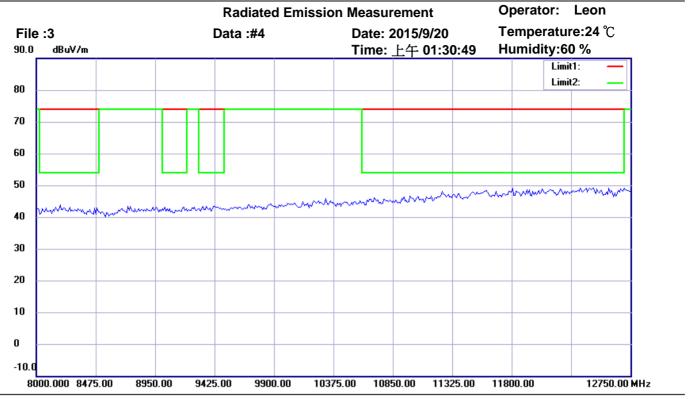

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

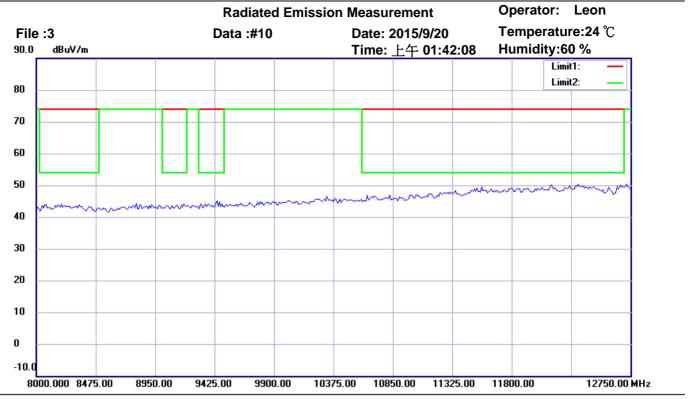

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

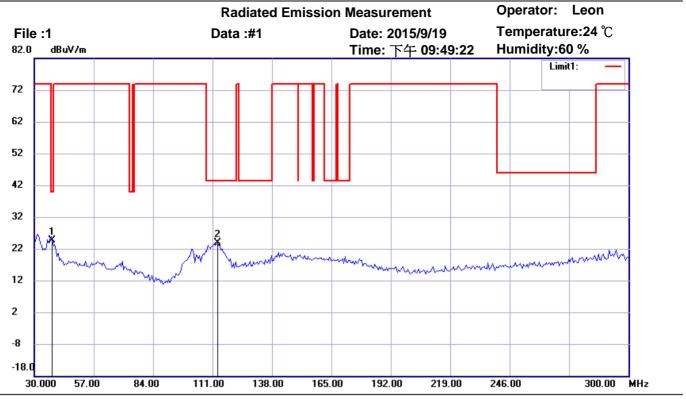

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	38.1162	10.17	peak	14.37	24.54	40.00	100	155	-15.46	
	113.3267	10.27	peak	13.50	23.77	43.50	100	30	-19.73	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

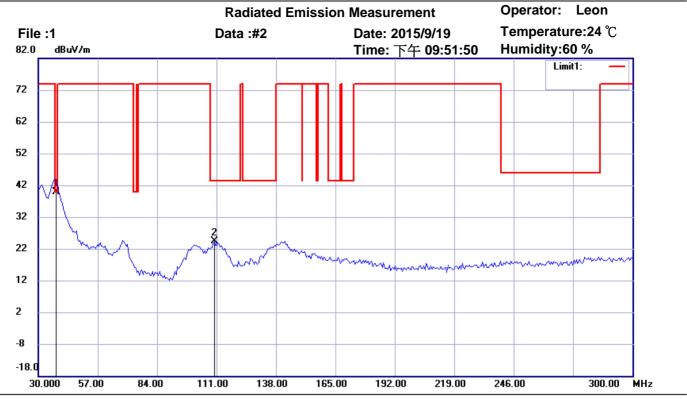

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.6353	25.45	QP	14.32	39.77	40.00	100	160	-0.23	
	110.0802	11.22	peak	13.27	24.49	43.50	100	15	-19.01	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

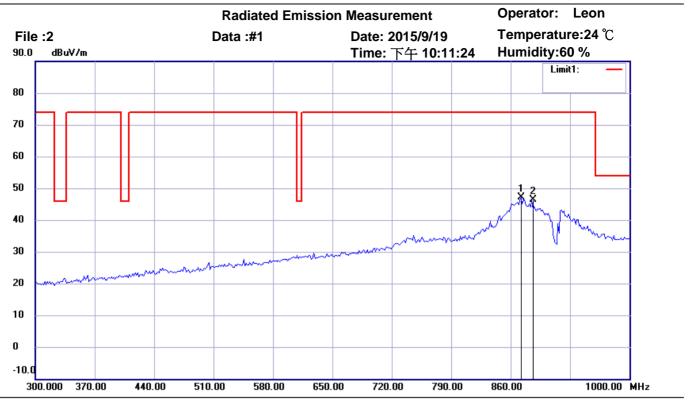

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	872.3446	19.25	peak	27.92	47.17	74.00	100	140	-26.83	
	884.9700	18.21	peak	28.13	46.34	74.00	100	250	-27.66	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

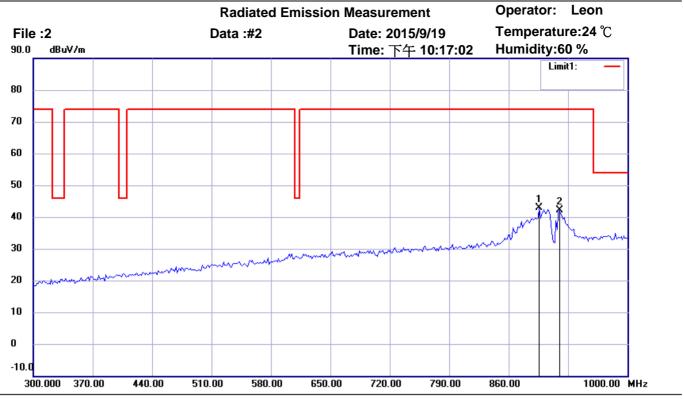

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	896.1924	14.51	peak	28.32	42.83	74.00	100	65	-31.17	
	920.0401	13.70	peak	28.39	42.09	74.00	100	175	-31.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

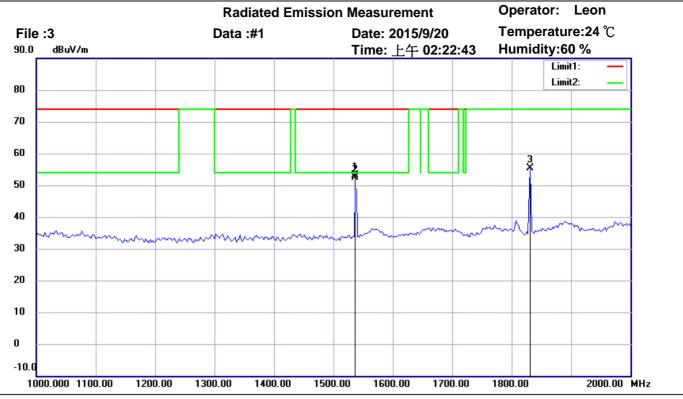

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	61.57	peak	-8.50	53.07	74.00	120	165	-20.93	
*	1537.074	60.98	AVG	-8.50	52.48	54.00	120	165	-1.52	
	1831.663	62.23	peak	-6.86	55.37	74.00	100	50	-18.63	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

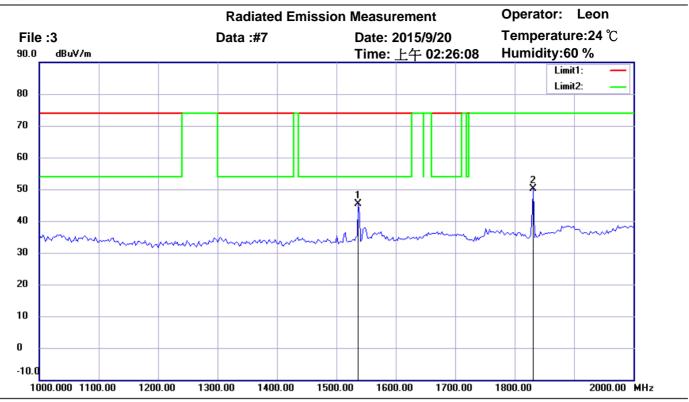

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	53.87	peak	-8.50	45.37	74.00	100	175	-28.63	
*	1831.663	57.10	peak	-6.86	50.24	74.00	100	190	-23.76	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

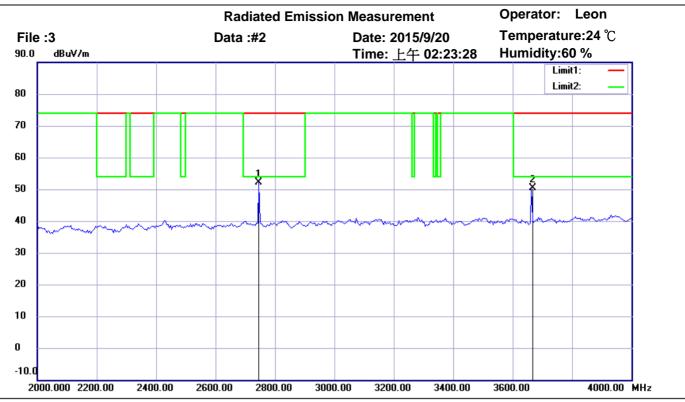

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	2745.491	55.14	peak	-2.97	52.17	74.00	100	230	-21.83	
	3663.327	51.50	peak	-1.15	50.35	74.00	100	95	-23.65	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

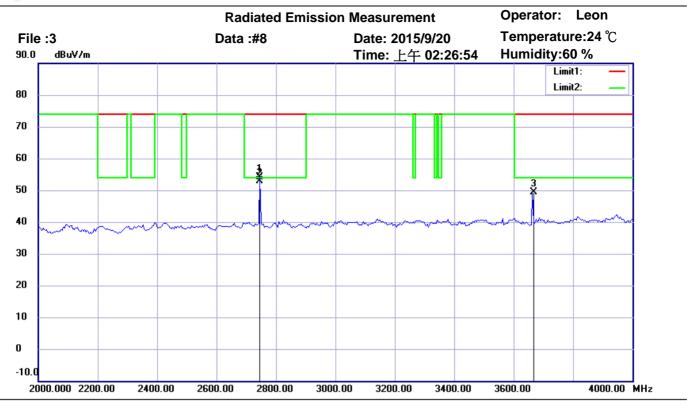

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.491	57.18	peak	-2.97	54.21	74.00	100	195	-19.79	
*	2745.491	55.79	AVG	-2.97	52.82	54.00	100	195	-1.18	
	3663.327	50.58	peak	-1.15	49.43	74.00	100	70	-24.57	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

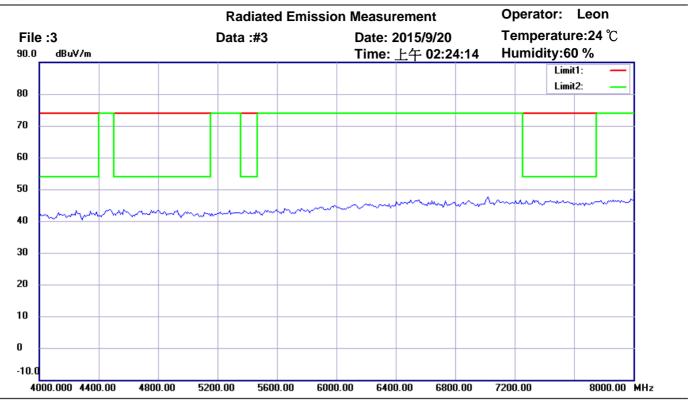

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

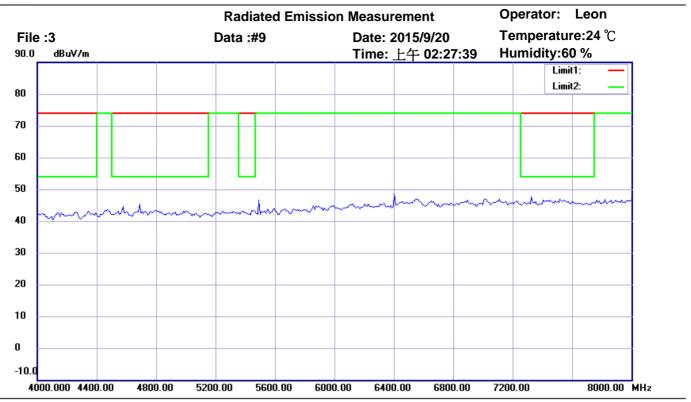

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

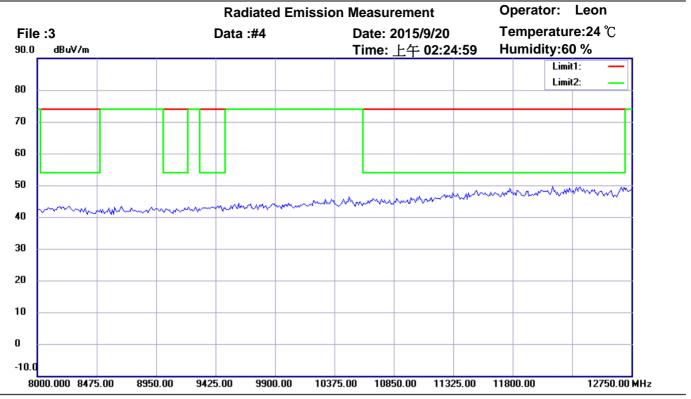

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

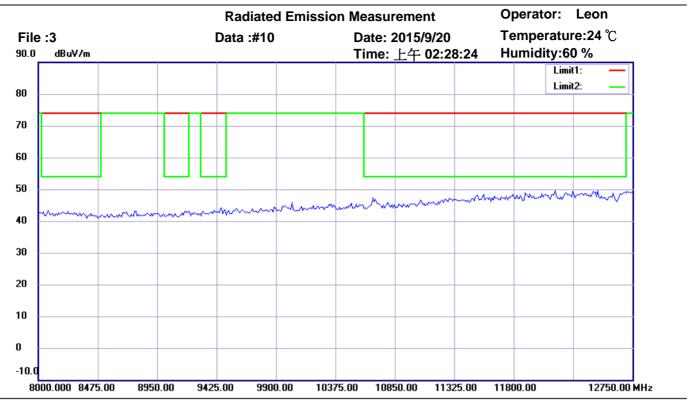

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

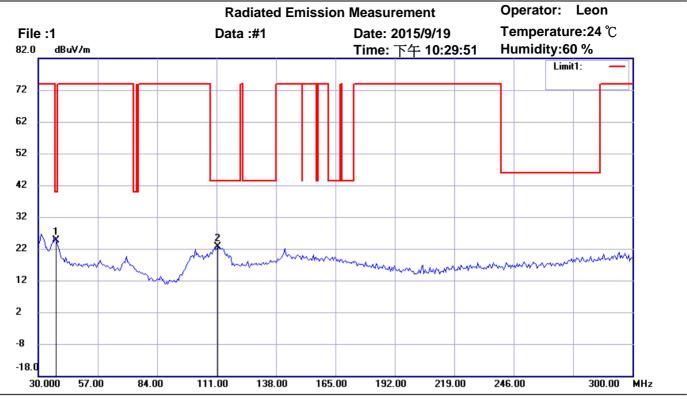

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	38.1162	10.19	peak	14.37	24.56	40.00	100	95	-15.44	
	111.7034	9.31	peak	13.38	22.69	43.50	100	120	-20.81	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

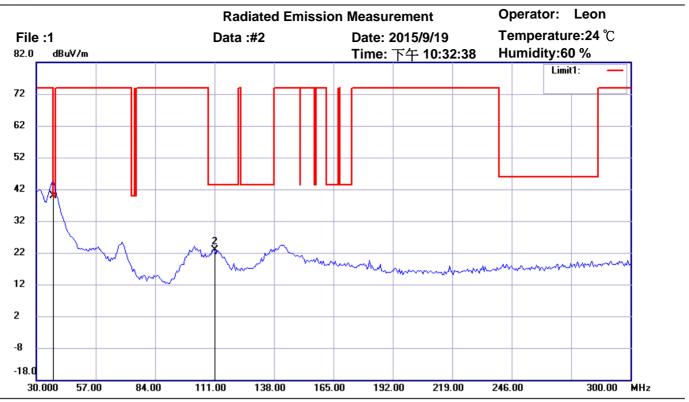

Site: Chamber


Condition: FCC Restriction Band 30-300 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.5331	25.57	QP	14.30	39.87	40.00	100	165	-0.13	
	111.1623	9.56	peak	13.34	22.90	43.50	100	20	-20.60	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

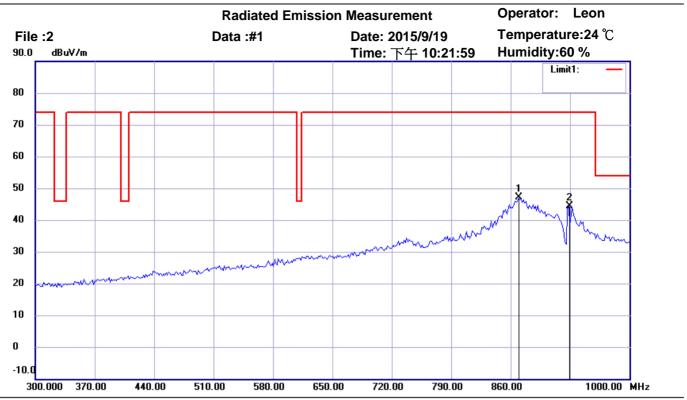

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	869.5390	19.29	peak	27.87	47.16	74.00	100	110	-26.84	
	928.4570	16.02	peak	28.39	44.41	74.00	100	85	-29.59	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

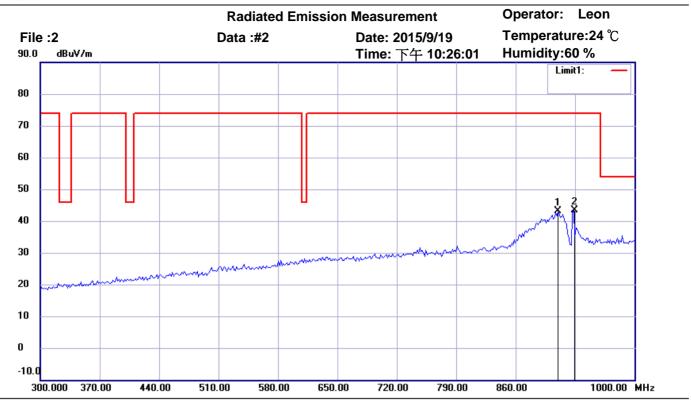

Site: Chamber


Condition: FCC Restriction Band 300-1000 Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	910.2204	14.64	peak	28.38	43.02	74.00	100	15	-30.98	
*	928.4570	14.90	peak	28.39	43.29	74.00	100	70	-30.71	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

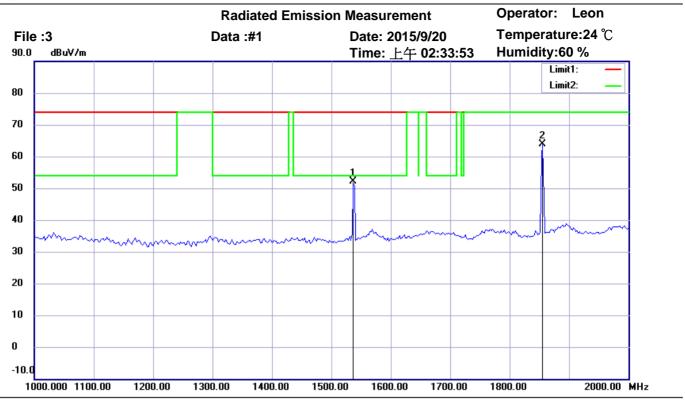

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	60.59	peak	-8.50	52.09	74.00	125	160	-21.91	
*	1855.711	70.46	peak	-6.56	63.90	74.00	100	175	-10.10	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

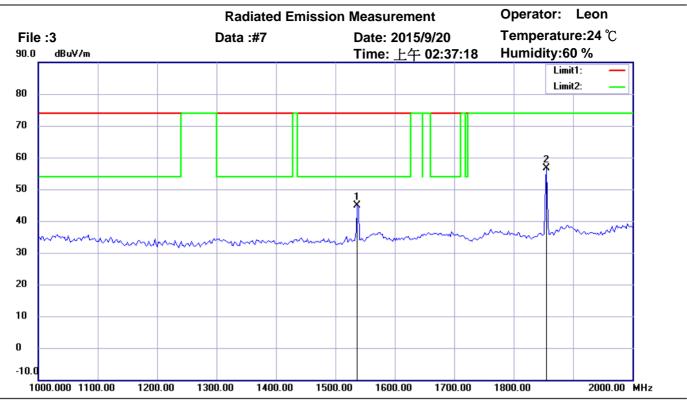

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	53.34	peak	-8.50	44.84	74.00	100	215	-29.16	
*	1855.711	63.13	peak	-6.56	56.57	74.00	100	190	-17.43	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

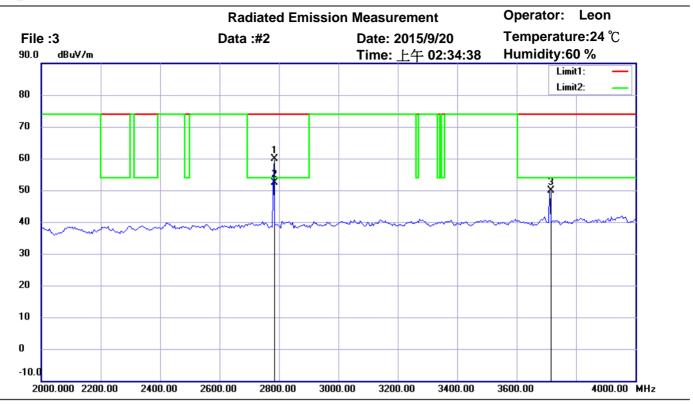

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.878	62.79	peak	-2.86	59.93	74.00	100	204	-14.07	
*	2781.878	55.23	AVG	-2.86	52.37	54.00	100	204	-1.63	
	3711.423	50.93	peak	-1.13	49.80	74.00	100	75	-24.20	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

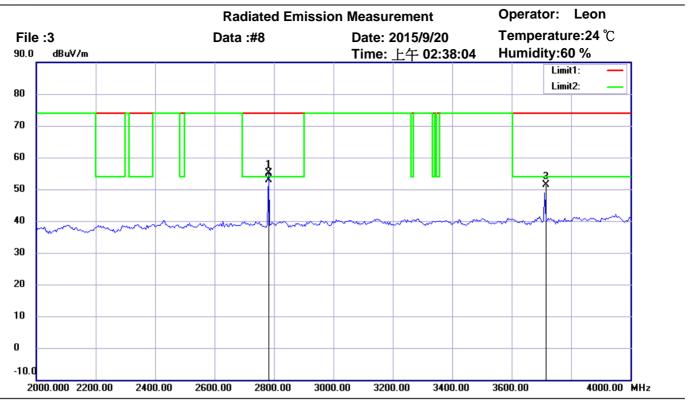

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.563	57.99	peak	-2.86	55.13	74.00	135	217	-18.87	
*	2781.563	55.78	AVG	-2.86	52.92	54.00	135	217	-1.08	
	3711.423	52.63	peak	-1.13	51.50	74.00	110	125	-22.50	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

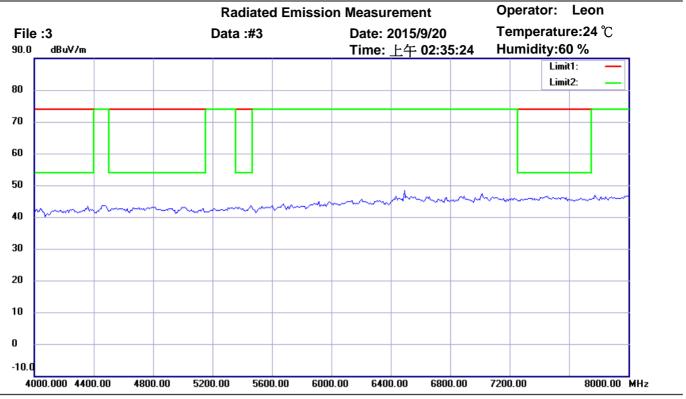

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

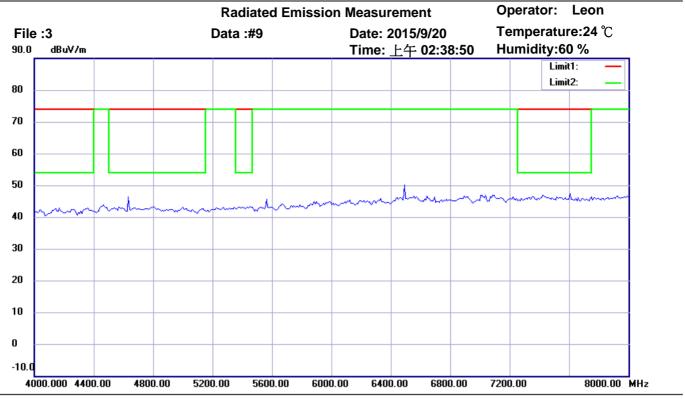

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

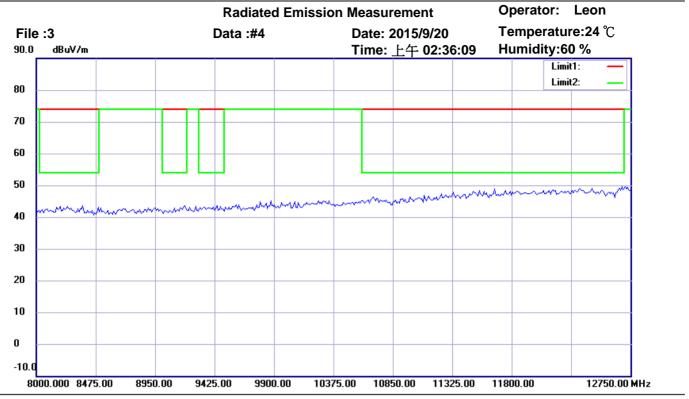

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

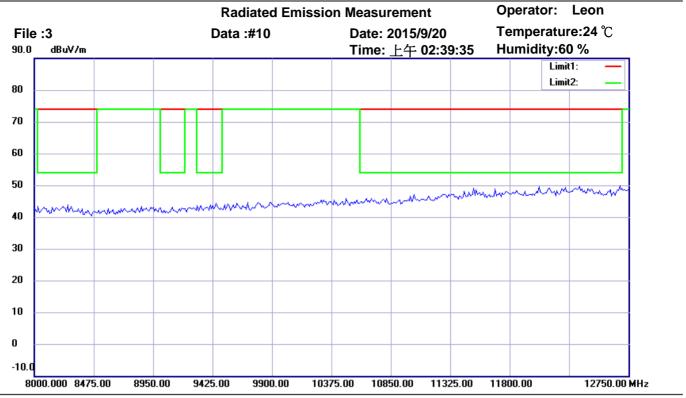

Site: Chamber


Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

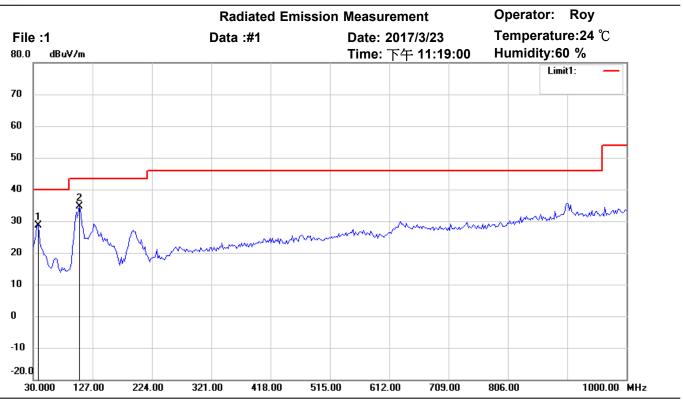

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7754	36.56	peak	-7.87	28.69	40.00	100	50	-11.31	
*	105.8116	42.64	peak	-8.02	34.62	43.50	100	170	-8.88	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

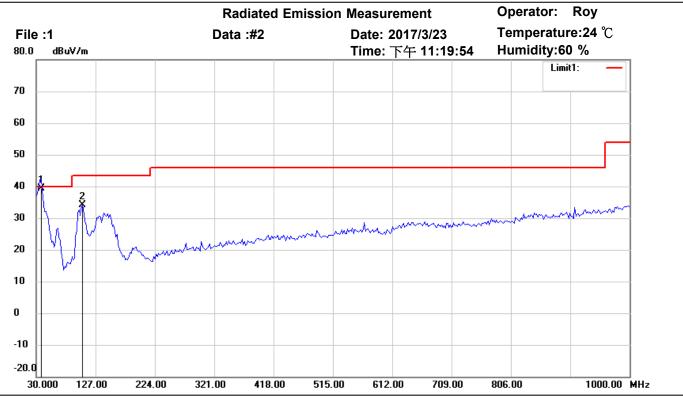

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7754	47.36	QP	-7.87	39.49	40.00	100	165	-0.51	
	105.8115	42.09	peak	-8.02	34.07	43.50	100	130	-9.43	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

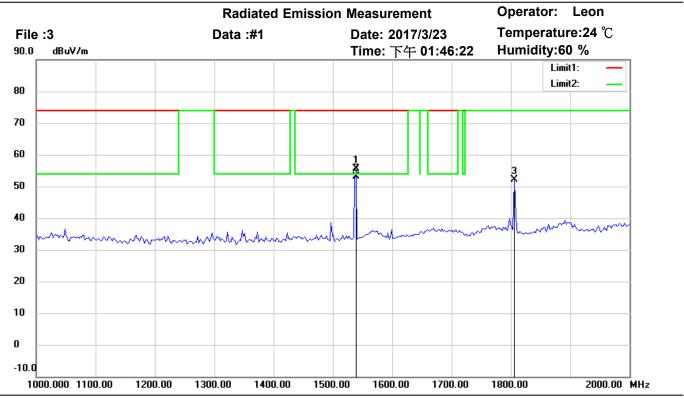

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.874	64.31	peak	-8.77	55.54	74.00	155	270	-18.46	
*	1537.874	61.97	AVG	-8.77	53.20	54.00	155	270	-0.80	
	1805.611	59.04	peak	-6.82	52.22	74.00	150	215	-21.78	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

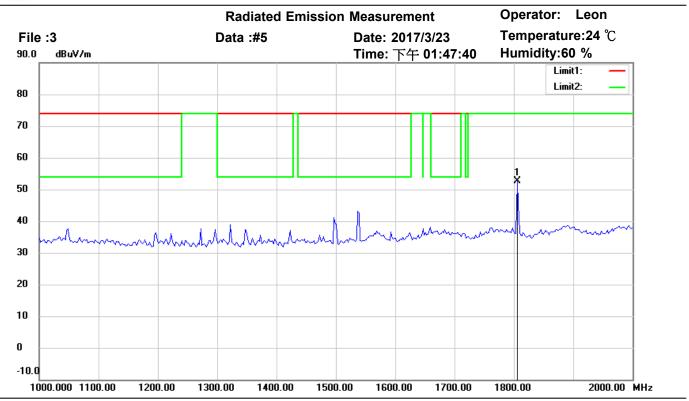

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1805.611	59.39	peak	-6.82	52.57	74.00	150	75	-21.43	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

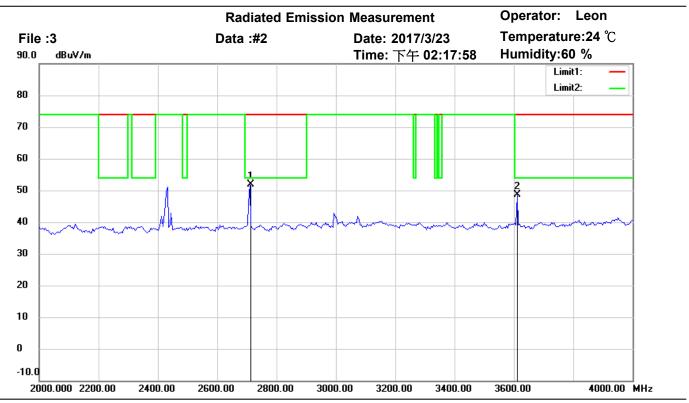

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	2709.419	56.06	peak	-4.09	51.97	74.00	150	95	-22.03	
	3611.222	51.08	peak	-2.54	48.54	74.00	150	160	-25.46	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

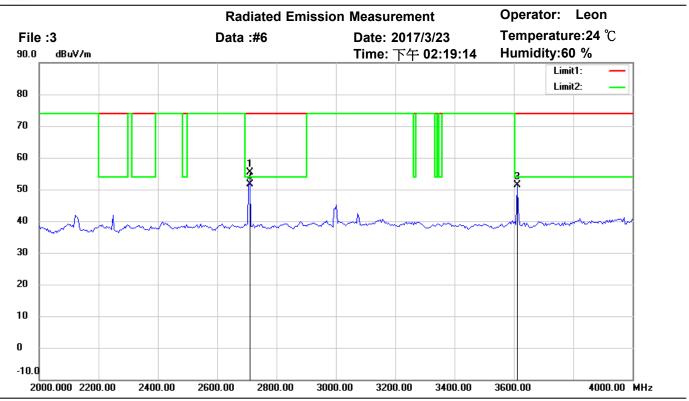

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2708.315	59.41	peak	-4.09	55.32	74.00	150	213	-18.68	
*	2708.315	55.66	AVG	-4.09	51.57	54.00	150	213	-2.43	
	3611.222	53.98	peak	-2.54	51.44	74.00	150	95	-22.56	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

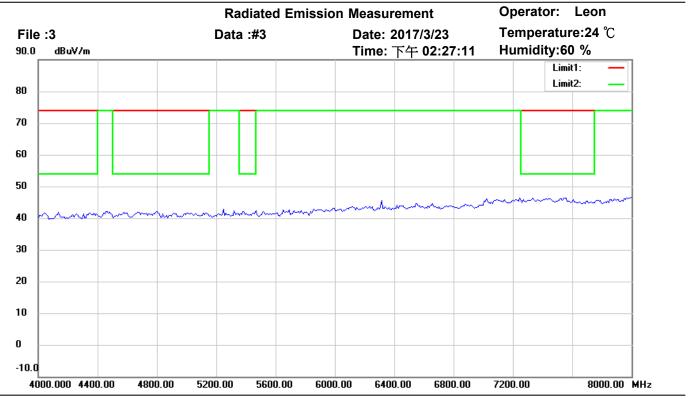

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

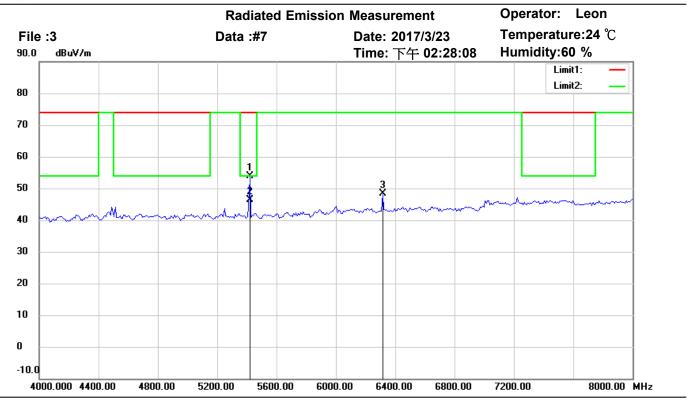

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5416.503	52.91	peak	0.85	53.76	74.00	100	160	-20.24	
*	5416.503	45.63	AVG	0.85	46.48	54.00	100	160	-7.52	
	6316.633	45.23	peak	3.06	48.29	74.00	100	160	-25.71	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

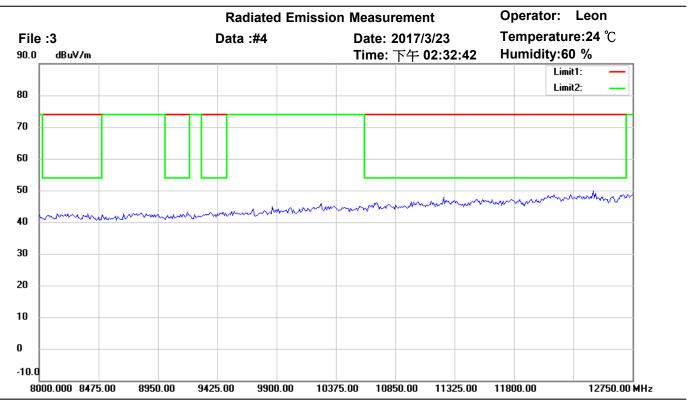

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

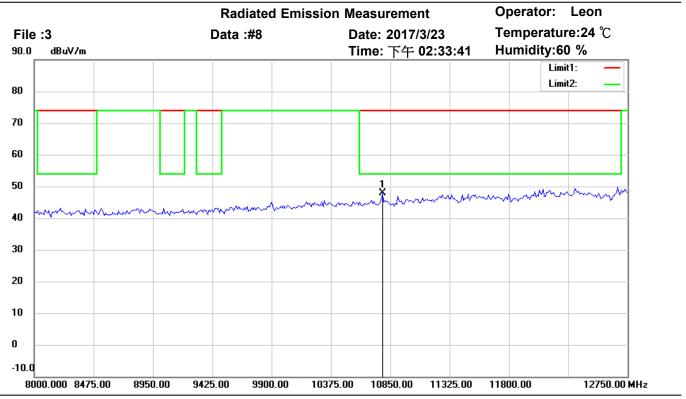

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: TX 902.75MHz

Note:


M/N:

Mk	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10789.078	38.00	peak	9.82	47.82	74.00	100	30	-26.18	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

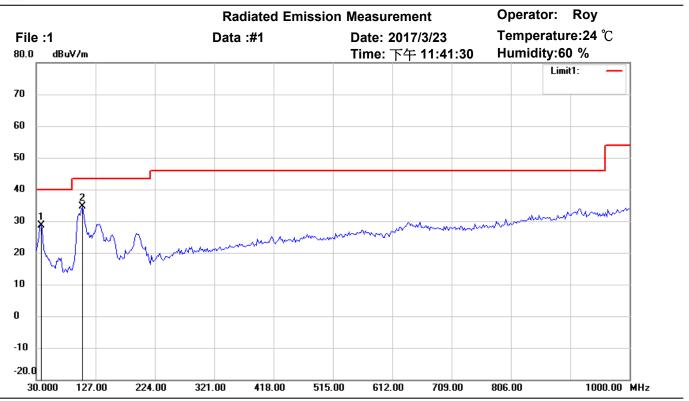

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7754	36.60	peak	-7.87	28.73	40.00	100	30	-11.27	
*	105.8116	42.55	peak	-8.02	34.53	43.50	100	110	-8.97	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

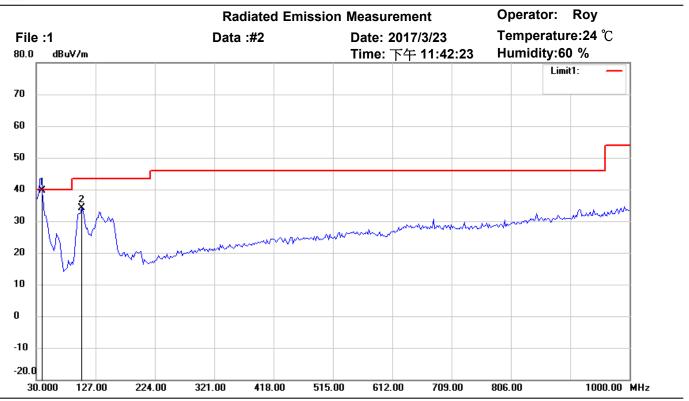

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	38.0501	47.50	QP	-7.91	39.59	40.00	100	175	-0.41	
	103.8677	42.53	peak	-8.51	34.02	43.50	100	225	-9.48	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

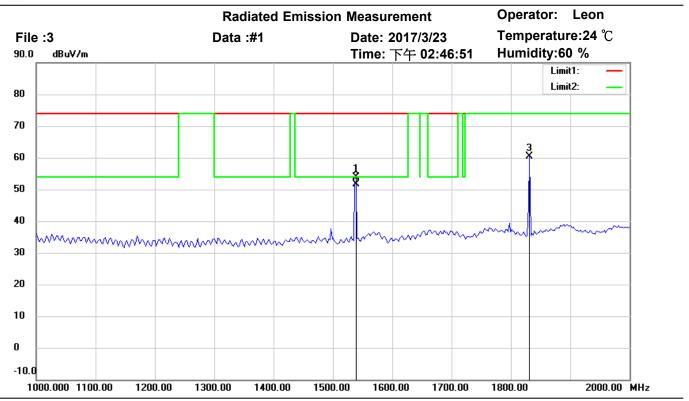

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.874	62.74	peak	-8.77	53.97	74.00	150	265	-20.03	
*	1537.874	60.50	AVG	-8.77	51.73	54.00	150	265	-2.27	
	1831.663	66.84	peak	-6.56	60.28	74.00	150	275	-13.72	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

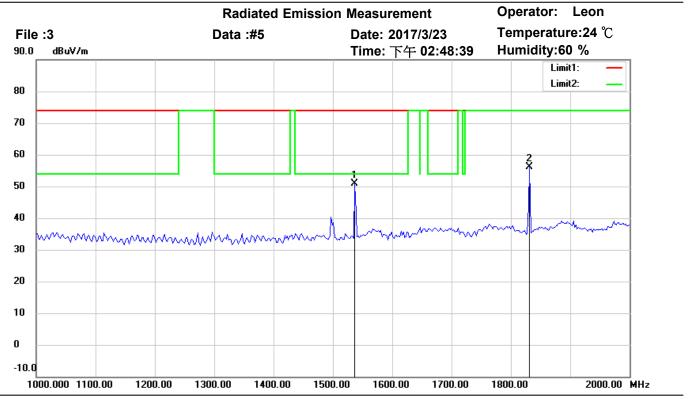

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	59.66	peak	-8.78	50.88	74.00	150	95	-23.12	
*	1831.663	62.76	peak	-6.56	56.20	74.00	150	160	-17.80	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

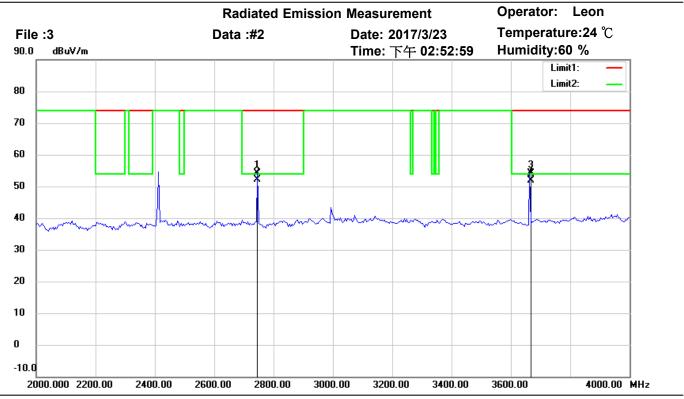

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.491	58.21	peak	-4.05	54.16	74.00	150	275	-19.84	
*	2745.491	56.25	AVG	-4.05	52.20	54.00	150	275	-1.80	
	3663.327	56.68	peak	-2.45	54.23	74.00	150	130	-19.77	
	3663.327	54.36	AVG	-2.45	51.91	54.00	150	130	-2.09	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

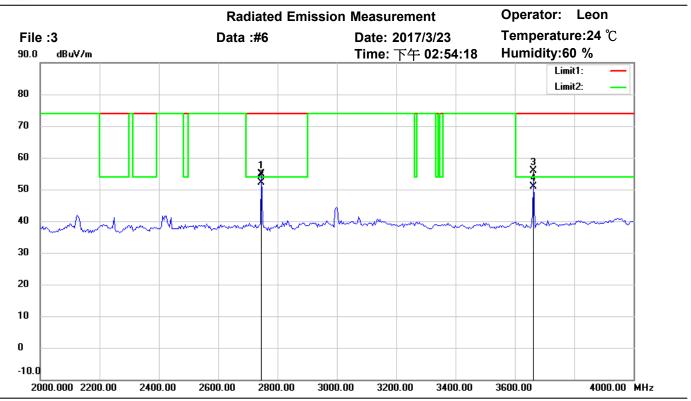

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2745.491	59.02	peak	-4.05	54.97	74.00	150	230	-19.03	
*	2745.491	56.15	AVG	-4.05	52.10	54.00	150	230	-1.90	
	3661.233	58.33	peak	-2.46	55.87	74.00	100	283	-18.13	
	3661.233	53.40	AVG	-2.46	50.94	54.00	100	283	-3.06	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

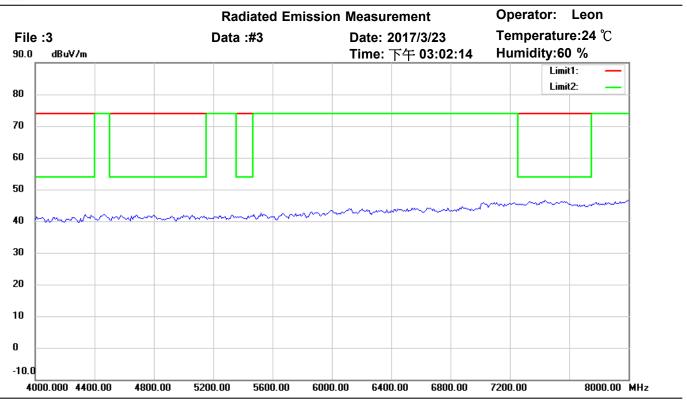

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment	
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)		



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

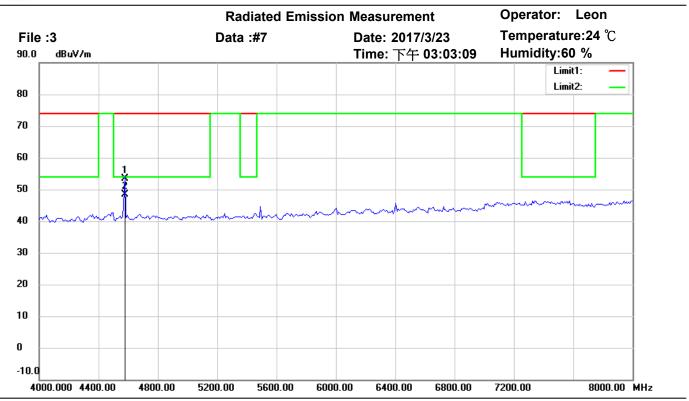

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4576.258	54.09	peak	-0.70	53.39	74.00	125	173	-20.61	
*	4576.258	49.17	AVG	-0.70	48.47	54.00	125	173	-5.53	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

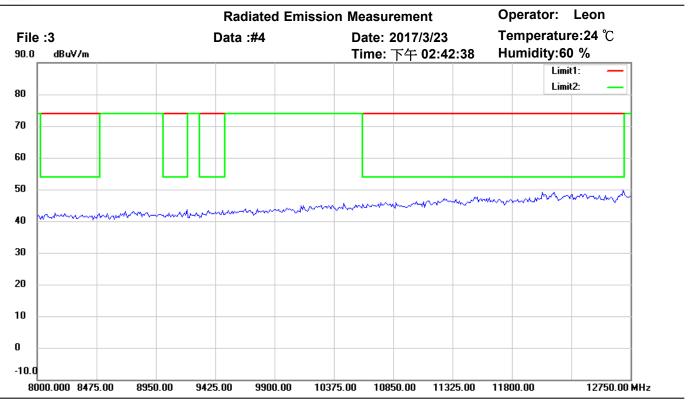

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

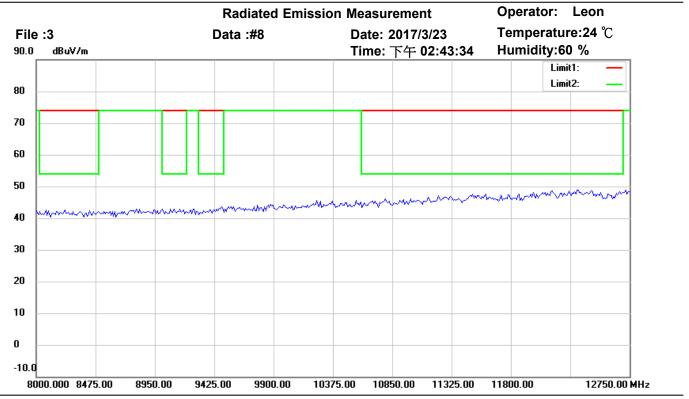

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: TX 915.25MHz

Note:


M/N:

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

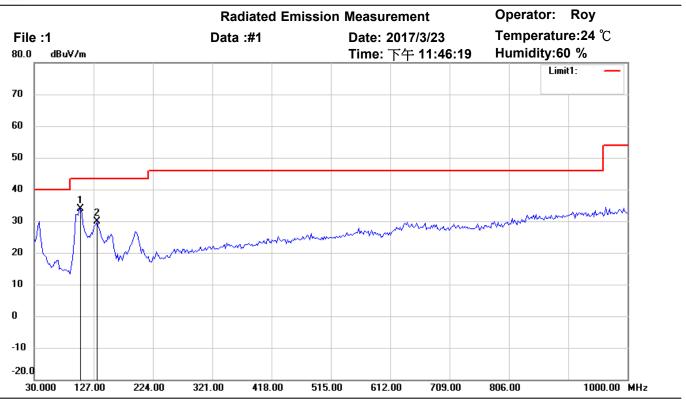

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	105.8115	41.94	peak	-8.02	33.92	43.50	100	190	-9.58	
	133.0261	36.13	peak	-6.33	29.80	43.50	100	80	-13.70	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

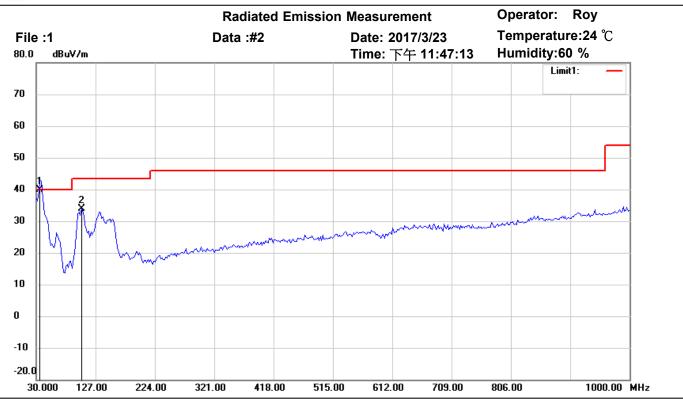

Site: Chamber

Condition: FCC_part 15 RE-Class C_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	35.8316	47.42	QP	-7.59	39.83	40.00	100	155	-0.17	
	103.8677	42.47	peak	-8.51	33.96	43.50	100	20	-9.54	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

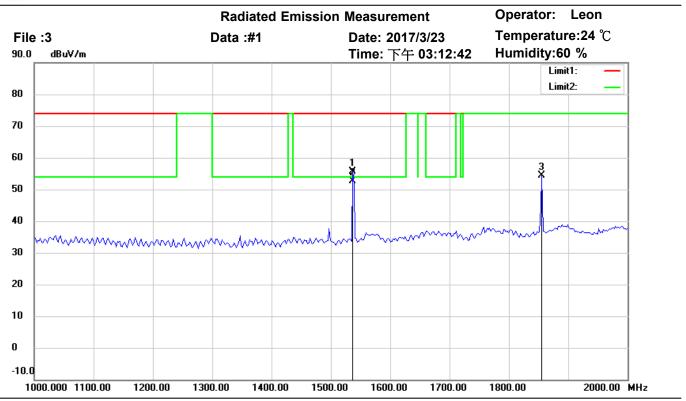

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	64.38	peak	-8.78	55.60	74.00	150	273	-18.40	
*	1537.074	61.35	AVG	-8.78	52.57	54.00	150	273	-1.43	
	1855.711	60.66	peak	-6.32	54.34	74.00	150	200	-19.66	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

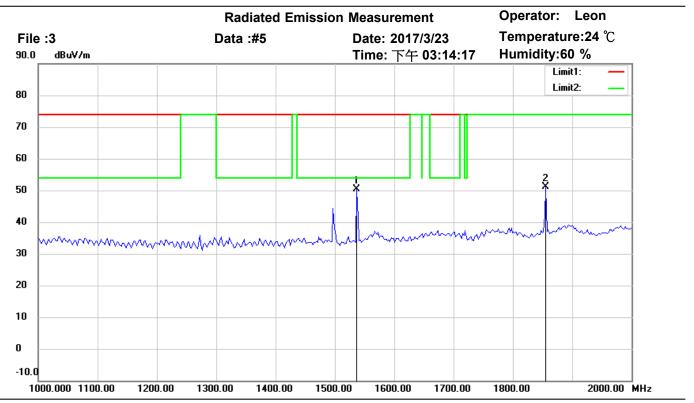

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1537.074	59.14	peak	-8.78	50.36	74.00	150	95	-23.64	
*	1855.711	57.41	peak	-6.32	51.09	74.00	150	140	-22.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

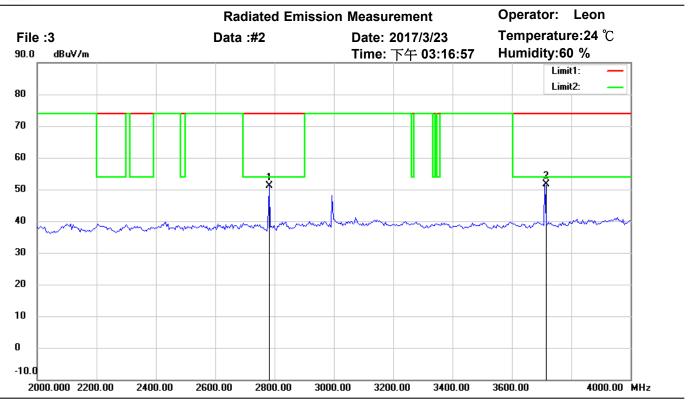

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.563	55.09	peak	-4.01	51.08	74.00	150	175	-22.92	
*	3711.423	54.10	peak	-2.38	51.72	74.00	150	90	-22.28	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

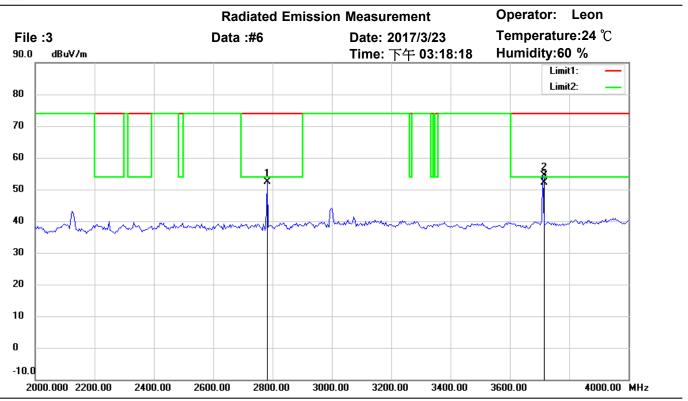

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	2781.563	56.48	peak	-4.01	52.47	74.00	150	155	-21.53	
	3711.423	56.65	peak	-2.38	54.27	74.00	150	240	-19.73	
*	3711.423	54.57	AVG	-2.38	52.19	54.00	150	240	-1.81	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

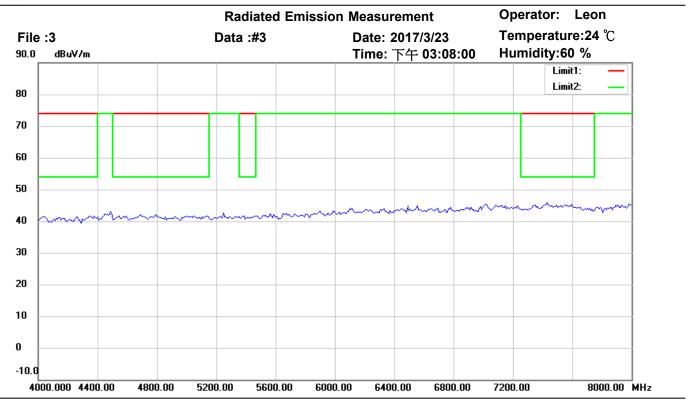

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

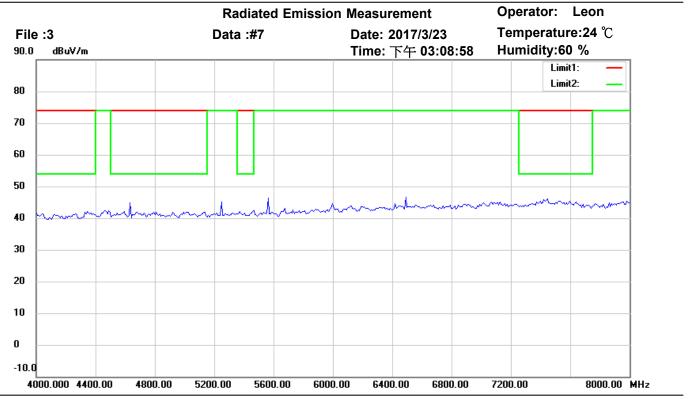

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: TX 927.25MHz

Note:


M/N:

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

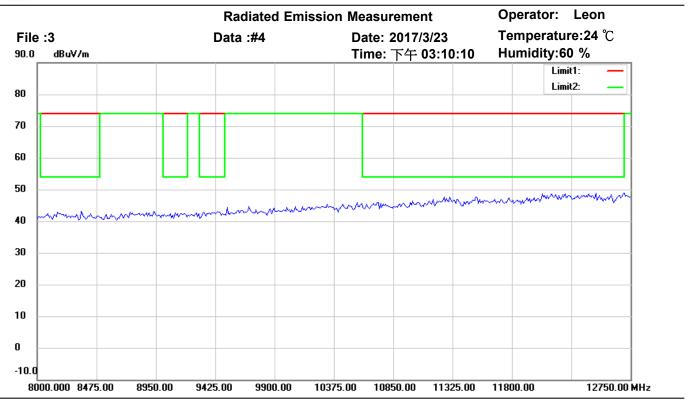

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: TX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

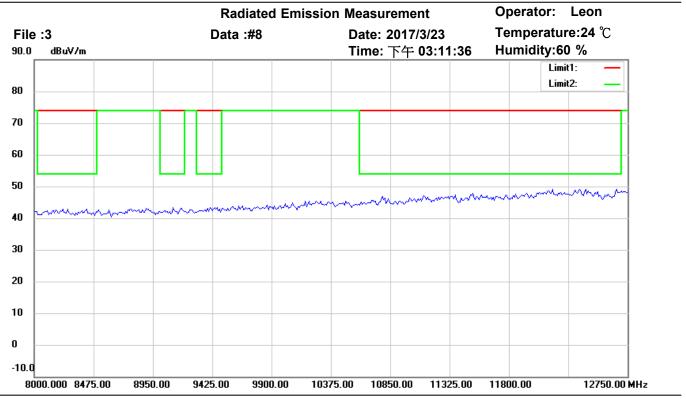

Site: Chamber

Condition: FCC Restriction Band_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: TX 927.25MHz

Note:


M/N:

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

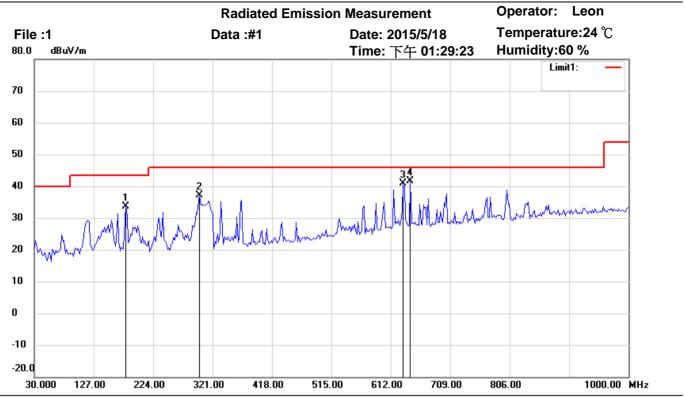

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	179.6793	19.96	peak	13.74	33.70	43.50	100	165	-9.80	
	300.2004	20.99	peak	16.04	37.03	46.00	100	35	-8.97	
	632.6051	16.69	peak	24.16	40.85	46.00	100	90	-5.15	
*	644.2685	17.18	peak	24.43	41.61	46.00	100	110	-4.39	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

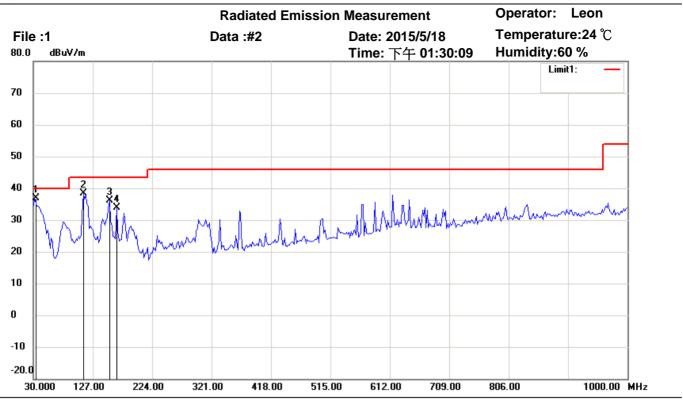

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	31.9440	23.03	peak	13.84	36.87	40.00	100	95	-3.13	
	111.6433	24.90	peak	13.38	38.28	43.50	100	110	-5.22	
	154.4088	20.67	peak	15.50	36.17	43.50	100	145	-7.33	
	166.0721	18.57	peak	15.25	33.82	43.50	100	70	-9.68	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

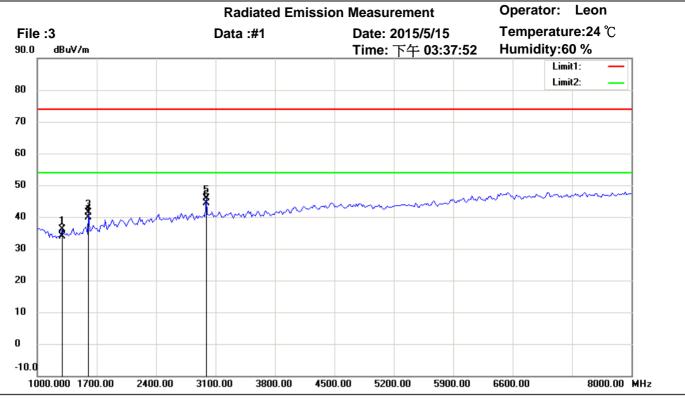

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1294.589	44.86	peak	-8.69	36.17	74.00	100	155	-37.83	
	1294.589	42.69	AVG	-8.69	34.00	54.00	100	155	-20.00	
	1603.206	49.10	peak	-7.75	41.35	74.00	100	230	-32.65	
	1603.206	47.63	AVG	-7.75	39.88	54.00	100	230	-14.12	
	2991.984	48.35	peak	-2.47	45.88	74.00	100	190	-28.12	
*	2991.984	46.75	AVG	-2.47	44.28	54.00	100	190	-9.72	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

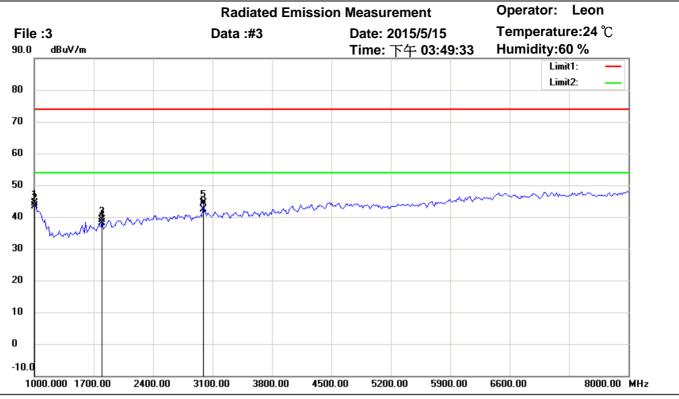

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1014.028	51.11	peak	-6.80	44.31	74.00	100	75	-29.69	
*	1014.028	50.14	AVG	-6.80	43.34	54.00	100	75	-10.66	
	1799.599	46.33	peak	-7.27	39.06	74.00	100	130	-34.94	
	1799.599	45.30	AVG	-7.27	38.03	54.00	100	130	-15.97	
	2991.984	46.76	peak	-2.47	44.29	74.00	100	210	-29.71	
	2991.984	44.91	AVG	-2.47	42.44	54.00	100	210	-11.56	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

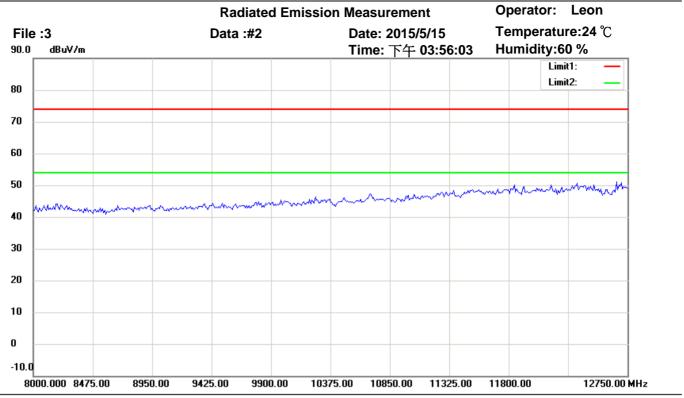

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

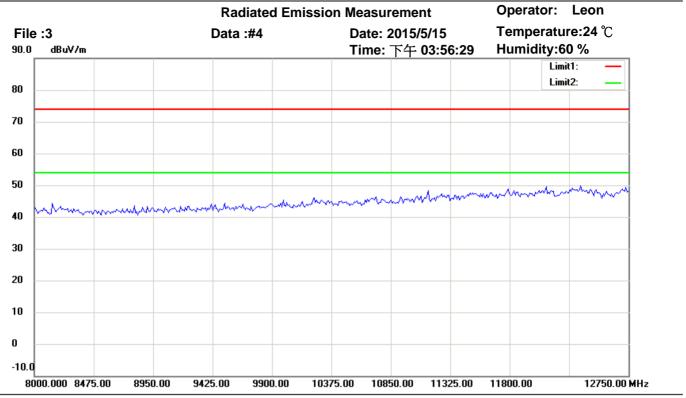

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

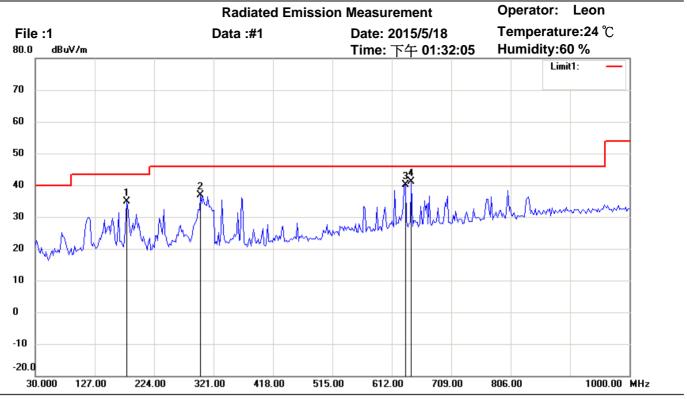

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	179.6793	21.24	peak	13.74	34.98	43.50	100	220	-8.52	
	300.2004	20.87	peak	16.04	36.91	46.00	100	170	-9.09	
	634.5490	16.03	peak	24.20	40.23	46.00	100	215	-5.77	
*	644.2685	16.61	peak	24.43	41.04	46.00	100	135	-4.96	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

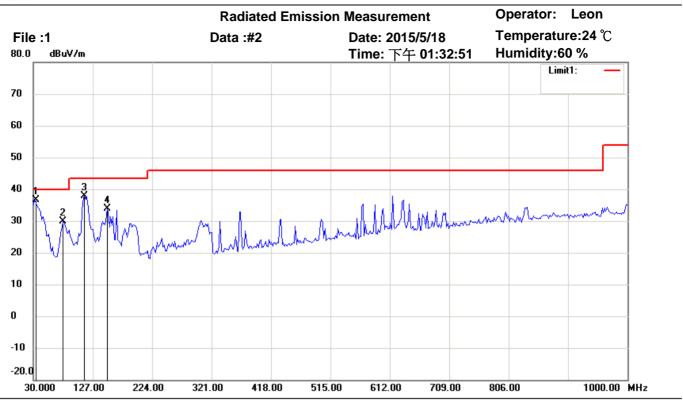

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	31.9440	22.78	peak	13.84	36.62	40.00	100	75	-3.38	
	78.5972	19.59	peak	10.30	29.89	40.00	100	60	-10.11	
	113.5872	24.39	peak	13.52	37.91	43.50	100	110	-5.59	
	150.5210	18.42	peak	15.50	33.92	43.50	100	35	-9.58	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

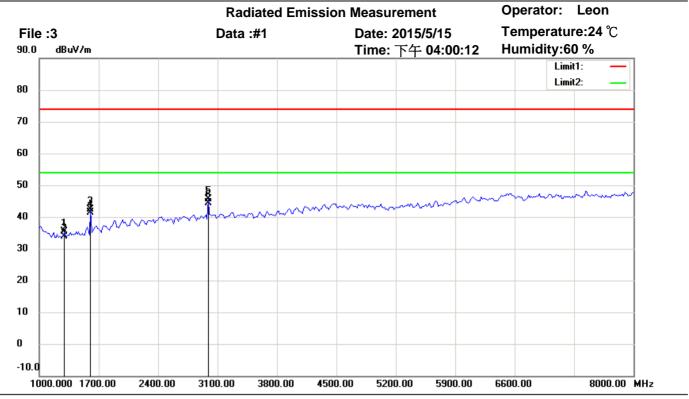

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1294.589	43.98	peak	-8.69	35.29	74.00	100	85	-38.71	
	1294.589	42.56	AVG	-8.69	33.87	54.00	100	85	-20.13	
	1603.206	50.20	peak	-7.75	42.45	74.00	100	110	-31.55	
	1603.206	49.11	AVG	-7.75	41.36	54.00	100	110	-12.64	
	2991.984	48.00	peak	-2.47	45.53	74.00	100	175	-28.47	
*	2991.984	46.79	AVG	-2.47	44.32	54.00	100	175	-9.68	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

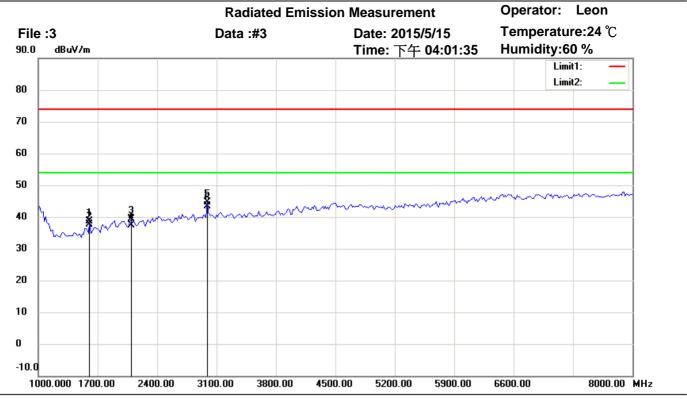

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	46.41	peak	-7.75	38.66	74.00	100	145	-35.34	
	1603.206	45.33	AVG	-7.75	37.58	54.00	100	145	-16.42	
	2094.188	44.76	peak	-5.35	39.41	74.00	100	130	-34.59	
	2094.188	42.71	AVG	-5.35	37.36	54.00	100	130	-16.64	
	2991.984	47.07	peak	-2.47	44.60	74.00	100	90	-29.40	
*	2991.984	45.73	AVG	-2.47	43.26	54.00	100	90	-10.74	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

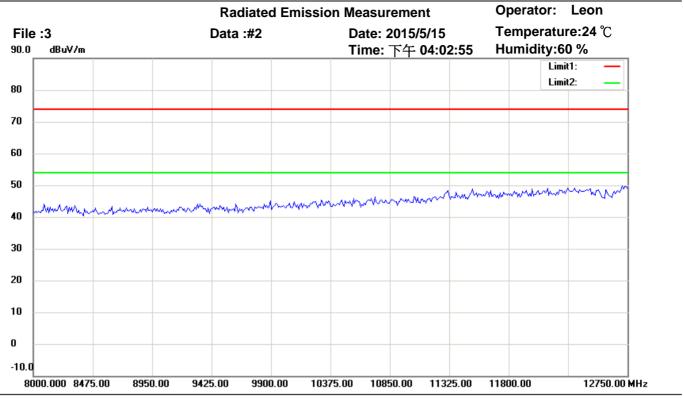

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

NAI-	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

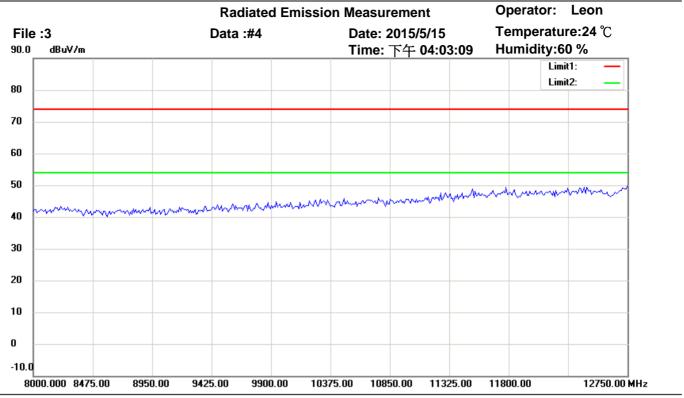

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

NAI-	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

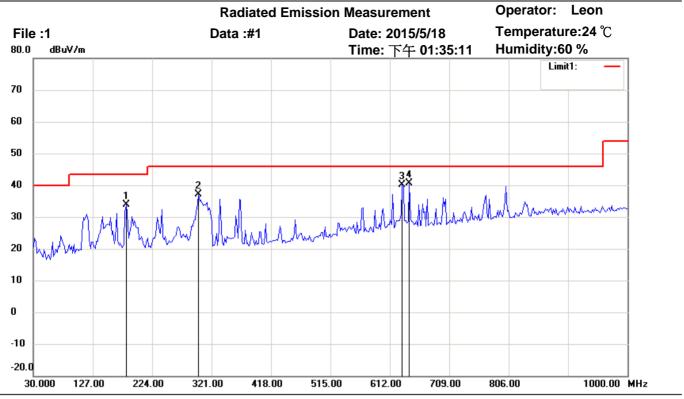

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	181.6231	20.38	peak	13.53	33.91	43.50	100	145	-9.59	
	300.2004	21.18	peak	16.04	37.22	46.00	100	110	-8.78	
	632.6051	16.03	peak	24.16	40.19	46.00	100	90	-5.81	
*	644.2685	16.16	peak	24.43	40.59	46.00	100	75	-5.41	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

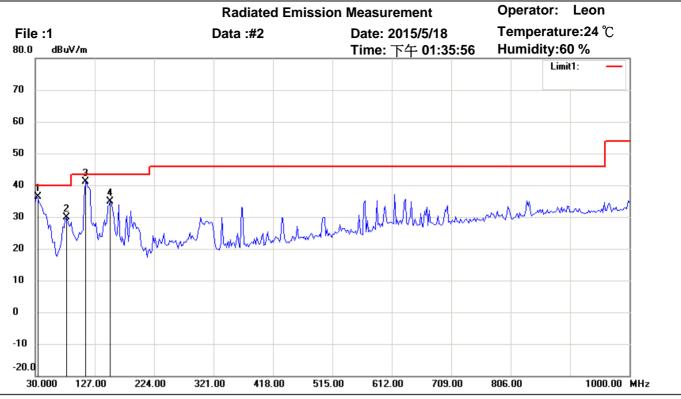

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	31.9440	22.63	peak	13.84	36.47	40.00	100	220	-3.53	
	80.5411	19.96	peak	9.97	29.93	40.00	100	175	-10.07	
*	111.6433	27.64	peak	13.38	41.02	43.50	100	165	-2.48	
	152.4648	19.33	peak	15.50	34.83	43.50	100	40	-8.67	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

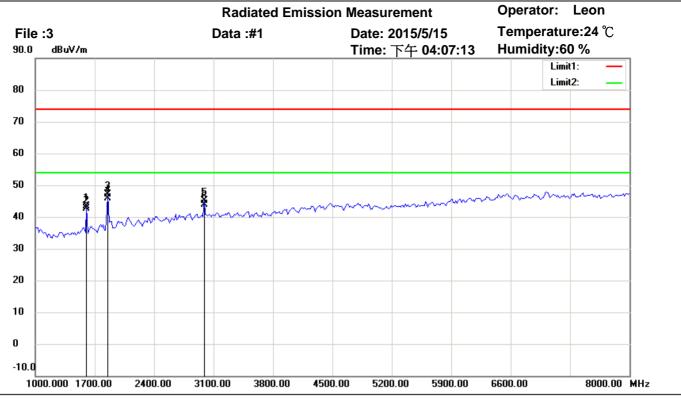

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	51.13	peak	-7.75	43.38	74.00	100	235	-30.62	
	1603.206	50.33	AVG	-7.75	42.58	54.00	100	235	-11.42	
	1855.711	53.64	peak	-6.56	47.08	74.00	100	160	-26.92	
*	1855.711	52.46	AVG	-6.56	45.90	54.00	100	160	-8.10	
	2991.984	47.69	peak	-2.47	45.22	74.00	100	120	-28.78	
	2991.984	46.25	AVG	-2.47	43.78	54.00	100	120	-10.22	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

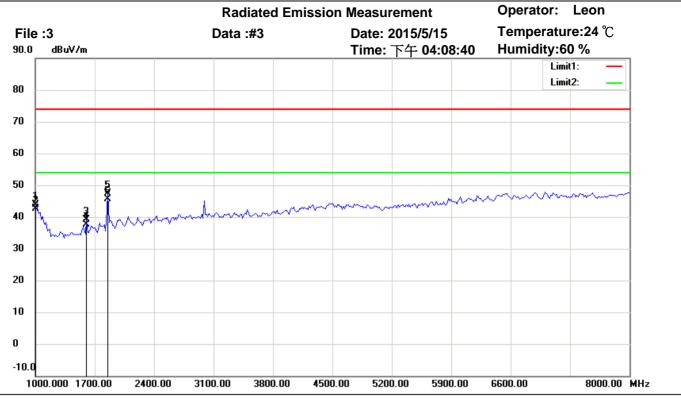

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1014.028	50.73	peak	-6.80	43.93	74.00	100	75	-30.07	
	1014.028	49.51	AVG	-6.80	42.71	54.00	100	75	-11.29	
	1603.206	46.78	peak	-7.75	39.03	74.00	100	120	-34.97	
	1603.206	45.36	AVG	-7.75	37.61	54.00	100	120	-16.39	
	1855.711	53.84	peak	-6.56	47.28	74.00	100	165	-26.72	
*	1855.711	52.17	AVG	-6.56	45.61	54.00	100	165	-8.39	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

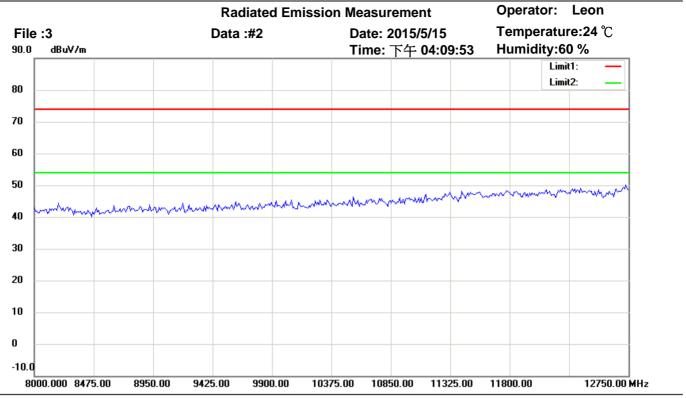

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

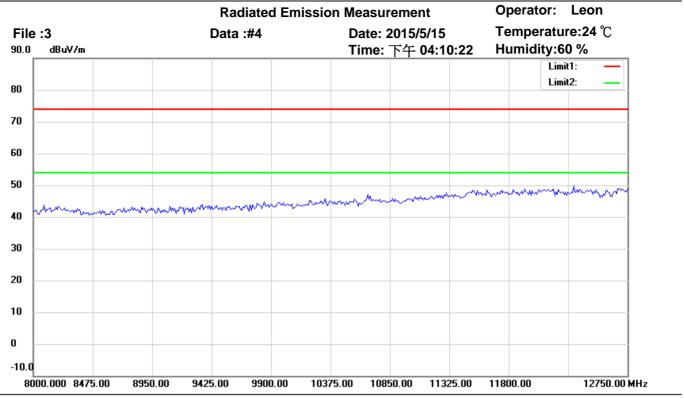

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz


	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

RX Antenna model: PWD100



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei

Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

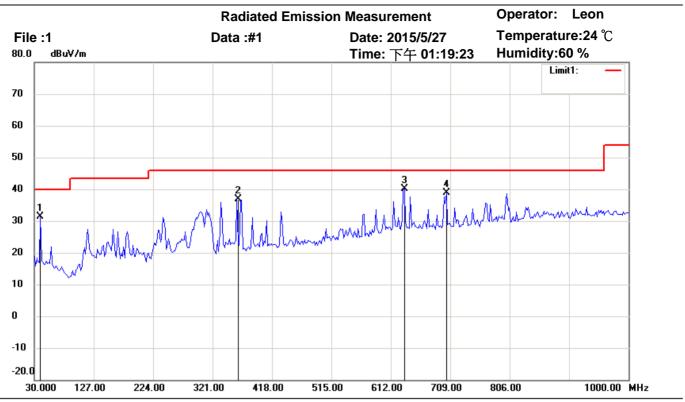

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	16.76	peak	14.56	31.32	40.00	100	145	-8.68	
	360.4610	19.17	peak	17.63	36.80	46.00	100	110	-9.20	
*	634.5490	15.93	peak	24.20	40.13	46.00	100	75	-5.87	
	702.5852	13.72	peak	25.26	38.98	46.00	100	150	-7.02	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

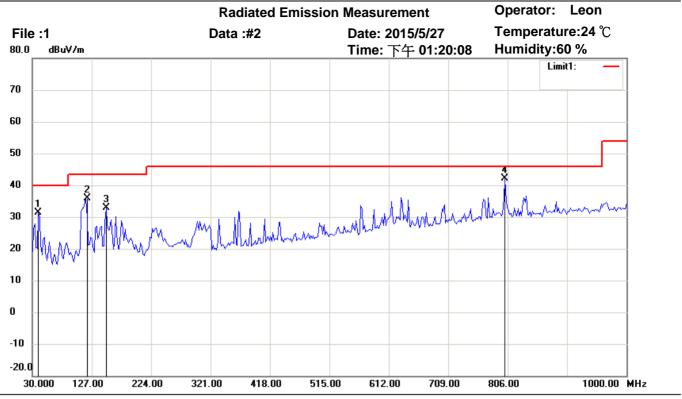

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	16.88	peak	14.56	31.44	40.00	100	60	-8.56	
	117.4750	22.07	peak	13.80	35.87	43.50	100	90	-7.63	
	150.5210	17.40	peak	15.50	32.90	43.50	100	35	-10.60	
*	801.7234	15.40	peak	26.63	42.03	46.00	100	85	-3.97	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

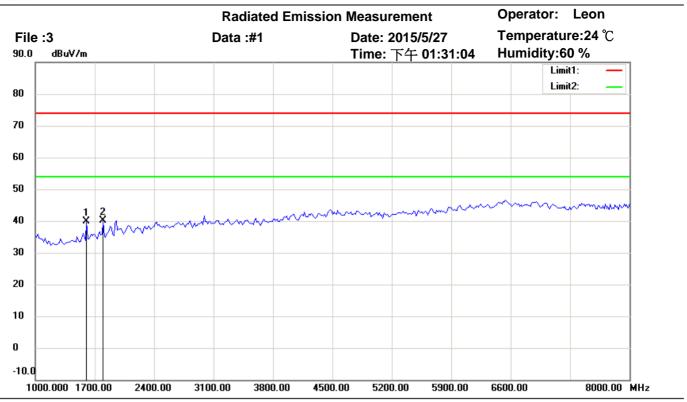

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	47.68	peak	-7.75	39.93	74.00	100	95	-34.07	
*	1799.599	47.34	peak	-7.27	40.07	74.00	100	160	-33.93	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

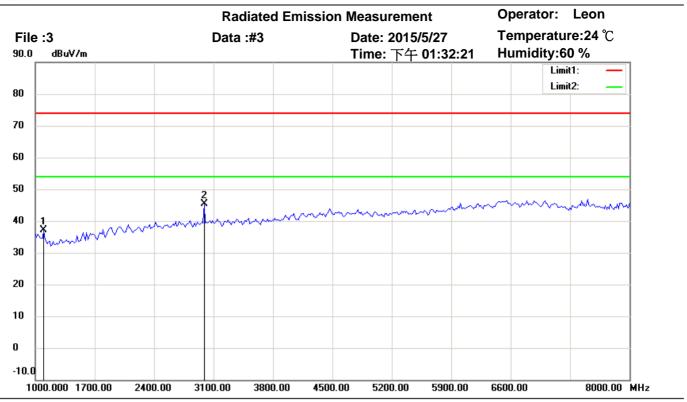

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1098.196	45.63	peak	-8.45	37.18	74.00	100	140	-36.82	
*	2991.984	47.95	peak	-2.47	45.48	74.00	100	130	-28.52	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

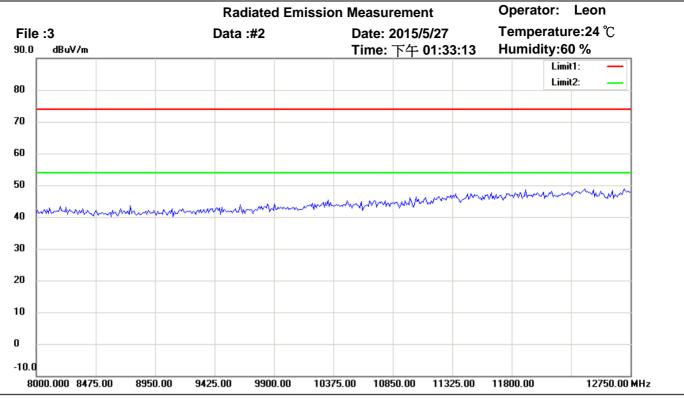

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

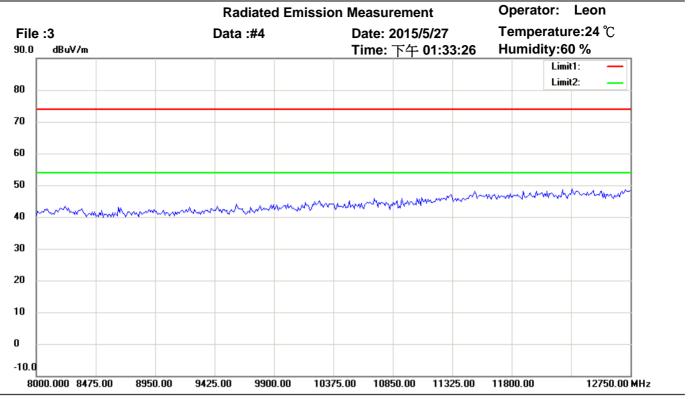

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

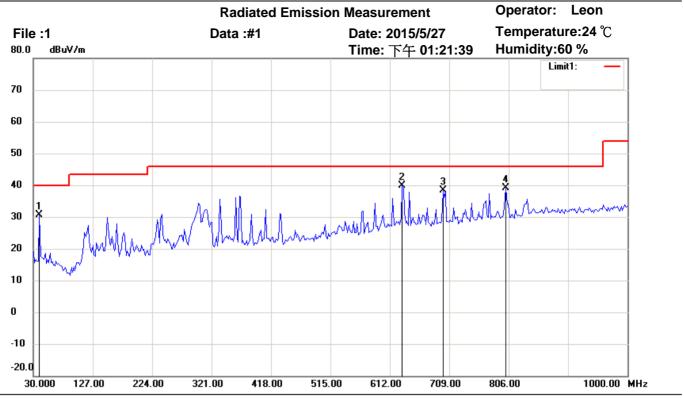

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	16.03	peak	14.56	30.59	40.00	100	135	-9.41	
*	632.6052	15.68	peak	24.16	39.84	46.00	100	145	-6.16	
	698.6974	13.27	peak	25.20	38.47	46.00	100	80	-7.53	
	801.7234	12.55	peak	26.63	39.18	46.00	100	110	-6.82	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

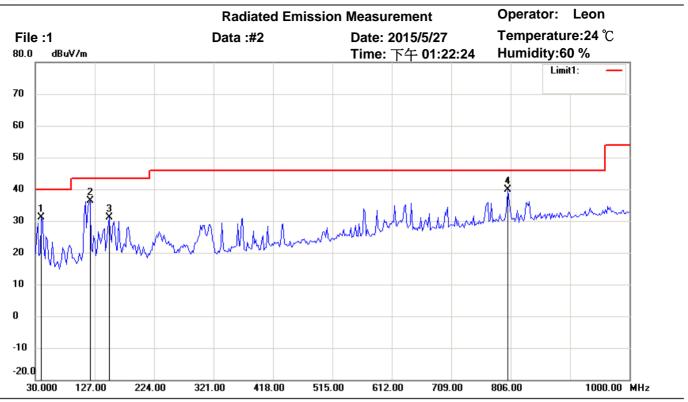

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	16.49	peak	14.56	31.05	40.00	100	80	-8.95	
	119.4188	22.37	peak	13.94	36.31	43.50	100	175	-7.19	
	150.5210	15.71	peak	15.50	31.21	43.50	100	130	-12.29	
*	801.7234	13.13	peak	26.63	39.76	46.00	100	210	-6.24	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

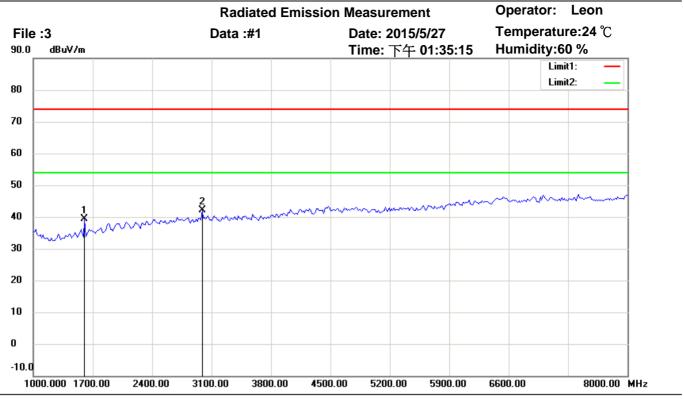

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	47.21	peak	-7.75	39.46	74.00	100	95	-34.54	
*	2991.984	44.69	peak	-2.47	42.22	74.00	100	110	-31.78	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

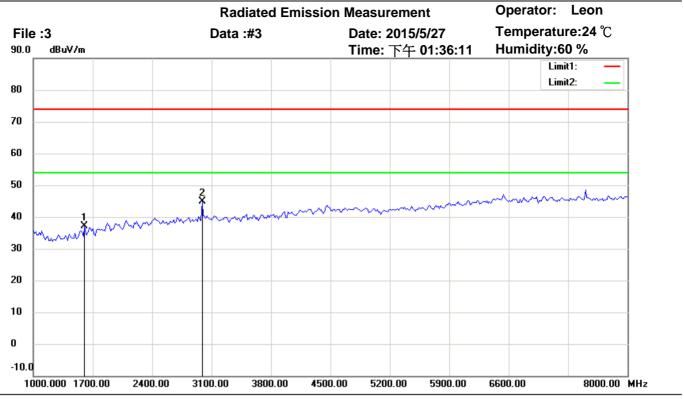

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	44.94	peak	-7.75	37.19	74.00	100	135	-36.81	
*	2991.984	47.34	peak	-2.47	44.87	74.00	100	75	-29.13	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

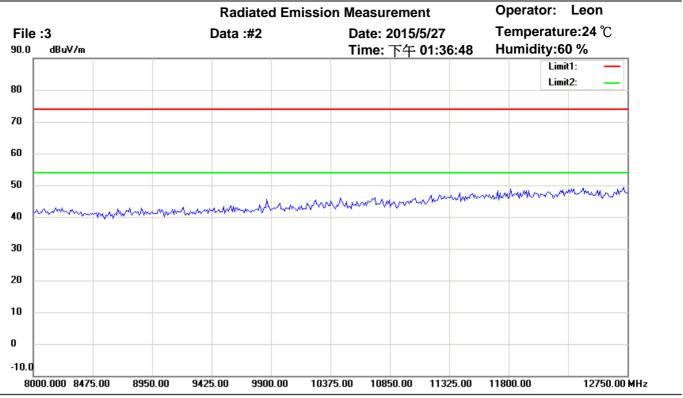

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

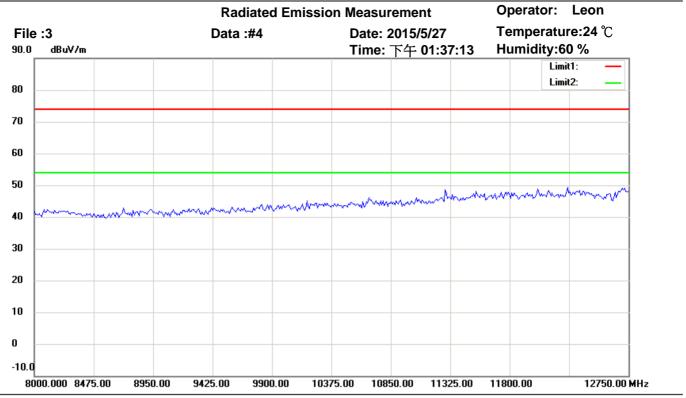

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

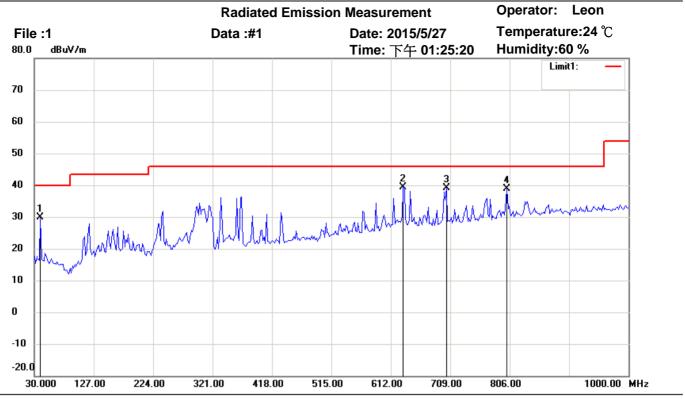

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	15.35	peak	14.56	29.91	40.00	100	230	-10.09	
*	632.6052	15.30	peak	24.16	39.46	46.00	100	70	-6.54	
	702.5852	13.79	peak	25.26	39.05	46.00	100	115	-6.95	
	801.7234	12.18	peak	26.63	38.81	46.00	100	160	-7.19	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

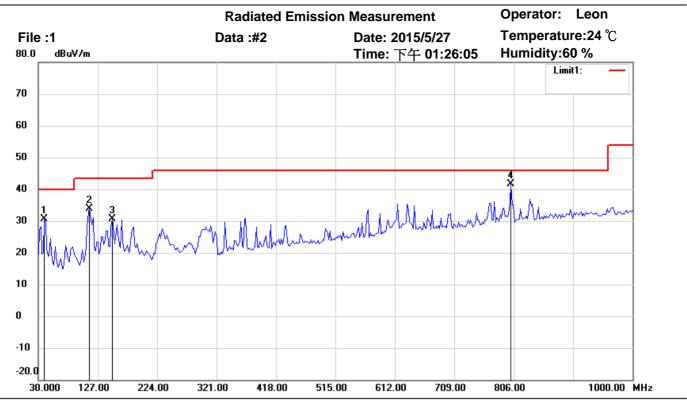

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	39.7194	16.02	peak	14.56	30.58	40.00	100	165	-9.42	
	113.5872	20.37	peak	13.52	33.89	43.50	100	110	-9.61	
	150.5210	15.11	peak	15.50	30.61	43.50	100	90	-12.89	
*	801.7234	15.07	peak	26.63	41.70	46.00	100	75	-4.30	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

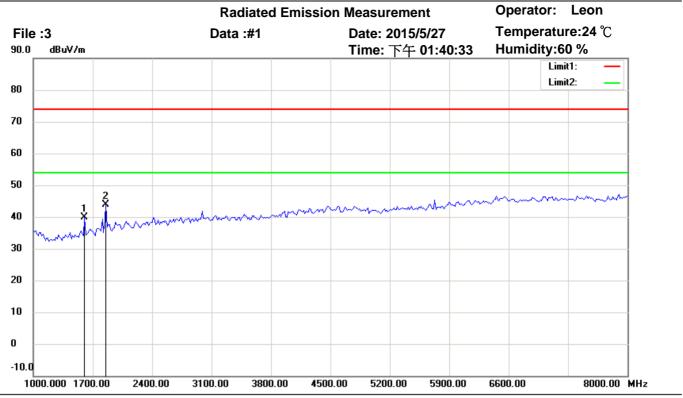

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1603.206	47.73	peak	-7.75	39.98	74.00	100	210	-34.02	
*	1855.711	50.42	peak	-6.56	43.86	74.00	100	130	-30.14	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

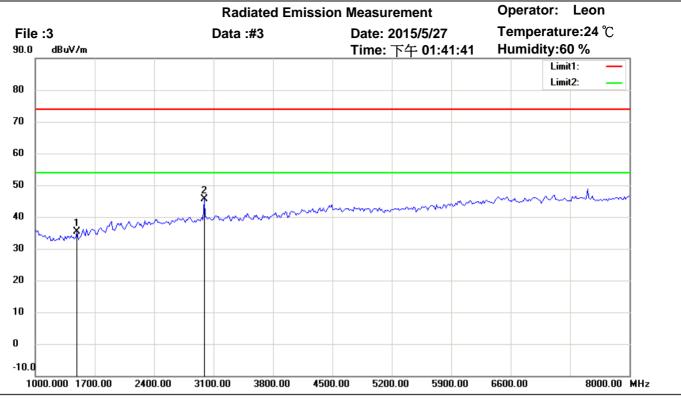

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1490.982	44.30	peak	-8.92	35.38	74.00	100	120	-38.62	
*	2991.984	48.10	peak	-2.47	45.63	74.00	100	85	-28.37	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

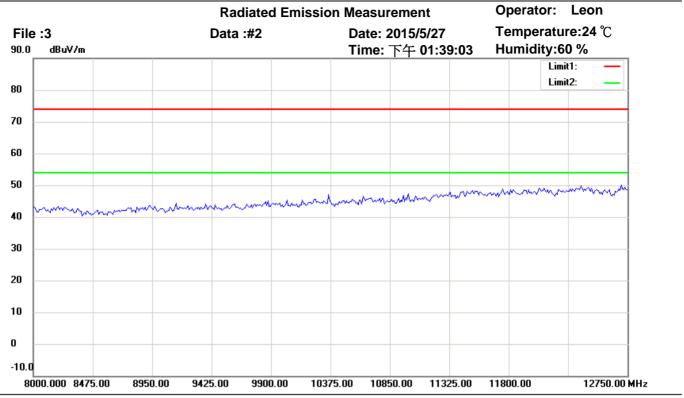

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

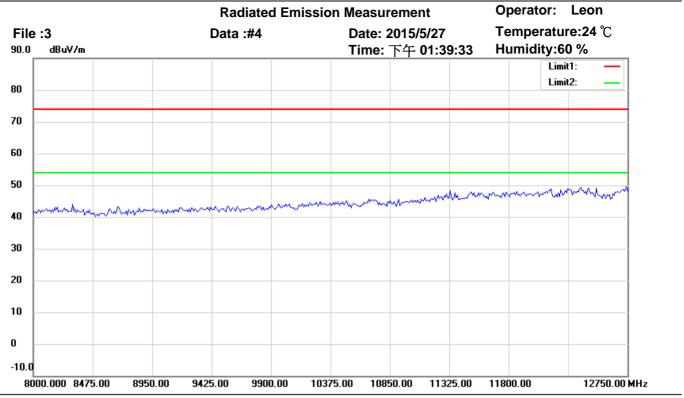

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

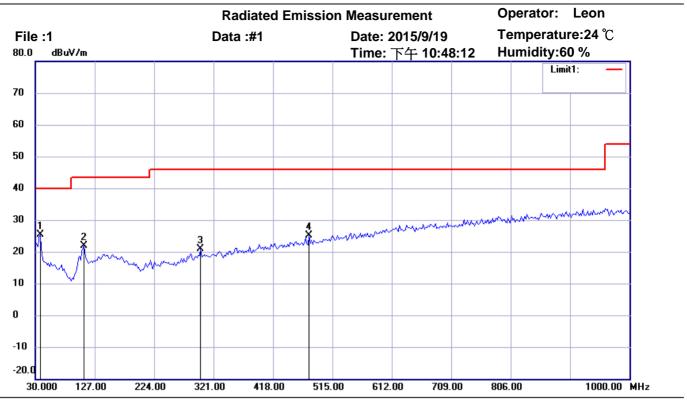

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7754	11.01	peak	14.33	25.34	40.00	100	35	-14.66	
	109.6993	8.56	peak	13.21	21.77	43.50	100	60	-21.73	
	300.2004	4.86	peak	16.04	20.90	46.00	100	145	-25.10	
	477.0942	4.67	peak	20.56	25.23	46.00	100	120	-20.77	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

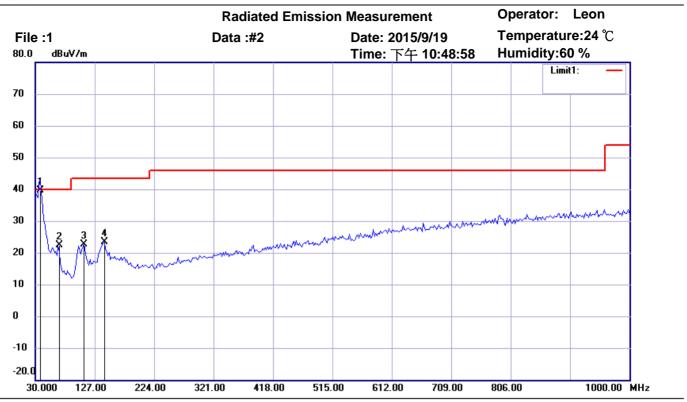

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	25.41	QP	14.33	39.74	40.00	100	170	-0.26	
	66.9340	10.04	peak	12.28	22.32	40.00	100	55	-17.68	
	109.6994	9.48	peak	13.21	22.69	43.50	100	120	-20.81	
	142.7455	7.84	peak	15.43	23.27	43.50	100	95	-20.23	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

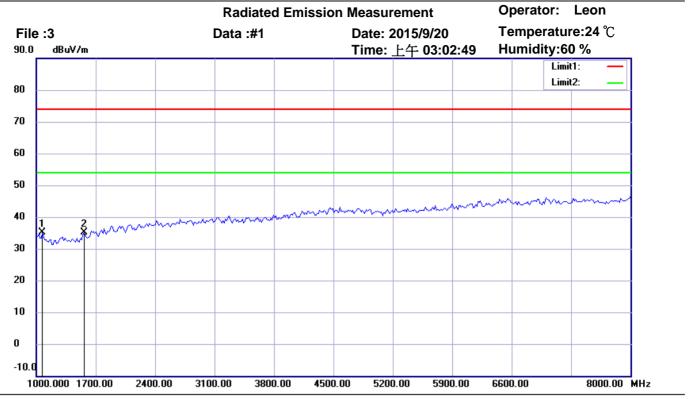

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1070.140	42.95	peak	-7.90	35.05	74.00	100	125	-38.95	
	1561.122	43.23	peak	-8.22	35.01	74.00	100	60	-38.99	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

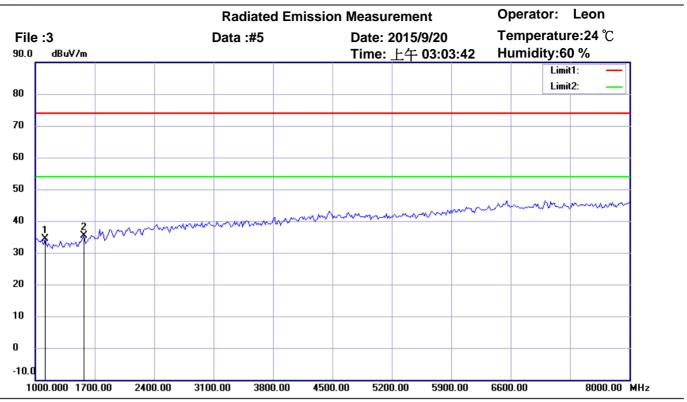

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1112.224	43.09	peak	-8.64	34.45	74.00	100	110	-39.55	
*	1575.150	43.50	peak	-8.06	35.44	74.00	100	35	-38.56	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

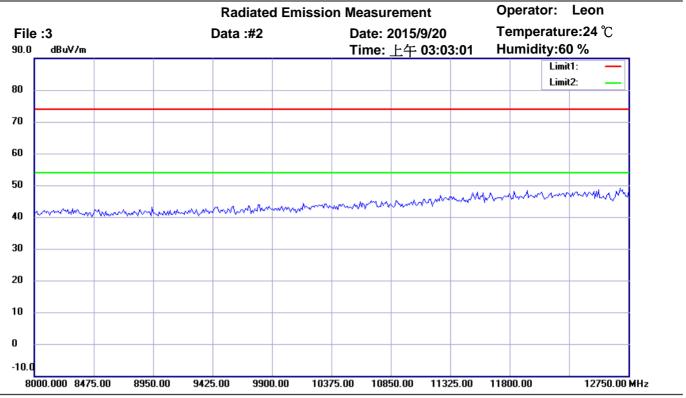

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

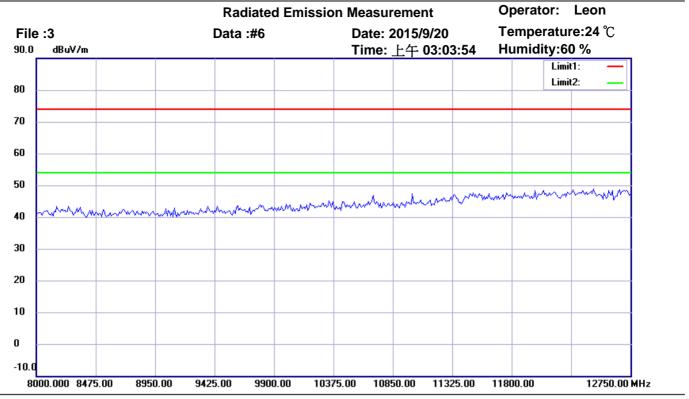

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

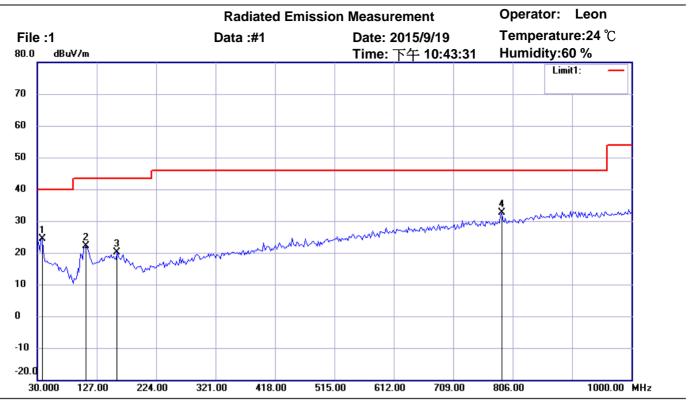

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7754	10.02	peak	14.33	24.35	40.00	100	120	-15.65	
	109.6993	8.83	peak	13.21	22.04	43.50	100	175	-21.46	
	160.2404	4.64	peak	15.48	20.12	43.50	100	140	-23.38	
*	788.1162	6.11	peak	26.44	32.55	46.00	100	55	-13.45	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

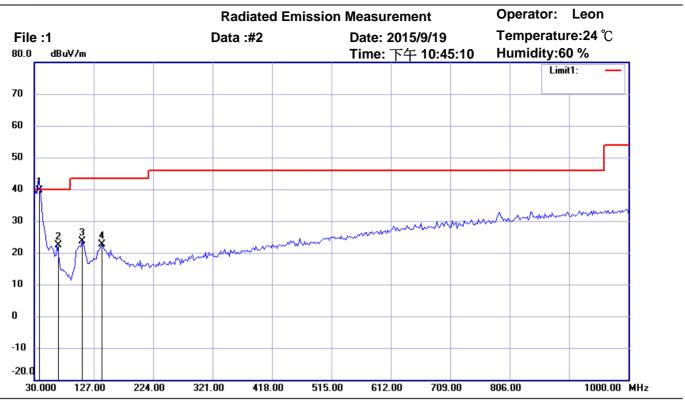

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	25.26	QP	14.33	39.59	40.00	100	135	-0.41	
	66.9340	10.16	peak	12.28	22.44	40.00	100	90	-17.56	
	107.7555	10.83	peak	12.85	23.68	43.50	100	60	-19.82	
	140.8015	7.18	peak	15.41	22.59	43.50	100	155	-20.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

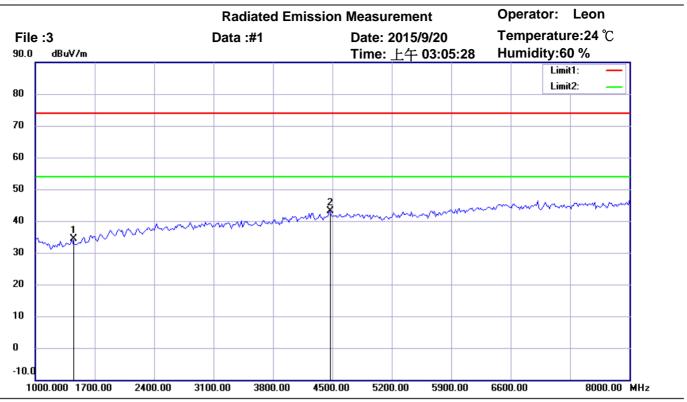

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1434.870	43.31	peak	-8.89	34.42	74.00	100	65	-39.58	
*	4464.930	42.32	peak	0.75	43.07	74.00	100	90	-30.93	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

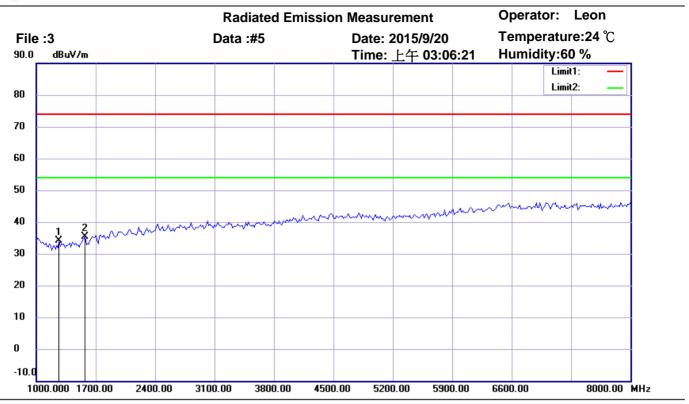

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1266.533	43.05	peak	-8.99	34.06	74.00	100	135	-39.94	
*	1575.150	43.38	peak	-8.06	35.32	74.00	100	210	-38.68	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

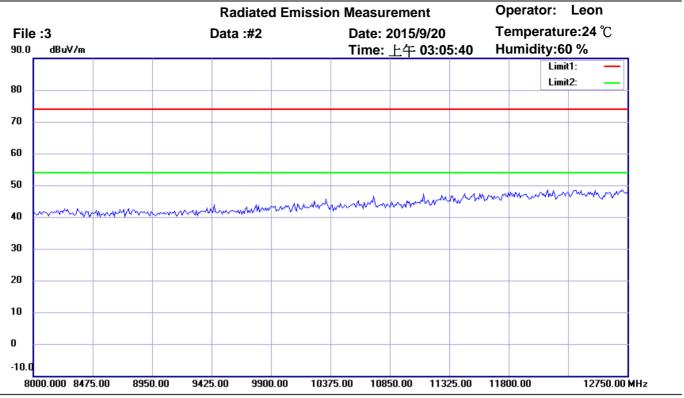

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

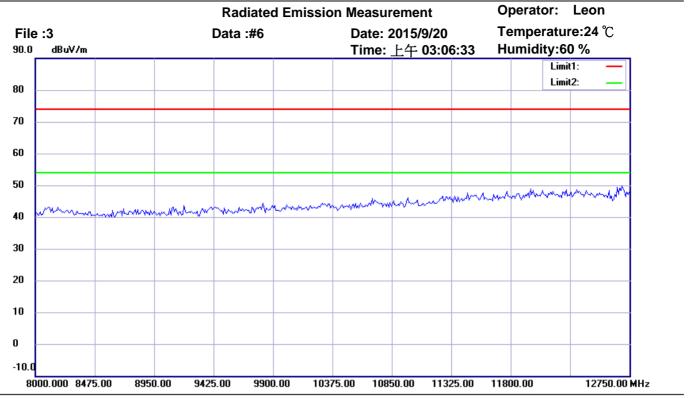

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

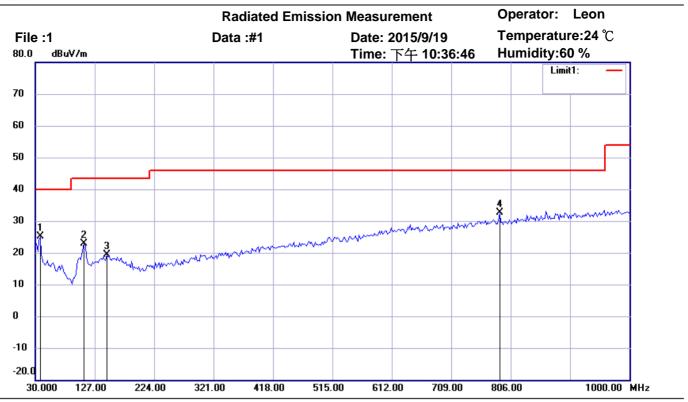

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7754	10.71	peak	14.33	25.04	40.00	100	105	-14.96	
	109.6993	9.78	peak	13.21	22.99	43.50	100	90	-20.51	
	146.6332	3.95	peak	15.47	19.42	43.50	100	130	-24.08	
*	788.1162	6.31	peak	26.44	32.75	46.00	100	165	-13.25	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

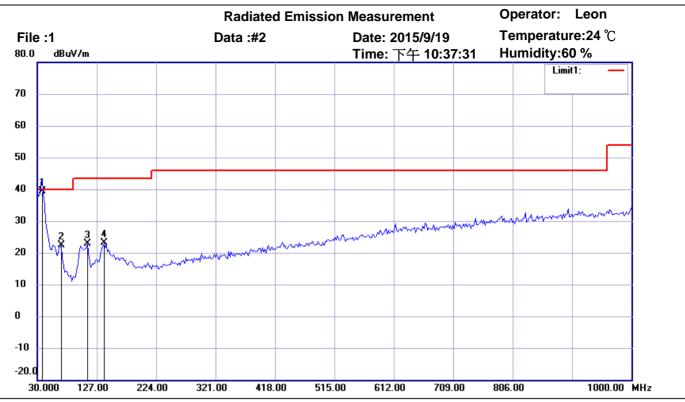

Site: Chamber


Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.5875	24.97	QP	14.31	39.28	40.00	100	125	-0.72	
	68.8777	10.23	peak	12.04	22.27	40.00	100	185	-17.73	
	111.6431	9.60	peak	13.38	22.98	43.50	100	55	-20.52	
	138.8575	7.86	peak	15.33	23.19	43.50	100	230	-20.31	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

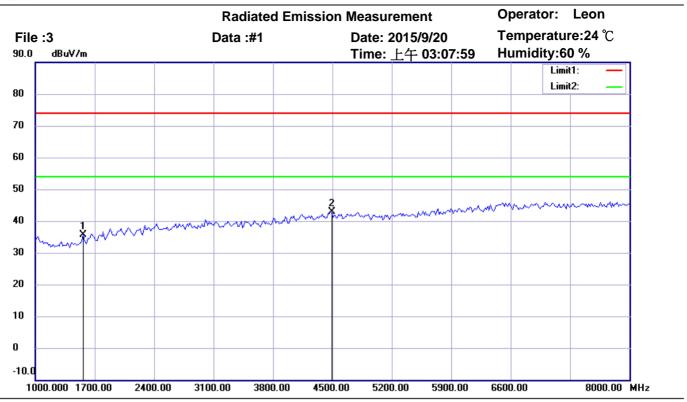

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1561.122	43.81	peak	-8.22	35.59	74.00	100	145	-38.41	
*	4478.958	41.98	peak	0.92	42.90	74.00	100	60	-31.10	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

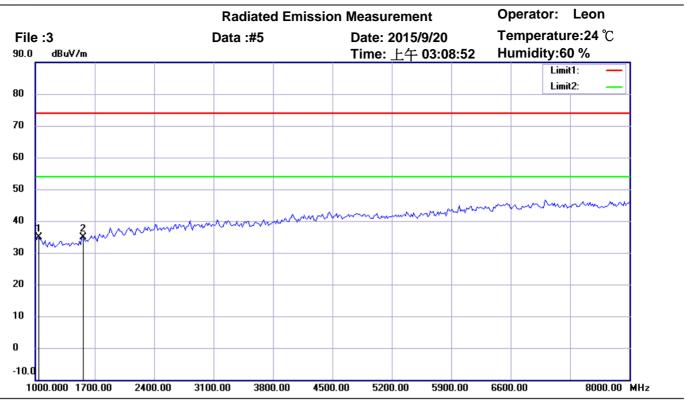

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1042.084	42.16	peak	-7.35	34.81	74.00	100	55	-39.19	
*	1561.122	43.21	peak	-8.22	34.99	74.00	100	30	-39.01	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

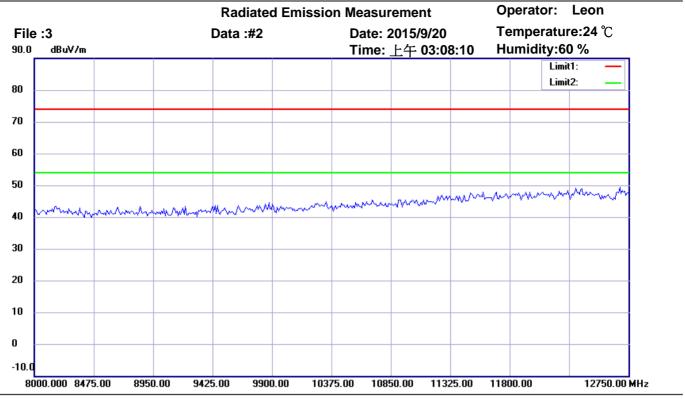

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

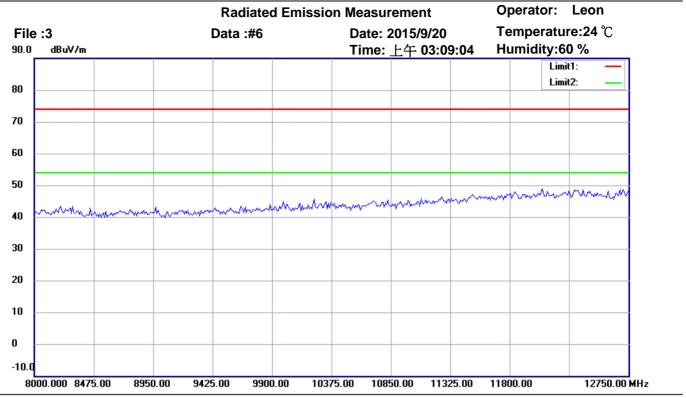

Site: Chamber


Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

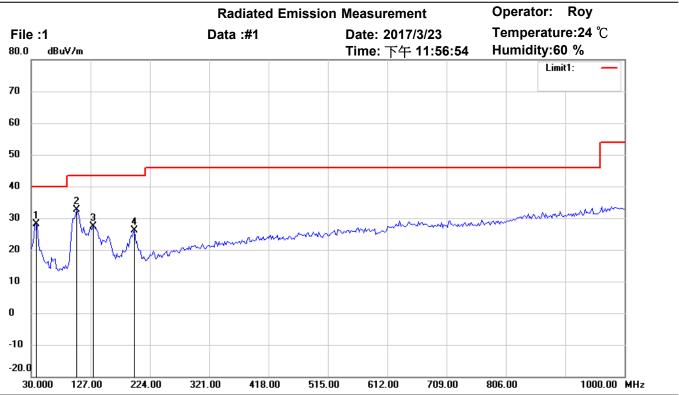

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7756	35.93	peak	-7.87	28.06	40.00	100	245	-11.94	
*	103.8677	41.17	peak	-8.51	32.66	43.50	100	180	-10.84	
	131.0822	33.52	peak	-6.22	27.30	43.50	100	300	-16.20	
	199.1182	36.53	peak	-10.34	26.19	43.50	100	160	-17.31	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

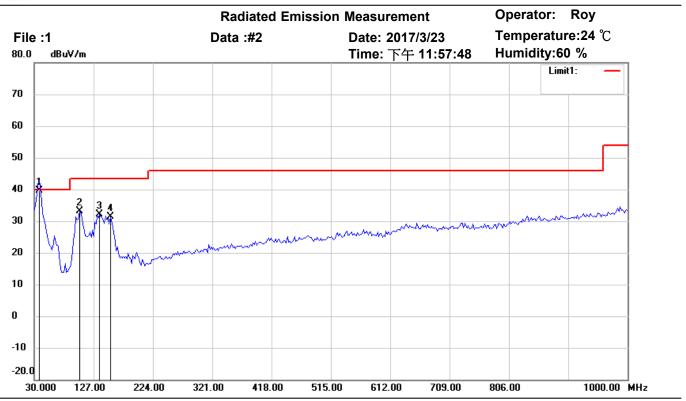

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	47.49	QP	-7.87	39.62	40.00	100	100	-0.38	
	103.8677	41.53	peak	-8.51	33.02	43.50	100	250	-10.48	
	136.9138	38.78	peak	-6.54	32.24	43.50	100	325	-11.26	
	154.4088	39.56	peak	-8.16	31.40	43.50	100	40	-12.10	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

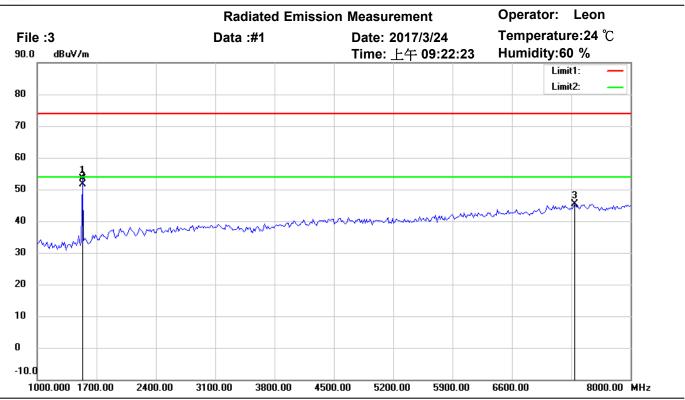

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1533.066	62.32	peak	-8.82	53.50	74.00	150	235	-20.50	
*	1533.066	60.57	AVG	-8.82	51.75	54.00	150	235	-2.25	
	7340.681	40.73	peak	4.63	45.36	74.00	150	60	-28.64	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

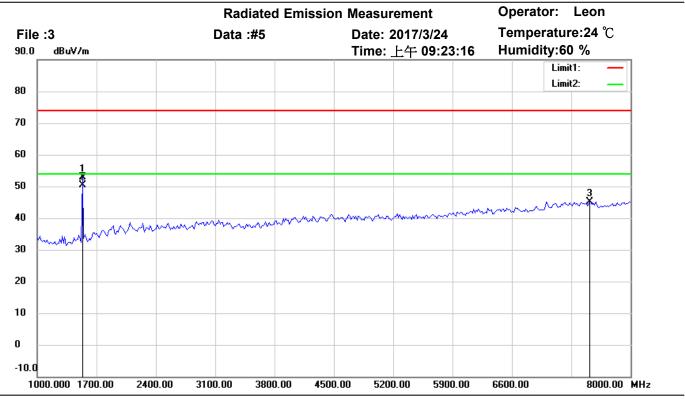

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 902.75MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1533.066	61.82	peak	-8.82	53.00	74.00	150	95	-21.00	
*	1533.066	59.23	AVG	-8.82	50.41	54.00	150	95	-3.59	
	7523.046	40.52	peak	4.65	45.17	74.00	150	160	-28.83	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

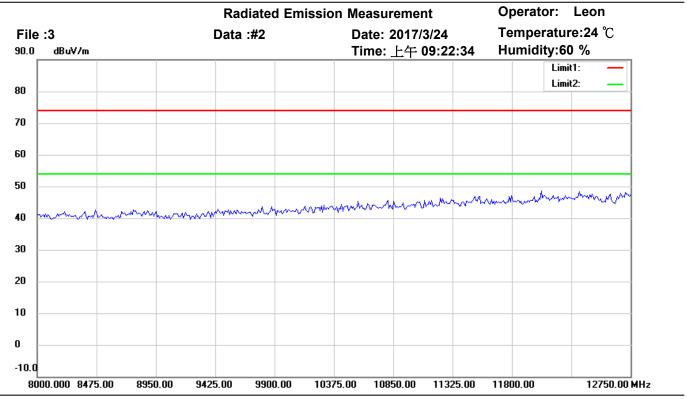

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 902.75MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment	l
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)		



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

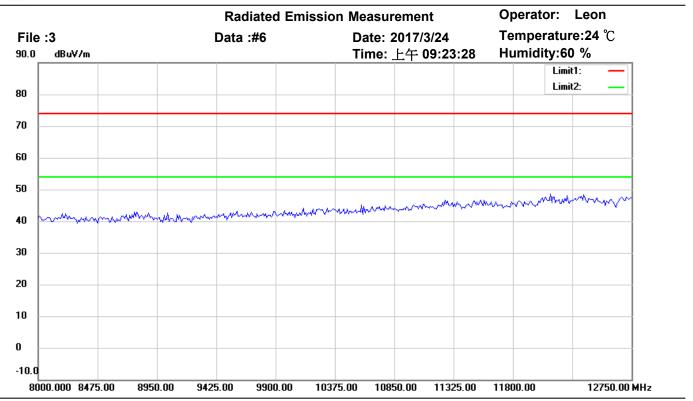

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: RX 902.75MHz

Note:


M/N:

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

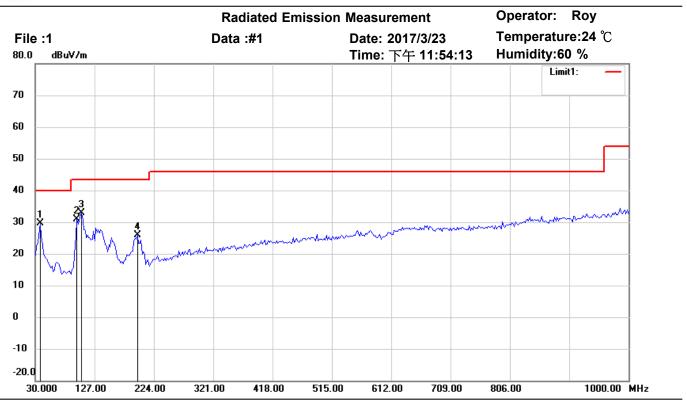

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	37.38	peak	-7.87	29.51	40.00	100	80	-10.49	
	98.0361	41.07	peak	-10.19	30.88	43.50	100	150	-12.62	
	105.8116	40.79	peak	-8.02	32.77	43.50	100	110	-10.73	
	197.1741	36.49	peak	-10.49	26.00	43.50	100	230	-17.50	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

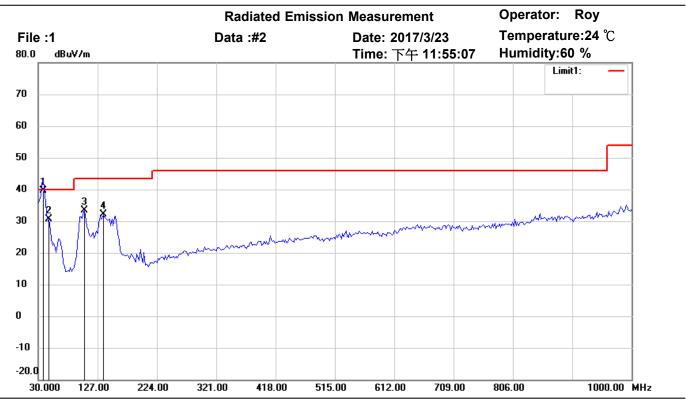

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	47.55	QP	-7.87	39.68	40.00	100	140	-0.32	
	47.4950	40.00	peak	-9.26	30.74	40.00	100	205	-9.26	
	105.8116	41.41	peak	-8.02	33.39	43.50	100	290	-10.11	
	136.9138	38.72	peak	-6.54	32.18	43.50	100	310	-11.32	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

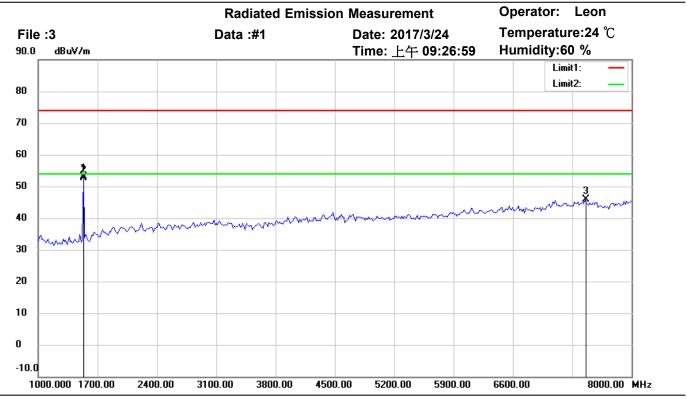

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1533.066	61.90	peak	-8.82	53.08	74.00	150	233	-20.92	
*	1533.066	61.56	AVG	-8.82	52.74	54.00	150	233	-1.26	
	7452.906	40.97	peak	4.85	45.82	74.00	150	195	-28.18	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

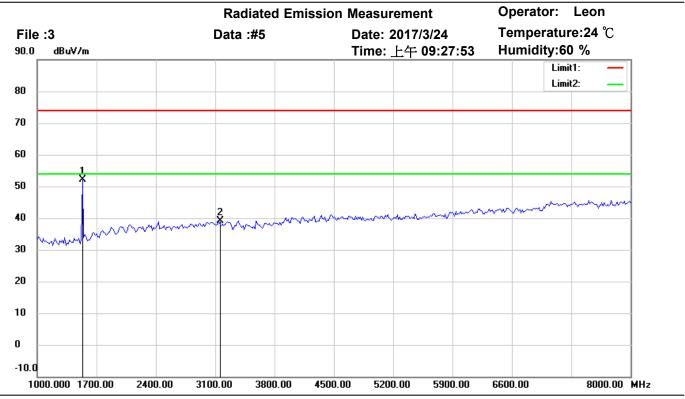

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 915.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1533.066	60.85	peak	-8.82	52.03	74.00	150	175	-21.97	
	3146.293	41.91	peak	-2.81	39.10	74.00	150	40	-34.90	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

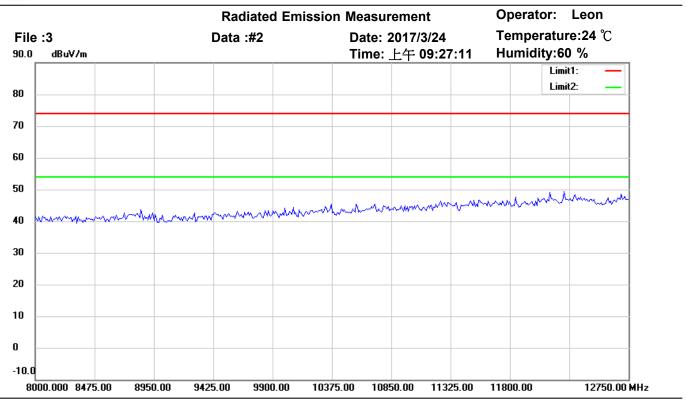

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 915.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

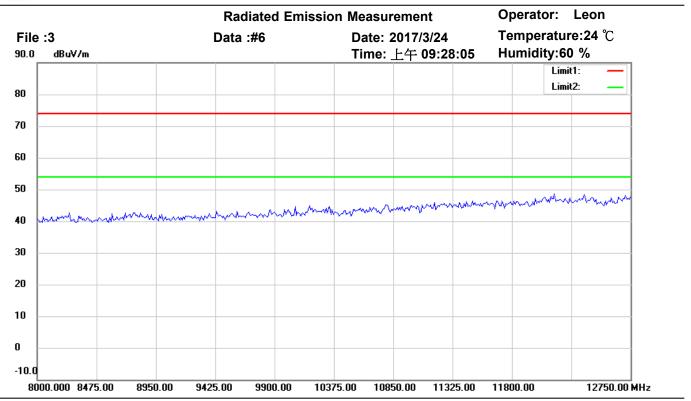

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.

Test Mode: RX 915.25MHz

Note:


M/N:

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	

Distance: 3m



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

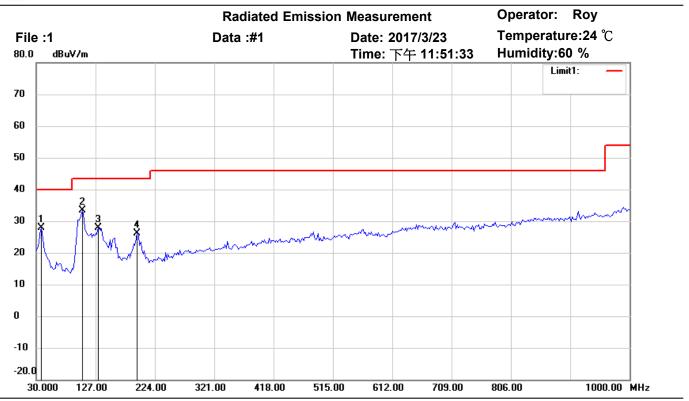

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	37.7756	35.78	peak	-7.87	27.91	40.00	100	325	-12.09	
*	105.8116	41.37	peak	-8.02	33.35	43.50	100	50	-10.15	
	131.0822	34.02	peak	-6.22	27.80	43.50	100	190	-15.70	
	195.2305	36.78	peak	-10.64	26.14	43.50	100	105	-17.36	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

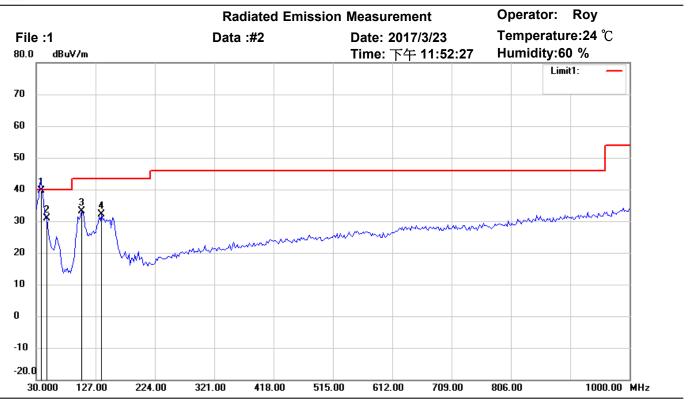

Site: Chamber

Condition: FCC_part 15 RE-Class B_30-1000MHz Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	37.7756	47.51	QP	-7.87	39.64	40.00	100	185	-0.36	
	47.4950	40.12	peak	-9.26	30.86	40.00	100	220	-9.14	
	103.8677	41.57	peak	-8.51	33.06	43.50	100	295	-10.44	
	136.9138	38.67	peak	-6.54	32.13	43.50	100	335	-11.37	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

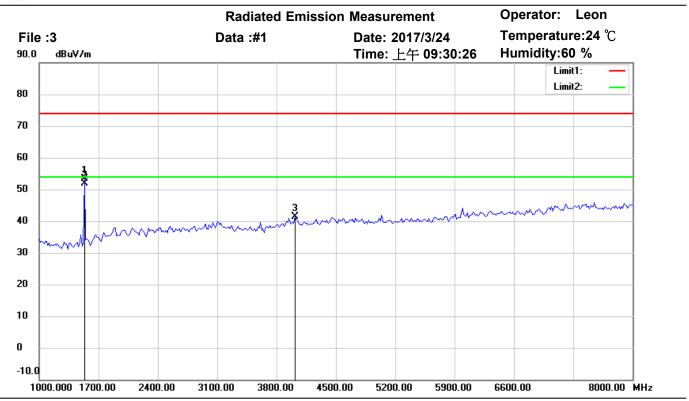

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1533.066	62.29	peak	-8.82	53.47	74.00	150	210	-20.53	
*	1533.066	60.79	AVG	-8.82	51.97	54.00	150	210	-2.03	
	4016.032	42.52	peak	-1.14	41.38	74.00	150	175	-32.62	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

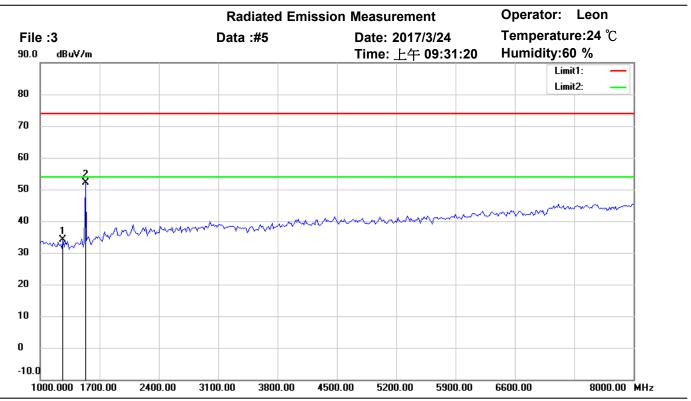

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 927.25MHz

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1266.533	43.50	peak	-9.41	34.09	74.00	150	90	-39.91	
*	1533.066	60.91	peak	-8.82	52.09	74.00	150	235	-21.91	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

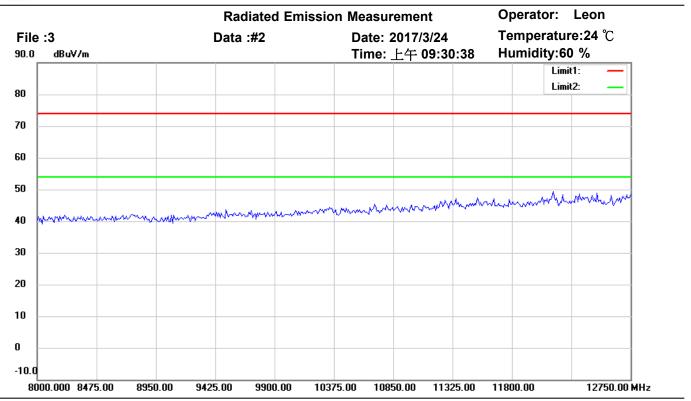

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Horizontal

EUT: W6R21703-16688 Power: 120 Va.c.


M/N: Distance: 3m

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	



Tel:+886-2-6606-8877 Fax:+886-2-6606-8875

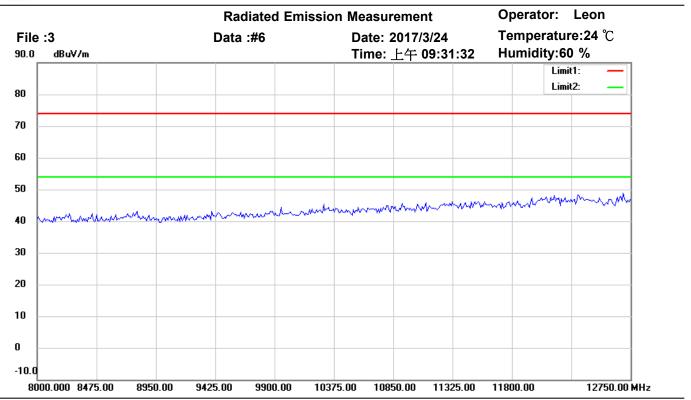

Site: Chamber

Condition: FCC_part 15 RE-Class B_Above 1GHz_PK Polarization: Vertical

Test Mode: RX 927.25MHz

	Frequency	Reading	Detector	Corr. factor	Result	Limit	Ant.Pos	Tab.Pos	Margin	Comment
Mk.	(MHz)	(dBuV)		(dB/m)	(dBuV/m)	(dBuV/m)	(cm)	(deg.)	(dB)	