Report No.: 0600342


DVD Playing mode (Modulating on) AC Mains

Tested By:Hong, Report No.:0600342 Scan Settings (1 Range)

----- Frequencies ----- Receiver Settings -----Step IF BW Detector M-Time Atten Preamp OpRge 5k 10k PK+AV 10ms AUTO LN OFF 60dB Start 150k 30M

Final Measurement: x QP / + AV

Meas Time: 1 s Subranges: 16 Acc Margin: 20dB Transducer No. Start Stop Name 1 15 9k 30M EW0090 21 9k 30M EW0698

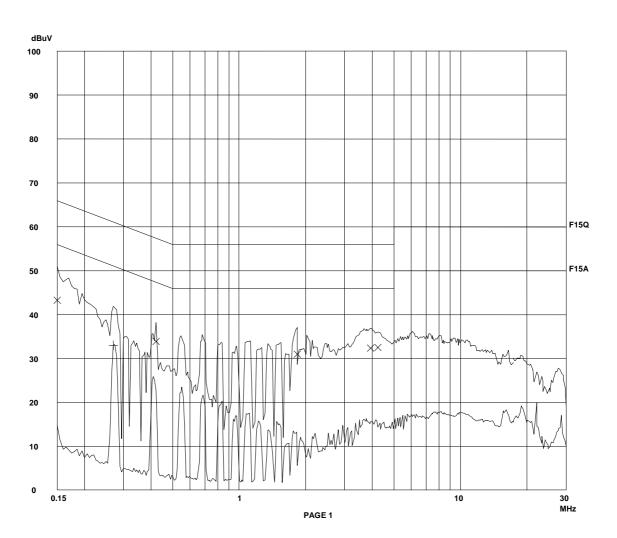



Report No.: 0600342

DVD Playing mode (Modulating on) AC Mains

Tested By:Hong, Report No.:0600342

Scan Settings (1 Range)

|------ Frequencies ------|------- Receiver Settings ------|
Start Stop Step IF BW Detector M-Time Atten Preamp OpRge
150k 30M 5k 10k PK+AV 10ms AUTO LN OFF 60dB

Final Measurement Results:

Frequency QP Level QP Limit

MHz dBuV dBuV

0.15000 43.2 66.0

0.42000 33.9 57.5

1.83000 31.0 56.0

3.92500 32.3 56.0

4.22500 32.4 56.0

Frequency AV Level AV Limit

MHz dBuV dBuV

0.27000 33.0 51.1

* limit