

FCC RF Test Report

APPLICANT **Teleepoch Limited EQUIPMENT** CDMA mobile phone

: PCD BRAND NAME

MODEL NAME : CM370MV

FCC ID : U46-CM370MV

STANDARD : FCC 47 CFR Part 2, 22(H), 24(E), 27(L)

CLASSIFICATION : PCS Licensed Transmitter Held to Ear (PCE) Tx/Rx FREQUENCY RANGE : 824.70 ~ 848.31 MHz /869.70 ~ 893.31 MHz

: 0.12 W MAX. ERP/EIRP POWER EMISSION DESIGNATOR : 1M25F9W

The product was received on Mar 15, 2011 and completely tested on Mar 20, 2011. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI / TIA / EIA-603-C-2004 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL (KUNSHAN) INC., the test report shall not be reproduced except in full.

Reviewed by:

Jones Tsai / Manager



1190

Report No.: FG131537

SPORTON INTERNATIONAL (KUNSHAN) INC. No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV

Page Number : 1 of 31 Report Issued Date: May 12, 2011

Report Version : Rev. 01





TABLE OF CONTENTS

| RE | visio | N HISTORY | 3 |
|----|---|---|----------------------|
| SU | MMAF | RY OF TEST RESULT | 4 |
| 1 | GEN | ERAL DESCRIPTION | 5 |
| | 1.1 1.2 1.3 1.4 1.5 1.6 | Applicant | 5 6 6 |
| 2 | TES 1 2.1 2.2 | T CONFIGURATION OF EQUIPMENT UNDER TEST Test Mode Connection Diagram of Test System | 7 |
| 3 | TEST | 「RESULT | 9 |
| | 3.1 3.2 3.3 3.4 3.5 3.6 3.7 | Conducted Output Power Measurement | 11 14 16 19 |
| 4 | LIST | OF MEASURING EQUIPMENTS | 30 |
| | PEND | ERTAINTY OF EVALUATION | 31 |
| ΑP | PEND | IX B. SETUP PHOTOGRAPHS | |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 2 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



REVISION HISTORY

| REPORT NO. | VERSION | DESCRIPTION | ISSUED DATE |
|------------|---------|-------------------------|--------------|
| FG131537 | Rev. 01 | Initial issue of report | May 12, 2011 |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 3 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



SUMMARY OF TEST RESULT

| Report Section | FCC Rule | IC Rule | Description | Limit | Result | Remark |
|-------------------|--|---|---|-------------------------------------|--------|--|
| 3.1 | §2.1046 | N/A | Conducted Output Power | N/A | PASS | - |
| 3.2 | §22.913(a)(2) | RSS-132(4.4) SRSP-503(5.1.3) | Effective Radiated Power | < 7 Watts | PASS | - |
| 3.2 | §24.232(c) | RSS-133 (6.4) SRSP-510(5.1.2) | Equivalent Isotropic Radiated Power | < 2 Watts | PASS | - |
| 3.2 | §27.50(d)(2) | RSS-139 (6.4) SRSP-513(5.1.2) | Equivalent Isotropic Radiated Power | < 1 Watts | PASS | - |
| 3.3 | \$2.1049 \$22.917(a) \$24.238(a) \$27.53(g) | N/A | Occupied Bandwidth | N/A | PASS | - |
| 3.4 | §2.1051 §22.917(a) §24.238(a) §27.53(g) | RSS-132 (4.5.1) RSS-133 (6.5.1) RSS-139 (6.5) | Band Edge Measurement | < 43+10log ₁₀ (P[Watts]) | PASS | - |
| 3.5 | \$2.1051 \$22.917(a) \$24.238(a) \$27.53(g) | RSS-132 (4.5.1) RSS-133 (6.5.1) RSS-139 (6.5) | Conducted Emission | < 43+10log ₁₀ (P[Watts]) | PASS | - |
| 3.6 | §2.1053 §22.917(a) §24.238(a) §27.53(g) | RSS-132 (4.5.1) RSS-133 (6.5.1) RSS-139 (6.5) | Field Strength of Spurious Radiation | < 43+10log ₁₀ (P[Watts]) | PASS | Under limit 45.77 dB at 5854 MHz |
| 3.7 | \$2.1055 \$22.355 \$24.235 \$27.54 | RSS-132 (4.3) RSS-133 (6.3) RSS-139 (6.3) | Frequency Stability for Temperature & Voltage | < 2.5 ppm | PASS | - |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 4 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



1 General Description

1.1 Applicant

Teleepoch Limited

5A,B1 Building,Digital tech Zone,high-techpark(south),Nanshan District,Shenzhen

1.2 Manufacturer

Teleepoch Limited

5A,B1 Building,Digital tech Zone,high-techpark(south),Nanshan District,Shenzhen

1.3 Feature of Equipment Under Test

| Product Feature & Specification | | | | |
|---------------------------------|------------------------|--|--|--|
| Equipment | CDMA mobile phone | | | |
| Brand Name | PCD | | | |
| Model Name | CM370MV | | | |
| FCC ID | U46-CM370MV | | | |
| Tx Frequency | 824 MHz ~ 849 MHz | | | |
| Rx Frequency | 869 MHz ~ 894 MHz | | | |
| Maximum Output Power to Antenna | 24.11 dBm | | | |
| Maximum ERP/EIRP | 0.12 W (20.77 dBm) | | | |
| Antenna Type | Fixed Internal Antenna | | | |
| HW Version | V1.0 | | | |
| SW Version | CM370MV_V1.10 | | | |
| Type of Modulation | QPSK | | | |
| Type of Emission | 1M25F9W | | | |
| EUT Stage | Identical Prototype | | | |

Remark:

- 1. For other wireless features of this EUT, the test report will be issued separately.
- This test report recorded only product characteristics and test results of PCS Licensed Transmitter Held to Ear (PCE).
- **3.** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

SPORTON INTERNATIONAL (KUNSHAN) INC. TEL: 86-0512-5790-0158

FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 5 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



1.4 Testing Site

| Test Site | SPORTON INTERNATIONAL (KUNSHAN) INC. | | | |
|--------------------|--|-----------|--|--|
| | No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C. | | | |
| Test Site Location | TEL: +86-0512-5790-0158 | | | |
| | FAX: +86-0512-5790-0958 | | | |
| Took Site No. | Sporton Site No. | | | |
| Test Site No. | TH01-KS | 03CH01-KS | | |

1.5 Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- Preliminary Guidance for Receiving Applications for Certification of 3G Device. May 9, 2006.
- 47 CFR Part 2, 22(H), 24(E), 27(L)
- ANSI / TIA / EIA-603-C-2004
- IC RSS-132 Issue 2
- IC RSS-133 Issue 5
- IC RSS-139 Issue 2

Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B (DoC), recorded in a separate test report.

1.6 Ancillary Equipment List

| Iten | Equipment | Trade Name | Model No. | FCC ID | Data Cable | Power Cord |
|------|------------------|------------|-----------|--------|------------|-------------------|
| 1. | System Simulator | R&S | CMU200 | N/A | N/A | Unshielded, 1.8 m |

SPORTON INTERNATIONAL (KUNSHAN) INC. TEL: 86-0512-5790-0158

FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 6 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



2 Test Configuration of Equipment Under Test

2.1 Test Mode

During all testing, EUT is in link mode with base station emulator at maximum power level. The spurious emission measurements were carried out in semi-anechoic chamber with 3-meter test range, and EUT is rotated on three test planes to find out the worst emission.

Frequency range investigated for radiated emission is as follows:

- 1. 30 MHz to 9000 MHz for CDMA2000 BC0.
- 2. 30 MHz to 19000 MHz for CDMA2000 BC1.
- 3. 30 MHz to 18000 MHz for CDMA2000 BC15.

| Test Modes | | | | | |
|---------------------------------|-----------------------------|-------------------|--|--|--|
| Band Radiated TCs Conducted TCs | | | | | |
| CDMA2000 BC0 | ■ 1xRTT Link + Adapter Mode | ■ 1xRTT Link Mode | | | |

Note:

1. The maximum RF output power levels are 1xRTT RC3+SO55 mode for CDMA2000 BC0, only these modes were used for all tests.

The conducted power tables are as follows:

| Conducted Power (*Unit: dBm) | | | | | |
|------------------------------|--------------------|--------------|--------|--|--|
| Band | | CDMA2000 BC0 | | | |
| Channel | 1013 | 384 | 777 | | |
| Frequency | 824.7 | 836.52 | 848.31 | | |
| 1xRTT RC1+SO55 | 24.00 | 23.92 | 23.86 | | |
| 1xRTT RC3+SO55 | 24.10 | 24.03 | 23.97 | | |
| 1xRTT RC3+SO32(+F-SCH) | <mark>24.11</mark> | 23.99 | 23.96 | | |
| 1xRTT RC3+SO32(+SCH) | 23.99 | 23.95 | 23.94 | | |


SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 7 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



Report No.: FG131537

2.2 Connection Diagram of Test System

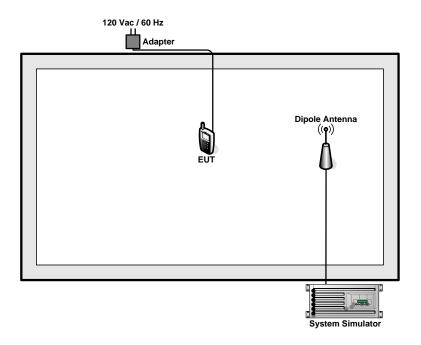

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 8 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3 Test Result

3.1 Conducted Output Power Measurement

3.1.1 Description of the Conducted Output Power Measurement

A base station simulator was used to establish communication with the EUT. Its parameters were set to transmit the maximum power on the EUT. The measured power in the radio frequency on the transmitter output terminals shall be reported.


3.1.2 Measuring Instruments

See list of measuring instruments of this test report.

3.1.3 Test Procedures

- 1. The transmitter output port was connected to base station.
- 2. Set EUT at maximum power through base station.
- 3. Select lowest, middle, and highest channels for each band and different modulation.

3.1.4 Test Setup



TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 9 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.1.5 Test Result of Conducted Output Power

| CDMA2000 BC0 | | | | | | |
|--------------|-------------|------------|--------------------|-----------------------|-------------------------|--|
| Test Mode | Test Status | Channel | Frequency (MHz) | Conducted Power (dBm) | Conducted Power (Watts) | |
| 00111 0000 | | 1013 (Low) | 824.70 | 24.11 dBm | 0.26 | |
| CDMA 2000 | RC3+SO32 | 384 (Mid) | 836.52 | 23.99 dBm | 0.25 | |
| 1xRTT | | 777 (High) | 848.31 | 23.96 dBm | 0.25 | |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 10 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01

3.2 Effective Radiated Power and Effective Isotropic Radiated Power Measurement

3.2.1 Description of the ERP/EIRP Measurement

ERP/EIRP is measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The ERP of mobile transmitters must not exceed 7 Watts. The EIRP of mobile transmitters are limited to 2 Watts for 1850~1910 MHz and 1 watt for 1710~1755 MHz.

Report No.: FG131537

3.2.2 Measuring Instruments

See list of measuring instruments of this test report.

3.2.3 Test Procedures

- 1. The EUT was placed on a turntable with 1.0 meter height in a fully anechoic chamber.
- 2. The EUT was set at 1.2 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest radiated power.
- 4. The height of the receiving antenna is adjusted to look for the maximum ERP/EIRP.
- 5. Taking the record of maximum ERP/EIRP.
- 6. A dipole antenna was substituted in place of the EUT and was driven by a signal generator.
- 7. The conducted power at the terminal of the dipole antenna is measured.
- 8. Repeat step 3 to step 5 to get the maximum ERP/EIRP of the substitution antenna.
- 9. ERP/EIRP = Ps + Et Es + Gs = Ps + Rt Rs + Gs

Ps (dBm): Input power to substitution antenna.

Gs (dBi or dBd): Substitution antenna Gain.

Et = Rt + AF

Es = Rs + AF

AF (dB/m): Receive antenna factor

Rt: The highest received signal in spectrum analyzer for EUT.

Rs: The highest received signal in spectrum analyzer for substitution antenna.

Page Number

Report Version

: 11 of 31


: Rev. 01

Report Issued Date: May 12, 2011



Report No.: FG131537

3.2.4 Test Setup

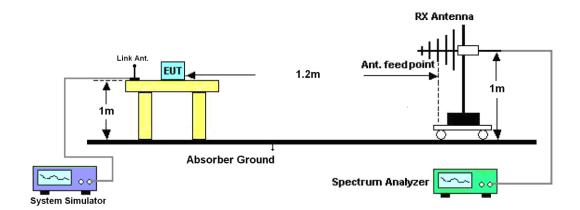

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 12 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



Report No. : FG131537

3.2.5 Test Result of ERP

| CDMA2000 BC0 1xRTT_RC3+SO32 Radiated Power ERP | | | | | | |
|--|-------------|-------------|-------------------|-------------|--------------|------------|
| | | Hori | zontal Polariza | ition | | |
| Frequency (MHz) | Rt (dBm) | Rs (dBm) | Ps (dBm) | Gs (dBd) | ERP (dBm) | ERP (W) |
| 824.70 | -28.12 | -48.12 | 0.00 | -1.08 | 18.92 | 0.08 |
| 836.52 | -27.68 | -48.28 | 0.00 | -0.93 | 19.67 | 0.09 |
| 848.31 | -26.82 | -48.35 | 0.00 | -0.76 | 20.77 | 0.12 |
| | | Ve | rtical Polarizati | ion | | |
| Frequency (MHz) | Rt (dBm) | Rs (dBm) | Ps (dBm) | Gs (dBd) | ERP (dBm) | ERP (W) |
| 824.70 | -40.33 | -47.97 | 0.00 | -1.08 | 6.56 | 0.00 |
| 836.52 | -40.19 | -48.01 | 0.00 | -0.93 | 6.89 | 0.00 |
| 848.31 | -39.60 | -48.05 | 0.00 | -0.76 | 7.69 | 0.01 |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV

Page Number : 13 of 31 Report Issued Date : May 12, 2011 : Rev. 01 Report Version



3.3 Occupied Bandwidth Measurement

3.3.1 Description of Occupied Bandwidth Measurement

The emission bandwidth is defined as the width of the signal between two points, located at the 2 sides of the carrier frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.


3.3.2 Measuring Instruments

See list of measuring instruments of this test report.

3.3.3 Test Procedures

- 1. The EUT was connected to Spectrum Analyzer and Base Station via power divider.
- 2. The 99% and 26 dB occupied bandwidth (BW) of the middle channel for the highest RF powers were measured.

3.3.4 Test Setup

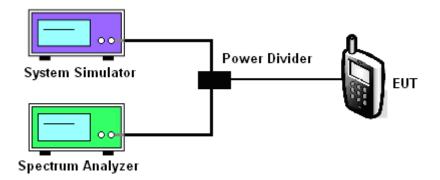

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV

Page Number : 14 of 31 Report Issued Date: May 12, 2011

Report No.: FG131537


Report Version : Rev. 01



3.3.5 Test Result (Plots) of Occupied Bandwidth


| Band : | CDMA2000 BC0 | Power Stage : | High |
|-------------|----------------|---------------|------|
| Test Mode : | 1xRTT_RC3+SO32 | | |

99% Occupied Bandwidth Plot on Channel 384

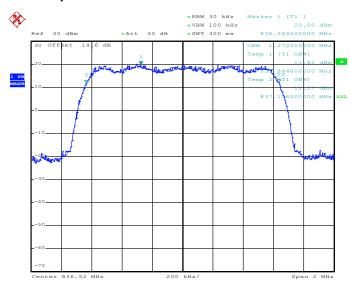

TH-01
Date: 18.MAR.2011 11:21:11

26dB Bandwidth Plot on Channel 384

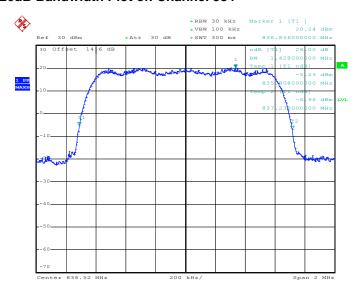

TH-01 Date: 18.MAR.2011 11:12:23

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 15 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.4 Band Edge Measurement

3.4.1 Description of Band Edge Measurement

The power of any emission outside of the authorized operating frequency ranges must be lower than the transmitter power (P) by a factor of at least 43 + 10 log (P) dB.

3.4.2 Measuring Instruments

See list of measuring instruments of this test report.

3.4.3 Test Procedures

- 1. The EUT was connected to Spectrum Analyzer and Base Station via power divider.
- The band edges of low and high channels for the highest RF powers were measured. Setting RBW as roughly BW/100.
- The RBW was replaced by 10 kHz, due to the spectrum analyzer IF-Filter including an excess
 of the limit. A worst case correction factor of 10 log (1% BW/measurement RBW) was
 implemented.

SPORTON INTERNATIONAL (KUNSHAN) INC.


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 16 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01





3.4.4 Test Setup

<Conducted Band Edge >

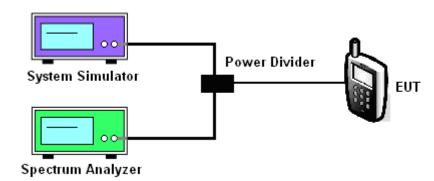


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 17 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.4.5 Test Result (Plots) of Conducted Band Edge


| Band : | CDMA2000 BC0 | Power Stage : | High |
|-------------|----------------|---------------|------|
| Test Mode : | 1xRTT_RC3+SO32 | | |

Lower Band Edge Plot on Channel 1013

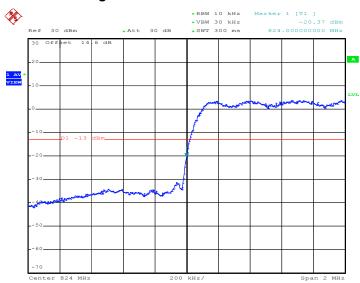

TH-01
Date: 18.MAR.2011 10:33:12

Higher Band Edge Plot on Channel 777

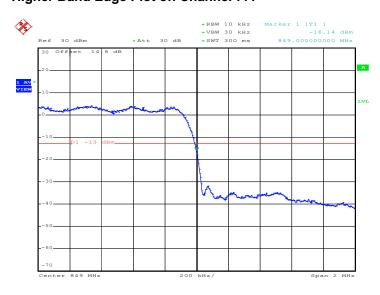

TH-01
Date: 18.MAR.2011 10:29:42

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 18 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01

3.5 Conducted Emission Measurement

3.5.1 Description of Conducted Emission Measurement

The power of any emission outside of the authorized operating frequency ranges must be lower than the transmitter power (P) by a factor of at least 43 + 10 log (P) dB.

It is measured by means of a calibrated spectrum analyzer and scanned from 30 MHz up to a frequency including its 10th harmonic.

3.5.2 Measuring Instruments

See list of measuring instruments of this test report.

3.5.3 Test Procedures

- 1. The EUT was connected to spectrum analyzer and base station via power divider.
- 2. The middle channel for the highest RF power within the transmitting frequency was measured.
- 3. The conducted spurious emission for the whole frequency range was taken.


SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 19 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



Report No.: FG131537

3.5.4 Test Setup

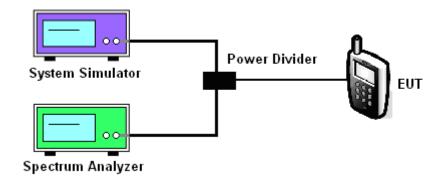


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 20 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.5.5 Test Result (Plots) of Conducted Emission


| Band : | CDMA2000 BC0 | Power Stage : | |
|-------------|----------------|---------------|--|
| Test Mode : | 1xRTT_RC3+SO32 | | |

Conducted Emission Plot between 30MHz ~ 1GHz

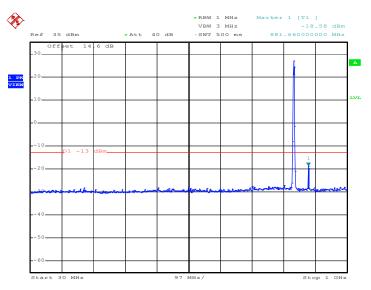

TH-01 Date: 18.MAR.2011 11:34:37


Conducted Emission Plot between 1GHz ~ 3GHz

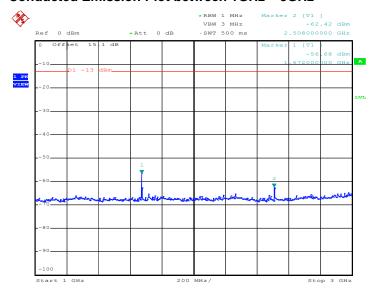


TH-01 Date: 18.MAR.2011 11:38:30

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 21 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01








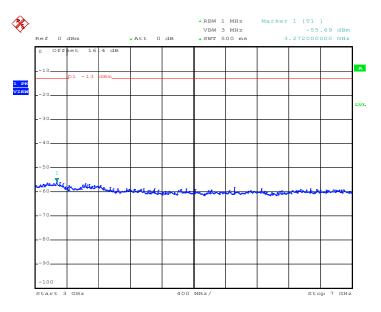

TH-01

Date: 18.MAR.2011 11:40:05

Conducted Emission Plot between 7GHz ~ 9GHz

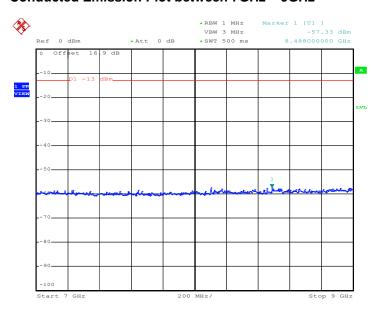

TH-01

Date: 18.MAR.2011 11:41:13

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 22 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01

3.6 Field Strength of Spurious Radiation Measurement

3.6.1 Description of Field Strength of Spurious Radiated Measurement

The radiated spurious emission was measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitter power (P) by a factor of at least 43 + 10 log (P) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

3.6.2 Measuring Instruments

See list of measuring instruments of this test report.

Test Procedures 3.6.3

- 1. The EUT was placed on a rotatable wooden table with 0.8 meter about ground.
- 2. The EUT was set 3 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest spurious emission.
- 4. The height of the receiving antenna is varied between one meter and four meters to search the maximum spurious emission for both horizontal and vertical polarizations.
- 5. Taking the record of maximum spurious emission.
- 6. A horn antenna was substituted in place of the EUT and was driven by a signal generator.
- 7. Tune the output power of signal generator to the same emission level with EUT maximum spurious emission.
- 8. Taking the record of output power at antenna port.
- Repeat step 7 to step 8 for another polarization.
- 10. EIRP (dBm) = S.G. Power Tx Cable Loss + Tx Antenna Gain
- 11. ERP (dBm) = EIRP 2.15

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV

Page Number : 23 of 31 Report Issued Date: May 12, 2011


Report No.: FG131537

Report Version : Rev. 01



Report No. : FG131537

3.6.4 Test Setup

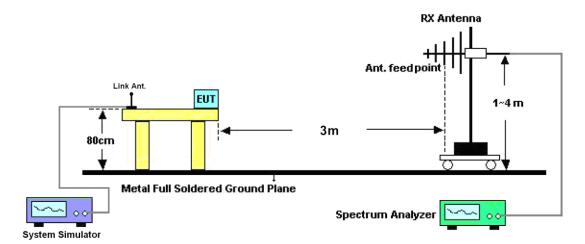


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 24 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.6.5 Test Result of Field Strength of Spurious Radiated

| Band : | CDMA2000 BC0 | Temperature : | 19~20°C | | |
|-----------------|---|---------------------|------------|--|--|
| Test Mode : | 1xRTT_RC3+SO32 | Relative Humidity : | 41~42% | | |
| Test Engineer : | Okey Yuan | Polarization : | Horizontal | | |
| Damark . | Spurious emissions within 20 1000MHz were found more than 20dD below limit line | | | | |

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

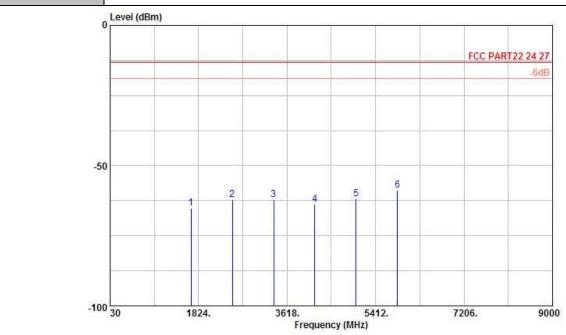

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 HORIZONTAL


| ı | Frequency | ERP | Limit | Over | SPA | S.G. | TX Cable | TX Antenna | Polarization | Result |
|---|-----------|--------|-------|--------|---------|--------|----------|------------|--------------|--------|
| ı | | | | Limit | Reading | Power | loss | Gain | | |
| | (MHz) | (dBm) | (dBm) | (dB) | (dBm) | (dBm) | (dB) | (dBi) | (H/V) | |
| | 1674 | -65.13 | -13 | -52.13 | -60.91 | -65.78 | 0.57 | 3.37 | Н | Pass |
| | 2509 | -62.16 | -13 | -49.16 | -64.41 | -64.39 | 0.78 | 5.16 | Н | Pass |
| | 3345 | -62.21 | -13 | -49.21 | -64.15 | -65.85 | 0.87 | 6.66 | Н | Pass |
| | 4182 | -63.70 | -13 | -50.70 | -65.64 | -68.29 | 0.97 | 7.71 | Н | Pass |
| | 5018 | -61.94 | -13 | -48.94 | -68.14 | -67.61 | 1.09 | 8.91 | Н | Pass |
| | 5854 | -58.77 | -13 | -45.77 | -66.84 | -65.21 | 1.22 | 9.81 | Н | Pass |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 25 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



FCC RF Test Report

| Band : | CDMA2000 BC0 | Temperature : | 19~20°C | | | |
|-----------------|--|---------------------|----------|--|--|--|
| Test Mode : | 1xRTT_RC3+SO32 | Relative Humidity : | 41~42% | | | |
| Test Engineer : | Okey Yuan | Polarization : | Vertical | | | |
| Remark : | Spurious emissions within 30-1000MHz were found more than 20dB below limit line. | | | | | |

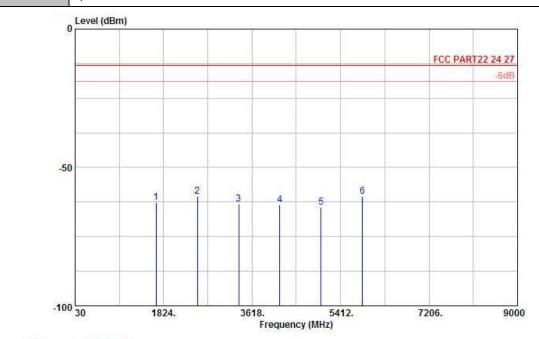

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 VERTICAL

| Frequency | ERP | Limit | Over Limit | SPA Reading | S.G. Power | TX Cable loss | TX Antenna Gain | Polarization | Result |
|-----------|--------|-------|---------------|----------------|---------------|---------------|--------------------|--------------|--------|
| (MHz) | (dBm) | (dBm) | (dB) | (dBm) | (dBm) | (dB) | (dBi) | (H/V) | |
| 1672 | -62.78 | -13 | -49.78 | -58.43 | -63.43 | 0.57 | 3.37 | V | Pass |
| 2509 | -60.32 | -13 | -47.32 | -63.43 | -62.55 | 0.78 | 5.16 | V | Pass |
| 3345 | -63.14 | -13 | -50.14 | -65.12 | -66.78 | 0.87 | 6.66 | V | Pass |
| 4182 | -63.51 | -13 | -50.51 | -65.49 | -68.10 | 0.97 | 7.71 | V | Pass |
| 5018 | -64.48 | -13 | -51.48 | -69.42 | -70.15 | 1.09 | 8.91 | V | Pass |
| 5854 | -60.48 | -13 | -47.48 | -68.47 | -66.92 | 1.22 | 9.81 | V | Pass |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 26 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



3.7 Frequency Stability Measurement

3.7.1 Description of Frequency Stability Measurement

The frequency stability shall be measured by variation of ambient temperature and variation of primary supply voltage to ensure that the fundamental emission stays within the authorized frequency block. The frequency stability of the transmitter shall be maintained within ±0.00025% (±2.5ppm) of

the center frequency.

3.7.2 Measuring Instruments

See list of measuring instruments of this test report.

3.7.3 Test Procedures for Temperature Variation

1. The EUT was set up in the thermal chamber and connected with the base station.

2. With power OFF, the temperature was decreased to -30°C and the EUT was stabilized for three hours. Power was applied and the maximum change in frequency was recorded within one

minute.

3. With power OFF, the temperature was raised in 10°C step up to 50°C. The EUT was stabilized at each step for at least half an hour. Power was applied and the maximum frequency change

was recorded within one minute.

4. If the EUT can not be turned on at -30°C, the testing lowest temperature will be raised in 10°C

step until the EUT can be turned on.

3.7.4 Test Procedures for Voltage Variation

1. The EUT was placed in a temperature chamber at 25±5° C and connected with the base

station.

2. The power supply voltage to the EUT was varied from BEP to 115% of the nominal value

measured at the input to the EUT.

3. The variation in frequency was measured for the worst case.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 27 of 31
Report Issued Date : May 12, 2011

Report No.: FG131537

Report Version : Rev. 01



Report No.: FG131537

3.7.5 Test Setup



TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 28 of 31 Report Issued Date : May 12, 2011 Report Version : Rev. 01



3.7.6 Test Result of Temperature Variation

| Band : | CDMA2000 BC0 | Channel: | 384 |
|-------------|----------------|--------------|-----|
| Test Mode : | 1xRTT_RC3+SO32 | Limit (ppm): | 2.5 |

| Temperature (°C) | Freq. Dev. (Hz) | Deviation (ppm) | Result |
|------------------|--------------------|--------------------|--------|
| -30 | N/A | N/A | |
| -20 | N/A | N/A | |
| -10 | -8 | -0.01 | |
| 0 | -9 | -0.01 | |
| 10 | -6 | -0.01 | PASS |
| 20 | -7 | -0.01 | |
| 30 | -12 | -0.01 | |
| 40 | -6 | -0.01 | |
| 50 | 6 | 0.01 | |

Note:

- 1. The EUT stops transmitting at temperatures -20°C, -30°C.
- 2. The manufacturer declared that the EUT could work properly between temperatures -10°C~50°C.

3.7.7 Test Result of Voltage Variation

| Band & Channel | Mode | Voltage (Volt) | Freq. Dev. (Hz) | Deviation (ppm) | Limit (ppm) | Result |
|-----------------------|-------------------|-------------------|-----------------------|--------------------|----------------|--------|
| CDMA2000 BC0 CH384 | 1xRTT RC3+SO32 | 3.8 | 6 | 0.01 | | |
| | | BEP | 7 | 0.01 | 2.5 | PASS |
| 011304 | | 4.2 | -5 | -0.01 | | |

Note:

- 1. Normal Voltage = 3.8V.
- 2. Battery End Point (BEP) = 3.4 V.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV

Page Number : 29 of 31 Report Issued Date: May 12, 2011 Report Version : Rev. 01



4 List of Measuring Equipments

| Instrument | Manufacturer | Model No. | Serial No. | Characteristics | Calibration Date | Due Date | Remark |
|------------------------------|--------------|-----------|------------|------------------|---------------------|---------------|--------------------------|
| Spectrum Analyzer | R&S | FSP40 | 100319 | 9kHz~40GHz | Jan. 07, 2010 | Jan. 06, 2012 | Conducted (TH01-KS) |
| Power Meter | Aglient | E4416A | MY45101555 | N/A | Aug. 24, 2010 | Aug. 23, 2011 | Conducted (TH01-KS) |
| Power Sensor | Aglient | E9327A | MY44421198 | N/A | Aug. 24, 2010 | Aug. 23, 2011 | Conducted (TH01-KS) |
| Thermal Chamber | Ten Billion | TTC-B3S | TBN-960502 | N/A | Dec. 28, 2010 | Dec. 27, 2011 | Conducted (TH01-KS) |
| DC Power Supply | TOPWARD | 3306D | N/A | N/A | N/A | N/A | Conducted (TH01-KS) |
| EMI Test Receiver | R&S | ESCI | 100534 | 9kHz~3GHz | Nov. 16, 2010 | Nov. 15, 2011 | Radiation (03CH01-KS) |
| Spectrum Analyzer | R&S | FSP40 | 100319 | 9kHz~40GHz | Jan. 07, 2010 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Bilog Antenna | SCHAFFNER | CBL6112D | 23182 | 25MHz~2GHz | Dec. 07, 2010 | Dec. 06, 2011 | Radiation (03CH01-KS) |
| Double Ridge Horn Antenna | EMCO | 3117 | 00075959 | 1MHz~18GHz | Jan. 07, 2010 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Amplifier | Wireless | FPA-6592G | 060004 | 30MHz~2GHz | Dec. 09, 2010 | Dec. 08, 2011 | Radiation (03CH01-KS) |
| Amplifier | Agilent | 8449B | 3008A02370 | 1GHz~26.5GH z | Jan. 07, 2010 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Actice hore antenna | com-power | AHA-118 | 701023 | 1G-18GHz | Nov. 09, 2010 | Nov. 08, 2011 | Radiation (03CH01-KS) |
| Signal Generator | R&S | SMR40 | 100455 | 10G-40GHz | Jan. 06, 2010 | Jan. 05, 2012 | Radiation (03CH01-KS) |
| SHE-EHF Horn | Schwarzbeck | BBHA9170 | BBHA170249 | 15-40GHz | Oct. 15,2010 | Oct. 14,2011 | Radiation (03CH01-KS) |
| Loop Antenna | R&S | HFH2-Z2 | 860004/00 | 9G-30GHz | Jul. 29, 2010 | Jul. 28, 2011 | Radiation (03CH01-KS) |
| Bluetooth Base Station | R&S | CBT | 100783 | N/A | Aug. 17, 2010 | Aug. 16, 2011 | Radiation (03CH01-KS) |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 30 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01



5 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

| | Uncerta | inty of X _i | | |
|---|---------------|-----------------------------|--------------------|--|
| Contribution | dB | Probability Distribution | u(X _i) | |
| Receiver Reading | 0.41 | Normal (k=2) | 0.21 | |
| Antenna Factor Calibration | 0.83 | Normal (k=2) | 0.42 | |
| Cable Loss Calibration | 0.25 | Normal (k=2) | 0.13 | |
| Pre-Amplifier Gain Calibration | 0.27 | Normal (k=2) | 0.14 | |
| RCV/SPA Specification | 2.50 | Rectangular | 0.72 | |
| Antenna Factor Interpolation for Frequency | 1.00 | Rectangular | 0.29 | |
| Site Imperfection | 1.43 | Rectangular | 0.83 | |
| Mismatch | +0.39 / -0.41 | U-Shape | 0.28 | |
| Combined Standard Uncertainty Uc(y) | 1.27 | | | |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) | 2.54 | | | |

Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)

| | Uncertai | | | | |
|--|---------------|-----------------------------|--------------------|----------------|-------------------------------------|
| Contribution | dB | Probability Distribution | u(X _i) | C _i | C _i * u(X _i) |
| Receiver Reading | ±0.10 | Normal (k=2) | 0.10 | 1 | 0.10 |
| Antenna Factor Calibration | ±1.70 | Normal (k=2) | 0.85 | 1 | 0.85 |
| Cable Loss Calibration | ±0.50 | Normal (k=2) | 0.25 | 1 | 0.25 |
| Receiver Correction | ±2.00 | Rectangular | 1.15 | 1 | 1.15 |
| Antenna Factor Directional | ±1.50 | Rectangular | 0.87 | 1 | 0.87 |
| Site Imperfection | ±2.80 | Triangular | 1.14 | 1 | 1.14 |
| Mismatch Receiver VSWR Γ 1 = 0.197 Antenna VSWR Γ 2 = 0.194 Uncertainty = 20Log(1- Γ 1* Γ 2) | +0.34 / -0.35 | U-Shape | 0.244 | 1 | 0.244 |
| Combined Standard Uncertainty Uc(y) | 2.36 | | | | |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) | 4.72 | | | | |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : 31 of 31
Report Issued Date : May 12, 2011
Report Version : Rev. 01

Appendix A. Photographs of EUT

Please refer to Sporton report number EP131537 as below.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: U46-CM370MV Page Number : A1 of A1
Report Issued Date : May 12, 2011
Report Version : Rev. 01