FCC RF Test Report

APPLICANT : Texas Instruments Incorporated

EQUIPMENT: WiFi and Bluetooth Module

BRAND NAME : Texas Instruments

MODEL NAME : WL18MODGI

FCC ID : Z64-WL18DBMOD

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Oct. 09, 2014 and testing was completed on Dec. 10, 2014. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 1 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

TABLE OF CONTENTS

RE	VISIOI	N HISTORY	3	
SU	MMAR	RY OF TEST RESULT	4	
1	GENERAL DESCRIPTION			
	1.1	Applicant	5	
	1.2	Manufacturer	5	
	1.3	Product Feature of Equipment Under Test	5	
	1.4	Product Specification subjective to this standard	6	
	1.5	Modification of EUT	6	
	1.6	Testing Location	6	
	1.7	Applicable Standards	8	
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	9	
	2.1	Descriptions of Test Mode	9	
	2.2	Test Mode	10	
	2.3	Connection Diagram of Test System	11	
	2.4	Support Unit used in test configuration and system	12	
	2.5	EUT Operation Test Setup	12	
	2.6	Measurement Results Explanation Example	12	
3	TEST	RESULT	13	
	3.1	Number of Channel Measurement	13	
	3.2	Hopping Channel Separation Measurement	15	
	3.3	Dwell Time Measurement	22	
	3.4	20dB and 99% Bandwidth Measurement	25	
	3.5	Peak Output Power Measurement	38	
	3.6	Conducted Band Edges Measurement	40	
	3.7	Conducted Spurious Emission Measurement		
	3.8	Band Edges and Spurious Emission in the Restricted Band		
	3.9	AC Conducted Emission Measurement		
	3.10	Antenna Requirements	69	
4	LIST	OF MEASURING EQUIPMENT	70	
5	UNCI	ERTAINTY OF EVALUATION	71	
AP	PEND	IX A. TEST RESULT OF RADIATED TEST RESULTS		
AP	PEND	IX B. SETUP PHOTOGRAPHS		

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 2 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR4O0971A	Rev. 01	Initial issue of report	Dec. 19, 2014

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 3 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

Report No.: FR4O0971A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	IC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	RSS-210 A8.4(2)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	RSS-210 A8.1(b)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	RSS-210 A8.1(d)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	RSS-210 A8.1(a)	20dB Bandwidth	NA	Pass	-
3.4	-	RSS-Gen 4.6.1	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	RSS-210 A8.1(b)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	RSS-210 A8.5	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	RSS-210 A8.5	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	RSS-210 A8.5	Band Edges and Spurious Emission in the Restricted Band	15.209(a) & 15.247(d)	Pass	Under limit 13.41 dB at 897.100 MHz
3.9	15.207	RSS-Gen 7.2.4	AC Conducted Emission	15.207(a)	Pass	Under limit 15.10 dB at 0.150 MHz
3.10	15.203 & 15.247(b)	RSS-210 A8.4	Antenna Requirement	N/A	Pass	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 4 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

1 General Description

1.1 Applicant

Texas Instruments Incorporated

12500 TI Boulevard, M/S 8751, Dallas, TX 75243, USA

1.2 Manufacturer

Jorjin Technologies Inc

17F, No. 239, Sec. 1, Datong Rd., Xizhi Dist., New Taipei City 221, Taiwan

1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment	WiFi and Bluetooth Module				
Brand Name	Texas Instruments				
Model Name	WL18MODGI				
FCC ID	Z64-WL18DBMOD				
EUT supports Radios application	WLAN 11a/b/g/n HT20/HT40				
EOT Supports Radios application	Bluetooth v4.0 EDR/LE				
HW Version	WG7837-T0B				
EUT Stage	Identical Prototype				

Remark: The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 5 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

1.4 Product Specification subjective to this standard

Product Specification subjective to this standard				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 11.64 dBm (0.0146 W) Bluetooth EDR (2Mbps) : 9.37 dBm (0.0086 W) Bluetooth EDR (3Mbps) : 9.71 dBm (0.0094 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps) : 0.808MHz Bluetooth EDR (2Mbps) : 1.172MHz Bluetooth EDR (3Mbps) : 1.160MHz			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) : π /4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

Antenna Information					
Antenna Type Brand 2.4GHz~2.5GHz 4.9GHz~5.8GH					
PCB	Ethertronics	-0.6	4.5		
Dipole	LSR	2	2		
PCB	Laird	2	4		
Chip	Pulse	3.2	4.2		
PIFA	LSR	2	3		
Chip	TDK	2.4	3.96		

1.5 Modification of EUT

No modifications are made to the EUT during all test items.

1.6 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1022 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.				
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,				
Took Cita Lagation	Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.				
Test Site Location	TEL: +886-3-327-3456				
	FAX: +886-3-328-4978				
Took Site No		Sporton Site No.			
Test Site No.	TH02-HY	CO05-HY	03CH07-HY		

Note: The test site complies with ANSI C63.4 2009 requirement.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 6 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 7 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

Report No.: FR4O0971A

1.7 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- FCC Public Notice DA 00-705
- ANSI C63.10-2009

Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD

TEL: 886-3-327-3456

Page Number : 8 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

Report No.: FR4O0971A

2 Test Configuration of Equipment Under Test

2.1 Descriptions of Test Mode

Preliminary tests were performed in different data rates and recorded the RF output power in the following table:

		В	luetooth RF Output Powe	er
Channel	Eroguenev		Data Rate / Modulation	
Chamilei	Frequency	GFSK	π/4-DQPSK	8-DPSK
		1Mbps	2Mbps	3Mbps
Ch00	2402MHz	<mark>11.64</mark> dBm	9.37 dBm	9.71 dBm
Ch39	2441MHz	11.26 dBm	9.15 dBm	9.53 dBm
Ch78	2480MHz	11.16 dBm	8.83 dBm	9.23 dBm

Remark:

- 1. All the test data for each data rate were verified, but only the worst case was reported.
- 2. The data rate was set in 1Mbps for all the test items due to the highest RF output power.
- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction (150 kHz to 30 MHz), radiation (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower).
- b. AC power line Conducted Emission was tested under maximum output power.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD

TEL: 886-3-327-3456

Page Number : 9 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

2.2 Test Mode

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Summary table of Test Cases					
	Data Rate / Modulation				
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps		
	GFSK	π /4-DQPSK	8-DPSK		
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz		
Test Cases	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz		
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz		
Bluetooth BR 1Mbps GFSK					
Radiated	Mode 1: CH00_2402 MHz				
Test Cases	Mode 2: CH39_2441 MHz				
	Mode 3: CH78_2480 MHz				
AC					
Conducted	Mode 1 :WLAN (2.4GHz) Link + Bluetooth Link + Adapter				
Emission					
Remark: For radiated test cases, the worst mode data rate 1Mbps was reported only, because			ported only, because this		
data rate has the highest RF output power at preliminary tests, and the conducted spurious					
emissions and conducted band edge measurement for each data rate are no worse than					

1Mbps, and no other significantly frequencies found in conducted spurious emission.


SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 10 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

2.3 Connection Diagram of Test System

<Bluetooth Tx Mode>

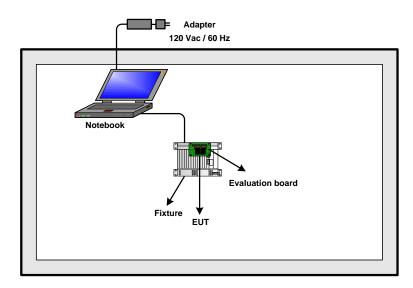

<AC Conducted Emission Mode>

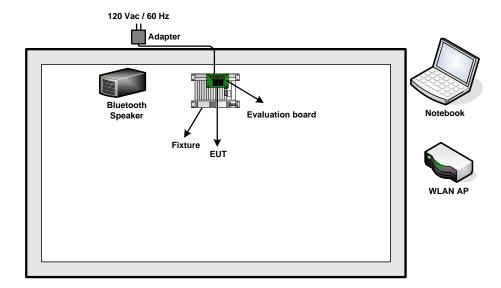

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 11 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	WLAN AP	D-Link	DIR-628	KA2DIR628A2	N/A	Unshielded, 1.8 m
2.	Notebook	DELL	Latitude E6320	FCC DoC/ Contains FCC ID: QDS-BRCM1054	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
3.	Notebook	Lenovo	M490S	FCC DoC	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
4.	Bluetooth Speaker	МІ	MDZ-03-AC	N/A	N/A	N/A
5.	Fixture	N/A	N/A	N/A	N/A	N/A
6.	Evaluation board	N/A	WG1300BE00	N/A	N/A	N/A

2.5 EUT Operation Test Setup

For Bluetooth function, programmed RF utility, "HCI Tester" installed in the notebook make the EUT provide functions like channel selection and power level for continuous transmitting and receiving signals.

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

 $Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$ = 4.2 + 10 = 14.2 (dB)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 12 of 71
Report Issued Date : Dec. 19, 2014

Report No.: FR4O0971A

Report Version : Rev. 01

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW ≥ 1% of the span; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup



3.1.5 Test Result of Number of Hopping Frequency

Test Mode :	1Mbps	Temperature :	24~26℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 13 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A



Number of Hopping Channel Plot on Channel 00 - 78

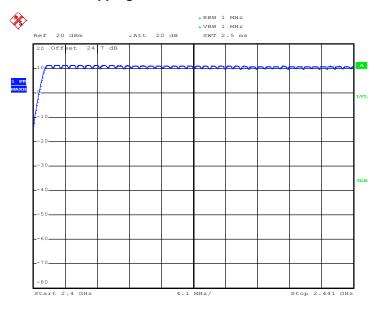

Date: 28.NOV.2014 14:26:43

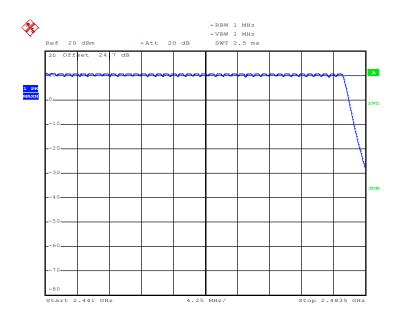

Date: 28.NOV.2014 14:27:52

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 14 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 Span = wide enough to capture the peaks of two adjacent channels; RBW ≥ 1% of the span;
 VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 15 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

3.2.5 Test Result of Hopping Channel Separation

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.5093	Pass
39	2441	0.996	0.5093	Pass
78	2480	1.002	0.5307	Pass

Channel Separation Plot on Channel 00 - 01

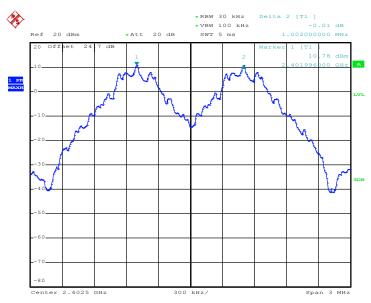


Date: 28.NOV.2014 11:53:15

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 16 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

Channel Separation Plot on Channel 39 - 40

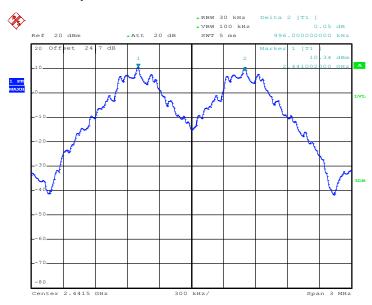

Date: 28.NOV.2014 11:54:10

Channel Separation Plot on Channel 77 - 78

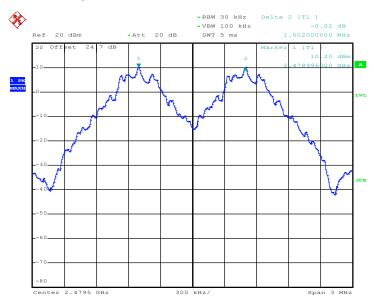

Date: 28.NOV.2014 11:56:22

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 17 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report Template No.: BU5-FR15CBT Version 1.0

Report No.: FR4O0971A

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	0.996	0.8320	Pass
39	2441	1.008	0.8320	Pass
78	2480	1.002	0.8360	Pass

Channel Separation Plot on Channel 00 - 01

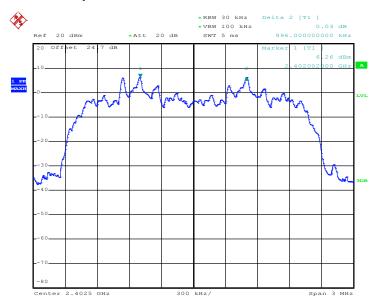


Date: 28.NOV.2014 11:57:07

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 18 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

Channel Separation Plot on Channel 39 - 40

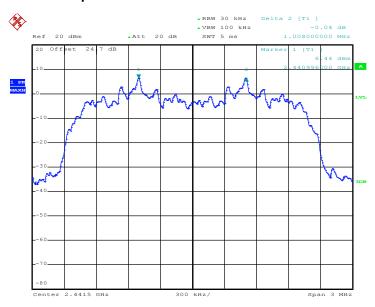

Date: 28.NOV.2014 11:58:28

Channel Separation Plot on Channel 77 - 78

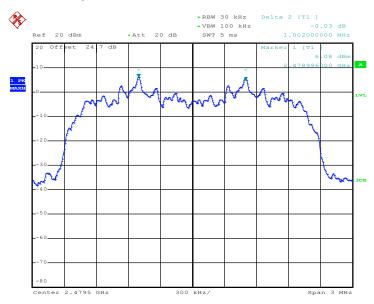

Date: 28.NOV.2014 12:00:11

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 19 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8160	Pass
39	2441	1.008	0.8120	Pass
78	2480	1.002	0.8160	Pass

Channel Separation Plot on Channel 00 - 01

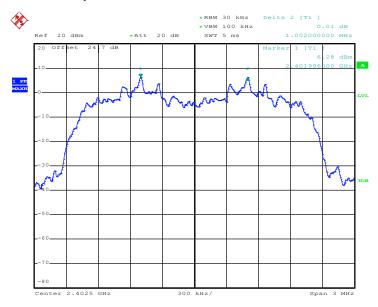


Date: 28.NOV.2014 12:01:13

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 20 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

Channel Separation Plot on Channel 39 - 40

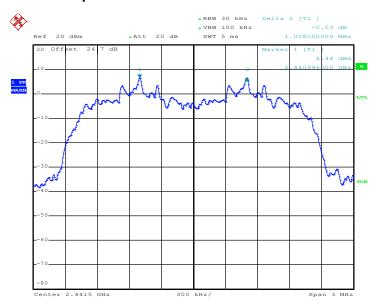

Date: 28.NOV.2014 12:02:08

Channel Separation Plot on Channel 77 - 78

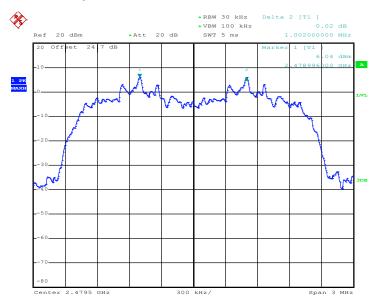

Date: 28.NOV.2014 12:03:00

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 21 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 22 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.3.5 Test Result of Dwell Time

Test Mode :	DH5	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Mode	Channel	Hops Over Occupancy Time(hops)	IIMA	Dwell Time (sec)	Limits (sec)	Pass/Fail
Normal	79	106.67	2.92	0.31	0.4	Pass
AFH	20	53.33	2.92	0.16	0.4	Pass

Remark:


- In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels.
 With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4 x 79) (s),
 Hops Over Occupancy Time comes to (1600 / 6 / 79) x (0.4 x 79) = 106.67 hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4×20) (s), Hops Over Occupancy Time comes to $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$ hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 23 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Package Transfer Time Plot

Report No.: FR4O0971A

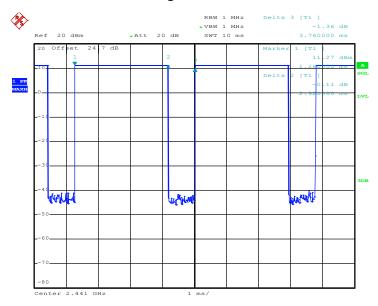

Date: 27.NOV.2014 23:34:41

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 24 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 Span = approximately 2 to 3 times the 20 dB bandwidth, centered on a hopping channel;
 RBW ≥ 1% of the 20 dB bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;

RBW ≥ 1% of the 20 dB bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak

Trace = \max hold.

- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 For 99% Bandwidth measurement, the RBW=30kHz, and VBW = 100kHz. Sweep = auto;
 Detector function = sample. Trace = max hold.
- 6. Measure and record the results in the test report.

3.4.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 25 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

3.4.5 Test Result of 20dB Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	0.764
39	2441	0.764
78	2480	0.796

20 dB Bandwidth Plot on Channel 00

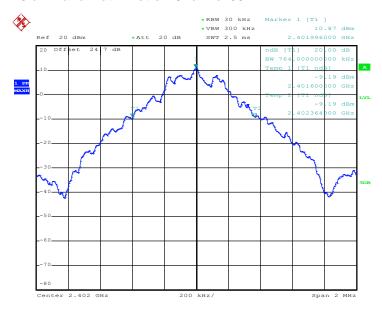


Date: 28.NOV.2014 12:03:19

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 26 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

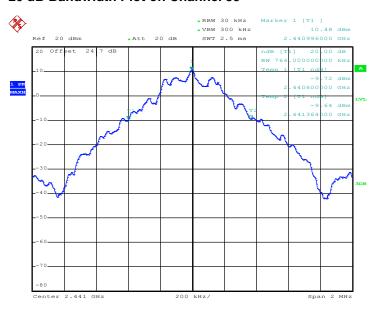

Date: 28.NOV.2014 12:03:41

20 dB Bandwidth Plot on Channel 78

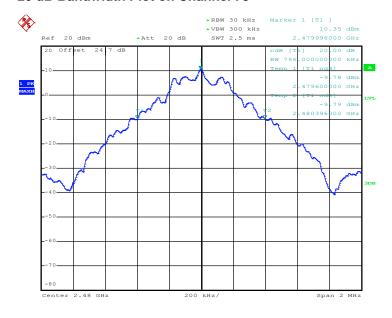

Date: 28.NOV.2014 13:30:55


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 27 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Test Mode :	2Mbps	Temperature :	24~26℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.248
39	2441	1.248
78	2480	1.254

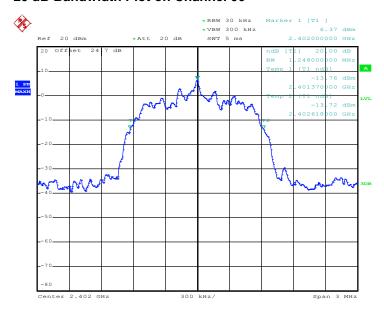

Date: 28.NOV.2014 13:31:12


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 28 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

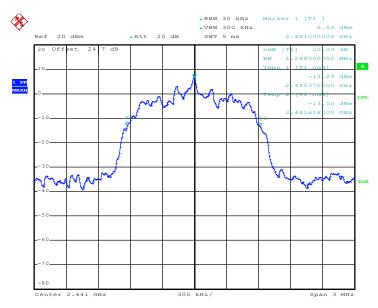

Date: 28.NOV.2014 13:31:30

20 dB Bandwidth Plot on Channel 78

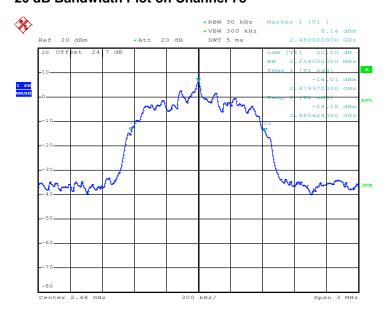

Date: 28.NOV.2014 13:31:50


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 29 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.224
39	2441	1.218
78	2480	1.224

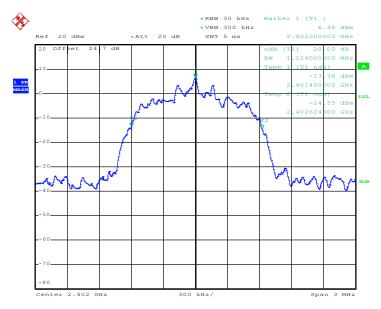

Date: 28.NOV.2014 13:32:21


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 30 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

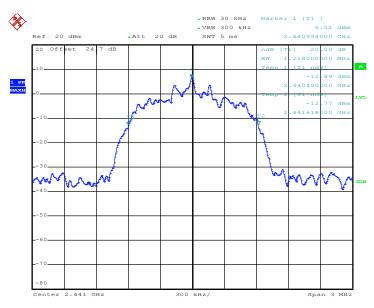

Date: 28.NOV.2014 13:32:42

20 dB Bandwidth Plot on Channel 78

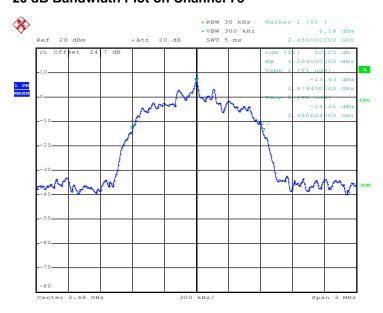

Date: 28.NOV.2014 13:33:01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 31 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

3.4.6 Test Result of 99% Occupied Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	0.792
39	2441	0.808
78	2480	0.808

99% Occupied Bandwidth Plot on Channel 00

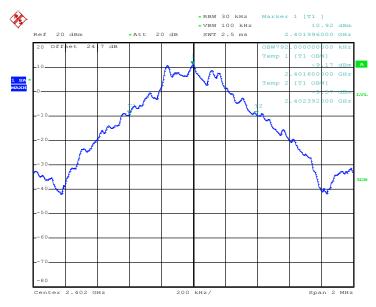


Date: 28.NOV.2014 13:33:55

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 32 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

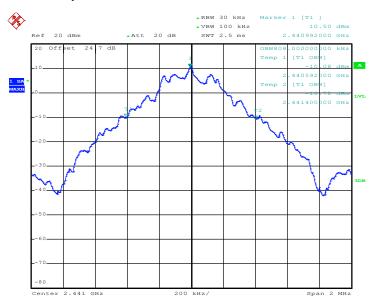

Date: 28.NOV.2014 13:34:31

99% Occupied Bandwidth Plot on Channel 78

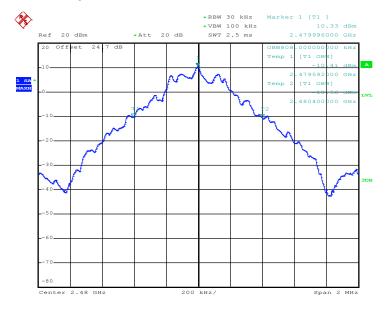

Date: 28.NOV.2014 13:37:53


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 33 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%


Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.172
39	2441	1.172
78	2480	1.164

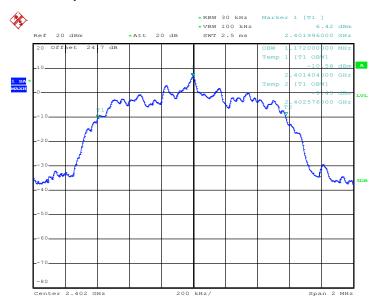

Date: 28.NOV.2014 13:39:26


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 34 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

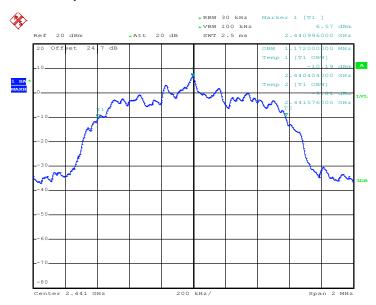

Date: 28.NOV.2014 13:40:11

99% Occupied Bandwidth Plot on Channel 78

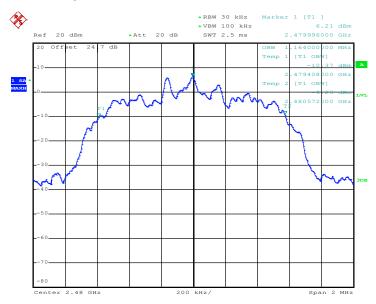

Date: 28.NOV.2014 13:38:37


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 35 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.156
39	2441	1.156
78	2480	1.160

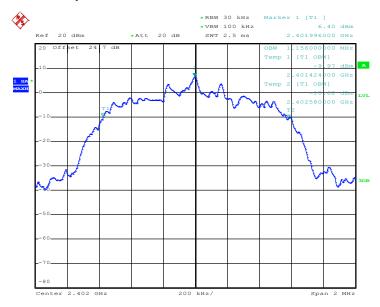


Date: 28.NOV.2014 13:41:23

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 36 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

99% Occupied Bandwidth Plot on Channel 39

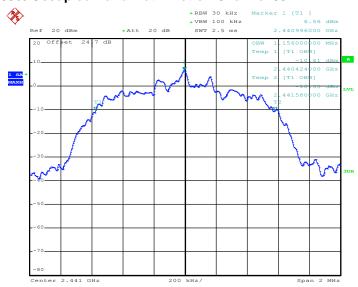

Date: 28.NOV.2014 13:40:46

99% Occupied Bandwidth Plot on Channel 78

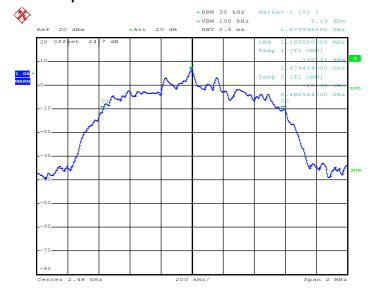

Date: 28.NOV.2014 13:42:00

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 37 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps is 1watt, and for 2Mbps, 3Mbps and AFH are 0.125 watts.


3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 38 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.5.5 Test Result of Peak Output Power

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

	F	RF Power (dBm)		
Channel	Frequency	GFSK	Max. Limits	Pass/Fail
	(MHz)	1 Mbps	(dBm)	Pass/Faii
00	2402	11.64	20.97	Pass
39	2441	11.26	20.97	Pass
78	2480	11.16	20.97	Pass

Note: For AFH mode using 20 hopping channels, the maximum output power limit is 20.97dBm.

Test Mode :	2Mbps	Temperature :	24~26℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

	Eroguenev	R	F Power (dBm)	
Channel	Frequency	π/4-DQPSK	Max. Limits	Page/Fail
	(MHz)	2 Mbps	(dBm)	Pass/Fail
00	2402	9.37	20.97	Pass
39	2441	9.15	20.97	Pass
78	2480	8.83	20.97	Pass

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

	Fraguanay	RF Power (dBm)		
Channel	Frequency	8-DPSK	8-DPSK Max. Limits	
	(MHz)	3 Mbps	(dBm)	Pass/Fail
00	2402	9.71	20.97	Pass
39	2441	9.53	20.97	Pass
78	2480	9.23	20.97	Pass

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 39 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- The testing follows the guidelines in Band-edge Compliance of RF Conducted Emissions of FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz (≥ 1% span=10MHz), VBW = 300kHz (≥ RBW). Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup

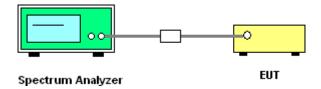


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 40 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.6.5 Test Result of Conducted Band Edges


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

Low Band Edge Plot on Channel 00

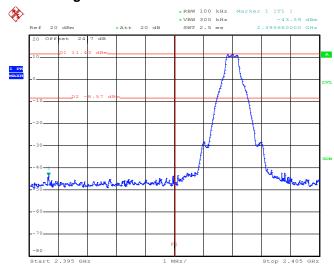

Date: 28.NOV.2014 13:43:19

High Band Edge Plot on Channel 78

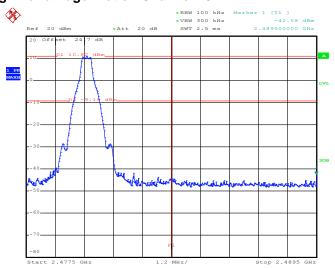

Date: 28.NOV.2014 13:47:22

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 41 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A




Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

Low Band Edge Plot on Channel 00

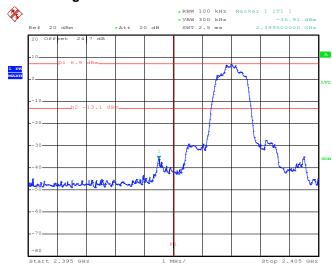

Date: 28.NOV.2014 13:54:25

High Band Edge Plot on Channel 78

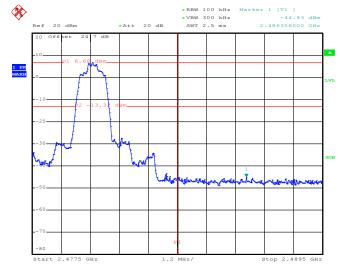


Date: 28.NOV.2014 13:50:27

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 42 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

Low Band Edge Plot on Channel 00

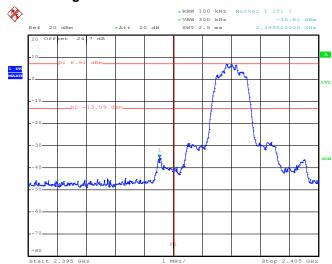

Date: 28.NOV.2014 13:57:29

High Band Edge Plot on Channel 78

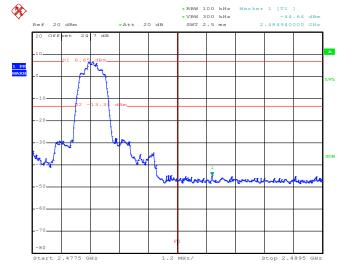

Date: 28.NOV.2014 14:11:43

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 43 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.6.6 Test Result of Conducted Hopping Mode Band Edges


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

1Mbps Hopping Mode Low Band Edge Plot

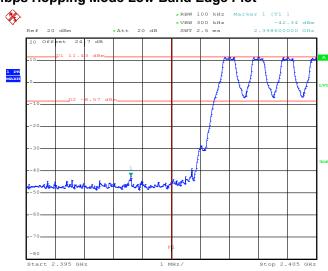

Date: 28.NOV.2014 13:42:39

1Mbps Hopping Mode High Band Edge Plot

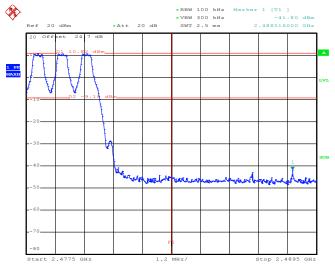

Date: 28.NOV.2014 13:47:01


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 44 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

2Mbps Hopping Mode Low Band Edge Plot

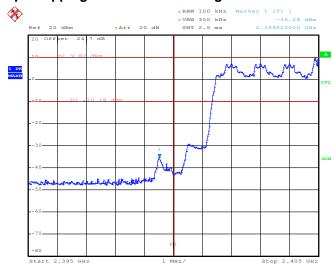

Date: 28.NOV.2014 13:54:07

2Mbps Hopping Mode High Band Edge Plot

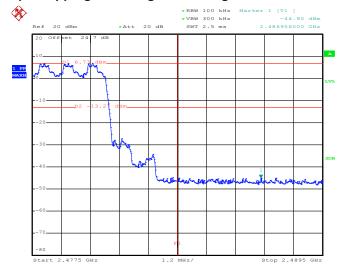

Date: 28.NOV.2014 13:50:09


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 45 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Kenny Chen	Relative Humidity :	48~51%

3Mbps Hopping Mode Low Band Edge Plot

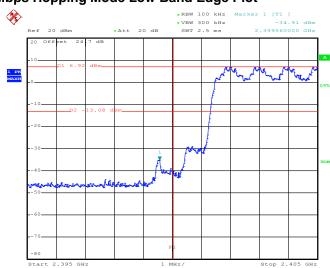

Date: 28.NOV.2014 13:57:07

3Mbps Hopping Mode High Band Edge Plot

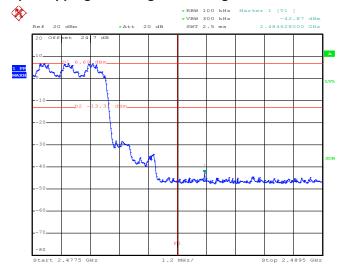

Date: 28.NOV.2014 14:11:26

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 46 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- The testing follows the guidelines in Spurious RF Conducted Emissions of FCC Public Notice DA 00-705 Measurement Guidelines
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 47 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.7.5 Test Result of Conducted Spurious Emission


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	00	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

1Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

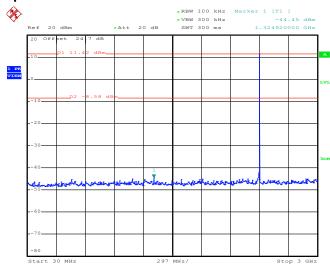

Date: 28.NOV.2014 13:59:58

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

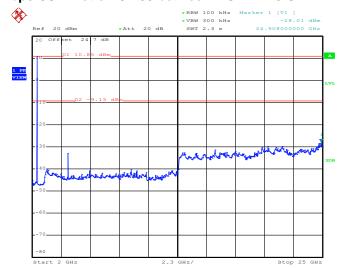

Date: 28.NOV.2014 14:00:19

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 48 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

SPORTON LAB.	FCC RF Test Report


Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

1Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

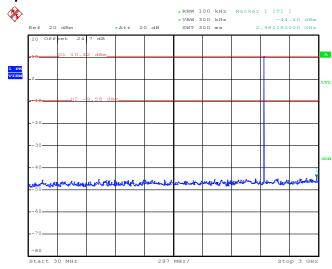

Date: 28.NOV.2014 14:02:11

1Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

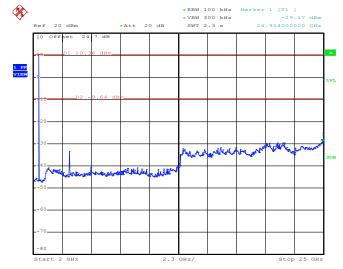

Date: 28.NOV.2014 14:02:33

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 49 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A




Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

1Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

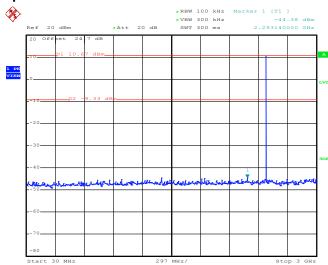

Date: 28.NOV.2014 14:03:01

1Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

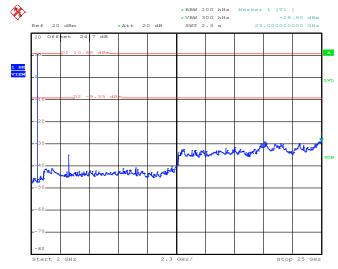

Date: 28.NOV.2014 14:03:23


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 50 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Channel :	00	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

2Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

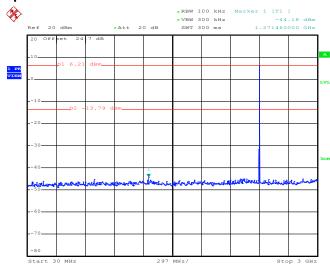

Date: 28.NOV.2014 14:08:03

2Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

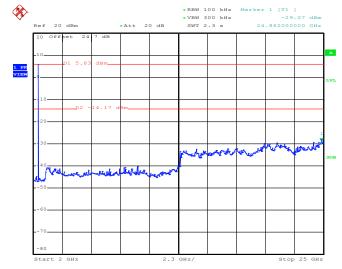

Date: 28.NOV.2014 14:08:25


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 51 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

2Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

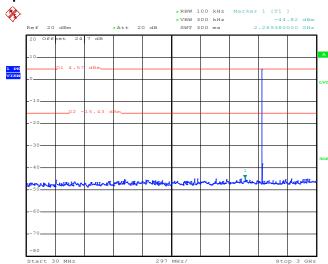

Date: 28.NOV.2014 14:06:41

2Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

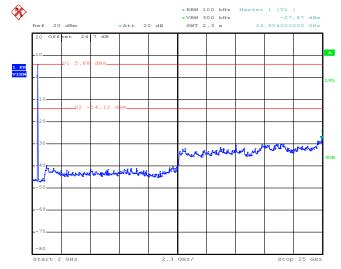

Date: 28.NOV.2014 14:07:03

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 52 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A




Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

2Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

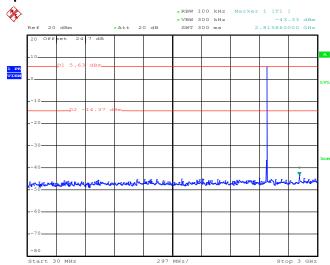

Date: 28.NOV.2014 14:05:52

2Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

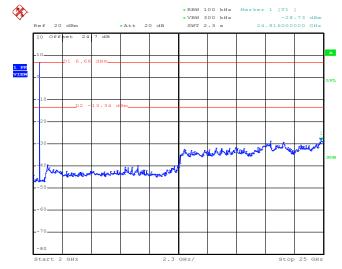

Date: 28.NOV.2014 14:06:14

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 53 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A




Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	00	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

3Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

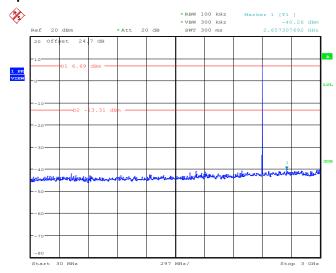

Date: 10.DEC.2014 00:48:18

3Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

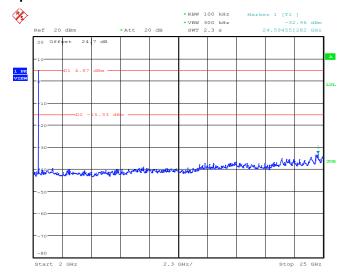

Date: 10.DEC.2014 00:48:39


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 54 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

3Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

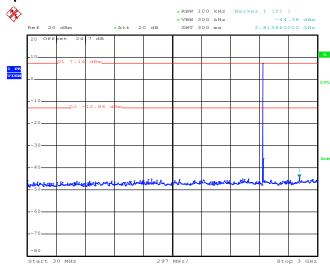

Date: 28.NOV.2014 14:09:16

3Mbps CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

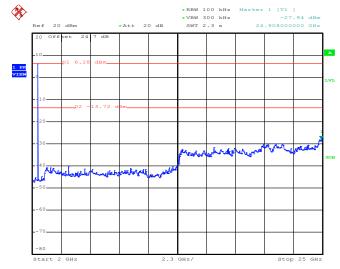

Date: 28.NOV.2014 14:09:37


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 55 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A


Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	78	Relative Humidity :	48~51%
		Test Engineer :	Kenny Chen

3Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

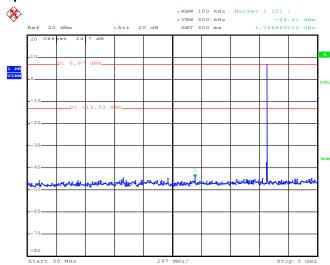

Date: 28.NOV.2014 14:13:04

3Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

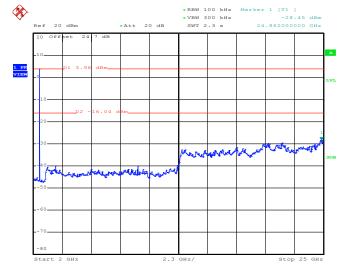

Date: 28.NOV.2014 14:13:26

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 56 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.8 Band Edges and Spurious Emission in the Restricted Band

3.8.1 Limit of Band Edges and Spurious Emission in the Restricted Band

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the FCC section 15.209 limits as below.

Conducted Band Edges and Spurious Emission in the Restricted Band

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD

TEL: 886-3-327-3456

Page Number : 57 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.8.3 Test Procedures

- The testing follows the guidelines in Spurious Radiated Emissions of FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The EUT was placed on a turntable with 0.8 meter above ground.
- 3. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 4. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 5. Set to the maximum power setting and enable the EUT transmit continuously.
- 6. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c). Duty cycle = On time/100 milliseconds


 On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

 Average Emission Level = Peak Emission Level + 20*log(Duty cycle)
- 7. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-47.74dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

3.8.4 Test Setup


For Conducted Measurement Setup:



For radiated emissions below 30MHz

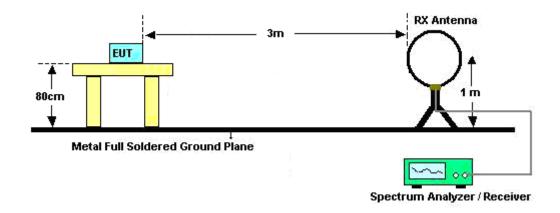

For radiated emissions from 30MHz to 1GHz

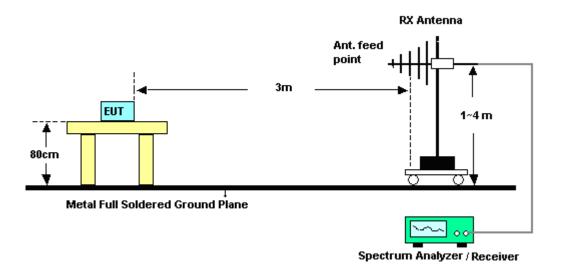


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 59 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

For radiated emissions above 1GHz

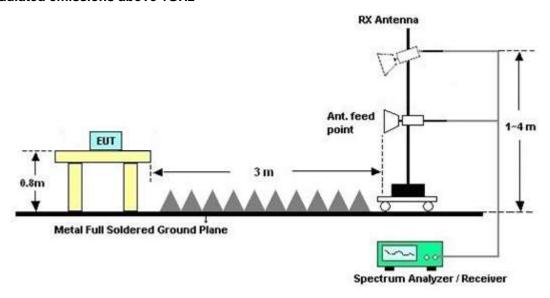

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)


The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 60 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01


Report No.: FR4O0971A

3.8.6 Duty cycle correction factor for average measurement

DH5 on time (One Pulse) Plot on Channel 39

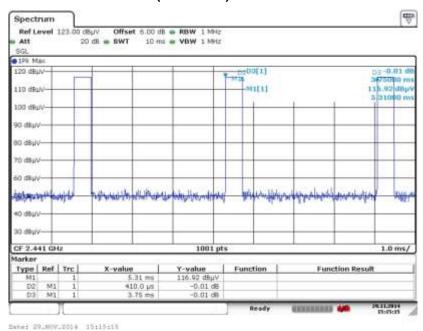

DH5 on time (Count Pulses) Plot on Channel 39

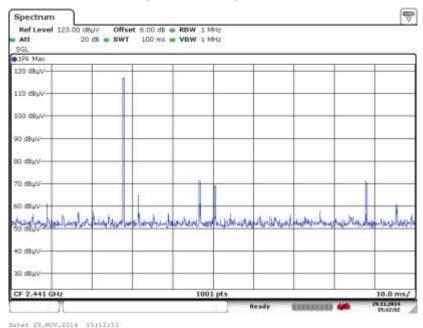

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 1 * 0.41 / 100 = 0.41 %
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -47.74 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 61 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.8.7 Test Result of Conducted Spurious at Band Edges in the Restricted Band

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Grounding	Peak
				Limit	Line	Level	Gain	Loss	Factor	Avg
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dBi)	(dB)	(dB)	(P/A)
DT		2377.34	-30.46	-9.26	-21.2	-36.16	3.2	2.5	0	Р
BT CH00		2377.34	-78.2	-37	-41.2	-	-	1	0	Α
2402MHz	*	2402.04	15.9	-	-	10.2	3.2	2.5	0	Р
2402141112	*	2402.04	-31.84	-	-	-	-	-	0	Α
		2389.61	-39.18	-17.98	-21.2	-44.88	3.2	2.5	0	Р
		2389.61	-86.92	-45.72	-41.2	ı	-	1	0	Α
BT	*	2441.1	15.53	-	-	9.83	3.2	2.5	0	Р
CH39 2441MHz	*	2441.1	-32.21	-	-	-	-	-	0	Α
2441111112		2492.02	-37.54	-16.34	-21.2	-43.24	3.2	2.5	0	Р
		2492.02	-85.28	-44.08	-41.2	-	-	-	0	Α
	*	2480.05	15.5	-	-	9.8	3.2	2.5	0	Р
BT	*	2480.05	-32.24	-	-	-	-	-	0	Α
CH78 2480MHz		2484.46	-35.29	-14.09	-21.2	-40.99	3.2	2.5	0	Р
2400W1112	_	2484.46	-83.03	-41.83	-41.2	-	-	-	0	Α

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 62 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A

3.8.8 Test Result of Conducted Spurious Emission in the Restricted Band

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Grounding	Peak
				Limit	Line	Level	Gain	Loss	Factor	Avg
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dBi)	(dB)	(dB)	(P/A)
		84.81	-67.9	-12.7	-55.2	-78.3	3.2	2.5	4.7	Р
		162.57	-66.74	-15.04	-51.7	-77.14	3.2	2.5	4.7	Р
ВТ		244.92	-67.85	-18.65	-49.2	-78.25	3.2	2.5	4.7	Р
CH00		433	-68.29	-19.09	-49.2	-78.69	3.2	2.5	4.7	Р
2402MHz		598.9	-65.59	-16.39	-49.2	-75.99	3.2	2.5	4.7	Р
		800.5	-53.14	-3.94	-49.2	-63.54	3.2	2.5	4.7	Р
		4806	-27.72	-6.52	-21.2	-38.12	3.2	2.5	0	Р
		4806	-75.46	-34.26	-41.2	-	-	-	0	Α
		58.62	-68.72	-13.52	-55.2	-79.12	3.2	2.5	4.7	Р
		126.39	-68.19	-16.49	-51.7	-78.59	3.2	2.5	4.7	Р
		233.04	-66.32	-17.12	-49.2	-76.72	3.2	2.5	4.7	Р
		407.1	-68.41	-19.21	-49.2	-78.81	3.2	2.5	4.7	Р
BT		571.6	-66.68	-17.48	-49.2	-77.08	3.2	2.5	4.7	Р
CH39 2441MHz		813.8	-53.12	-3.92	-49.2	-63.52	3.2	2.5	4.7	Р
244 HVINZ		4884	-27.13	-5.93	-21.2	-37.53	3.2	2.5	0	Р
		4884	-74.87	-33.67	-41.2	-	-	-	0	А
		7323	-50.11	-28.91	-21.2	-55.81	3.2	2.5	0	Р
		7323	-97.85	-56.65	-41.2	-	-	-	0	А
		75.9	-67.56	-12.36	-55.2	-77.96	3.2	2.5	4.7	Р
		182.28	-68.16	-16.46	-51.7	-78.56	3.2	2.5	4.7	Р
		240.06	-67.54	-18.34	-49.2	-77.94	3.2	2.5	4.7	Р
		434.4	-67.85	-18.65	-49.2	-78.25	3.2	2.5	4.7	Р
BT		566	-67.46	-18.26	-49.2	-77.86	3.2	2.5	4.7	Р
CH78		827.1	-52.46	-3.26	-49.2	-62.86	3.2	2.5	4.7	Р
2480MHz		4962	-28.75	-7.55	-21.2	-34.45	3.2	2.5	0	Р
		4962	-76.49	-35.29	-41.2	-	-	-	0	А
		7440	-49.36	-28.16	-21.2	-55.06	3.2	2.5	0	Р
		7440	-97.1	-55.9	-41.2	-	-	-	0	А

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 63 of 71 Report Issued Date: Dec. 19, 2014 : Rev. 01 Report Version

Report Template No.: BU5-FR15CBT Version 1.0

3.8.9 Test Result of Cabinet Radiated Spurious at Band Edges

Please refer to Appendix A.

3.8.10 Test Result of Cabinet Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix A.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 64 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Frequency of emission (MHz)	Conducted limit (dBμV)				
Frequency of emission (MHZ)	Quasi-peak	Average			
0.15-0.5	66 to 56*	56 to 46*			
0.5-5	56	46			
5-30	60	50			

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.


3.9.3 Test Procedures

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 65 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.9.4 Test Setup

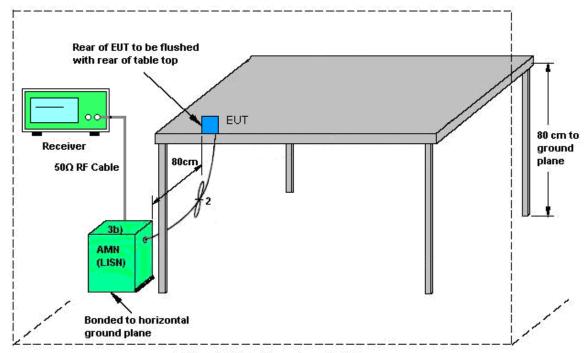

AMN = Artificial mains network (LISN)

AE = Associated equipment

EUT = Equipment under test

ISN = Impedance stabilization network

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 66 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

3.9.5 Test Result of AC Conducted Emission

Test Mode :	Mode 1	Temperature :	20~22 ℃
Test Engineer :	Kai-Chun Chu	Relative Humidity :	46~48%
Test Voltage :	120Vac / 60Hz	Phase :	Line

Function Type: WLAN (2.4GHz) Link + Bluetooth Link + Adapter

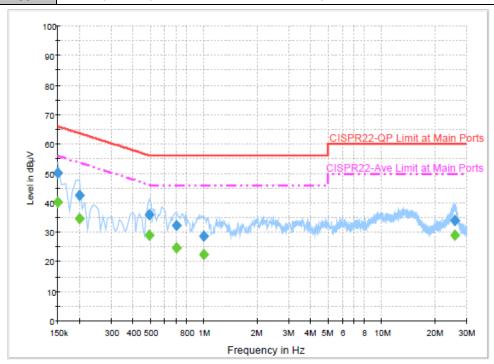

Final Result : Quasi-Peak

Frequency (MHz)	Quasi-Peak (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.150000	50.1	Off	L1	19.5	15.9	66.0
0.198000	42.5	Off	L1	19.4	21.2	63.7
0.494000	36.0	Off	L1	19.4	20.1	56.1
0.702000	32.5	Off	L1	19.6	23.5	56.0
0.990000	28.9	Off	L1	19.5	27.1	56.0
25.766000	34.0	Off	L1	19.9	26.0	60.0

Final Result : Average

Frequency (MHz)	Average (dBµV)	Filter	Line	Corr.	Margin (dB)	Limit (dBµV)
	,			` '	` '	` ' '
0.150000	40.3	Off	L1	19.5	15.7	56.0
0.198000	34.6	Off	L1	19.4	19.1	53.7
0.494000	29.2	Off	L1	19.4	16.9	46.1
0.702000	24.9	Off	L1	19.6	21.1	46.0
0.990000	22.5	Off	L1	19.5	23.5	46.0
25.766000	29.0	Off	L1	19.9	21.0	50.0

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 67 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A



Test Mode :	Mode 1	Temperature :	20~22 ℃
Test Engineer :	Kai-Chun Chu	Relative Humidity :	46~48%
Test Voltage :	120Vac / 60Hz	Phase :	Neutral

Function Type: | WLAN (2.4GHz) Link + Bluetooth Link + Adapter

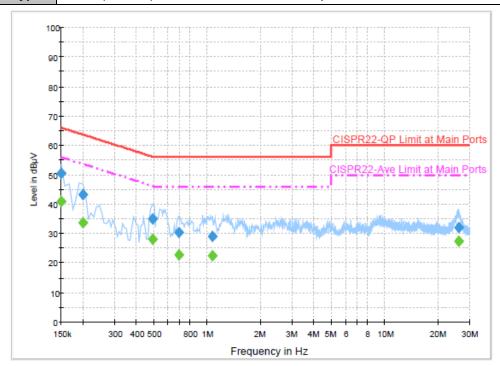

Final Result : Quasi-Peak

Frequency (MHz)	Quasi-Peak (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.150000	50.6	Off	N	19.5	15.4	66.0
0.198000	43.2	Off	N	19.4	20.5	63.7
0.494000	35.1	Off	N	19.4	21.0	56.1
0.694000	30.3	Off	N	19.6	25.7	56.0
1.070000	29.0	Off	N	19.6	27.0	56.0
25.982000	31.9	Off	N	20.1	28.1	60.0

Final Result : Average

Frequency	Average	C:ltor	Lina	Corr.	Margin	Limit
(MHz)	(dBµV)	Filter	Line	(dB)	(dB)	(dBµV)
0.150000	40.9	Off	N	19.5	15.1	56.0
0.198000	33.7	Off	N	19.4	20.0	53.7
0.494000	28.1	Off	N	19.4	18.0	46.1
0.694000	22.7	Off	N	19.6	23.3	46.0
1.070000	22.4	Off	N	19.6	23.6	46.0
25.982000	27.3	Off	N	20.1	22.7	50.0

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 68 of 71 Report Issued Date: Dec. 19, 2014 Report Version : Rev. 01

Report No.: FR4O0971A

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the FCC rule.

3.10.2 Antenna Anti-Replacement Construction

Non-standard antenna connector is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 69 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz~40GHz	Jun. 09, 2014	Oct. 22, 2014 ~ Dec. 10, 2014	Jun. 08, 2015	Conducted (TH02-HY)
Power Meter	Agilent	E4416A	GB412923 44	300MHz~40GHz	Jan. 28, 2014	Oct. 22, 2014 ~ Dec. 10, 2014	Jan. 27, 2015	Conducted (TH02-HY)
Power Sensor	Agilent	E9327A	US404415 48	300MHz~40GHz	Jan. 28, 2014	Oct. 22, 2014 ~ Dec. 10, 2014	Jan. 27, 2015	Conducted (TH02-HY)
EMI Test Receiver	Rohde & Schwarz	ESCI 7	100724	9 kHz~7 GHz	Aug. 30, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Aug. 29, 2015	Radiation (03CH07-HY)
Spectrum Analyzer	Rohde & Schwarz	FSV30	101749	10Hz ~ 30GHz	Feb. 10, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Feb. 09, 2015	Radiation (03CH07-HY)
Loop Antenna	R&S	HFH2-Z2	100315	9 kHz~30 MHz	Jul. 28, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Jul. 27, 2015	Radiation (03CH07-HY)
Bilog Antenna	Schaffner	CBL6111C	2726	30MHz ~ 1GHz	Sep. 27, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Sep. 26, 2015	Radiation (03CH07-HY)
Double Ridge Horn Antenna	ESCO	3117	75962	1GHz~18GHz	Aug. 19, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Aug. 18, 2015	Radiation (03CH07-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170 251	18GHz~40GHz	Oct. 02, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Oct. 01, 2015	Radiation (03CH07-HY)
Preamplifier	COM-POWER	PA-103A	161241	10 MHz ~ 1000MHz	Mar. 17, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Mar. 16, 2015	Radiation (03CH07-HY)
Preamplifier	Agilent	8449B	3008A023 62	1 GHz~26.5 GHz	Oct. 21, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Oct. 20, 2015	Radiation (03CH07-HY)
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1590074	DC~18 GHz	Jul. 07, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Jul. 06, 2015	Radiation (03CH07-HY)
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1590075	DC~18 GHz	Apr. 21, 2014	Nov. 29, 2014 ~ Dec. 10, 2014	Apr. 20, 2015	Radiation (03CH07-HY)
Turn Table	ChainTek	ChainTek 3000	N/A	0 ~ 360 degree	N/A	Nov. 29, 2014 ~ Dec. 10, 2014	N/A	Radiation (03CH07-HY)
Antenna Mast	ChainTek	ChainTek 3000	N/A	N/A	N/A	Nov. 29, 2014 ~ Dec. 10, 2014	N/A	Radiation (03CH07-HY)
EMI Test Receiver	Rohde & Schwarz	ESCS 30	100356	9kHz ~ 2.75GHz	Nov. 12, 2014	Dec. 10, 2014	Nov. 11, 2015	Conduction (CO05-HY)
LISN (for auxiliary equipment)	Rohde & Schwarz	ENV216	100081	9kHz ~ 30MHz	Dec. 12, 2013	Dec. 10, 2014	Dec. 11, 2014	Conduction (CO05-HY)
LISN	Rohde & Schwarz	ENV216	100080	9kHz ~ 30MHz	Dec. 02, 2014	Dec. 10, 2014	Dec. 01, 2015	Conduction (CO05-HY)
AC Power Source	ChainTek	APC-1000W	N/A	N/A	N/A	Dec. 10, 2014	N/A	Conduction (CO05-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 70 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report No.: FR4O0971A

5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of	2.26
Confidence of 95% (U = 2Uc(y))	2.20

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty	for a Level of	4.50
Confidence of 95% (U = 2Uc(v))	4.50

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : 71 of 71
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

Appendix A. Radiated Spurious Emission

Test Engineer :	Derreck Chen	Temperature :	23~25°C
		Relative Humidity :	48~51%

15C 2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2316.63	47.86	-26.14	74	43.21	32.07	6.8	34.22	100	0	Р	Н
		2316.63	0.12	-53.88	54	-	-	-	-	-	-	Α	Н
	*	2402	44.75	-	-	39.96	32.18	6.91	34.3	100	0	Р	Н
	*	2402	-2.99	-	-	-	-	-	-	-	-	Α	Н
ВТ													Н
CH00													Н
2402MHz		2327.68	46.57	-27.43	74	41.9	32.09	6.8	34.22	100	0	Р	V
		2327.68	-1.17	-55.17	54	-	-	-	-	-	-	Α	V
	*	2402	45.52	-	-	40.73	32.18	6.91	34.3	100	0	Р	V
	*	2402	-2.22	-	-	-	-	-	-	-	-	Α	V
													V
													V
		2363.96	47.24	-26.76	74	42.49	32.13	6.87	34.25	100	0	Р	Н
		2363.96	-0.5	-54.5	54	-	-	-	-	-	-	Α	Н
	*	2441	44.24	-	-	39.44	32.24	6.95	34.39	100	0	Р	Н
	*	2441	-3.5	-	-	-	-	-	-	-	-	Α	Н
ВТ		2487.27	46.52	-27.48	74	41.67	32.28	7	34.43	100	0	Р	Н
CH 39		2487.27	-1.22	-55.22	54	-	-	-	-	-	-	Α	Н
2441MHz		2340.78	46.87	-27.13	74	42.17	32.11	6.84	34.25	100	0	Р	V
		2340.78	-0.87	-54.87	54	-	-	-	-	-	-	Α	V
	*	2441	45.21	1	-	40.41	32.24	6.95	34.39	100	0	Р	V
	*	2441	-2.53	-	-	-	-	-	-	-	-	Α	V
		2494.49	46.49	-27.51	74	41.67	32.3	7	34.48	100	0	Р	V
		2494.49	-1.25	-55.25	54	-	-	-	-	-	-	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : A1 of A6
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
	*	2480	44.47	-	-	39.62	32.28	7	34.43	100	0	Р	Н
	*	2480	-3.27	-	-	-	-	1	-	-	-	Α	Н
		2498.04	47.5	-26.5	74	42.68	32.3	7	34.48	100	0	Р	Н
		2498.04	-0.24	-54.24	54	ı	•	ı	-	ı	-	Α	Н
рт													Н
BT CH 78													Н
2480MHz	*	2480	44.55	ı	-	39.7	32.28	7	34.43	100	0	Р	V
240001112	*	2480	-3.19	-	-	-	-	-	-	-	-	Α	V
		2497.97	44.92	-29.08	74	40.1	32.3	7	34.48	100	0	Р	V
		2497.97	-2.82	-56.82	54	-	-	-	-	-	-	Α	V
													V
													V
	No other spurious found.												
Remark	2. All	results are PA	SS against F	eak and	Average lim	it line.							

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : A2 of A6
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

15C 2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		(MHz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB/m)	Loss (dB)	Factor (dB)	Pos (cm)	Pos (deg)	Avg. (P/A)	(H/V
		4806	40.63	-33.37	74	54.23	34.25	11.11	58.96	100	0	P	Н
		4806	-7.11	-61.11	54	-	-	-	-	-	-	Α	Н
													Н
ВТ													Н
CH 00		4806	41.44	-32.56	74	55.04	34.25	11.11	58.96	100	0	Р	V
2402MHz		4806	-6.3	-60.3	54	-	-	-	-	-	-	Α	V
													V
													V
		4884	41.24	-32.76	74	54.56	34.3	11.21	58.83	100	0	Р	Н
		4884	-6.5	-60.5	54	-	-	-	-	-	-	Α	Н
		7323	42.19	-31.81	74	49.25	35.6	15.08	57.74	100	0	Р	Н
BT		7323	-5.55	-59.55	54	-	-	1	-	1	1	Α	Н
CH 39 2441MHz		4884	42.04	-31.96	74	55.36	34.3	11.21	58.83	100	0	Р	V
∠44 I IVI MZ		4884	-5.7	-59.7	54	•	•	ı	-	ı	1	Α	V
		7323	41.73	-32.27	74	48.79	35.6	15.08	57.74	100	0	Р	V
		7323	-6.01	-60.01	54	-	-	-	-	-	-	Α	V
		4962	40.92	-33.08	74	53.89	34.37	11.32	58.66	100	0	Р	Н
		4962	-6.82	-60.82	54	-	-	-	-	-	-	Α	Н
ВТ		7440	42.02	-31.98	74	49.14	35.6	15.13	57.85	100	0	Р	Н
CH 78		7440	-5.72	-59.72	54	-	-	-	-	-	-	Α	Н
2480MHz		4962	41.72	-32.28	74	54.69	34.37	11.32	58.66	100	0	Р	V
		4962	-6.02	-60.02	54	-	-	-	-	-	-	Α	V
		7440	41.14	-32.86	74	48.26	35.6	15.13	57.85	100	0	Р	V
		7440	-6.6	-60.6	54	-	-	-	-	-	-	Α	٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD

Report Issued Date : Dec. 19, 2014 Report Version : Rev. 01

Page Number

Report Template No.: BU5-FR15CBT Version 1.0

: A3 of A6

15C Emission below 1GHz

2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		74.28	9.06	-30.94	40	31.4	6.8	2.06	31.2			Р	Н
		118.83	20.36	-23.14	43.5	37.74	11.35	2.38	31.11			Р	Н
		240.06	14.12	-31.88	46	30.76	11.4	2.96	31			Р	Н
		415.5	20.36	-25.64	46	31.21	16.45	3.52	30.82			Р	Н
		568.8	22.22	-23.78	46	29.18	19.75	4.01	30.72			Р	Н
		866.3	25.74	-20.26	46	28.37	23.08	4.66	30.37	102	23	Р	Н
													Н
													Н
													Н
													Н
2.4011-													Н
2.4GHz BT													Н
LF		65.91	10.28	-29.72	40	33.36	6.08	2.06	31.22			Р	V
		154.47	12.42	-31.08	43.5	30.24	10.72	2.61	31.15			Р	V
		245.46	16.79	-29.21	46	32.93	11.9	2.96	31			Р	V
		396.6	27.36	-18.64	46	38.98	15.78	3.52	30.92			Р	V
		666.8	30.09	-15.91	46	35.85	20.36	4.35	30.47			Р	V
		897.1	32.59	-13.41	46	35.13	23.11	4.66	30.31	198	269	Р	V
													V
													V
													V
													V
													V
													V
	1. No	o other spurious	s found.										
Remark		results are PA		mit line.									

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : A4 of A6
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions								
	shall not exceed the level of the fundamental frequency per 15.209(c).								
!	Test result is over limit line.								
P/A	Peak or Average								
H/V	Horizontal or Vertical								

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : A5 of A6
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 1.0

A calculation example for radiated spurious emission is shown as below:

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

FCC ID: Z64-WL18DBMOD Report Template No.: BU5-FR15CBT Version 1.0

: A6 of A6 Page Number Report Issued Date : Dec. 19, 2014

Report Version : Rev. 01



Report No.: FR4O0971A

Appendix B. Setup Photographs

<Conducted Emission>



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : B1 of B2
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01




Report No.: FR4O0971A

<Radiated Emission>

LF



HF

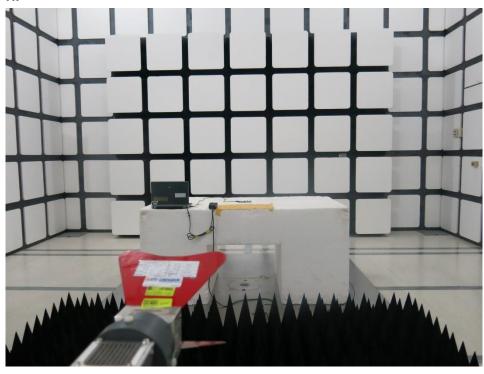

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL18DBMOD Page Number : B2 of B2
Report Issued Date : Dec. 19, 2014
Report Version : Rev. 01