Hearing Aid Compatibility (HAC) T-Coil Test Report

APPLICANT: Zebra Technologies Corporation

EQUIPMENT: Touch computer

BRAND NAME: Zebra

MODEL NAME : TC56CJ

FCC ID : UZ7TC56CJ

T-RATING : T3

STANDARD : FCC 47 CFR §20.19

ANSI C63.19-2011

We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Eric Huang / Manager

Approved by: Jones Tsai / Manager





Report No.: HA822218B

SPORTON INTERNATIONAL INC.

No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 1 of 18
Report Issued Date : Apr. 30, 2018

Report Version : Rev. 01



Table of Contents

| 1. | General Information | 4 |
|----|--------------------------------------|----|
| 2. | Administration Data | 5 |
| | Applied Standards | |
| 4. | Air Interface and Operating Mode | 6 |
| | Measurement standards for T-Coil | |
| | 5.1 Frequency Response | 7 |
| | 5.2 T-Coil Signal Quality Categories | 7 |
| 6. | T-Coil Test Procedure | 8 |
| | 6.1 Test Flow Chart | g |
| | 6.2 Test Setup Diagram | 10 |
| | 6.3 Description of EUT Test Position | 12 |
| 7. | Test Equipment List | 13 |
| 8. | T-Coil testing for OTT VoIP Calling | 14 |
| | Uncertainty Assessment | |
| | References | |

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 2 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01



Revision History

| REPORT NO. | VERSION | DESCRIPTION | ISSUED DATE |
|------------|---------|-------------------------|---------------|
| HA822218B | Rev. 01 | Initial issue of report | Apr. 30, 2018 |
| | | | |
| | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 3 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01

1. General Information

| | Product Feature & Specification | | | | | | | |
|-------------------|--|--|--|--|--|--|--|--|
| Applicant Name | Zebra Technologies Corporation | | | | | | | |
| Equipment Name | The state of the s | | | | | | | |
| Brand Name | Zebra | | | | | | | |
| Model Name | TC56CJ | | | | | | | |
| FCC ID | UZ7TC56CJ | | | | | | | |
| IMEI | 353856080523432 | | | | | | | |
| HW Version | REV. LEVEL: A | | | | | | | |
| SW Version | 91-01-49-NG-00-4 | | | | | | | |
| FW Version | FUSION_BA_2_10.0.1.012_N | | | | | | | |
| MFD | 05MAR18 | | | | | | | |
| EUT Stage | Engineering sample | | | | | | | |
| Exposure category | General Population/Uncontrolled Exposure | | | | | | | |
| Date Tested | 2018/4/21 ~ 2018/4/25 | | | | | | | |
| Frequency Band | GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 17: 706.5 MHz ~ 713.5 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5720 MHz WLAN 5.8GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz | | | | | | | |
| Mode | GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA CDMA2000 : 1xRTT/1xEv-Do(Rel.0)/1xEv-Do(Rev.A) LTE: QPSK, 16QAM 802.11a/b/g/n/ac HT20/HT40/VHT20/VHT40/VHT80 Bluetooth BR/EDR/LE NFC:ASK | | | | | | | |

Report No.: HA822218B

 SPORTON INTERNATIONAL INC.
 Page Number
 : 4 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

2. Administration Data

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

| Testing Laboratory | | | | | | |
|--------------------|--|--|--|--|--|--|
| Test Site | SPORTON INTERNATIONAL INC. | | | | | |
| Test Site Location | No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978 | | | | | |
| Test Site No. | Sporton Site No. : SAR04-HY | | | | | |
| | Applicant | | | | | |
| Company Name | Zebra Technologies Corporation | | | | | |
| Address | 1 Zebra Plaza Holtsville, NY 11742 | | | | | |
| Manufacturer | | | | | | |
| Company Name | Wistron Corporation | | | | | |
| Address | 21F, No. 88, Sec. 1, Hsin Tai Wu Rd., Hsichih Dist, New Taipei City 221, Taiwan R.O.C. | | | | | |

3. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 5 of 18
Report Issued Date : Apr. 30, 2018

Report No.: HA822218B

Report Version : Rev. 01

4. Air Interface and Operating Mode

| Air Interface | Band MHz | Туре | C63.19 Tested | Simultaneous Transmitter | Name of Voice Service | Power Reduction |
|------------------|-------------|------|--------------------|-----------------------------|---|--------------------|
| | EDGE850 | | Yes | | Google Duo ⁽¹⁾ | |
| GSM | EDGE1900 | VD | | WLAN, BT | WFC ^{(1), (2)} | No |
| | 850 HSPA | | | WLAN, BT | Google Duo ⁽¹⁾ | No |
| UMTS | 1750 HSPA | VD | Yes | WLAN, BT | _ / | No |
| | 1900 HSPA | | | WLAN, BT | WFC ^{(1), (2)} | No |
| CDMA | 850 EVDO | \/D | V | WLAN, BT | Google Duo ⁽¹⁾ | No |
| CDMA | 1900 EVDO | VD | Yes | WLAN, BT | WFC ^{(1), (2)} | No |
| | Band 2 | | | WLAN, BT | Google Duo ⁽¹⁾ / WFC ^{(1), (2)} | No |
| | Band 4 | | | WLAN, BT | | No |
| LTE | Band 5 | VD | Yes | WLAN, BT | | No |
| (FDD) | Band 12 | VD | 162 | WLAN, BT | | No |
| | Band 13 | | WLAN, BT | | No | |
| | Band 17 | | | WLAN, BT | | No |
| | 2450 | | | | Google Duo ⁽¹⁾ | No |
| | 5200 | | | | | No |
| Wi-Fi | 5300 VD Yes | Yes | GSM,WCDMA,CDMA,LTE | / | No | |
| | 5500 | | | | WFC ^{(1), (2)} | No |
| | 5800 | | | | | No |
| BT | 2450 | DT | No | GSM,WCDMA,CDMA,LTE | NA | No |

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)
VD= CMRS and IP Voice Service over Digital Transport

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used.
- The Workforce Connect (WFC) is an over-the-top (OTT) voice services operating over IP, and this voice application was development and pre-installed on a wireless handset by the Zebra Technologies Corporation.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 6 of 18 Report Issued Date: Apr. 30, 2018

Report No.: HA822218B


: Rev. 01 Report Version

5. Measurement standards for T-Coil

5.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA822218B

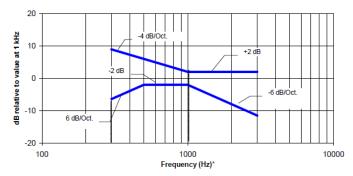

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

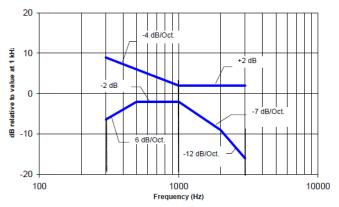

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

5.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

| Category | Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB) |
|-------------|--|
| Category T1 | 0 to 10 dB |
| Category T2 | 10 to 20 dB |
| Category T3 | 20 to 30 dB |
| Category T4 | > 30 dB |

Table 1 T-Coil Signal Quality Categories

 SPORTON INTERNATIONAL INC.
 Page Number
 : 7 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

6. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA822218B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 8 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

6.1 Test Flow Chart


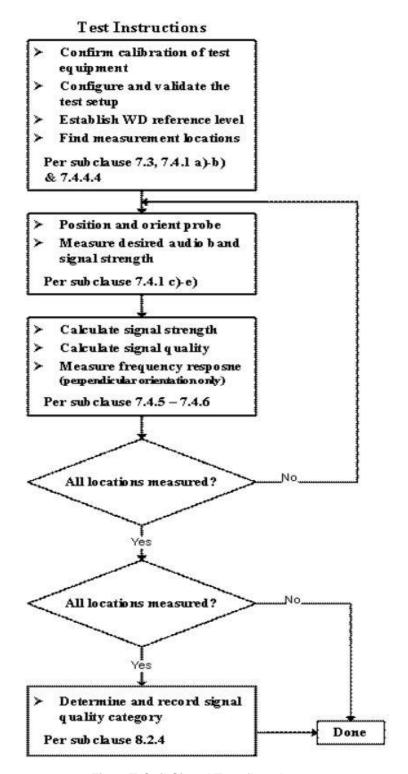


Fig. 2 T-Coil Signal Test flowchart

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 9 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01

6.2 Test Setup Diagram

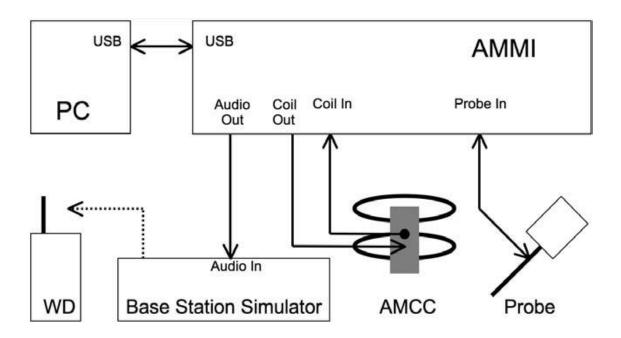

General Note:

- 1. Define the all applicable input audio level as below according to ANSI C63.19 2011 and KDB 285076 D02v03:
 - OTT VoIP input Level: -20dBm0
- 2. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- 3. The test setup used for WFC VoIP application is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and can be determined the audio input level of -20dBm0.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 10 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01



 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA822218B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

| Signal [file name] | Duration [s] | Peak-to- RMS [dB] | RMS [dB] | Required gain factor *) | Gain setting |
|-------------------------------|-----------------|----------------------|-------------|-------------------------|-----------------|
| 1kHz sine | | 3.0 | 0.0 | 1.00 | |
| 48k_1.025kHz_10s.wav | 10 | 3.0 | 0.0 | 1.00 | |
| 48k_1kHz_3.15kHz_10s.wav | 10 | 6.0 | -3.0 | 1.42 | |
| 48k_315Hz_1kHz_10s.wav | 10 | 6.0 | -2.9 | 1.40 | |
| 48k csek 8k 441 white 10s.wav | 10 | 13.8 | -10.5 | 3.34 | |
| 48k_multisine_50-5000_10s.wav | 10 | 11.1 | -7.9 | 2.49 | |
| 48k_voice_1kHz_1s.wav | 1 | 16.2 | -12.7 | 4.33 | |
| 48k voice 300-3000 2s.wav | 2 | 21.6 | -18.6 | 8.48 | |

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

- Gatting setting at -16dBm0 = required gain factor * calculated gain

| Gain Value | 20* log(gain) | AMCC Coil In | Level |
|------------|---------------|--------------|--------|
| (linear) | dB | (dBv RMS) | dBm0 |
| | | -2.47 | 3.14 |
| 10 | 20 | -19.85 | -14.24 |
| 8.17 | 18.24 | -21.61 | -16 |

| Signal Type | Duration (s) | Peak to RMS (dB) | RMS (dB) | Required Gain Factor | Calculated Gain Setting |
|------------------------|-----------------|---------------------|-------------|----------------------|----------------------------|
| 1kHz sine | - | 3 | 0 | 1 | 8.17 |
| 48k_voice_1kHz | 1 | 16.2 | -12.7 | 4.33 | 35.36 |
| 48k_voice_300Hz ~ 3kHz | 2 | 21.6 | -18.6 | 8.48 | 69.25 |

 SPORTON INTERNATIONAL INC.
 Page Number
 : 11 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

6.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

- ♦ The area is 5 cm by 5 cm.
- ◆ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

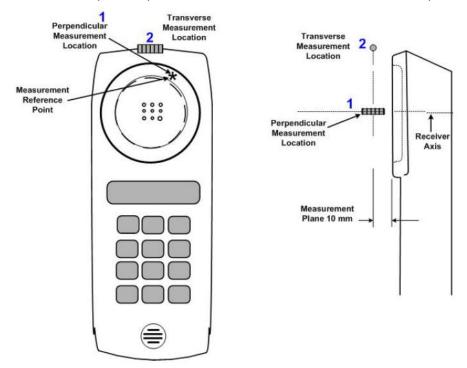


Fig.3 A typical EUT reference and plane for T-Coil measurements

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 12 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01



7. Test Equipment List

| Manufacturer | Name of Equipment | Type/Madel | Serial Number | Calib | ration |
|--------------|---------------------------------|------------|---------------|---------------|---------------|
| Manuracturer | Name of Equipment | Type/Model | Seriai Number | Last Cal. | Due Date |
| SPEAG | Audio Magnetic 1D Field Probe | AM1DV3 | 3130 | Nov. 21, 2017 | Nov. 20, 2018 |
| SPEAG | Data Acquisition Electronics | DAE4 | 854 | May. 02, 2017 | May. 01, 2018 |
| SPEAG | Audio Magnetic Calibration Coil | AMCC | 1049 | NCR | NCR |
| SPEAG | Audio Measuring Instrument | AMMI | 1041 | NCR | NCR |
| Gencom | Thermometer | TE1 | TM685-1 | Mar. 16, 2018 | Mar. 15, 2019 |
| R&S | R&S Base Station | | 149637 | Jul. 26, 2017 | Jul. 25, 2018 |
| SPEAG | SPEAG Test Arch Phantom | | N/A | NCR | NCR |
| SPEAG | Phone Positoiner | N/A | N/A | NCR | NCR |

Note:

SPORTON INTERNATIONAL INC.Page NumberTEL: 886-3-327-3456Report Issued

FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 13 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01

^{1.} NCR: "No-Calibration Required"

8. T-Coil testing for OTT VoIP Calling

General Notes:

1. The google Duo VoIP call software is pre-installed on this device and head-to-ear scenario should be consideration, the google Duo only support OPUS audio codec and support 6Kbpa to 75Kbps bitrate. According to KDB 285076 D02, all air interfaces via a data connection with google Duo VoIP calling would be consideration to be tested.

Report No.: HA822218B

- 2. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0
- 3. The WFC VoIP application software is pre-installed on this device and head-to-ear scenario should be consideration, the WFC VoIP application support several audio codecs as below table. According to KDB 285076 D02, all air interfaces via a data connection with WFC VoIP calling would be consideration to be tested.
- 4. For OTT over LTE or OTT over WiFi radio configuration investigation is choose either one codec and an investigation was performed on all frequency band, data rates and modulations and RB configuration to determine the radio configuration to be used for testing, the following tests results which the worst case configuration would be remarked to be used for the testing for the handset.
- 5. For OTT VoIP codec investigation test reduction, due to all air interface have the same codec configuration, therefore, the codec investigation was choose UMTS B2 to determine the audio codec configuration to be used for others air interfaces testing. the following codec investigation tests results which the worst case codec would be remarked to be used for the testing for the handset.

< Radio configure Investigation>

| Air Interface | Bandwidth (MHz) | Modulation | RB size | RB offset | channel | ABM1 dB (A/m) | ABM2 dB (A/m) | Signal Quality (dB) |
|---------------|--------------------|------------|------------|--------------|---------|------------------|------------------|---------------------------|
| LTE B2 | 20 | QPSK | 1 | 0 | 18900 | 1.89 | -34.26 | 36.15 |
| LTE B2 | 20 | QPSK | 50 | 0 | 18900 | 1.85 | -35.59 | 37.44 |
| LTE B2 | 20 | QPSK | 100 | 0 | 18900 | 1.89 | -35.55 | 37.44 |
| LTE B2 | 20 | 16QAM | 1 | 0 | 18900 | 1.89 | -35.25 | 37.14 |
| LTE B2 | 20 | 64QAM | 1 | 0 | 18900 | 1.89 | -34.99 | 36.88 |
| LTE B2 | 15 | QPSK | 1 | 0 | 18900 | 1.90 | -35.08 | 36.98 |
| LTE B2 | 10 | QPSK | 1 | 0 | 18900 | 1.89 | -35.18 | 37.07 |
| LTE B2 | 5 | QPSK | 1 | 0 | 18900 | 1.90 | -35.22 | 37.12 |
| LTE B2 | 3 | QPSK | 1 | 0 | 18900 | 1.91 | -35.30 | 37.21 |
| LTE B2 | 1.4 | QPSK | 1 | 0 | 18900 | 1.90 | -35.35 | 37.25 |

 SPORTON INTERNATIONAL INC.
 Page Number
 : 14 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01



| Air Interface | BW (MHz) | Mode | Channel | ABM1 dB (A/m) | ABM2 dB (A/m) | Signal Quality dB |
|----------------|-------------|------|---------|------------------|------------------|-------------------------|
| 802.11b | 20 | 1M | 6 | -2.55 | -33.89 | 31.34 |
| 802.11b | 20 | 11M | 6 | -0.60 | -33.57 | 32.97 |
| 802.11g | 20 | 6M | 6 | 0.88 | -33.35 | 34.23 |
| 802.11g | 20 | 54M | 6 | -1.19 | -33.50 | 32.31 |
| 802.11n-HT20 | 20 | MCS0 | 6 | -1.00 | -33.12 | 32.12 |
| 802.11n-HT20 | 20 | MCS7 | 6 | -0.26 | -32.68 | 32.42 |
| 802.11n-HT40 | 40 | MCS0 | 6 | 0.90 | -33.20 | 34.10 |
| 802.11n-HT40 | 40 | MCS7 | 6 | 0.92 | -32.86 | 33.78 |
| 802.11ac-VHT40 | 40 | MCS0 | 6 | 0.88 | -32.73 | 33.61 |
| 802.11ac-VHT40 | 40 | MCS8 | 6 | 0.90 | -32.68 | 33.58 |
| 802.11a | 20 | 6M | 40 | 1.44 | -33.68 | 35.12 |
| 802.11a | 20 | 54M | 40 | 1.43 | -34.79 | 36.22 |
| 802.11an-HT20 | 20 | MCS0 | 40 | 1.45 | -34.74 | 36.19 |
| 802.11an-HT20 | 20 | MCS7 | 40 | 1.44 | -35.08 | 36.52 |
| 802.11an-HT40 | 40 | MCS0 | 38 | 1.45 | -35.17 | 36.62 |
| 802.11an-HT40 | 40 | MCS7 | 38 | 1.46 | -35.21 | 36.67 |
| 802.11ac-VHT20 | 20 | MCS0 | 40 | 1.46 | -35.17 | 36.63 |
| 802.11ac-VHT20 | 20 | MCS8 | 40 | 1.47 | -35.24 | 36.71 |
| 802.11ac-VHT40 | 40 | MCS0 | 38 | 1.47 | -35.32 | 36.79 |
| 802.11ac-VHT40 | 40 | MCS8 | 38 | 1.47 | -35.20 | 36.67 |
| 802.11ac-VHT80 | 80 | MCS0 | 50 | 1.46 | -35.18 | 36.64 |
| 802.11ac-VHT80 | 80 | MCS8 | 50 | 1.47 | -34.94 | 36.41 |

<Duo Codec Investigation>

| Codec | Bitrate 6Kbps | Bitrate 40Kbps | Bitrate 70Kbps | Orientation | Band / Channel | | |
|---------------------|------------------|-------------------|-------------------|-------------|----------------|--|--|
| ABM 1 (dBA/m) | 7.2 | 7.43 | 7.57 | | | | |
| ABM 2 (dBA/m) | -34.92 | -35.27 | -35.5 | Assign | UMTS B2 / 9400 | | |
| Signal Quality (dB) | 42.12 | 42.7 | 43.07 | Axial | OW13 B2 / 9400 | | |
| Freq. Response | PASS | PASS | PASS | | | | |

<WFC Codec Investigation>

| Codec | G.711 a-Law | G.711 u-Law | G.729 | G.722 16KHz | GSM 8KHz | Orientation | Band / BW / Channel |
|------------------------|-------------|-------------|--------|----------------|-------------|-------------|------------------------|
| ABM 1 (dBA/m) | 4.87 | 5.14 | 4.42 | -0.35 | 4.6 | | UMTS B2 / 9400 |
| ABM 2 (dBA/m) | -37.22 | -37.2 | -36.81 | -36.67 | -36.68 | Axial | |
| Signal Quality (dB) | 42.09 | 42.34 | 41.23 | 36.32 | 41.28 | Axiai | |
| Freq. Response | PASS | PASS | PASS | PASS | PASS | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 15 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01



<Summary Tests Results>

| Plot No. | Air Interface | Mode | Channel | Probe Position | ABM1 dB (A/m) | ABM2 dB (A/m) | Ambient Noise dB (A/m) | Freq. Response Variation dB | Signal Quality dB | T Rating | Frequency Response |
|-------------|-----------------------------|-----------------|---------|-------------------|---------------------|---------------------|---------------------------------|--------------------------------------|-------------------------|-------------|-----------------------|
| 01 | GSM850 | SM850 EDGE | 189 | Axial (Z) | -1.70 | -27.55 | -50.01 | 1.77 | 25.85 | T3 | PASS |
| UI | GSIVIOSU | EDGE | 109 | Transversal (Y) | -9.81 | -42.58 | -50.20 | | 32.77 | T4 | |
| 02 | GSM1900 | EDGE | 661 | Axial (Z) | -3.18 | -24.95 | -50.20 | 1.66 | 21.77 | T3 | PASS |
| 02 | G3W1900 | LDOL | 001 | Transversal (Y) | -10.67 | -44.90 | -50.03 | 1.00 | 34.23 | T4 | |
| 03 | WCDMA II | HSPA | 9400 | Axial (Z) | -0.35 | -36.67 | -50.02 | 1.61 | 36.32 | T4 | PASS |
| 03 | WCDIVIA II | HOFA | 9400 | Transversal (Y) | -7.26 | -46.81 | -50.19 | 1.01 | 39.55 | T4 | FASS |
| 04 | WCDMA IV | HSPA | 1413 | Axial (Z) | 0.78 | -36.17 | -50.06 | 1.63 | 36.95 | T4 | DAGO |
| 04 | VVCDIVIA IV | ПОРА | 1413 | Transversal (Y) | -7.05 | -46.99 | -50.07 | 1.03 | 39.94 | T4 | PASS |
| 05 | WCDMA V | HSPA | 4182 | Axial (Z) | 0.22 | -35.55 | -50.20 | 1.65 | 35.77 | T4 | PASS |
| 05 | VVCDIVIA V | ПОРА | 4102 | Transversal (Y) | -7.23 | -46.53 | -50.16 | | 39.30 | T4 | |
| 06 | CDMA BC0 | DTAD 152 6Kbpc | 004 | Axial (Z) | 0.08 | -36.57 | -50.20 | 4.05 | 36.65 | T4 | PASS |
| 06 | CDIVIA BCU | RTAP 153.6Kbps | 384 | Transversal (Y) | -7.48 | -47.01 | -50.17 | 1.65 | 39.53 | T4 | |
| 07 | CDMA BC1 | DTAD 152 6Vbpc | 000 | Axial (Z) | 0.10 | -35.47 | -50.17 | 4.00 | 35.57 | T4 | PASS |
| 07 | CDMA BC1 | RTAP 153.6Kbps | 600 | Transversal (Y) | -7.67 | -47.28 | -50.11 | 1.63 | 39.61 | T4 | |
| 00 | LTE David O | 20M ODCK 4 0 | 18900 | Axial (Z) | 1.02 | -34.07 | -50.14 | 1.65 | 35.09 | T4 | PASS |
| 80 | LTE Band 2 | 20M_QPSK_1_0 | | Transversal (Y) | -6.51 | -46.14 | -50.20 | | 39.63 | T4 | |
| 00 | LTC Bond 4 | 20M ODEK 1 0 | 20175 | Axial (Z) | -1.62 | -34.04 | -50.11 | 1.62 | 32.42 | T4 | PASS |
| 09 | LTE Band 4 | 20M_QPSK_1_0 | | Transversal (Y) | -9.00 | -46.08 | -50.17 | | 37.08 | T4 | |
| 10 | LTC David C | 40M ODCK 4 0 | 00505 | Axial (Z) | -4.76 | -35.41 | -50.10 | 4.04 | 30.65 | T4 | PASS |
| 10 | LTE Band 5 | 10M_QPSK_1_0 | 20525 | Transversal (Y) | -12.55 | -46.50 | -50.01 | 1.61 | 33.95 | T4 | |
| 4.4 | 1.TE D 1.40 | 4014 ODOK 4 0 | 00005 | Axial (Z) | -5.82 | -35.18 | -50.03 | 4.00 | 29.36 | T3 | PASS |
| 11 | LTE Band 12 | 10M_QPSK_1_0 | 23095 | Transversal (Y) | -13.74 | -46.66 | -50.01 | 1.62 | 32.92 | T4 | |
| 40 | LTE Daniel 40 | 40M ODCK 4 0 | | Axial (Z) | -4.38 | -35.71 | -50.11 | | 31.33 | T4 | PASS |
| 12 | LTE Band 13 | 10M_QPSK_1_0 | 23230 | Transversal (Y) | -12.01 | -46.11 | -50.04 | 1.63 | 34.10 | T4 | |
| 40 | 10/1 AND 4011- | 000 445 4845 | 6 | Axial (Z) | -0.74 | -32.89 | -50.20 | 1.61 | 32.15 | T4 | PASS |
| 13 | WLAN2.4GHz | 802.11b 1Mbps | | Transversal (Y) | -8.35 | -43.44 | -50.07 | | 35.09 | T4 | |
| | M// AN/5011 | 000 44 014 | 40 | Axial (Z) | 0.73 | -35.11 | -50.04 | 1.57 | 35.84 | T4 | PASS |
| 14 | 14 WLAN5GHz 802. | 802.11a 6Mbps | | Transversal (Y) | -7.07 | -45.06 | -50.12 | | 37.99 | T4 | |
| 45 | MILANISOLI- | | 60 | Axial (Z) | 0.91 | -34.77 | -50.04 | 1.52 | 35.68 | T4 | - PASS |
| 15 | 5 WLAN5GHz 802.11a 6Mbp | 802.11a 6Mbps | | Transversal (Y) | -6.67 | -45.02 | -50.01 | | 38.35 | T4 | |
| 40 | 16 WLAN5GHz 802 | 000 44 004 | 124 | Axial (Z) | 0.86 | -34.64 | -50.08 | 1.53 | 35.50 | T4 | PASS |
| 16 | | 802.11a 6Mbps | | Transversal (Y) | -6.81 | -45.30 | -50.04 | | 38.49 | T4 | |
| | \A(I A\)=011 | z 802.11a 6Mbps | 157 | Axial (Z) | 0.96 | -34.87 | -50.14 | 1.58 | 35.83 | T4 | PASS |
| 17 | WLAN5GHz | | | Transversal (Y) | -6.80 | -45.43 | -50.08 | | 38.63 | T4 | |

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Nick Yu.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ

Page Number : 16 of 18 Report Issued Date: Apr. 30, 2018

Report No.: HA822218B

Report Version : Rev. 01

9. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA822218B

| Error Description | Uncertainty Value (±%) | Probability Distribution | Divisor | Ci (ABM1) | Ci (ABM2) | Standard Uncertainty (ABM1) | Standard Uncertainty (ABM2) | | |
|---------------------------------------|------------------------------|-----------------------------|---------|--------------|--------------|-----------------------------------|-----------------------------------|--|--|
| Probe Sensitivity | | | | | | | | | |
| Reference Level | 3.0 | Normal | 1 | 1 | 1 | ± 3.0 % | ± 3.0 % | | |
| AMCC Geometry | 0.4 | Rectangular | √3 | 1 | 1 | ± 0.2 % | ± 0.2 % | | |
| AMCC Current | 1.0 | Rectangular | √3 | 1 | 1 | ± 0.6 % | ± 0.6 % | | |
| Probe Positioning During Calibrate | 0.1 | Rectangular | √3 | 1 | 1 | ± 0.1 % | ± 0.1 % | | |
| Noise Contribution | 0.7 | Rectangular | √3 | 0.0143 | 1 | ± 0.0 % | ± 0.4 % | | |
| Frequency Slope | 5.9 | Rectangular | √3 | 0.1 | 1 | ± 0.3 % | ± 3.5 % | | |
| | | Probe Sy | stem | | | | | | |
| Repeatability / Drift | 1.0 | Rectangular | √3 | 1 | 1 | ± 0.6 % | ± 0.6 % | | |
| Linearity / Dynamic Range | 0.6 | Rectangular | √3 | 1 | 1 | ± 0.4 % | ± 0.4 % | | |
| Acoustic Noise | 1.0 | Rectangular | √3 | 0.1 | 1 | ± 0.1 % | ± 0.6 % | | |
| Probe Angle | 2.3 | Rectangular | √3 | 1 | 1 | ± 1.4 % | ± 1.4 % | | |
| Spectral Processing | 0.9 | Rectangular | √3 | 1 | 1 | ± 0.5 % | ± 0.5 % | | |
| Integration Time | 0.6 | Normal | 1 | 1 | 5 | ± 0.6 % | ± 3.0 % | | |
| Field Disturbation | 0.2 | Rectangular | √3 | 1 | 1 | ± 0.1 % | ± 0.1 % | | |
| | | Test Siç | gnal | | | | | | |
| Reference Signal Spectral Response | 0.6 | Rectangular | √3 | 0 | 1 | ± 0.0 % | ± 0.4 % | | |
| | | Position | ning | | | | | | |
| Probe Positioning | 1.9 | Rectangular | √3 | 1 | 1 | ± 1.1 % | ± 1.1 % | | |
| Phantom Thickness | 0.9 | Rectangular | √3 | 1 | 1 | ± 0.5 % | ± 0.5 % | | |
| EUT Positioning | 1.9 | Rectangular | √3 | 1 | 1 | ± 1.1 % | ± 1.1 % | | |
| External Contributions | | | | | | | | | |
| RF Interference | 0.0 | Rectangular | √3 | 1 | 0.3 | ± 0.0 % | ± 0.0 % | | |
| Test Signal Variation | 2.0 | Rectangular | √3 | 1 | 1 | ± 1.2 % | ± 1.2 % | | |
| Combined Standard Uncertainty | | | | | | | ± 6.1 % | | |
| Coverage Factor for 95 % | | | | | | | = 2 | | |
| Expanded Uncertainty | | | | | | | ± 12.3 % | | |

Table 8.2 Uncertainty Budget of audio band magnetic measurement

 SPORTON INTERNATIONAL INC.
 Page Number
 : 17 of 18

 TEL: 886-3-327-3456
 Report Issued Date
 : Apr. 30, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01



10. References

- [1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.
- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: UZ7TC56CJ Page Number : 18 of 18
Report Issued Date : Apr. 30, 2018
Report Version : Rev. 01