



TEL: 886-3-327-3456 Page Number : C93 of C104



TEL: 886-3-327-3456 Page Number : C94 of C104

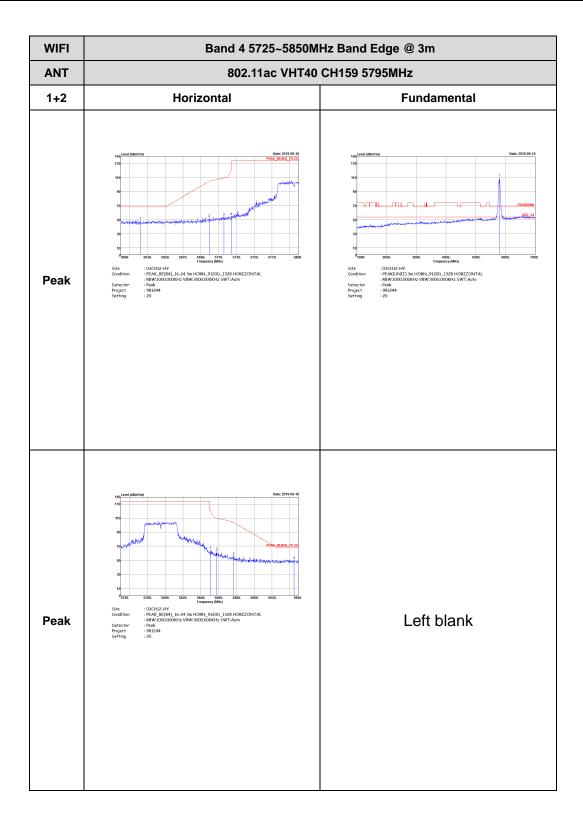


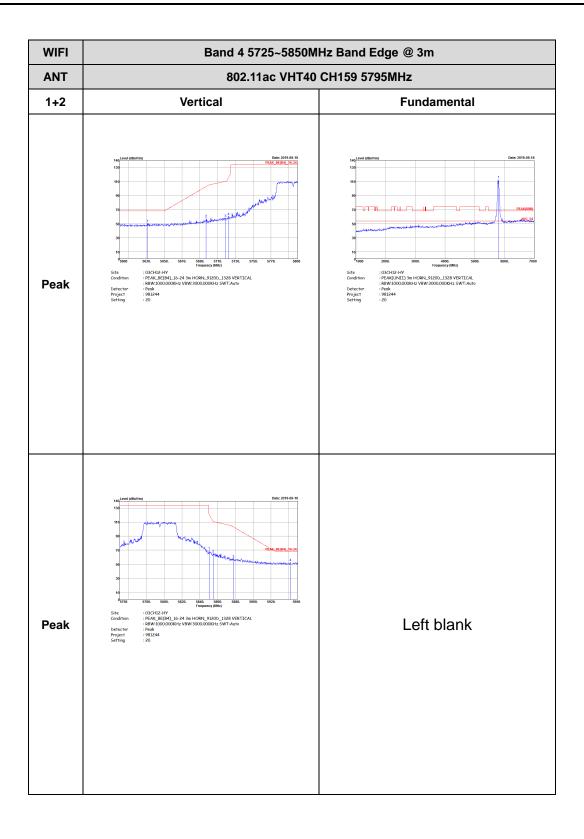

TEL: 886-3-327-3456 Page Number : C95 of C104


# Band 4 5725~5850MHz WIFI 802.11ac VHT80 (Band Edge @ 3m)

Report No.: FR981244F

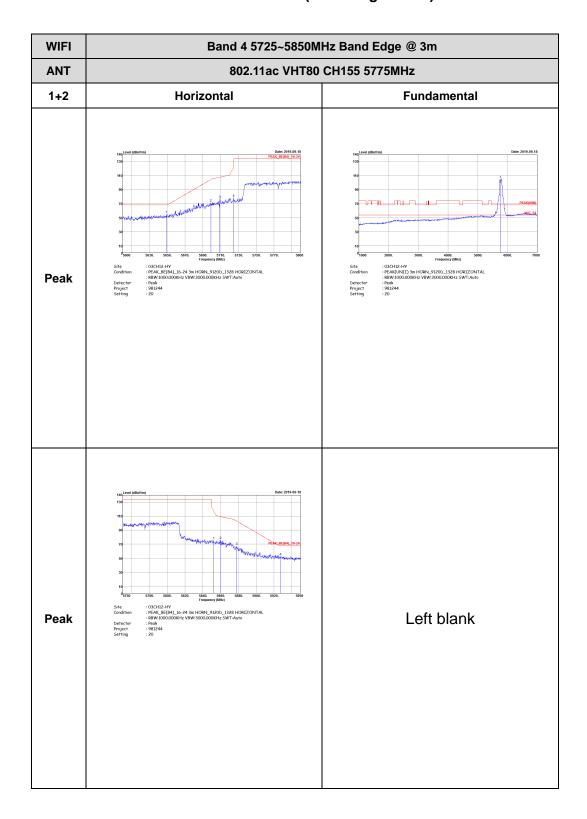

TEL: 886-3-327-3456 Page Number : C96 of C104




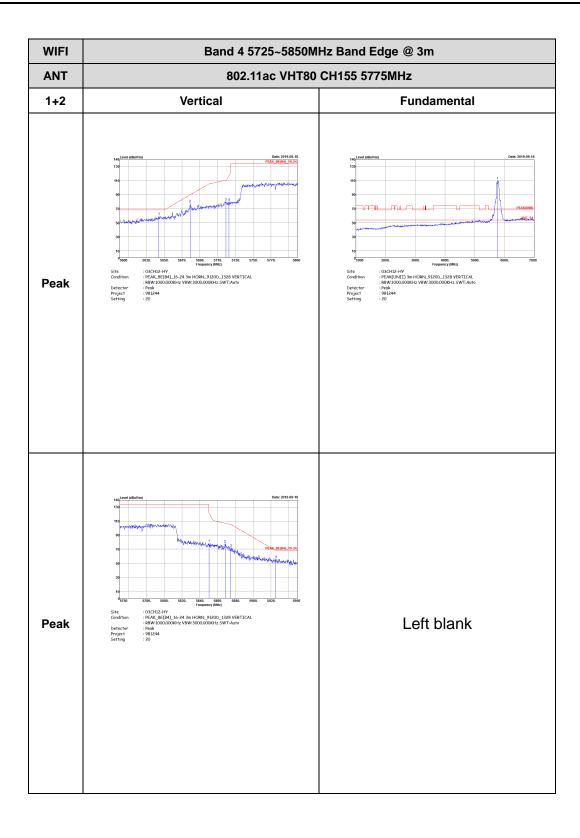


: C97 of C104 TEL: 886-3-327-3456 Page Number

# Band 4 - 5725~5850MHz WIFI 802.11ac VHT20 (Harmonic @ 3m)


Report No.: FR981244F

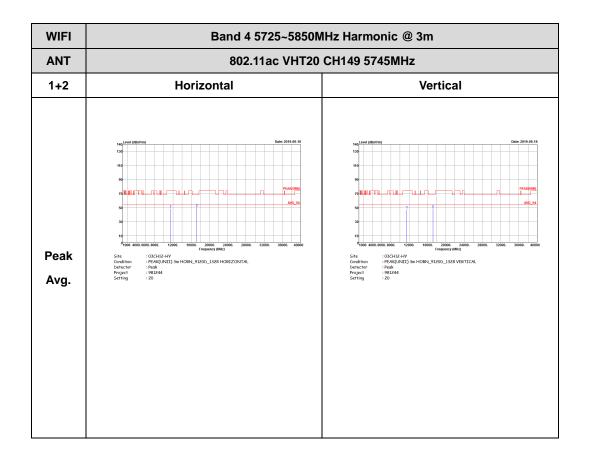

TEL: 886-3-327-3456 Page Number : C98 of C104

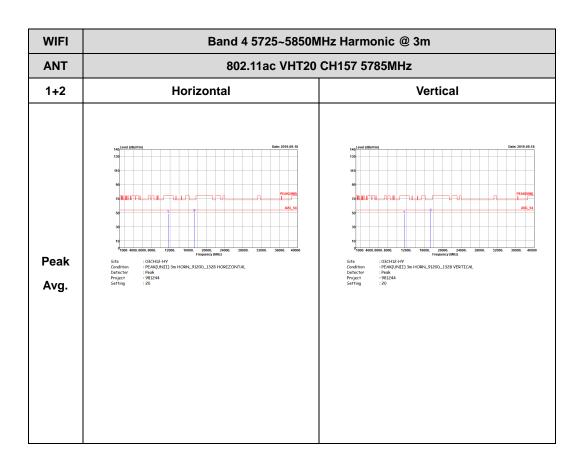


TEL: 886-3-327-3456 Page Number : C99 of C104

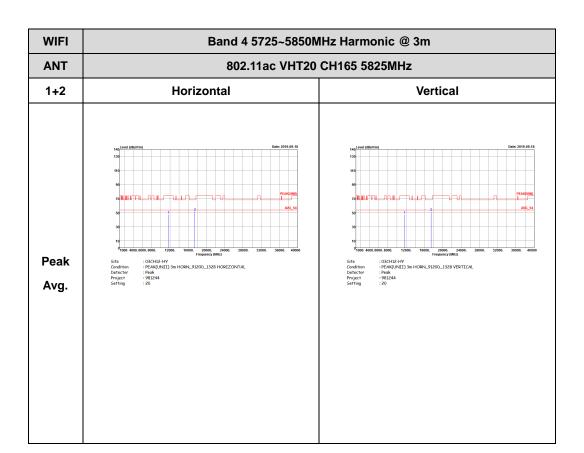


TEL: 886-3-327-3456 Page Number : C100 of C104

# Band 4 5725~5850MHz WIFI 802.11ac VHT40 (Harmonic @ 3m)

Report No.: FR981244F

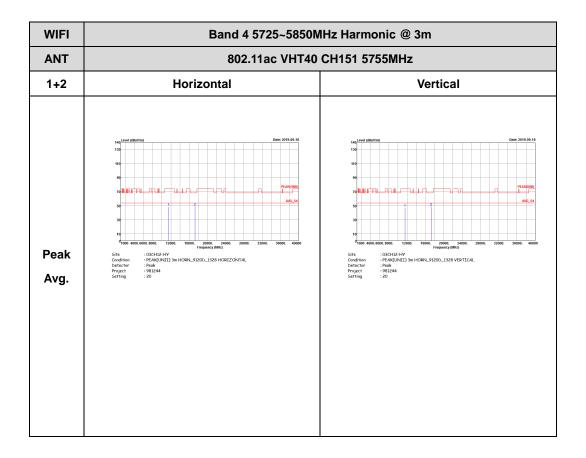


TEL: 886-3-327-3456 Page Number : C101 of C104

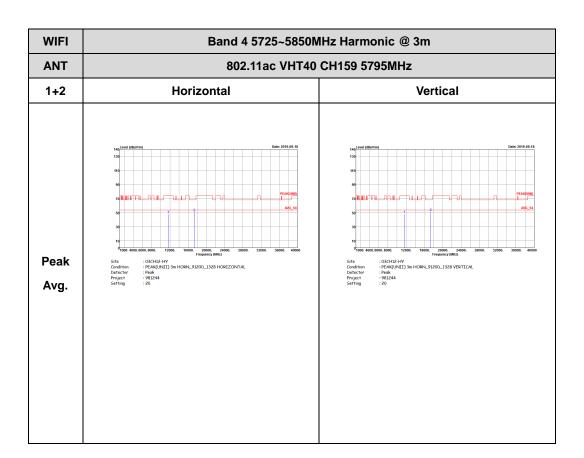

TEL: 886-3-327-3456 Page Number : C102 of C104

# Band 4 5725~5850MHz WIFI 802.11ac VHT80 (Harmonic @ 3m)


Report No.: FR981244F

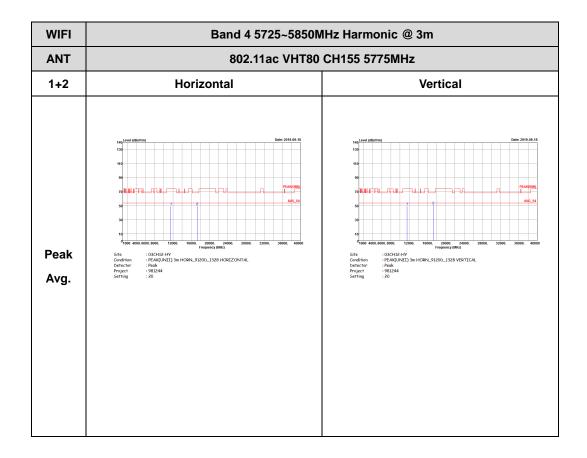

TEL: 886-3-327-3456 Page Number : C103 of C104

# Emission below 1GHz 5GHz WIFI 802.11ac VHT20 (LF)

Report No.: FR981244F

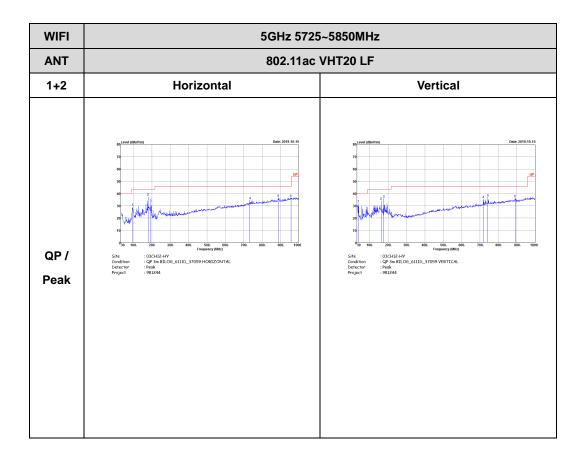

TEL: 886-3-327-3456 Page Number : C104 of C104

# **Appendix D. Duty Cycle Plots**


Antenna	Band	Duty Cycle(%)	T(us)	1/T(kHz)	VBW Setting	Duty Factor(dB)
1	802.11a	95.81	2060	0.49	1kHz	0.19
2	802.11a	95.83	2070	0.48	1kHz	0.18
1+2	802.11a for Ant. 1	96.06	2075	0.48	1kHz	0.17
1+2	802.11a for Ant. 2	95.32	2059	0.49	1kHz	0.21
1	5GHz 802.11n HT20	95.05	1920	0.52	1kHz	0.22
2	5GHz 802.11n HT20	95.54	1930	0.52	1kHz	0.20
1+2	5GHz 802.11n HT20 for Ant. 1	95.56	1935	0.52	1kHz	0.20
1+2	5GHz 802.11n HT20 for Ant. 2	95.76	1919	0.52	1kHz	0.19
1	5GHz 802.11n HT40	92.20	945	1.06	3kHz	0.35
2	5GHz 802.11n HT40	91.79	950	1.05	3kHz	0.37
1+2	5GHz 802.11n HT40 for Ant. 1	91.39	934	1.07	3kHz	0.39
1+2	5GHz 802.11n HT40 for Ant. 2	91.82	943	1.06	3kHz	0.37
1	5GHz 802.11ac VHT20	95.07	1930	0.52	1kHz	0.22
2	5GHz 802.11ac VHT20	95.54	1930	0.52	1kHz	0.20
1+2	5GHz 802.11ac VHT20 for Ant. 1	95.33	1940	0.52	1kHz	0.21
1+2	5GHz 802.11ac VHT20 for Ant. 2	95.02	1929	0.52	1kHz	0.22
1	5GHz 802.11ac VHT40	91.39	955	1.05	3kHz	0.39
2	5GHz 802.11ac VHT40	91.39	955	1.05	3kHz	0.39
1+2	5GHz 802.11ac VHT40 for Ant. 1	92.89	954	1.05	3kHz	0.32
1+2	5GHz 802.11ac VHT40 for Ant. 2	92.31	948	1.05	3kHz	0.35
1	5GHz 802.11ac VHT80	89.09	735	1.36	3kHz	0.50
2	5GHz 802.11ac VHT80	90.18	735	1.36	3kHz	0.45
1+2	5GHz 802.11ac VHT80 for Ant. 1	89.66	728	1.37	3kHz	0.47
1+2	5GHz 802.11ac VHT80 for Ant. 2	90.59	732	1.37	3kHz	0.43

Report No.: FR981244F

TEL: 886-3-327-3456 Page Number : D-1 of D13

#### <Ant. 1>


#### 802.11a

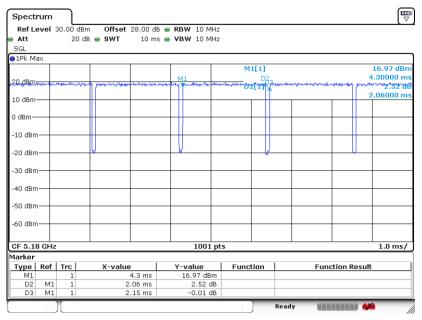

Report No.: FR981244F

Date: 17.SEP.2019 20:08:07

#### 802.11n HT20

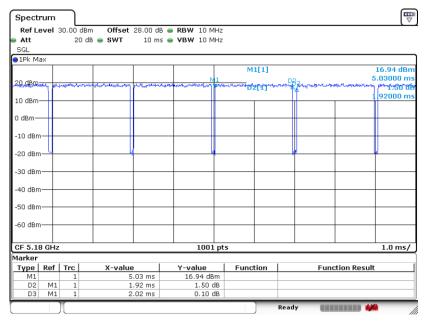


Date: 17.SEP.2019 20:13:11

TEL: 886-3-327-3456 Page Number : D-2 of D13




#### 802.11n HT40

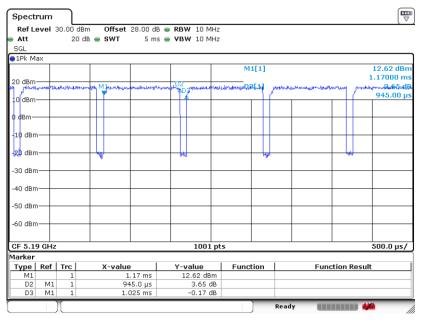

Report No.: FR981244F

Date: 17.SEP.2019 20:16:53

#### 802.11ac VHT20

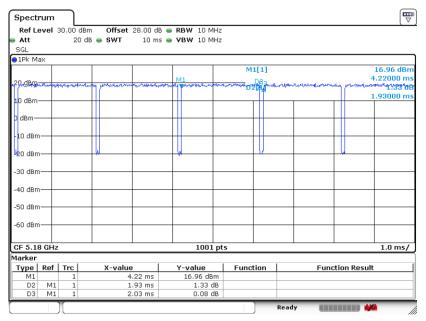


Date: 17.SEP.2019 20:18:40

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D-3 of D13




#### 802.11ac VHT40

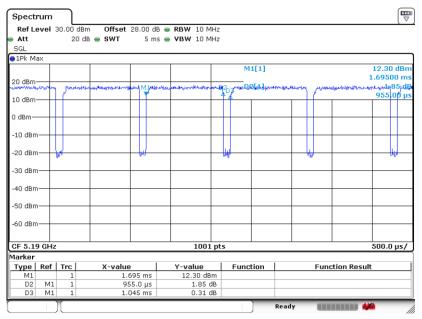

Report No.: FR981244F

Date: 17.SEP.2019 20:19:29

#### 802.11ac VHT80

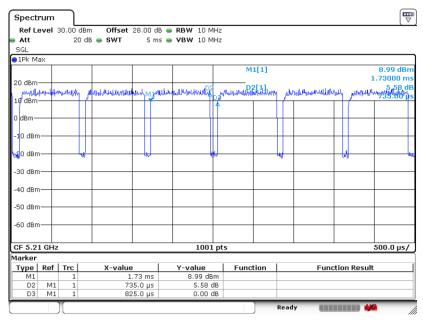


Date: 17.SEP.2019 20:24:56

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D-4 of D13

#### <Ant. 2>


#### 802.11a

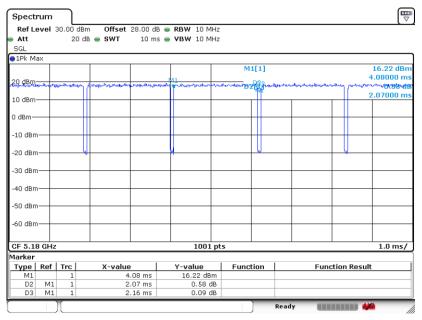

Report No.: FR981244F

Date: 17.SEP.2019 20:08:53

#### 802.11n HT20

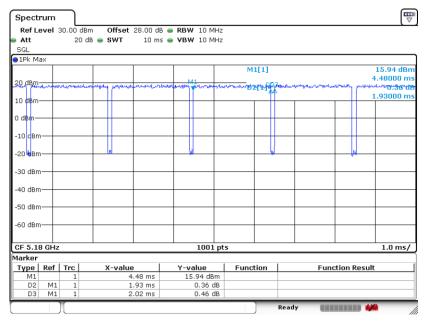


Date: 17.SEP.2019 20:09:40

TEL: 886-3-327-3456 Page Number: D-5 of D13




#### 802.11n HT40

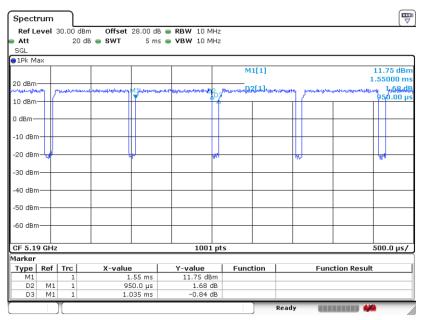

Report No.: FR981244F

Date: 17.SEP.2019 20:17:38

#### 802.11ac VHT20

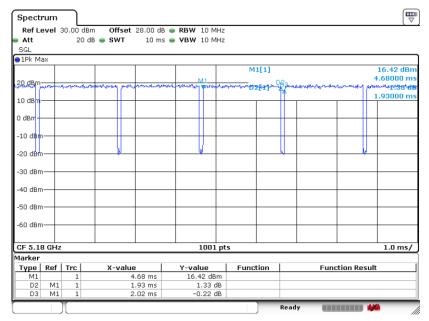


Date: 17.SEP.2019 20:18:13

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D-6 of D13




#### 802.11ac VHT40

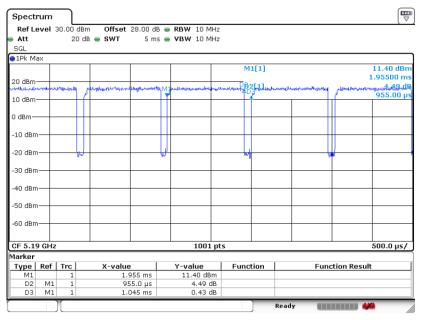

Report No.: FR981244F

Date: 17.SEP.2019 20:20:07

#### 802.11ac VHT80

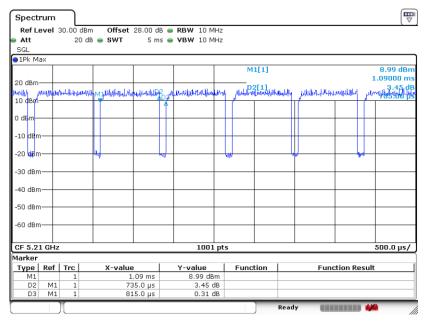


Date: 17.SEP.2019 20:28:46

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D-7 of D13

#### MIMO <Ant. 1>


#### 802.11a

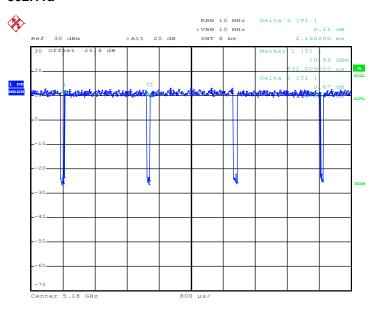

Report No.: FR981244F

Date: 12.AUG.2019 22:56:43


#### 802.11n HT20

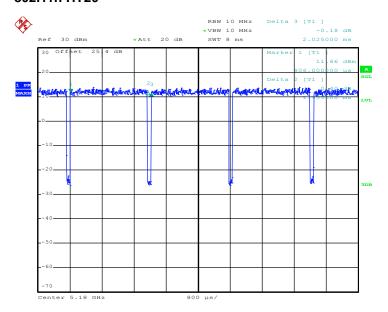

Date: 13.AUG.2019 00:12:26

TEL: 886-3-327-3456 Page Number : D-8 of D13


#### 802.11n HT40

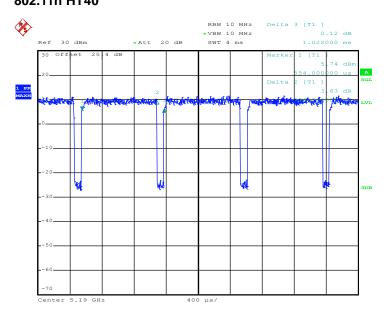

Report No.: FR981244F

Date: 13.AUG.2019 00:31:51

#### 802.11ac VHT20

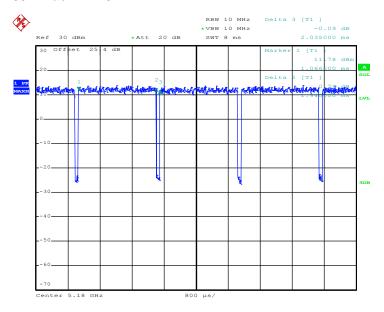


Date: 13.AUG.2019 00:17:20

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D-9 of D13


#### 802.11ac VHT40

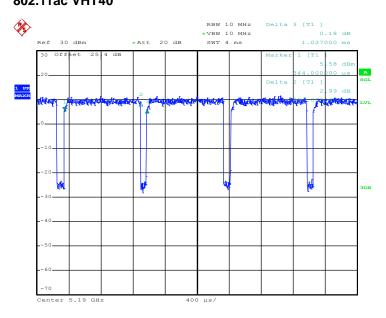

Report No.: FR981244F

Date: 13.AUG.2019 01:22:09

#### 802.11ac VHT80

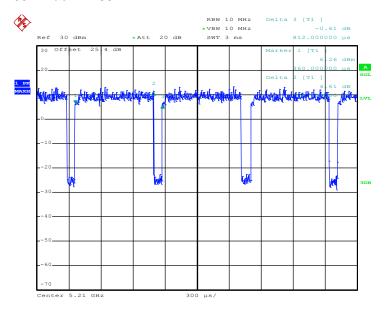


Date: 13.AUG.2019 01:43:02

TEL: 886-3-327-3456 Page Number : D-10 of D13

#### MIMO <Ant. 2>


#### 802.11a

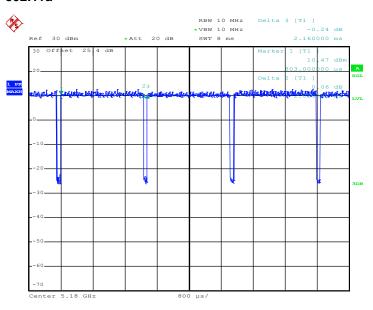

Report No.: FR981244F


Date: 12.AUG.2019 22:59:00

#### 802.11n HT20

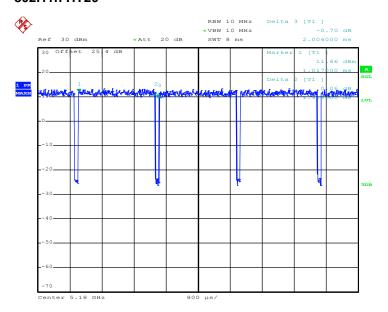


Date: 13.AUG.2019 00:13:26

TEL: 886-3-327-3456 Page Number : D-11 of D13

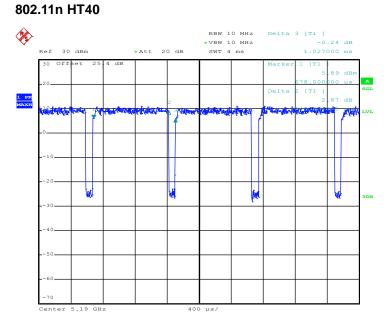

Date: 13.AUG.2019 00:34:08


#### 802.11ac VHT20

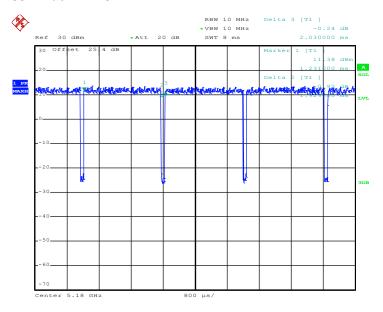

Date: 13.AUG.2019 00:18:46

: D-12 of D13 TEL: 886-3-327-3456 Page Number


#### 802.11ac VHT40

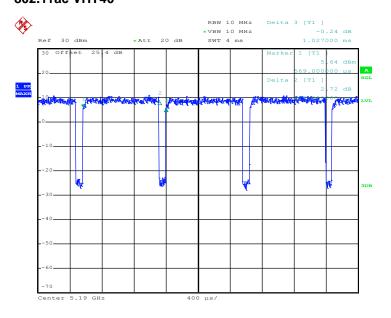

Report No.: FR981244F

Date: 13.AUG.2019 01:25:21

#### 802.11ac VHT80

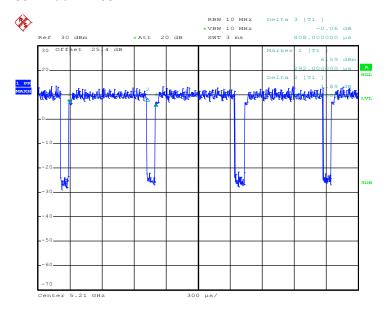

Date: 13.AUG.2019 01:47:00

TEL: 886-3-327-3456 Page Number : D-13 of D13