
# Band 4 5725~5850MHz WIFI 802.11ac VHT80 (Harmonic @ 3m)


Report No.: FR882724F

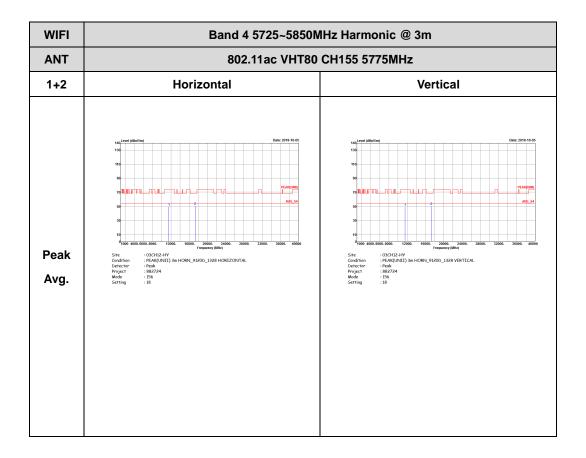

TEL: 886-3-327-3456 Page Number : C99 of C100

# Emission below 1GHz 5GHz WIFI 802.11ac VHT40 (LF)

Report No.: FR882724F

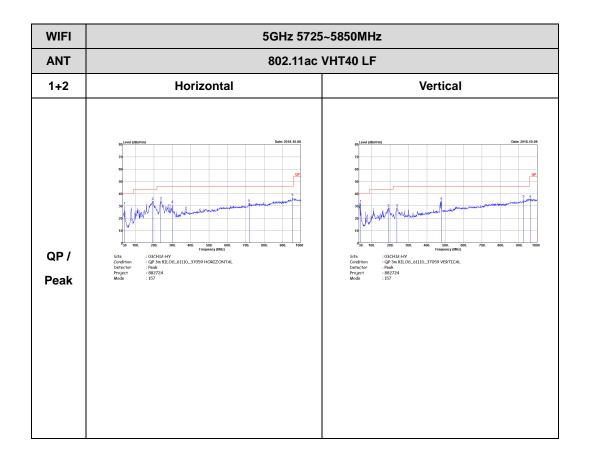

TEL: 886-3-327-3456 Page Number : C100 of C100





# Appendix D. Duty Cycle Plots


Antenna	Band	Duty Cycle(%)	T(us)	1/T(kHz)	VBW Setting	Duty Factor(dB)
1	802.11a	94.86	2030.00	0.49	1kHz	0.23
2	802.11a	94.86	2030.00	0.49	1kHz	0.23
1+2	802.11a for Ant. 1	95.31	2030.00	0.49	1kHz	0.21
1+2	802.11a for Ant. 2	95.31	2030.00	0.49	1kHz	0.21
1	5GHz 802.11n HT20	94.97	1890.00	0.53	1kHz	0.22
2	5GHz 802.11n HT20	94.47	1880.00	0.53	1kHz	0.25
1+2	5GHz 802.11n HT20 for Ant. 1	94.95	1880.00	0.53	1kHz	0.23
1+2	5GHz 802.11n HT20 for Ant. 2	94.47	1880.00	0.53	1kHz	0.25
1	5GHz 802.11n HT40	90.69	925.00	1.08	3kHz	0.42
2	5GHz 802.11n HT40	90.69	925.00	1.08	3kHz	0.42
1+2	5GHz 802.11n HT40 for Ant. 1	91.18	930.00	1.08	3kHz	0.40
1+2	5GHz 802.11n HT40 for Ant. 2	88.94	925.00	1.08	3kHz	0.51
1	5GHz 802.11ac VHT20	94.42	1896.00	0.53	1kHz	0.25
2	5GHz 802.11ac VHT20	94.82	1904.00	0.53	1kHz	0.23
1+2	5GHz 802.11ac VHT20 for Ant. 1	94.05	1896.00	0.53	1kHz	0.27
1+2	5GHz 802.11ac VHT20 for Ant. 2	94.42	1896.00	0.53	1kHz	0.25
1	5GHz 802.11ac VHT40	90.69	936.00	1.07	3kHz	0.42
2	5GHz 802.11ac VHT40	90.15	952.00	1.05	3kHz	0.45
1+2	5GHz 802.11ac VHT40 for Ant. 1	89.14	952.00	1.05	3kHz	0.50
1+2	5GHz 802.11ac VHT40 for Ant. 2	90.15	952.00	1.05	3kHz	0.45
1	5GHz 802.11ac VHT80	86.88	596.00	1.68	3kHz	0.61
2	5GHz 802.11ac VHT80	86.13	596.00	1.68	3kHz	0.65
1+2	5GHz 802.11ac VHT80 for Ant. 1	86.67	598.00	1.67	3kHz	0.62
1+2	5GHz 802.11ac VHT80 for Ant. 2	86.63	596.00	1.68	3kHz	0.62

Report No.: FR882724F

TEL: 886-3-327-3456 Page Number : D1 of D13


<Ant. 1>

#### 802.11a

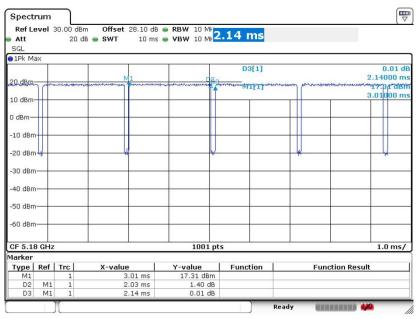

Date: 31.AUG.2018 20:53:01

# 802.11n HT20

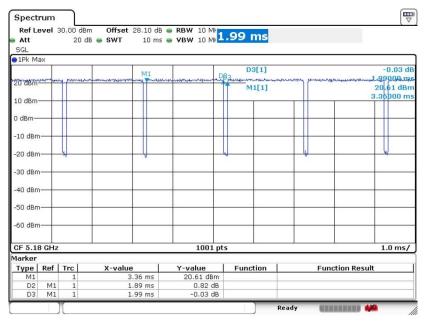


Date: 31.AUG.2018 21:20:55

TEL: 886-3-327-3456 Page Number : D2 of D13

# FCC RADIO TEST REPORT


# Report No.: FR882724F

#### 802.11n HT40

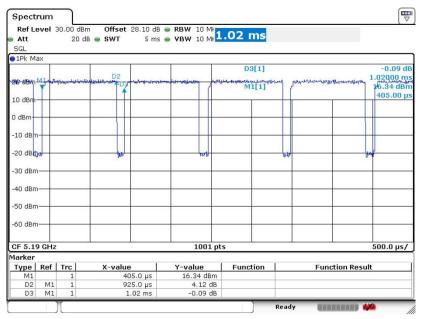

Date: 31.AUG.2018 21:31:23


#### 802.11ac VHT20

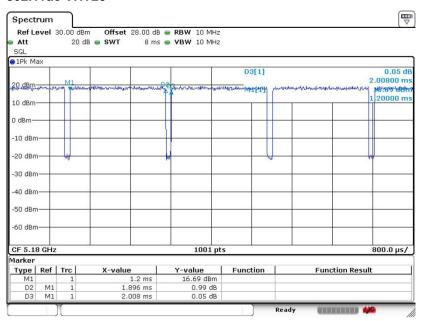

Date: 18.SEP.2018 07:13:45


TEL: 886-3-327-3456 Page Number : D3 of D13

# 802.11ac VHT40

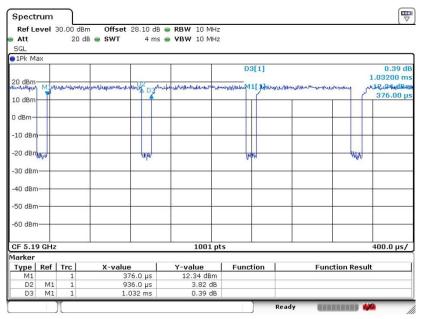

Date: 12.SEP.2018 01:37:11

#### 802.11ac VHT80

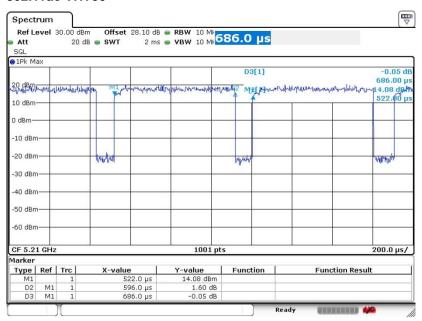


Date: 31.AUG.2018 21:45:45

TEL: 886-3-327-3456 Page Number : D4 of D13

Report No.: FR882724F


<Ant. 2>

#### 802.11a

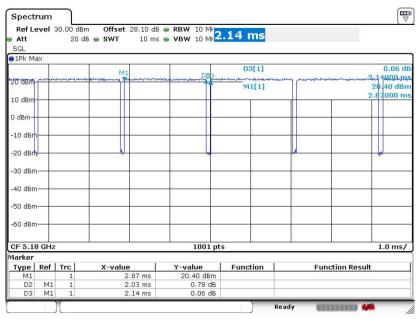

Date: 31.AUG.2018 21:13:24


# 802.11n HT20

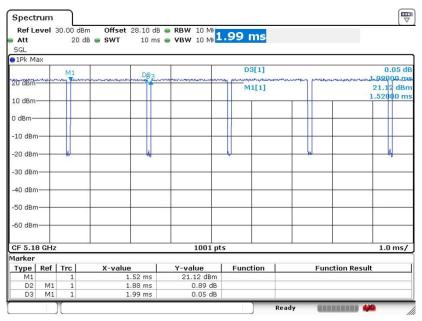

Date: 31.AUG.2018 21:23:30


TEL: 886-3-327-3456 Page Number : D5 of D13

#### 802.11n HT40

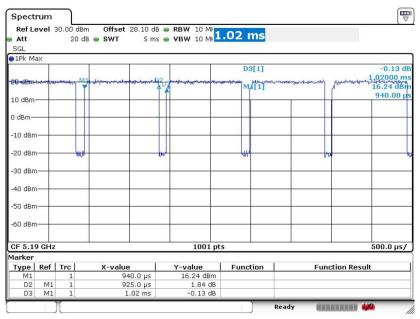

Date: 31.AUG.2018 21:35:15


#### 802.11ac VHT20

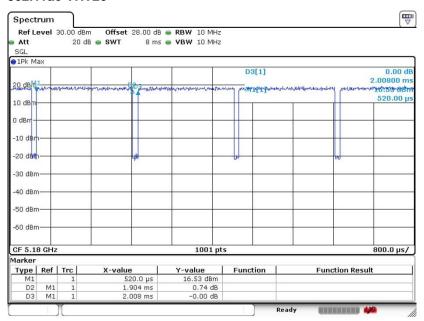

Date: 18.SEP.2018 07:35:14


TEL: 886-3-327-3456 Page Number : D6 of D13

# 802.11ac VHT40

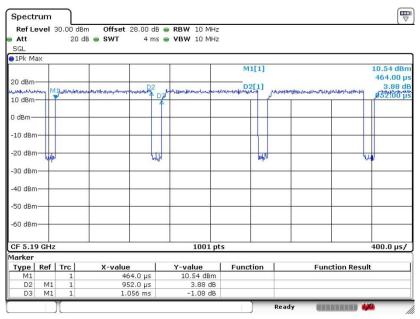

Date: 20.SEP.2018 00:22:46

#### 802.11ac VHT80

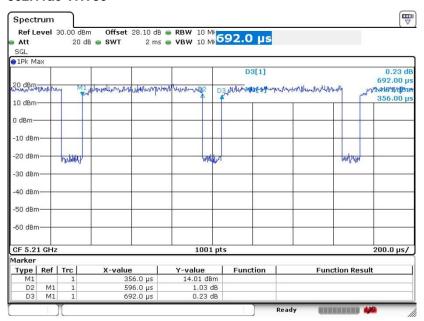


Date: 31.AUG.2018 21:48:44

TEL: 886-3-327-3456 Page Number : D7 of D13


# MIMO <Ant. 1>

#### 802.11a

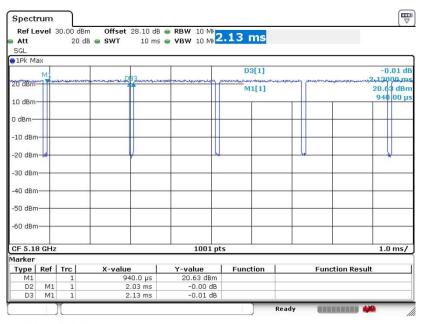

Date: 31.AUG.2018 21:16:36


# 802.11n HT20

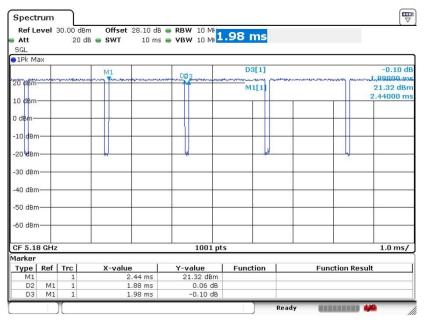

Date: 31.AUG.2018 21:25:41


TEL: 886-3-327-3456 Page Number : D8 of D13

#### 802.11n HT40

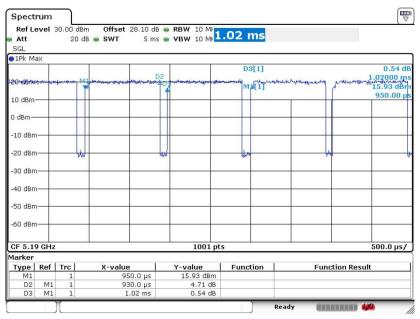

Date: 31.AUG.2018 21:39:51


#### 802.11ac VHT20

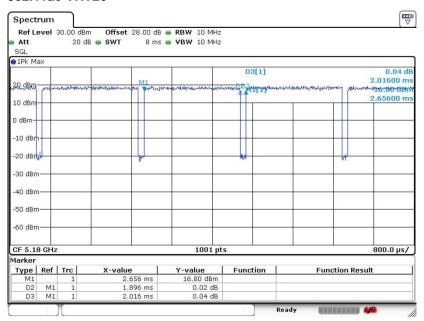

Date: 18.SEP.2018 07:44:44


TEL: 886-3-327-3456 Page Number : D9 of D13

# 802.11ac VHT40

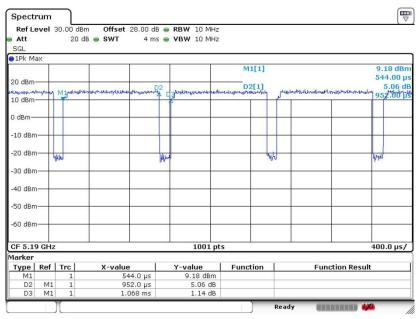

Date: 20.SEP.2018 00:35:28

#### 802.11ac VHT80

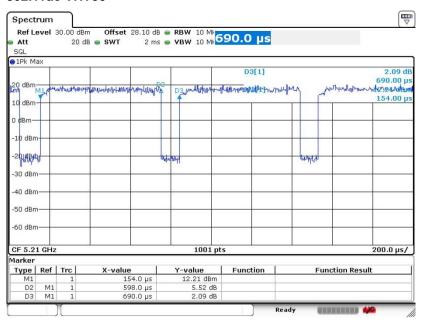


Date: 31.AUG.2018 21:51:24

FAX: 886-3-328-4978

TEL: 886-3-327-3456 Page Number : D10 of D13


# MIMO <Ant. 2>

#### 802.11a

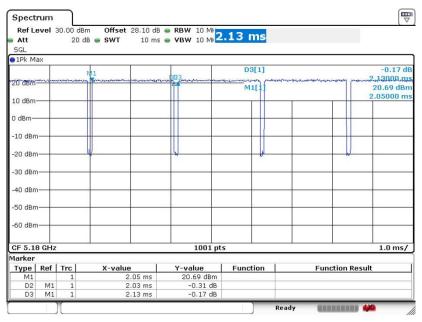

Date: 31.AUG.2018 21:17:14

# 802.11n HT20

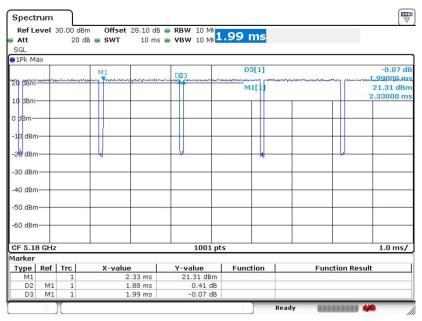


Date: 31.AUG.2018 21:26:46

FAX: 886-3-328-4978


TEL: 886-3-327-3456 Page Number : D11 of D13

#### 802.11n HT40

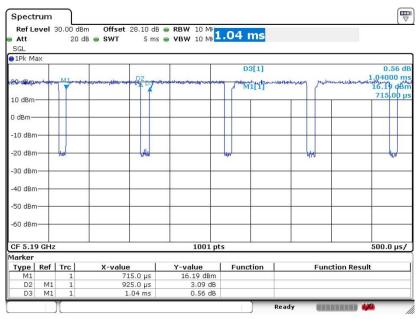

Date: 31.AUG.2018 21:39:02


#### 802.11ac VHT20

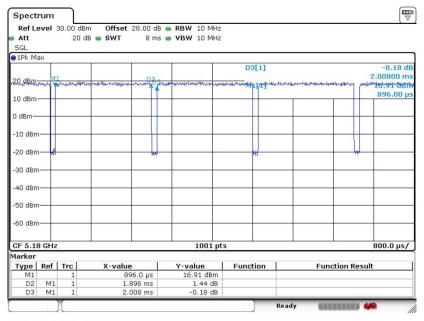

Date: 18.SEP.2018 07:45:40


TEL: 886-3-327-3456 Page Number : D12 of D13

# 802.11ac VHT40

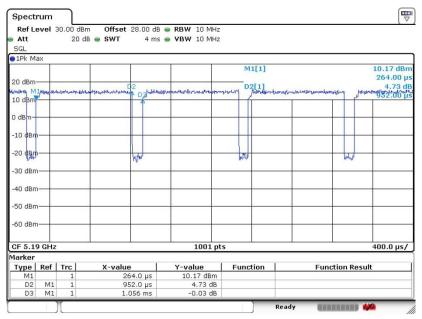

Date: 20.SEP.2018 00:36:15

#### 802.11ac VHT80

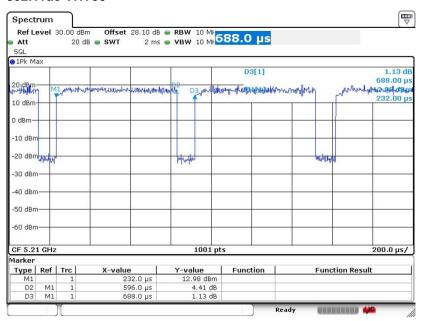

Date: 31.AUG.2018 21:50:48

TEL: 886-3-327-3456 Page Number : D13 of D13