## **Radiated Spurious Emission**

## LTE Band 2

LTE Band 2 / 1.4MHz / QPSK										
Channel	Frequency ( MHz )	EIRP ( dBm )	Limit ( dBm )	Over Limit ( dB )	SPA Reading (dBm)	S.G. Power ( dBm )	TX Cable loss ( dB )	TX Antenna Gain (dBi)	Polarization (H/V)	
	3702	-30.88	-13	-17.88	-26.51	-37.45	1.67	8.24	Н	
	5556	-45.34	-13	-32.34	-47.8	-52.41	2.66	9.72	Н	
	7404	-49.66	-13	-36.66	-53.72	-58.81	2.46	11.61	Н	
	9252	-45.96	-13	-32.96	-52.4	-56.02	2.54	12.60	Н	
	12958.5	-55.08	-13	-42.08	-67.85	-65.11	2.92	12.95	Н	
Laurant	14806.5	-43.98	-13	-30.98	-56.87	-53.83	3.52	13.37	Н	
Lowest	3702	-32.26	-13	-19.26	-27.73	-38.83	1.67	8.24	V	
	5556	-47.36	-13	-34.36	-49.78	-54.43	2.66	9.72	V	
	7404	-51.88	-13	-38.88	-56.07	-61.03	2.46	11.61	V	
	9252	-50.28	-13	-37.28	-57.08	-60.34	2.54	12.60	V	
	12958.5	-54.98	-13	-41.98	-67.32	-65.01	2.92	12.95	V	
	14806.5	-44.22	-13	-31.22	-57.08	-54.07	3.52	13.37	V	
	3762	-29.42	-13	-16.42	-24.9	-36.05	1.69	8.31	Н	
	5640	-45.02	-13	-32.02	-47.84	-52.07	2.71	9.76	Н	
	7524	-47.49	-13	-34.49	-51.47	-56.88	2.42	11.81	Н	
	9399	-55.26	-13	-42.26	-61.77	-65.23	2.57	12.54	Н	
	13168.5	-55.68	-13	-42.68	-68.28	-65.94	2.97	13.24	Н	
N 42 1 11	15048	-47.65	-13	-34.65	-60.51	-57.7	3.62	13.67	Н	
Middle	3762	-31.77	-13	-18.77	-27.34	-38.4	1.69	8.31	V	
	5640	-49.68	-13	-36.68	-52.55	-56.73	2.71	9.76	V	
	7524	-50.29	-13	-37.29	-54.51	-59.68	2.42	11.81	V	
	9399	-53.68	-13	-40.68	-60.68	-63.65	2.57	12.54	V	
	13168.5	-54.22	-13	-41.22	-66.58	-64.48	2.97	13.24	V	
	15048	-48.29	-13	-35.29	-61.27	-58.34	3.62	13.67	V	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B1 of B24



	3822	-24.08	-13	-11.08	-19.49	-30.76	1.71	8.39	Н
	5730	-47.29	-13	-34.29	-50.6	-54.32	2.76	9.79	Н
	7638	-46.76	-13	-33.76	-51.09	-56.26	2.38	11.88	Н
	9546	-52.33	-13	-39.33	-59.14	-62.2	2.60	12.47	Н
	13368	-56.48	-13	-43.48	-68.92	-66.97	3.02	13.52	Н
18.1	15279	-45.11	-13	-32.11	-58.91	-55.39	3.71	13.99	Н
Highest	3822	-25.05	-13	-12.05	-21.52	-31.73	1.71	8.39	V
	5730	-49.09	-13	-36.09	-52.35	-56.12	2.76	9.79	V
	7638	-48.08	-13	-35.08	-52.69	-57.58	2.38	11.88	V
	9546	-48.62	-13	-35.62	-55.77	-58.49	2.60	12.47	V
	13368	-56.28	-13	-43.28	-68.73	-66.77	3.02	13.52	V
	15279	-44.78	-13	-31.78	-58.66	-55.06	3.71	13.99	V

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B2 of B24



LTE Band 2 / 3MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3708 -29.46 -13 -16.46 -25.11 -36.04 1.67 8.25 Н 5556 -45.38 -13 -32.38 -47.9 -52.45 2.66 9.72 Н 7410 -49.96 -13 -36.96 -53.87 -59.12 2.46 11.62 Н 9262.5 -46.27-13 -33.27 -52.67 -56.33 2.54 12.60 Н 11121 -53.88 -13 -40.88 -64.9 -63.65 2.69 12.45 Н 2.92 12969 -56.82 -13 -43.82 -69.68 -66.86 12.96 Н Н Lowest ٧ 3708 -31.51 -13 -18.51 -27.1 -38.09 1.67 8.25 ٧ 5556 -46.44 -13 -33.44 -48.91 -53.51 2.66 9.72 7410 V -52.28 -13 -39.28 -56.33 -61.44 2.46 11.62 -55.93 ٧ 9262.5 -49.16 -13 -36.16 -59.22 2.54 12.60 11121 -57.83 -13 -44.83 -68.66 -67.6 2.69 12.45 ٧ 12969 -55.81 -13 -42.81 -68.17 -65.85 2.92 12.96 V V -15.14 -23.62 -34.77 3762 -28.14 -13 1.69 8.31 Н 5646 -45.54 -13 -32.54 -48.43 -52.59 2.71 9.76 Н 7524 -53.96 Н -49.94 -13 -36.94-59.33 2.42 11.81 9409.5 -56.32 -13 -43.32 -62.98 -66.29 2.57 12.54 Н 13168.5 -54.79 -13 -41.79 -67.45 -65.05 2.97 Н 13.24 15048 -46.74 -13 -33.74 -59.54 -56.79 3.62 13.67 Н Н Middle ٧ 3762 -30.87 -13 -17.87 -26.43 -37.5 1.69 8.31 -52.79 ٧ 5646 -49.95 -13 -36.95 -57 2.71 9.76 7524 -52.42 -13 -39.42 -56.71 -61.81 2.42 ٧ 11.81 9409.5 -55.27 -13 -42.27 -62.27 -65.24 2.57 12.54 ٧ 13168.5 -54.11 -13 -41.11 -66.55 -64.37 2.97 13.24 ٧ 15048 -45.96 -13 -32.96 -59.03 -56.01 3.62 13.67 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978




3822 -24.26 -13 -11.26 -19.58 -30.94 1.71 8.39 Н 5730 -47.66 -13 -34.66 -50.99 -54.69 2.76 9.79 Н 7638 -46.84 -13 -33.84 -51.24 -56.34 2.38 11.88 Н 9546 -52.27 -13 -39.27 -59.18 -62.14 2.60 12.47 Η 13368 -57.68 -13 -44.68 -70.15 -68.17 3.02 13.52 Н 15279 -44.76 -13 -31.76 -58.59 -55.04 3.71 13.99 Н Н Highest ٧ 3822 -25.59 -13 -12.59 -21.14 -32.27 1.71 8.39 5730 -49.47 -13 -52.77 2.76 9.79 ٧ -36.47 -56.5 -54.13 ٧ 7638 -49.37 -13 -36.37 -58.87 2.38 11.88 9546 -50.77 -13 -37.77 -57.93 -60.64 2.60 12.47 ٧ 13368 -56.31 -13 -43.31 -68.63 -66.8 3.02 13.52 ٧ ٧ 15279 -44.17 -13 -31.17 -58 -54.45 3.71 13.99 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B4 of B24

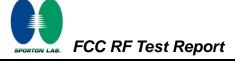

LTE Band 2 / 5MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Gain Limit Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3708 -30.11 -13 -17.11 -25.66 -36.69 1.67 8.25 Н 5562 -46.25 -13 -33.25 -48.82 -53.31 2.66 9.72 Н 7422 -50.63 -13 -37.63 -54.6 -59.82 2.45 11.64 Н 9273 -45.51 -13 -32.51 -52.02 -55.56 2.54 12.59 Н 11131.5 -51.37 -13 -38.37 -62.52 -61.13 2.69 12.45 Н 2.92 12979.5 -56.15 -13 -43.15 -69.06 -66.2 12.97 Н Н Lowest ٧ 3705 -31.47 -13 -18.47 -27.16 -38.05 1.67 8.25 ٧ 5557.5 -48.22 -13 -35.22 -50.53 -55.28 2.66 9.72 -57.52 -40.32 V 7410 -53.32 -13 -62.48 2.46 11.62 -57.23 ٧ 9262.5 -50.27 -13 -37.27 -60.33 2.54 12.60 11115 -57.92 -13 -44.92 -68.86 -67.69 2.69 12.45 ٧ 12967.5 -57.45 -13 -44.45 -70 -67.49 2.92 12.96 V V -19.97 -32.97 3762 -13 -28.2 -39.6 1.69 8.31 Н 5646 -53.45 -13 -40.45 -56.57 -60.5 2.71 9.76 Н 7530 -54.80 -58.59 Н -13 -41.80 -64.2 2.42 11.82 9409 -55.33 -13 -42.33 -61.79 2.57 12.54 Н -65.3 -66.1 13179 -55.82 -13 -42.82 -68.86 2.98 Н 13.25 15058 -44.14 -13 -31.14 -56.96 -54.2 3.62 13.68 Н Н Middle ٧ 3762 -32.97 -13 -19.97 -28.04 -39.6 1.69 8.31 ٧ 5646 -53.65 -13 -40.65 -56.52 -60.7 2.71 9.76 7530 -54.60 -13 -41.60 -58.55 2.42 11.82 ٧ -64 9409.5 -55.13 -13 -42.13 -62.09 -65.1 2.57 12.54 ٧ 13179 -55.92 -13 -42.92 -68.24 -66.2 2.98 13.25 ٧ 15058.5 -44.04 -13 -31.04 -57.19 -54.1 3.62 13.68 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978




3822 -25.55 -13 -12.55 -21 -32.23 1.71 8.39 Н 5730 -49.37 -13 -36.37 -52.63 -56.4 2.76 9.79 Н 7638 -47.75 -13 -34.75 -52.3 -57.25 2.38 11.88 Н 9546 -54.05 -13 -41.05 -60.91 -63.92 2.60 12.47 Η 13368 -58.65 -13 -45.65 -71.22 -69.14 3.02 13.52 Н 15279 -45.05 -13 -32.05 -58.86 -55.33 3.71 13.99 Н Н Highest ٧ 3822 -27.32 -13 -14.32 -22.86 -34 1.71 8.39 5730 -51.88 -13 -55.26 -58.91 2.76 9.79 ٧ -38.88 -54.36 ٧ 7638 -49.74 -13 -36.74 -59.24 2.38 11.88 9546 -54.32 -13 -41.32 -61.52 -64.19 2.60 12.47 ٧ 13370 -58.74 -13 -45.74 -71.17 -69.23 3.02 13.52 ٧ ٧ 15279 -45.47 -13 -32.47 -59.32 -55.75 3.71 13.99 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

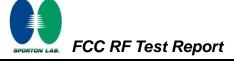

LTE Band 2 / 10MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3708 -29.52 -13 -16.52 -25.26 -36.1 1.67 8.25 Н 5568 -46.34 -13 -33.34 -49.21 -53.4 2.66 9.73 Н 7422 -49.91 -13 -36.91 -54.08 -59.1 2.45 11.64 Н 9273 -45.55 -13 -32.55 -52.3 -55.6 2.54 12.59 Н 11131.5 -53.34 -13 -40.34 -64.6 -63.12.69 12.45 Н -55.94 2.93 12990 -13 -42.94 -69.02 -66 12.99 Н Н Lowest ٧ 3708 -31.02 -13 -18.02 -26.75 -37.6 1.67 8.25 ٧ 5568 -47.74 -13 -34.74 -50.56 -54.8 2.66 9.73 -57.49 V 7422 -53.01 -13 -40.01 2.45 11.64 -62.2 ٧ 9273 -48.45 -13 -35.45 -55.6 -58.5 2.54 12.59 11131.5 -57.34 -13 -44.34 -68.53 -67.1 2.69 12.45 ٧ 12990 -56.74 -13 -43.74 -69.47 -66.8 2.93 12.99 V V -28.06 3762 -32.27 -13 -19.27-38.9 1.69 8.31 Н 5640 -47.85 -13 -34.85 -50.96 -54.9 2.71 9.76 Н -37.21 -54.45 Н 7518 -50.21 -13 -59.6 2.42 11.81 9399 -55.13 -13 -42.13 -62.02 2.57 12.54 Н -65.1 11278.5 -57.20 -13 -44.20 -69.1 -66.9 2.68 12.39 Н 13158 -55.95 -13 -42.95 -68.94 -66.2 2.97 13.22 Н Н Middle ٧ 3762 -34.27 -13 -21.27 -30.08 -40.9 1.69 8.31 ٧ 5640 -52.75 -13 -39.75 -55.9 -59.8 2.71 9.76 7518 -50.51 -13 -37.51 -54.9 2.42 ٧ -59.9 11.81 9399 -53.33 -13 -40.33 -60.62 -63.3 2.57 12.54 ٧ 13158 -57.55 -13 -44.55 -70.29 -67.8 2.97 13.22 ٧ 15037.5 -48.26 -13 -35.26 -61.61 -58.3 3.61 13.65 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B7 of B24



3810 -28.53 -13 -15.53 -24.26 -35.2 1.70 8.37 Н 5718 -49.76 -13 -36.76 -53.35 -56.8 2.75 9.79 Н 7620 -47.52 -13 -34.52 -52.11 -57 2.39 11.87 Н 9525 -50.71 -13 -37.71 -57.73 -60.6 2.60 12.49 Η 11436 -58.26 -13 -45.26 -70.65 -67.9 2.68 12.33 Н 13336.5 -56.44 -13 -43.44 -69.19 -66.9 3.01 13.47 Н Н Highest ٧ 3810 -27.83 -13 -14.83 -23.6 -34.5 1.70 8.37 5718 -49.66 -13 -53.26 -56.7 2.75 9.79 ٧ -36.66 ٧ 7620 -48.82 -13 -35.82 -53.67 -58.3 2.39 11.87 9525 -50.01 -13 -37.01 -57.42 -59.9 2.60 12.49 ٧ 11436 -58.16 -13 -45.16 -70.52 -67.8 2.68 12.33 ٧ ٧ 13336.5 -58.14 -13 -45.14 -68.94 -68.6 3.01 13.47 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978



LTE Band 2 / 15MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3714 -30.89 -13 -17.89 -26.48 -37.48 1.67 8.26 Н 5574 -45.88 -13 -32.88 -48.41 -52.94 2.67 9.73 Н 7428 -51.63 -13 -38.63 -55.48 -60.83 2.45 11.66 Н 9283.5 -45.57 -13 -32.57 -52 -55.61 2.54 12.59 Н 11142 -49.87 -13 -36.87 -60.96 -59.63 2.69 12.44 Н 2.93 13000.5 -56.23 -13 -43.23-68.94-66.3 13.00 Н Н Lowest 3714 -32.96-13 -19.96 -28.53 -39.55 1.67 8.26 ٧ ٧ 5574 -47.43 -13 -34.43 -49.95 -54.49 2.67 9.73 V 7428 -54.46 -13 -41.46 -58.57 2.45 -63.66 11.66 ٧ 9283.5 -48.71 -13 -35.71 -55.53 -58.75 2.54 12.59 11142 -53.59 -13 -40.59 -64.47 -63.35 2.69 12.44 ٧ 13000.5 -57.31 -13 -44.31 -69.6 -67.38 2.93 13.00 V V -35.07 -15.44 3762 -28.44 -13 -24.01 1.69 8.31 Н 5640 -44.67 -13 -31.67 -47.59 -51.72 2.71 9.76 Н -50.84 Η 7518 -46.83 -13 -33.83 -56.222.42 11.81 9399 -51.61 -13 -38.61 -58.26 -61.58 2.57 12.54 Н 13158 -13 -43.38 -69.02 -66.63 2.97 13.22 Н -56.38 15037.5 -49.28 -13 -36.28 -62.07 -59.32 3.61 13.65 Н Н Middle ٧ 3762 -30.81 -13 -17.81 -26.32 -37.44 1.69 8.31 -49.64 ٧ 5640 -13 -36.64 -52.47 -56.69 2.71 9.76 7518 -50.28 -13 -37.28 -54.37 -59.67 ٧ 2.42 11.81 9399 -54.59 -13 -41.59 -61.58 -64.56 2.57 12.54 ٧ 13158 -57.33 -13 -44.33 -69.75 -67.58 2.97 13.22 ٧ 15037.5 -46.87 -13 -33.87 -59.87 -56.91 3.61 13.65 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B9 of B24



3804 -32.96 -13 -19.96 -28.44 -39.63 1.70 8.36 Н 5706 -54.28 -13 -41.28 -57.42 -61.32 2.74 9.78 Н 7608 -46.97 -13 -33.97 -51.26 -56.44 2.39 11.86 Н 9514.5 -49.62 -13 -56.37 -59.52 2.59 -36.62 12.49 Η 11415 -54.36 -13 -41.36 -66.35 -64.01 2.68 12.33 Н 15216 -45.17 -13 -32.17 -58.69 -55.38 3.69 13.90 Н Н Highest 3804 -32.96 -13 -19.96 -28.48 -39.63 1.70 8.36 V 5706 -53.98 -13 -57.19 -61.02 2.74 9.78 ٧ -40.98 7608 -45.99 ٧ -13 -32.99 -50.52 -55.46 2.39 11.86 9514.5 -50.39 -13 -37.39 -57.47 -60.29 2.59 12.49 ٧ 11415 -55.28 -13 -42.28 -67.3 -64.93 2.68 12.33 ٧ 15216 -44.98 -13 -31.98 -58.6 -55.19 3.69 13.90 ٧ ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B10 of B24



LTE Band 2 / 20MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3720 -31.33 -13 -18.33 -26.87 -37.92 1.67 8.26 Н 5580 -46.85 -13 -33.85 -49.38 -53.91 2.67 9.73 Н 7440 -52.44 -13 -39.44 -56.36 -61.67 2.45 11.68 Н 9304.5 -47.16 -13 -34.16 -53.62 -57.19 2.55 12.58 Н 11163 -43.84 -13 -30.84 -54.99 -53.59 2.69 12.43 Н 13021.5 -53.66 -13 -40.66 -66.44 -63.75 2.94 13.03 Н Н Lowest 3720 -33.02 -13 -20.02 -28.62 -39.61 1.67 8.26 ٧ ٧ 5580 -48.31 -13 -35.31 -50.84 -55.37 2.67 9.73 V 7440 -55.23 -13 -42.23 -59.34 -64.46 2.45 11.68 ٧ 9304.5 -49.88 -13 -36.88 -56.71 -59.91 2.55 12.58 11163 -50.54 -13 -37.54 -61.54 -60.29 2.69 12.43 ٧ 13021.5 -55.87 -13 -42.87 -68.31 -65.96 2.94 13.03 V V -23.73 3762 -28.26 -13 -15.26 -34.89 1.69 8.31 Н 5640 -46.12 -13 -33.12 -48.99 -53.17 2.71 9.76 Н -47.44 -34.44 Η 7518 -13 -51.36 -56.83 2.42 11.81 9399 -54.26 -13 -41.26 -60.82 -64.23 2.57 12.54 Н 13158 -13 -42.28 -67.94 -65.53 2.97 13.22 Н -55.28 15037.5 -49.22 -13 -36.22 -62.1 -59.26 3.61 13.65 Н Н Middle ٧ 3762 -30.56 -13 -17.56 -26.07 -37.19 1.69 8.31 -53.72 ٧ 5640 -50.88 -13 -37.88 -57.93 2.71 9.76 7518 -49.83 -36.83 -53.98 -59.22 ٧ -13 2.42 11.81 9399 -55.02 -13 -42.02 -62.02 -64.99 2.57 12.54 ٧ 13158 -55.13 -13 -42.13 -67.55 -65.38 2.97 13.22 ٧ 15037.5 -49.28 -13 -36.28 -62.34 -59.32 3.61 13.65 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978



	3798	-31.98	-13	-18.98	-27.44	-38.64	1.70	8.36	Н
	5700	-48.43	-13	-35.43	-51.53	-55.47	2.74	9.78	Н
	7602	-47.28	-13	-34.28	-51.49	-56.74	2.40	11.86	Н
	9504	-49.38	-13	-36.38	-56.1	-59.29	2.59	12.50	Н
	11404.5	-48.44	-13	-35.44	-60.47	-58.09	2.68	12.34	Н
	15195	-50.26	-13	-37.26	-63.59	-60.45	3.68	13.87	Н
l limb and									Н
Highest	3798	-34.28	-13	-21.28	-29.72	-40.94	1.70	8.36	V
	5700	-50.99	-13	-37.99	-54.09	-58.03	2.74	9.78	V
	7602	-50.82	-13	-37.82	-55.27	-60.28	2.40	11.86	V
	9504	-50.48	-13	-37.48	-57.56	-60.39	2.59	12.50	V
	11404.5	-53.36	-13	-40.36	-65.28	-63.01	2.68	12.34	V
	15195	-50.87	-13	-37.87	-64.44	-61.06	3.68	13.87	V
									V

Report No.: FG6O0520B

: B12 of B24

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC. Page Number

TEL: 886-3-327-3456 FAX: 886-3-328-4978

## LTE Band 4

LTE Band 4 / 1.4MHz / QPSK										
Channel	Frequency ( MHz )	EIRP (dBm)	Limit ( dBm )	Over Limit ( dB )	SPA Reading (dBm)	S.G. Power ( dBm )	TX Cable loss (dB)	TX Antenna Gain (dBi)	Polarization (H/V)	
	3420	-41.83	-13	-28.83	-37.7	-47.9	1.58	7.65	Н	
	5136	-34.12	-13	-21.12	-34.8	-41.4	2.42	9.70	Н	
	6846	-50.42	-13	-37.42	-55.21	-58.4	2.64	10.62	Н	
	8556	-55.76	-13	-42.76	-62.18	-65.9	2.39	12.52	Н	
	10270.5	-49.29	-13	-36.29	-57.82	-58.9	2.69	12.31	Н	
	11982	-43.78	-13	-30.78	-56.24	-53.4	2.68	12.30	Н	
Lawaat								Gain (dBi) 7.65 9.70 10.62 12.52 12.31	Н	
Lowest	3420	-47.33	-13	-34.33	-43.09	-53.4	1.58	7.65	V	
	5136	-43.22	-13	-30.22	-43.68	-50.5	2.42	9.70	V	
	6846	-54.62	-13	-41.62	-59.31	-62.6	2.64	10.62	V	
	8556	-58.16	-13	-45.16	-64.95	-68.3	2.39	12.52	V	
	10270.5	-55.49	-13	-42.49	-63.84	-65.1	2.69	12.31	V	
	11982	-45.78	-13	-32.78	-57.76	-55.4	2.68	12.30	V	
									V	
	3468	-33.64	-13	-20.64	-29.68	-39.9	1.59	7.86	Н	
	5196	-35.65	-13	-22.65	-36.64	-42.9	2.45	9.70	Н	
	6930	-46.40	-13	-33.40	-51.07	-54.5	2.61	10.72	Н	
	8664	-46.54	-13	-33.54	-53	-56.7	2.41	10.62 12.52 12.31 12.30  7.65 9.70 10.62 12.52 12.31 12.30  7.86 9.70 10.72 12.57 12.36 12.33  7.86 9.70 10.72 12.57 12.36	Н	
	10396.5	-41.13	-13	-28.13	-49.91	-50.8	2.69	12.36	Н	
	12129	-42.68	-13	-29.68	-55.27	-52.3	2.71	12.33	Н	
									Н	
Middle	3468	-40.44	-13	-27.44	-36.47	-46.7	1.59	7.86	V	
	5196	-42.35	-13	-29.35	-43.18	-49.6	2.45	9.70	V	
	6930	-52.50	-13	-39.50	-57.18	-60.6	2.61	10.72	V	
	8664	-50.24	-13	-37.24	-56.99	-60.4	2.41	12.57	V	
	10396.5	-47.43	-13	-34.43	-56.14	-57.1	2.69	12.36	V	
	12129	-44.48	-13	-31.48	-56.55	-54.1	2.71	12.33	V	
									V	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B13 of B24



3510 -38.50 -13 -25.50 -34.7 -44.9 1.61 8.01 Н 5262 -36.19 -13 -23.19 -37.45 -43.4 2.49 9.70 Н 7020 -53.54 -13 -40.54 -58.12 -61.8 2.58 10.84 Н 8772 -55.32 -13 -42.32 -61.71 -65.5 2.43 12.61 Η 10533 -52.19 -13 -39.19 -61.22 -61.9 2.69 12.41 Н 12286.5 -52.79 -13 -39.79 -65.48 -62.4 2.75 12.36 Н Н Highest 3510 -45.50 -13 -32.50 -41.51 -51.9 1.61 8.01 V -41.49 -13 -28.49 -42.64 -48.7 2.49 9.70 ٧ 5262 7020 ٧ -57.14 -13 -44.14 -61.77 -65.4 2.58 10.84 8772 -58.42 -13 -45.42 -65.18 -68.6 2.43 12.61 ٧ 10533 -57.39 -13 -44.39 -66.4 -67.1 2.69 12.41 ٧ 12286.5 -54.39 -13 -41.39 -66.43 -64 2.75 12.36 ٧ ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B14 of B24



LTE Band 4 / 3MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (dBm) (H/V) (MHz) (dB) (dBm) (dBm) (dB) (dBi) 3426 -47.11 -13 -34.11 -43.02 -53.2 1.58 7.67 Н 5136 -41.02 -13 -28.02 -41.61 -48.3 2.42 9.70 Н 6852 -57.12 -13 -44.12 -61.8 -65.1 2.64 10.62 Н 8562 -59.36 -13 -46.36 -65.81 -69.5 2.39 12.52 Н 10281 -56.08 -13 -43.08 -64.67 -65.7 2.69 12.31 Н -47.08 11992.5 -13 -34.08 -59.56 -56.7 2.68 12.30 Н Н Lowest ٧ 3426 -47.01 -13 -34.01 -43.02 -53.1 1.58 7.67 ٧ 5136 -41.86 -13 -28.86 -42.27-49.14 2.42 9.70 V 6852 -57.52 -13 -44.52 -62.24 -65.5 2.64 10.62 ٧ 8562 -59.26 -13 -46.26 -66.02 -69.4 2.39 12.52 10281 -56.58 -13 -43.58 -64.97 -66.2 2.69 12.31 ٧ 11992.5 -47.48 -13 -34.48 -59.45 -57.1 2.68 12.30 V V -40.24 -27.24 -36.32 3468 -13 -46.5 1.59 7.86 Н -52.8 5202 -45.55 -13 -32.55 -46.48 2.45 9.70 Н 6936 -40.89 -58.54 10.72 Η -53.89 -13 -62 2.61 8670 -52.34 -13 -39.34 -58.77 2.41 12.57 Н -62.5 10407 -45.53 -13 -32.53 -54.36 -55.2 2.69 12.36 Н 12139.5 -43.29 -13 -30.29 -55.84 -52.9 2.71 12.33 Н Н Middle ٧ 3468 -40.34 -13 -27.34 -36.3 -46.6 1.59 7.86 ٧ 5202 -46.15 -13 -33.15 -46.97 -53.4 2.45 9.70 -53.19 -13 -40.19 -57.89 2.61 10.72 ٧ 6936 -61.3 8670 -52.34 -13 -39.34 -59.08 -62.5 2.41 12.57 ٧ 10407 -44.33 -13 -31.33 -53.03 -54 2.69 12.36 ٧ 12139.5 -43.99 -13 -30.99 -55.97 -53.6 2.71 12.33 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B15 of B24




3510 -47.00 -13 -34.00 -43.04 -53.4 1.61 8.01 Н 5262 -43.99 -13 -30.99 -45.14 -51.2 2.49 9.70 Н 7014 -57.66 -13 -44.66 -62.22 -65.9 2.59 10.83 Н 8772 -58.92 -13 -45.92 -65.29 -69.1 2.43 12.61 Η 10522.5 -56.19 -13 -43.19 -65.3 -65.9 2.69 12.40 Н 12276 -51.59 -13 -38.59 -64.25 -61.2 2.75 12.36 Н Н Highest ٧ 3510 -57.00 -13 -44.00 -43.05 -63.4 1.61 8.01 5262 -43.29 -13 -30.29 -50.5 2.49 9.70 ٧ -44.5 7014 -57.96 ٧ -13 -44.96 -62.54 -66.2 2.59 10.83 8772 -58.52 -13 -45.52 -65.33 -68.7 2.43 12.61 ٧ 10522.5 -56.09 -13 -43.09 -65.05 -65.8 2.69 12.40 ٧ ٧ 12276 -51.59 -13 -38.59 -63.65 -61.2 2.75 12.36 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B16 of B24

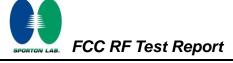

LTE Band 4 / 5MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (dBm) (H/V) (MHz) (dB) (dBm) (dBm) (dB) (dBi) 3426 -47.01 -13 -34.01 -42.91 -53.1 1.58 7.67 Н 5136 -41.62 -13 -28.62 -42.2 -48.9 2.42 9.70 Н 6852 -57.22 -13 -44.22 -61.85 -65.2 2.64 10.62 Н 8562 -58.26 -13 -45.26-64.66 -68.4 2.39 12.52 Н 10270.5 -55.69 -13 -42.69 -64.19 -65.3 2.69 12.31 Н -45.58 11992.5 -13 -32.58-58.13 -55.22.68 12.30 Н Н Lowest ٧ 3426 -46.91 -13 -33.91 -42.88 -53 1.58 7.67 ٧ 5136 -40.82 -13 -27.82 -41.3 -48.1 2.42 9.70 V 6852 -57.22 -13 -44.22 -61.77 -65.2 2.64 10.62 ٧ 8562 -58.66 -13 -45.66 -65.42 -68.8 2.39 12.52 10270.5 -56.19 -13 -43.19 -64.61 -65.8 2.69 12.31 ٧ 11992.5 -46.28 -13 -33.28 -58.26 -55.9 2.68 12.30 V V -33.34 -29.39 3468 -13 -20.34 -39.6 1.59 7.86 Н 5196 -35.25 -13 -22.25 -36.19 -42.5 2.45 9.70 Н 6930 -46.90 -33.90 10.72 Н -13 -51.51 -55 2.61 8664 -46.24 -13 -33.24 -52.67 -56.4 2.41 12.57 Н 10396.5 -38.53 -13 -25.53 -47.36 -48.2 2.69 12.36 Н 12129 -40.08 -13 -27.08 -52.69 -49.7 2.71 12.33 Н Н Middle ٧ 3468 -40.04 -13 -27.04 -36.07 -46.3 1.59 7.86 ٧ 5196 -45.85 -13 -32.85 -46.66 -53.1 2.45 9.70 -52.90 -13 -39.90 -57.54 2.61 10.72 ٧ 6930 -61 8664 -51.94 -13 -38.94 -58.63 -62.1 2.41 12.57 ٧ 10396.5 -46.03 -13 -33.03 -54.66 -55.7 2.69 12.36 ٧ 12129 -42.68-13 -29.68 -54.7 -52.3 2.71 12.33 ٧ ٧

Report No.: FG6O0520B

SPORTON INTERNATIONAL INC. Page Number : B17 of B24

TEL: 886-3-327-3456 FAX: 886-3-328-4978



-57.30 3504 -13 -44.30 -43.47 -63.7 1.61 8.00 Н 5256 -54.68 -13 -41.68 -45.86 -61.9 2.48 9.70 Н 7008 -57.87 -13 -44.87 -62.47 -66.1 2.59 10.82 Н 8760 -58.53 -13 -45.53 -64.98 -68.7 2.43 12.60 Η 10512 -55.49 -13 -42.49 -64.6 -65.2 2.69 12.40 Н 12265.5 -49.59 -13 -36.59 -62.29 -59.2 2.74 12.35 Н Н Highest 3504 -47.20 -13 -34.20 -43.25 -53.6 1.61 8.00 V 5256 -45.68 -13 -46.79 2.48 9.70 ٧ -32.68 -52.9 7008 -57.07 ٧ -13 -44.07 -61.67 -65.3 2.59 10.82 8760 -58.53 -13 -45.53 -65.26 -68.7 2.43 12.60 ٧ 10512 -55.29 -13 -42.29 -64.23 -65 2.69 12.40 ٧ ٧ 12265.5 -50.29 -13 -37.29 -62.36 -59.9 2.74 12.35 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B18 of B24



LTE Band 4 / 10MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3432 -39.38 -13 -26.38 -35.22 -45.5 1.58 7.70 Н 5148 -29.52 -13 -16.52 -29.86 -36.8 2.42 9.70 Н 6858 -50.91 -13 -37.91 -55.38 -58.9 2.64 10.63 Н 8574 -53.06 -13 -40.06 -59.15 -63.2 2.39 12.53 Н 10291 -53.88 -13 -40.88 -62.34 -63.5 2.69 12.32 Н 12003 -51.58 -13 -38.58 -63.86 -61.2 2.68 12.30 Н Н Lowest ٧ 3432 -44.58 -13 -31.58 -40.27-50.7 1.58 7.70 ٧ 5148 -38.52 -13 -25.52 -38.77 -45.8 2.42 9.70 V 6858 -55.81 -13 -42.81 -58.78 2.64 10.63 -63.8 ٧ 8574 -55.96 -13 -42.96 -62.51 -66.1 2.39 12.53 10291 -59.48 -13 -46.48 -67.39 -69.1 2.69 12.32 ٧ 12003 -54.88 -13 -41.88 -66.67 -64.5 2.68 12.30 V V -34.54 -30.04 3468 -13 -21.54 -40.8 1.59 7.86 Н 5196 -35.55 -13 -22.55 -36.06 -42.8 2.45 9.70 Н 6930 -46.00 -33.00 -50.28 10.72 Н -13 -54.1 2.61 8664 -46.04 -13 -33.04 -51.9 -56.2 2.41 12.57 Н 10396 -39.83 -13 -26.83 -48.54 -49.5 2.69 12.36 Н 12129 -42.98 -13 -29.98 -54.82 -52.6 2.71 12.33 Н Н Middle ٧ 3468 -41.24 -13 -28.24 -36.67 -47.5 1.59 7.86 ٧ 5196 -42.25 -13 -29.25 -42.28-49.5 2.45 9.70 -53.10 -13 -40.10 -57.15 -61.2 2.61 10.72 ٧ 6930 8664 -50.84 -13 -37.84 -56.94 -61 2.41 12.57 ٧ 10396 -45.83 -13 -32.83 -54.53 -55.5 2.69 12.36 ٧ 12129 -44.48 -13 -31.48 -56.32 -54.1 2.71 12.33 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978



3498 -39.71 -13 -26.71 -35.82 -46.1 1.60 7.99 Н 5250 -39.98 -13 -26.98 -40.78 -47.2 2.48 9.70 Н 7002 -51.29 -13 -38.29 -55.74 -59.5 2.59 10.80 Н 8748 -54.43 -13 -41.43 -60.7 -64.6 2.43 12.60 Η 10501.5 -46.69 -13 -33.69 -55.55 -56.4 2.69 12.40 Н 12255 -45.29 -13 -32.29 -57.63 -54.9 2.74 12.35 Н Н Highest ٧ 3498 -45.91 -13 -32.91 -41.88 -52.3 1.60 7.99 5250 -45.78 -13 -32.78 2.48 9.70 ٧ -46.73 -53 7002 ٧ -54.99 -13 -41.99 -59.48 -63.2 2.59 10.80 8748 -56.93 -13 -43.93 -63.4 -67.1 2.43 12.60 ٧ 10501.5 -54.69 -13 -41.69 -63.41 -64.4 2.69 12.40 ٧ ٧ 12255 -48.49 -13 -35.49 -60.41 -58.1 2.74 12.35 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B20 of B24



LTE Band 4 / 15MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Reading Gain **Power** loss (dBm) (H/V) (MHz) (dBm) (dB) (dBm) (dBm) (dB) (dBi) 3438 -35.46 -13 -22.46 -31.44 -41.6 1.58 7.73 Н 5154 -30.23 -13 -17.23 -30.92 -37.5 2.43 9.70 Н 6870 -50.09 -13 -37.09 -54.78 -58.1 2.63 10.64 Н 8586 -50.96 -13 -37.96 -57.37 -61.1 2.39 12.53 Н 10302 -50.57 -13 -37.57 -59.15 -60.2 2.69 12.32 Н -55.89 12024 -43.38 -13 -30.38 -53 2.68 12.30 Н Н Lowest ٧ 3438 -41.56 -13 -28.56 -37.48 -47.7 1.58 7.73 ٧ 5154 -38.23 -13 -25.23 -38.83 -45.5 2.43 9.70 V 6870 -54.29 -13 -41.29 -58.96 2.63 10.64 -62.3 ٧ 8586 -54.46 -13 -41.46 -61.24 -64.6 2.39 12.53 10302 -56.97 -13 -43.97 -65.47 -66.6 2.69 12.32 ٧ 12024 -46.38 -13 -33.38 -58.39 -56 2.68 12.30 V V -20.44 -29.53 3468 -33.44 -13 -39.7 1.59 7.86 Н 5196 -34.55 -13 -21.55 -35.52 -41.8 2.45 9.70 Н 6930 -47.4 10.72 Η -42.70-13 -29.70 -50.8 2.61 8664 -45.34 -13 -32.34 -51.7 -55.5 2.41 12.57 Н 10396.5 -37.83 -13 -24.83 -46.68 -47.5 2.69 12.36 Н 12129 -41.68 -13 -28.68 -54.31 -51.3 2.71 12.33 Н Н Middle ٧ 3468 -40.64 -13 -27.64 -36.64 -46.9 1.59 7.86 -42.19 ٧ 5196 -41.35 -13 -28.35 -48.6 2.45 9.70 -51.00 -13 -38.00 -55.6 2.61 10.72 ٧ 6930 -59.1 8664 -49.24 -13 -36.24 -56.05 -59.4 2.41 12.57 ٧ 10396.5 -47.13 -13 -34.13 -55.78 -56.8 2.69 12.36 ٧ 12129 -42.78-13 -29.78 -54.82 -52.4 2.71 12.33 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B21 of B24




	3498	-37.91	-13	-24.91	-33.97	-44.3	1.60	7.99	Н
	5244	-38.38	-13	-25.38	-39.56	-45.6	2.48	9.70	Н
	6990	-46.71	-13	-33.71	-51.28	-54.9	2.59	10.79	Н
	8736	-54.53	-13	-41.53	-60.94	-64.7	2.43	12.59	Н
	10480.5	-46.00	-13	-33.00	-55	-55.7	2.69	12.39	Н
	12234	-45.69	-13	-32.69	-58.2	-55.3	2.74	12.35	Н
18.1									Н
Highest	3498	-42.91	-13	-29.91	-38.97	-49.3	1.60	7.99	V
	5244	-44.98	-13	-31.98	-46.08	-52.2	2.48	9.70	V
	6990	-54.11	-13	-41.11	-58.72	-62.3	2.59	10.79	V
	8736	-57.43	-13	-44.43	-64.16	-67.6	2.43	12.59	V
	10491	-53.00	-13	-40.00	-61.84	-62.7	2.69	12.40	V
	12234	-47.09	-13	-34.09	-59.08	-56.7	2.74	12.35	V
									V

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

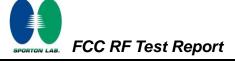

LTE Band 4 / 20MHz / QPSK **TX Antenna SPA** S.G. TX Cable Over **EIRP Polarization** Frequency Limit Channel Limit Gain Reading **Power** loss (dBm) (dBm) (H/V) (MHz) (dB) (dBm) (dBm) (dB) (dBi) 3420 -47.13 -13 -34.13 -43.01 -53.2 1.58 7.65 Н 5136 -46.12 -13 -33.12 -46.75 -53.4 2.42 9.70 Н 6846 -57.22 -13 -44.22 -62.02 -65.2 2.64 10.62 Н 8556 -59.76 -13 -46.76 -66.19 -69.9 2.39 12.52 Н 10270.5 -53.69 -13 -40.69 -62.17 -63.3 2.69 12.31 Н 11982 -46.48 -13 -33.48 -58.98 -56.1 2.68 12.30 Н Н Lowest ٧ 3420 -47.33 -13 -34.33 -43.09 -53.4 1.58 7.65 ٧ 5136 -45.22 -13 -32.22-45.73 -52.5 2.42 9.70 V 6846 -57.32 -13 -44.32 -62.06 -65.3 2.64 10.62 ٧ 8556 -58.96 -13 -45.96 -65.61 -69.1 2.39 12.52 -62.72 10270.5 -54.29 -13 -41.29 -63.9 2.69 12.31 ٧ 11982 -45.98 -13 -32.98 -58.01 -55.6 2.68 12.30 V V -29.46 3450 -33.41 -13 -20.41 -39.6 1.59 7.78 Н 5172 -37.34 -13 -24.34 -38.1 -44.6 2.44 9.70 Н -35.55 Η 6894 -48.55 -13 -53.23 -56.6 2.62 10.67 8616 -49.45 -13 -36.45 -55.9 -59.6 2.40 12.55 Н 10344 -49.86 -13 -36.86 -58.61 -59.5 2.69 12.34 Н 12066 -42.78 -13 -29.78 -55.17 -52.4 2.69 12.31 Н Н Middle ٧ 3450 -39.41 -13 -26.41 -35.39 -45.6 1.59 7.78 2.44 ٧ 5172 -43.14 -13 -30.14 -43.82 -50.4 9.70 6894 -54.55 -13 -41.55 -59.24 2.62 10.67 ٧ -62.6 8616 -53.25 -13 -40.25 -59.99 -63.4 2.40 12.55 ٧ 10344 -57.06 -13 -44.06 -65.67 -66.7 2.69 12.34 ٧ 12066 -44.48 -13 -31.48 -56.41 -54.1 2.69 12.31 ٧ ٧

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B23 of B24



3474 -41.11 -13 -28.11 -37.24 -47.4 1.60 7.89 Н 5208 -46.26 -13 -33.26 -47.32 -53.5 2.46 9.70 Н 6942 -55.18 -13 -42.18 -59.84 -63.3 2.61 10.73 Н 8682 -51.94 -13 -38.94 -58.21 -62.1 2.41 12.57 Η 10417.5 -44.63 -13 -31.63 -53.51 -54.3 2.69 12.37 Н 12150 -42.99 -13 -29.99 -55.59 -52.6 2.72 12.33 Н Н Highest ٧ 3474 -41.31 -13 -28.31 -37.31 -47.6 1.60 7.89 5208 -46.36 -13 -47.28 2.46 9.70 ٧ -33.36 -53.6 -54.78 ٧ 6942 -13 -41.78 -59.42 -62.9 2.61 10.73 8682 -51.24 -13 -38.24 -58.04 2.41 12.57 ٧ -61.4 10417.5 -45.73 -13 -32.73 -54.43 -55.4 2.69 12.37 ٧ ٧ 12150 -43.49 -13 -30.49 -55.55 -53.1 2.72 12.33 ٧

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

TEL: 886-3-327-3456 FAX: 886-3-328-4978