# **FCC RF Test Report**

APPLICANT : PAX Technology Limited EQUIPMENT : Mobile Payment Terminal

BRAND NAME : PAX MODEL NAME : D190

FCC ID : V5PD190LTE

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Jun. 18, 2019 and testing was completed on Jul. 03, 2019. We, Sporton International (ShenZhen) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International (ShenZhen) Inc., the test report shall not be reproduced except in full.

Derreck Chen

Reviewed by: Derreck Chen / Supervisor

Fire Shih

Approved by: Eric Shih / Manager

# Sporton International (ShenZhen) Inc.

1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055

People's Republic of China

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 1 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Cert #5145.01

Report No.: FR961801A

# **TABLE OF CONTENTS**

RE\	/ISIOI	N HISTORY	3
SUI	MMAR	RY OF TEST RESULT	4
1	GENI	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	6
	1.5	Modification of EUT	6
	1.6	Testing Location	6
	1.7	Applicable Standards	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Carrier Frequency Channel	8
	2.2	Test Mode	g
	2.3	Connection Diagram of Test System	10
	2.4	Support Unit used in test configuration and system	11
	2.5	EUT Operation Test Setup	11
	2.6	Measurement Results Explanation Example	11
3	TEST	RESULT	12
	3.1	Number of Channel Measurement	12
	3.2	Hopping Channel Separation Measurement	14
	3.3	Dwell Time Measurement	21
	3.4	20dB and 99% Bandwidth Measurement	23
	3.5	Output Power Measurement	36
	3.6	Conducted Band Edges Measurement	38
	3.7	Conducted Spurious Emission Measurement	45
	3.8	Radiated Band Edges and Spurious Emission Measurement	55
	3.9	AC Conducted Emission Measurement	59
	3.10	Antenna Requirements	61
4	LIST	OF MEASURING EQUIPMENT	62
5	UNC	ERTAINTY OF EVALUATION	63
APF	PEND	IX A. AC CONDUCTED EMISSION TEST RESULT	
APF	PEND	IX B. RADIATED SPURIOUS EMISSION	
APF	PEND	IX C. DUTY CYCLE PLOTS	

Sporton International (Shenzhen) Inc.

**APPENDIX D. SETUP PHOTOGRAPHS** 

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 2 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR961801A	Rev. 01	Initial issue of report	Jul. 29, 2019

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 3 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# **SUMMARY OF TEST RESULT**

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-
3.4	-	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 6.55 dB at 30.000 MHz
3.9	15.207	AC Conducted Emission	15.207(a)	Pass	Under limit 3.07 dB at 0.460 MHz
3.10	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 4 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 1 General Description

# 1.1 Applicant

#### **PAX Technology Limited**

Room 2416, 24/F., Sun Hung Kai Centre, 30 Harbour Road, Wanchai, Hong Kong

#### 1.2 Manufacturer

#### PAX Computer Technology (Shenzhen) Co., Ltd.

4/F, No.3 Building, Software Park, Second Central Science-Tech Road, High-Tech industrial Park, Shenzhen, Guangdong, P.R.C.

# 1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment	Mobile Payment Terminal				
Brand Name	PAX				
Model Name	D190				
FCC ID	V5PD190LTE				
	GSM/LTE/NFC				
	WLAN 2.4GHz 802.11b/g/n HT20				
EUT supports Radios application	WLAN 5GHz 802.11a/n HT20/HT40				
	WLAN 5GHz 802.11ac VHT20/VHT40/VHT80				
	Bluetooth BR / EDR / LE				
	Conducted:868197030036813				
IMEI Code	Conduction: 868197030032408				
	Radiation: N/A				
HW Version	D190-xxx-xxxx				
SW Version	V0.0.0.1				
EUT Stage	Production Unit				

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 5 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 6.67 dBm (0.0046 W) Bluetooth EDR (2Mbps) : 5.64 dBm (0.0037 W) Bluetooth EDR (3Mbps) : 5.91 dBm (0.0039 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps) : 0.916MHz Bluetooth EDR (2Mbps) : 1.196MHz Bluetooth EDR (3Mbps) : 1.180MHz			
Antenna Type / Gain	FPC Antenna with gain -0.60 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) : π /4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

#### 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

# 1.6 Testing Location

Sporton International (Shenzhen) Inc. is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Test Firm	Sporton International (Shenzhen) Inc.							
Test Site Location	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595							
	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.					
Test Site No.	CO01-SZ TH01-SZ	CN1256	421272					

Test Firm	Sporton International (Shenzhen) Inc.						
Test Site Location	No. 3 Bldg the third floor of south, Shahe River west, Fengzeyuan Warehouse, Nanshan Shenzhen, 518055 People's Republic of China TEL: +86-755-33202398						
Test Site No.	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.				
rest site No.	03CH02-SZ	CN1256	421272				

Sporton International (Shenzhen) Inc.
TEL: 86-755-8637-9589

FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 6 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

### 1.7 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

#### Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 7 of 63

Report Issued Date : Jul. 29, 2019

Report Version : Rev. 01

Report No.: FR961801A

# 2 Test Configuration of Equipment Under Test

# 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 8 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR961801A

#### 2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Z plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases						
	Data Rate / Modulation						
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps				
	GFSK	π/4-DQPSK	8-DPSK				
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz				
Conducted Test Cases	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz				
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz				
		Bluetooth BR 1Mbps GFSK					
Radiated	Mode 1: CH00_2402 MHz						
Test Cases		Mode 2: CH39_2441 MHz					
Test Cases		Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz					
Test Cases	Made 4 a COM OFO Lilla a F	Mode 3: CH78_2480 MHz	140) - 110D O-1-1-(O-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1				
	Mode 1 : GSM 850 Idle + B	Mode 3: CH78_2480 MHz	4G) + USB Cable(Charging				

#### Remark:

- 1. For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter and USB Cable .


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 9 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

# 2.3 Connection Diagram of Test System

#### For Radiation

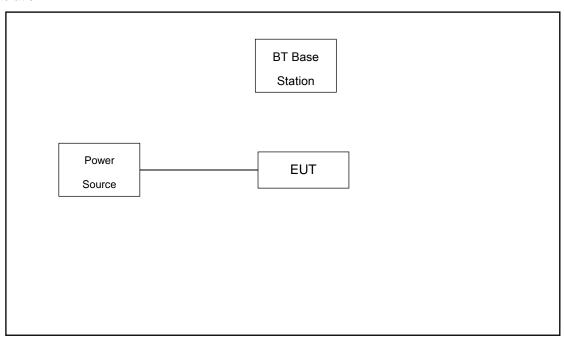

#### For Conducted Emission

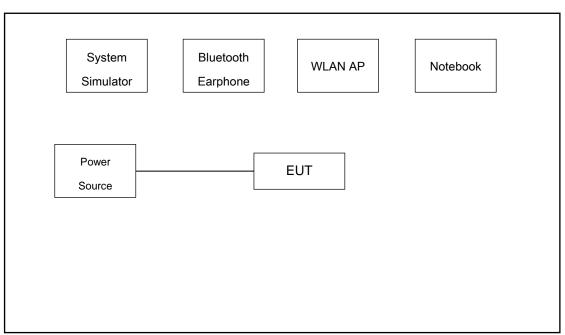

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 10 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR961801A

### 2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Base Station	Anritsu	MT8820C	N/A	N/A	Unshielded,1.8m
2.	BT Base Station	R&S	СВТ	N/A	N/A	Unshielded,1.8m
3.	WLAN AP	D-Link	DIR-820L	KA2IR820LA1	N/A	Unshielded,1.8m
4.	Notebook	Lenovo	E540	FCC DoC	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
5.	Bluetooth Earphone	Samsung	EO-MG900	N/A	N/A	N/A

### 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit/receive.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

### 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 5.0 dB and 10dB attenuator.

Offset(dB) = RF cable loss + attenuator factor. (dB) .  
= 
$$5.0 + 10 = 15$$
(dB)

Report No.: FR961801A

### 3 Test Result

#### 3.1 Number of Channel Measurement

#### 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

#### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

#### 3.1.4 Test Setup



#### 3.1.5 Test Result of Number of Hopping Frequency

Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%


Number of Hopping	Adaptive Frequency	Limits	Pass/Fail
(Channel)	Hopping (Channel)	(Channel)	1 435/1 411
79	20	> 15	Pass

Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 12 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### Number of Hopping Channel Plot on Channel 00 - 78

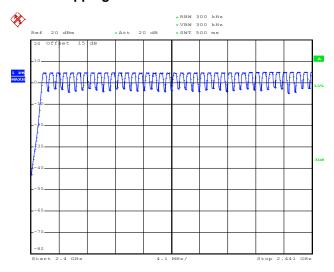

Date: 2.JUL.2019 21:55:07

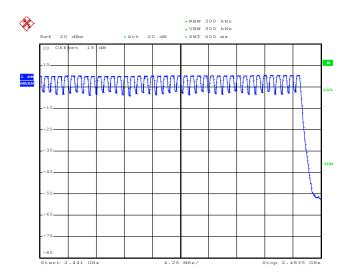

Date: 2.JUL.2019 22:02:11

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 13 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

### 3.2 Hopping Channel Separation Measurement

#### 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

#### 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:
   Span = wide enough to capture the peaks of two adjacent channels;
   RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.2.4 Test Setup



**Sporton International (Shenzhen) Inc.** TEL: 86-755-8637-9589

FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 14 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

### 3.2.5 Test Result of Hopping Channel Separation

Test Mode :	1Mbps	Temperature :	21~25℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	0.996	0.6027	Pass
39	2441	0.984	0.6027	Pass
78	2480	1.008	0.6027	Pass

#### Channel Separation Plot on Channel 00 - 01

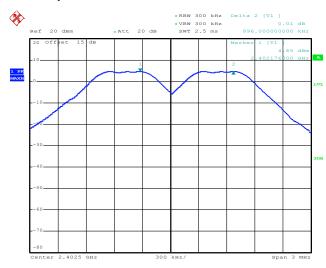


Date: 2.JUL.2019 21:17:13

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 15 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### Channel Separation Plot on Channel 39 - 40

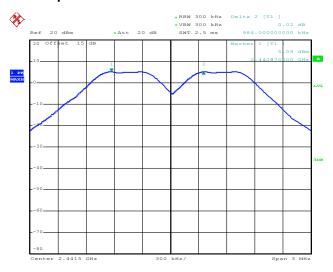

Date: 2.JUL.2019 21:34:59

#### **Channel Separation Plot on Channel 77 - 78**

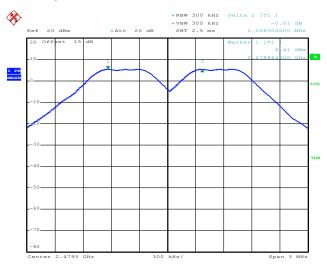

Date: 2.JUL.2019 21:46:14


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 16 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	0.990	0.8600	Pass
39	2441	1.002	0.8760	Pass
78	2480	0.990	0.8920	Pass

#### Channel Separation Plot on Channel 00 - 01

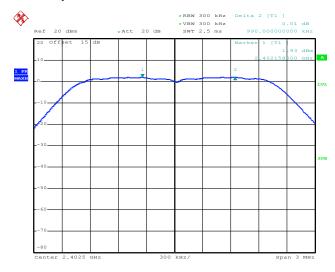


Date: 2.JUL.2019 22:26:39

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 17 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### Channel Separation Plot on Channel 39 - 40

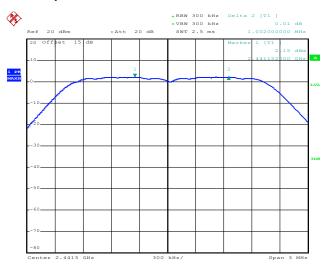

Date: 2.JUL.2019 22:33:00

#### **Channel Separation Plot on Channel 77 - 78**

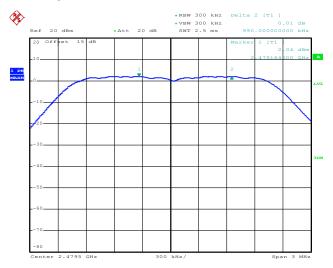

Date: 2.JUL.2019 22:43:52


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 18 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.020	0.8400	Pass
39	2441	0.996	0.8400	Pass
78	2480	1.008	0.8440	Pass

#### Channel Separation Plot on Channel 00 - 01

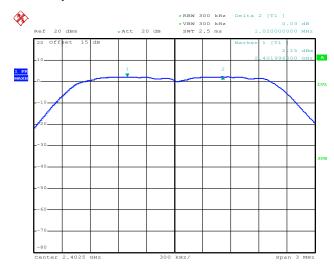


Date: 2.JUL.2019 23:52:30

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 19 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### Channel Separation Plot on Channel 39 - 40

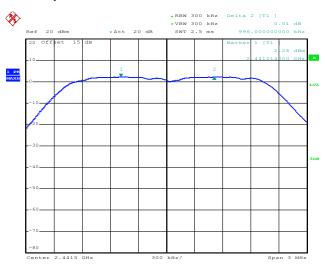

Date: 2.JUL.2019 23:17:59

#### **Channel Separation Plot on Channel 77 - 78**

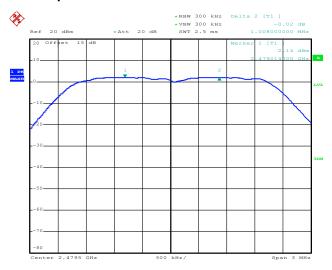

Date: 2.JUL.2019 23:54:22

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 20 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

#### 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.3.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 21 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### 3.3.5 Test Result of Dwell Time

Test Mode :	2DH5	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Mode	Channel	Hops Over Occupancy Time(hops)		Dwell Time (sec)	Limits (sec)	Pass/Fail
Normal	79	106.67	2.8986	0.31	0.4	Pass
AFH	20	53.34	2.8986	0.15	0.4	Pass

#### **Package Transfer Time Plot**

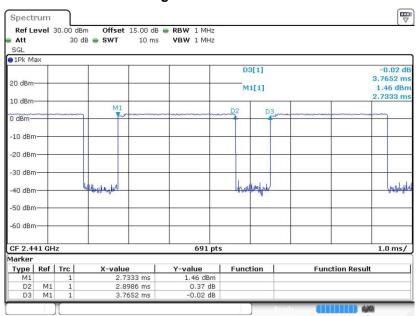

Date: 22.JUN.2019 17:49:44

#### Remark:

- In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels.
   With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4 x 79) (s),
   Hops Over Occupancy Time comes to (1600 / 6 / 79) x (0.4 x 79) = 106.67 hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit  $(0.4 \times 20)$  (s), Hops Over Occupancy Time comes to  $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$  hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 22 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### 3.4 20dB and 99% Bandwidth Measurement

#### 3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only


#### 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
  - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
  - $RBW \ge 1\%$  of the 20 dB bandwidth;  $VBW \ge RBW$ ; Sweep = auto; Detector function = peak;
  - Trace = max hold.
- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
  - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
  - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = sample;
  - Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.4.4 Test Setup

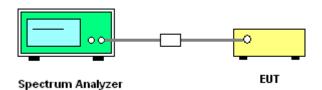

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 23 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### 3.4.5 Test Result of 20dB Bandwidth

Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	0.904
39	2441	0.904
78	2480	0.904


#### 20 dB Bandwidth Plot on Channel 00

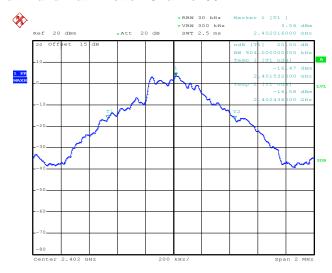

Date: 2.JUL.2019 21:09:50


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 24 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

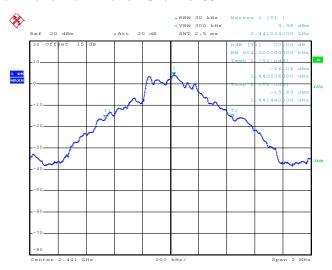

Date: 2.JUL.2019 21:35:37

#### 20 dB Bandwidth Plot on Channel 78

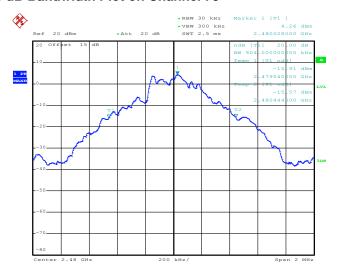


Date: 2.JUL.2019 21:46:57

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 25 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.290
39	2441	1.314
78	2480	1.338

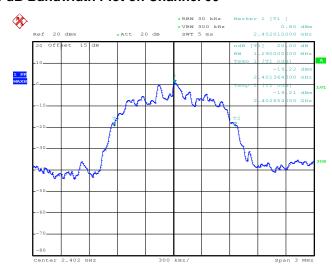

Date: 2.JUL.2019 22:27:15


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 26 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

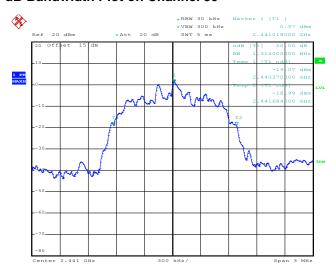

Date: 2.JUL.2019 22:33:35

### 20 dB Bandwidth Plot on Channel 78

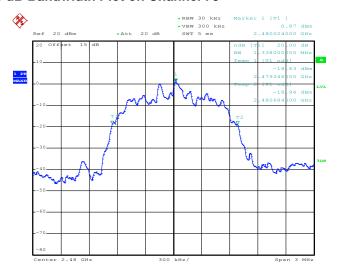


Date: 2.JUL.2019 22:44:39

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 27 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%


Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.260
39	2441	1.260
78	2480	1.266

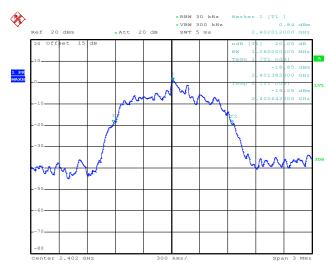

Date: 2.JUL.2019 23:09:50


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 28 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

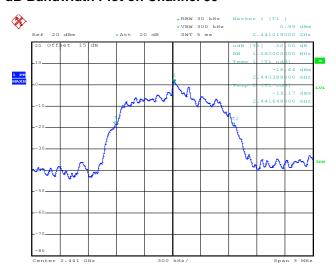

Date: 2.JUL.2019 23:18:38

#### 20 dB Bandwidth Plot on Channel 78

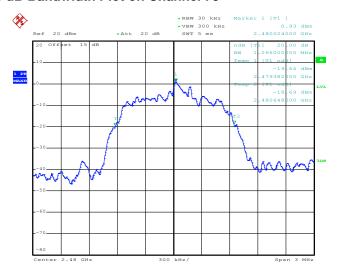

Date: 2.JUL.2019 23:32:03

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 29 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

### 3.4.6 Test Result of 99% Occupied Bandwidth

Test Mode :	1Mbps	Temperature :	21~25℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	0.912
39	2441	0.912
78	2480	0.916

#### 99% Occupied Bandwidth Plot on Channel 00

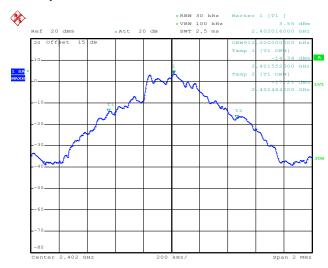


Date: 2.JUL.2019 21:10:34

Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 30 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

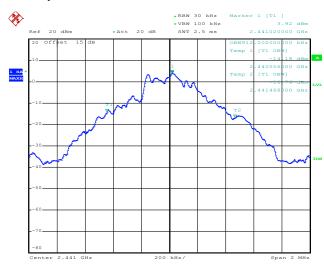

Date: 2.JUL.2019 21:36:48

#### 99% Occupied Bandwidth Plot on Channel 78

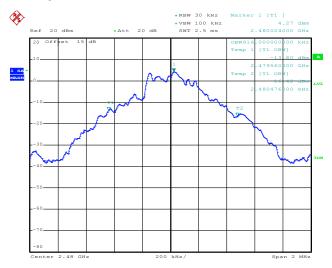

Date: 2.JUL.2019 21:48:01

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 31 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%


Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.192
39	2441	1.196
78	2480	1.192



Date: 2.JUL.2019 22:29:07


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 32 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

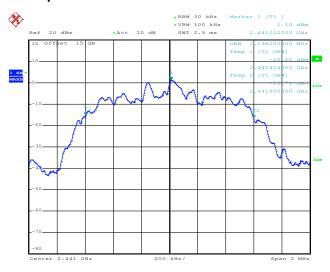

Date: 2.JUL.2019 22:34:12

#### 99% Occupied Bandwidth Plot on Channel 78

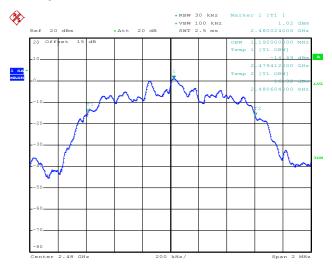


Date: 2.JUL.2019 22:45:34

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 33 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%


Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.180
39	2441	1.180
78	2480	1.180

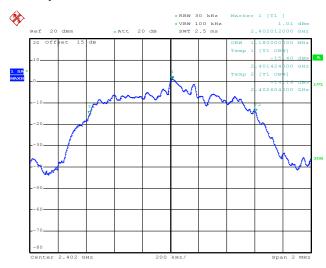

Date: 2.JUL.2019 23:11:16


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 34 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

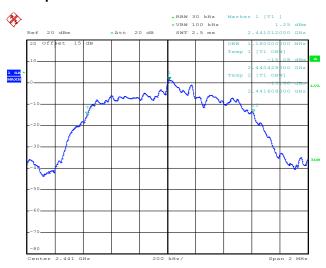

Date: 2.JUL.2019 23:27:33

#### 99% Occupied Bandwidth Plot on Channel 78

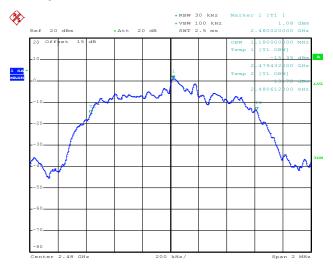

Date: 2.JUL.2019 23:33:42

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 35 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR961801A

### 3.5 Output Power Measurement

#### 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following:

(1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


#### 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

#### 3.5.4 Test Setup



TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 36 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.5.5 Test Result of Peak Output Power

Test Mode :	1Mbps	Temperature :	21~25℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

	F	RF Power (dBm)		
Channel	Frequency (MHz)	GFSK Max. Limits		Page/Fail
	(IVITIZ)	1 Mbps	(dBm)	Pass/Fail
00	2402	6.00	20.97	Pass
39	2441	6.43	20.97	Pass
78	2480	6.67	20.97	Pass

Test Mode :	2Mbps	Temperature :	21~25℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

	Fragueney	RF Power (dBm)		
Channel	Channel Frequency (MHz)		Max. Limits	Pass/Fail
	(IVITIZ)	2 Mbps	(dBm)	Pass/Fall
00	2402	5.59	20.97	Pass
39	2441	5.58	20.97	Pass
78	2480	5.64	20.97	Pass

Test Mode :	3Mbps	Temperature :	21~25℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

	Eroguenev	RF Power (dBm)		
Channel	Frequency (MHz)	8-DPSK	Max. Limits	Page/Fail
	(IVITIZ)	3 Mbps	(dBm)	Pass/Fail
00	2402	5.79	20.97	Pass
39	2441	5.69	20.97	Pass
78	2480	5.91	20.97	Pass

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 37 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.6 Conducted Band Edges Measurement

# 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

## 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

#### 3.6.4 Test Setup




TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 38 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.6.5 Test Result of Conducted Band Edges


Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Channel :	00 and 78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### Low Band Edge Plot on Channel 00

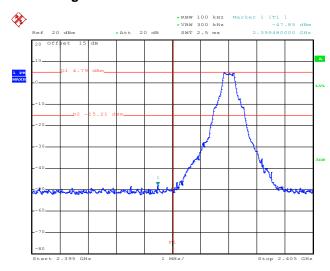

Date: 2.JUL.2019 21:27:47

#### **High Band Edge Plot on Channel 78**

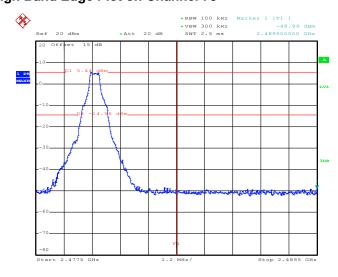


Date: 2.JUL.2019 21:47:16

Report No.: FR961801A


Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Channel :	00 and 78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### Low Band Edge Plot on Channel 00

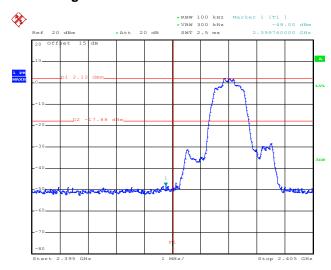

Date: 2.JUL.2019 22:50:38

#### **High Band Edge Plot on Channel 78**

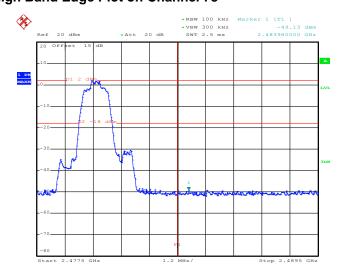

Date: 2.JUL.2019 22:44:58


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 40 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel :	00 and 78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### Low Band Edge Plot on Channel 00

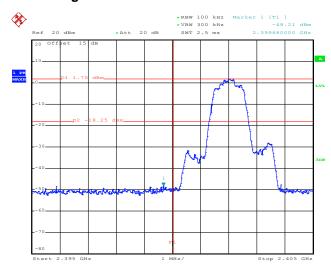

Date: 2.JUL.2019 23:10:25

#### **High Band Edge Plot on Channel 78**

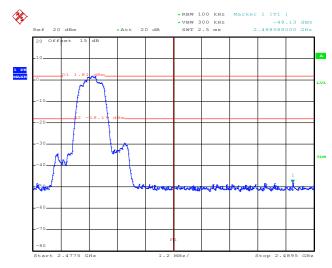

Date: 2.JUL.2019 23:33:06

Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 41 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.6.6 Test Result of Conducted Hopping Mode Band Edges


Test Mode :	1Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

# **Hopping Mode Low Band Edge Plot**

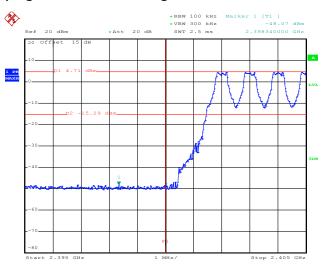

Date: 2.JUL.2019 22:07:56

#### **Hopping Mode High Band Edge Plot**

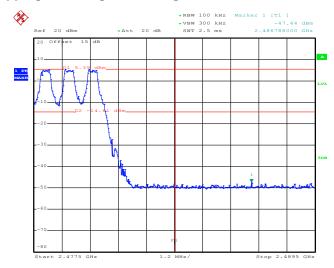


Date: 2.JUL.2019 22:11:43

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 42 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


Test Mode :	2Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

# **Hopping Mode Low Band Edge Plot**

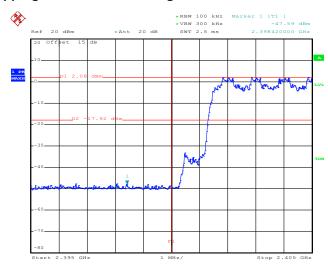

Date: 2.JUL.2019 22:56:13

#### **Hopping Mode High Band Edge Plot**

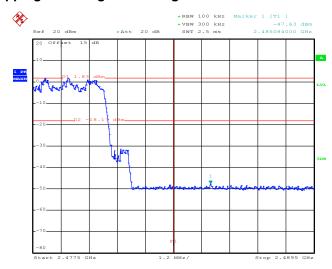

Date: 2.JUL.2019 22:59:07


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 43 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


Test Mode :	3Mbps	Temperature :	<b>21~25</b> ℃
Test Engineer :	Zhang Jiang	Relative Humidity :	51~54%

# **Hopping Mode Low Band Edge Plot**

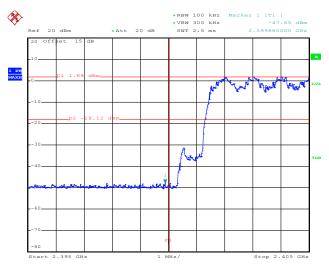

Date: 2.JUL.2019 23:40:26

#### **Hopping Mode High Band Edge Plot**

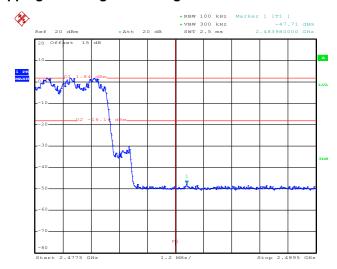

Date: 2.JUL.2019 23:43:51

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 44 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.7 Conducted Spurious Emission Measurement

#### 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

## 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

#### 3.7.4 Test Setup



Sporton International (Shenzhen) Inc.


TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 45 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.7.5 Test Result of Conducted Spurious Emission


Test Mode :	1Mbps	Temperature :	21~25℃
Test Channel :	00,39,78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

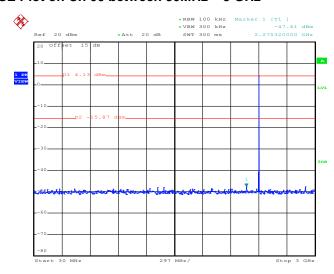

Date: 2.JUL.2019 21:30:10

#### 1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

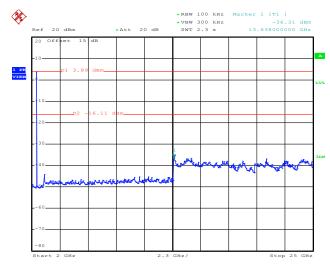


Date: 2.JUL.2019 21:30:31

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 46 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

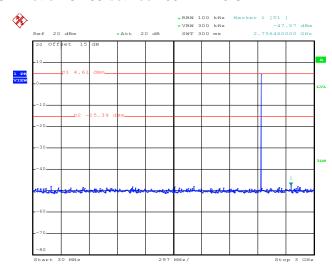

Date: 2.JUL.2019 21:37:15

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

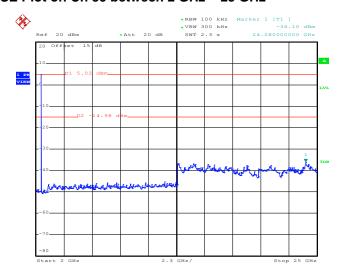


Date: 2.JUL.2019 21:37:37

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 47 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

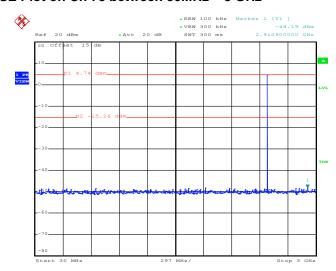

Date: 2.JUL.2019 21:48:49

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

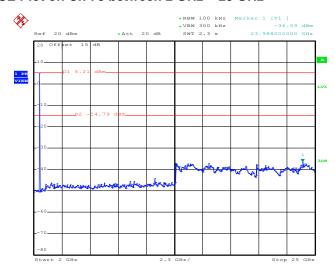

Date: 2.JUL.2019 21:49:10


Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 48 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


Test Mode :	2Mbps	Temperature :	21~25℃
Test Channel :	00,39,78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

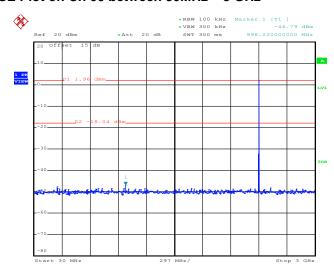

Date: 2.JUL.2019 22:30:20

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

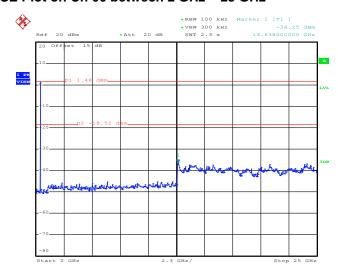


Date: 2.JUL.2019 22:30:42

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 49 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

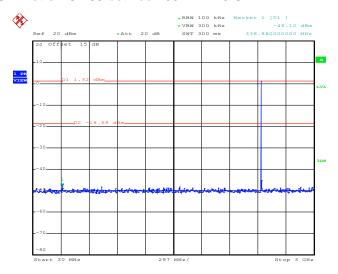

Date: 2.JUL.2019 22:40:46

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

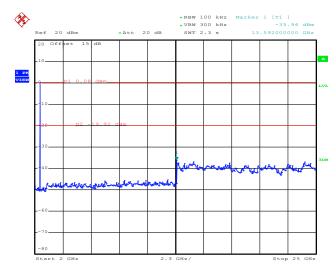


Date: 2.JUL.2019 22:41:08

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 50 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

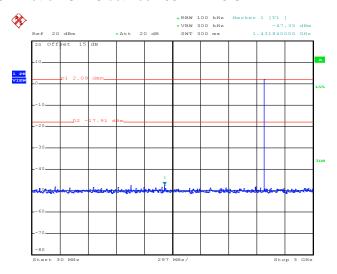

Date: 2.JUL.2019 22:46:16

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

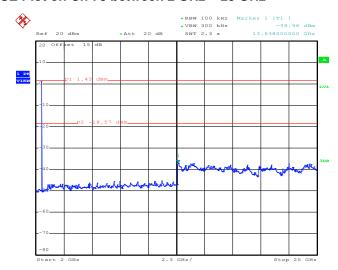


Date: 2.JUL.2019 22:46:37

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 51 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


Test Mode :	3Mbps	Temperature :	21~25℃
Test Channel :	00,39,78	Relative Humidity :	51~54%
		Test Engineer :	Zhang Jiang

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

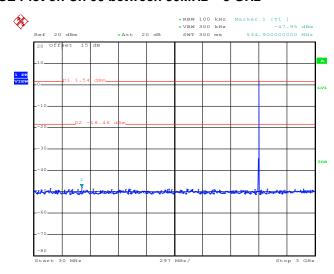

Date: 2.JUL.2019 23:16:14

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

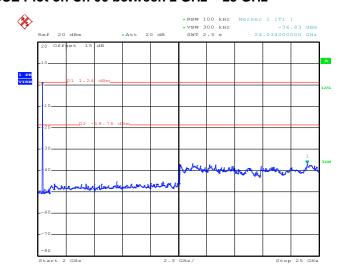


Date: 2.JUL.2019 23:16:36

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 52 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

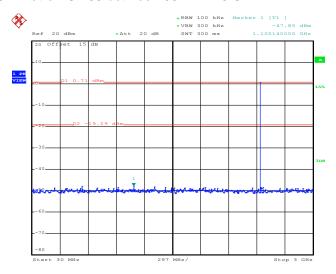

Date: 2.JUL.2019 23:28:22

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

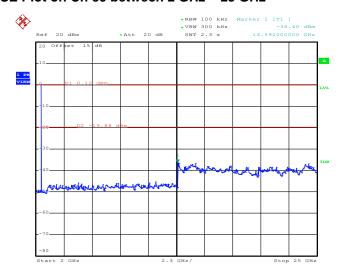


Date: 2.JUL.2019 23:28:44

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 53 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01


Report No.: FR961801A

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

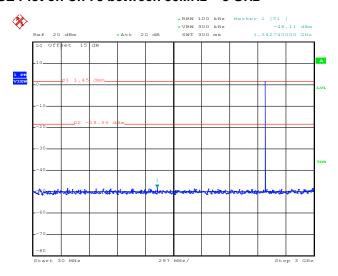

Date: 2.JUL.2019 23:34:56

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

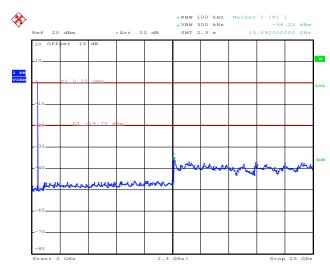

Date: 2.JUL.2019 23:35:18

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 54 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.8 Radiated Band Edges and Spurious Emission Measurement

# 3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance			
(MHz)	(microvolts/meter)	(meters)			
0.009 – 0.490	2400/F(kHz)	300			
0.490 – 1.705	24000/F(kHz)	30			
1.705 – 30.0	30	30			
30 – 88	100	3			
88 – 216	150	3			
216 - 960	200	3			
Above 960	500	3			

# 3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 55 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### 3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)


- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Report No.: FR961801A

# 3.8.4 Test Setup


#### For radiated emissions below 30MHz

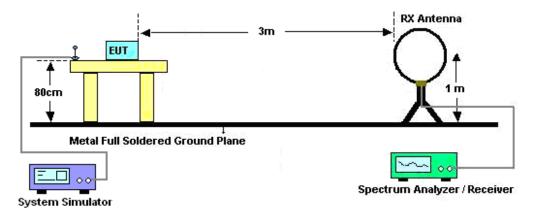

For radiated emissions from 30MHz to 1GHz



#### For radiated emissions above 1GHz

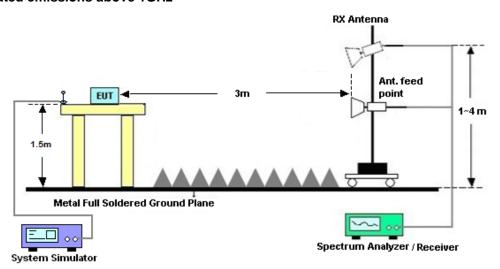

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 57 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

## 3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix B.

# 3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10<sup>th</sup> Harmonic)

Please refer to Appendix B.

## 3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix C.

**Sporton International (Shenzhen) Inc.** TEL: 86-755-8637-9589

FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 58 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### 3.9 AC Conducted Emission Measurement

#### 3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBµV)					
Frequency of emission (MHz)	Quasi-peak	Average				
0.15-0.5	66 to 56*	56 to 46*				
0.5-5	56	46				
5-30	60	50				

<sup>\*</sup>Decreases with the logarithm of the frequency.

# 3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.


#### 3.9.3 Test Procedures

- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 59 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.9.4 Test Setup

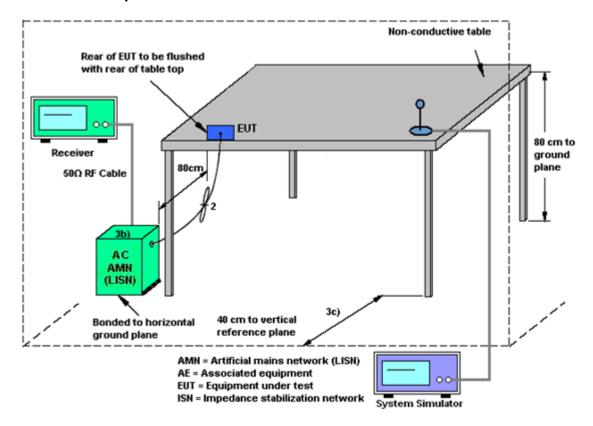

# 3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix A.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 60 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 3.10 Antenna Requirements

# 3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

# 3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

#### 3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 61 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR961801A

# 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101078	10Hz~40GHz	Apr. 18, 2019	Jun. 22, 2019~ Jul. 02, 2019	Apr. 17, 2020	Conducted (TH01-SZ)
Spectrum Analyzer	R&S	FSP30	101400	9KHz~30GHz	Dec. 22, 2018	Jun. 22, 2019~ Jul. 02, 2019	Dec. 21, 2019	Conducted (TH01-SZ)
Pulse Power Senor	Anritsu	MA2411B	1207253	30MHz~40GHz	Dec. 22, 2018	Jun. 22, 2019~ Jul. 02, 2019	Dec. 21, 2019	Conducted (TH01-SZ)
Power Meter	Anritsu	ML2495A	1218010	50MHz Bandwidth	Dec. 22, 2018	Jun. 22, 2019~ Jul. 02, 2019	Dec. 21, 2019	Conducted (TH01-SZ)
EXA Spectrum Analyzer	KEYSIGHT	N9010A	MY551502 13	10Hz~44GHz	Apr. 19, 2019	Jul. 03, 2019	Apr. 18, 2020	Radiation (03CH02-SZ)
Loop Antenna	R&S	HFH2-Z2	100354	9kHz~30MHz	May 29, 2019	Jul. 03, 2019	May 28, 2020	Radiation (03CH02-SZ)
Bilog Antenna	TeseQ	CBL6112D	35407	30MHz-2GHz	Jun. 05, 2019	Jul. 03, 2019	Jun. 04, 2020	Radiation (03CH02-SZ)
Double Ridge Horn Antenna	SCHWARZBE CK	BBHA 9120D	9120D-128 5	1GHz~18GHz	Jan. 07, 2019	Jul. 03, 2019	Jan. 06, 2020	Radiation (03CH02-SZ)
HF Amplifier	MITEQ	TTA1840-35- HG	1871923	18GHz~40GHz	Jul. 16, 2018	Jul. 03, 2019	Jul. 15, 2019	Radiation (03CH02-SZ
SHF-EHF Horn	com-power	AH-840	101071	18Ghz-40GHz	Mar. 30, 2019	Jul. 03, 2019	Mar. 29, 2020	Radiation (03CH02-SZ)
LF Amplifier	Burgeon	BPA-530	102211	0.01~3000Mhz	Oct. 18, 2018	Jul. 03, 2019	Oct. 17, 2019	Radiation (03CH02-SZ)
HF Amplifier	MITEQ	AMF-7D-0010 1800-30-10P- R	1707137	1GHz~18GHz	Oct. 20, 2018	Jul. 03, 2019	Oct. 19, 2019	Radiation (03CH02-SZ)
Amplifier	Agilent	8449B	3008A010 23	1GHz~26.5GHz	Oct. 18, 2018	Jul. 03, 2019	Oct. 17, 2019	Radiation (03CH02-SZ)
AC Power Source	Chroma	61601	616010002 470	N/A	NCR	Jul. 03, 2019	NCR	Radiation (03CH02-SZ)
Turn Table	Chaintek	T-200	N/A	0~360 degree	NCR	Jul. 03, 2019	NCR	Radiation (03CH02-SZ)
Antenna Mast	Chaintek	MBS-400	N/A	1 m~4 m	NCR	Jul. 03, 2019	NCR	Radiation (03CH02-SZ)
EMI Receiver	R&S	ESR7	101630	9kHz~7GHz;	Dec. 23, 2018	Jun. 21, 2019	Dec. 22, 2019	Conduction (CO01-SZ)
AC LISN	EMCO	3816/2SH	00103912	9kHz~30MHz	Oct. 18, 2018	Jun. 21, 2019	Oct. 17, 2019	Conduction (CO01-SZ)
AC LISN (for auxiliary equipment)	EMCO	3816/2SH	00103892	9kHz~30MHz	Dec. 23, 2018	Jun. 21, 2019	Dec. 22, 2019	Conduction (CO01-SZ)
AC Power Source	Chroma	61602	616020000 891	100Vac~250Vac	Jul. 18, 2018	Jun. 21, 2019	Jul. 17, 2019	Conduction (CO01-SZ)

NCR: No Calibration Required

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 62 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

# 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

#### <u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

Measuring Uncertainty for a Level of Confidence	2.6dB
of 95% (U = 2Uc(y))	2.0UB

#### Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	5.4 ID
1	5.1dB
of 95% (U = 2Uc(y))	

#### Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measurin	g Uncertainty for a Level of Confidence	5.0dB
	of 95% (U = 2Uc(y))	5.00B

#### Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)


Measuring Uncertainty for a Level of Confidence	4.4dB
of 95% (U = 2Uc(y))	4.4ub

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : 63 of 63
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A


# **Appendix A. AC Conducted Emission Test Results**

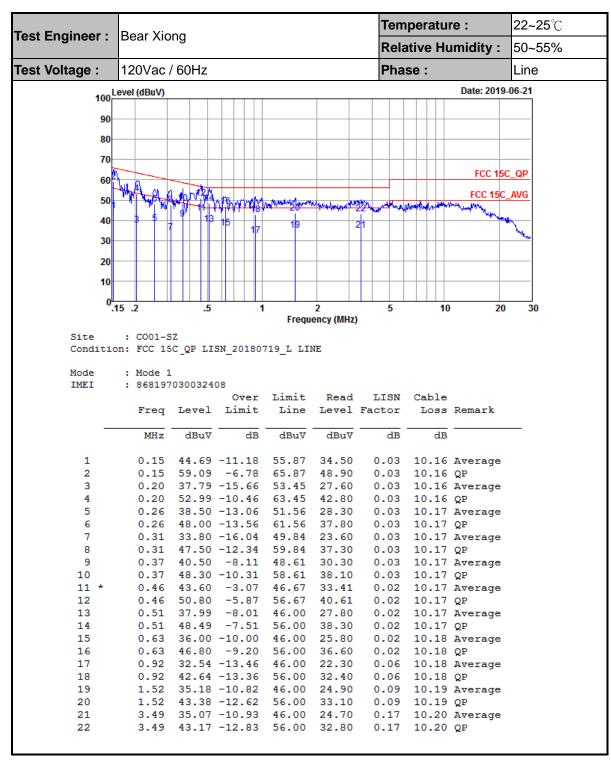

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : A1 of A2
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR961801A

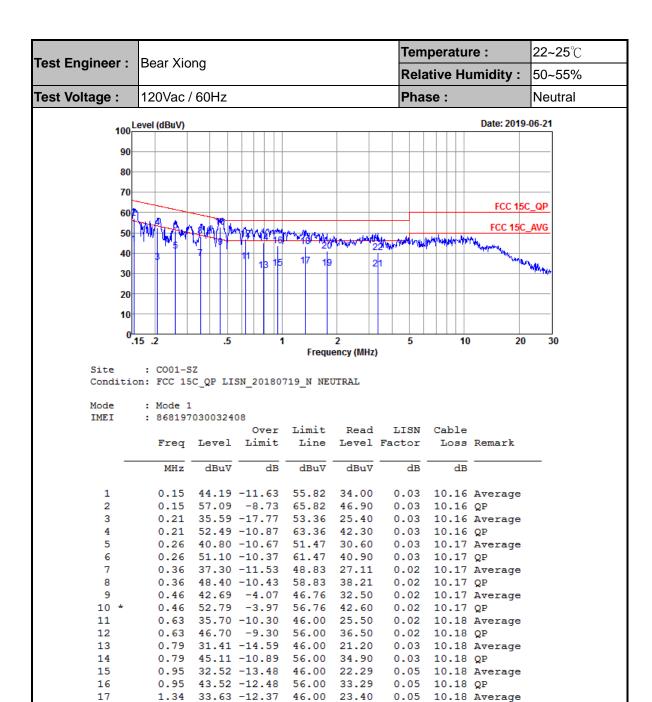

1.34 43.33 -12.67 56.00 33.10

1.76 32.34 -13.66 46.00 22.10

40.94 -15.06 56.00

3.35 31.94 -14.06 46.00 21.70

3.35 40.24 -15.76 56.00 30.00

17

19

20

21

1.76

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE

Page Number : A2 of A2 Report Issued Date: Jul. 29, 2019 Report Version : Rev. 01

0.05 10.18 Average

0.05 10.19 Average

0.04 10.20 Average

10.19 QP

0.05 10.18 QP

0.04 10.20 QP

0.05

30.70

Report No.: FR961801A

# Appendix B. Radiated Spurious Emission

#### 2.4GHz 2400~2483.5MHz

# BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
		2332.26	40.46	-33.54	74	39.89	26.91	6.5	32.84	184	206	Р	Н
		2332.26	15.67	-38.33	54	-	-	-	-	-	-	Α	Н
D.T.	*	2402	93.15	-	-	92.26	27.07	6.6	32.78	184	206	Р	Н
BT CH00	*	2402	68.36	-	-	-	-	-	-	-	-	Α	Н
2402MHz		2353.79	40.78	-33.22	74	40.08	26.99	6.53	32.82	187	264	Р	V
2402111112		2353.79	15.99	-38.01	54	-	-	-	-			Α	٧
	*	2402	98.45	-	-	97.56	27.07	6.6	32.78	187	264	Р	٧
	*	2402	73.66	-	-	-	-	-	-	-	-	Α	V
		2387.42	40.62	-33.38	74	39.78	27.07	6.57	32.8	201	199	Р	Н
		2387.42	15.83	-38.17	54	-	-	-	-	-	-	Α	Н
	*	2441	95.28	-	-	94.15	27.2	6.67	32.74	201	199	Р	Н
	*	2441	70.49	-	-	-	-	-	-	-	-	Α	Н
		2496.01	41.1	-32.9	74	39.74	27.33	6.73	32.7	201	199	Р	Н
BT		2496.01	16.31	-37.69	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		2348.78	40.81	-33.19	74	40.15	26.95	6.53	32.82	150	281	Р	٧
244   IVIF12		2348.78	16.02	-37.98	54	-	-	-	-	-	-	Α	V
	*	2441	97.51	-	-	96.38	27.2	6.67	32.74	150	281	Р	V
	*	2441	72.72	-	-	-	-	-	-	-	-	Α	٧
		2488.73	41.02	-32.98	74	39.68	27.33	6.73	32.72	150	281	Р	٧
		2488.73	16.23	-37.77	54	-	-	-	-	-	-	Α	V

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : B1 of B6
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

BT	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		(MHz)	( dBµV/m )	Limit ( dB )	Line ( dBµV/m )	Level ( dBµV )	Factor ( dB/m )	Loss (dB)	Factor ( dB )	Pos (cm)	Pos ( deg )	Avg. (P/A)	(H/V)
	*	2480	97.26	-	-	95.99	27.29	6.7	32.72	194	198	Р	Н
	*	2480	72.47	-	-	-	-	-	-	-	-	Α	Н
		2483.88	44.84	-29.16	74	43.57	27.29	6.7	32.72	194	198	Р	Н
BT		2483.88	20.05	-33.95	54	-	-	-	-	-	-	Α	Н
CH 78 2480MHz	*	2480	99.18	-	-	97.91	27.29	6.7	32.72	158	274	Р	V
246UNITZ	*	2480	74.39	-	-	-	-	-	-	-	-	Α	V
		2483.68	48.36	-25.64	74	47.09	27.29	6.7	32.72	158	274	Р	V
		2483.68	23.57	-30.43	54	-	-	-	-	-	-	Α	V

# Remark 2.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : B2 of B6
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

No other spurious found.

<sup>2.</sup> All results are PASS against Peak and Average limit line.

#### 2.4GHz 2400~2483.5MHz

# BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
ВТ		4804	42.18	-31.82	74	59.03	31.01	9.61	57.47	151	219	Р	Н
		4804	17.39	-36.61	54	-	-	-	-	-	-	Α	Н
CH 00 2402MHz		4804	43.22	-30.78	74	60.07	31.01	9.61	57.47	151	219	Р	V
24UZIVI 17Z		4804	18.43	-35.57	54	ı	-	-	-	-	-	Α	V
		4882	40.74	-33.26	74	57.49	31.06	9.71	57.52	150	258	Р	Н
		4882	15.95	-38.05	54	-	-	-	-	-	-	Α	Н
DT		7323	45.95	-28.05	74	56.87	35.97	12.04	58.93	152	309	Р	Н
BT CH 20		7323	21.16	-32.84	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		4882	40.94	-33.06	74	57.69	31.06	9.71	57.52	150	258	Р	V
		4882	16.15	-37.85	54	-	-	-	-	-	-	Α	V
		7323	45.92	-28.08	74	56.84	35.97	12.04	58.93	152	309	Р	V
		7323	21.13	-32.87	54	-	-	-	-	-	-	Α	V
		4960	40.18	-33.82	74	56.83	31.12	9.81	57.58	118	289	Р	Н
		4960	15.39	-38.61	54	-	-	-	-	-	-	Α	Н
DT		7440	46.2	-27.8	74	56.74	36.29	12.15	58.98	158	273	Р	Н
BT CH 70		7440	21.41	-32.59	54	-	-	-	-	-	-	Α	I
CH 78 2480MHz		4960	41.05	-32.95	74	57.7	31.12	9.81	57.58	118	289	Р	V
		4960	16.26	-37.74	54	-	-	-	-	-	-	Α	V
		7440	46.26	-27.74	74	56.8	36.29	12.15	58.98	158	273	Р	V
		7440	21.47	-32.53	54	-	-	-	-	-	-	Α	V

# Remark

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : B3 of B6
Report Issued Date : Jul. 29, 2019

Report No.: FR961801A

Report Version : Rev. 01
Report Template No.: BU5-FR15CBT Version 2.0

<sup>1.</sup> No other spurious found.

<sup>2.</sup> All results are PASS against Peak and Average limit line.

#### **Emission below 1GHz**

# 2.4GHz BT (LF)

S Po: 1) (deg - -		H H
-	Р	Н
-		
	Р	Н
-		
	Р	Н
0 15	5 P	Н
-	Р	Н
-	Р	Н
0 10	1 P	V
-	Р	V
-	Р	V
-	Р	V
-	Р	V
-	Р	V
	-	101 P - P - P - P - P

# Remark

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : B4 of B6
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

<sup>1.</sup> No other spurious found.

<sup>2.</sup> All results are PASS against limit line.

# Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any							
	unwanted emissions shall not exceed the level of the fundamental frequency.							
!	Test result is <b>over limit</b> line.							
P/A	Peak or Average							
H/V	Horizontal or Vertical							

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : B5 of B6
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A

#### A calculation example for radiated spurious emission is shown as below:

Report No.: FR961801A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

#### For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level( $dB\mu V/m$ ) Limit Line( $dB\mu V/m$ )
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

 Sporton International (Shenzhen) Inc.
 Page Number
 : B6 of B6

 TEL: 86-755-8637-9589
 Report Issued Date
 : Jul. 29, 2019


 FAX: 86-755-8637-9595
 Report Version
 : Rev. 01

FCC ID: V5PD190LTE Report Template No.: BU5-FR15CBT Version 2.0




# Appendix C. Duty Cycle Plots

# DH5 on time (One Pulse) Plot on Channel 39

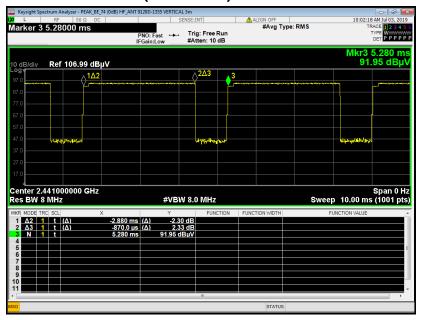

#### DH5 on time (Count Pulses) Plot on Channel 39

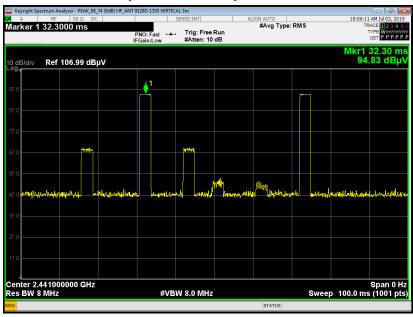

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds =  $2 \times 2.88 / 100 = 5.76 \%$
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

Sporton International (Shenzhen) Inc.

TEL: 86-755-8637-9589 FAX: 86-755-8637-9595 FCC ID: V5PD190LTE Page Number : C1 of C1
Report Issued Date : Jul. 29, 2019
Report Version : Rev. 01

Report No.: FR961801A