

Partial FCC RF Test Report

APPLICANT : Acer Inc. **EQUIPMENT** : 3G Module **BRAND NAME** : Ericsson : F3307 MODEL NAME

MARKETING NAME : ASPIRE 4820T, ASPIRE 4820, ASPIRE 4745

FCC ID : VV7-MBMF33072-A

STANDARD : FCC 47 CFR Part 2, 22(H), 24(E) CLASSIFICATION : PCS Licensed Transmitter (PCB) Tx/Rx FREQUENCY RANGE : GSM850 : 824.2 ~ 848.8 MHz /

869.2 ~ 893.8 MHz

GSM1900: 1850.2 ~ 1909.8 MHz/

1930.2 ~ 1989.8 MHz

MAX. ERP/EIRP POWER GSM850 (GPRS 8): 0.89 W

> **GSM850 (EDGE 8): 0.26 W** GSM1900 (GPRS 8): 0.98 W **GSM1900 (EDGE 8): 0.43 W**

This is a partial report which is only valid combined with the WWAN Module (Brand name: Ericsson / Model name: F3307, FCC ID: VV7-MBMF33072-A) Report.

The product was installed into Notebook Computer (Brand Name: Acer, Gateway, PackardBell, Model Name: ZQ1B, ZQ1C; ZQ1, ZQ1A, Marketing Name: Aspire 4820T, Aspire 4820, Aspire 4745) during test.

The product was received on Jan. 13, 2011 and completely tested on Feb. 19, 2011. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI / TIA / EIA-603-C-2004 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by:

Roy Wu / Manager





Report No.: FG021239-09

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.

Page Number : 1 of 25 Report Issued Date: Feb. 22, 2011

Report Version : Rev. 01

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SU	MMAF	RY OF TEST RESULT	4
1	GEN	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	
	1.3	Feature of Equipment Under Test	6
	1.4	Testing Site	7
	1.5	Applied Standards	7
	1.6	Ancillary Equipment List	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Test Mode	8
	2.2	Connection Diagram of Test System	9
3	FIEL	D STRENGTH OF SPURIOUS RADIATION MEASUREMENT	10
	3.1	Effective Radiated Power and Effective Isotropic Radiated Power Measurement	10
	3.2	Description of Field Strength of Spurious Radiated Measurement	14
4	LIST	OF MEASURING EQUIPMENT	24
5	UNC	ERTAINTY OF EVALUATION	25
ΑP	PEND	IX A. PHOTOGRAPHS OF EUT	
ΑP	PEND	IX B. SETUP PHOTOGRAPHS	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 2 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FG021239-09	Rev. 01	Initial issue of report	Feb. 22, 2011

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 3 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



SUMMARY OF TEST RESULT

Report Section	FCC Rule	FCC Rule IC Rule Description		Limit	Result	Remark
3.1	§22.913(a)(2)	RSS-132(4.4) SRSP-503(5.1.3)	Effective Radiated		PASS	-
3.1	§24.232(c)	RSS-133 (6.4) Equiv SRSP-510(5.1.2) Rai		< 2 Watts	PASS	-
3.2	§2.1053 §22.917(a) §24.238(a)	RSS-132 (4.5.1) RSS-133 (6.5.1)	Field Strength of Spurious Radiation	< 43+10log ₁₀ (P[Watts])		Under limit 0.58 dB at 5636 MHz

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 4 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

1 General Description

1.1 Applicant

Acer Inc.

8F., No. 88, Sec. 1, Hsin Tai Wu Rd., Hsichih, Taipei Hsien 221, Taiwan, R.O.C.

1.2 Manufacturer

Quanta Computer Inc.

- 1. No. 2, Lane 58, Sanzhuang Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- 2. No. 4, Wen Ming 1st Street, Kuei Shan Hsiang, Taoyuan Shien 333, Taiwan, R.O.C.
- 3. No. 8, Dongjing Rd., Songjiang Industrial Zone, Shanghai, P.R. China
- 4. No. 4, Lane 58, Sanzhuang Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- 5. North to Songsheng. Road, Songjiang Industrial Zone, Shanghai, P.R. China
- 6. B#, No. 1, South Rongteng Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- Standard Factory, South to Valqua, Rongxin Road, Songjiang Export Processing Zone, Shanghai,
 P.R. China
- 8. C#, No. 1, South Rongteng Road, Songhjang Export Processing Zone, Shanghai, P.R. China
- 9. No. 6, Lane 66, Sanzhuang Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- 10. No. 6, Lane 58, Sanzhuang Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- 11. Huade Building, No. 18, ChuangYe Rd., ShandDi Zone, HaiDian District, Beijing, P.R.C.
- 12. No. 68, Sanzhuang Road, Songjiang Export Processing Zone, Shanghai, P.R. China
- 13. 2F., C Building, XinYe Rd., Export Processing District In Torch, Zhongshan, Guangdong, P.R.C.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A

TEL: 886-3-327-3456

Page Number : 5 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



Feature of Equipment Under Test 1.3

Product Feature & Specification						
Equipment	3G Module					
Brand Name	Ericsson					
Model Name	F3307					
Marketing Name	Aspire 4820T, Aspire 4820, Aspire 4745					
FCC ID	VV7-MBMF33072-A					
Host Notebook Computer	Brand Name: Acer, Gateway, PackardBell Model Name: ZQ1B, ZQ1C; ZQ1, ZQ1A Marketing Name: Aspire 4820T, Aspire 4820, Aspire 4745 HW Version: M/B: C SW Version: BIOS: V1.19					
Tx Frequency	GSM850 : 824 MHz ~ 849 MHz GSM1900 : 1850 MHz ~ 1910 MHz					
Rx Frequency	GSM850 : 869 MHz ~ 894 MHz GSM1900 : 1930 MHz ~ 1990 MHz					
Maximum ERP/EIRP	GSM850 (GPRS 8) : 0.89 W (29.50 dBm) GSM850 (EDGE 8) : 0.26 W (24.07 dBm) GSM1900 (GPRS 8) : 0.98 W (29.93 dBm) GSM1900 (EDGE 8) : 0.43 W (26.35 dBm)					
Antenna Type	PIFA Antenna					
HW Version	M/B : C					
SW Version	BIOS: V1.19					
Type of Modulation	GSM / GPRS : GMSK EDGE : 8PSK					
EUT Stage	Production Unit					

Remark:

- 1. For other wireless features of this EUT, the test report will be issued separately.
- This test report recorded only product characteristics and test results of PCS Licensed Transmitter (PCB).
- The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 6 of 25 Report Issued Date: Feb. 22, 2011

Report No.: FG021239-09

Report Version : Rev. 01

1.4 Testing Site

Test Site	SPORTON INTERNATIONAL INC.	PORTON INTERNATIONAL INC.					
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,						
Toot Site Leastion	Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.						
Test Site Location	TEL: +886-3-327-3456						
	FAX: +886-3-328-4978						
Test Site No.	Sporton Site No.	FCC/IC Registration No.					
Test Site NO.	03CH07-HY	722060/4086B-1					

1.5 Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- Preliminary Guidance for Receiving Applications for Certification of 3G Device. May 9, 2006.
- FCC 47 CFR Part 2, 22(H), 24(E)
- ANSI / TIA / EIA-603-C-2004
- IC RSS-132 Issue 2
- IC RSS-133 Issue 5

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B (DoC), recorded in a separate test report.

1.6 Ancillary Equipment List

Item	Equipment	Trade Name	Model No.	FCC ID	Data Cable	Power Cord
1.	System Simulator	R&S	CMU200	N/A	N/A	Unshielded, 1.8 m

SPORTON INTERNATIONAL INC.TEL: 886-3-327-3456
FAX: 886-3-328-4978

FCC ID: VV7-MBMF33072-A

Page Number : 7 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



2 Test Configuration of Equipment Under Test

2.1 Test Mode

During all testing, EUT is in link mode with base station emulator at maximum power level. The spurious emission measurements were carried out in semi-anechoic chamber with 3-meter test range.

Frequency range investigated for radiated emission is as follows:

- 1. 30 MHz to 9000 MHz for GSM850.
- 30 MHz to 19000 MHz for GSM1900.

Test Modes						
Band Radiated TCs						
0014.050	■ GPRS 8 Link					
GSM 850	■ EDGE 8 Link					
CCM 4000	■ GPRS 8 Link					
GSM 1900	■ EDGE 8 Link					

Remark: Only the radiated emission of the WWAN module on the host notebook computer was performed in this report, and the conducted test cases can be referred to Ericsson module report (FCC ID: VV7-MBMF33072-A).

Note:

- The maximum power levels are GPRS multi-slot class 8 mode for GMSK link, EDGE multi-slot class 8 mode for 8PSK link, only these modes were used for all tests.
- 2. Because there are individual antennas for each WWAN, WLAN, and Bluetooth, the co-location test modes are not required.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A


TEL: 886-3-327-3456

Page Number : 8 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



Report No.: FG021239-09

2.2 Connection Diagram of Test System

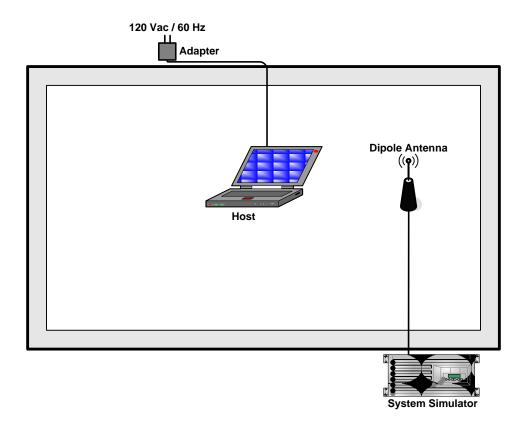

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 9 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

3 Field Strength of Spurious Radiation Measurement

3.1 Effective Radiated Power and Effective Isotropic Radiated Power Measurement

3.1.1 Description of the ERP/EIRP Measurement

ERP/EIRP is measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The ERP of mobile transmitters must not exceed 7 Watts and the EIRP of mobile transmitters are limited to 2 Watts.

3.1.2 Measuring Instruments

See list of measuring instruments of this test report.

3.1.3 Test Procedures

- 1. The EUT was placed on a turntable with 1.0 meter height in a fully anechoic chamber.
- 2. The EUT was set at 1.2 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest radiated power.
- 4. The height of the receiving antenna is adjusted to look for the maximum ERP/EIRP.
- 5. Taking the record of maximum ERP/EIRP.
- 6. A dipole antenna was substituted in place of the EUT and was driven by a signal generator.
- 7. The conducted power at the terminal of the dipole antenna is measured.
- 8. Repeat step 3 to step 5 to get the maximum ERP/EIRP of the substitution antenna.
- 9. ERP/EIRP = Ps + Et Es + Gs = Ps + Rt Rs + Gs

Ps (dBm): Input power to substitution antenna.

Gs (dBi or dBd): Substitution antenna Gain.

Et = Rt + AF

Es = Rs + AF

AF (dB/m): Receive antenna factor

Rt: The highest received signal in spectrum analyzer for EUT.

Rs: The highest received signal in spectrum analyzer for substitution antenna.

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 10 of 25
Report Issued Date : Feb. 22, 2011

Report Version : Rev. 01



Report No.: FG021239-09

3.1.4 Test Setup

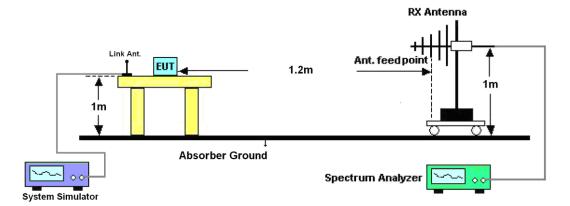

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 11 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

3.1.5 Test Result of ERP

GSM850 (GPRS 8) Radiated Power ERP											
	Horizontal Polarization										
Frequency	Frequency Rt Rs Ps Gs ERP ERP										
(MHz)	(dBm)	(dBm)	(dBm)	(dBd)	(dBm)	(W)					
824.20	-18.08	-48.12	0.00	-1.08	28.96	0.79					
836.40	-17.85	-48.28	0.00	-0.93	29.50	0.89					
848.80	-18.52	-48.35	0.00	-0.76	29.07	0.81					
		Ve	ertical Polarizati	on							
Frequency	Rt	Rs	Ps	Gs	ERP	ERP					
(MHz)	(dBm)	(dBm)	(dBm)	(dBd)	(dBm)	(W)					
824.20	-18.39	-47.97	0.00	-1.08	28.50	0.71					
836.40	-17.76	-48.01	0.00	-0.93	29.32	0.86					
848.80	-18.67	-48.05	0.00	-0.76	28.62	0.73					

GSM850 (EDGE 8) Radiated Power ERP											
	Horizontal Polarization										
Frequency Rt Rs Ps Gs ERP ERP (MHz) (dBm) (dBm) (dBd) (dBm) (W)											
824.20	-23.39	-48.12	0.00	-1.08	23.65	0.23					
836.40	-23.28	-48.28	0.00	-0.93	24.07	0.26					
848.80	-24.38	-48.35	0.00	-0.76	23.21	0.21					
		Ve	ertical Polarizati	on							
Frequency (MHz)	Rt (dBm)	Rs (dBm)	Ps (dBm)	Gs (dBd)	ERP (dBm)	ERP (W)					
824.20	-26.01	-47.97	0.00	-1.08	20.88	0.12					
836.40	-25.73	-48.01	0.00	-0.93	21.35	0.14					
848.80	-26.69	-48.05	0.00	-0.76	20.60	0.11					

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 12 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



3.1.6 Test Result of EIRP

GSM1900 (GPRS 8) Radiated Power EIRP											
	Horizontal Polarization										
Frequency	Frequency Rt Rs Ps Gs EIRP EIRP										
(MHz)	(dBm)	(dBm)	(dBm)	(dBi)	(dBm)	(W)					
1850.20	-23.91	-51.88	0.00	1.96	29.93	0.98					
1880.00	-25.53	-52.99	0.00	2.00	29.46	0.88					
1909.80	-26.97	-54.28	0.00	1.98	29.29	0.85					
		Ve	ertical Polarizati	on							
Frequency	Rt	Rs	Ps	Gs	EIRP	EIRP					
(MHz)	(dBm)	(dBm)	(dBm)	(dBi)	(dBm)	(W)					
1850.20	-23.53	-52.13	0.00	1.96	30.56	1.14					
1880.00	-24.71	-53.17	0.00	2.00	30.46	1.11					
1909.80	-25.28	-54.13	0.00	1.98	30.83	1.21					

GSM1900 (EDGE 8) Radiated Power EIRP											
	Horizontal Polarization										
Frequency Rt Rs Ps Gs EIRP EIRP (MHz) (dBm) (dBm) (dBm) (dBm) (W)											
1850.20	-33.71	-51.88	0.00	1.96	20.13	0.10					
1880.00	-32.99	-52.99	0.00	2.00	22.00	0.16					
1909.80	-36.79	-54.28	0.00	1.98	19.47	0.09					
		Ve	ertical Polarization	on							
Frequency (MHz)	Rt (dBm)	Rs (dBm)	Ps (dBm)	Gs (dBi)	EIRP (dBm)	EIRP (W)					
1850.20	-27.74	-52.13	0.00	1.96	26.35	0.43					
1880.00	-29.26	-53.17	0.00	2.00	25.91	0.39					
1909.80	-29.74	-54.13	0.00	1.98	26.37	0.43					

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 13 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

3.2 Description of Field Strength of Spurious Radiated Measurement

The radiated spurious emission was measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitter power (P) by a factor of at least 43 + 10 log (P) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

3.2.1 Measuring Instruments

See list of measuring instruments of this test report.

3.2.2 Test Procedures


- 10. The EUT was placed on a rotatable wooden table with 0.8 meter about ground.
- 11. The EUT was set 3 meters from the receiving antenna, which was mounted on the antenna tower.
- 12. The table was rotated 360 degrees to determine the position of the highest spurious emission.
- 13. The height of the receiving antenna is varied between one meter and four meters to search the maximum spurious emission for both horizontal and vertical polarizations.
- 14. Make the measurement with the spectrum analyzer's RBW = 1MHz, VBW = 3MHz, Sweep = 500ms, Taking the record of maximum spurious emission.
- 15. A horn antenna was substituted in place of the EUT and was driven by a signal generator.
- 16. Tune the output power of signal generator to the same emission level with EUT maximum spurious emission.
- 17. Taking the record of output power at antenna port.
- 18. Repeat step 7 to step 8 for another polarization.
- 19. EIRP (dBm) = S.G. Power Tx Cable Loss + Tx Antenna Gain
- 20. ERP (dBm) = EIRP 2.15

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 14 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



Report No.: FG021239-09


3.2.3 Test Setup

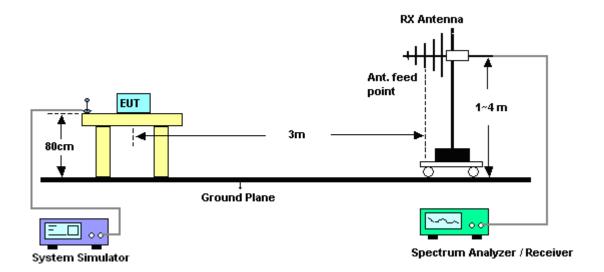

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 15 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



3.2.4 Test Result of Field Strength of Spurious Radiated

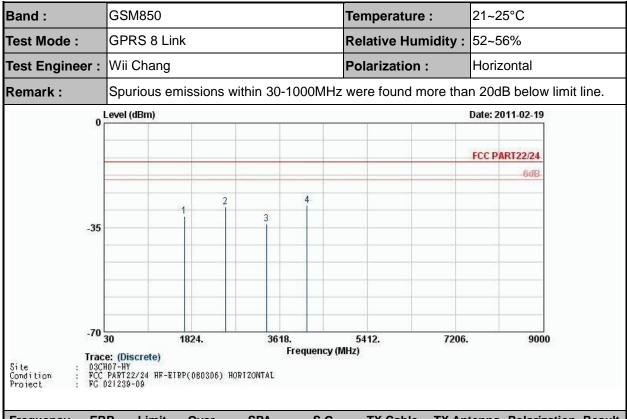


Frequency	ERP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
1669	-31.15	-13	-18.15	-38.84	-32.87	1.62	5.49	Н	Pass
2509	-28.20	-13	-15.20	-40.34	-30.17	2.10	6.22	Н	Pass
3346	-33.90	-13	-20.90	-46.85	-36.79	3.03	8.07	Н	Pass
4182	-27.66	-13	-14.66	-42.76	-32.20	2.52	9.21	Н	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 16 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

FCC RF Test Report

Band :	GSM850	Temperature :	21~25°C				
Test Mode :	GPRS 8 Link	Relative Humidity :	52~56%				
Test Engineer :	Wii Chang	Polarization :	Vertical				
Domark :	purious amissions within 30-1000MHz were found more than 20dB below limit line						

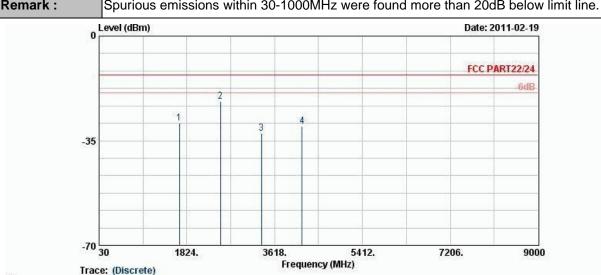

Frequency	ERP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
1669	-29.22	-13	-16.22	-39.14	-30.94	1.62	5.49	V	Pass
2509	-21.95	-13	-8.95	-34.54	-23.92	2.10	6.22	V	Pass
3346	-32.5	-13	-19.50	-46.94	-35.39	3.03	8.07	V	Pass
4182	-30.16	-13	-17.16	-46.09	-34.70	2.52	9.21	V	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 17 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

Report No. : FG021239-09	Re	port	No.	:	FG	021	123	9-09
--------------------------	----	------	-----	---	----	-----	-----	------

Test Mode : E				Tomporate.	Temperature :							
rest wode.	DGE 8 Link			Relative Hu	umidity:	52~56%						
Test Engineer : W	/ii Chang			Polarizatio	n :	Horizontal						
Remark: S	purious emis	sions with	in 30-1000N	Hz were found	more tha	n 20dB below	limit line.					
Date: 2011-02-19												
						FCC PART22/24						
						-6dB						
	1	2	3									
-35												
-70 30 Trace: Site : 03CH07- Condition : FCC PA	182 (Discrete) -HY RT22/24 HF-ETRP(0		3618. Frequen	5412. cy (MHz)	7206.	9000						


Frequency	ERP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
1669	-33.28	-13	-20.28	-40.96	-35.00	1.62	5.49	Н	Pass
2509	-31.90	-13	-18.90	-44.03	-33.87	2.10	6.22	Н	Pass
4182	-31.43	-13	-18.43	-46.53	-35.97	2.52	9.21	Н	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 18 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

Band :	GSM850	Temperature :	21~25°C
Test Mode :	EDGE 8 Link	Relative Humidity :	52~56%

Polarization:

Spurious emissions within 30-1000MHz were found more than 20dB below limit line. Remark:

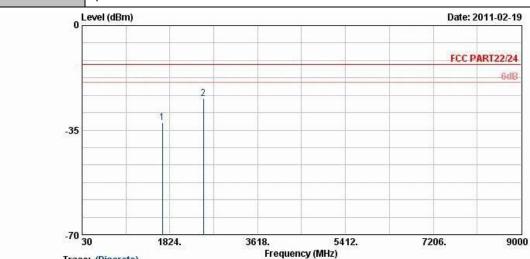

Test Engineer : Wii Chang

Trace: (Discrete)
03CH07-HY
FCC PART22/24 HF-ETRP(080306) VERTICAL
FG 021239-09

Frequency	ERP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
1669	-32.64	-13	-19.64	-42.56	-34.36	1.62	5.49	V	Pass
2509	-24.51	-13	-11.51	-37.09	-26.48	2.10	6.22	V	Pass

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 19 of 25 Report Issued Date: Feb. 22, 2011 Report Version : Rev. 01

Report No.: FG021239-09

Vertical

Report No.	:	FG0212	239-09
------------	---	--------	--------


Band :		GSM190	0			Temperature	:	21~25°C 52~56%		
Test Mode :		GPRS 8	Link			Relative Hun	nidity :			
Test Engine	er:	Wii Chan	ıg			Polarization	:	Horizontal		
Remark :		Spurious	emissions	within 30-10	000MHz	were found m	ore tha	n 20dB below lin	nit line.	
	0 !	Level (dBm)						Date: 2011-02-19		
	-							FCC PART22/24		
			1	2			3	-6d8		
	-35									
	-70	30 e: (Discrete)	3824.	7618. Fr	equency (M	11412. Hz)	15206	. 19000		
Site : Condition : Project	03CF FCC	107-HY	7-ETRP(080306)	HORTZONTAL						
Frequency	EIR	RP Limi	t Over	SPA Reading	S.G. Power	TX Cable loss	TX An	tenna Polarizatio	on Res	

Frequency	EIRP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
3760	-21.51	-13	-8.51	-37.87	-27.81	2.51	8.81	Н	Pass
5636	-21.32	-13	-8.32	-43.09	-29.03	2.99	10.70	Н	Pass
15040	-17.45	-13	-4.45	-51.95	-26.42	4.75	13.72	Н	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 20 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

FCC RF Test Report

Band :	GSM1900	Temperature :	21~25°C				
Test Mode :	GPRS 8 Link	Relative Humidity :	52~56%				
Test Engineer :	Wii Chang	Polarization :	Vertical				
Domark .	purious emissions within 20 1000MHz were found more than 20dR helew limit line						

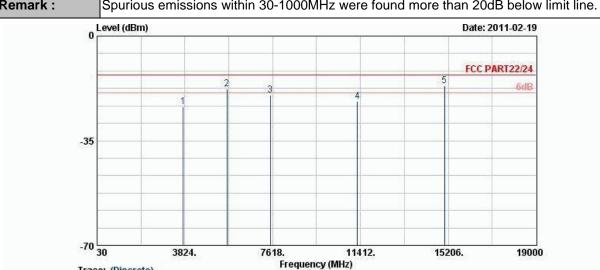

Frequency	EIRP	Limit	Over	SPA	S.G.	TX Cable	TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
3760	-23.68	-13	-10.68	-40.98	-29.98	2.51	8.81	V	Pass
5636	-17.81	-13	-4.81	-39.38	-25.52	2.99	10.70	V	Pass
7520	-19.72	-13	-6.72	-47.77	-28.25	3.59	12.12	V	Pass
11280	-21.87	-13	-8.87	-51.54	-30.91	4.27	13.31	V	Pass
15040	-16.59	-13	-3.59	-50.06	-25.56	4.75	13.72	V	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 21 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

Report No. : FG021239-09	Re	port	No.	:	FG	02	123	9-	09
--------------------------	----	------	-----	---	----	----	-----	----	----

19000

15206.

Band :	GSM1900	Temperature :	Temperature :		21~25°C			
Test Mode :	EDGE 8 Link	Relative Hum	idity :	52~56%				
Test Engineer :	Wii Chang	Polarization :		Horizontal				
Remark :	Spurious emissions within 30	purious emissions within 30-1000MHz were found more than 20dB below limi						
0	Level (dBm)		- 31	Date: 2011-02-19	ý Ó			
	2			FCC PART22/24				
			3	-6dB				
	1							
-35								

Trace: (Discrete)
Site : 03CH07-HY
Condition : FCC PART22/24 HF-EIRP(080306) HORIZONTAL
Project : FG 021239-09

3824.

Frequency	EIRP	Limit	Over Limit	SPA Reading	S.G. Power	TX Cable loss	TX Antenna Gain	Polarization	Result
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
3760	-25.73	-13	-12.73	-42.08	-32.03	2.51	8.81	Н	Pass
5636	-13.58	-13	-0.58	-35.35	-21.29	2.99	10.70	Н	Pass
15040	-17.36	-13	-4.36	-51.86	-26.33	4.75	13.72	Н	Pass


Frequency (MHz)

11412.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 22 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

FCC RF Test Report

Band :	GSM1900	Temperature :	21~25°C			
Test Mode :	EDGE 8 Link	Relative Humidity :	52~56%			
Test Engineer :	Wii Chang	Polarization :	Vertical			
Damark .	Couriers agriculate within 20 4000MHz was found many than 20 dD balanching the					

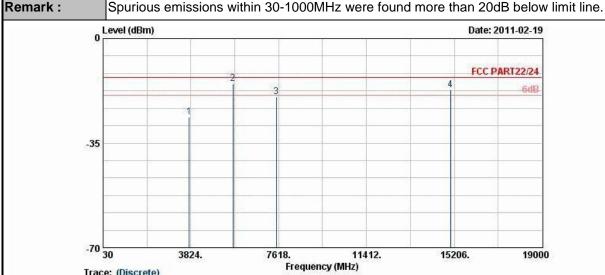

Frequency	EIRP	Limit	Over	SPA	S.G.	TX Cable	TV Antonno	Polarization	Docult
Frequency	LIKE	Lillit	Limit	Reading	Power	loss	Gain	Folarization	Result
(MHz)	(dBm)	(dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/V)	
3760	-26.19	-13	-13.19	-43.49	-32.49	2.51	8.81	V	Pass
5636	-15.12	-13	-2.12	-36.69	-22.83	2.99	10.70	V	Pass
7520	-19.45	-13	-6.45	-47.50	-27.98	3.59	12.12	V	Pass
15040	-17.22	-13	-4.22	-50.69	-26.19	4.75	13.72	V	Pass

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 23 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Due Date	Remark
Bilog Antenna	SCHAFFNER	CBL6111C	2726	30MHz ~ 1GHz	Oct. 31, 2010	Oct. 30, 2011	Radiation (03CH07-HY)
Spectrum Analyzer	R&S	FSP	101067	9KHz ~ 30GHz	Dec. 03, 2010	Dec. 02, 2011	Radiation (03CH07-HY)
Double Ridge Horn Antenna	ESCO	3117	00075962	1GHz ~ 18GHz	Aug. 19, 2010	Aug. 18, 2011	Radiation (03CH07-HY)
SHF-EHF Horn Antenna	SCHWARZBECK	BBHA 9170	BBHA917025 1	15GHz- 40GHz	Oct. 18, 2010	Oct. 17, 2011	Radiation (03CH07-HY)
Pre Amplifier	Agilent	8449B	3008A02362	1GHz~ 26.5GHz	Dec. 06, 2010	Dec. 05, 2011	Radiation (03CH07-HY)
Pre Amplifier	COM-POWER	PA-103A	161241	10-1000MHz.32dB. GAIN	Mar. 27, 2010	Mar. 26, 2011	Radiation (03CH07-HY)
Loop Antenna	R&S	HFH2-Z2	860004/001	9 kHz~30 MHz	Jul. 29, 2010	Jul. 28, 2011	Radiation (03CH07-HY)
System Simulator	R&S	CMU200	117995	N/A	Mar. 19, 2009	Mar. 18, 2011	Radiation (03CH07-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 24 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01



5 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

	Uncerta	inty of X _i		
Contribution	dB	Probability Distribution	u(X _i)	
Receiver Reading	0.41	Normal (k=2)	0.21	
Antenna Factor Calibration	0.83	Normal (k=2)	0.42	
Cable Loss Calibration	0.25	Normal (k=2)	0.13	
Pre-Amplifier Gain Calibration	0.27	Normal (k=2)	0.14	
RCV/SPA Specification	2.50	Rectangular	0.72	
Antenna Factor Interpolation for Frequency	1.00	Rectangular	0.29	
Site Imperfection	1.43	Rectangular	0.83	
Mismatch	+0.39 / -0.41	U-Shape	0.28	
Combined Standard Uncertainty Uc(y)	1.27			
Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y))	2.54			

Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)

	Uncertai	nty of X _i					
Contribution	dB	Probability Distribution	u(X _i)	C _i	C _i * u(X _i)		
Receiver Reading	±0.10	Normal (k=2)	0.10	1	0.10		
Antenna Factor Calibration	±1.70	Normal (k=2)	0.85	1	0.85		
Cable Loss Calibration	±0.50	Normal (k=2)	0.25	1	0.25		
Receiver Correction	±2.00	Rectangular	1.15	1	1.15		
Antenna Factor Directional	±1.50	Rectangular	0.87	1	0.87		
Site Imperfection	±2.80	Triangular	1.14	1	1.14		
Mismatch Receiver VSWR Γ 1 = 0.197 Antenna VSWR Γ 2 = 0.194 Uncertainty = 20Log(1- Γ 1* Γ 2)	+0.34 / -0.35	U-Shape	0.244	1	0.244		
Combined Standard Uncertainty Uc(y)	2.36						
Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y))		4.72					

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : 25 of 25
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01

Appendix A. Photographs of EUT

Please refer to Sporton report number EP021239-09 as below.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: VV7-MBMF33072-A Page Number : A1 of A1
Report Issued Date : Feb. 22, 2011
Report Version : Rev. 01