
# 8. Tune up Process



- Please refer to the next page


### Maximum RF Output Power:

### A. GSM850

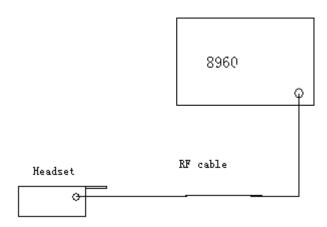

- 1, Power up the headset and connect it with 8960
- 2, Set RF cable loss in 8960.
- 3, Set up 8960 cell band for GSM850; 128 is pilot channel; radio configuration for (166channel, PCL 5).
- 4, Originate the call after the phone registration.
- 5, Select test item: digital average power
- 6, Rvs power ctrl set up ALL up bits
- 7, Set up Cell power -100dBm


## Receiver Sensitivity

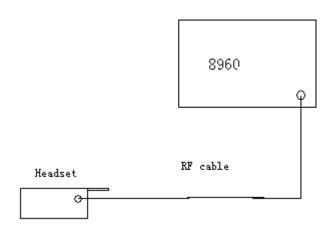

- 1, Power up the headset and connect it with 8960
- 2,Set RF cable loss in 8960.


- 3,Set Set up 8960 cell band for GSM850; 128 is pilot channel; radio configuration for (166channel, PCL 5).
- 4, Set up Cell power -102dBm
- 5,Originate the call after the phone registration.
- 6, Select test item: Frame Error Rate

#### B. PCS1900

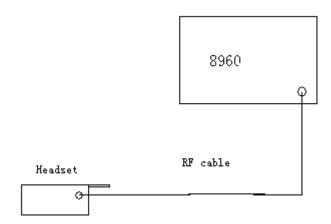

- 1, Power up the headset and connect it with 8960
- 2, Set RF cable loss in 8960.
- 3, Set up 8960 cell band for PCS1900; 512 is pilot channel; radio configuration for (600 channel, PCL 05).
- 4, Originate the call after the phone registration <sub>o</sub>
- 5, Select test item: digital average power
- 6, Rvs power ctrl set up ALL up bits
- 7, Set up Cell power -100dBm

Receiver Sensitivity

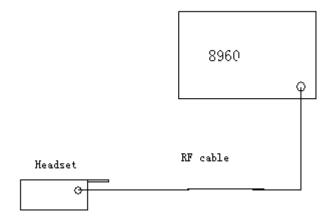

- 1, Power up the headset and connect it with 8960
- 2,Set RF cable loss in 8960.
- 3,Set Set up 8960 cell band for PCS1900; 512 is pilot channel ; radio configuration for  $\,$  (600 channel, PCL 0).
- 4, Set up Cell power -102dBm
- 5, Originate the call after the phone registration  $_{\circ}$
- 6, Select test item : Frame Error Rate